## Browns Ferry 3 4Q/2003 Plant Inspection Findings

# **Initiating Events**

Significance: Oct 03, 2003 Identified By: NRC Item Type: NCV NonCited Violation Changes Made to the Fire Protection

Changes Made to the Fire Protection Program Regarding Compensatory Fire Watch Implementation Without NRC Approval

A Severity Level IV non-cited violation (NCV) of 10 CFR 50.48(a) and the Unit 2 and 3 Operating License Conditions was identified for a change to the approved fire protection program (FPP) which removed the requirement to implement fire watches for impaired fire protection systems and features. On October 23, 2002, the licensee inappropriately used the fire protection license change process to revise the FPP to permit the removal of fire suppression systems and/or fire rated barrier assemblies, necessary to satisfy the separation and suppression requirements of 10 CFR 50, Appendix R, Section III.G, from service without compensatory measures being implemented (i.e., fire watches being posted) in the affected plant area. The change could adversely affect the ability to achieve and maintain safe shutdown (SSD) in the event of a severe fire in the affected area.

This issue was not assessed in accordance with the SDP but instead was assessed in accordance with guidance in Sections IV.A.1 through IV.A.4 and Section IV.B of the NRC's Enforcement Policy. The issue was significant because the licensee's change process for the FPP allowed this degraded condition to be accepted without prior NRC approval. The inspectors concluded that this issue had a credible impact on safety because the licensee's failure to properly evaluate the removal of fire watch posting requirements could adversely affect or degrade the ability for achieving and maintaining SSD from the main control room, local shutdown stations, or alternate shutdown stations. However, the inspectors determined that this finding was of very low significance because, based on an assessment of the impacts of the identified fire protection features removed from service, the licensee's overall SSD capabilities in the affected fire areas and related FPP features (fire brigade) remained adequate to achieve and maintain SSD conditions. Therefore, this finding is characterized as Green.

Inspection Report# : 2003007(pdf)

# **Mitigating Systems**

Significance: Dec 27, 2003 Identified By: NRC Item Type: NCV NonCited Violation Inadequate Maintenance Procedure for Control Rod Drive Pump 3A

Maintenance on Control Rod Drive pump 3A was conducted using an inadequate maintenance procedure. Work practices were inconsistent with the vendor manual. Pump seal clearances were improperly set and during the post maintenance test the pump seal rubbed sufficiently to cause sparking and damage of the new seal.

The inspectors identified a non-cited violation (NCV) (Self-Revealing) of 10 CFR Part 50, Appendix B, Section V,

Instructions, Procedures, and Drawings. The finding is greater than minor in that it affects the mitigating systems cornerstone objective and degrades the attribute of equipment availability and reliability. The finding is of very low safety significance based on the operation of the standby pump and all other mitigation systems were available during the activity.

Inspection Report# : 2003005(pdf)



Significance: Apr 05, 2003 Identified By: Self Disclosing

Item Type: NCV NonCited Violation

Inadequate work control process procedure and poor troubleshooting techniques resulted in the loss of the Unit 3 HPCI.

Green. An inadequate work control authorization process procedure and poor trouble shooting techniques resulted in the failure of Unit 3 High Pressure Coolant Injection System (HPCI). The procedure did not provide specific procedural direction for assessing all possible impacts of the proposed work activity on the associated plant system.

A self-revealing non-cited violation of Technical Specification 5.4.1a was identified. This finding is greater than minor because the loss of the HPCI system had an actual impact on safety in that an important mitigating system was not available to respond to postulated events. The finding is of very low safety significance because all other mitigating systems were available to provide core cooling injection.

Inspection Report# : 2003002(pdf)

## **Barrier Integrity**

### **Emergency Preparedness**

## **Occupational Radiation Safety**

**Public Radiation Safety** 

### **Physical Protection**

#### Miscellaneous

file://C:\RROP\NRR\OVERSIGHT\ASSESS\BF3\bf3\_pim.html

#### Significance: N/A Nov 21, 2003 Identified By: NRC Item Type: FIN Finding Browns Ferry PI&R Inspection Results

Overall, the licensee maintained an effective program for the identification and correction of conditions adverse to quality. The licensee was effective at identifying problems at a low threshold to enter into the Corrective Action Program (CAP). In general, the licensee consistently prioritized issues in accordance with their CAP and routinely performed adequate evaluations that were technically accurate and of sufficient depth. However, minor problems were identified related to thoroughness of CAP issue documentation and categorization of level D PERs for issues where higher categorization may have been more consistent with the licensee's CAP requirements. The licensee's CAP tracking program output reports were considered paper intensive and a contributor to inefficiencies identified in the area of issue documentation and ability to perform efficient CAP trending.

Formal root cause evaluations for significant conditions adverse to quality were thorough and detailed. Corrective actions developed for lower level root and contributing causes were generally timely, effective, and commensurate with the safety-significance of the issue. Although the licensee incorporated a wide variety of root cause techniques, non-uniform root cause report outputs resulted in a cumbersome process for personnel to ensure all contributing causes were being adequately considered for broader corrective actions or extent of condition reviews. The licensee's periodic self-assessments and audits were effective in identifying deficiencies in the CAP and covered all areas of plant performance. Corrective actions for previous performance examples were being actively monitored within self-assessments and audits of the CAP. Several identified repetitive deficiencies with the CAP that resulted in the issuance of higher level CAP problem reports to address. Overall, the ability to perform self critical assessments was considered an effective program attribute, especially when addressing repetitive human factor performance issues where desired improvements were continuous in nature.

Site management was purposely active and involved in the CAP and focused appropriate attention on significant plant issues. At the Management Review Committee (MRC) meetings, management made frequent modification of Problem Evaluation Report (PER) priorities, PER descriptions, PER root cause determination techniques, and other items to ensure CAP expectations were being implemented.

Based on review of the licensee's Concern Resolution Program and discussions conducted with plant employees from various departments, the inspectors did not identify any reluctance to report safety concerns.

Initial reviews of the CAP for Unit 1 concluded that the licensee had established adequate processes and measures for including Unit 1 into the CAP at Browns Ferry. Problem identification thresholds were sufficiently low and management was actively involved in implementation of the program in order to instill consistent expectations and improve program efficiencies. Trending of Unit 1 PERs was well established and recent data did not indicate any areas of concern with the current Unit 1 recovery activities. Inspection Report# : 2003008(pdf)

#### Significance: SL-II Jun 23, 2001 Identified By: NRC Item Type: VIO Violation EMPLOYEE PROTECTED ACTIVITY

On February 7, 2000, a Severity Level II violation with civil penalty was issued to the licensee. The violation was not site-specific and involved employment discrimination contrary to the requirements of 10 CFR 50.7, "Employee Protection," in that the licensee did not select a former employee to a competitive position in the corporate chemistry organization in 1996, due, at least in part, to his engagement in protected activities. On January 22, 2001, the licensee denied the violation and on May 4, an Order was issued sustaining the violation and imposing the civil penalty. On June 1, TVA requested an enforcement hearing on the Order. Inspection Report# : 2001002(pdf)

Last modified : March 02, 2004