

## Adoption of the Amendment

■ Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

■ 2. Section 39.13 is amended by adding the following new airworthiness directive:

#### 2004-08-06 BAE Systems (Operations)

**Limited** (Formerly British Aerospace Regional Aircraft): Amendment 39-13575. Docket 2001-NM-272-AD.

**Applicability:** All Model BAe 146-100A and -200A series airplanes; certificated in any category.

**Compliance:** Required as indicated, unless accomplished previously.

To prevent the failure of the main landing gear (MLG), which could result in damage to the airplane structure or injury to airplane occupants, accomplish the following:

#### Inspection to Determine Part Number

(a) Within 50 landings or 31 days after the effective date of this AD, whichever occurs first: Inspect the inner link of the side stays of the MLG to determine the part number, per the Accomplishment Instructions of BAE Systems (Operations) Limited Inspection Service Bulletin ISB.32-166, dated May 28, 2001. Although this service bulletin specifies to submit certain information to the manufacturer, this AD does not include such a requirement.

**Note 1:** BAE Systems (Operations) Limited Inspection Service Bulletin, ISB.32-166, dated May 28, 2001, references Messier-Dowty Service Bulletin 146-32-153, dated May 29, 2001, as an additional source of service information for accomplishment of the inspection and replacement required by this AD. Although the Messier-Dowty service bulletin specifies to submit certain information to the manufacturer, this AD does not include such a requirement.

#### Replacement at New Reduced Safe Life

(b) For any side stay which, during the inspection required by paragraph (a) of this AD, is found to have an inner link with part number 200884319, 200884320, 200884331, 200884332, 200884342, or 200884343: Replace the inner link with a new inner link having the same part number, at the applicable compliance time specified in paragraph 1.D. "Compliance" of BAE Systems (Operations) Limited Inspection Service Bulletin ISB.32-166, dated May 28, 2001, as measured from the effective date of this AD.

#### Safe Remaining Life

(c) If any side stay having an inner link with part number 200884319, 200884320,

200884331, 200884332, 200884342, or 200884343 has been used at different operating weights, and the service bulletin recommends contacting Messier-Dowty for appropriate action based on the safe remaining life of the side stay: Contact the Manager, International Branch, ANM-116, FAA, Transport Airplane Directorate; or the Civil Aviation Authority (CAA), which is the airworthiness authority for the United Kingdom, (or its delegated agent); for appropriate action.

#### Alternative Methods of Compliance

(d) In accordance with 14 CFR 39.19, the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, is authorized to approve alternative methods of compliance for this AD.

#### Incorporation by Reference

(e) Unless otherwise specified in this AD, the actions shall be done in accordance with BAE Systems (Operations) Limited Inspection Service Bulletin ISB.32-166, dated May 28, 2001. This incorporation by reference was approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained from British Aerospace Regional Aircraft American Support, 13850 Mclearn Road, Herndon, Virginia 20171. Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

**Note 2:** The subject of this AD is addressed in British airworthiness directive 005-05-2001.

#### Effective Date

(f) This amendment becomes effective on May 24, 2004.

Issued in Renton, Washington, on April 6, 2004.

**Kevin M. Mullin,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 04-8541 Filed 4-16-04; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. 2002-NM-292-AD; Amendment 39-13573; AD 2004-08-04]

RIN 2120-AA64

#### Airworthiness Directives; McDonnell Douglas Model MD-11 and MD-11F Airplanes

**AGENCY:** Federal Aviation Administration, DOT.

**ACTION:** Final rule.

**SUMMARY:** This amendment adopts a new airworthiness directive (AD),

applicable to certain McDonnell Douglas Model MD-11 and MD-11F airplanes, that requires repetitive inspections of the transfer pipe assembly installation for the tail tank for damage and cracks, and corrective action, if necessary. This action is necessary to detect and correct damage and cracks to the transfer pipe assembly installation for the tail tank, which could result in fuel leakage and possible ignition. This action is intended to address the identified unsafe condition.

**DATES:** Effective May 24, 2004.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of May 24, 2004.

**ADDRESSES:** The service information referenced in this AD may be obtained from Boeing Commercial Airplanes, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Data and Service Management, Dept. C1-L5A (D800-0024). This information may be examined at the Federal Aviation Administration (FAA), Transport Airplane Directorate, Rules Docket, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

**FOR FURTHER INFORMATION CONTACT:** Samuel Lee, Aerospace Engineer, Propulsion Branch, ANM-140L, FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California 90712-4137; telephone (562) 627-5262; fax (562) 627-5210.

**SUPPLEMENTARY INFORMATION:** A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) to include an airworthiness directive (AD) that is applicable to certain McDonnell Douglas Model MD-11 and MD-11F airplanes was published in the **Federal Register** on November 28, 2003 (68 FR 66768). That action proposed to require repetitive inspections of the transfer pipe assembly installation for the tail tank for damage and cracks, and corrective action, if necessary.

#### Comments

Interested persons have been afforded an opportunity to participate in the making of this amendment. Due consideration has been given to the single comment received.

The commenter supports the proposed rule.

## Conclusion

The FAA has determined that air safety and the public interest require the adoption of the rule as proposed.

## Interim Action

This AD is considered to be interim action. The manufacturer has advised that it currently is developing Service Bulletin MD11-28-111 that will address the unsafe condition addressed by this AD. Once this new service bulletin is developed, approved, and available, the FAA may consider additional rulemaking.

## Cost Impact

There are approximately 187 airplanes of the affected design in the worldwide fleet. The FAA estimates that 60 airplanes of U.S. registry will be affected by this AD, that it will take approximately 2 work hours per airplane to accomplish the required inspection, and that the average labor rate is \$65 per work hour. Based on these figures, the cost impact of the AD on U.S. operators is estimated to be \$7,800, or \$130 per airplane, per inspection cycle.

The cost impact figure discussed above is based on assumptions that no operator has yet accomplished any of the requirements of this AD action, and that no operator would accomplish those actions in the future if this AD were not adopted. The cost impact figures discussed in AD rulemaking actions represent only the time necessary to perform the specific actions actually required by the AD. These figures typically do not include incidental costs, such as the time required to gain access and close up, planning time, or time necessitated by other administrative actions. Manufacturer warranty remedies may be available for labor costs associated with this AD. As a result, the costs attributable to the AD may be less than stated above.

## Regulatory Impact

The regulations adopted herein will not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this final rule does not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this action (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034,

February 26, 1979); and (3) will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A final evaluation has been prepared for this action and it is contained in the Rules Docket. A copy of it may be obtained from the Rules Docket at the location provided under the caption **ADDRESSES**.

## List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

## Adoption of the Amendment

■ Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

## PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

### § 39.13 [Amended]

■ 2. Section 39.13 is amended by adding the following new airworthiness directive:

#### 2004-08-04 McDonnell Douglas:

Amendment 39-13573. Docket 2002-NM-292-AD.

**Applicability:** Model MD-11 and MD-11F airplanes, as listed in McDonnell Douglas Alert Service Bulletin MD11-28A110, dated May 2, 2000; certificated in any category.

**Compliance:** Required as indicated, unless accomplished previously.

To detect and correct damage and cracks to the transfer pipe assembly installation for the tail tank, which could result in fuel leakage and possible ignition, accomplish the following:

#### Service Bulletin References

(a) The term "service bulletin," as used in this AD, means the Accomplishment Instructions of McDonnell Douglas Alert Service Bulletin MD11-28A110, dated May 2, 2000. Although the service bulletin referenced in this AD specifies to submit certain information to the manufacturer, this AD does not include such a requirement.

#### Initial Inspection

(b) Within 700 flight hours from the effective date of this AD, perform a general visual inspection to detect any damage and cracking on the transfer pipe assembly installation for the tail tank, in accordance with the service bulletin.

**Note 1:** For the purposes of this AD, a general visual inspection is defined as: "A visual examination of an interior or exterior area, installation, or assembly to detect obvious damage, failure, or irregularity. This

level of inspection is made from within touching distance unless otherwise specified. A mirror may be necessary to enhance visual access to all exposed surfaces in the inspection area. This level of inspection is made under normally available lighting conditions such as daylight, hangar lighting, flashlight, or droplight and may require removal or opening of access panels or doors. Stands, ladders, or platforms may be required to gain proximity to the area being checked."

#### Condition 1 (No Damage/Cracking)

(c) If no damage or cracking to the transfer pipe assembly installation for the tail tank is found during the inspection required by paragraph (b) of this AD, repeat that inspection thereafter at intervals not to exceed 700 flight hours.

#### Condition 2 (Damage/Cracking found)

(d) If any damage or cracking to the transfer pipe assembly installation for the tail tank is found during the inspection required by paragraph (b) of this AD, before further flight, repair and/or replace any damaged or cracked part with a serviceable part, per the service bulletin. Repeat that inspection thereafter at intervals not to exceed 700 flight hours.

#### Alternative Methods of Compliance

(e) In accordance with 14 CFR 39.19, the Manager, Los Angeles Aircraft Certification Office (ACO), FAA, is authorized to approve alternative methods of compliance (AMOCs) for this AD.

#### Incorporation by Reference

(f) The actions shall be done in accordance with McDonnell Douglas Alert Service Bulletin MD11-28A110, dated May 2, 2000. This incorporation by reference was approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained from Boeing Commercial Airplanes, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Data and Service Management, Dept. C1-L5A (D800-0024). Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

#### Effective Date

(g) This amendment becomes effective on May 24, 2004.

Issued in Renton, Washington, on April 6, 2004.

**Kevin M. Mullin,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*  
[FR Doc. 04-8539 Filed 4-16-04; 8:45 am]

**BILLING CODE 4910-13-P**