

(2) To request a different method of compliance or a different compliance time for this AD, follow the procedures in 14 CFR 39.19. Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

#### Material Incorporated by Reference

(m) You must use Boeing 737 Flight Crew Operations Manual Bulletin No. TBC-67, dated March 5, 2007, to perform the actions that are required by this AD, unless the AD specifies otherwise. The Director of the **Federal Register** approved the incorporation by reference of this document in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Contact Boeing Commercial Airplanes, P.O. Box 3707, Seattle, Washington 98124-2207, for a copy of this service information. You may review copies at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on April 18, 2007.

**Ali Bahrami,**

*Manager, Transport Airplane Directorate,  
Aircraft Certification Service.*

[FR Doc. E7-7850 Filed 4-27-07; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2007-27342 Directorate Identifier 2007-CE-014-AD; Amendment 39-15037; AD 2007-09-05]

**RIN 2120-AA64**

#### **Airworthiness Directives; APEX Aircraft Model CAP 10 B Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for the products listed above. This AD results from mandatory continuing airworthiness information (MCAI) issued by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as:

A CAP10B aircraft experienced a reduced elevator deflection by about 13° due to an incorrect routing of the Push To Talk (PTT) wire bundle and improperly secured

connectors which impeded the complete and free movement of the control stick.

We are issuing this AD to require actions to correct the unsafe condition on these products.

**DATES:** This AD becomes effective June 4, 2007.

On June 4, 2007 the Director of the Federal Register approved the incorporation by reference of certain publications listed in this AD.

**ADDRESSES:** You may examine the AD docket on the Internet at <http://dms.dot.gov> or in person at the Docket Management Facility, U.S. Department of Transportation, 400 Seventh Street, SW., Nassif Building, Room PL-401, Washington, DC.

**FOR FURTHER INFORMATION CONTACT:** Sarjapur Nagarajan, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4145; fax: (816) 329-4090.

#### **SUPPLEMENTARY INFORMATION:**

##### **Streamlined Issuance of AD**

The FAA is implementing a new process for streamlining the issuance of ADs related to MCAI. The streamlined process will allow us to adopt MCAI safety requirements in a more efficient manner and will reduce safety risks to the public. This process continues to follow all FAA AD issuance processes to meet legal, economic, Administrative Procedure Act, and **Federal Register** requirements. We also continue to meet our technical decisionmaking responsibilities to identify and correct unsafe conditions on U.S.-certificated products.

This AD references the MCAI and related service information that we considered in forming the engineering basis to correct the unsafe condition. The AD contains text copied from the MCAI and for this reason might not follow our plain language principles.

#### **Discussion**

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 to include an AD that would apply to the specified products. That NPRM was published in the **Federal Register** on March 9, 2007 (72 FR 10624). That NPRM proposed to correct an unsafe condition for the specified products. The MCAI states:

A CAP10B aircraft experienced a reduced elevator deflection by about 13° due to an incorrect routing of the Push To Talk (PTT) wire bundle and improperly secured connectors which impeded the complete and free movement of the control stick.

Actions specified in this AD are intended to inspect, detect and correct any

discrepancy on the PTT electrical circuit connectors and wires that could lead to a reduction of the control stick movements.

#### **Comments**

We gave the public the opportunity to participate in developing this AD. We received no comments on the NPRM or on the determination of the cost to the public.

#### **Conclusion**

We reviewed the available data and determined that air safety and the public interest require adopting the AD as proposed.

#### **Differences Between This AD and the MCAI or Service Information**

We have reviewed the MCAI and related service information and, in general, agree with their substance. But we might have found it necessary to use different words from those in the MCAI to ensure the AD is clear for U.S. operators and is enforceable. In making these changes, we do not intend to differ substantively from the information provided in the MCAI and related service information.

We might also have required different actions in this AD from those in the MCAI in order to follow FAA policies. Any such differences are highlighted in a note within the AD.

#### **Costs of Compliance**

We estimate that this AD will affect 31 products of U.S. registry. We also estimate that it will take about 1 work-hour per product to comply with basic requirements of this AD. The average labor rate is \$80 per work-hour. Based on these figures, we estimate the cost of this AD to the U.S. operators to be \$2,480 or \$80 per product.

In addition, we estimate that any necessary follow-on actions would take about 3 work-hours and require parts costing \$90, for a cost of \$330 per product. We have no way of determining the number of products that may need these actions.

#### **Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in

air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

### Regulatory Findings

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866;
- (2) Is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this AD and placed it in the AD Docket.

### Examining the AD Docket

You may examine the AD docket on the Internet at <http://dms.dot.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains the NPRM, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone (800) 647-5227) is in the ADDRESSES section. Comments will be available in the AD docket shortly after receipt.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

### § 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new AD:

**2007-09-05 APEX Aircraft (Type Certificate No. A36EU formerly held by AVIONS MUDRY et CIE):** Amendment 39-15037; Docket No. FAA-2007-27342; Directorate Identifier 2007-CE-014-AD.

#### Effective Date

(a) This airworthiness directive (AD) becomes effective June 4, 2007.

#### Affected ADs

(b) None.

#### Applicability

(c) This AD applies to Model CAP 10 B airplanes, serial numbers 001 through 282, fitted with major change 000302 (wood-carbon wings), that are certificated in any category.

#### Subject

(d) Air Transport Association of America (ATA) Code 27: Flight Controls.

#### Reason

(e) The mandatory continuing airworthiness information (MCAI) states:

A CAP10B aircraft experienced a reduced elevator deflection by about 13° due to an incorrect routing of the Push To Talk (PTT) wire bundle and improperly secured connectors which impeded the complete and free movement of the control stick.

Actions specified in this AD are intended to inspect, detect and correct any discrepancy on the PTT electrical circuit connectors and wires that could lead to a reduction of the control stick movements.

#### Actions and Compliance

(f) Unless already done, do the following actions:

(1) Within the next 50 hours time-in-service after June 4, 2007 (the effective date of this AD), inspect the wire routing for the proper location and attachment of the connectors as detailed in the accomplishment instructions of APEX Aircraft Mandatory Service Bulletin No. 050605, dated October 17, 2006.

(2) Before further flight, if a defect or discrepancy is found during the inspection in paragraph (f)(1) of this AD, modify the wire bundle and connectors routing as detailed in the accomplishment instructions of APEX Aircraft Mandatory Service Bulletin No. 050605, dated October 17, 2006.

#### FAA AD Differences

**Note:** This AD differs from the MCAI and/or service information as follows: No differences.

#### Other FAA AD Provisions

(g) The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, Standards Staff, FAA, ATTN: Sarjapur Nagarajan, Aerospace Engineer, FAA, Small Airplane Directorate,

901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4145; fax: (816) 329-4090, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

(2) *Airworthy Product:* For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

(3) *Reporting Requirements:* For any reporting requirement in this AD, under the provisions of the Paperwork Reduction Act (44 U.S.C. 3501 et seq.), the Office of Management and Budget (OMB) has approved the information collection requirements and has assigned OMB Control Number 2120-0056.

#### Related Information

(h) Refer to MCAI European Aviation Safety Agency AD No: 2007-0014, dated January 12, 2007; and APEX Aircraft Mandatory Service Bulletin No. 050605, dated October 17, 2006, for related information.

#### Material Incorporated by Reference

(i) You must use APEX Aircraft Mandatory Service Bulletin No. 050605, dated October 17, 2006, to do the actions required by this AD, unless the AD specifies otherwise.

(1) The Director of the Federal Register approved the incorporation by reference of this service information under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) For service information identified in this AD, contact Apex Aircraft, Bureau de Navigabilité, 1, route de Troyes, 21121 DAROIS—France; telephone: +33 380 35 65 10; fax +33 380 35 65 15; e-mail: [airworthiness@apex-aircraft.com](mailto:airworthiness@apex-aircraft.com); Internet: <http://www.apex-aircraft.com>.

(3) You may review copies at the FAA, Central Region, Office of the Regional Counsel, 901 Locust, Room 506, Kansas City, Missouri 64106; or at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Kansas City, Missouri, on April 19, 2007.

**Charles L. Smalley,**

*Acting Manager, Small Airplane Directorate, Aircraft Certification Service.*

[FR Doc. E7-7994 Filed 4-27-07; 8:45 am]

**BILLING CODE 4910-13-P**