

### Revise Airworthiness Limitations Section (ALS) To Incorporate Fuel Maintenance and Inspection Tasks

(f) Within 3 months after the effective date of this AD, revise the ALS of the Instructions for Continued Airworthiness to incorporate Airbus A318/A319/A320/A321 ALS Part 5—Fuel Airworthiness Limitations, dated February 28, 2006, as defined in Airbus A318/A319/A320/A321 Fuel Airworthiness Limitations, Document 95A.1931/05, Issue 1, dated December 19, 2005 (approved by the European Aviation Safety Agency (EASA) on March 14, 2006), Section 1, “Maintenance/Inspection Tasks.” For all tasks identified in Section 1 of Document 95A.1931/05, the initial compliance times start from the effective date of this AD and must be accomplished within the repetitive interval specified in Section 1 of Document 95A.1931/05.

### Revise ALS To Incorporate CDCCLs

(g) Within 12 months after the effective date of this AD, revise the ALS of the Instructions for Continued Airworthiness to incorporate Airbus A318/A319/A320/A321 ALS Part 5—Fuel Airworthiness Limitations, dated February 28, 2006, as defined in Airbus A318/A319/A320/A321 Fuel Airworthiness Limitations, Document 95A.1931/05, Issue 1, dated December 19, 2005 (approved by the EASA on March 14, 2006), Section 2, “Critical Design Configuration Control Limitations.”

### No Alternative Inspections, Inspection Intervals, or CDCCLs

(h) Except as provided by paragraph (i) of this AD: After accomplishing the actions specified in paragraphs (f) and (g) of this AD, no alternative inspections, inspection intervals, or CDCCLs may be used.

### Alternative Methods of Compliance (AMOCs)

(i)(1) The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested in accordance with the procedures found in 14 CFR 39.19.

(2) Before using any AMOC approved in accordance with § 39.19 on any airplane to which the AMOC applies, notify the appropriate principal inspector in the FAA Flight Standards Certificate Holding District Office.

### Related Information

(j) EASA airworthiness directive 2006-0203, dated July 11, 2006, also addresses the subject of this AD.

Issued in Renton, Washington, on February 7, 2007.

### Ali Bahrami,

Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. E7-2977 Filed 2-21-07; 8:45 am]

BILLING CODE 4910-13-P

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2007-27302; Directorate Identifier 2006-NM-273-AD]

RIN 2120-AA64

### Airworthiness Directives; McDonnell Douglas DC-10-30 and DC-10-30F (KC-10A and KDC-10) Airplanes

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for certain McDonnell Douglas DC-10-30 and DC-10-30F (KC-10A and KDC-10) airplanes. This proposed AD would require installing Teflon sleeving around the fuel pump wire harness inside the conduit in the aft supplemental fuel tank. This proposed AD results from fuel system reviews conducted by the manufacturer. We are proposing this AD to prevent the potential of ignition sources inside fuel tanks, which, in combination with flammable fuel vapors, could result in fuel tank explosions and consequent loss of the airplane.

**DATES:** We must receive comments on this proposed AD by April 9, 2007.

**ADDRESSES:** Use one of the following addresses to submit comments on this proposed AD.

- DOT Docket Web site: Go to <http://dms.dot.gov> and follow the instructions for sending your comments electronically.

- Government-wide rulemaking Web site: Go to <http://www.regulations.gov> and follow the instructions for sending your comments electronically.

- Mail: Docket Management Facility, U.S. Department of Transportation, 400 Seventh Street SW., Nassif Building, room PL-401, Washington, DC 20590.

- Fax: (202) 493-2251.

- Hand Delivery: Room PL-401 on the plaza level of the Nassif Building, 400 Seventh Street, SW., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

Contact Boeing Commercial Airplanes, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Data and Service Management, Dept. C1-L5A (D800-0024), for the service information identified in this proposed AD.

**FOR FURTHER INFORMATION CONTACT:** Samuel Lee, Aerospace Engineer,

Propulsion Branch, ANM-140L, FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California 90712-4137; telephone (562) 627-5262; fax (562) 627-5210.

### SUPPLEMENTARY INFORMATION:

#### Comments Invited

We invite you to submit any relevant written data, views, or arguments regarding this proposed AD. Send your comments to an address listed in the **ADDRESSES** section. Include the docket number “FAA-2007-27302; Directorate Identifier 2006-NM-273-AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of the proposed AD. We will consider all comments received by the closing date and may amend the proposed AD in light of those comments.

We will post all comments we receive, without change, to <http://dms.dot.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact with FAA personnel concerning this proposed AD. Using the search function of that Web site, anyone can find and read the comments in any of our dockets, including the name of the individual who sent the comment (or signed the comment on behalf of an association, business, labor union, etc.). You may review DOT’s complete Privacy Act Statement in the **Federal Register** published on April 11, 2000 (65 FR 19477-78), or you may visit <http://dms.dot.gov>.

#### Examining the Docket

You may examine the AD docket on the Internet at <http://dms.dot.gov>, or in person at the Docket Management Facility office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The Docket Management Facility office (telephone (800) 647-5227) is located on the plaza level of the Nassif Building at the DOT street address stated in the **ADDRESSES** section. Comments will be available in the AD docket shortly after the Docket Management System receives them.

#### Discussion

The FAA has examined the underlying safety issues involved in fuel tank explosions on several large transport airplanes, including the adequacy of existing regulations, the service history of airplanes subject to those regulations, and existing maintenance practices for fuel tank systems. As a result of those findings,

we issued a regulation titled "Transport Airplane Fuel Tank System Design Review, Flammability Reduction and Maintenance and Inspection Requirements" (66 FR 23086, May 7, 2001). In addition to new airworthiness standards for transport airplanes and new maintenance requirements, this rule included Special Federal Aviation Regulation No. 88 ("SFAR 88," Amendment 21-78, and subsequent Amendments 21-82 and 21-83).

Among other actions, SFAR 88 requires certain type design (*i.e.*, type certificate (TC) and supplemental type certificate (STC)) holders to substantiate that their fuel tank systems can prevent ignition sources in the fuel tanks. This requirement applies to type design holders for large turbine-powered transport airplanes and for subsequent modifications to those airplanes. It requires them to perform design reviews and to develop design changes and maintenance procedures if their designs do not meet the new fuel tank safety standards. As explained in the preamble to the rule, we intended to adopt airworthiness directives to mandate any changes found necessary to address unsafe conditions identified as a result of these reviews. In evaluating these design reviews, we have established four criteria intended to define the unsafe conditions associated with fuel tank systems that require corrective actions. The percentage of operating time during which fuel tanks are exposed to flammable conditions is one of these criteria. The other three criteria address the failure types under evaluation: Single failures, single failures in combination with a latent condition(s), and in-service failure experience. For all four criteria, the evaluations included consideration of previous actions taken that may mitigate the need for further action.

We have determined that the actions identified in this proposed AD are necessary to reduce the potential of ignition sources inside fuel tanks, which, in combination with flammable fuel vapors, could result in fuel tank explosions and consequent loss of the airplane.

We have received a report indicating that fuel leaked from the No. 1 main fuel tank boost pump electrical conduit into the fuel shroud drain system, on a Model DC-10-30 airplane. The airplane had accumulated about 25,000 total flight hours. Investigation revealed that electrical arcing between chafed wiring and the inside of the conduit wall caused a hole in the conduit. Fuel then leaked into the conduit through the hole from the fuel tank. This condition, if not prevented, could result in the potential

of ignition sources inside fuel tanks, which, in combination with flammable fuel vapors, could result in fuel tank explosions and consequent loss of the airplane.

#### Relevant Service Information

We have reviewed McDonnell Douglas DC-10 Service Bulletin 24-128, dated January 19, 1984. The service bulletin describes procedures for installing Teflon sleeving around the fuel pump wire harness inside the conduit in the aft supplemental fuel tank. Accomplishing the actions specified in the service information is intended to adequately address the unsafe condition.

#### FAA's Determination and Requirements of the Proposed AD

We have evaluated all pertinent information and identified an unsafe condition that is likely to exist or develop on other airplanes of this same type design. For this reason, we are proposing this proposed AD, which would require accomplishing the actions specified in the service information described previously, except as discussed under "Difference Between the Proposed AD and Service Bulletin."

#### Difference Between the Proposed AD and Service Bulletin

The service bulletin recommends accomplishing the modification within 34,000 flight hours after installing the supplemental fuel tank. When the service bulletin was issued in 1984, we did not have a safety concern that warranted AD action. However, the service bulletin was re-evaluated as part of the SFAR 88 review activity. We determined that AD action is warranted. From that review, we also determined that the recommended compliance time should be re-examined. Boeing subsequently recommended a 60-month compliance time, which is consistent with the compliance time recommended in similar Boeing service bulletins. In developing an appropriate compliance time for this AD, we considered the typical utilization of the affected airplanes, the degree of urgency associated with the subject unsafe condition, and the time necessary to perform the modification (2 hours). In light of all of these factors, we find that a 60-month compliance time represents an appropriate interval of time for affected airplanes to continue to operate without compromising safety.

#### Costs of Compliance

There are about 5 airplanes of the affected design in the worldwide fleet.

This proposed AD would affect about 5 airplanes of U.S. registry. The proposed actions would take about 2 work hours per airplane, at an average labor rate of \$80 per work hour. The cost of required parts is negligible. Based on these figures, the estimated cost of the proposed AD for U.S. operators is \$800, or \$160 per airplane.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, Section 106, describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701, "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We have determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that the proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
3. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this proposed AD and placed it in the AD docket. See the **ADDRESSES** section for a location to examine the regulatory evaluation.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

## The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

2. The Federal Aviation Administration (FAA) amends § 39.13 by adding the following new airworthiness directive (AD):

**McDonnell Douglas:** Docket No. FAA-2007-27302; Directorate Identifier 2006-NM-273-AD.

#### Comments Due Date

(a) The FAA must receive comments on this AD action by April 9, 2007.

#### Affected ADs

(b) None.

#### Applicability

(c) This AD applies to McDonnell Douglas Model DC-10-30 and DC-10-30F (KC-10A and KDC-10) airplanes, certificated in any category; as identified McDonnell Douglas DC-10 Service Bulletin 24-128, dated January 19, 1984.

#### Unsafe Condition

(d) This AD results from fuel system reviews conducted by the manufacturer. We are issuing this AD to prevent the potential of ignition sources inside fuel tanks, which, in combination with flammable fuel vapors, could result in fuel tank explosions and consequent loss of the airplane.

#### Compliance

(e) You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

#### Modification

(f) Within 60 months after the effective date of this AD, install Teflon sleeving around the fuel pump wire harness inside the conduit in the aft supplemental fuel tank, in accordance with the Accomplishment Instructions of McDonnell Douglas DC-10 Service Bulletin 24-128, dated January 19, 1984.

#### Alternative Methods of Compliance (AMOCs)

(g)(1) The Manager, Los Angeles Aircraft Certification Office, FAA, has the authority to approve AMOCs for this AD, if requested in accordance with the procedures found in 14 CFR 39.19.

(2) Before using any AMOC approved in accordance with § 39.19 on any airplane to which the AMOC applies, notify the appropriate principal inspector in the FAA Flight Standards Certificate Holding District Office.

Issued in Renton, Washington, on February 13, 2007.

**Ali Bahrami,**

*Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. E7-2975 Filed 2-21-07; 8:45 am]

BILLING CODE 4910-13-P

## DEPARTMENT OF HEALTH AND HUMAN SERVICES

### Food and Drug Administration

#### 21 CFR Part 352

[Docket No. 2006N-0479]

RIN 0910-AF43

#### Insect Repellent-Sunscreen Drug Products for Over-the-Counter Human Use; Request for Information and Comments

**AGENCY:** Food and Drug Administration, HHS.

**ACTION:** Request for data and information.

**SUMMARY:** The Food and Drug Administration (FDA) is seeking information to formulate a regulatory position on insect repellent products that contain over-the-counter (OTC) sunscreen ingredients. FDA is considering amending its monograph for OTC sunscreen drug products (the regulation that establishes conditions under which these drug products are generally recognized as safe and effective and not misbranded) to add conditions for marketing insect repellent-sunscreen drug products. The insect repellent ingredients in these products are regulated by the Environmental Protection Agency (EPA). Elsewhere in this issue of the **Federal Register** is a companion document in which EPA is also requesting information and comments on these products. The decision on what regulations, if any, to propose will be based, in part, on information and comments submitted in response to this request for data and information.

**DATES:** Submit written or electronic comments by May 23, 2007.

**ADDRESSES:** You may submit comments, identified by Docket No. 2006N-0479 or RIN 0910-AF43, by any of the following methods:

#### Electronic Submissions

Submit electronic comments in the following ways:

- Federal eRulemaking Portal: <http://www.regulations.gov>. Follow the instructions for submitting comments.

- Agency Web site: <http://www.fda.gov/dockets/ecomments>. Follow the instructions for submitting comments on the agency Web site.

#### Written Submissions

Submit written submissions in the following ways:

- FAX: 301-827-6870.
- Mail/Hand delivery/Courier [For paper, disk, or CD-ROM submissions]: Division of Dockets Management (HFA-305), Food and Drug Administration, 5630 Fishers Lane, rm. 1061, Rockville, MD 20852.

To ensure more timely processing of comments, FDA is no longer accepting comments submitted to the agency by e-mail. FDA encourages you to continue to submit electronic comments by using the Federal eRulemaking Portal or the agency Web site, as described in the *Electronic Submissions* portion of this paragraph.

*Instructions:* All submissions received must include the agency name and Docket No. and Regulatory Information Number (RIN) for this rulemaking. All comments received will be posted without change to <http://www.fda.gov/ohrms/dockets/default.htm>, including any personal information provided. For additional information on submitting comments, see the "Comments" heading of the **SUPPLEMENTARY INFORMATION** section of this document.

*Docket:* For access to the docket to read background documents or comments received, go to <http://www.fda.gov/ohrms/dockets/default.htm> and insert the docket number, found in brackets in the heading of this document, into the "Search" box and follow the prompts and/or go to the Division of Dockets Management, 5630 Fishers Lane, rm. 1061, Rockville, MD 20852.

**FOR FURTHER INFORMATION CONTACT:** Matthew R. Holman, Center for Drug Evaluation and Research, Food and Drug Administration, 10903 New Hampshire Ave., Bldg. 22, MS 5411, Silver Spring, MD 20993, 301-796-2090.

#### SUPPLEMENTARY INFORMATION:

##### I. Background

##### A. Description of Insect Repellent-Sunscreen Drug Products

FDA and EPA are seeking information to formulate a regulatory position for combination insect repellent-sunscreen drug products for use on human skin. Because sunscreen drug products are regulated by FDA and the insect repellent components of these products are separately regulated by EPA, both agencies are seeking comments to