

Compliance

(e) To address this problem, you must do the following, unless already done:

Actions	Compliance	Procedures
<p>(1) Inspect the fuel system, including inspecting and doing functional tests of the fuel selector valve.</p> <p>(2) Perform any corrective actions required as specified in Sierra Hotel Aero, Inc. Navion Service Bulletin No. 106, dated February 27, 2007, including replacing the fuel selector valve with one of the following part numbers (P/N):</p> <p>(i) Navion P/N 147-30013-201 for airplanes equipped with ON/OFF fuel valves for the main tank.</p> <p>(ii) Navion P/N 147-30013-202 for airplanes equipped with main and auxiliary selectable tanks.</p> <p>(iii) Navion P/N 147-30013-203 for airplanes equipped with left tip, right tip and main tanks.</p> <p>(3) As terminating action for the required repetitive inspections in paragraph (e)(1) of this AD, you may replace the fuel selector valve with the applicable P/N as specified in paragraphs (e)(2)(i), (e)(2)(ii), and (e)(2)(iii) of this AD.</p>	<p>Initially no later than 100 hours time-in-service (TIS) or 12 months, whichever occurs first, after the effective date of this AD. Repeatedly thereafter inspect the fuel selector valve at intervals not to exceed 12 months until the replacement required by paragraph (e)(2) of this AD is done.</p> <p>Before further flight after any inspection required by this AD where corrective actions are necessary.</p> <p>At any time after the initial inspection required in paragraph (e)(1) of this AD; however, if replacement of the fuel selector valve is required as a corrective action as specified in Sierra Hotel Aero, Inc. Navion Service Bulletin No. 106, dated February 27, 2007, then you must replace before further flight.</p>	<p>Follow Sierra Hotel Aero, Inc. Navion Service Bulletin No. 106, dated February 27, 2007.</p> <p>Use the following service information:</p> <p>(A) Sierra Hotel Aero, Inc. Navion Service Bulletin No. 106, dated February 27, 2007.</p> <p>(B) Sierra Hotel Aero, Inc. Navion Service Bulletin No. 101A, dated August 23, 2005.</p> <p>(C) Navion Aircraft Corporation Navion Service letter # 87, dated February 20, 1965.</p> <p>Follow the procedures in Sierra Hotel Aero, Inc. Navion Service Bulletin No. 101A, dated August 23, 2005.</p>

Alternative Methods of Compliance (AMOCs)

(f) The Manager, Chicago Aircraft Certification Office, FAA, ATTN: Tim Smyth, Aerospace Engineer, 2300 East Devon Avenue, Room 107, Des Plaines, Illinois 60018; telephone: (847) 294-7132; fax: (847) 294-7834, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

Related Information

(g) To get copies of the service information referenced in this AD, contact Sierra Hotel Aero, 1690 Aeronca Lane, South St. Paul, MN 55075; phone: (651) 306-1456; fax: (612) 677-3171; Internet: <http://www.navion.com/servicebulletins.html>; e-mail: servicebulletinsupport@navion.com. To view the AD docket, go to the Docket Management Facility; U.S. Department of Transportation, 400 Seventh Street, SW., Nassif Building, Room PL-401, Washington, DC, or on the Internet at <http://dms.dot.gov>. The docket number is Docket No. FAA-2007-27611; Directorate Identifier 2007-CE-024-AD.

Issued in Kansas City, Missouri, on April 6, 2007.

Kim Smith,

Manager, Small Airplane Directorate, Aircraft Certification Service.

[FR Doc. E7-6928 Filed 4-11-07; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2007-27849; Directorate Identifier 2006-NM-249-AD]

RIN 2120-AA64

Airworthiness Directives; Dassault Model Falcon 2000EX and Falcon 900EX Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for the products listed above. This proposed AD results from mandatory continuing airworthiness information (MCAI) issued by an aviation authority of

another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as some stringer reinforcements (F900DX) and some rivets (F900DX/F2000EX) missing from the skin panels on each side of the fuselage between frames 9 and 10 on certain Falcon 900DX and Falcon 2000EX EASy aircraft; this situation affects the structural integrity of the fuselage. The proposed AD would require actions that are intended to address the unsafe condition described in the MCAI.

DATES: We must receive comments on this proposed AD by May 14, 2007.

ADDRESSES: You may send comments by any of the following methods:

- *DOT Docket Web Site:* Go to <http://dms.dot.gov> and follow the instructions for sending your comments electronically.

- *Fax:* (202) 493-2251.

- *Mail:* Docket Management Facility, U.S. Department of Transportation, 400 Seventh Street, SW., Nassif Building, Room PL-401, Washington, DC 20590-0001.

- *Hand Delivery:* Room PL-401 on the plaza level of the Nassif Building, 400 Seventh Street, SW., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

• *Federal eRulemaking Portal*: <http://www.regulations.gov>. Follow the instructions for submitting comments.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://dms.dot.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone (800) 647-5227) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT: Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98057-3356; telephone (425) 227-1137; fax (425) 227-1149.

SUPPLEMENTARY INFORMATION:

Streamlined Issuance of AD

The FAA is implementing a new process for streamlining the issuance of ADs related to MCAI. This streamlined process will allow us to adopt MCAI safety requirements in a more efficient manner and will reduce safety risks to the public. This process continues to follow all FAA AD issuance processes to meet legal, economic, Administrative Procedure Act, and **Federal Register** requirements. We also continue to meet our technical decision-making responsibilities to identify and correct unsafe conditions on U.S.-certificated products.

This proposed AD references the MCAI and related service information that we considered in forming the engineering basis to correct the unsafe condition. The proposed AD contains text copied from the MCAI and for this reason might not follow our plain language principles.

Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2007-27849; Directorate Identifier 2006-NM-249-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD because of those comments.

We will post all comments we receive, without change, to <http://dms.dot.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, has issued EASA Emergency Airworthiness Directive 2006-0320-E, dated October 18, 2006 (referred to after this as "the MCAI"), to correct an unsafe condition for the specified products. The MCAI states that following the incorporation of a design change to the Karman fairing, it has been determined that some stringer reinforcements (F900DX) and some rivets (F900DX/F2000EX) are missing from the skin panels on each side of the fuselage between frames 9 and 10 on certain Falcon 900DX and Falcon 2000EX EASy aircraft. This situation affects the structural integrity of the fuselage and may lead to an unsafe condition if left uncorrected. The MCAI was issued to recover the certificated structural strength by adding the missing rivets and checking the condition of the adjacent structure, and to add the missing stringer caps on F900DX (as appropriate). These actions include inspecting the area, including holes and structure, where missing rivets are found, and contacting the manufacturer if the holes are out-of-round beyond tolerance, or if cracks are found, as applicable.

Relevant Service Information

Dassault has issued Service Bulletin F900EX-308, dated October 18, 2006, and Service Bulletin Falcon F2000EX-133, dated September 28, 2006. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI.

FAA's Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, they have notified us of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all information provided by the State of Design Authority and determined the unsafe condition exists and is likely to

exist or develop on other products of the same type design.

Differences Between This AD and the MCAI or Service Information

We have reviewed the MCAI and related service information and, in general, agree with their substance. But we might have found it necessary to use different words from those in the MCAI to ensure the AD is clear for U.S. operators and is enforceable. In making these changes, we do not intend to differ substantively from the information provided in the MCAI and related service information.

We might also have proposed different actions in this AD from those in the MCAI in order to follow FAA policies. Any such differences are described in a separate paragraph of the proposed AD. These requirements, if ultimately adopted, will take precedence over the actions copied from the MCAI.

Costs of Compliance

Based on the service information, we estimate that this proposed AD would affect about 2 products of U.S. registry. We also estimate that it would take about 170 work-hours per product to comply with this proposed AD. The average labor rate is \$80 per work-hour. Required parts would cost \$0 per product. Where the service information lists required parts costs that are covered under warranty, we have assumed that there will be no charge for these costs. As we do not control warranty coverage for affected parties, some parties may incur costs higher than estimated here. Based on these figures, we estimate the cost of the proposed AD on U.S. operators to be \$27,200, or \$13,600 per product.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on

products identified in this rulemaking action.

Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
3. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this proposed AD and placed it in the AD docket.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. The FAA amends § 39.13 by adding the following new AD:

Dassault Aviation: Docket No. FAA-2007-27849; Directorate Identifier 2006-NM-249-AD.

Comments Due Date

(a) We must receive comments by May 14, 2007.

Affected ADs

(b) None.

Applicability

(c) This AD applies to Dassault Model Falcon 2000EX airplanes, S/N (serial number) 82; and Falcon 900EX (version F900DX) airplanes, S/Ns 601 through 605; certificated in any category.

Reason

(d) The mandatory continuing airworthiness information (MCAI) states that

following the incorporation of a design change to the Karman fairing, it has been determined that some stringer reinforcements (F900DX) and some rivets (F900DX/F2000EX) are missing from the skin panels on each side of the fuselage between frames 9 and 10 on certain Falcon 900DX and Falcon 2000EX EASy aircraft. This situation affects the structural integrity of the fuselage and may lead to an unsafe condition if left uncorrected. The MCAI was issued to recover the certificated structural strength by adding the missing rivets and checking the condition of the adjacent structure, and to add the missing stringer caps on F900DX (as appropriate). These actions include inspecting the area, including holes and structure, where missing rivets are found, and contacting the manufacturer if the holes are out-of-round beyond tolerance, or if cracks are found, as applicable.

Actions and Compliance

(e) Within 3 months after the effective date of this AD, unless already done, do the following actions: Inspect and repair the aircraft in accordance with the instructions of Dassault Service Bulletin F900EX-308, dated October 18, 2006, for version F900DX, S/N 601 through 605; and Dassault Service Bulletin F2000EX-133, dated September 28, 2006, for Model F2000EX S/N 82.

FAA AD Differences

Note: This AD differs from the MCAI and/or service information as follows: No differences.

Other FAA AD Provisions

(f) The following provisions also apply to this AD:

(1) Alternative Methods of Compliance (AMOCs): The Manager, International Branch, ANM-116, FAA, ATTN: Tom Rodriguez, Aerospace Engineer, 1601 Lind Avenue, SW., Renton, Washington 98057-3356, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Before using any AMOC approved in accordance with § 39.19 on any airplane to which the AMOC applies, notify the appropriate principal inspector in the FAA Flight Standards Certificate Holding District Office.

(2) Airworthy Product: For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

(3) Reporting Requirements: For any reporting requirement in this AD, under the provisions of the Paperwork Reduction Act, the Office of Management and Budget (OMB) has approved the information collection requirements and has assigned OMB Control Number 2120-0056.

Related Information

(g) Refer to MCAI EASA Emergency Airworthiness Directive 2006-0320-E, dated October 18, 2006; Dassault Service Bulletin F900EX-308, dated October 18, 2006; and

Dassault Service Bulletin F2000EX-133, dated September 28, 2006, for related information.

Issued in Renton, Washington, on April 5, 2007.

Stephen P. Boyd,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. E7-6932 Filed 4-11-07; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF THE TREASURY

Internal Revenue Service

26 CFR Part 1

[REG-144859-04]

RIN 1545-BD72

Section 1367 Regarding Open Account Debt

AGENCY: Internal Revenue Service (IRS), Treasury.

ACTION: Notice of proposed rulemaking and notice of public hearing.

SUMMARY: This document proposes amendments to the regulations relating to the treatment of open account debt between S corporations and their shareholders. These proposed regulations provide rules regarding the definition of open account debt and the adjustments in basis of any indebtedness of an S corporation to a shareholder under section 1367(b)(2) of the Internal Revenue Code (Code) for shareholder advances and repayments on advances of open account debt. The proposed regulations affect shareholders of S corporations and are necessary to provide guidance needed to comply with the applicable tax law. This document also provides notice of a public hearing.

DATES: Written or electronic comments and requests for a public hearing must be received by July 11, 2007. Outlines of topics to be discussed at the public hearing scheduled for July 31, 2007, at 10 a.m., must be received by July 10, 2007.

ADDRESSES: Send submissions to: CC:PA:LPD:PR (REG-144859-04), room 5203, Internal Revenue Service, P.O. Box 7604, Ben Franklin Station, Washington, DC 20044. Submissions also may be hand-delivered Monday through Friday between the hours of 8 a.m. and 4 p.m. to: CC:PA:LPD:PR (REG-144859-04), Courier's Desk, Internal Revenue Service, 1111 Constitution Avenue, NW., Washington, DC, or sent electronically, via the Federal eRulemaking Portal at <http://www.federalregister.gov>