

Once the requirements of paragraph (b)(1) of this AD have been accomplished, the AFM revision required by paragraph (b)(2)(i) of this AD may be removed from the AFM.

#### Parts Installation

(c) As of the effective date of this AD, no person may install a spoiler lift dump valve having a serial number listed in paragraph (a)(1) of this AD, unless the valve's serial number includes a suffix of "A" to indicate that it has been modified to remove the defect that is the subject of this AD.

#### Alternative Methods of Compliance

(d) In accordance with 14 CFR 39.19, the Manager, New York Aircraft Certification Office, FAA, is authorized to approve alternative methods of compliance for this AD.

**Note 2:** The subject of this AD is addressed in Canadian airworthiness directive CF-2001-44, dated December 3, 2001.

Issued in Renton, Washington, on February 20, 2004.

**Kalene C. Yanamura,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 04-4932 Filed 3-4-04; 8:45 am]

BILLING CODE 4910-13-P

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. 2003-NM-138-AD]

RIN 2120-AA64

#### Airworthiness Directives; Dornier Model 328-300 Series Airplanes

**AGENCY:** Federal Aviation Administration, DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** This document proposes the adoption of a new airworthiness directive (AD) that is applicable to certain Dornier Model 328-300 series airplanes. This proposal would require modification of a certain ground cooling fan. This action is necessary to prevent overheating of the connecting terminals of the ground cooling fan, which could result in smoke or fire in the flight compartment and main cabin. This action is intended to address the identified unsafe condition.

**DATES:** Comments must be received by April 5, 2004.

**ADDRESSES:** Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 2003-NM-138-AD, 1601 Lind Avenue, SW.,

Renton, Washington 98055-4056. Comments may be inspected at this location between 9 a.m. and 3 p.m., Monday through Friday, except Federal holidays. Comments may be submitted via fax to (425) 227-1232. Comments may also be sent via the Internet using the following address: [9-anm-nprmcomment@faa.gov](mailto:9-anm-nprmcomment@faa.gov). Comments sent via fax or the Internet must contain "Docket No. 2003-NM-138-AD" in the subject line and need not be submitted in triplicate. Comments sent via the Internet as attached electronic files must be formatted in Microsoft Word 97 or 2000 or ASCII text.

The service information referenced in the proposed rule may be obtained from AvCraft Aerospace GmbH, P.O. Box 1103, D-82230 Wessling, Germany. This information may be examined at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington.

**FOR FURTHER INFORMATION CONTACT:** Dan Rodina, Aerospace Engineer, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98055-4056; telephone (425) 227-2125; fax (425) 227-1149.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

Interested persons are invited to participate in the making of the proposed rule by submitting such written data, views, or arguments as they may desire. Communications shall identify the Rules Docket number and be submitted in triplicate to the address specified above. All communications received on or before the closing date for comments, specified above, will be considered before taking action on the proposed rule. The proposals contained in this action may be changed in light of the comments received.

Submit comments using the following format:

- Organize comments issue-by-issue. For example, discuss a request to change the compliance time and a request to change the service bulletin reference as two separate issues.
- For each issue, state what specific change to the proposed AD is being requested.
- Include justification (*e.g.*, reasons or data) for each request.

Comments are specifically invited on the overall regulatory, economic, environmental, and energy aspects of the proposed rule. All comments submitted will be available, both before and after the closing date for comments, in the Rules Docket for examination by interested persons. A report

summarizing each FAA-public contact concerned with the substance of this proposal will be filed in the Rules Docket.

Commenters wishing the FAA to acknowledge receipt of their comments submitted in response to this action must submit a self-addressed, stamped postcard on which the following statement is made: "Comments to Docket Number 2003-NM-138-AD." The postcard will be date stamped and returned to the commenter.

#### Availability of NPRMs

Any person may obtain a copy of this NPRM by submitting a request to the FAA, Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 2003-NM-138-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056.

#### Discussion

The Luftfahrt-Bundesamt (LBA), which is the airworthiness authority for Germany, notified the FAA that an unsafe condition may exist on certain Dornier Model 328-300 series airplanes. The LBA advises that certain data indicate that the high transition resistance of the connecting terminals in a certain ground cooling fan may cause the terminals to overheat. Such high transition resistance is due to a loose stud connection. Overheating of the connecting terminals could result in smoke or fire in the flight compartment and main cabin.

#### Explanation of Relevant Service Information

Dornier has issued Service Bulletin SB-328J-21-045, Revision 1, dated February 26, 2003, which describes procedures for modification of any ground cooling fan having part number AE1716D00. The modification involves replacement of the wire subassemblies (positive and negative) with new wire subassemblies, installation of a hexagon nut on the positive terminal to improve the terminal lug installation, and replacement of the basic flat washer with a spring washer. Accomplishment of the actions specified in the service bulletin is intended to adequately address the identified unsafe condition. The LBA classified this service bulletin as mandatory and issued German airworthiness directive 2003-144, dated May 15, 2003, to ensure the continued airworthiness of these airplanes in Germany.

#### FAA's Conclusions

This airplane model is manufactured in Germany and is type certificated for operation in the United States under the provisions of section 21.29 of the

Federal Aviation Regulations (14 CFR 21.29) and the applicable bilateral airworthiness agreement. Pursuant to this bilateral airworthiness agreement, the LBA has kept us informed of the situation described above. We have examined the findings of the LBA, reviewed all available information, and determined that AD action is necessary for products of this type design that are certificated for operation in the United States.

### Explanation of Requirements of Proposed Rule

Since an unsafe condition has been identified that is likely to exist or develop on other airplanes of the same type design registered in the United States, the proposed AD would require accomplishment of the actions specified in the service bulletin described previously.

### Cost Impact

We estimate that 52 airplanes of U.S. registry would be affected by this proposed AD, that it would take about 2 work hours per airplane to accomplish the proposed modification, and that the average labor rate is \$65 per work hour. Required parts would cost about \$14,000 per airplane. Based on these figures, the cost impact of the proposed AD on U.S. operators is estimated to be \$734,760, or \$14,130 per airplane.

The cost impact figure discussed above is based on assumptions that no operator has yet accomplished any of the proposed requirements of this AD action, and that no operator would accomplish those actions in the future if this AD were not adopted. The cost impact figures discussed in AD rulemaking actions represent only the time necessary to perform the specific actions actually required by the AD. These figures typically do not include incidental costs, such as the time required to gain access and close up, planning time, or time necessitated by other administrative actions.

### Regulatory Impact

The regulations proposed herein would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this proposal would not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this proposed regulation (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under the DOT

Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) if promulgated, will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A copy of the draft regulatory evaluation prepared for this action is contained in the Rules Docket. A copy of it may be obtained by contacting the Rules Docket at the location provided under the caption ADDRESSES.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

### The Proposed Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration proposes to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

**Fairchild Dornier GmbH (Formerly Dornier Luftfahrt GmbH):** Docket 2003-NM-138-AD.

**Applicability:** Model 328-300 series airplanes equipped with a ground cooling fan, part number AE1716D00, certificated in any category.

**Compliance:** Required as indicated, unless accomplished previously.

To prevent overheating of the connecting terminals of the ground cooling fan, which could result in smoke or fire in the flight compartment and main cabin, accomplish the following:

#### Modification

(a) Within 60 days after the effective date of this AD: Modify the ground cooling fan by doing all the actions per the Accomplishment Instructions of Dornier Service Bulletin SB-328J-21-045, Revision 1, dated February 26, 2003.

#### Alternative Methods of Compliance

(b) In accordance with 14 CFR 39.19, the Manager, International Branch, ANM-116, FAA, Transport Airplane Directorate, is authorized to approve alternative methods of compliance for this AD.

**Note 1:** The subject of this AD is addressed in German airworthiness directive 2003-144, dated May 15, 2003.

Issued in Renton, Washington, on February 24, 2004.

**Kalene C. Yanamura,**  
*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*  
[FR Doc. 04-4933 Filed 3-4-04; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. 2003-NM-120-AD]

RIN 2120-AA64

### Airworthiness Directives; Dornier Model 328-100 and -300 Series Airplanes

**AGENCY:** Federal Aviation Administration, DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** This document proposes the adoption of a new airworthiness directive (AD) that is applicable to all Dornier Model 328-100 and -300 series airplanes. This proposal would require a one-time inspection for fracture and/or breakage of the hinge bolt of the output rod of the rudder spring tab lever assembly, and corrective action if necessary. This proposal also would require modification of the hinge bolt. This action is necessary to prevent fracture and/or breakage of the hinge bolt, which could result in migration of the bolt tail, a loose spring tab, and consequent reduced controllability of the airplane. This action is intended to address the identified unsafe condition.

**DATES:** Comments must be received by April 5, 2004.

**ADDRESSES:** Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 2003-NM-120-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056. Comments may be inspected at this location between 9 a.m. and 3 p.m., Monday through Friday, except Federal holidays. Comments may be submitted via fax to (425) 227-1232. Comments may also be sent via the Internet using the following address: [9-anm-nprmcomment@faa.gov](mailto:9-anm-nprmcomment@faa.gov). Comments sent via fax or the Internet must contain "Docket No. 2003-NM-120-AD" in the subject line and need not be submitted in triplicate. Comments sent via the Internet as attached electronic files must be formatted in Microsoft Word 97 or 2000 or ASCII text.