

under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this AD and placed it in the AD Docket.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://dms.dot.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains the NPRM, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone (800) 647-5227) is in the ADDRESSES section. Comments will be available in the flyer docket shortly after receipt.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

■ Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new AD:

2007-05-03 Alpha Aviation Design Limited (Type Certificate No. A48EU previously held by APEX Aircraft and AVIONS PIERRE ROBIN): Amendment 39-14964; Docket No. FAA-2006-26493; Directorate Identifier 2006-CE-78-AD.

Effective Date

(a) This airworthiness directive (AD) becomes effective April 9, 2007.

Affected ADS

(b) None.

Applicability

(c) This AD applies to Model R2160 airplanes, serial numbers 1 through 378, that:

- (1) Are certificated in any category; and
- (2) Do not have Robin Aviation Modification No. 14 Fuel Shut-off Control Protector installed.

Reason

(d) The mandatory continuing airworthiness information (MCAI) states: An occurrence of inadvertent manipulation of the fuel shut-off control has been reported.

Actions and Compliance

(e) *Do the following actions, unless already done:* Within the next 200 hours time-in-service after April 9, 2007 (the effective date of this AD), install a protector on the fuel shut-off control according to the instructions of Robin Aviation Imperative Service Bulletin No. 180, dated March 20, 2001.

FAA AD Differences

Note: This AD differs from the MCAI and/or service information as follows: No differences.

Other FAA AD Provisions

(f) *The following provisions also apply to this AD:*

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, Standards Staff, FAA, Small Airplane Directorate, *ATTN:* Karl Schletzbaum, Aerospace Engineer, 901 Locust, Room 301, Kansas City, Missouri 64106; *telephone:* (816) 329-4146; *fax:* (816) 329-4090, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19.

(2) *Airworthy Product:* For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

(3) *Reporting Requirements:* For any reporting requirement in this AD, under the provisions of the Paperwork Reduction Act (44 U.S.C. 3501 *et seq.*), the Office of Management and Budget (OMB) has approved the information collection requirements and has assigned OMB Control Number 2120-0056.

Related Information

(g) Refer to MCAI Civil Aviation Authority AD DCA/R2000/32, Effective Date: June 29, 2006, for related information.

Material Incorporated by Reference

(h) You must use Robin Aviation Imperative Service Bulletin No. 180, dated March 20, 2001, to do the actions required by this AD, unless the AD specifies otherwise.

(1) The Director of the Federal Register approved the incorporation by reference of this service information under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) For service information identified in this AD, contact Alpha Aviation Design Limited, Ingham Road, Hamilton Airport, R.D.2. Hamilton 2020, New Zealand.

(3) You may review copies at the FAA, Central Region, Office of the Regional Counsel, 901 Locust, Room 506, Kansas City, Missouri 64106; or at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Kansas City, Missouri, on February 22, 2007.

Kim Smith,

Manager, Small Airplane Directorate, Aircraft Certification Service.

[FR Doc. E7-3475 Filed 3-2-07; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2006-26684; Directorate Identifier 2006-NM-193-AD; Amendment 39-14969; AD 2007-05-08]

RIN 2120-AA64

Airworthiness Directives; Airbus Model A330 and A340 Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Final rule.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for all Airbus Model A330 and A340 airplanes. This AD requires revising the Airworthiness Limitations section of the Instructions for Continued Airworthiness by incorporating new and revised certification maintenance requirements (CMRs). This AD results from the manufacturer's determination that additional and revised CMRs are necessary in order to ensure continued operational safety of the affected airplanes. We are issuing this AD to prevent safety-significant latent failures that would, in combination with one or more other specific failures or events, result in a hazardous or catastrophic failure condition.

DATES: This AD becomes effective April 9, 2007.

The Director of the Federal Register approved the incorporation by reference of certain publications listed in the AD as of April 9, 2007.

ADDRESSES: You may examine the AD docket on the Internet at <http://dms.dot.gov> or in person at the Docket Management Facility, U.S. Department of Transportation, 400 Seventh Street, SW., Nassif Building, Room PL-401, Washington, DC.

Contact Airbus, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France, for service information identified in this AD.

FOR FURTHER INFORMATION CONTACT: Tim Backman, Aerospace Engineer, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington

98057-3356; telephone (425) 227-2797; fax (425) 227-1149.

SUPPLEMENTARY INFORMATION:

Examining the Docket

You may examine the airworthiness directive (AD) docket on the Internet at <http://dms.dot.gov> or in person at the Docket Management Facility office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The Docket Management Facility office (telephone (800) 647-5227) is located on the plaza level of the Nassif Building at the street address stated in the **ADDRESSES** section.

Discussion

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 to include an AD that would apply to all Airbus Model A330 and A340 airplanes. That NPRM was published in the **Federal Register** on December 27, 2006 (71 FR 77632). That NPRM proposed to require revising the Airworthiness Limitations section of the Instructions for Continued Airworthiness by incorporating new and revised certification maintenance requirements (CMRs).

Comments

We provided the public the opportunity to participate in the development of this AD. We received no comments on the NPRM or on the determination of the cost to the public.

Conclusion

We have carefully reviewed the available data and determined that air safety and the public interest require adopting the AD as proposed.

Costs of Compliance

This AD affects about 27 Model A330 airplanes of U.S. registry. The required actions take about 1 work hour per airplane, at an average labor rate of \$80 per work hour. Based on these figures, the estimated cost of this AD for U.S. operators is \$2,160, or \$80 per airplane.

Currently there are no affected Model A340 airplanes on the U.S. Register. However, if an affected airplane is imported and placed on the U.S. Register in the future, the required actions would take about 1 work hour per airplane, at an average labor rate of \$80 per work hour. Based on these figures, the estimated cost of this AD to U.S. operators is \$80 per airplane.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, Section 106, describes the authority of

the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701, "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We have determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866;
- (2) Is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this AD and placed it in the AD docket. See the **ADDRESSES** section for a location to examine the regulatory evaluation.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

■ Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

■ 2. The Federal Aviation Administration (FAA) amends § 39.13

by adding the following new airworthiness directive (AD):

2007-05-08 Airbus: Amendment 39-14969. Docket No. FAA-2006-26684; Directorate Identifier 2006-NM-193-AD.

Effective Date

(a) This AD becomes effective April 9, 2007.

Affected ADs

(b) None.

Applicability

(c) This AD applies to all Airbus Model A330 and A340 airplanes.

Note 1: This AD requires revisions to certain operator maintenance documents to include new inspections. Compliance with these inspections is required by 14 CFR 91.403(c). For airplanes that have been previously modified, altered, or repaired in the areas addressed by these inspections, the operator may not be able to accomplish the inspections described in the revisions. In this situation, to comply with 14 CFR 91.403(c), the operator must request approval for an alternative method of compliance according to paragraph (g) of this AD. The request should include a description of changes to the required inspections that will ensure the continued damage tolerance of the affected structure. The FAA has provided guidance for this determination in Advisory Circular (AC) 25-1529-1.

Unsafe Condition

(d) This AD results from the manufacturer's determination that additional and revised certification maintenance requirements (CMRs) are necessary in order to ensure continued operational safety of the affected airplanes. We are issuing this AD to prevent safety-significant latent failures that would, in combination with one or more other specific failures or events, result in a hazardous or catastrophic failure condition.

Compliance

(e) You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

Revise the Airworthiness Limitations Section of the Instructions for Continued Airworthiness

(f) Within 3 months after the effective date of this AD: Revise the Airworthiness Limitations section of the Instructions for Continued Airworthiness by incorporating Airbus A330 Certification Maintenance Requirements, Document 955.2074/93, Issue 19, dated March 22, 2006 (for all Model A330 airplanes); or Airbus A340 Certification Maintenance Requirements, Document 955.3019/92, Issue 14, dated December 19, 2005 (for all Model A340 airplanes). Accomplish the actions specified in the applicable CMR at the times specified in the applicable CMR and in accordance with the applicable CMR, except as provided by paragraphs (f)(1), (f)(2), (f)(3), and (f)(4) of this AD.

(1) The associated interval for any new task is to be counted from the effective date of this AD.

(2) The associated interval for any revised task is to be counted from the previous performance of the task.

(3) For Model A340 airplanes that have exceeded the more restrictive limitations of Airbus A340 Certification Maintenance Requirements, Document 955.3019/92, Issue 14, Maintenance Significant Items (MSI) 21.28.00 and 21.43.00: Do the task within 2,500 flight hours after the previous accomplishment. Repeat the task thereafter at the applicable interval in the Airbus A340 Certification Maintenance Requirements, Document 955.3019/92, Issue 14.

(4) For Model A340 airplanes that have accumulated more than 2,700 flight hours since the last maintenance done in accordance with Airbus A340 Certification Maintenance Requirements, Document 955.3019/92, Issue 14, MSI 28.24.00: Do the next task within 800 flight hours after the effective date of this AD. Repeat the task thereafter at the applicable interval in the Airbus A340 Certification Maintenance Requirements, Document 955.3019/92, Issue 14.

Alternative Methods of Compliance (AMOCs)

(g)(1) The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested in accordance with the procedures found in 14 CFR 39.19.

(2) Before using any AMOC approved in accordance with § 39.19 on any airplane to which the AMOC applies, notify the appropriate principal inspector in the FAA Flight Standards Certificate Holding District Office.

Related Information

(h) The European Aviation Safety Agency airworthiness directives 2006-0224, dated July 27, 2006, and 2006-0225, dated July 21, 2006, also address the subject of this AD.

Material Incorporated by Reference

(i) You must use Airbus A330 Certification Maintenance Requirements, Document 955.2074/93, Issue 19, dated March 22, 2006; or Airbus A340 Certification Maintenance Requirements, Document 955.3019/92, Issue 14, dated December 19, 2005; as applicable, to perform the actions that are required by this AD, unless the AD specifies otherwise. The Director of the Federal Register approved the incorporation by reference of these documents in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Contact Airbus, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France, for a copy of this service information. You may review copies at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on February 22, 2007.

Ali Bahrami,

Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. E7-3658 Filed 3-2-07; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2006-26071; Directorate Identifier 2006-CE-51-AD; Amendment 39-14965; AD 2007-05-04]

RIN 2120-AA64

Airworthiness Directives; Mooney Airplane Company, Inc., (Mooney) Models M20M and M20R Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: The FAA adopts a new airworthiness directive (AD) for certain Mooney Airplane Company, Inc., Models M20M and M20R airplanes. This AD requires you to remove the upper left and upper right engine mount attaching hardware, cut out and remove the upholstery and insulation between the fuselage tubular frame and the firewall, and replace the upper left and upper right engine mount attaching hardware with the new parts kit. This AD results from failure of the engine mount attaching hardware to maintain torque as a result of firewall insulation and upholstery being compressed between the fuselage tubular frame and the firewall at the upper left and upper right engine mount attach points. We are issuing this AD to prevent the upper right and upper left engine mounting hardware from losing torque, which could result in a reduction in engine mount load carrying capability and could lead to engine mount failure.

DATES: This AD becomes effective on April 9, 2007.

As of April 9, 2007, the Director of the Federal Register approved the incorporation by reference of certain publications listed in the regulation.

ADDRESSES: To get the service information identified in this AD, contact Mooney Airplane Company, Inc., 165 Al Mooney Road North, Kerrville, Texas 78028; *telephone:* (830) 896-6000, or go to: <http://www.mooney.com/images/pdfs/sb-pdf/m20-292a.pdf>.

To view the AD docket, go to the Docket Management Facility; U.S.

Department of Transportation, 400 Seventh Street, SW., Nassif Building, Room PL-401, Washington, DC 20590-0001 or on the Internet at <http://dms.dot.gov>. The docket number is FAA-2006-26071; Directorate Identifier 2006-CE-51-AD.

FOR FURTHER INFORMATION CONTACT:

Andrew McAnaul, Aerospace Engineer, ASW-150 (c/o MIDO-43), 10100 Reunion Place, Suite 650, San Antonio, Texas 78216; *telephone:* (210) 308-3365; *fax:* (210) 308-3370.

SUPPLEMENTARY INFORMATION:

Discussion

On November 7, 2006, we issued a proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) to include an AD that would apply to certain Mooney Airplane Company, Inc. Models M20M and M20R airplanes. This proposal was published in the **Federal Register** as a notice of proposed rulemaking (NPRM) on November 7, 2006 (71 FR 65062). The NPRM proposed to retorque the upper left and upper right engine mounting hardware as an interim action. The NPRM also proposed to remove the upper left and upper right engine mount attaching hardware, cut out and remove the upholstery and insulation between the fuselage tubular frame and the firewall, and replace the upper left and upper right engine mount attaching hardware with the new parts kit.

Comments

We provided the public the opportunity to participate in developing this AD. The following presents the comments received on the proposal and FAA's response to each comment:

Comment Issue: Jack Buster of the Modification and Replacement Parts Association (MARPA) suggests that paragraph (g) of the proposed action be amended to include the Internet Uniform Resource Locator (URL) address for the relevant service information.

We agree with the commenter's (Jack Buster, MARPA) recommendation. We added the manufacturer's Internet URL address in the information on how to obtain the relevant service information.

Conclusion

Since the NPRM was published, the manufacturer has revised the applicable service bulletin to clarify the fastener torque requirement. The change does not change the intent of the required action and does not create any additional burden on the owners/operators. The AD will reference the appropriate service information: Mooney Airplane Company, Inc. Service