

Gases (1605(b)) Program (January 2007), referred to throughout this part as the "Technical Guidelines," have been approved for incorporation by reference by the Director of the **Federal Register** in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. \* \* \*

[FR Doc. E7-1436 Filed 1-30-07; 8:45 am]  
**BILLING CODE 6450-01-P**

**FARM CREDIT ADMINISTRATION**

**12 CFR Part 620**  
**RIN 3052-AC19**

**Disclosure to Shareholders; Correction**

**AGENCY:** Farm Credit Administration.  
**ACTION:** Correcting amendment.

**SUMMARY:** The Farm Credit Administration (FCA) published a final rule (71 FR 5740, February 2, 2006) that amended the regulations affecting the governance of the Farm Credit System. This document corrects a nonsubstantive error in the final rule.

**EFFECTIVE DATE:** April 5, 2006.

**FOR FURTHER INFORMATION CONTACT:** Cindy R. Nicholson, Technical Editor, Office of General Counsel, Farm Credit Administration, McLean, VA 22102-5090, (703) 883-4020, TTY (703) 883-4020.

**SUPPLEMENTARY INFORMATION:** In revising § 620.5(i)(2)(i), we inadvertently omitted the last two paragraphs in the final rule as published at 71 FR 5740, February 2, 2006.

**List of Subjects in 12 CFR Part 620**

Accounting, Agriculture, Banks, banking, Reporting and recordkeeping requirements, Rural areas.

■ Accordingly, 12 CFR part 620 is corrected by making the following correcting amendment:

**PART 620—DISCLOSURE TO SHAREHOLDERS**

■ 1. The authority citation for part 620 continues to read as follows:

**Authority:** Secs. 5.17, 5.19, 8.11 of the Farm Credit Act (12 U.S.C. 2252, 2254, 2279aa-11) sec. 424 of Pub. L. 100-233, 101 Stat. 1568, 1656.

**Subpart B—Annual Report to Shareholders**

■ 2. Amend § 620.5(i)(2)(i) by adding paragraphs (E) and (F) to read as follows:

**§ 620.5 Contents of the annual report to shareholders.**

\* \* \* \* \*

(i)(2)(i) \* \* \*  
 (E) Compensation amounts reported under the category "Other" (column (f)) shall reflect the dollar value of all other compensation not properly reportable in any other column. Items reported in this column shall be specifically identified and described in a footnote to the table. Such compensation includes, but is not limited to:

(1) The amount paid to the senior officer pursuant to a plan or arrangement in connection with the resignation, retirement, or termination of such officer's employment with the institution; or

(2) The amount of contributions by the institution on behalf of the senior officer to a vested or unvested defined contribution plan unless the plan is made available to all employees on the same basis.

(F) Amounts displayed under "Total" (column (g)) shall reflect the sum total of amounts reported in columns (c), (d), (e), and (f).

\* \* \* \* \*

Dated: January 25, 2007.  
**Roland E. Smith,**  
*Secretary, Farm Credit Administration Board.*  
 [FR Doc. E7-1533 Filed 1-30-07; 8:45 am]  
**BILLING CODE 6705-01-P**

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 39**

[Docket No. FAA-2007-27077; Directorate Identifier 2006-NM-286-AD; Amendment 39-14916; AD 2007-03-05]

**RIN 2120-AA64**

**Airworthiness Directives; Gulfstream Aerospace LP Model Gulfstream 100 Airplanes, and Model Astra SPX and 1125 Westwind Astra Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule; request for comments.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for the products listed above. This AD results from mandatory continuing airworthiness information (MCAI) issued by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The unsafe condition is incomplete closure of the main entry door, which may result in the door opening in flight, causing damage to

wing, fuselage, engine, and/or tail, and possible damage to the airplane. This AD requires actions that are intended to address the unsafe condition described in the MCAI.

**DATES:** This AD becomes effective February 15, 2007.

We must receive comments on this AD by March 2, 2007.

**ADDRESSES:** You may send comments by any of the following methods:

- DOT Docket Web Site: Go to <http://dms.dot.gov> and follow the instructions for sending your comments electronically.
- Fax: (202) 493-2251.
- Mail: Docket Management Facility, U.S. Department of Transportation, 400 Seventh Street, SW., Nassif Building, Room PL-401, Washington, DC 20590-0001.
- Hand Delivery: Room PL-401 on the plaza level of the Nassif Building, 400 Seventh Street, SW., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.
- Federal eRulemaking Portal: <http://www.regulations.gov>. Follow the instructions for submitting comments.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://dms.dot.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone (800) 647-5227) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Mike Borfitz, Aerospace Engineer, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98057-3356; telephone (425) 227-2677; fax (425) 227-1149.

**SUPPLEMENTARY INFORMATION:**

**Streamlined Issuance of AD**

The FAA is implementing a new process for streamlining the issuance of ADs related to MCAI. This streamlined process will allow us to adopt MCAI safety requirements in a more efficient manner and will reduce safety risks to the public. This process continues to follow all FAA AD issuance processes to meet legal, economic, Administrative Procedure Act, and **Federal Register** requirements. We also continue to meet our technical decision-making responsibilities to identify and correct unsafe conditions on U.S.-certificated products.

This AD references the MCAI and related service information that we considered in forming the engineering basis to correct the unsafe condition. The AD contains text copied from the MCAI and for this reason might not follow our plain language principles.

#### Discussion

The Civil Aviation Authority of Israel (CAAI), which is the aviation authority for Israel, has issued Israeli Airworthiness Directive 52-06-11-08, dated November 28, 2006 (referred to after this as "the MCAI"), to correct an unsafe condition for the specified products. The unsafe condition is incomplete closure of the main entry door, which may result in the door opening in flight, causing damage to wing, fuselage, engine, and/or tail, and possible damage to the airplane. The MCAI requires amending the airplane flight manuals to include additional procedures for verifying complete closure and locking of the main entry door. You may obtain further information by examining the MCAI in the AD docket.

#### FAA's Determination and Requirements of This AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, they have notified us of the unsafe condition described in the MCAI and service information referenced above. We are issuing this AD because we evaluated all the information provided by the State of Design Authority and determined the unsafe condition exists and is likely to exist or develop on other products of the same type design.

#### Differences Between the AD and the MCAI or Service Information

We have reviewed the MCAI and related service information and, in general, agree with their substance. But we might have found it necessary to use different words from those in the MCAI to ensure the AD is clear for U.S. operators and is enforceable. In making these changes, we do not intend to differ substantively from the information provided in the MCAI and related service information.

We might also have required different actions in this AD from those in the MCAI in order to follow FAA policies. Any such differences are described in a separate paragraph of the AD. These requirements take precedence over the actions copied from the MCAI.

#### FAA's Determination of the Effective Date

An unsafe condition exists that requires the immediate adoption of this AD. The FAA has found that the risk to the flying public justifies waiving notice and comment prior to adoption of this rule because there have been two incidents of main entry doors opening in flight, both at relatively low altitude and airspeeds. Since it cannot be shown the airplane can continue safe operation and return to the nearest airport after such an event in any phase of flight, we have determined that loss of an airplane is possible unless immediate actions are taken. Therefore, we determined that notice and opportunity for public comment before issuing this AD are impracticable and that good cause exists for making this amendment effective in fewer than 30 days.

#### Comments Invited

This AD is a final rule that involves requirements affecting flight safety, and we did not precede it by notice and opportunity for public comment. We invite you to send any written relevant data, views, or arguments about this AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2007-27077; Directorate Identifier 2006-NM-286-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this AD. We will consider all comments received by the closing date and may amend this AD because of those comments.

We will post all comments we receive, without change, to <http://dms.dot.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this AD.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, part A, subpart III, section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for

safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We determined that this AD would not have federalism implications under Executive Order 13132. This AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
3. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this AD and placed it in the AD docket.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

#### Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

2. The FAA amends § 39.13 by adding the following new AD:

**2007-03-05 Gulfstream Aerospace LP (Formerly Israel Aircraft Industries, Ltd.):** Amendment 39-14916. Docket No. FAA-2007-27077; Directorate Identifier 2006-NM-286-AD.

#### Effective Date

(a) This airworthiness directive (AD) becomes effective February 15, 2007.

#### Affected ADs

(b) None.

#### Applicability

(c) This AD applies to Gulfstream Model Gulfstream 100 airplanes; and Model Astra SPX and 1125 Westwind Astra airplanes;

certificated in any category; all serial numbers.

#### Reason

(d) The unsafe condition is incomplete closure of the main entry door, which may result in the door opening in flight, causing damage to wing, fuselage, engine, and/or tail, and possible damage to the airplane. The mandatory continuing airworthiness information (MCAI) requires amending the airplane flight manuals to include additional procedures for verifying complete closure and locking of the main entry door.

#### Actions and Compliance

(e) Unless already done, do the following actions. Within 10 days after the effective date of this AD, amend section IV, Normal Procedures, of the following Gulfstream airplane flight manuals (AFMs): Model 1125 Astra, 25W-1001-1; Model Astra SPX, SPX-1001-1; and Model G100, G100-1001-1; as applicable; to include the following statement. Insertion of copies of this AD at the appropriate places of the AFMs is acceptable.

“1. BEFORE ENGINE START: (PRE and POST Mod 20052/Gulfstream Service Bulletin 100-31-284): CABIN DOOR—CLOSED (Physically verify door latch handle pin is fully engaged in the handle lock).

2. BEFORE TAXIING: Change the CABIN DOOR procedure as follows (POST Mod 20052/Gulfstream Service Bulletin 100-31-284): Check CABIN DOOR light—OUT.

3. BEFORE TAKE-OFF: Insert between the POSITION lights switch and the THRUST LEVERS procedures: (PRE Mod 20052/Gulfstream Service Bulletin 100-31-284): Check CABIN DOOR light—OUT (50% N1 may be required).

(POST Mod 20052/Gulfstream Service Bulletin 100-31-284): Check CABIN DOOR light—OUT; CABIN DOOR SEAL light—OUT (50% N1 may be required).”

**Note 1:** Mod 20052 is equivalent to Gulfstream Service Bulletin 100-31-284, dated August 17, 2006.

**Note 2:** This AD may be accomplished by a holder of a Private Pilot's License.

#### FAA AD Differences

**Note 3:** This AD differs from the MCAI and/or service information as follows: We revised the order in which the AFM procedures for verifying closure and locking of the main entry door appear in the MCAI. We also removed one procedure under “BEFORE TAXIING” for verifying the cabin door seal light is out (Post Mod 20052/Post Gulfstream Service Bulletin 100-31-284) and for verifying the cabin door light is out (Pre Mod 20052/Pre Gulfstream Service Bulletin 100-31-284).

#### Other FAA AD Provisions

(f) The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, Attn: Mike Borfitz, Aerospace Engineer, 1601 Lind Avenue, SW., Renton, Washington 98057-3356, has the

authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Before using any AMOC approved in accordance with § 39.19 on any airplane to which the AMOC applies, notify the appropriate principal inspector in the FAA Flight Standards Certificate Holding District Office.

(2) *Airworthy Product:* For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

(3) *Reporting Requirements:* For any reporting requirement in this AD, under the provisions of the Paperwork Reduction Act, the Office of Management and Budget (OMB) has approved the information collection requirements and has assigned OMB Control Number 2120-0056.

#### Related Information

(g) Refer to MCAI Israeli Airworthiness Directive 52-06-11-08, dated November 28, 2006, for related information.

#### Material Incorporated by Reference

(h) None.

Issued in Renton, Washington, on January 23, 2007.

**Ali Bahrami,**

*Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. E7-1397 Filed 1-30-07; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

**[Docket No. FAA-2007-27064; Directorate Identifier 2006-NM-274-AD; Amendment 39-14915; AD 2007-03-04]**

**RIN 2120-AA64**

#### **Airworthiness Directives; Airbus Model A330-200, A330-300, A340-200, A340-300, A340-500, and A340-600 Series Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule; request for comments.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for the products listed above. This AD results from mandatory continuing airworthiness information (MCAI) issued by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as cracking of the wing MLG

(main landing gear) rib 6 aft bearing forward lugs, which could result in reduced structural integrity of the MLG attachment. This AD requires actions that are intended to address the unsafe condition described in the MCAI.

**DATES:** This AD becomes effective February 15, 2007.

The Director of the Federal Register approved the incorporation by reference of certain publications listed in this AD as of February 15, 2007.

We must receive comments on this AD by March 2, 2007.

**ADDRESSES:** You may send comments by any of the following methods:

- *DOT Docket Web Site:* Go to <http://dms.dot.gov> and follow the instructions for sending your comments electronically.

- *Fax:* (202) 493-2251.

- *Mail:* Docket Management Facility, U.S. Department of Transportation, 400 Seventh Street, SW., Nassif Building, Room PL-401, Washington, DC 20590-0001.

- *Hand Delivery:* Room PL-401 on the plaza level of the Nassif Building, 400 Seventh Street, SW., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

- *Federal eRulemaking Portal:* <http://www.regulations.gov>. Follow the instructions for submitting comments.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://dms.dot.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone (800) 647-5227) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Tim Backman, Aerospace Engineer, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98057-3356; telephone (425) 227-2797; fax (425) 227-1149.

#### SUPPLEMENTARY INFORMATION:

##### Streamlined Issuance of AD

The FAA is implementing a new process for streamlining the issuance of ADs related to MCAI. This streamlined process will allow us to adopt MCAI safety requirements in a more efficient manner and will reduce safety risks to the public. This process continues to follow all FAA AD issuance processes to meet legal, economic, Administrative