# UNITED STATES DEPARTMENT OF THE INTERIOR MINERALS MANAGEMENT SERVICE GULF OF MEXICO REGION

### **ACCIDENT INVESTIGATION REPORT**

1. OCCURRED DATE: 15-AUG-2006 TIME: 1745 HOURS  2. OPERATOR: BP Exploration & Production Inc. REPRESENTATIVE: Teri Halverson TELEPHONE: (281) 221-5225 CONTRACTOR: REPRESENTATIVE: TELEPHONE:	STRUCTURAL DAMAGE  CRANE  OTHER LIFTING DEVICE  DAMAGED/DISABLED SAFETY SYS.  INCIDENT >\$25K  H2S/15MIN./20PPM  REQUIRED MUSTER  SHUTDOWN FROM GAS RELEASE  OTHER			
3. OPERATOR/CONTRACTOR REPRESENTATIVE/SUPERVISOR ON SITE AT TIME OF INCIDENT:	6. OPERATION:			
4. LEASE: 00133  AREA: GI LATITUDE: BLOCK: 47 LONGITUDE:  5. PLATFORM: C RIG NAME:	PRODUCTION DRILLING WORKOVER COMPLETION HELICOPTER MOTOR VESSEL PIPELINE SEGMENT NO. X OTHER Submerged Platform			
6. ACTIVITY:	8. CAUSE:			
DEVELOPMENT/PRODUCTION (DOCD/POD)  7. TYPE:  HISTORIC INJURY  REQUIRED EVACUATION  LTA (1-3 days)  LTA (>3 days  RW/JT (1-3 days)  RW/JT (>3 days)	EQUIPMENT FAILURE HUMAN ERROR EXTERNAL DAMAGE SLIP/TRIP/FALL WEATHER RELATED X LEAK UPSET H20 TREATING OVERBOARD DRILLING FLUID OTHER			
Other Injury	9. WATER DEPTH: 88 FT.			
FATALITY X POLLUTION FIRE EXPLOSION	10. DISTANCE FROM SHORE: 18 MI.			
LWC HISTORIC BLOWOUT UNDERGROUND	11. WIND DIRECTION: S SPEED: 10 M.P.H.			
SURFACE DEVERTER SURFACE EQUIPMENT FAILURE OR PROCEDURES	12. CURRENT DIRECTION: <b>s</b> SPEED: <b>5</b> M.P.H.			
COLLISION HISTORIC >\$25K <=\$25K	13. SEA STATE: <b>2</b> FT.			

MMS - FORM 2010 PAGE: 1 OF 5

#### Platform History:

The Grand Isle 47C platform is located 15 miles offshore and is one of the seven BP operated Shelf platforms downed in federal waters by Hurricane Katrina on August 29, 2005. As part of BP's initial hurricane response, over-flights were conducted as early as September 6, 2005. In addition, an ROV vehicle was mobilized for inspection of all of BP's downed platforms on October 20, 2005. Subsequently, a response vessel and crew was assigned 24/7 to the Grand Isle 40s field which has remained in action since January, 2006. The Gl-47C platform was built in 1957 and prior to Katrina was producing 991 BOPD. Prior to Katrina, there were 16 existing wells connected to the platform, of which only eight were producing with the remaining being PA'd.

#### History of Response:

From October 2005 through May 2006, intermittent releases from GI-47C had totaled 34 barrels. No additional releases were observed from the end of January through May 21, 2006. Beginning May 21, 2006 the frequency and magnitude of the releases have increased: 21 May-8 bbls; 9 June -3 bbls; and 29 Jun-5 bbls. On June 22, 2006, BP met with USCG MSU Morgan City in Morgan City to discuss the ongoing operation. On July 7, 2006, BP assembled a project team to function as a fit for purpose IMT to focus on GI-47C activities and to develop IAPs, which have been forwarded daily to the USCG. Two response vessels were tasked to monitor, contain, and recover all hydrocarbon releases 24/7 specifically from Gl-47C. On July 19, 2006 the Ocean Intervention One vessel arrived on site at Gl-47C for additional surveying utilizing mesotech, ROV, echoscope, video, sniffers, etc. On 12 and 15 August 2006, over-flights observed hydrocarbon releases of 11.5 and 25.6 bbls respectively. Both of these larger volume spills were successfully recovered & naturally dissipated with no impact to the coastline. The total volume of oil released and reported to MMS is 53.1 bbls.

A much larger, fully staffed and trained Incident Management Team (IMT) was activated as a precautionary measure on August 16, 2006 in response to the increasing frequency and magnitude of hydrocarbon releases. It will be in action until current operational risks are better understood and/or mitigated. This larger IMT is fully integrated with BP's Decommissioning and Downed Platform teams. Staffing for these teams has increased significantly to more than 150 relevant experts including: ICS trained IMT staff, marine well intervention and relief well experts from Wild Well Control Incorporated; decommissioning expertise from Winmar; O'Brien's. MSRC, and TRG spill responders, diving and ROV specialists; well experts visualization experts; and large sub-teams responsible for decommissioning the downed platforms.

BP has reported spills to the National Response Center (NRC), the Minerals Management Service (MMS), and United States Coast Guard (USCG). Given the recent releases, the frequency of communications with both agencies has increased.

#### Source Control:

Six vessels presently on site see complete list below.

#### Vessel Assets On Site:

Sea Horse V (Seacor) ID Vessel
Sea Horse VI (Seacor) - ID Vessel
Louisiana Responder (MSRC) - OSRV
Admiral (MSRC) - OSRV
Ocean Intervention I (Oceaneering) - ROV operations
Endeavor (Field Staging)

MMS - FORM 2010 PAGE: 2 OF 5

- OI 2 completed ROV work and successfully identified the well and source of the leak-C7.
- OI 1 is on location. Operations are scheduled to begin 30 August 2006.

Endeavor is In the Grand Isle area, available for logistics support (primary assignment is at GI-40)

Contingency:

Moana Wave has completed shallow hazard assessment work in support of relief well planning (if needed).

Collection dome construction 90% complete. (See Attached B)

18. LIST THE PROBABLE CAUSE(S) OF ACCIDENT:

Leaking casing valve on Well C-7

19. LIST THE CONTRIBUTING CAUSE(S) OF ACCIDENT:

Platform destroyed by Hurricane Katrina. (Submerged on bottom)

MMS - FORM 2010 PAGE: 3 OF 5

21. PROPERTY DAMAGED:

NATURE OF DAMAGE:

53.1 bbls of oil leaked from Well C-007 Platform destroyed by Hurricane Katrina from destroyed platform.

ESTIMATED AMOUNT (TOTAL):

22. RECOMMENDATIONS TO PREVENT RECURRANCE NARRATIVE:

No recommendations to MMS.

The New Orleans District concurs with BP's recommendation to prevent future pollution events from the C-007 Well.

- 1) BP has several Oil Spill Response Vessels 24/7 on location to collect all hydrocarbons released from Well C-007.
- 2) BP is currently constructing a Collection Dome to place over the leaking well.
- 3) BP is currently developing a Relief Well Contingency to drill relief well and conduct kill operations.
- 23. POSSIBLE OCS VIOLATIONS RELATED TO ACCIDENT: NO
- 24. SPECIFY VIOLATIONS DIRECTLY OR INDIRECTLY CONTRIBUTING. NARRATIVE:
- 25. DATE OF ONSITE INVESTIGATION:

15-AUG-2006

26. ONSITE TEAM MEMBERS:

Stephen Lucky /

29. ACCIDENT INVESTIGATION PANEL FORMED: NO

OCS REPORT:

30. DISTRICT SUPERVISOR:

Troy Trosclair

APPROVED

DATE: 09-NOV-2006

05-APR-2007

MMS - FORM 2010 PAGE: 4 OF 5

EV2010R

## **POLLUTION ATTACHMENT**

1.	VOLUME:	GAL	53.1	BBL			
		YARDS LONG X		YARDS WID	E		
	APPEARANCE:						
2.	TYPE OF HYDROCARE	ON RELEASED:	X OIL				
			DIES	EL			
			COND	ENSATE			
			HYDR	AULIC			
			□ NATU	RAL GAS			
			OTHE	R			
3.	SOURCE OF HYDROCA	RBON RELEASED	Casing	y valve on	Well C-007		
4.	WERE SAMPLES TAKE	N? <b>NO</b>					
5.	. WAS CLEANUP EQUIPMENT ACTIVATED? YES						
	IF SO, TYPE: X SKIMMER  X CONTAINMENT BOOM  ABSORPTION EQUIPMENT						
		DISPERSANTS					
	Ц	OTHER					
6.	ESTIMATED RECOVER	Υ:	GAL		4 BBL		
7.	RESPONSE TIME:	0 HOURS					
8.	. IS THE POLLUTION IN THE PROXIMITY OF AN ENVIRONMENTALLY SENSITIVE AREA (CLASS I)? NO						
9.	. HAS REGION OIL SPILL TASK FORCE BEEN NOTIFIED? YES						
10.	CONTACTED SHORE:	NO IF YE	ES, WHERE	:			
11.	. WERE ANY LIVE ANIMALS OBSERVED NEAR: NO						
12.	. WERE ANY OILED OR DEAD ANIMALS OBSERVED NEAR SPILL: NO						

MMS - FORM 2010 PAGE: 5 OF 5