



## **ATTACHMENT 2**

### **MAINTENANCE GROUP CHAIRMAN'S FACTUAL REPORT**

**DCA-07-MA-310**

**Field Maintenance Report (FMR) print out for N454AA**

AC 454 AA PIR.76	SYS 2210
MDIS.14SEP/STL T-0854 FO AP 2 LT INOP	EMPL 640150
FACT.14SEP/STL/TA RELAMPED THE FOS AP 2 BLUE ENGAGED LIGHT. OPS OKAY	EMPL 629611
45422E64C/2003.14SEP.STL	KQ NBR 1
▲ Update this Item ▲	
AC 454 AA PIR.82	SYS 2450
MDIS.17SEP/ORD T-9999 DC BUS OFF LIGHT ON	EMPL 026510
FACT.17SEP/ORD/TS T/S/S/ AND REPLACED RELAY R2-326. DC EMERG PWR XFER RELAY AND DC BUS OFF LITE OPS CKS NORMAL	EMPL 091084
45424E654/1052.17SEP.ORD	KQ NBR 2
▲ Update this Item ▲	
AC 454 AA PIR.62	SYS 2430
MDIS.06SEP/ORD T-2305 DC BUS OFF LIGHT ILLUMINATED	EMPL 137728
FACT.06SEP/ORD/TS CYCLED POWER FAULT RESET OPS NML	EMPL 133275
45424E637/0729.06SEP.ORD	KQ NBR 3
▲ Update this Item ▲	
AC 454 AA PIR.97	SYS 2520
	G/M 01.5 A/M 00.0 G/TIME 01.5
MDIS.25SEP/STL T-9999 WINDOW SHADE AT 8A BROKEN	EMPL 683904
DFRL.1 /25SEP/STL /TA RSN. GT	EMPL 683904
INFO.2 /25SEP/STL DEFERRED WINDOW SHADE AGT SEATG 8A ENTERED ON MIC SHEET.RMVD WINDOW SHADE FROM AIRCRAFT. DEFERRAL REF 25-99T AUTH NBR 9-8437-C	EMPL 683904
FACT.25SEP/DFW/NC REPLACED WINDOW SHADE ASSY AT SEAT 8A. REMOVED PDL 9-8437*C, CLEARED MIC SHEET	EMPL 138069
45425E66E/1306.25SEP.STL	KQ NBR 4
▲ Update this Item ▲	
AC 454 AA TFI.	SYS 2520
	KWRD MISC PART. POSN 8 A PRI 2
MEL PRIORITY CODE GRN	
MDIS.25SEP/STL PDL 09-9437-C REF.2599T MISSING OR BROKEN MISCELLANEOUS PART.... WINDOW SHADE DAMAGED	EMPL MELINT
PART.25SEP/TTS 1 CPN REVR004 QTY 1 VERIFY CORRECT PARTS PER THE IPC	EMPL 159280
INFO.1 /26SEP/DFW ***** MEL 099437 CLEARED ON 25SEP AT DFW	EMPL 581839
ATBT.25SEP/TUL NAME M. D. ANDERSON	EMPL 159280
1 REPLACE WINDOW SHADE AS PER FINDINGS. CLEAR MIC	
2 SHEET.	

FACT.25SEP/DFW/NC  
REPLACED WINDOW SHADE ASSY AT SEAT 8A. REMOVED PDL  
9-8437\*C, CLEARED MIC SHEET  
45425E66D/1029.25SEP.TUL  
EMPL 138069  
KQ NBR 5

▲ Update this Item ▲

AC 454 AA PIR.96  
SYS 2520

MDIS.22SEP/DFW T-1783  
LONG STRIP BELOW O/H BIN 20AB IS LOOSE  
EMPL CREW

FACT.22SEP/DFW/TA  
SECURED CKS OK  
45425E66C/2123.22SEP.PHX  
EMPL MECH  
KQ NBR 6

▲ Update this Item ▲

AC 454 AA PIR.93  
SYS 2521

MDIS.21SEP/DFW T-1315  
SEAT 9D WONT STAY UPRIGHT  
EMPL 089279

FACT.21SEP/DFW/TH  
SEAT 9D CHECKS OK  
45425E669/0739.22SEP.DFW  
EMPL 120727  
KQ NBR 7

▲ Update this Item ▲

AC 454 AA PIR.91  
SYS 2530

MDIS.20SEP/LAX T-0379  
LATCH BROKEN ON GARBAGE BIN AT AFT LH GALLEY  
POSITION  
EMPL 052440

FACT.20SEP/LAX/TA  
ADJUSTED LATCH OPS CKS NORMAL  
45425E664/1442.20SEP.LAX  
EMPL 142047  
KQ NBR 8

▲ Update this Item ▲

AC 454 AA PIR.77  
SYS 2530

MDIS.14SEP/STL T-0854  
AFT GALLEY STATION 472 LONG TOOTH ON CART SECURING  
DEVICE STICKY  
EMPL 640150

FACT.14SEP/STL/DC  
LUBED CART SECURITY ARM OPS NORMAL  
45425E64D/2004.14SEP.STL  
EMPL 680455  
KQ NBR 9

▲ Update this Item ▲

AC 454 AA PIR.75  
SYS 2521

MDIS.14SEP/STL T-1419  
UPPER POUCH ON SEAT LOCK 5F HAS INBD SPRING BROKEN.  
EMPL 680696

DFRL.1 /14SEP/STL /TA RSN. GT  
INFO.2 /14SEP/STL  
EMPL 670370  
EMPL 670370

PLACARDED PER PDL 25-99T ENTERED ON MIC  
SHEET.DEFERRAL REF 25-99T AUTH NBR 9-9232-C

FACT.14SEP/STL/DC  
REPLACED UPPER SEAT POUCH ARM SPRING-OPS NORMAL  
45425E649/0743.14SEP.STL  
EMPL 680455  
KQ NBR 10

▲ Update this Item ▲

AC 454 AA TFI.  
SYS 2520

KWRD MISC PART. POSN 5F  
MEL PRIORITY CODE GRN  
PRI 2

MDIS.13SEP/STL EMPL MELINT  
PDL 09-9232-C REF.2599T  
MISSING OR BROKEN MISCELLANEOUS PART....  
MAGAZINE POCKET SPRING BROKEN.

PART.14SEP/TTS EMPL 536684  
1 CPN 4063978 QTY 1  
2 CPN 4063980 QTY 1  
3 CPN 4078096 QTY 4

INFO.1 /15SEP/STL EMPL 699280  
\*\*\*\*\*  
MEL 099232 CLEARED ON 14SEP AT STL

ATBT.14SEP/TUL NAME W. R. PROSCH EMPL 536684  
1 REPLACE THE LIT POCKET SPRING AS NECESSARY.

FACT.14SEP/STL/DC EMPL 680455  
REPLACED UPPER SEAT POUCH ARM SPRING OPS NORMAL  
45425E648/0713.14SEP.TUL KQ NBR 11

▲ Update this Item ▲

AC 454 AA PIR.73 SYS 2521

MDIS.13SEP/STL T-0819 EMPL 638255  
SEAT 9D WILL NOT STAY UP

FACT.13SEP/STL/TA EMPL 680482  
OPERATED SEAT 9D OPS CHECKED NORMAL  
45425E645/1313.13SEP.STL KQ NBR 12

▲ Update this Item ▲

AC 454 AA PIR.70 SYS 2532  
KWRD MAKER POSN G2 FORWARD  
ARM CODE: 25321002 MSG NBR: 02558943

MDIS.10SEP/LAX T-1519 EMPL 198853  
HOT WATER LIGHT OUT IN GALLEY CM NBR 1 F/C

FACT.10SEP/LAX/AC EMPL 433235  
RELAMPED F/C NBR 1 COFFEE MAKER OPS CHECKS OK.  
45425E63F/1928.10SEP.LAX KQ NBR 13

▲ Update this Item ▲

AC 454 AA PIR.68 SYS 2532  
KWRD MAKER POSN G1 FORWARD  
ARM CODE: 25321001 MSG NBR: 02558941

MDIS.10SEP/LAX T-1519 EMPL 198853  
HOT WATER LIGHT ON CM NBR 1 AFT GALLEY

FACT.10SEP/LAX/AC EMPL 433235  
RELAMPED F/C NBR 1 COFFEE MAKER OPS CHECKS OK.  
45425E63D/1926.10SEP.LAX KQ NBR 14

▲ Update this Item ▲

AC 454 AA PIR.67 SYS 2521  
ARM CODE: 2521431D MSG NBR: 02558940

MDIS.10SEP/LAX T-1519 EMPL 198853  
SEAT 31D WILL NOT STAY UPRIGHT

FACT.10SEP/LAX/AC EMPL 566773  
SEAT RECLINE AT 31D ADJUSTED AND OPS CK GOOD. SEAT  
OK FOR SVC.  
45425E63C/1926.10SEP.LAX KQ NBR 15

▲ Update this Item ▲

AC 454 AA PIR.66 SYS 2521  
 MDIS.10SEP/LAX T-1519 EMPL 198853  
 ARMREST AT 22A BROKEN  
 FACT.10SEP/LAX/AC EMPL 566773  
 REPLACED ARMREST CAP AT SEAT 22A AS REQUIRED. SEAT  
 OK FOR SERVICE.  
 45425E63B/1925.10SEP.LAX KO NBR 16

▲ Update this Item ▲

AC 454 AA PIR.61 SYS 2521  
 ARM CODE: 2521422E MSG NBR: 02558934  
 MDIS.03SEP/SMF T-1827 EMPL 049537  
 22E SEAT BACK WILL NOT RECLINE  
 INFO.1 /03SEP/SMF EMPL CONTR  
 DEFERRED SEAT 22E SEAT BACK PER MEL 25-16B AUTH 9  
 241C C ENTERED IN MIC SHEET  
 FACT.04SEP/DFW/TA EMPL 111147  
 ADJUSTED SEAT RECLINE 22E/OPS GOOD REMOVED DEV  
 9-241C-C 25-16B CLEARED MIC  
 45425E636/1742.03SEP.SMF KO NBR 17

▲ Update this Item ▲

AC 454 AA MEL. SYS 2521  
 KWRD PSGR SEAT. POSN 22E PRI 2  
 MEL PRIORITY CODE YLW  
 MDIS.03SEP/SMF EMPL MELINT  
 MEL 09-241C-C REF.2516B  
 PSGR SEAT SECURED UPRIGHT \*DEGRADED\*.....  
 RECLINE INOP - SEATBACK SECURED UPRIGHT  
 PART.03SEP/TTS EMPL 684820  
 1 CPN 4136907 QTY 1  
 2 CPN 4065559 QTY 1  
 3 CPN 4063530 QTY 1  
 POSSIBLE PARTS. CHECK IPC FOR EFFECTIVITY AND  
 APPLICABILITY.  
 INFO.1 /04SEP/DFW EMPL 443898  
 \*\*\*\*\*  
 MEL 090241 CLEARED ON 04SEP AT DFW  
 ATBT.03SEP/TUL NAME J. D. BARTHELMS EMPL 684820  
 1 MAKE A THOROUGH CHECK OF THE SEAT RECLINE CABLE  
 2 ASSEMBLY AND THE HYDROLOCK. REPLACE ANY SUSPECT  
 3 PARTS. ENSURE RECLINE MECHANISM PROPERLY ADJUSTED.  
 4 REF MM 25-23-04-1  
 FACT.04SEP/DFW/TA EMPL 111147  
 ADJUSTED SEAT RECLINE 22E/OPS GOOD REMOVED DEV  
 9-241C-C 25-16B CLEARED MIC  
 45425E635/1914.03SEP.TUL KO NBR 18

▲ Update this Item ▲

AC 454 AA TFI. SYS 2520  
 KWRD MISC PART. POSN CAPT PRI 2  
 MEL PRIORITY CODE GRN  
 MDIS.31AUG/SFO EMPL MELINT  
 PDL 08-9635-C REF.2599T  
 MISSING OR BROKEN MISCELLANEOUS PART....  
 CAPT SEAT CUSHION WORN-USABLE  
 PART.31AUG/TTS EMPL 509921

1	CPN 4016636	QTY	1		
INFO.1	/01SEP/LAX			EMPL	352147
	*****				
	MEL 089635 CLEARED ON 31AUG AT LAX				
ATBT.	31AUG/TUL	NAME	L. R. CANTRELL	EMPL	509921
1	REPLACE THE CAPT SEAT BOTTOM CUSHION AS REQUIRED.				
FACT.	31AUG/LAX/NC			EMPL	350845
	REMOVED AND REPLACED CAPTS SEAT CUSHION REMOVED				
	PLACARD CLEAR MIC.				
45425E632/0540.	31AUG.TUL	KQ NBR		19	
▲ Update this Item ▲					
AC	454 AA PIR.60			SYS	2510
MDIS.	30AUG/SFO T-1575			EMPL	CREW
	CAPTS SEAT CUSHION IS VERY HARD. NO CUSHION.				
INFO.1	/30AUG/SFO			EMPL	433286
	DEFERRED PER PDL 25-99T AUTH 8-9645-C ENTERED IN				
	MIC. REQUIRES CPN 4016636				
FACT.	31AUG/LAX/NC			EMPL	350845
	REMOVED AND REPLACED CAPTS SEAT CUSHION REMOVED				
	PLACARD CLEAR MIC.				
45425E630/0146.	31AUG.SFO	KQ NBR		20	
▲ Update this Item ▲					
AC	454 AA PIR.59			SYS	2561
MDIS.	30AUG/DFW T-0670			EMPL	CREW
	SLIDE FELL OUT OF PACK ON FWD CABIN ENTRY DOOR.				
FACT.	30AUG/DFW/TA	EMPL-2	122503	EMPL	142438
	INSTALLED SERVICABLE SLIDE PACK L1 DOOR.				
45425E62F/0144.	31AUG.SFO	KQ NBR		21	
▲ Update this Item ▲					
AC	454 AA PIR.58			SYS	2561
MDIS.	30AUG/AUS T-9999			EMPL	MECH
	L-1 DOOR SLIDE LANYARD CABLE BROKEN.				
FACT.	30AUG/AUS/TA			EMPL	329380
	/REPLACED LANYARD.				
45425E62E/0143.	31AUG.SFO	KQ NBR		22	
▲ Update this Item ▲					
AC	454 AA TFI.			SYS	2620
		POSN	BOTH		
MDIS.	29SEP/TUL	**TECH LIST**		EMPL	650017
	REF OTS ACFT FIRE BOTTLES FIRED DUE LH FIRE				
PART.	29SEP/TTS			EMPL	650017
	1 CPN EXT5288	QTY	2		
ATBT.	29SEP/TUL	NAME	J. M. DICIOLOLA	EMPL	650017
1	CHECK EACH BOTTLE CONNECTORS AND VISIBLE WIRING..				
2	IF OK THEN REPLACE BOTH FIRE BOTTLES AND CHECK				
3	SYSTEM. REF MM 26-20-01-2.				
45426E67A/1947.	29SEP.TUL...DFRD-	1 DAYS		KQ NBR	23
▲ Update this Item ▲					
AC	454 AA PIR.88			SYS	2760
MDIS.	18SEP/TUL T-9999			EMPL	054490
	MAINT ENTRY SPOILER CONTROL SHUTOFF VALVE LEAKING				

L/H WHEEL WELL.

FACT.18SEP/TUL/0922 EMPL 054490  
REPLACED SPOILER CONTROL SHUTOFF VALVE.OPS CK LK  
CK. OK.  
45427E65D/0358.19SEP.TUL KQ NBR 24

▲ Update this Item ▲

AC 454 AA TFI. SYS 2899

MDIS.28SEP/TUL EMPL 091705

\*\*\*\*\*FLEET MANAGERS REQUEST\*\*\*\*\*  
DUE TO THE INCREASE OF MICROBIAL GROWTH WITHIN THE  
MD80 FUEL TANKS.  
\*\*\*MINIMUM OF 8 HOURS OF DWELL TIME REQUIRED\*\*\*

ATBT.28SEP/TUL NAME D. L. BIGLER EMPL 091705

1 \*\*\*\*\*MANDATORY, DO NOT DEVIATE\*\*\*\*\*  
2 ACCOMPLISH MCM SECTION 5 WORK CARD 0926.

3

4 DO NOT ACCOMPLISH THE CARD UNLESS A MINIMUM OF 8  
5 HOURS OF DWELL TIME FOR KATHON TO SIT IN TANKS IS  
6 AVAILABLE.

7

8 ENTER INTO THE FMR THE DWELL TIME KATHON WAS IN  
9 TANKS. CREDIT FOR THIS CARD WILL NOT BE ISSUED  
10 UNLESS DWELL TIME IS ENTERED AND TIME IS 8 HOURS OR  
11 GREATER.

45428E676/2052.28SEP.TUL...DFRD- 2 DAYS KQ NBR 25

▲ Update this Item ▲

AC 454 AA PIR.64 SYS 2845

MDIS.08SEP/DFW T-0339 EMPL 094185

RT WING TANK HAS 7000# FUEL WITH FUEL IN CENTER  
TK.

FACT.08SEP/DFW/TH EMPL 105598

BALANCED FUEL VERIFIED VTO SHUTOFF GND CKS OK.

45428E639/1221.08SEP.DFW KQ NBR 26

▲ Update this Item ▲

AC 454 AA PIR.63 SYS 2901

MDIS.07SEP/DFW T-9999 EMPL 056762

MAINT ENTRY: FLEET SERVICE REPORTS, POSSIBLE  
HYDRAULIC LEAK CENTER GEAR AREA

FACT.07SEP/DFW/NC EMPL 130782

REMOVED AND REPLACED RT GROUND SPOILER HYD P LINE.  
BORROWED FROM A/C NO 208. BORROWED PARTS TAG  
#109176. OPS AND LEAK CKS GOOD

45429E638/1834.07SEP.DFW KQ NBR 27

▲ Update this Item ▲

AC 454 AA PIR.56 SYS 2988

POSN L/H

ARM CODE: 29320101 MSG NBR: 02958922

MDIS.29AUG/AUS T-1629 EMPL 093980

LEFT HYDRAULIC QUANTITY READS OFF SCALE HIGH WITH  
PUMPS OFF

FACT.29AUG/AUS/DC EMPL 329380

BLD LH HYDRAULIC RESEROIR SERVICED TO FULL

45429E62A/2210.29AUG.AUS KQ NBR 28

▲ Update this Item ▲

AC 454 AA TFI. SYS 3130  
POSN DFDR DOWN PRI 1

MDIS.28SEP/TUL \*\*TECH LIST\*\* EMPL 650017

\*\*\*\*\*ENGINEERING REQUEST\*\*\*\*\*

ACCOMPLISH THE FOLLOWING MCM CARD FOR ENGINEERING  
EVALUATION.

PART.28SEP/TUL EMPL 650017

1 CPN TES9468 QTY 1

ATBT.28SEP/TUL NAME J. M. DICIOLLA EMPL 650017

1 ACCOMPLISH MCM SECTION 12 CARD 31-92-11 AND PERFORM  
2 FLIGHT DATA RECORDER DOWNLOAD AND UPLOAD TO THE RDS  
3 SYSTEM PER CARD.

UPDT.28SEP/TUL NAME J. M. DICIOLLA EMPL 650017

4 AIRCRAFT CAN NOT FLY UNTIL ENGINEERING HAS REVIEWED  
5 DOWNLOAD AND ISSUED APPLICABLE BILL OF WORK AND  
6 THAT BILL OF WORK IS COMPLIED WITH.

45431E675/1448.28SEP.TUL...DFRD- 2 DAYS KQ NBR 29

▲ Update this Item ▲

AC 454 AA PIR.90 SYS 3150

MDIS.20SEP/AUS T-9999 EMPL 113008

MASTER CAUTION WARNING DOES NOT ILLUMINATE DURING  
ENG FIRE TEST.

FACT.20SEP/AUS/DC EMPL 113008

REMOVED AND REPLACED MASTER CAUTION CONTROL BOX OPS  
CHECKS GOOD.

45431E661/0838.20SEP.AUS KQ NBR 30

▲ Update this Item ▲

AC 454 AA PIR.84 SYS 3260

MDIS.17SEP/TUL T-2001 EMPL 168241

ONE BULB BURNED OUT IN LEFT MAIN LANDING GEAR.

FACT.17SEP/TUL/TA EMPL 074948

REPLACED DEFECTIVE LAMPS IN LEFT LANDING GEAR  
ANNUNCIATOR. OPS CK GOOD IAW MM.

45432E656/1156.17SEP.TUL KQ NBR 31

▲ Update this Item ▲

AC 454 AA PIR.99 SYS 3310

POSN L/H

ARM CODE: 33101801 MSG NBR: 03358994

G/M 00.5 A/M 00.0 G/TIME 00.5

MDIS.26SEP/DFW T-1342 EMPL 013770

CAPTS BRIEFCASE LIGHT INOP.

FACT.26SEP/DFW/NC EMPL 507851

RELAMPED BRIEF CASE LIGHT OPS CK OK.

45433E672/2153.26SEP.DFW KQ NBR 32

▲ Update this Item ▲

AC 454 AA PIR.98 SYS 3320

ARM CODE: 33206108 MSG NBR: 03358993

MDIS.26SEP/DFW T-1619 EMPL 017126

ONE BULB IN RIGHT AFT LAV INOP

FACT.26SEP/DFW/TA EMPL MECH

RELAMPED OPS CHECK GOOD



45433E671/2104.26SEP.DFW	KQ NBR	33
▲ Update this Item ▲		
AC 454 AA PIR.95	SYS	3325
MDIS.21SEP/IAD T-1710	EMPL	CREW
30E READ LIGHT INOP		
FACT.21SEP/IAD/TA	EMPL	MECH
RELAMPED OPS CK OK		
45433E66B/2121.22SEP.PHX	KQ NBR	34
▲ Update this Item ▲		
AC 454 AA PIR.92	SYS	3325
MDIS.20SEP/LAX T-0379	EMPL	052440
READING LIGHT OUT AT F/A AFT JUMPSEAT		
FACT.20SEP/LAX/TA	EMPL	142047
RELAMPED LIGHT ASSY OPS CKS NORMAL		
45433E665/1444.20SEP.LAX	KQ NBR	35
▲ Update this Item ▲		
AC 454 AA PIR.85	SYS	3340
ARM CODE: 33401201	MSG NBR:	03358967
MDIS.17SEP/TUL T-0684	EMPL	089359
BOTH LEFT WING WHITE NAV LIGHTS BURNED OUT.		
FACT.17SEP/TUL/TA	EMPL	074948
FOUND UPPER LAMP LOOSE, SECURED AND OPS CK GOOD PER MM.		
45433E657/1234.17SEP.TUL	KQ NBR	36
▲ Update this Item ▲		
AC 454 AA TFI.	SYS	3325
MEL PRIORITY CODE YLW	PRI	2
MDIS.10SEP/LAX	EMPL	MELINT
PDL 09-9183-C	REF.	3399A
PSGR SEAT READING LIGHT *SEAT DEGRADED*.		
NO SMOKING LIGHT INOP		
PART.11SEP/TTS	EMPL	612562
1 CPN LIGR007	QTY	1
INFO.1 /12SEP/STL	EMPL	679008
*****		
MEL 099183 CLEARED ON 11SEP AT STL		
ATBT.11SEP/TUL NAME S. CONLEY	EMPL	612562
1 RELAMP OR REPLACE LIGHT ASSY PER YOUR FINDINGS.		
FACT.11SEP/STL/DC	EMPL	673036
REPLACED NO SMOKING SEAT BELT LENS ASSY CKD OPS		
FOUND NORMAL NO SMOKING SIDE PREV DEACTIVATED		
CLEARED MIC SHEET		
45433E641/0642.11SEP.TUL	KQ NBR	37
▲ Update this Item ▲		
AC 454 AA PIR.71	SYS	3320
ARM CODE: 33205001	MSG NBR:	03358944
MDIS.10SEP/LAX T-1519	EMPL	198853
GALLEY LIGHT F/C - OUT		

FACT.10SEP/LAX/AC EMPL 433235  
RELAMPED F/C GALLEY OPS CHECKS NML.  
45433E640/1929.10SEP.LAX KQ NBR 38

▲ Update this Item ▲

AC 454 AA PIR.69 SYS 3320

MDIS.10SEP/LAX T-1519 EMPL 198853

PSU NO SMOKING SIGN PLACARD MISSING AT SEAT 31DEF

PART.10SEP/LAX EMPL 521717

1 CPN LIGR007 QTY 1

DFRL.1 /10SEP/LAX /TA RSN. NS EMPL 521717

INFO.2 /10SEP/LAX EMPL 521717

DEFERED NO SMOKING SIGN PLACARD DUE TO NO STOCK IN  
LAX. DEFERAL REF. 33-99A AUTH NBR 9-9183-C ITEM  
ENTERED IN MIC SHEET.

FACT.11SEP/STL/DC EMPL 673036

REPLACED NO SMOKING SEAT BELT LENS ASSY CKD OPS  
FOUND NORMAL NO SMOKING SIDE PREV DEACTIVATED  
CLEARED MIC SHEET

45433E63E/1927.10SEP.LAX KQ NBR 39

▲ Update this Item ▲

AC 454 AA PIR.65 SYS 3320

MDIS.10SEP/LAX T-1519 EMPL 198853

LAV LIGHT OUT IN RT AFT LAV

FACT.10SEP/LAX/AC EMPL 433235

RELAMPED RT AFT LAV OPS CHECKS NML.

45433E63A/1924.10SEP.LAX KQ NBR 40

▲ Update this Item ▲

AC 454 AA PIR.87 SYS 3510

MDIS.18SEP/ORD T-2329 EMPL 089611

FLT CREW O2 BOTTLE PRESSURE LOW

FACT.18SEP/ORD/TS EMPL 054457

REPLACED CREW O2 BOTTLE LEAK CK O.K..

45435E65B/1340.18SEP.ORD KQ NBR 41

▲ Update this Item ▲

AC 454 AA PIR.74 SYS 3520

MDIS.13SEP/STL T-0819 EMPL 638255

THE PANEL THAT HOUSES THE AFT FA-S O2 MASK CAME OFF  
AND WOULD NOT STAY ON.

FACT.13SEP/STL/TA EMPL 680482

REINSGTALLED COVER TO AFT F-AS O2 MASK

45435E646/1314.13SEP.STL KQ NBR 42

▲ Update this Item ▲

AC 454 AA PIR.81 SYS 4910

MDIS.16SEP/ORD T-1311 EMPL 086068

MAINT ENTRY: FOUND APU BLEED VALVE NOT FULLY  
OPENING

DFRL.1 /16SEP/ORS /TS RSN. RR EMPL 086060

INFO.2 /16SEP/ORD EMPL 086060

PLAC APU AIR INOP PER MEL 49-8 AUTH  
9-1353DC-CENTERED ON MIC SHEET

FACT.16SEP/ORD/DC EMPL 084596  
REPLACED TRA 5159 ON APU OPS AND LKS CKS GOOD.  
REMOVED DEVIATION MEL REF 49-8. AUTH 9-1353DC-C.  
CLEARED MIC SHEET  
45449E652/0128.17SEP.ORD KQ NBR 43

▲ Update this Item ▲

AC 454 AA MEL. SYS 4910  
KWRD VALVE..... POSN APU AIR PRI 2  
MEL PRIORITY CODE YLW

MDIS.16SEP/ORD EMPL MELINT  
MEL 09-1353DC-C REF.4908  
APU BLEED AIR VALVE \*GRD AIR REQD\*.....  
LOW APU AIR PRESS.

PART.16SEP/TTS EMPL 536684  
1 CPN VAL5836 QTY 1  
2 CPN 5937909 QTY 1  
3 CPN TRA5159 QTY 1

INFO.1 /17SEP/ORD EMPL 037285  
\*\*\*\*\*  
MEL 091353 CLEARED ON 16SEP AT ORD

ATBT.16SEP/TUL NAME W. R. PROSCH EMPL 536684  
1 REVIEW LOGBOOK AND PERFORM FAULT REVIEW ON  
2 APU ECU, USING MCM SEC 12 CARD 49-96-92,  
3 TROUBLESHOOT  
4 AND REPAIR PER FINDINGS..

FACT.16SEP/ORD/DC EMPL 084596  
REPLACED TRA 5159 ON APU OPS AND LK CKS GOOD.  
REMOVED DEVIATION MEL REF 49-8 AUTH 9-1353 CLEARED  
MIC SHEET  
45449E64F/1318.16SEP.TUL KQ NBR 44

▲ Update this Item ▲

AC 454 AA PIR.94 SYS 5250

MDIS.21SEP/DFW T-1315 EMPL 089279  
FIRST CLASS LAV - RING AROUND LOCK LATCH LOOSE

FACT.21SEP/DFW/TH EMPL 120727  
SECURED RING AT F/C LAV LOCK LATCH, CHECKS OK  
45452E66A/0740.22SEP.DFW KQ NBR 45

▲ Update this Item ▲

AC 454 AA TFL. SYS 5399  
PRI 4

MDIS.13SEP/TUL EMPL 482896  
\*\*\*\*\*ENGINEERING REQUEST\*\*\*\*\*  
\*\*\*\*\*B-CHECK ITEM ONLY\*\*\*\*\*

DFRL.3 /18SEP/TUL /0922 RSN. RR EMPL 115457  
INFO.4 /23SEP/LGA EMPL 673903

INSPECTED LOWER WING TO BODY FILLET PANELS FOUND NO  
SCRATCHES AND CREASES

DFRL.5 /24SEP/LGA /IS RSN. RR EMPL 494625  
INFO.6 /24SEP/LGA EMPL 494625

CONT DFRL TO NEXT B-CK  
ATBT.13SEP/TUL NAME J. E. HARDEE EMPL 482896

1 INSPECT LOWER WING TO BODY FILLET PANELS FOR ANY  
2 POSSIBLE SCRATCHES OR CREASES. CONTACT TECH  
3 SERVICES WITH FINDINGS.

45453E647/1402.13SEP.TUL...DFRD- 17 DAYS KQ NBR 46

▲ Update this Item ▲

AC 454 AA TFI. POSN LH SYS 5400

MDIS.29SEP/TUL \*\*TECH LIST\*\* EMPL 650017  
INSPECT PYLON DUE TO FIRE

ATBT.29SEP/TUL NAME J. M. DICIOLOLA EMPL 650017

- 1 REQUEST QA INSPECTION IN ADDITION TO REQUIRED
- 2 INSPECTION FOR ENGINE CHANGE PER MCM 05-96-13.
- 3 OBSERVE MCM SECTION 8 CARD 8451. BEYOND CHECKS FOR
- 4 STRUCTURAL CONCERNS CHECK FOR FIRE DAMAGE TO
- 5 WIRING..CONNECTORS.. TUBING ETC. DOCUMENT YOUR
- 6 FINDINGS INT THE FMR.

45454E679/1911.29SEP.TUL...DFRD- 1 DAYS KO NBR 47

▲ Update this Item ▲

AC 454 AA TFI. POSN L/H ENG SYS 7110  
PRI 1

MDIS.29SEP/TUL \*\*TECH LIST\*\* EMPL 344018  
REPLACE L/H ENGINE PYLON APRON ASSEMBLY DUE  
TO HEAT DAMAGE.

PART.29SEP/TUL EMPL 344018

- |   |             |     |   |
|---|-------------|-----|---|
| 1 | CPN APR3003 | QTY | 1 |
| 2 | CPN 5541096 | QTY | 4 |

ATBT.29SEP/TUL NAME S. R. ITAK EMPL 344018

- 1 DUE TO FIRE DAMAGE REPLACE L/H ENGINE APRON
- 2 ASSEMBLY PER M/M 71-10-04-2. SRM 57-30-01
- 3 REF IPC 71-10-06-05

45471E67C/2036.29SEP.TUL...DFRD- 1 DAYS KO NBR 48

▲ Update this Item ▲

AC 454 AA TFI. POSN LH SYS 7110  
PRI 1

MDIS.29SEP/TUL \*\*TECH LIST\*\* EMPL 650017  
REPLACE COWL ACCESS DOORS UPPER AND LOWER

PART.29SEP/TTS EMPL 650017

- |   |             |     |   |
|---|-------------|-----|---|
| 1 | CPN COW3002 | QTY | 1 |
| 2 | CPN COW3004 | QTY | 1 |
| 3 | CPN COW3006 | QTY | 1 |

ATBT.29SEP/TUL NAME J. M. DICIOLOLA EMPL 650017

- 1 DUE TO FIRE DAMAGE REPLACE ALL THREE COWL DOORS.
- 2 REF MM 71-10-03-2-1

45471E677/1901.29SEP.TUL...DFRD- 1 DAYS KO NBR 49

▲ Update this Item ▲

AC 454 AA TFI. POSN 1 SYS 7290

MDIS.29SEP/FOE EMPL ENGRMV

SHUTDOWN NBR 1 ENG ON 29SEP AT STL.  
REASON - SHUTDOWN

TSI - 5339  
TSV - 5339

INFO.1 /30SEP/FOE EMPL ENGRMV

120  
S/D 120LH ENGINE FIRE, START VALVE OPEN LIGHT ON..

FACT.29SEP/FOE/XX EMPL ENGRMV

CPN/SERIAL NBR S/D ENG3327/ 725872

45472E67B/2034.29SEP.TUL KO NBR 50

▲ Update this Item ▲

AC 454 AA TFI. SYS 7200

LT START VALVE REPLACE NO HELP  
 PART.27SEP/TTS EMPL 071625  
 1 CPN 5725996 QTY 1  
 2 CPN 5460085 QTY 2  
 INFO.1 /27SEP/DFW EMPL 091747  
 REPCD LT ENG START VLV NO HELP PLACARDED LT ENG START  
 VLV INOP PER MEL VLV OPENED & VERIFIED CLOSED PER  
 MPM.  
 ATBT.27SEP/TUL NAME T. J. LACKMAN EMPL 071625  
 1 SUGGEST TROUBLESHOOT WIRING. REF WDM 74-11-00  
 2 START VALVE HAS BEEN REPLACED REF MM  
 3 80-10-02-2.CHECK OPERATION OF VALVE REPAIR PER  
 4 YOUR FINDING.  
 5 \*\*\* NOTE START VALVE REPLACE IN DFW 27/SEPT/07  
 6 AND IN ORD 16/SEPT/07  
 7 START VALVE SWITCH REPLACE IN SEPT/19/07  
 45480E673/0901.27SEP.TUL...DFRD- 3 DAYS KQ NBR 55

▲ Update this Item ▲

AC 454 AA PIR.86 \*\*ALERT\*\* SYS 8000  
 MDIS.17SEP/ORD T-2333 EMPL 089359  
 LEFT ENGINE START VALVE WILL NOT OPEN  
 INFO.1 /17SEP/ORD EMPL 165219  
 REF 80-2 AUTH 9-1455C-C PLACARDED LEFT ENG START  
 VALVE INOP PER MEL. ENTERED IN MIC SHEET  
 INFO.2 /17SEP/DFW EMPL 300005  
 REPLACED START VALVE, NO HELP, FOUND AIR FILTER  
 (CPN 5463619) NOT ALLOWING AIR FLOW TO VALVE.  
 PART NIS AT DFW. CONTINUE DEFERRAL TULSA TECH  
 NOTIFIED.  
 DFRL.3 /17SEP/ORD /PS RSN. FT EMPL 113145  
 INFO.4 /17SEP/ORD EMPL 113145  
 432399/ REMOVED AND REPLACED 8TH STAGE CHECK VALVE  
 AND AIR FILTER FOR START VALVE. ON INITIAL START  
 SEQUENCE W/ APU AIR ON. START VALVE WONT OPEN.  
 AFTER CYCLNG START SWITCH THE SECOND TIME, START  
 VALVE OPENS AND ENGINE STARTS TURNING. ONLY HAPPENS  
 WHEN APU AIR SWITCH IS INITIALLY TURNED ON W/ 0  
 DUCT PRESSURE  
 FACT.18SEP/TUL/0922 EMPL 127531  
 STARTED L/H ENG SEVERAL TIMES. COULD NOT DUPLICATE.  
 START VALVE OPERATED NORMAL. OK FOR SERVICE. RMVD  
 PLACARD AND CLEARED MIC SHEET.  
 45480E659/1641.17SEP.ORD KQ NBR 56

▲ Update this Item ▲

AC 454 AA MEL. \*\*ALERT\*\* SYS 8000  
 KWRD VALVE..... POSN LEFT PRI 2  
 MEL PRIORITY CODE YLW  
 MDIS.17SEP/ORD EMPL MELINT  
 MEL 09-1455C-C REF.8002  
 ENGINE START VALVE.....  
 PART.17SEP/TTS EMPL 612562  
 1 CPN VAL6256 QTY 1  
 INFO.1 /17SEP/DFW EMPL 300005  
 REPLACED START VALVE, NO HELP, FOUND AIR FILTER  
 (CPN 5463619) NOT ALLOWING AIR FLOW TO VALVE.  
 PART NIS AT DFW. CONTINUE DEFERRAL TULSA TECH  
 NOTIFIED.  
 DFRL.2 /17SEP/ORD /PS RSN. FT EMPL 113145  
 INFO.3 /17SEP/ORD EMPL 113145

432389/ ATBT ACCOMPLISHED . NO HELP. NEEDS FURTHER  
T/S..  
INFO.4 /19SEP/TUL EMPL 127505  
\*\*\*\*\*

MEL 091455 CLEARED ON 18SEP AT TUL  
ATBT.18SEP/TUL NAME S. CONLEY EMPL 612562  
1 FIELD REPORTS LT ENG START SWITCH REQUIRES  
2 ENGAGEMENT TWICE TO OPEN START VALVE EVENTHOUGH APU  
3 AIR RAMPS UP TO 40 PSI.REF WDM 74-11-00 PG 557 AND  
4 WDM 49-31-01 PG 516 SHT 3. REMOVE APU ECU AND DISC  
5 STARTER PLUG P1-838 AND MEG WIRING FROM C/B B1-1 TO  
6 PIN A OF PLUG P1-838 AND PIN B10 OF ECU PLUG  
7 R5-604A. THE START SIGNAL SPLITS FROM TERMINAL  
8 BLOCK S3-48 AND GOES TO BOTH STARTER AND ECU.

FACT.18SEP/TUL/0922 EMPL 127531  
STARTED L/H ENG SEVERAL TIMES, COULD NOT DUPLICATE  
START VALVE OPERATED NORMAL , OK FOR SERVICE. RMVD  
PLACARD AND CLEARED MIC SHEET.  
45480E658/1543.17SEP.TUL KQ NBR 57

▲ Update this item ▲

AC 454 AA PML.89 \*\*ALERT\*\* SYS 8000  
KWRD VALVE..... POSN LH PRI 2  
MEL PRIORITY CODE YLW

MDIS.19SEP/ORD T-1548 \*DOD\* EMPL 093693  
LEFT ENGINE START VALVE WOULD NOT OPEN UNTIL THE  
FOURTH ATTEMPT.  
\*\*\*\*\* MEL DATA \*\*\*\*\*  
MEL 09-1672C-C REF.8002  
ENGINE START VALVE.....  
WONT OPEN

DFRL.1 /19SEP/ORD /TA RSN. FT EMPL-2 055300 EMPL 164808  
INFO.2 /19SEP/ORD EMPL 164808  
55300/DEFERED LEFT ENGINE STARTER SHUT OFF VALVE  
MAINT PER MEL ENTERED ON MIC SHEET. MPM 80-2  
ACCOMPLISHED.

INFO.3 /20SEP/AUS EMPL 340702  
\*\*\*\*\*  
MEL 091672 CLEARED ON 19SEP AT AUS  
ATBT.19SEP/TUL NAME J. H. HAMILTON EMPL 462616  
1 PREVIOUS HISTORY.2 VALVES REPLACED, NO HELP...  
2 TROUBLESHOOT WIRING PER WDM 74-11-00.REPAIR AS  
3 REQUIRED.

FACT.19SEP/AUS/DC EMPL 329380  
/REPLACED #1 ENGINE START SWITCH AND START VALVE.  
OPS CKS OK. LK CK OK. REMOVED PLACARD CLEARED MIC.  
45480E65F/1726.19SEP.TUL KQ NBR 58

▲ Update this item ▲

AC 454 AA PIR.79 \*\*ALERT\*\* SYS 8000  
MDIS.16SEP/TPA T-0214 EMPL 680624  
LH START VALVE WILL NOT OPEN

FACT.16SEP/TPA/TS EMPL 629413  
REPLACED LEFT ENG START VALVE - OPS NORMAL  
45480E650/0125.17SEP.ORD KQ NBR 59

▲ Update this item ▲

AC 454 AA PIR.80 \*\*ALERT\*\* SYS 8000

MDIS.16SEP/ORD T-1311

EMPL 027111

REPORT WRITE UP #79 LEFT START VALVE WILL NOT  
OPEN

FACT.16SEP/ORD/TS

EMPL 086060

REMOVED & REPLACED #1 ENG START VALVE PER M/M  
START VALVE OPERATION NORMAL

45480E651/0126.17SEP.ORD

KQ NBR 60

▲ Update this Item ▲

	POSN LH	PRI 1
MDIS.29SEP/TUL	**TECH LIST**	EMPL 650017
REPLACE LH ENGINE		
PART.29SEP/TTS		EMPL 650017
1 CPN ENG3327	QTY 1	
ATBT.29SEP/TUL	NAME J. M. DICIOLOLA	EMPL 650017
1 REPLACE THE LH ENGINE. OBSERVE MCM 71-91-99.		
UPDT.29SEP/TUL	NAME J. M. DICIOLOLA	EMPL 650017
2 ***IMPORTANT***REPLACE MOUNTS PRECAUTIONARY AND		
3 CONE BOLTS. CHECK YOKES AND MOUNT FOR THE ISOLATORS		
4 FOR DAMAGE.		
45472E678/1907.29SEP.TUL...DFRD-	1 DAYS	KQ NBR 51
▲ Update this Item ▲		
AC 454 AA TFI.		SYS 7290
DSN 717354	POSN 2	
MDIS.18SEP/FOE		EMPL ENGRMV
REPLACED NBR 2 ENG ON 18SEP AT TUL.		
REMOVAL REASON - TIME		
TSI	- 8202	
TSV	- 19072	
INFO.1 /19SEP/FOE		EMPL ENGRMV
040 TIME - LIFE LIMITED PART		
LIFE LIMITED PART		
FACT.18SEP/FOE/XX		EMPL ENGRMV
CPN/SERIAL NBR OFF	ENG3327/ 717354	
SERIAL NBR ON	709934	
45472E65C/0034.19SEP.TUL		KQ NBR 52
▲ Update this Item ▲		
AC 454 AA PIR.72		SYS 7399
MDIS.12SEP/LAX T-0793		EMPL CREW
INFO TO MAINT: LEFT EGT ENGINE REACHED 470 DEGREES		
ON START IN LAS.		
FACT.12SEP/LAX/TA		EMPL 142047
INFO NOTED EGT WITHIN LIMTS PER MM.		
45473E642/1443.12SEP.LAX		KQ NBR 53
▲ Update this Item ▲		
AC 454 AA PIR.57		SYS 7988
	POSN L/H	
ARM CODE: 79010001		MSG NBR: 07958923
MDIS.29AUG/AUS T-1629		EMPL 093980
LEFT ENGINE NEEDS OIL SERVICE		
FACT.29AUG/AUS/DC		EMPL 329380
SERVICED LEFT ENGINE OIL TO FULL		
45479E62B/2211.29AUG.AUS		KQ NBR 54
▲ Update this Item ▲		
AC 454 AA PML. 1 **ALERT**		SYS 8000
DSN 19SEP/3 **REPEAT**KWRD VALVE.....	POSN LT	PRI 2
MEL PRIORITY CODE YLW		
MDIS.27SEP/DFW T-2328		EMPL 092651
LEFT START VLV DID NOT OPEN ON ENGINE START.		
***** MEL DATA *****		
MEL 09-2293C-C		REF.8002
ENGINE START VALVE.....		