

USCG Activity Summary Report

Five (5) pages total including this cover



Activity Summary Report

Title: EXPRESS SHUTTLE II - 4TH ANNUAL INSP
 Activity ID: 1996809
 Activity Start Time: 10/05/2004 7:00:00 AM
 Originating Unit: MSO Tampa
 Owner Unit: MSO Tampa
 Controlling Unit: MSO Tampa
 Activity Type: Vessel Inspection/PSC
 Team Lead:
 Status: Open - Submitted for Review
 Status Date: 10/12/2004
 Prompt Date:
 Subject POC: CHRIS CONNER (727) 919-8954
 Vessel Name: EXPRESS SHUTTLE II
 VIN: 1053146

Vessel Owner/Operator:

=====

Owning Organization Name
 PARADISE OF PORT RICHEY INC - Unknown
Address **City** **State** **Zip** **Country** **Province**
 6520 RIDGE RD PORT RICHEY FL 34668 US
Operating Organization Name
 PARADISE OF PORT RICHEY INC - Unknown
Address **City** **State** **Zip** **Country** **Province**
 6520 RIDGE RD PORT RICHEY FL 34668 US

Activities Conducted:

=====

Type	Date	Unit
Annual Inspection	10/05/04	MSO Tampa

Inspection Results

=====

System	Date	Results
Accommodation/Occupational Safety	10/05/04	Outstanding Deficiencies Exist
Communications	10/05/04	Inspected Satisfactory
Construction/Loadline	10/05/04	Outstanding Deficiencies Exist
Deck/Cargo	10/05/04	Inspected Satisfactory
Documentation	10/05/04	Inspected Satisfactory
Electrical	10/05/04	Outstanding Deficiencies Exist
Engineering	10/05/04	Outstanding Deficiencies Exist
Fire Fighting	10/05/04	Inspected Satisfactory
Lifesaving	10/05/04	Outstanding Deficiencies Exist
Navigation	10/05/04	Outstanding Deficiencies Exist
Operations/Management	10/05/04	Inspected Satisfactory
Personnel	10/05/04	Inspected Satisfactory
Stability	10/05/04	Inspected Satisfactory

Inspection Results - Deficiencies

=====

ITEM	COMPLIANCE DATE	DATE ISSUED	DATE RESOLVED
1	10/12/2004	10/05/2004	
SYSTEM	SUBSYSTEM	COMPONENT	
Accommodation/Occupational Safety		Other Accommodation Spaces	Open Deck
Space			

---Description---

Provide a placard with the max passenger amount for second deck IWO aft ladder.

Inspection Results - Deficiencies
(Continued)

ITEM	COMPLIANCE DATE	DATE ISSUED	DATE RESOLVED
10	10/12/2004	10/05/2004	
SYSTEM Electrical	SUBSYSTEM Lighting (service)	COMPONENT Lighting Fixture	
---Description---			
Provide a light cover for light in E/R.			
11	10/12/2004	10/05/2004	
SYSTEM Lifesaving	SUBSYSTEM Lifejacket/PFD (General)	COMPONENT Storage	
---Description---			
Label life preserver location with the size and amount.			
12	10/12/2004	10/05/2004	
SYSTEM Lifesaving	SUBSYSTEM Lifejacket/PFD (General)	COMPONENT Quantity	
---Description---			
Remove all child (16total) life preservers, w/labels from vessel. Vsl COI states no children allowed. Vsl rep will remove.			
13	11/05/2004	10/05/2004	
SYSTEM Engineering	SUBSYSTEM Bilge Water Management System	COMPONENT Strainer	
---Description---			
Provide strainers for bilge pick-up lines as per 46CFR182.25.5(b).			
14	11/05/2004	10/05/2004	
SYSTEM Electrical	SUBSYSTEM Electric Supply System (service)	COMPONENT Cable	
---Description---			
Secure wires and remove dead-ended wires as needed throughout vessel.			
2	10/05/2004	10/05/2004	10/05/2004
SYSTEM Navigation	SUBSYSTEM Collision/Grounding Avoidance	COMPONENT Navigation Lights	
---Description---			
Prior to night time operation, repair stern light.			
3	11/05/2004	10/05/2004	
SYSTEM Lifesaving	SUBSYSTEM Lifefloat	COMPONENT Serviceable	
---Description---			
Replace or repair 03 L/F's as discussed.			
4	11/05/2004	10/05/2004	
SYSTEM Lifesaving	SUBSYSTEM Lifefloat	COMPONENT Lifeline	
---Description---			
Replace tag lines on all L/F's as needed.			
5	10/12/2004	10/05/2004	
SYSTEM Construction/Loadline	SUBSYSTEM Penetrations	COMPONENT Flange Pad	
---Description---			
Reseal cleat backing plates in store room and fuel oil room.			

Inspection Results - Deficiencies
(Continued)

ITEM	COMPLIANCE DATE	DATE ISSUED	DATE RESOLVED
6	10/12/2004	10/05/2004	
SYSTEM	SUBSYSTEM	COMPONENT	
Accommodation/Occupational Safety Space		Other Accommodation Spaces	Open Deck

---Description---

Provide a support beam or repair 2nd deck overhead.

ITEM	COMPLIANCE DATE	DATE ISSUED	DATE RESOLVED
7	10/05/2004	10/05/2004	10/05/2004
SYSTEM	SUBSYSTEM	COMPONENT	
Engineering	Diesel Engine (propulsion-reduction gear)	Piping (exhaust)	

---Description---

Prior to the carriage of passengers, repair water leak from STBD engine, outboard, and PORT engine inboard water cooled exhaust pipe.

ITEM	COMPLIANCE DATE	DATE ISSUED	DATE RESOLVED
8	10/12/2004	10/05/2004	
SYSTEM	SUBSYSTEM	COMPONENT	
Electrical	Electric Supply System (service)	Battery Installation	

---Description---

Repair and properly mount engine battery switches.

ITEM	COMPLIANCE DATE	DATE ISSUED	DATE RESOLVED
9	10/12/2004	10/05/2004	
SYSTEM	SUBSYSTEM	COMPONENT	
Accommodation/Occupational Safety		Occupational Safety	Guards for Exposed Hazards

---Description---

Provide safety shields for both PORT and STBD PTO's.

Documents and Certificates:

(none)

Narrative Summary:

EXPRESS SHUTTLE II - 4TH ANNUAL INSPECTION

14 CG-835's ISSUED
02 CG-835's CLEARED
12 CG-835'S REMAIN OUTSTANDING

Vsl type: () Dinner Cruise () Dive Boat () Parasail Boat (X) Excursion Boat
() Charter () Fish Boat () Aux. Sail, night sail (Y/N) () Other = ()

Hull: () STL (X) FRP () AL () Wood

Type: (X) Mono () Cat () Pontoon () Other ()

Number of Decks: 2

Propulsion/NO.: (X) IB () OB () I/O () Single (X) Twin () Gas (X) Diesel

Length: 65 Build Date: 18JUL97 GTON: 43

Route: LC

Location: New Port Richey Certificates Issued: None

(N) Owner/Operator change from COI/COD

Items retained for TAMMS file:

1. CG-840 BOOK
2. CG-835
3. 7th District Abbreviated DAPI audit
4. Vessel risk assessment

Attending Inspector(s): CWO3 Lawrence & Kirsch

Comments:

05OCT04: Attended vessel for the purpose of conducting the 4th annual inspection. Met with vsI rep and explained the scope of inspection. Inspected documentation, certificates, and licenses, ALL SAT. Company DAPI audit was conducted on 31AUG04. Inspected navigational equipment and publications, SAT. Inspected NAV lights, UNSAT. Stern light was out, but replaced by time we departed. Inspected life floats, UNSAT. Issued an 835 to replace 3 out of 4. Badly damaged from normal wear. Also replace tag lines as needed on all L/F's. Issued another 835 to support the top deck where the L/F's are stored. They had cut the overhang to remove engines, but the repair failed and the overhang is cracked down the middle. In heavy seas, this could give way and fall on passengers. Inspected EPIRB and float lights, SAT. Inspected flares, first-aid kit and CPR cards, SAT. Inspected life jackets, UNSAT. They still have 16 child size jackets on board and the COI states none. Vsl rep wanted to remove jackets. Inspected fixed smoke detection system, SAT. Inspected portable fire extinguishers, ALL SAT. inspected installed FFFE system, SAT. Tested all bilge high level alarms, SAT. Tested installed bilge pumping system by pumping out AFT void. Couldn't get system to pump until mate pulled check valve off at the end of pipe in bilge. That's when I noticed that the system has no strainers to prevent the check valves from getting clogged. Issued an 835 to provide strainers for all bilge pick-up tubes. Inspected all voids. Issued an 835 to reseal the bolts that hold the deck cleats on via a backing plate. Issued an 835 to commence cleaning up loss and dead-ended wires. Issued an 835 to repair battery switches. They are placed up-side down and the covers are coming off, which could cause shock or a fire. Inspected and tested all engines, UNSAT. Issued an 835 to provide covers for PTO's and repair exhaust water leaks. Just at idle, water was leaking from the exhaust pipe where the rubber flex pipe starts. Crew had leaks repaired prior to our departure. Discussed and walked through drills, SAT. Issued 14 835's, cleared 02 prior to departure, w/12 remaining outstanding. Case closed.

//s// CWO3 R. Lawrence, MSO Tampa

Activity Action Log:

Eff. Date	Unit	Individual	Description
10/04/2004 SHUTTLE II	MSO Tampa	Lawrence, Robert G.	Subject Changed from NESSE to EXPRESS
10/04/2004 Pending"	MSO Tampa	Lawrence, Robert G.	Status Changed to "Open - Scheduled, Action
10/04/2004 Pending"	MSO Tampa	Lawrence, Robert G.	Status Changed to "Open - Scheduled, Action
10/12/2004 Pending"	MSO Tampa	Lawrence, Robert G.	Status Changed to "Open - Scheduled, Action
10/12/2004 Review"	MSO Tampa	Lawrence, Robert G.	Status Changed to "Open - Submitted for