

Information and Regulatory Affairs of OMB.

#### List of Subjects in 10 CFR Part 50

Antitrust, Classified information, Criminal penalties, Fire protection, Intergovernmental relations, Nuclear power plants and reactors, Radiation protection, Reactor siting criteria, Reporting and recordkeeping requirements.

■ For the reasons set forth in the preamble and under the authority of the Atomic Energy Act of 1954, as amended; the Energy Reorganization Act of 1974, as amended; and 5 U.S.C. 552 and 553, the NRC is adopting the following amendments to 10 CFR part 50.

#### PART 50—DOMESTIC LICENSING OF PRODUCTION AND UTILIZATION FACILITIES

■ 1. The authority citation for part 50 continues to read as follows:

**Authority:** Secs. 102, 103, 104, 105, 161, 182, 183, 186, 189, 68 Stat. 936, 937, 938, 948, 953, 954, 955, 956, as amended, sec. 234, 83 Stat. 444, as amended (42 U.S.C. 2132, 2133, 2134, 2135, 2201, 2232, 2233, 2236, 2239, 2282); secs. 201, as amended, 202, 206, 88 Stat. 1242, as amended, 1244, 1246 (42 U.S.C. 5841, 5842, 5846).

Section 50.7 also issued under Pub. L. 95–601, sec. 10, 92 Stat. 2951 (42 U.S.C. 5841). Section 50.10 also issued under secs. 101, 185, 68 Stat. 955, as amended (42 U.S.C. 2131, 2235); sec. 102, Pub. L. 91–190, 83 Stat. 853 (42 U.S.C. 4332). Sections 50.13, 50.54(dd), and 50.103 also issued under sec. 108, 68 Stat. 939, as amended (42 U.S.C. 2138). Sections 50.23, 50.35, 50.55, and 50.56 also issued under sec. 185, 68 Stat. 955 (42 U.S.C. 2235). Sections 50.33a, 50.55a, and Appendix Q also issued under sec. 102, Pub. L. 91–190, 83 Stat. 853 (42 U.S.C. 4332). Sections 50.34 and 50.54 also issued under sec. 204, 88 Stat. 1245 (42 U.S.C. 5844). Sections 50.58, 50.91, and 50.92 also issued under Pub. L. 97–415, 96 Stat. 2073 (42 U.S.C. 2239). Section 50.78 also issued under sec. 122, 68 Stat. 939 (42 U.S.C. 2152). Sections 50.80 and 50.81 also issued under sec. 184, 68 Stat. 954, as amended (42 U.S.C. 2234). Appendix F also issued under sec. 187, 68 Stat. 955 (42 U.S.C. 2237).

■ 2. In § 50.33, paragraph (f)(2) is revised to read as follows:

#### § 50.33. Contents of applications; general information.

\* \* \* \* \*

(f) \* \* \*

(2) If the application is for an operating license, the applicant shall submit information that demonstrates the applicant possesses or has reasonable assurance of obtaining the funds necessary to cover estimated operation costs for the period of the license. The applicant shall submit estimates for total annual operating

costs for each of the first five years of operation of the facility. The applicant shall also indicate the source(s) of funds to cover these costs. An applicant seeking to renew or extend the term of an operating license for a power reactor need not submit the financial information that is required in an application for an initial license. Applicants to renew or extend the term of an operating license for a nonpower reactor shall include the financial information that is required in an application for an initial license.

\* \* \* \* \*

■ 3. Section 50.76 is added to read as follows:

#### § 50.76. Licensee's change of status; financial qualifications.

An electric utility licensee holding an operating license (including a renewed license) for a nuclear power reactor, no later than seventy-five (75) days prior to ceasing to be an electric utility in any manner not involving a license transfer under § 50.80, shall provide the NRC with the financial qualifications information that would be required for obtaining an initial operating license as specified in § 50.33(f)(2). The financial qualifications information must address the first full five years of operation after the date the licensee ceases to be an electric utility.

Dated at Rockville, Maryland, this 26th day of January 2004.

For the Nuclear Regulatory Commission.

Annette L. Vietti-Cook,

Secretary of the Commission.

[FR Doc. 04–1942 Filed 1–29–04; 8:45 am]

BILLING CODE 7590–01–P

#### DEPARTMENT OF TRANSPORTATION

#### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. 2002–NM–82–AD; Amendment 39–13444; AD 2004–02–09]

RIN 2120–AA64

#### Airworthiness Directives; McDonnell Douglas Model DC–9–81 (MD–81), DC–9–82 (MD–82), DC–9–83 (MD–83), DC–9–87 (MD–87), and MD–88 Airplanes

**AGENCY:** Federal Aviation Administration, DOT.

**ACTION:** Final rule.

**SUMMARY:** This amendment adopts a new airworthiness directive (AD), applicable to certain McDonnell Douglas Model DC–9–81 (MD–81), DC–9–82 (MD–82), DC–9–83 (MD–83), DC–

9–87 (MD–87), and MD–88 airplanes. This action requires a one-time visual inspection to determine if discrepant circuit breakers are installed, and corrective action if necessary. This action is necessary to prevent internal overheating and arcing of circuit breakers and airplane wiring due to long-term use and breakdown of internal components of the circuit breakers, which could result in smoke and fire in the flight compartment and main cabin. This action is intended to address the identified unsafe condition.

**DATES:** Effective March 5, 2004.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of March 5, 2004.

**ADDRESSES:** The service information referenced in this AD may be obtained from Boeing Commercial Aircraft Group, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Data and Service Management, Dept. C1–L5A (D800–0024). This information may be examined at the Federal Aviation Administration (FAA), Transport Airplane Directorate, Rules Docket, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

**FOR FURTHER INFORMATION CONTACT:** Elvin K. Wheeler, Aerospace Engineer, Systems and Equipment Branch, ANM–130L, FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California 90712–4137; telephone (562) 627–5344; fax (562) 627–5210.

**SUPPLEMENTARY INFORMATION:** A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) to include an airworthiness directive (AD) that is applicable to certain McDonnell Douglas Model DC–9–81 (MD–81), DC–9–82 (MD–82), DC–9–83 (MD–83), DC–9–87 (MD–87), and MD–88 airplanes was published in the **Federal Register** on May 23, 2003 (68 FR 28175). That action proposed to require a one-time visual inspection to determine if discrepant circuit breakers are installed, and corrective action if necessary.

#### Comments

Interested persons have been afforded an opportunity to participate in the making of this amendment. Due consideration has been given to the comments received.

### Support for Proposed AD

One commenter concurs with the proposed AD.

### Request To Delay Rule Until Certain Part Numbers (P/N) Are Removed From Manufacturer's Parts List

The other commenter, an operator, requests that the final rule not be released until the Wood Electric circuit breaker P/Ns are removed from Boeing's Approved Equivalent Parts List. The commenter states that Boeing should ensure that the affected parts are purged from the Boeing specification part stock, with the supporting documentation reflecting only acceptable parts. The commenter further states that the Wood Electric circuit breaker P/Ns are still approved to the Boeing specification numbers listed in the referenced alert service bulletin as the parts to be installed for the terminating action specified in the proposed AD. The commenter asserts that this will increase the possibility that the discrepant circuit breakers may still be installed on airplanes in the future.

We do not agree. We have confirmed with the manufacturer, Boeing, that it has revised the Approved Equivalent Parts List and inserted an "x" code by all Wood Electric circuit breakers. This prohibits those parts from being ordered and installed. The Wood Electric circuit breakers are no longer being manufactured and have been out of production for over twenty years, and, therefore, are no longer available from parts stock. Boeing Alert Service Bulletin MD80-24A194, Revision 01, dated March 11, 2003, referenced in this final rule, specifies that Wood Electric Corporation and Wood Electric Division of Potter Brumfield Corporation circuit breakers be replaced with currently approved circuit breakers. No change to this final rule is necessary.

### Conclusion

After careful review of the available data, including the comments noted above, the FAA has determined that air safety and the public interest require the adoption of the rule as proposed.

### Changes to 14 CFR Part 39/Effect on the AD

On July 10, 2002, the FAA issued a new version of 14 CFR part 39 (67 FR 47997, July 22, 2002), which governs the FAA's airworthiness directives system. The regulation now includes material that relates to altered products, special flight permits, and alternative methods of compliance. However, for clarity and consistency in this final rule, we have retained the language of the NPRM regarding that material.

### Increase in Labor Rate

After the proposed rule was issued, we reviewed the figures we use to calculate the labor rate to do the required actions. To account for various inflationary costs in the airline industry, we find it appropriate to increase the labor rate used in these calculations from \$60 per work hour to \$65 per work hour. The economic impact information, below, has been revised to reflect this increase in the specified hourly labor rate.

### Cost Impact

There are approximately 1,177 airplanes of the affected design in the worldwide fleet. The FAA estimates that 709 airplanes of U.S. registry will be affected by this AD, that it will take approximately 80 work hours per airplane to accomplish the required inspection of the circuit breakers (over 700 installed on each airplane), and that the average labor rate is \$65 per work hour. Based on these figures, the cost impact of the AD on U.S. operators is estimated to be \$3,686,800, or \$5,200 per airplane.

The cost impact figure discussed above is based on assumptions that no operator has yet accomplished any of the requirements of this AD action, and that no operator would accomplish those actions in the future if this AD were not adopted. The cost impact figures discussed in AD rulemaking actions represent only the time necessary to perform the specific actions actually required by the AD. These figures typically do not include incidental costs, such as the time required to gain access and close up, planning time, or time necessitated by other administrative actions.

### Regulatory Impact

The regulations adopted herein will not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this final rule does not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this action (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory

Flexibility Act. A final evaluation has been prepared for this action and it is contained in the Rules Docket. A copy of it may be obtained from the Rules Docket at the location provided under the caption **ADDRESSES**.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### Adoption of the Amendment

■ Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

■ 2. Section 39.13 is amended by adding the following new airworthiness directive:

#### 2004-02-09 McDonnell Douglas:

Amendment 39-13444. Docket 2002-NM-82-AD.

**Applicability:** Model DC-9-81 (MD-81), DC-9-82 (MD-82), DC-9-83 (MD-83), DC-9-87 (MD-87), and MD-88 airplanes; as listed in Boeing Alert Service Bulletin MD80-24A194, Revision 01, dated March 11, 2003; certificated in any category.

**Note 1:** This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (c) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

**Compliance:** Required as indicated, unless accomplished previously.

To prevent internal overheating and arcing of circuit breakers and airplane wiring due to long-term use and breakdown of internal components of the circuit breakers, which could result in smoke and fire in the flight compartment and main cabin, accomplish the following:

#### Inspection and Replacement, if Necessary

(a) Within 18 months after the effective date of this AD: Perform a one-time general visual inspection of the circuit breakers to determine if discrepant circuit breakers are installed (includes circuit breakers

manufactured by Wood Electric and Wood Electric Division of Brumfield Potter Corporations, and incorrect circuit breakers installed per Boeing Alert Service Bulletin MD80-24A194, dated February 19, 2002), per Boeing Alert Service Bulletin MD80-24A194, Revision 01, dated March 11, 2003.

**Note 2:** For the purposes of this AD, a general visual inspection is defined as: "A visual examination of an interior or exterior area, installation, or assembly to detect obvious damage, failure, or irregularity. This level of inspection is made from within touching distance unless otherwise specified. A mirror may be necessary to enhance visual access to all exposed surfaces in the inspection area. This level of inspection is made under normally available lighting conditions such as daylight, hangar lighting, flashlight, or droplight and may require removal or opening of access panels or doors. Stands, ladders, or platforms may be required to gain proximity to the area being checked."

(1) If no discrepant circuit breaker is found: No further action is required by this paragraph.

(2) If any discrepant circuit breaker is found: Before further flight, replace the circuit breaker with a new, approved circuit breaker, per the service bulletin.

#### Part Installation

(b) As of the effective date of this AD, no person shall install, on any airplane, a circuit breaker having a part number listed in the "Existing Part Number" column in the table specified in paragraph 2.C.2. of Boeing Alert Service Bulletin MD80-24A194, Revision 01, dated March 11, 2003.

#### Alternative Methods of Compliance

(c) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Los Angeles Aircraft Certification Office (ACO), FAA. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, Los Angeles ACO.

**Note 3:** Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the Los Angeles ACO.

#### Special Flight Permit

(d) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

#### Incorporation by Reference

(e) The actions shall be done in accordance with Boeing Alert Service Bulletin MD80-24A194, Revision 01, dated March 11, 2003. This incorporation by reference was approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained from Boeing Commercial Aircraft Group, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Data and Service Management,

Dept. C1-L5A (D800-0024). Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

#### Effective Date

(f) This amendment becomes effective on March 5, 2004.

Issued in Renton, Washington, on January 20, 2004.

**Kalene C. Yanamura,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 04-1913 Filed 1-29-04; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. 2003-NM-43-AD; Amendment 39-13441; AD 2004-02-06]

**RIN 2120-AA64**

**Airworthiness Directives; McDonnell Douglas Model DC-10-10, DC-10-10F, DC-10-15, DC-10-30, DC-10-30F, DC-10-30F (KC-10A- and KDC-10), DC-10-40, DC-10-40F, MD-10-10F, and MD-10-30F Airplanes; and Model MD-11 and MD-11F Airplanes**

**AGENCY:** Federal Aviation Administration, DOT.

**ACTION:** Final rule.

**SUMMARY:** This amendment adopts a new airworthiness directive (AD), applicable to certain McDonnell Douglas transport category airplanes. For certain airplanes, this amendment requires a general visual inspection to detect cracking in the nuts on the lower attach bolt assemblies of the forward attach bracket of the inboard flap outboard hinge, replacement of both upper and lower attach bolt assemblies with new bolts and nuts made from Inconel material, and replacement of certain preload-indicating (PLI) washers with new washers. For certain other airplanes, this amendment requires replacement of the lower attach bolt assemblies of the inboard forward attach bracket of the inboard flap outboard hinge with new bolts and nuts made from Inconel material, and replacement of PLI washers with new washers. This action is necessary to prevent separation of the inboard flap outboard hinge from the wing structure and consequent reduced controllability of the airplane.

This action is intended to address the identified unsafe condition.

**DATES:** Effective March 5, 2004.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of March 5, 2004.

**ADDRESSES:** The service information referenced in this AD may be obtained from Boeing Commercial Airplanes, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Data and Service Management, Dept. C1-L5A (D800-0024). This information may be examined at the Federal Aviation Administration (FAA), Transport Airplane Directorate, Rules Docket, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

#### FOR FURTHER INFORMATION CONTACT:

Ronald Atmur, Aerospace Engineer, Airframe Branch, ANM-120L, FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California 90712-4137; telephone (562) 627-5224; fax (562) 627-5210.

**SUPPLEMENTARY INFORMATION:** A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) to include an airworthiness directive (AD) that is applicable to certain McDonnell Douglas transport category airplanes was published in the **Federal Register** on September 30, 2003 (68 FR 56216). That action proposed to require, for certain airplanes, a general visual inspection to detect cracking in the nuts on the lower attach bolt assemblies of the forward attach bracket of the inboard flap outboard hinge, replacement of both upper and lower attach bolt assemblies with new bolts and nuts made from Inconel material, and replacement of certain preload-indicating (PLI) washers with new washers. For certain other airplanes, that action proposed to require replacement of the lower attach bolt assemblies of the inboard forward attach bracket of the inboard flap outboard hinge with new bolts and nuts made from Inconel material, and replacement of PLI washers with new washers.

#### Comments

Interested persons have been afforded an opportunity to participate in the making of this amendment. No comments were submitted in response to the proposal or the FAA's determination of the cost to the public.