

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2016**

Published June 2, 2016

CHILD SEATS:

Graco Children's Products Inc. (Graco) is recalling certain Graco TurboBooster booster seats, models 1967886, 1963973, 1963974, 1963975, 1963976, and 1975173, manufactured between December 22, 2015, and April 5, 2016. The instructions for the booster seats are missing the information that the seats should be securely belted to the vehicle at all times, even if the seat is unoccupied. As such, these seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems." In the event of a vehicle crash, an unoccupied and unsecured child restraint may strike other occupants and cause injury. Graco will notify registered owners and provide the missing printed instructions, free of charge. Non-registered owners can obtain the missing printed instructions by contacting Graco customer service at 1-800-345-4109. The recall is expected to begin on, or about, June 10, 2016.

16C-004

Kiddy USA (Kiddy) is recalling certain World Plus combination forward facing child restraints that convert to a high back booster seat, model 51 100 WP, manufactured from July 2, 2012, through October 5, 2013. The buckle/tongue on the affected booster seats may only partially engage. As a result, the consumer may have a false impression that the buckle is fully latched when it is not. As such, these seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems." A partially engaged buckle will not adequately restrain the child in the event of a crash, increasing the risk of injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Kiddy customer service at 1-855-92KIDDY (1-855-925-4339).

16C-005

EQUIPMENT:

Kraco Enterprises, LLC (Kraco) is recalling certain Who-Rae Butterfly Rose 3-pc seat cover kits manufactured October 1, 2015, to October 31, 2015 and sold through AutoZone stores. The packaging for the affected seat covers incorrectly states that they are acceptable for use in vehicles that have seat-mounted side air bags. However, the seat covers in the package do not have special side seams intended to allow for the correct deployment of seat-mounted side air bags upon return of the mispackaged seat covers. If the driver is in crash, the seat covers may prevent the side air bags from deploying properly, increasing the risk of injury. Kraco does not have a list of purchasers of the affected seat covers, and thus will not be mailing letters. Signage will be posted at AutoZone stores and owners may return the seat covers to the store for a full refund or a free set of seat covers suitable for use with seat-mounted side airbags. Owners may also contact Kraco customer service at 1-800-678-1910 for a free refund or a free set of seat covers suitable for use with seat-mounted side airbags.

16E-025

Robert Bosch LLC (Bosch) is recalling certain aftermarket replacement front brake pads, models Bosch QuietCast BC598 and BP765, Bosch Blue BE598 and BE598H, Prostop PD598 and PD765M, Duralast Gold DG598, Duralast MKD598, MKD765, Bosch Best D598, Stop Master ST598, UltraStop ULT598, UltraLife MX598 and MX765, BrakeBest MKD765, and Prostop Platinum PGD598. These brake pads, manufactured October 1, 2014, to October 31, 2015 are intended for use on 2001-2007 Ford Taurus, 2001-2005 Mercury Sable, 1995-1999 Ford Taurus SHO, 1995-2002 Lincoln Continental, and 1993-1998 Lincoln Mark VIII

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2016**

Published June 2, 2016

vehicles. These brake pads may shift out of position and damage or break the brake disc. A damaged or broken brake disc may reduce a vehicle's braking power or cause it to pull unexpectedly to one side while braking, increasing the risk of a crash. Bosch will instruct the owners how to have the affected brake pads replaced, free of charge. The recall began on May 26, 2016. Owners may contact Bosch customer service at 1-248-553-9000.

16E-026

Hale Products Inc. (Hale) is recalling certain 6 Inch Suction Strainers, part number 010-0030-00-0, manufactured July 15, 2015, to March 30, 2016. The affected strainers may have been improperly soldered leaving the strainer weak, which can cause the strainer to break and allow the strainer and debris to enter and possibly damage the fire pump. If the strainer and/or debris enters the pump, and the operator is forced to shut down the pump, there could be an increased risk of injury. Hale will replace the defective strainers with new strainers, next day air, free of charge. The recall began on April 20, 2016. Owners may contact Hale Products at 1-800-533-3569.

16E-027

Key Safety Systems, Inc. (KSS) is recalling certain Driver Frontal Air Bags, model ADI Dual, manufactured May 6, 2007, to January 29, 2016. These air bags may be missing a chemical enhancer required for the second stage deployment, resulting in the second stage deploying improperly in certain crashes. An air bag that inflates improperly increases the risk of injury. KSS will notify the vehicle manufacturers that purchased the affected air bags, and those manufacturers will notify owners and their dealers will replace the air bag module, free of charge. The recall began on April 1, 2016. Owners may contact KSS customer service at 1-586-726-3800.

16E-028

Hale Products Inc. (Hale) is recalling certain Portable Pumps powered with Yanmar 9 horsepower diesel engines, manufactured March 1, 2007, to December 11, 2015. These pumps may incorrectly identify the warning light on the dash panel to warn of low oil pressure when the warning light actually warns of low battery charge. If the operator shuts off the pump to add oil due to the mislabeled light, the pump may not restart due to having a weak battery. If the pump cannot be operated, fire suppression may be hindered, increasing the risk of injury. Hale will notify the purchasers of the pump and will provide a replacement label to affix over the oil warning icon on the pump panel. The manufacturer has not yet provided a notification schedule. Owners may contact Hale customer service at 1-800-533-3569.

16E-029

Advics North America, Inc. (Advics) is recalling certain ABS Brake Actuators manufactured October 12, 2015, to January 29, 2016. These actuators are made for Toyota vehicles as part numbers 44540-06260, 44540-06370, 44540-0E240, 44540-0E250, 44540-0E260, 44540-0E270, 44540-0E280, 44540-0E290, 44540-0E261, 44540-0E271, 44540-0R170, 44540-0R220, 44540-33450-A, 44540-33750-A, 44540-48430-A, 44540-48440-A, 44540-48620-A, 44540-48600-A, 44540-48610-A, 44540-48630-A, 44050-0R330, and for Nissan vehicles as part numbers 47660 5AA0C, 47660 5AE0C, and 47660 4RB0B. These ABS actuators may have been assembled with a gear pump containing a damaged O-ring resulting in a lack of brake fluid pressure. Insufficient brake fluid pressure may lengthen the distance needed to stop the vehicle, increasing the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2016**

Published June 2, 2016

risk of a crash. ADVICS has notified the vehicle manufacturers that purchased the brake actuators. Those manufacturers have filed recalls with NHTSA and will notify the affected owners. Dealers will inspect and replace the actuators, as necessary, free of charge. Owners may contact ADVICS customer service at 1-513-696-5450.

16E-030

Soaring Helmet Corporation (Soaring) is recalling certain Vega XTV 7400 helmets, sizes 2XS - 2XL, manufactured January 3, 2011, to February 24, 2012. The affected helmets may not adequately protect a user in the event of a head impact during a crash. As such, these helmets fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." Helmets that do not adequately protect the wearer increase their risk of injury in the event of a crash. Since the helmet purchasers are unknown, a notification will be placed on the Vega website. Retailers will exchange the helmets for a different Vega helmet or offer a refund, free of charge. Owners may contact Soaring at 1-425-656-0683.

16E-031

Soaring Helmet Corporation (Soaring) is recalling certain Vega CFS helmets, part number 7590, in all sizes, manufactured April 1, 2011, to April 29, 2011. The affected helmets may not adequately protect a user in the event of a head impact during a crash. As such, these helmets fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." Helmets that do not adequately protect the wearer increase their risk of injury in the event of a crash. Since the helmet purchasers are unknown, a notification will be placed on the Vega website. Retailers will exchange the helmets for a different Vega helmet or offer a refund, free of charge. Owners may contact Soaring at 1-425-656-0683.

16E-032

Soaring Helmet Corporation (Soaring) is recalling certain Stealth Phantom helmets, part numbers 8300 and 8351, in sizes extra small through XXL, in all sizes and graphics, manufactured April 1, 2013, to December 30, 2014. The affected helmets may not adequately protect the wearer from penetration injuries in the event of a crash. As such, these helmets fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." By wearing a noncompliant helmet, the user may not be adequately protected in the event of a crash, increasing their risk of injury. Since the helmet purchasers are unknown, a notification will be placed on the Stealth website. Retailers will exchange the helmets for a different Stealth helmet or offer a refund, free of charge. Owners may contact Soaring at 1-425-656-0683.

16E-033

Nitrous Outlet is recalling certain .122 Nitrous Solenoid valves, part number 00-50004 manufactured May 1, 2015, to July 30, 2015. Due to improper welding, the affected valves may separate when under pressure either during installation or during use of the nitrous system resulting in the piston ejecting. If the piston ejects, it can increase the risk of injury to those nearby or possibly damage other nearby components. Nitrous Outlet has notified owners, and offered to provide a full refund or a replacement part, free of charge. Owners may contact Nitrous Outlet customer service at 1-254-848-4300.

16E-034

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2016**

Published June 2, 2016

Steve Johnson Induction Solutions (Induction Solutions) is recalling certain Bottom Exit, Side Exit, and .125 Bottom Exit nitrous oxide solenoid valves, part number 22X01751Gm 12/DC, manufactured from May 1, 2015, through July 30, 2015. The affected valves have end stops on the sleeves that may break when under pressure either during installation or during use. If the end stop on the sleeves breaks, the end stop may come off under pressure, increasing the risk of injury to those nearby or possibly damaging other nearby components. Induction Solutions notified all affected owners on August 17, 2015, and provided a replacement solenoid, free of charge. Owners may contact Induction Solutions customer service at 1-352-593-5900.

16E-035

Freedman Seating Company (Freedman) is recalling certain Family Seat, Family 3pta and ICS seats manufactured January 15, 2016, to January 29, 2016. Due to bolt failure, the affected seats may separate from the base frame. As such, these seats fail to comply with the requirements of Federal Motor Vehicle Safety System (FMVSS) number 222, "School Bus Passenger Seating and Crash Protection." In the event of a crash, the seat may separate from the base frame, increasing the risk of injury to the seat occupant. Freedman will notify the bus manufacturers that purchased the affected seats and will provide new, replacement seats free of charge. Freedman began notifying the affected bus manufacturers on April 15, 2016. The bus manufacturers will conduct recalls to notify the bus owners and provide them with a free remedy. Owners may contact their bus manufacturer or Freedman customer service at 1-800-443-4540.

16E-037

Hale Products Inc. (Hale) is recalling certain Class 1 Es-Key power control modules, models PDM, HDPDM, SN, and SNII, manufactured February 28, 2006, to April 6, 2016. The affected power control modules may not provide sufficient circuit protection depending on their combination of software and installation, possibly resulting in a short circuit. A short circuit may result in damage to components of the vehicle's electrical system, affecting their function such as causing a loss of headlights, increasing the risk of a crash. A short circuit may also increase the risk of a fire. Hale will notify owners, and dealers will upgrade the software or retrofit fuses to outputs, free of charge. The recall began on May 10, 2016. Owners may contact Hale customer service at 1-800-533-3569.

16E-038

Chrysler (FCA US LLC) is recalling certain RAM ProMaster Trailer Light Modules, part number 68229650AB. These accessory modules were sold for installation on RAM ProMaster and ProMaster City vehicles. The Trailer Tow Lighting Control Module may have a software error on the affected vehicles and can prevent illumination of the trailer brake lights during brake actuation. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Assoc. Equipment." Trailer brake lights that are inoperative can increase the risk of a crash. Chrysler will mail letters to owners to try to notify the purchasers of the modules, and dealers will replace the Trailer Tow Light Control Modules, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S29.

16E-039

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2016**

Published June 2, 2016

TIRES:

Bridgestone/Firestone North America Tire (Bridgestone) is recalling certain Firestone FR710 tires, size 205/65R16, and Champion Fuel Fighter tires, sizes 205/65R15 and 205/70R15, manufactured March 27, 2016, to April 9, 2016. These replacement passenger car tires may have been manufactured with inconsistent rubber coverage over the steel plies. As a result, the tread may separate. A tread separation increases the risk of a crash. All the affected tires have been contained and destroyed, therefore, an owner notification letter will not be issued for this campaign. All affected tires were returned to BATO on May 5, 2016. Owners may contact Bridgestone customer service at 1-800-847-3272.

16T-005

Pirelli Tire LLC (Pirelli) is recalling certain P Zero Trofeo tires, size 225/50RR15 91Y, manufactured from April 1, 2015, through April 7, 2015. The affected tires may not be marked with a date code. As such, these tires fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 139, "New Pneumatic Radial Tires for Light Vehicles." A missing date code could render the tire difficult to identify in the event of a safety-related issue, possibly causing them not to be removed from service. This will increase the risk of crash. Pirelli will notify owners, and dealers will replace the tires missing the date code, free of charge. The recall is expected to begin during June 2016. Owners may contact Pirelli customer service at 1-800-747-3554.

16T-006

VEHICLES:

General Motors LLC (GM) is recalling certain model year 2014-2016 Chevrolet Express and GMC Savana incomplete vehicles equipped with a 159 inch wheel base manufactured August 2, 2013, to January 30, 2016. The affected vehicles were shipped to final stage manufacturers without a tire pressure monitoring system (TPMS). As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 138, "Tire Pressure Monitoring Systems." Without a TPMS, the driver would not be alerted if one or more tires became under inflated. Driving with under inflated tires increases the risk of a crash. GM will notify owners, and dealers will install the hardware and software necessary to equip the vehicles with a TPMS, free of charge. The recall began on May 25, 2016. Owners may contact Chevrolet customer service at 1-800-222-1020, or GMC customer service at 1-800-462-8782. GM's number for this recall is 15819.

16V-184

Kompact Kamp is recalling certain 1983-2016 Li'l Clipper and other motorcycle trailers that were manufactured without side marker lights. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Assoc. Equipment." Without side marker lights, vehicle visibility can be decreased to other drivers, increasing the risk of a crash. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Kompact Kamp customer service at 1-717-933-8070.

16V-185

Pierce Manufacturing (Pierce) is recalling certain model year 2010-2016 Arrow-XT, Quantum, and Velocity

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2016**

Published June 2, 2016

vehicles manufactured from October 30, 2010, through January 24, 2016. The affected vehicles are equipped with Pelican 9410L flashlights, part number 9410-021-245 or 9410-021-110, with lithium ion battery packs which may overheat. If the flashlight battery pack overheats, it can increase the risk of a fire. Pierce will notify owners and instruct them to inspect the flashlight and battery pack, and if necessary, to request a replacement battery pack from Pelican Products, free of charge. The recall began on April 18, 2016. Owners may contact Pierce customer service at 1-414-832-3000. Pierce's recall number for this campaign is 74B271.

16V-186

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain model year 2010 Jaguar XF vehicles manufactured December 17, 2008, to April 15, 2009. The smell of fuel, illumination of the Malfunction Indicator Lamp (MIL), or fuel on the ground is caused by a fuel leak from a cracked outlet flange inside the fuel tank. If there is fuel leak or odor in the presence of an ignition source, it can increase the risk of a fire. Jaguar will notify owners, and dealers will replace the fuel outlet mounting flange, free of charge. The recall began on May 11, 2016. Owners may contact Jaguar customer service at 1-201-760-8534. Jaguar's number for this recall is J059.

16V-187

Ford Motor Company (Ford) is recalling certain model year 2015-2016 Transit vehicles manufactured March 12, 2014, to March 18, 2016. In the affected vehicles, the side curtain air bag may not deploy with the proper trajectory due to being folded and packaged incorrectly. A side curtain air bag that does not deploy as intended may increase the risk of occupant injury in the event of a crash. Ford will notify owners, and dealers will inspect and re-orient the side curtain air bag assembly, as necessary, free of charge. The recall began on May 18, 2016. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16S13.

16V-188

Kalmar Solutions, LLC (Kalmar) is recalling certain model year 2014-2016 Ottawa T2 vehicles manufactured July 14, 2014, to March 25, 2016. The brake system air pressure gauge, may not display the accurate air pressure level. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." If the brake system pressure gauge does not display the proper air pressure, there is an increased risk of a crash. Kalmar will notify owners, and dealers will replace the air system pressure sensors, free of charge. Owners may contact Kalmar customer service at 1-785-229-6327.

16V-189

Nova Bus (Nova) is recalling certain model year 2010-2015 Nova LFS transit buses manufactured from August 10, 2010, through November 5, 2015. The affected seats have J-Brackets that may be missing welds which could allow the seat belt anchorage assembly to separate from the J-Bracket. If the seat belt anchorage assembly separates from the J-Bracket, the bus driver may not be properly restrained in the event of a crash increasing their risk of injury. Nova will notify owners, and dealers will inspect the seats for missing welds. If missing welds are found, the seats will be repaired, free of charge. The recall is expected to begin during June 2016. Owners may contact Nova customer service at 1-450-472-6410. Nova's recall number for this campaign is CR3632.

16V-191

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2016**

Published June 2, 2016

Nissan North America, Inc. (Nissan) is recalling certain model year 2016 Murano vehicles manufactured December 17, 2015, to February 11, 2016, and 2016 Maxima vehicles manufactured November 25, 2015, to February 12, 2016 and equipped with an antilock braking system (ABS) and Vehicle Dynamic Control (VDC). The ABS actuator may have a damaged O-ring that may result in a lack of brake fluid pressure. Insufficient brake fluid pressure may lengthen the distance needed to stop the vehicle, increasing the risk of a crash. Nissan will notify owners, and dealers will inspect and replace the ABS actuator, as necessary, free of charge. The recall began on May 16, 2016. Owners may contact Nissan customer service at 1-800-647-7261.

16V-193

Jayco, Inc. (Jayco) is recalling certain model year 2016 Octane travel trailers, model 222(V2), manufactured March 23, 2016, to March 30, 2016. The turn signal wires on the affected trailers may be crossed, activating the opposite turn signal of the one intended. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Assoc. Equipment." Crossed turn signal wires may confuse other drivers by incorrectly indicating the intended direction and thereby increasing the risk of a crash. Jayco will notify owners, and dealers will inspect and repair the wiring, as necessary, free of charge. The recall began on April 25, 2016. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9901293.

16V-195

Cruiser RV (Cruiser) is recalling certain model year 2016-2017 Stryker travel trailers, models ST3316, STG3112 and STG3212, manufactured December 11, 2015, to March 10, 2016. The affected vehicles are equipped with safety chains on the A-frame that are rated for 11,700 lbs instead of being rated equal to, or greater than, the gross vehicle weight rating (GVWR) of the travel trailer. In the event the main trailer connection fails, the weight of the trailer can break the safety chains if the chains are not strong enough, allowing the trailer to separate from the vehicle, increasing the risk of a crash. Cruiser will notify owners, and dealers will replace the existing safety chains with chains that have a 16,200lb rating, free of charge. The recall began on April 21, 2016. Owners may contact Cruiser customer service at 1-260-562-3500.

16V-196

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2016 Toyota Sienna vehicles manufactured February 15, 2016, to February 19, 2016. In the affected vehicles, incorrect front seat belt height adjusters may have been installed. During a crash, this incorrect height adjuster may contact the B-pillar and tear or separate. Failure and detachment of seat belt height adjuster would result in the occupant not being properly restrained in a crash, increasing their risk of injury. Toyota will notify owners, and dealers will replace the front seat belt height adjusters, free of charge. The recall began on April 29, 2016. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is G0H.

16V-197

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2016 Toyota RAV4 vehicles manufactured October 30, 2015, to February 3, 2016, 2016 Lexus RX350 vehicles manufactured October 26, 2015, to February 8, 2016, and 2016 Lexus ES350 vehicles manufactured September 1, 2015, to February 29, 2016. These vehicles are equipped with an ABS actuator that may have a damaged O-ring which

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2016**

Published June 2, 2016

could result in improper brake fluid pressure control during ABS, Traction Control, or Stability Control activation. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 126, "Electronic Stability Control Systems." Insufficient brake fluid pressure may cause a loss of vehicle control, increasing the risk of a crash. Toyota will notify owners, and dealers will inspect the brake actuator, replacing it as necessary, free of charge. The recall is expected to begin June 5, 2016. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is GOI, GLC.

16V-198

Bugatti is recalling certain model year 2006-208 Veyron vehicles manufactured October 3, 2006, to December 22, 2006. In the affected vehicles, the positive battery (B+) cable and the connection to the alternator may corrode. The corrosion may result in the battery positive cable overheating, increasing the risk of a fire. All affected vehicles have had the battery B+ cable and the alternator replaced, free of charge. Owners may contact Bugatti at 1-805-557-1050.

16V-199

Bugatti is recalling certain model year 2006-2010 Veyron vehicles manufactured March 10, 2006, to January 17, 2010 and 2010-2011 Veyron Grand Sport vehicles manufactured September 29, 2009, to June 30, 2010. In the affected vehicles, the fuel tank gauge may indicate that there is more fuel in the tank than there actually is. The inaccurate gauge may cause a driver to unexpectedly run out of fuel and the vehicle to stall, increasing the risk of a crash. Bugatti will notify owners, and dealers will replace the fuel tank control unit and upgrade the software, free of charge. The recall began on May 23, 2016. Owners may contact Bugatti at 1-805-557-1050.

16V-200

Heartland Recreational Vehicles, LLC (Heartland) is recalling certain model year 2016-2017 Torque travel trailers, models T31 and T32, manufactured December 15, 2015, to March 16, 2016. The affected vehicles are equipped with safety chains on the A-frame that are rated for 11,700 lbs instead of being rated equal to, or greater than, the gross vehicle weight rating (GVWR) of the travel trailer. In the event the main trailer connection fails, the weight of the trailer can break the safety chains if the chains are not strong enough, allowing the trailer to separate from the vehicle, increasing the risk of a crash. Heartland will notify owners, and dealers will replace the existing safety chains with chains that have a 16,200 pound rating, free of charge. The recall began on April 21, 2016. Owners may contact Heartland customer service at 1-877-262-8032 or by email at parts@heartlandrvs.com.

16V-201

Chrysler (FCA US LLC) is recalling certain model year 2015-2016 Ram ProMaster City vans manufactured September 26, 2014, to March 5, 2016. A low-voltage electrical harness connector by the front driver seat may be susceptible to water intrusion and corrosion. Corrosion may result in a loss of communication to the Transmission Control Module (TCM) and may cause the transmission to unexpectedly shift into and stay in neutral without warning the next time that the vehicle stops. An unintended shift into neutral will prevent the vehicle from being moved. Additionally, if the driver turns off the engine, the driver will be unable to restart the engine. Both scenarios can increase the risk of a crash. Chrysler will notify owners, and dealers will relocate the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2016**

Published June 2, 2016

harness connector to under the instrument panel, free of charge. The recall is expected to begin on June 3, 2016. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S24.

16V-202

Mazda North American Operations (Mazda) is recalling certain model year 2016 CX-3 vehicles manufactured June 1, 2015, to December 2, 2015, 2013-2014 Mazda2 vehicles manufactured July 3, 2013, to August 8, 2014, 2014-2016 CX-5 vehicles manufactured January 19, 2013, to December 2, 2015, and 2013-2015 CX-9 vehicles manufactured December 6, 2012, to July 31, 2015. The lower mounting nuts and bolts that attach the front strut assembly to the steering knuckle may loosen, allowing the steering knuckle to separate. If the steering knuckle separates from the strut assembly, it can cause a loss of steering control, increasing the risk of a crash. Mazda will notify owners, and dealers will inspect the lower mounting nuts and bolts that secure the front strut assembly to the steering knuckle. If the bolts are loose, they will be replaced and then correctly tightened, free of charge. The recall is expected to begin May 20, 2016. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 9316D.

16V-203

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2013-2016 FCC XCS, XCM, XCR, XCL, XCP, XBS, XBR, and XBP trucks manufactured from January 7, 2013, through June 1, 2015. On certain motorhome chassis built with a heavier, adjustable foot pedal, the brake activation signal to certain towed devices may not deactivate when the motorhome service brakes are released. If the brake activation signal to a towed device remains active when the motorhome chassis service brakes are released, the brakes on a towed device may remain engaged depending on brake configuration of the trailer. As a result, the brakes would drag and possibly overheat potentially resulting in a fire. Additionally, following drivers may be confused by the motorhome's actions, increasing the risk of a crash. DTNA will notify owners, and dealers will modify the affected brake assemblies, free of charge. The recall is expected to begin on, or about, June 7, 2016. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's recall number for this campaign is FL-704.

16V-204

Forest River, Inc. (Forest River) is recalling certain model year 2015 and 2016 Rockport vehicles, models RPAF1466N, RPAF14FX and RPGSA92-12, manufactured from January 30, 2015, through February 24, 2015. The affected vehicles may have been manufactured without a tire pressure monitoring system (TPMS). As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 138, "Tire Pressure Monitoring Systems." Without the TPMS, the driver would not be alerted one or more of the vehicle's tires is under-inflated. An under-inflated tire may result in tire failure, increasing the risk of a crash. Because the manufacturer of the chassis is General Motors LLC (GM), GM will notify owners, and GM dealers will install the correct hardware and software for the TPMS, free of charge. The recall began on May 9, 2016. Owners may contact Forest River at 1-574-295-1022 or GM customer service at 1-800-462-8782.

16V-205

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2010-2017 Freightliner M2 Business Class, 108SD, 114SD, and Columbia trucks manufactured from January 6, 2010, through February

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2016**

Published June 2, 2016

29, 2016, equipped with certain Bendix rear disk brakes and spring suspensions. The rear disk brake caliper may have been installed incorrectly, thus allowing the caliper to contact the suspension. Caliper contact with the spring suspension may reduce the braking effectiveness, increasing the risk of a crash. DTNA will notify owners, and dealers will correct the orientation of the rear brake calipers, as necessary, free of charge. The recall is expected to begin June 7, 2016. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's recall number for this campaign is FL-705.

16V-206

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2016 114SD and M2 Business Class trucks manufactured from June 10, 2015, through October 1, 2015. The affected vehicles have front axles that have a 20,000 pound capacity, however, the installed Bridgestone R249 front tires have a lower maximum load capacity. The operator may unintentionally overload the tires, possibly causing tire failure thereby increasing the risk of a crash. DTNA will notify owners, and dealers will replace the front tires with tires of a higher load capacity, free of charge. The recall is expected to begin June 7, 2016. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's recall number for this campaign is FL-706.

16V-207

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2014-2015 FCCC XBS, XCL, XCS, XCR and XCM motorhome chassis manufactured from March 10, 2015, through January 14, 2016 and equipped with Detroit front axles. The front sway bar mounting brackets may not fit properly on the axle causing the mounting bolts to bend or loosen. If the sway bar bolts loosen, the sway bar may detach from the axle, affecting the handling and increasing the risk of a crash. DTNA will notify owners, and dealers will modify the mounting of the sway bar, free of charge. The recall is expected to begin June 7, 2016. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL-707.

16V-208

General Motors LLC (GM) is recalling certain model year 2014-2015 Chevrolet Silverado 1500 and GMC Sierra 1500 trucks manufactured January 29, 2013, to January 21, 2015. While entering the vehicle, the seat belt tensioner cable may be positioned such that the driver slides over it. This movement may result in the fatigue and separation of the cable. If the tensioner cable separates, the driver may not be properly restrained in the event of a crash, increasing their risk of injury. GM will notify owners, and dealers will modify the vehicles to prevent the tensioner from being damaged. Any tensioner that has already been damaged will be replaced, free of charge. Interim notices were mailed to owners on May 19, 2016. Owners will receive a second notice when remedy parts become available. Owners may contact Chevrolet customer service at 1-800-222-1020 or GMC customer service at 1-800-462-8782. GM's number for this recall is 15822.

16V-209

Kia Motors America (Kia) is recalling certain model year 2015-2016 K900 vehicles manufactured December 18, 2013 to January 11, 2016. In the affected vehicles when use of the headlights in Auto mode overtime may flicker or turn off when driving. If the headlights flicker or do not provide steady illumination, increases the risk of a vehicle crash. Kia will notify owners, and dealers will replace the multi-function switch, free of charge. The recall is expected to begin May 27, 2016. Owners may contact Kia customer service at 1-800-333-4542.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2016**

Published June 2, 2016

Kia's number for this recall is SC130.

16V-210

Mercedes-Benz USA, LLC (MBUSA) is recalling certain model year 2016 SLK300 vehicles manufactured June 2, 2015 to July 14, 2015 and equipped with a nine-speed automatic transmission. The backup power supply for the ignition switch in the affected vehicles may not have been properly connected. As a result, if the vehicle is being driven and there is a loss of power from the main vehicle battery, the transmission cannot be shifted to "Park" nor can the electric parking brake be applied. In this situation, without the backup power supply, the only way to keep the vehicle from moving is to press the brake pedal. As soon as the driver attempts to exit the vehicle, the vehicle may roll, increasing the risk of injury. MBUSA will notify owners, and dealers will correct the ignition switch wiring and perform a software update, free of charge. The recall began on May 9, 2016. Owners may contact MBUSA customer service at 1-800-367-6372.

16V-211

Strick Trailers, LLC (Strick) is recalling certain model year 2004 Single axle 28 foot van trailers, model S4280E99NFOWW, manufactured August 1, 2003, to October 31, 2003 and equipped with rear impact guards using gussets 52236 and 52237. These rear impact guard gussets increase the chances of injury in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 223, "Rear Impact Guards." If the rear impact guards do not meet the safety standards, it can increase the risk of injury in the event of a crash. Strick will notify owners, and service centers will install reinforcements to the rear impact guards, free of charge. The recall is expected to begin June 10, 2016. Owners may contact Strick customer service at 1-260-692-1300.

16V-212

Karavan Trailers Inc (Karavan) is recalling certain model year 2016 KPSD trailers manufactured September 29, 2015, to March 29, 2016. The axle spindle flange on the affected trailers may bend and result in abnormal tire camber, causing excessive wear on the tires. Excessive wear may result in tire failure, increasing the risk of a crash. Karavan will notify owners, and dealers will replace the axle assembly, free of charge. The recall is expected to begin during June 2016. Owners may contact Karavan customer service at 1-920-928-6200.

16V-213

Hillsboro Industries (Hillsboro) is recalling certain model year 2016 Open Aluminum Utility Trailers manufactured November 6, 2015, to April 1, 2016. On these trailers with a 2,990 Gross Vehicle Weight Rating (GVWR), the axle attachment hardware may have been improperly installed, and as a result, the axle may not remain secured and aligned. If the axle shifts, the trailer may pull to one side, increasing the risk of a crash. Hillsboro believes that all affected trailers were quarantined at dealers before being sold, therefore owner notifications will not be sent. Dealers will correct the axle mounting, free of charge. The recall began on April 14, 2016. Owners may contact Hillsboro customer service at 1-316-947-3127.

16V-214

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2016 Avalon and Camry vehicles manufactured November 30, 2015 to March 4, 2016. The occupant classification system (OCS) that

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2016**

Published June 2, 2016

activates or deactivates the front passenger seat air bag system may have been improperly calibrated. As a result, the front passenger air bag and the front passenger knee air bag may not deploy as intended in certain crash scenarios. As such, these vehicles fail to comply with Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." Air bags that do not deploy as intended during a crash increase the risk of injury. Toyota will notify owners, and dealers will recalibrate the OCS, free of charge. The recall began by May 13, 2016. Owners may contact Toyota customer service at 1-888-270-9371. Toyota's number for this recall is G0J.

16V-215

Forest River, Inc. (Forest River) is recalling certain model year 2012-2016 Starcraft Bus Xpress, Starquest, Starlite, Allstar, Allstar XL, MVP, Ultrastar, and XLT transit buses manufactured from January 1, 2012, through April 6, 2016. The labels on the rear emergency exit window are not located within 16 centimeters of the release mechanisms as required. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 217, "Bus Emergency Exits and Window Retention and Release." If the label is not located the correct distance from the mechanism, it may hinder an occupant's ability to open the emergency window and escape from the vehicle quickly in the event of an emergency. Forest River will notify owners, and provide a new label along with instructions for the correct placement of the label on the window. The label and instructions will be provided free of charge. The recall is expected to begin June 8, 2016. Owners may contact Starcraft customer service at 1-574-642-3112. Forest River's recall number for this campaign is 5-04112016-0169.

16V-216

Forest River, Inc. (Forest River) is recalling certain 2008-2016 Glaval Bus Apollo, Concorde II, Entourage, Legacy, Primetime, Sport, Titan, Titan II, and Titan II Low Floor transit buses manufactured from August 1, 2008, through March 6, 2016. The labels on the rear emergency exit window are not located within 16 centimeters of the release mechanisms as required. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 217, "Bus Emergency Exits and Window Retention and Release." If the label is not located the correct distance from the mechanism, it may hinder an occupant's ability to open the emergency window and escape from the vehicle quickly in the event of an emergency. Forest River will notify owners, and provide a new label along with instructions for the correct placement of the label on the window. The label and instructions will be provided free of charge. The recall is expected to begin June 9, 2016. Owners may contact Glaval Bus customer service at 1-574-642-3112. Forest River's number for this campaign is 35-04112016-0168.

16V-217

Forest River, Inc. (Forest River) is recalling certain model year 2015-2016 Shasta Airflyte 16 foot and 19 foot recreational vehicles manufactured from April 28, 2015, through May 14, 2015. The dinette table on the affected vehicles may not have adequate support when lowered on its supporting leg. Without adequate support, the dinette table may fall between the dinette benches without warning, possibly resulting in injury. Forest River will notify owners, and dealers will install two new support legs, free of charge. The recall is expected to begin June 9, 2016. Owners may contact Forest River customer service at 1-574-821-1314. Forest River's recall number for this campaign is 53-04112016-0170.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2016**

Published June 2, 2016

16V-218

Nissan North America, Inc. (Nissan) is recalling certain model year 2014-2016 Nissan Rogue vehicles manufactured July 31, 2013, to January 16, 2016. In the affected vehicles, the rear lift gate support stays may corrode due to insufficient anti-corrosion treatment. Corrosion of one or both of the rear lift gate support stays could cause a sudden release of pressure. If this occurs, the support stays may break off, increasing the risk of injury. Nissan will notify owners, and dealers will replace the rear tailgate stays, free of charge. Parts are not currently available. Owners will be sent interim notifications by mid-June 2016. A second notice will be sent when remedy parts become available. Owners may contact Nissan customer service at 1-800-647-7261.

16V-219

Forest River, Inc. (Forest River) is recalling certain model year 2014-2016 Startrans Bus Senator II, Senator HD, Candidate II, President, and President S2 transit buses manufactured from May 16, 2014, through April 6, 2016. The labels on the rear emergency exit window are not located within 16 centimeters of the release mechanisms as required. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 217, "Bus Emergency Exits and Window Retention and Release." If the label is not located the correct distance from the mechanism, it may hinder an occupant's ability to open the emergency window and escape from the vehicle quickly in the event of an emergency. Forest River will notify owners, and provide a new label along with instructions for the correct placement of the label on the window. The label and instructions will be provided free of charge. The recall is expected to begin June 10, 2016. Owners may contact StarTrans customer service at 1-574-642-3112. Forest River's recall number for this campaign is 5-04142016-0171.

16V-220

Riverside RV (Riverside) is recalling certain model year 2015 White Water Retro travel trailers, model 176S, manufactured September 1, 2015, to February 1, 2016. The axle on the affected trailers may be too narrow, and as a result, the tires may rub, causing tire failure. Tire failure increases the risk of a crash. Riverside will notify owners, and dealers will inspect and replace the axle, as necessary, free of charge. The recall began on May 11, 2016. Owners may contact Riverside customer service at 1-260-499-4578.

16V-221

Eldorado National-Kansas (Eldorado) is recalling certain model year 2010-2015 Amerivan and Amerivan 10 vehicles manufactured September 1, 2009, to March 28, 2016 on Dodge and Chrysler minivan chassis. The crimp fastener on the fuel line assembly of the affected vehicles may not be fully crimped, allowing fuel to leak at the hose to fitting assembly. A fuel leak in the presence of an ignition source can increase the risk of a fire. Eldorado will notify owners, and dealers will inspect and rework or replace the fuel line assembly, free of charge. The recall began on May 11, 2016. Owners may contact Eldorado Mobility customer service at 1-866-392-6300.

16V-222

New Flyer Industries Ltd. (New Flyer) is recalling certain model year 2013 C40LFR, XN35, 2014-2016 XD35, XD60, XDE40, 2015-2016 XD40, XDE60, 2014 XDE35, 2013-2015 XE40, 2013-2016 XN40,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2016**

Published June 2, 2016

XN60, and 2014-2015 XT40, and XT60 transit buses. These buses have an Electric Transit Operator (ETO) controller that controls the bus door operator motor and brake which may have a software defect which can cause failure of the rear door guide roller linkage resulting in a bus' rear door opening unexpectedly while the bus is in motion. If the rear bus door opens unexpectedly while the bus is in motion, there is an increased risk of injury for the passengers. New Flyer will notify owners, and dealers will install a firmware upgrade, and replace the roller bracket plates, free of charge. The recall began on May 4, 2016. Owners may contact New Flyer customer service at 1-204-224-6706. New Flyer's number for this recall is R16-005.

16V-223

Forest River, Inc. (Forest River) is recalling certain model year 2016 Elkhart ECE4 transit buses manufactured January 13, 2016, to January 26, 2016. These vehicles are equipped with seats that may separate from the base frame due to bolt failure. In the event of a crash, the seat can separate from the base frame, increasing the risk of injury to the seat occupant. Forest River will notify owners and dealers will replace the seats free of charge. The recall is expected to begin on, or about, June 14, 2016. Owners may contact Forest River customer service at 1-574-264-5179. Forest River's number for this recall is 42-04162016-0177.

16V-224

Forest River, Inc. (Forest River) is recalling certain model year 2016 Glaval Entourage and Universal transit buses manufactured from February 26, 2016, through March 3, 2016. These vehicles are equipped with seats that may separate from the base frame due to bolt failure. In the event of a crash, the seat can separate from the base frame, increasing the risk of injury to the seat occupant. Forest River will notify owners and dealers will replace the seats free of charge. The recall is expected to begin on, or about, June 14, 2016. Owners may contact Forest River customer service at 1-574-262-2212. Forest River's number for this recall is 35-04162016-0173.

16V-225

Forest River, Inc. (Forest River) is recalling certain model year 2016 StarTrans Senator II transit buses manufactured March 18, 2016, to March 21, 2016. These vehicles are equipped with seats that may separate from the base frame due to bolt failure. In the event of a crash, the seat can separate from the base frame, increasing the risk of injury to the seat occupant. Forest River will notify owners, and dealers will replace the seats free of charge. The recall is expected to begin on, or about, June 14, 2016. Owners may contact Forest River customer service at 1-574-262-2212. Forest River's number for this recall is 5-04162016-0175.

16V-226

Forest River, Inc. (Forest River) is recalling certain model year 2015-2016 Starcraft Prodigy and Quest school buses manufactured January 29, 2016, to February 25, 2016. These vehicles are equipped with seats that may separate from the base frame due to bolt failure. In the event of a crash, the seat can separate from the base frame, increasing the risk of injury to the seat occupant. Forest River will notify owners, and dealers will replace the seats free of charge. The recall is expected to begin on, or about, June 14, 2016. Owners may contact Forest River customer service at 1-574-262-2212. Forest River's number for this recall is 5-04162016-0174.

16V-227

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2016**

Published June 2, 2016

Gulf States Toyota, Inc. (Gulf States) is recalling certain model year 2015-2016 Toyota 4Runner vehicles manufactured September 22, 2014, to March 23, 2016 and equipped with accessories installed by Gulf States. The Load Carrying Capacity Modification Label may not reflect the correct added weight of the installed accessories. As a result, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 110, "Tire Selection and Rims for Passenger Cars." An incorrect label may result in the vehicle being overloaded, increasing the risk of a crash. Gulf States will notify owners, and dealers will install an accurate label, free of charge. The recall is expected to begin on June 1, 2016. Owners may contact Gulf States customer service at 1-800-444-1074. Gulf States' number for this recall is 16R2.

16V-228

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain model year 2009, 2011, 2012 and 2015 XF vehicles manufactured February 6, 2008 to October 20, 2014. In the affected vehicles, the driver frontal air bags may be missing a chemical enhancer required for the second stage deployment, resulting in the second stage deploying improperly in certain crashes. An air bag that inflates improperly increases the risk of injury. Jaguar will notify owners, and dealers will replace the driver frontal air bag module, free of charge. The recall began on May 5, 2016. Owners may contact Jaguar customer service at 1-800-452-4827. Jaguar's number for this recall is J065.

16V-229

Jayco, Inc. (Jayco) is recalling certain model year 2016 Octane Super Lite travel trailers manufactured November 2, 2015, to April 4, 2016. These trailers may have been built without a 30amp circuit breaker which, in the event of an electrical short, may result in a fire. An electrical short on an unprotected circuit increases the risk of a fire. Jayco will notify owners, and dealers will install a 30 amp circuit breaker, free of charge. The recall began on May 6, 2016. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9901295.

16V-230

Kia Motors America (Kia) is recalling certain model year 2016 Kia Optima vehicles manufactured November 10, 2015, to February 12, 2016. In these vehicles, the driver's frontal air bag may be missing a chemical enhancer required for the second stage air bag deployment, resulting in the second stage deploying improperly in certain crashes. An air bag that inflates improperly increases the risk of injury. Kia will notify owners, and dealers will replace the driver's frontal air bag module, free of charge. The recall began on May 6, 2016. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC131.

16V-231

Hyundai Motor Company (Hyundai) is recalling certain model year 2015-2016 Sonata vehicles manufactured May 29, 2014 to February 11, 2016, 2017 Elantra vehicles manufactured January 12, 2016 to February 22, 2016, and one 2016 Sonata Hybrid vehicle manufactured October 15, 2015. In these vehicles, the driver's frontal air bag may be missing a chemical enhancer required for the second stage air bag deployment, resulting in the second stage not deploying in certain crashes. The primary stage will deploy as intended. An air bag that does not inflate increases the risk of injury. Hyundai will notify owners, and dealers will replace the driver's frontal air bag module, free of charge. Owners may contact Hyundai customer service at 1-855-371-9460.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2016**

Published June 2, 2016

Hyundai's number for this recall is 144.

16V-232

Terex South Dakota, Inc. (Terex) is recalling certain model year 2001-2003 XT52, XT55 and XT60 aerial devices manufactured January 1, 2001, to May 31, 2003. The affected trucks have aerial devices that may have been built with lower booms made of material of insufficient strength. Booms made from weaker materials may crack and fail, increasing the risk of injury to the boom operator or those nearby. Terex will notify owners, and dealers will inspect the lower boom to verify that it was made with the correct material. Any boom that was made with an improper material will be replaced, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Terex customer service at 1-800-982-8975. Terex's recall campaign number is SN618. Note: This recall is an expansion of recall 15V-353.

16V-233

Strick Trailers, LLC (Strick) is recalling certain model year 2005-2009 single axle 28 foot van trailers manufactured July 25, 2004, to February 3, 2009 and equipped with rear impact guards using gussets 55997 and 555998. These rear impact guard gussets could increase the chances of injury in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 223, "Rear Impact Guards." If the rear impact guards do not meet the safety standards, it can increase the risk of injury in the event of a crash. Strick will notify owners, and service centers will install reinforcements to the rear impact guards, free of charge. The recall is expected to begin June 17, 2016. Owners may contact Strick customer service at 1-260-692-1300.

16V-234

Vermeer Manufacturing Company (Vermeer) is recalling certain model year 2015-2016 TLR33 trailers manufactured June 10, 2015, to April 14, 2016. The affected trailers may be equipped with undersized tires resulting in the tires rubbing against the fenders. Tire contact with the fender may cause sudden tire failure, increasing the risk of a crash. Vermeer will provide an install kit with necessary parts and instructions to install a frame lift, free of charge. The recall began on June 16, 2016. Owners may contact Vermeer customer service at 1-641-628-3141. Vermeer's number for this recall is IK3285.

16V-235

Southeast Toyota Distributors, LLC (SET) is recalling certain model year 2016 Toyota Yaris, Rav4, Land Cruiser and 4Runner vehicles, and Scion FR-S, iM, and TC vehicles manufactured January 28, 2016, to March 14, 2016. The Load Carrying Capacity Modification Label may not reflect the correct added weight of the installed accessories. As a result, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 110, "Tire Selection and Rims for Passenger Cars." An incorrect label may result in the vehicle being overloaded, increasing the risk of a crash. SET will notify owners, and provide them a corrected label to be installed over the inaccurate label, free of charge. The recall is expected to begin June 3, 2016. Owners may contact SET customer service at 1-866-405-4226. SET's number for this recall is SET16A.

16V-236

Forest River, Inc. (Forest River) is recalling certain model year 2015-2017 Prime Time Crusader trailers, model

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2016**

Published June 2, 2016

CSF370BHQ, manufactured August 26, 2014, to March 3, 2016. The Federal Placard on the affected trailers incorrectly indicates the Cargo Carrying Capacity (CCC) as 800-900 pounds, when the correct CCC is 2700 to 2800 pounds. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." The vehicle operator does not have accurate information regarding the vehicle's Cargo Carrying Capacity as currently indicated on the Federal Placard. Forest River will notify owners, and dealers will install a corrected Federal Placard, free of charge. The recall is expected to begin June 17, 2016. Owners may contact Forest River customer service at 1-574-862-1025. Forest River's number for this recall is 49-04172016-0178.

16V-237

Winnebago Industries, Inc (Winnebago) is recalling certain model year 2014 Winnebago Tour, and Itasca Ellipse vehicles manufactured May 23, 2013, to August 9, 2013 and built on a Freightliner chassis. On certain recreational vehicles built with a heavier, adjustable foot pedal, the brake activation signal to certain towed devices may not deactivate when the service brakes are released. If the brake activation signal to a towed device remains active when the motorhome chassis service brakes are released, the brakes on a towed device may remain engaged depending on brake configuration of the trailer. As a result, the brakes would drag and possibly overheat potentially resulting in a fire. Additionally, following drivers may be confused by the motorhome's actions, increasing the risk of a crash. Winnebago will notify owners, and dealers will modify the affected brake assemblies, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Winnebago customer service at 1-641-585-3535.

16V-238

Pitts Enterprises, Inc. (Pitts) is recalling certain model year 2014-2016 LT, LP and PT logging trailers manufactured January 1, 2014, to May 31, 2015. The affected trailers have a single point trunnion mount suspension which may develop cracks in the welds between the suspension and the frame. If the welds crack, the suspension can shift or detach, increasing the risk of a crash. Pitts will notify owners, and dealers will inspect the suspension for cracks and repair the welds, free of charge. The recall began on May 6, 2016. Owners may contact Pitts customer service at 1-800-321-8073.

16V-239

Chrysler (FCA US LLC) is recalling certain model year 2012-2014 Dodge Charger and Chrysler 300 vehicles manufactured February 15, 2011, to November 27, 2014, and 2014-2015 Jeep Grand Cherokee vehicles manufactured July 16, 2012, to December 22, 2015. The affected vehicles, equipped with an eight-speed automatic transmission and a monostable gear selector, may not adequately warn the driver when driver's door is opened and the vehicle is not in PARK, allowing them to exit the vehicle while the vehicle is still in gear. Drivers thinking that their vehicle's transmission is in the PARK position may be struck by the vehicle and injured if they attempt to get out of the vehicle while the engine is running and the parking brake is not engaged. FCA will notify owners, and dealers will update the vehicle software to mitigate the risk of vehicle rollaway, free of charge. Owners were mailed interim notices on May 14, 2016. Owners will receive a second notice when remedy parts become available. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S27.

16V-240

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2016**

Published June 2, 2016

Toyne Inc. (Toyne) is recalling certain model year 2014-2015 Pumper emergency vehicles manufactured December 20, 2014, to June 3, 2015. These vehicles are equipped with certain K Gearboxes from Hale Products which may shift out of gear from "road" to "neutral" while the truck is in transit. If the vehicle unexpectedly shifts to neutral on the way to attend a fire, the delay may hinder fire fighting efforts. Additionally, the loss of drive may increase the risk of a crash. All of the affected vehicles have been remedied by removing the gearbox, having Hale repair it and then reinstalling it, free of charge. Owners may contact Toyne customer service at 1-712-673-2328. Toyne's number for this recall is SB 129.

16V-241

Nissan North America, Inc. (Nissan) is recalling certain model year 2013-2016 Sentra vehicles manufactured June 13, 2012, to April 14, 2016. The front passenger seat belt bracket may become deformed if it is used to secure a Child Restraint System (CRS). The deformed seat bracket may cause the Occupant Classification System (OCS) to incorrectly classify the installed CRS, resulting in the front passenger air bag to not be turned off as designed when a CRS is in the seat. If the frontal passenger air bag deploys in the event of a crash when a child seat is installed in the front passenger seat, there will be an increased risk of injury to the child in the CRS. Nissan will notify owners, and dealers will reinforce the seat belt bracket as well as reprogram the Air Bag Control Unit (ACU) and OCS Electronic Control Unit (ECU), free of charge. The remedy is not yet available. Owners will be mailed an interim notification by the end of June 2016 and will be sent a second letter when the remedy is available. Owners are warned not to install a CRS in the front seat. Owners may contact Nissan customer service at 1-800-867-7669.

16V-242

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2016 Touareg vehicles manufactured July 7, 2015 to March 3, 2016. In the affected vehicles, the Tire Pressure Monitoring System (TPMS) may be improperly calibrated and, as a result, the TPMS may fail to warn the driver that the tire pressure is low. Additionally, the tire pressures printed on the Safety Certification labels are incorrect. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 138, "Tire Pressure Monitoring Systems." If the vehicle is driven on underinflated tires, the tires may fail suddenly, increasing the risk of a crash. Volkswagen has notified owners, and dealers will correct the TPMS settings and replace the safety certification label, free of charge. The recall began on May 13, 2016. Volkswagen's number for this recall is 44M9.

16V-243

Nissan North America, Inc. (Nissan) is recalling certain model year 2016-2017 Nissan Maxima, 2013-2016 Nissan Altima, NV200, LEAF, Sentra, and Pathfinder, 2014-2016 Nissan NV200 Taxi, Infiniti QX60, QX60 Hybrid, and Q50 Hybrid, 2014-2017 Nissan Rogue and Infiniti Q50, 2015-2016 Nissan Murano, Murano Hybrid, and Chevrolet City Express, 2014-2015 Nissan Pathfinder Hybrid, and 2013 Infiniti JX35 vehicles. In these vehicles, the front seat passenger Occupant Classification System (OCS) may incorrectly classify an adult passenger as a child or classify the seat as empty despite it being occupied. As a result, the passenger frontal air bag may be turned off and not deploy in the event of a crash. If the passenger frontal air bag does not deploy as intended in the event of a crash, the passenger is at an increased risk of injury. Nissan will notify their owners. Chevrolet City Express owners will be notified by General Motors. Dealers will reprogram the Air Bag Control

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2016**

Published June 2, 2016

Unit (ACU) and OCS Electronic Control Unit (ECU) in Altima, Maxima, Murano, Rogue, and Sentra vehicles, and replace the OCS ECU in LEAF, NV200, NV200 Taxi, Pathfinder, Infiniti Q50, JX35, and QX60 and Chevrolet City Express vehicles, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Nissan customer service at 1-800-867-7669, Infiniti customer service at 1-888-833-3216 or Chevrolet customer service at 1-800-222-1020.

16V-244

Ford Motor Company (Ford) is recalling certain model year 2014-2015 Ford Explorer vehicles manufactured January 17, 2014 to May 31, 2014. The affected vehicles may have improperly welded rear suspension toe links that may fracture. A fracture of the rear suspension toe link may result in a loss of steering control, increasing the risk of a crash. Ford will notify owners, and dealers will replace the rear suspension toe links, free of charge. The recall is expected to begin on June 9, 2016. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16S18.

16V-245

Ford Motor Company (Ford) is recalling certain model year 2016 Ford F-250, F-350, F-450, and F-550 trucks manufactured April 5, 2016, to April 11, 2016. The tires installed during assembly of the affected vehicles may have sustained damage to the inner sidewall, possibly resulting in a loss of air or a tire rupture. A rapid loss of air or a tire rupture while the vehicle is being driven may cause a loss of vehicle control, increasing the risk of a crash. Ford will notify owners, and dealers will inspect the tires for damage and replace them as necessary, free of charge. The recall began on May 23, 2016. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16S17.

16V-246

Ford Motor Company (Ford) is recalling certain model year 2009-2012 Ford Flex, 2008 and 2010-2012 Ford Taurus, 2008-2009 Ford Taurus X, 2008 Mercury Sable, 2009 and 2011 Lincoln MKS vehicles. The driver frontal air bag may improperly inflate during second-stage deployment in the event of a high speed crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." An improperly inflated air bag increases the risk of injury in the event of a crash. Ford will notify owners, and dealers will inspect and replace the driver's frontal air bag module, as necessary, free of charge. The recall is expected to begin on June 13, 2016. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16C06.

16V-247

Ford Motor Company (Ford) is recalling certain model year 2011-2012 Ford F-150 trucks manufactured August 19, 2011, to March 9, 2012, 2012 Ford Expedition, Lincoln Navigator vehicles manufactured August 19, 2011, to December 19, 2011, and 2012 Ford Mustang vehicles manufactured August 19, 2011, to February 21, 2012. The affected vehicles are equipped with an automatic transmission that may unexpectedly downshift to first gear, regardless of vehicle speed. An unexpected downshift into first gear can cause the vehicle to slow down suddenly without warning and the rear tires may slide or lock, increasing the risk of a crash. Ford will notify owners, and dealers will reprogram the powertrain control module with updated software, free of charge. The recall is expected to begin May 23, 2016. Owners may contact Ford customer service at 1-866-

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2016**

Published June 2, 2016

436-7332. Ford's number for this recall is 16S19.

16V-248

Chrysler (FCA US LLC) is recalling certain model year 2016 Jeep Grand Cherokee vehicles manufactured May 15, 2015 to February 19, 2016. The brake transmission shift interlock solenoid may have a loose electrical connection which could result in a loss of solenoid function. If the solenoid loses function, the transmission may lock in the Park or Neutral position when the vehicle comes to a stop, possibly rendering the vehicle disabled in traffic, increasing the risk of a crash. Chrysler will notify owners, and dealers will replace the shifter assembly, free of charge. The recall began on May 27, 2016. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S28.

16V-249

Ford Motor Company (Ford) is recalling certain model year 2016 Ford Fusion vehicles manufactured from March 10, 2016, through March 16, 2016. The front driver seat track assembly's rear riser may have been improperly welded to the seat track rail, and as a result, the driver may not be adequately restrained in a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) numbers 207, "Seating Systems" and 210, "Seat Belt Assembly Anchorages." An improperly welded driver seat riser may fail to adequately restrain the driver during crash, increasing the risk of injury. Ford quarantined the affected vehicles at dealerships prior to their sale. Dealers will replace the front driver seat track rail, free of charge. The recall began on May 19, 2016. Ford's number for this recall is 16C05.

16V-250

Subaru of America, Inc. (Subaru) is recalling certain model year 2015 Legacy and Outback vehicles manufactured July 20, 2015. The brake fluid in these certain models may contain excess moisture, which causes gelatinous material to form in the brake system and temporarily clog a valve filter in the vehicle dynamics control system. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 126, "Electronic Stability Control Systems." Loss in the electronic stability control system, may increase the risk of a crash. Subaru will notify owners, and dealers will perform an ABS activation, then flush and replace the brake fluid, free of charge, The manufacturer has not yet provided a notification schedule. Owners may contact Subaru customer service at 1-800-782-2783. Subaru's number for this recall is WTA-64.

16V-251

Newmar Corporation (Newmar) is recalling certain model year 2014-2016 Dutch Star, Mountain Aire, Essex, and 2015-2016 London Aire vehicles manufactured March 27, 2013, to October 16, 2015 and built on a Freightliner chassis. On certain recreational vehicles built with a heavier, adjustable foot pedal, the brake activation signal to certain towed devices may not deactivate when the service brakes are released. If the brake activation signal to a towed device remains active when the motorhome chassis service brakes are released, the brakes on a towed device may remain engaged depending on brake configuration of the trailer. As a result, the brakes would drag and possibly overheat potentially resulting in a fire. Additionally, following drivers may be confused by the motorhome's actions, increasing the risk of a crash. Newmar will notify owners, and Freightliner dealers will modify the affected assemblies, free of charge. The recall is expected to begin on June 25, 2016. Owners may contact Freightliner/Daimler Trucks North America LLC at 1-800-547-0712 or Newmar

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2016**

Published June 2, 2016

customer service at 1-800-731-8300. Newmar's number for this recall is 16V-204.

16V-252

Chrysler (FCA US LLC) is recalling certain model year 2014-2016 RAM ProMaster vehicles manufactured July 24, 2015, to February 15, 2016, and 2015-2016 ProMaster City vehicles manufactured August 15, 2014, to February 1, 2016. The Trailer Tow Lighting Control Module may have a software error on the affected vehicles and can prevent illumination of the trailer brake lights during brake actuation. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Assoc. Equipment." Trailer brake lights that are inoperative can increase the risk of a crash. Chrysler will notify owners, and dealers will replace the Trailer Tow Light Control Module, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S22.

16V-253

Custom Truck and Equipment (CTE) is recalling certain model year 2013-2016 Dominator-Propane, Dominator I, Dominator II, Dominator III, and Dominator IV trucks manufactured April 4, 2013, to January 22, 2016, equipped with IMT cranes, models 6000, 7500, 8600, 9500, 10000, 12000, and 14000. The affected cranes have a valve bank cover that may crack and fall from the crane while the crane is being transported. If the valve bank cover detaches from the crane it could be a road hazard, increasing the risk of a crash. CTE will notify owners, and dealers will replace the valve bank cover, with a thicker gauge cover, free of charge. The recall began May 28, 2016. Owners may contact Custom Truck customer service at 1-888-712-2962. CTE's number for this recall is TB2016001.

16V-254

Legacy Equipment Company (LEC) is recalling certain model year 2013-2016 Dominator-Propane, Dominator I, Dominator II, Dominator III, and Dominator IV trucks equipped with IMT cranes, models 6000, 7500, 8600, 9500, 10000, 12000, and 14000. The affected cranes have a valve bank cover that may crack and fall from the crane while the crane is being transported. If the valve bank cover detaches from the crane it could be a road hazard, increasing the risk of a crash. LEC will notify owners, and dealers will replace the valve bank cover, with a thicker gauge cover, free of charge. Owners may contact LEC customer service at 1-801-975-0400. LEC's number for this recall is TB2016001 - IMT dist.

16V-255

General Motors LLC (GM) is recalling certain model year 2016-2017 Chevrolet Silverado 1500 and 2016 Cadillac Escalade, Cadillac Escalade ESV, Chevrolet Suburban, Chevrolet Tahoe, GMC Sierra, GMC Yukon and GMC Yukon XL vehicles. The front upper control arms may have inadequate welds near the control arm bushing. Inadequate welds may allow the control arm to separate from the bushing, compromising steering and increasing the risk of a crash. GM will notify owners, and dealers will replace the left and right front upper control arms and realign the vehicle, free of charge. Parts are not currently available. Owners were mailed an interim notification on early May 3, 2016. Owners will be mailed a second notice when remedy parts are available. Until the repairs have been made, owners are advised not to drive their vehicles. Owners may contact Chevrolet customer service at 1-800-222-1020, Cadillac customer service at 1-800-458-8006, or GMC customer

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2016**

Published June 2, 2016

service at 1-800-462-8782. GM's number for this recall is 42190.

16V-256

General Motors LLC (GM) is recalling certain model year 2013-2016 Chevrolet Sonic and Trax vehicles and 2013-2015 Chevrolet Spark vehicles equipped with a Bring Your Own Media radio. The affected radios may fail to provide an audible warning chime when the driver, after turning off the ignition and leaving the key in the cylinder, waits 10 minutes or longer to open the door. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 114 "Theft Protection." Without audible indicators, the driver may leave the key in the ignition, increasing the risk of theft. GM will notify owners, and dealers will update the radio software, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 17130.

16V-257

Forest River, Inc. (Forest River) is recalling certain model year 2016-2017 Cardinal recreational vehicles, models CAF3455RL, CAF3825FL and CAF3850RL, manufactured from November 20, 2015, through April 1, 2016. These vehicles may be equipped with a Federal Placard that indicates an incorrect tire and rim combination. The placard states the tire and rim combination is ST235/80R16 LRE Tires with 80 PSI and a rim designation of 16X6.00JJ, when the actual combination on the vehicle is LT235/85T16 LRG Tires with 110 PSI and a rim designation of 16X6.00HD. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." If the operator inflates the tires to the PSI indicated on the label, the tires will be operated while being under-inflated causing pre-mature wear and a possible tire blow out, increasing the risk of a vehicle crash. Forest River will notify owners, and provide a new corrected Federal Placard, free of charge. The recall is expected to begin on, or about, June 23, 2016. Owners may contact Forest River customer service at 1-574-206-7600. Forest River's number for this recall is 15-04172016-0179.

16V-258

Monroe Truck Equipment (Monroe) is recalling one model year 2013 Ford F-550 truck with an IMT model 7500 crane. The affected crane has a valve bank cover that may crack and fall from the crane while the crane is being transported. If the valve bank cover detaches from the crane it could be a road hazard, increasing the risk of a crash. Monroe will notify the owner, and dealers will replace the valve bank cover with a thicker cover, free of charge. The recall is expected to begin in May 2016. Owners may contact Monroe customer service at 1-800-882-1900. Monroe's number for this recall is TB2016001 - IMT dist.

16V-259

Thor Motor Coach (TMC) is recalling certain model year 2017 ACE and Road Bear Rental motorhomes manufactured February 11, 2016, to March 9, 2016. The seat belt anchorages located in the slide out section may not meet the specified strength requirements, allowing them to pull loose during a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 210, "Seat Belt Assembly Anchorages." If the seat belt anchorages pull loose in a crash, they will not properly restrain the occupant, increasing the risk of injury. TMC will notify owners, and dealers will install reinforcement

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2016**

Published June 2, 2016

brackets, and plates, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact TMC customer service at 1-877-500-1020.

16V-260

Daimler Vans USA, LLC (DVUSA) is recalling certain model year 2015-2016 Mercedes Benz and Freightliner Sprinter 2500 and 3500 vehicles manufactured April 1, 2015, to October 31, 2015. The affected vehicles may have had multiple layers of paint applied, and as a result, in a crash, the windows may separate from the vehicle when the outer layer of paint peels from the layer below. If the windows separate from the vehicle in a crash, the occupants are at a greater risk of injury. DVUSA will notify owners, and dealers will remove the windows and inspect the paintwork, repainting the vehicles as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact DVUSA customer service at 1-770-705-2070.

16V-261