

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

**CHILD SEATS:**

None during May 2016.

**EQUIPMENT:**

ZF North America, Inc. (ZF) is recalling certain RL 77, and RL 80 EM axle assemblies, Part No.'s 4474077034, 4474077019, 447407718, 4474077021, 4474077020, 4474077036, 4474077026, and 44740770 manufactured May 1, 2014, to May 29, 2015. The steering box may have been manufactured with an incorrect spacer with insufficient height that can cause too much play, causing the connection to wear between the steering wheel and the front axle. If there is a loss of connection between the steering wheel and front axle wheels, it can cause loss of vehicle control, increasing the risk of a crash. ZF will notify owners, and dealers will install a corrected spacer, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact ZF customer service at 1-734-416-6200.

**16E-040**

Chrysler (FCA US LLC) is recalling aftermarket Mopar Canvas Seat Covers for certain 2012-2016 RAM 1500, 2500, and 3500 trucks. These Mopar canvas seat covers were sold through Chrysler dealerships beginning October 15, 2015. The seat covers can impede the deployment of the seat thorax airbags. If the seat cover impedes the air bag deployment, the seat thorax air bags may not provide adequate protection in the event of a crash, increasing the risk of an injury. Chrysler will notify owners to remove the front seat covers and return them for a full refund. The recall began on July 1, 2016. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S30.

**16E-041**

Takata Corporation (Takata) has determined that certain PSPI, PSPI-1.1, PSPI-2, PSPI 6, PSPI-L, and SPI air bag inflators assembled as part of the frontal air bag modules, and used as original equipment or replacement equipment, such as after a vehicle crash necessitating replacement of the original air bags, may rupture due to propellant degradation occurring after long-term exposure to high absolute humidity, high temperatures, and high temperature cycling. This recall addresses vehicles ever registered in the states of Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands. An inflator rupture may result in metal fragments striking the driver or other occupants resulting in serious injury or death. Takata will be working with vehicle manufacturers to determine into which vehicles the affected inflators were installed either as original or replacement equipment during service. As this work progresses, numerous vehicle recalls will likely be announced by the impacted vehicle manufacturers. Takata notified the OEMs on May 16, 2016. NHTSA will supply this information as soon as possible. Note: Vehicles registered outside of these states may be covered by recalls 16E-043 or 16E-044.

**16E-042**

Takata Corporation (Takata) has determined that certain PSPI, PSPI-1.1, PSPI-2, PSPI 6, PSPI-L, and SPI air bag inflators assembled as part of the frontal air bag modules, and used as original equipment or replacement equipment, such as after a vehicle crash necessitating replacement of the original air bags, may rupture due to

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

propellant degradation occurring after long-term exposure to moderate absolute humidity, temperatures, and temperature cycling. This recall addresses vehicles ever registered in the states of Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia. An inflator rupture may result in metal fragments striking the driver or other occupants resulting in serious injury or death. Takata will be working with vehicle manufacturers to determine into which vehicles the affected inflators were installed either as original or replacement equipment during service. As this work progresses, numerous vehicle recalls will likely be announced by the impacted vehicle manufacturers. Takata notified the OEMs on May 16, 2016. NHTSA will supply this information as soon as possible. Note: Vehicles registered outside of these states may be covered by recalls 16E-042 or 16E-044.

**16E-043**

Takata Corporation (Takata) has determined that certain PSPI, PSPI-1.1, PSPI-2, PSPI 6, PSPI-L, and SPI air bag inflators assembled as part of the frontal air bag modules, and used as original equipment or replacement equipment, such as after a vehicle crash necessitating replacement of the original air bags, may rupture due to propellant degradation occurring after long-term exposure to lower absolute humidity, temperature and temperature cycling. This recall addresses vehicles ever registered in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming. An inflator rupture may result in metal fragments striking the driver or other occupants resulting in serious injury or death. Takata will be working with vehicle manufacturers to determine into which vehicles the affected inflators were installed either as original or replacement equipment during service. As this work progresses, numerous vehicle recalls will likely be announced by the impacted vehicle manufacturers. Takata notified the OEMs on May 16, 2016. NHTSA will supply this information as soon as possible. Note: Vehicles registered outside of these states may be covered by recalls 16E-042 or 16E-043.

**16E-044**

Bendix Commercial Vehicle Systems LLC (Bendix) is recalling certain SR-5 Trailer Spring Brake Valves manufactured January 1, 2014, to March 4, 2016. These brake valves were improperly machined without a radius on the internal check valve seat, causing a delay of application of the spring brakes while parking. If there is a delay of the spring brake application, the trailer may roll away after it has decoupled from the tractor, increasing the risk of a crash or injury. The remedy for this recall is still under development. Bendix issued an interim notification on June 17, 2016. Owners may contact Bendix customer service at 1-877-345-9526.

**16E-045**

Hale Products, Inc (Hale) is recalling certain Class 1 Ultraview Touchscreen Displays manufactured September 30, 2011, to May 10, 2016. False activations or deactivations of accessories can happen without the operators knowledge causing accessories to turn on or off, affecting vehicle performance. The unintended turning on or off of accessories such as emergency beacons or automatic snow chains can increase the risk of a crash. Hale will notify the purchasers of the displays. Some models will be reprogrammed, others will get supplemental training guides to prevent the unintended activations. The recall began on June 30, 2016. Owners may contact Hale customer service at 1-800-533-3569.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

**16E-046**

Cummins Inc. (Cummins) is recalling certain ISX12, part number 4358814 and ISX15, part numbers 5317106 and 4358814, engines manufactured from March 7, 2016, through April 12, 2016. These engines have an Engine Control Module (ECM) that may short circuit and blow a fuse, resulting in the engine stalling without warning. If this occurs, the engine cannot be restarted until the ECM and fuse are replaced. An unexpected engine stall increases the risk of a crash. Cummins will notify owners and dealers will replace the existing ECM with a new ECM, free of charge. The recall is expected to begin on July 7, 2016. Owners may contact Cummins customer service at 1-800-343-7357.

**16E-047**

Tucker Rocky Distribution (Tucker Rocky) is recalling certain Speed and Strength SS2200 motorcycle helmets sizes XS, S, M, L, XL, XXL, manufactured January 25, 2013, to June 30, 2014. The helmets failed the penetration testing, failing to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 218, "Motorcycle Helmets." Inadequate helmet protection can increase the risk of serious injury to the wearer. Tucker Rocky will notify owners, and replace the helmet, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Tucker Rocky customer service at 1-817-258-9247.

**16E-048**

xperion E&E USA LLC (xperion) is recalling certain X-Store CNG Fuel Tanks, part numbers TC\_660\_1, TC\_660\_2, TC\_660\_3, TC\_660\_11, TC\_540\_5, 87330000677, 87330000669, and 87330000685, manufactured April 22, 2015, to April 27, 2016. These 27.5, 30, 40 and 45-DGE (Diesel Gallon Equivalent), back of cab and side mounted compressed natural gas (CNG) fuel tanks have a neck adapter that connects the tank boss to the fuel system that may pull out from the tank boss, allowing fuel to leak from the coupling. A CNG fuel leak in the presence of an ignition source increases the risk of a fire. xperion will notify the owners that purchased the affected tanks as part of a Momentum-brand CNG fuel system. xperion will repair the tank connector, free of charge. The recall began on June 3, 2016. Owners may contact xperion customer service at 1-740-788-9560.

**16E-049**

Stanley Assembly Technologies, (SAT) is recalling certain Mac Data Torq air-impact wrenches, part number ADT006, and Stanley Data Torq air-impact wrenches, part number 24N100006, manufactured September 23, 2015, to January 5, 2016. These computer-controlled air impact wrenches used to tighten vehicle lug nuts have software installed that may contain an error allowing the wrench to produce more torque than the amount set by the operator. If the lug nuts were over tightened, the wheel attaching studs may fracture and the wheel may separate from the vehicle, increasing the risk of a crash. SAT will notify the purchasers of the tools, and will recalibrate the impact wrenches and correct the software error. The manufacturer has not yet provided a notification schedule. Owners may contact SAT customer service at 1-614-876-3809.

**16E-050**

**TIRES:**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

None during May 2016.

**VEHICLES:**

QT Equipment is recalling certain model year 2013-2016 Dominator-Propane, Dominator I, Dominator II, Dominator III, and Dominator IV trucks equipped with IMT cranes, models 6000, 7500, 8600, 9500, 10000, 12000, or 14000. The affected cranes have a valve bank cover that may crack and fall from the crane while the crane is being transported. If the valve bank cover detaches from the crane it could be a road hazard, increasing the risk of a crash. QT Equipment will notify owners, and dealers will replace the valve bank cover, with a thicker cover, free of charge. The recall began on June 22, 2016. Owners may contact QT Equipment customer service at 1-800-758-2410.

**16V-262**

Kovatch Mobile Equipment Corp. (KME) is recalling certain model year 2012-2014 Predator Severe-Service vehicles manufactured September 2, 2011, to September 20, 2013. The cab door latch retaining hardware may loosen, preventing the cab door from closing properly and allowing the cab door to open unexpectedly while moving. If the door opens while the vehicle is in motion, the occupants are at an increased risk of injury. KME will notify owners, and dealers will inspect the cab door latch hardware, replacing it as necessary, free of charge. The recall began on May 25, 2016. Owners may contact KME customer service at 1-800-235-3926.

**16V-263**

Maserati North America, Inc. (Maserati) is recalling certain model year 2014-2016 Quattroporte and Ghibli vehicles manufactured February 1, 2013, to September 18, 2015. During the assembly process, the rear tie-rod to hub assembly attaching bolt may not have been properly tightened. An improperly tightened rear tie-rod to hub carrier assembly attaching bolt may allow the tie-rod to separate from the hub carrier, resulting in a loss of control, increasing the risk of a crash. Maserati will notify owners, and dealers will inspect the left and right rear tie-rod to hub carrier assembly attaching bolts to verify that they are properly tightened, replacing the rear tie-rod to hub carrier assembly as necessary, free of charge. The recall is expected to begin during July 2016. Owners may contact Maserati customer service at 1-201-510-2369. Maserati's number for this recall is 303.

**16V-264**

Blue Bird Body Company (Blue Bird) is recalling certain model year 2017 All American Forward Engine transit buses manufactured February 9, 2016, to February 19, 2016 and one Vision transit bus manufactured on February 1, 2016, equipped with Freedman Integrated Child Seats (ICS) Passenger Seats. These vehicles are equipped with seats that may separate from the base frame due to bolt failure. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems." In the event of a crash, the seat can separate from the base frame, increasing the risk of injury to the seat occupant. Blue Bird has notified owners, and dealers will replace the seats, free of charge. The recall began on May 23, 2016. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Bird's number for this recall is R16YP-NSB.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

**16V-265**

Adkins Truck Equipment Co. (Adkins) is recalling certain model year 2013-2016 Dominator-Propane, Dominator I, Dominator II, Dominator III, and Dominator IV trucks equipped with IMT cranes, models 6000, 7500, 8600, 9500, 10000, 12000, or 14000. The affected cranes have a valve bank cover that may crack and fall from the crane while the crane is being transported.. If the valve bank cover detaches from the crane it could be a road hazard, increasing the risk of a crash. Adkins will notify owners, and dealers will replace the valve bank cover with a thicker cover, free of charge. The recall began during May 2016. Owners may contact Adkins customer service at 1-704-596-2299. Adkins' number for this recall is 16E-012.

**16V-266**

Forest River, Inc. (Forest River) is recalling certain model year 2007-2014 Solera, and Coachmen Prism vehicles, built on Mercedes-Benz and Freightliner Sprinter chassis. Upon deployment of the driver's frontal air bag, excessive internal pressure may cause the inflator to rupture. In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator could rupture with metal fragments striking the vehicle occupants potentially resulting in serious injury or death. Forest River will notify owners, and either Mercedes-Benz or Freightliner dealers will replace the driver frontal air bag inflator, free of charge. Parts are not currently available. Interim notices were sent on June 23, 2016. A second notice will be sent when remedy parts are available. Owners may contact Forest River customer service at 1-877-496-3691 or may call the Sprinter/Takata hotline at 1-877-496-3691. Forest River's number for this recall is 51-04262016-0182.

**16V-267**

Volvo Car USA LLC (Volvo) is recalling certain model year 2016 XC90 vehicles manufactured January 27, 2015, to April 23, 2016. The sunroofs on the affected vehicles have a switch on the overhead console that may not be adequately recessed to prevent the switch from being unintentionally pressed. When pressed, the sunroof may fully close. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 118, "Power-Operated Window, Partition, and Roof Panel Systems." If the switch is unintentionally pressed and the sunroof panel closes, there is an increased risk of occupant injury. Volvo will notify owners, and dealers will perform a software upgrade that disables the auto-close function, free of charge. The recall began June 24, 2016. Owners may contact Volvo customer service at 1-800-458-1552 or by visiting <http://Volvo.custhelp.com>. Volvo's number for this recall is R89702.

**16V-268**

Auto Truck Inc. (Auto Truck) is recalling certain model year 2013-2016 IMT Dominator Series III vehicles manufactured April 4, 2013, to January 22, 2016, equipped with IMT cranes, models 6000, 7500, 8600, 9500, 10000, 12000, or 14000. The affected cranes have a valve bank cover that may crack and fall from the crane while the crane is being transported. If the valve bank cover detaches from the crane it could be a road hazard, increasing the risk of a crash. Auto Truck will notify owners, and dealers will replace the valve bank cover, with a thicker cover, free of charge. The recall began on June 24, 2016. Owners may contact Auto Truck customer service at 1-855-288-6875. Auto Truck's number for this recall is TB2016001, and TB2016002.

**16V-269**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

Newmar Corporation (Newmar) is recalling certain model year 2015-2016 Ventana, and Ventana LE vehicles manufactured March 27, 2015, to February 8, 2016, built on a Freightliner chassis. The front sway bar mounting brackets may not fit properly on the axle causing the mounting bolts to bend or loosen. If the sway bar bolts loosen, the sway bar may detach from the axle, affecting the handling and increasing the risk of a crash. Newmar will notify owners, and dealers for Daimler Trucks, manufacturer of the chassis, will modify the sway bar mounting, free of charge. The recall began on June 14, 2016. Owners should contact Daimler Trucks North America LLC at 1-800-547-0712, or e-mail them at DTNA.Warranty.Campaigns@Daimler.com to locate a service center. Owners may also contact the Newmar service department at 1-800-731-8300. Newmar's number for this recall is 16V 208.

**16V-270**

Kaufman Trailers (Kaufman) is recalling certain model year 2015-2016 Flatbed Equipment and Wedge Car Hauler trailers manufactured April 1, 2015, to April 30, 2016. The lock nuts that secure the axle hanger to the springs may not have been properly crimped allowing the nut to loosen and detach during operation. If the nuts were to fall off, the bolts could loosen, and the axle may disconnect from the spring hangers, shifting or detaching from the trailer and increasing the risk of a crash. Kaufman will notify owners, and provide them with new Nylock replacement nuts, free of charge. The recall began on May 20, 2016. Owners may contact Kaufman customer service at 1-336-790-6800.

**16V-271**

General Motors LLC (GM) is recalling certain model year 2016 Chevrolet Malibu vehicles manufactured March 7, 2016, through March 12, 2016. The memory chip in the electronic brake control module (EBCM) may fail and cause the loss of electronically controlled brake systems including anti-lock brakes (ABS) and electronic stability control (ESC). As such, these vehicles fail to conform to Federal Motor Vehicle Safety Standard (FMVSS) number 126, "Electronic Stability Control Systems." If the EBCM fails the primary braking system will still function, however, the loss of ABS and ESC increase the risk of a crash. GM will notify owners, and dealers will install a replacement EBCM, free of charge. The recall began on June 17, 2016. Owners may contact Chevrolet customer service at 1-800-222-1020). GM's number for this recall is 39440.

**16V-272**

Chrysler (FCA US LLC) is recalling certain model year 2009-2016 Dodge Journey vehicles manufactured July 31, 2007, to November 12, 2016. After exposure to cold temperatures, the power steering return hose may rupture at engine start-up causing a loss of power steering assist. A loss of power steering assist may require extra steering effort, especially at lower speeds, increasing the risk of a crash. Chrysler will notify owners, and dealers will replace the power steering return hoses, steel tubes, and power steering oil cooler, free of charge. The recall began on May 24, 2016. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S08.

**16V-273**

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain model year 2015-2016 Land Rover Discovery Sport vehicles manufactured September 17, 2014, to March 5, 2016. In the affected vehicles, the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

license plate illumination lamp may fall out. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Without license plate illumination, the vehicle may be difficult to identify at night. Land Rover will notify owners, and dealers will replace both rear license plate lamp housings, free of charge. The recall began on June 21, 2016. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is P077.

**16V-274**

Spartan Motors USA (Spartan) is recalling certain model year 2012-2015 Utilimaster Aeromaster vehicles manufactured from November 5, 2013, through March 31, 2016. The push-to-trip circuit breaker for the lift gate system may have been improperly wired. As a result, even though the circuit breaker has been pushed, the lift gate system may still be powered. With an improperly wired circuit breaker, maintenance personnel could be unaware that the lift gate system is still energized, increasing the risk of personal injury. Spartan will notify owners, and dealers will move and properly install the push-to-trip breaker on the driver's side of the vehicle, free of charge. The recall began on June 8, 2016. Owners may contact Spartan customer service at 1-800-543-5008. Spartan's number for this recall is 16013.

**16V-275**

Elpers Truck Equipment (Elpers) is recalling certain model year 2013-2016 Peterbilt 337, International 4300, 4400, Maxforce, Dodge 5500, and Ford F-450, and F-550 trucks manufactured April 4, 2013, to January 22, 2016 and equipped with IMT cranes, models 6000, 7500, 8600, 9500, 10000, 12000, and 14000. The affected cranes have a valve bank cover that may crack and fall from the crane while the crane is being transported. If the valve bank cover detaches from the crane it could be a road hazard, increasing the risk of a crash. Elpers will notify owners, and dealers will replace the valve bank cover, with a thicker gauge cover, free of charge. The recall began on May 25, 2016. Owners may contact Elpers' customer service at 1-877-244-4596. Elpers' number for this recall is TB2016001 - IMT dist.

**16V-276**

Winnebago Industries, Inc (Winnebago) is recalling certain model year 2016 Winnebago Journey and Forza, and 2016 Itasca Solei and Meridian motor homes manufactured May 7, 2015, to March 25, 2016. In the affected vehicles, the front sway bar mounting brackets may not fit properly on the axle causing the mounting bolts to bend or loosen. If the sway bar bolts loosen, the sway bar may detach from the axle, affecting the handling and increasing the risk of a crash. Winnebago will notify owners, and dealers for Daimler Trucks, manufacturer of the chassis, will modify the sway bar mounting, free of charge. The recall began on June 7, 2016. Owners may contact Winnebago customer service at 1-641-585-3535.

**16V-277**

REV Recreation Group (REV) is recalling certain model year 2016-2017 Holiday Rambler Endeavor motor homes, models 40DP, 40G, 40E, 40G and 40X, manufactured November 23, 2015, to April 7, 2016, and Holiday Rambler Endeavor XE motor homes, model 37PE, manufactured November 17, 2015, to April 6, 2016. The affected vehicles have a section of framework that may rub, or cause the mud flap to rub, against the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

front passenger-side tire, resulting in excessive tire wear. Additionally, steering may be restricted. Excessive tire wear may result in tire failure. Restricted steering can affect control of the vehicle. Either condition increases the risk of a crash. REV will notify owners, and dealers will inspect the tube steel skirt framing and remove the diagonal section if present, and install additional screws to secure the mud flap. This repair will be done free of charge. The recall began on June 14, 2016. Owners may contact REV customer service at 1-800-509-3417. REV's number for this recall is 160429REV.

**16V-278**

KTM North America, Inc. (KTM) is recalling certain model year 2015-2016 1290 Super Adventure motorcycles manufactured December 1, 2014, to December 11, 2015. These motorcycles have a rear shock absorber that may leak oil from the rebound damping plug, resulting in a loss of shock function. Loss of function of the rear shock may affect the handling of the motorcycle, increasing the risk of a crash. KTM will notify owners, and dealers will inspect the rebound damping plug for leaking and replace the shock absorber, as necessary, and install a new version of the suspension control unit software, free of charge. The recall began June 28, 2016. Owners may contact KTM customer service at 1-888-985-6090. KTM's number for this recall is TB1611.

**16V-279**

Newmar Corporation (Newmar) recalling certain model year 2014-2015 Essex, and 2015 Mountain Aire and London Aire motorhomes manufactured from May 20, 2013, through April 09, 2015. These vehicles are built on Freightliner rear engine chassis that have 18,000lb or 20,000lb-capacity front axles. In these motorhomes, the power steering fluid temperature may exceed the power steering hose material rating, subsequently causing the hoses to fail, resulting in a sudden loss of power steering. Loss of power steering assist would result in increased difficulty to steer the vehicle in either direction at low speeds, increasing the risk of a crash. Newmar will notify owners, and Freightliner dealers will replace the power steering hose with a higher temperature rated one, free of charge. The recall began on June 15, 2016. Owners may contact Freightliner customer service at 1-800-547-0712 or Newmar customer service at 1-800-731-8300. Newmar's number for this recall is 16V-121.

**16V-280**

Turtle Top is recalling certain model year 2016 Odyssey transit buses manufactured December 17, 2015, to March 29, 2016. These vehicles are equipped with seats that may separate from the base frame due to bolt failure. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 222, "School Bus Passenger Seating and Crash Protection", and 213, "Child Restraint Systems." In the event of a crash, the seat can separate from the base frame, increasing the risk of injury to the seat occupant. Turtle Top will notify owners, and dealers will replace the seats, free of charge. The recall began on June 22, 2016. Owners may contact Turtle Top customer service at 1-574-831-4340. Turtle Top's number for this recall is 16E-037.

**16V-281**

Keystone RV Company (Keystone) is recalling certain model year 2016-2017 Keystone Outback recreational trailers, model 326RL, manufactured February 24, 2016, to April 21, 2016. These vehicles have a television



**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

mounting bracket that may not be properly secured to the wall. The improperly secured bracket may allow the TV to fall, increasing the risk of injury to an occupant nearby. Keystone has notified the affected owners. Dealers will re-install the TV bracket with larger screws, free of charge. The recall began on May 13, 2016. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 16-251.

**16V-282**

Harley-Davidson Motor Company (Harley-Davidson) is recalling certain model year 2014-2016 FXDL Dyna Low Rider manufactured January 6, 2014 to April 7, 2016. In the affected motorcycles, engine vibrations can cause the ignition switch to become internally damaged and could cause the engine to unexpectedly shut off while driving. If the vibration causes the engine to shut off, the motorcycle would stall while riding, increasing the risk of a crash. Harley-Davidson will notify owners, and dealers will replace with a improved ignition switch, free of charge. The recall began on June 3, 2016. Owners may contact Harley-Davidson customer service at 1-800-258-2464. Harley-Davidson's number for this recall is 0168.

**16V-283**

Chrysler Group LLC (Chrysler) is recalling certain model year 2016 Jeep Cherokee vehicles manufactured October 3, 2015, to March 22, 2016. The right halfshaft may have been incorrectly manufactured causing it to fracture without warning. A fractured halfshaft may disconnect from the drive axle, increasing the risk of a crash. Chrysler will notify owners, and dealers will replace the right halfshaft, free of charge. The recall began on June 30, 2016. Owners may contact Chrysler's customer service at 1-800-853-1403. Chrysler's recall number is S39.

**16V-284**

Forest River, Inc. (Forest River) is recalling certain model year 2016-2017 Berkshire manufactured May 29, 2015, to April 26, 2016, and 2016 Coachmen Cross Country recreational vehicles manufactured April 30, 2015, to December 14, 2015 and built on Daimler Trucks chassis. The front sway bar mounting brackets may not fit properly on the axle causing the mounting bolts to bend or loosen. If the sway bar bolts loosen, the sway bar may detach from the axle, affecting the handling and increasing the risk of a crash. Forest River will notify owners, and Daimler Trucks dealers will modify the mounting of the sway bar, free of charge. The recall began on June 30, 2016. Owners may contact DTNA customer service at 1-800-547-0712. Forest River's number for this recall is 40-05032016-0183.

**16V-285**

Great Lakes Manufacturing Inc. (Great Lakes) is recalling certain model year 1998-2016 Drywall Pup trailers manufactured January 1, 1998, to April 29, 2016. The rear impact guards on the affected trailers do not extend within 4" of the side of the vehicle. As such, these trailers fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 224, "Rear Impact Protection." If the rear impact guards do not stretch the required length, it can increase the risk of injury in the event of a crash. Great Lakes will notify owners, and dealers will retrofit a new rear impact guard, free of charge. The recall began on June 29, 2016. Owners may contact Great Lakes customer service at 1-920-842-2012.

**16V-286**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

Chrysler Group LLC (Chrysler) is recalling certain model year 2016 Jeep Cherokee vehicles manufactured September 30, 2015, to October 2, 2015. The left halfshaft may have been incorrectly manufactured causing it to fracture without warning. A fractured halfshaft may disconnect from the drive axle, increasing the risk of a crash. Chrysler will notify owners, and dealers will replace the left halfshaft, free of charge. The recall began on June 30, 2016. Owners may contact Chrysler's customer service at 1-800-853-1403. Chrysler's recall number is S38.

**16V-287**

Chrysler (FCA US LLC) is recalling certain model year 2011-2016 Right Hand Drive Jeep Wrangler vehicles manufactured February 16, 2010, to May 2, 2016. The clockspring assembly may become contaminated with dust and cause the air bag circuit to fail. Failure of the air bag circuit may prevent the driver's frontal air bag from deploying in the event of a crash, increasing the risk of injury. Chrysler will notify owners, and dealers will replace the clockspring, wheel back cover, and column shroud, free of charge. Remedy parts are currently unavailable. Interim notices were mailed to owners on July 5, 2016. Owners will receive a second notice when remedy parts become available. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S40.

**16V-288**

Pacific Coachworks is recalling certain model year 2016 Rage'N toy haulers, model 27FBX, manufactured April 1, 2015, to April 30, 2016. There may be an incorrect Cargo Carrying Capacity (CCC) value printed on the Federal Information label, allowing the vehicle to be over loaded. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 120, "Wheel and Rims - Other Than Passenger Cars." If the vehicle was loaded to the incorrect CCC on the label, the vehicle would be overloaded, possibly causing tire failure, and increasing the risk of a crash. Pacific Coachworks will notify owners, and dealers will issue a corrected Federal Information Tag with the correct CCC information, free of charge. The recall began on June 27, 2016. Owners may contact Pacific Coachworks customer service at 1-951-686-7294.

**16V-289**

Chrysler (FCA US LLC) is recalling certain model year 2007-2010 Jeep Wrangler JK vehicles manufactured March 2, 2006, to August 13, 2010. The clockspring assembly may become contaminated with dust and cause the air bag circuit to fail. Failure of the air bag circuit may prevent the driver's frontal air bag from deploying in the event of a crash, increasing the risk of injury. Chrysler will notify owners, and dealers will replace the clockspring, wheel back cover, and column shroud, free of charge. Remedy parts are expected to become available in November 2016. Owners were mailed interim notices on July 5, 2016. Owners will receive a second notice when remedy parts become available. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S33.

**16V-290**

Keystone RV Company (Keystone) is recalling certain model year 2016-2017 Passport recreational trailers, model 3350BHWE, manufactured January 6, 2016, to April 21, 2016. These trailers were built with axles that

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

have a 3500 pound capacity instead of being built with axles that have a 4400 pound capacity. If the vehicle is loaded to the specifications listed, the incorrect axle may be overloaded and fail as a result, increasing the risk of a crash. Keystone has notified owners, and dealers will replace the axle, free of charge. The recall began May 16, 2016. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 16-252.

**16V-291**

Subaru of America, Inc. (Subaru) is recalling certain model year 2016-2017 Legacy and Outback vehicles manufactured February 29, 2016, to May 6, 2016. The steering column on the affected vehicles may have been improperly machined, and as a result, turning the steering wheel may have no effect on the direction of the wheels. The loss of steering ability would increase the risk of a crash. Subaru will notify owners, and dealers will inspect the lot number on the steering column, replacing the steering column, as necessary, free of charge. The recall began May 13, 2016. Owners may contact Subaru customer service at 1-800-782-2783 or by visiting <http://www.wtd65.service-campaign.com>. Subaru's number for this recall is WTD-65. Note: Until the vehicles have been inspected, owners are advised not to drive their vehicles.

**16V-292**

E-One Incorporated (E-One) is recalling certain model year 2015-2016 Cyclone II, Quest II and Typhoon emergency vehicles manufactured May 1, 2015, to March 31, 2016, equipped with pumps to provide pressurized water to aid in fighting fires. These pumps have 6" intake strainers that may have been improperly soldered during production and, as a result, the strainers may come apart during use, allowing parts of the strainer and debris to enter the pump, possibly damaging the pump. If the strainer and/or debris enters the pump, and the operator is forced to shut down the pump, reducing firefighting effectiveness, there could be an increased risk of injury. E-One will notify owners to check the strainer for missing solder at the joints. Any strainers missing solder will be replaced, free of charge. The recall began on June 6, 2016. Owners may contact E-One customer service at 1-352-861-3612 or Hale customer service at 1-800-533-3569.

**16V-293**

Kovatch Mobile Equipment Corp. (KME) is recalling certain model year 2016 KME Predator and KME 2016-2107 Predator Severe Service and Panther emergency vehicles, equipped with pumps to provide pressurized water to aid in fighting fires. These pumps have 6" intake strainers that may have been improperly soldered during production and, as a result, the strainers may come apart during use, allowing parts of the strainer and debris to enter the pump, possibly damaging the pump. If the strainer and/or debris enters the pump, and the operator is forced to shut down the pump, reducing firefighting effectiveness, there could be an increased risk of injury. KME will notify owners to check the strainer for missing solder at the joints. Any strainers missing solder will be replaced, free of charge. The recall began on June 14, 2016. Owners may contact KME customer service at 1-570-669-5577 or Hale Products Customer Service Center at 1-800-533-3569.

**16V-294**

Champion Bus, Inc. (Champion) is recalling certain model year 2016 Champion Bus Challenger shuttle buses manufactured January 29, 2016, to April 4, 2016. These vehicles are equipped with seats that may separate from the base frame due to bolt failure. As such, these seats fail to comply with the requirements of Federal

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

Motor Vehicle Safety System (FMVSS) number 222, "School Bus Passenger Seating and Crash Protection." In the event of a crash, the seat can separate from the base frame, increasing the risk of injury to the seat occupant. Champion will notify owners, and dealers will replace the seats, free of charge. The recall began on May 27, 2016. Owners may contact Champion customer service at 810-724-1753 extension 415.

**16V-295**

Supreme Corporation (Supreme) is recalling certain model year 2011-2014 Signature Van, Iner-City, and Kold King vehicles manufactured April 1, 2011, to December 31, 2014. These vehicles have roof marker lights mounted on composite corner caps. In the event that a marker light short circuits, the corner cap may catch fire. Supreme will notify owners, and dealers will install an in-line fuse with suitable amperage for the marker light circuit, free of charge. The recall began on July 1, 2016. Owners may contact Supreme customer service at 1-574-642-0800.

**16V-296**

Quality Trailers is recalling certain model year 2015 Flatbed Equipment and Wedge Car Hauler trailers manufactured April 1, 2015, to April 30, 2016. The lock nuts that secure the axle hanger to the springs may not have been properly crimped allowing the nut to loosen and detach during operation. If the nuts were to fall off, the bolts could loosen, and the axle may disconnect from the spring hangers, shifting or detaching from the trailer and increasing the risk of a crash. Quality Trailers will notify owners, and provide them with new Nylock replacement nuts, free of charge. The recall began on May 26, 2016. Owners may contact Quality customer service at 1-336-859-2501.

**16V-297**

Supreme Corporation (Supreme) is recalling certain model year 2010-2016 Classic American Trolley vehicles manufactured November 19, 2010, to January 29, 2016 and equipped with certain Recaro Ergo-M Commercial Bus Driver Seats. The affected seats have J-Brackets that may be missing welds which could allow the seat belt anchorage assembly to separate from the J-Bracket. If the seat belt anchorage assembly separates from the J-Bracket, the bus driver may not be properly restrained in the event of a crash increasing their risk of injury. Supreme will notify owners to have a Recaro dealers inspect the seats for missing welds. If missing welds are found, the seats will be repaired, free of charge. The recall began on June 20, 2016. Owners may contact Recaro customer service at 1-248-484-3203 or Supreme customer service at 1-574-642-0800.

**16V-298**

Supreme Corporation (Supreme) is recalling certain model year 2007-2009 Silver Crown and Ponyxpress vehicles manufactured January 24, 2007, to June 30, 2010 and equipped with entry steps that electrically extend and retract. The bolt that attaches the fan gear assembly to the steps may fracture allowing the fan gear to disengage from the steps. As a result, the steps may not remain in the expected position and may become unstable. Unstable entry and exit steps increase the risk of injury. Supreme will notify owners and advise them to have a Lippert Components dealer install a retainer bracket, free of charge. The recall began on June 20, 2016. Owners may contact Lippert Components customer service at 1-574-537-8900 or Supreme customer service at 1-574-642-0800.

**16V-299**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

Chrysler (FCA US LLC) is recalling certain model year 2016 Dodge Grand Caravan and Chrysler Town and Country vehicles manufactured March 16, 2016, to March 17, 2016. The nuts on the third row seatbacks were incorrectly torqued and may become loose. If the third row seatback becomes loose, it may separate from the seat frame, increasing the risk of injury. Chrysler will notify owners, and dealers will re-torque the third row seatback nuts, free of charge. The recall began on July 1, 2016. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S37.

**16V-300**

Chrysler (FCA US LLC) is recalling certain 2016 RAM 1500 trucks manufactured February 19, 2016, to March 3, 2016. The front halfshafts may have been incorrectly manufactured causing them to fracture without warning. A fractured halfshaft may damage underbody components and create road debris, increasing the risk of a crash. Chrysler will notify owners, and dealers will replace both front halfshafts, free of charge. The recall began on July 5, 2016. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S32.

**16V-301**

Chrysler (FCA US LLC) is recalling certain model year 2012-2016 Fiat 500 vehicles manufactured June 21, 2010, through January 12, 2016, equipped with a manual transmission. The clutch diaphragm spring may fracture and fail, causing an inability to switch gears. If the clutch diaphragm spring fails, the driver may not be able to shift gears or the vehicle may lose motive power, increasing the risk of a crash. The remedy for this recall will include the installation of a clutch pedal limiter and a clutch pedal switch. Interim notices were mailed to owners on June 28, 2016. Owners will receive a second notice when remedy parts become available. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S34.

**16V-302**

Chrysler (FCA US LLC) is recalling certain model year 2013-2016 Fiat 500e vehicles manufactured March 22, 2012, to January 29, 2016. The power inverter module (PIM) may experience voltage spikes which can cause the propulsion system to shut down and loss of motive power. Loss of motive power can increase the risk of a crash. Chrysler will notify owners, and dealers will update the PIM software, free of charge. The recall began on July 5, 2016. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S26.

**16V-303**

Jayco, Inc. (Jayco) is recalling certain 2016 Jay Flight SLX recreational trailers manufactured March 3, 2016, to April 20, 2016. The bolts that secure the propane tank to the trailer's A-frame may be missing lock washers, allowing the propane tank to loosen and detach from the vehicle. If the propane tank detaches from the trailer, there is an increased risk of a crash. Jayco has notified owners, and dealers will install the lock washers to the two bolts that secure the propane tank to the A-frame, free of charge. The recall began on May 17, 2016. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9901298.

**16V-304**

Jayco, Inc. (Jayco) is recalling certain model year 2017 Jay Flight trailers manufactured May 6, 2016, to May 9,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

2016. The weight ratings on the tire labels are incorrect. Thus, these vehicles fail to comply with the requirements of Federal Vehicle Safety Standard (FMVSS) No. 110, "Tire Selection and Rims." Incorrect weight ratings on the tire label could cause the operator to overload the vehicle and lead to premature tire wear, increasing the risk of a crash. All affected units are in dealer inventory. Dealers will be provided new, corrected labels. The recall began May 27, 2016. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9901299.

**16V-305**

Mercedes-Benz USA, LLC (MBUSA) is recalling certain model year 2016 SLK300 vehicles manufactured January 19, 2016 to April 19, 2016. In the affected vehicles, improperly manufactured lock nuts may have been used on the rear wheel tie rod connection, and as a result, the rear wheel alignment may change and the rear axle may steer independently. A change of the rear wheel alignment and independent steering of the rear axle may increase the risk of a crash. MBUSA will notify owners, and dealers will replace the lock nuts on the rear tie rods, free of charge. Owners may contact MBUSA customer service at 1-800-367-6372. MBUSA's number for this recall is 2016050008.

**16V-306**

Altec Industries Inc. (Altec) is recalling certain model year 2014-2016 DL and DM Digger Derricks manufactured October 1, 2014, to April 30, 2016 with the digger booms mounted in the corner. The rotation bearing fasteners on the affected vehicles may not have been properly torqued. If the fasteners are loose or improperly torqued, structural failure may result, causing unexpected movement of the digger derrick and increasing the risk of injury. Altec has notified owners, and instruct them to perform the annual torque inspection, free of charge. The recall began June 2, 2016. Owners may contact Altec customer service at 1-877-462-5832. Altec's number for this recall is CSN 633.

**16V-307**

Mercedes-Benz USA, LLC (MBUSA) is recalling certain model year 2016 AMG GT S vehicles manufactured June 1, 2015 to July 24, 2015. In affected vehicles, the adhesive bond between the carbon-fiber driveshaft and the rear flange may fail, and as a result, there may be a loss of torque to the rear wheels. If the adhesive bond fails and results in a loss of torque to the rear wheels, the vehicle operator may be unable to move the vehicle, or may experience deceleration if the vehicle is in motion, increasing the risk of a vehicle crash. MBUSA will notify owners, and dealers will inspect and replace the carbon-fiber driveshaft, as necessary, free of charge. Owners may contact MBUSA customer service at 1-800-367-6372. MBUSA's number for this recall is 2016050008.

**16V-308**

Eldorado National-Kansas (Eldorado) is recalling certain model year 2016 Advantage and Aerotech transit buses manufactured January 15, 2016, to January 29, 2016 and built on a Ford chassis. These vehicles are equipped with seats that may separate from the base frame due to bolt failure. As such, these seats fail to comply with the requirements of Federal Motor Vehicle Safety System (FMVSS) number 222, "School Bus Passenger Seating and Crash Protection." In the event of a crash, the seat can separate from the base frame, increasing the risk of injury to the seat occupant. Eldorado has notified owners, and dealers will replace the seats, free of charge. The recall began June 6, 2016. Owners may contact Freedman Seating Company at 1-773-

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

524-2440 or Eldorado customer service at 1-800-955-9086.

**16V-309**

Collins Bus Corporation (Collins) is recalling certain 2016 DH416 school buses manufactured February 18, 2016, to February 19, 2016 built on Ford chassis, and 2016 DE516 school buses manufactured January 18, 2016, to February 19, 2016 built on Chevrolet chassis. These vehicles are equipped with seats that may separate from the base frame due to bolt failure. As such, these seats fail to comply with the requirements of Federal Motor Vehicle Safety System (FMVSS) number 222, "School Bus Passenger Seating and Crash Protection." In the event of a crash, the seat can separate from the base frame, increasing the risk of injury to the seat occupant. Collins will notify owners, and the manufacturer of the seats will replace the seats free of charge. The recall began on June 17, 2016. Owners may contact Collins customer service at 1-800-533-1850. Collins' number for this recall is 16E037.

**16V-310**

BMW of North America, LLC (BMW) is recalling certain model year 2011 X5 xDrive 35i, xDrive50i, X5 M, X6 xDrive35i, X6 xDrive50i, and X6 M vehicles manufactured April 5, 2010, to November 20, 2010, 2011 X5 xDrive35d diesel vehicles manufactured April 7, 2010, to November 20, 2010, and 2011 X6 Active Hybrid vehicles manufactured April 15, 2010, to November 17, 2010. The affected vehicles have a front driveshaft universal joint that may not seal out water and debris from getting in and damaging the joint, which could lead to its failure. If the front universal joint fails, the front wheels would not be driven, affecting vehicle traction. Additionally, continued driving of the vehicle with a broken front universal joint may damage other components. Either condition may increase the risk of a crash. BMW will notify owners, and dealers will replace the front driveshaft, free of charge. The recall is expected to begin during July 2016. Owners may contact BMW customer service at 1-800-525-7417.

**16V-311**

Kia Motors America (Kia) is recalling certain model year 2013 Forte vehicles manufactured September 10, 2012, to October 31, 2012. The screws that hold the front seatbelt retractor retaining plates may not have been properly tightened, and as a result, the seatbelt retractor retaining plates may break in a crash. If a retaining plate breaks during a crash, pieces of the plate could strike the occupants, increasing risk of injury. Kia will notify owners, and dealers will inspect and replace both front seatbelt assemblies, as necessary, free of charge. Owners may contact Kia customer service at 1-800-333-4542. The recall began July 1, 2016. Kia's number for this recall is SC132.

**16V-312**

Spartan Motors (Spartan) is recalling certain model year 2007-2015 Spartan K3 and MM motorhome chassis manufactured September 21, 2006, to March 23, 2015. In the affected vehicles, the flexible exhaust tube may tear allowing hot exhaust to blow against other components or materials. If hot exhaust gas contacts other components or materials, it can increase the risk of a fire. Spartan will notify the motorhome manufacturers that purchased the affected chassis, and Spartan dealers will inspect the alignment of the tubes, correcting them and replacing any that are torn. These repairs will be performed free of charge. The recall began on June 23, 2016. Owners may contact Spartan customer service at 1-517-543-6400. Spartan's number for this recall is 16014.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

**16V-313**

Stoughton Trailers, LLC (Stoughton) is recalling certain 2014 AHV, AVW, AVXW and ZGPVW trailers. These trailers are equipped with certain SAF-Holland-brand CBX Trailer Suspension Air Ride Axle Systems. The affected trailer suspensions have pivot bolts that may fail. Failure of the pivot bolts may cause the suspension and attached axle to separate from the trailer, increasing the risk of a crash. Stoughton will notify owners, and SAF-Holland-approved repair shops will replace the defective pivot bolts with new pivot bolts, free of charge. Owners may contact Stoughton customer service at 1-608-873-2555, or SAF-Holland customer service at 1-888-396-6501. Note: This recall is an expansion of recall 14V-268.

**16V-314**

Lakota Corporation (Lakota) is recalling certain model year 2014 Luxe trailers. The affected trailers are equipped with certain Frigidaire KG series convection microwaves, model CFMV154CLS, that may start on their own and begin heating when unattended. If the microwave starts on its own and there are contents inside, a fire could result. Lakota will notify owners, and dealers will replace the membrane/keypad component, free of charge. The recall began on June 3, 2016. Owners may contact Lakota customer service at 1-574- 848-1636 or service@lakotatrailers.com.

**16V-315**

Autocar, LLC (Autocar) is recalling certain model year 2016-2017 Xpeditor vehicles manufactured March 04, 2016, through April 21, 2016. The tab lock washers on the rear axle wheel ends may not have been properly bent over the outer spindle nut during assembly. If the spindle nuts loosen, the wheel assembly may separate from the rear axle, increasing the risk of a crash. Autocar will notify owners and dealers will inspect the tab lock washers and remedy tabs where needed, free of charge. The recall began on June 30, 2016. Owners may contact Autocar's customer service at 1-765-489-5499. Autocar's number for this recall is ACX-1602.

**16V-316**

Mobility Works (WMK Inc.) is recalling certain model year 2014-2015 Ford E-150, E-250, E-350, and Chevrolet Express 2500 vans manufactured January 1, 2014, to December 31, 2015, and equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts by Ricon. The platform side plate of the affected wheelchair lifts may crack. Additionally, the lifts are equipped with folding link arms that may have pivot holes that are too big, allowing the bearings to move out of position. If the platform side plates crack or the platform mounting fails from out-of-position bearings, the lift platform can separate from the lift and come to rest against the vehicle's lift door. When the vehicle's doors are opened, the platform may fall onto the lift operator, increasing their risk of injury. Mobility Works will notify owners, and Ricon dealers will inspect the link arms for damage or for displaced bearings. The platform will be inspected for cracks. Any damaged parts will be replaced, free of charge. The recall began on June 17, 2016. Owners may contact Mobility Works customer service at 1-800-769-8267. Mobility Works' number for this recall is 16E-020.

**16V-317**

Heartland Recreational Vehicles, LLC (Heartland) is recalling certain 2016-2017 trailers manufactured



**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

September 28, 2015, to April 30, 2016. The safety chains located on the A- frame are rated for 11,700 pounds instead of chains that are rated equal or greater than the gross vehicle weight rating (GVWR). In the event the main trailer connection fails, the weight of the trailer could break the safety chains. This would allow the trailer to separate from the vehicle, increasing the risk of a crash. Heartland will notify owners, and dealers will replace the chains, free of charge. The recall began on June 2, 2016. Owners may contact Heartland customer service at 1-877-262-8032.

**16V-318**

Autocar Industries, LLC (Autocar) is recalling certain model year 2016-2017 Auto Xspotter and 2017 Autocar Xpert vehicles manufactured March 04, 2016, through April 21, 2016. The tab lock washers on the rear axle wheel ends may not have been properly bent over the outer spindle nut during assembly. If the spindle nuts loosen, the wheel assembly may separate from the rear axle, increasing the risk of a crash. Autocar will notify owners and dealers will inspect the tab lock washers and remedy tabs where needed, free of charge. The recall began on June 30, 2016. Owners may contact Autocar's customer service at 1-765-489-5499. Autocar's number for this recall is MDTT-1601.

**16V-319**

Gillig LLC (Gillig) is recalling certain 2016 Low Floor vehicles manufactured March 3, 2016, to April 21, 2016. The driver's side window on the affected vehicles may block too much light, thereby decreasing the driver's visibility. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 205, "Glazing Materials." Reduced driver's visibility can increase the risk of a crash. Gillig will notify owners, and dealers will install compliant driver's windows, free of charge. The recall began on June 20, 2016. Owners may contact Gillig customer service at 1-800-735-1500.

**16V-320**

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2012-2016 FCCC XCL, XCM, XCP, and XCR motorhome chassis manufactured January 23, 2012, to July 23, 2015. The throttle pedal position sensor on the affected vehicles may not return to zero, causing the engine brake to suddenly not activate as expected, reducing the vehicle's deceleration ability. A sudden loss of an engine brake without warning on a motorhome may lead to a reduced brake capacity potentially increasing the risk of a crash. DTNA will notify owners, and dealers will replace the throttle pedal, free of charge. An interim notice will be mailed to owners during July 2016. A second notice will be mailed to owners when parts become available. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-711.

**16V-321**

Keystone RV Company (Keystone) is recalling certain model year 2016-2017 Keystone Summerland recreational trailers, models 1700FQ, 1750RD and 1800BH, manufactured April 8, 2016, to April 20, 2016. The trailers may have been manufactured with ST215/75R14 Load Range C tires rated for 1870lbs, when they should have been manufactured with ST215/75R14 Load Range D tires rated for 2200lbs. Vehicle owners may inadvertently overload the tires which may result in tire failure, thereby increasing the risk of a crash. Keystone has notified owners, and dealers will replace the tires with ones of the proper load rating, free of charge. The recall began on May 25, 2016. Owners may contact Keystone customer service at 1-866-425-4369.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

Keystone's number for this recall is 16-253.

**16V-322**

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2014-2017 Thomas Built Buses Saf-T-Liner HDX school buses manufactured November 29, 2012, to February 4, 2016. These vehicles use a rubber elbow to connect a coolant line to a heater inside the bus. This elbow may restrict coolant flow and possibly fail as a result of the increased stress on the elbow. If the rubber elbow fails, hot coolant may leak inside the bus body increasing risk of injury to the passengers. DTNA will notify owners, and dealers will replace the rubber elbow with a nylon fitting, free of charge. An interim notice is scheduled to be sent to owners on July 10, 2016. A second notice will be mailed to owners when the final remedy becomes available. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-708.

**16V-323**

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2014-2017 Thomas Built Buses Saf-T-Liner HDX buses manufactured November 29, 2012, to February 4, 2016. These vehicles use a rubber elbow to connect a coolant line to a heater inside the bus. This elbow may restrict coolant flow and possibly fail as a result of the increased stress on the elbow. If the rubber elbow fails, hot coolant may leak inside the bus body increasing risk of injury to the passengers. DTNA will notify owners, and dealers will replace the rubber elbow with a nylon fitting, free of charge. An interim notice is scheduled to be sent to owners on July 10, 2016. A second notice will be mailed to owners when the final remedy becomes available. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-708.

**16V-324**

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2011-2017 Thomas Built Buses Saf-T-Liner HDX school buses manufactured April 28, 2010, to April 15, 2016. The affected vehicles have a transmission retarder that may increase coolant system pressure high enough to cause hose fatigue and lead to premature failure of the hose, resulting in a coolant leak inside the bus body. If the heater hose fails, hot coolant may leak inside the bus body increasing risk of injury to the passengers. DTNA will notify owners, and dealers will replace the heater hose, free of charge. The recall is expected to begin July 10, 2016. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-709.

**16V-325**

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2011-2017 Thomas Built Buses Saf-T-Liner HDX buses manufactured April 28, 2010, to April 15, 2016. The affected vehicles have a transmission retarder that may increase coolant system pressure high enough to cause hose fatigue and lead to premature failure of the hose, resulting in a coolant leak inside the bus body. If the heater hose fails, hot coolant may leak inside the bus body increasing risk of injury to the passengers. DTNA will notify owners, and dealers will replace the heater hose, free of charge. The recall is expected to begin July 10, 2016. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-709.

**16V-326**

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2015-2016 FCCC XCR chassis

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

manufactured May 12, 2014, to December 10, 2015. The incomplete vehicle document (IVD) labels incorrectly list the tire pressures as 130 psi in the steer and tag axle positions rather than the correct rating of 120psi. If the tire is inflated to the incorrect PSI on the label, the rims may suddenly fail due to being over pressurized, increasing the risk of a crash. DTNA notified the only purchaser of the affected chassis and provided them with corrected IVD labels, free of charge. DTNA will not notify the motorhome owners directly. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-710.

**16V-327**

Ameritrans Bus, Inc. (Ameritrans) is recalling certain model year 2012-2016 285 shuttle buses manufactured from August 1, 2012, through May 13, 2016 and built on Ford E-450 chassis. The certification labels may have an inaccurate gross vehicle weight rating (GVWR). As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the GVWR is unknowingly exceeded, vehicle handling may be adversely affected, increasing the risk of a crash. Ameritrans will notify owners, and dealers will remove and/or reposition bus seats as necessary and install a corrected labels, free of charge. The recall is expected to begin during July 2016. Owners may contact Ameritrans customer service at 1-574-262-8935.

**16V-328**

Thor Motor Coach (TMC) is recalling certain 2017 Tuscany, Tuscany ZTE, and Venetian motorhomes manufactured March 15, 2016, to April 7, 2016. The isolator relay cable for the chassis battery was improperly installed which could cause sudden, unexpected loss of power. If the motorhome experiences an unexpected loss of power, it can increase the risk of a crash. TMC will notify owners, and dealers will correctly install the isolator relay cable, free of charge. The recall began on June 28, 2016. Owners may contact TMC customer service at 1-877-500-1020. TMC's number for this recall is RC000114.

**16V-329**

Forest River, Inc. (Forest River) is recalling certain model year 2014-2016 Charleston Class A motorhomes manufactured from September 16, 2013, through September 25, 2016, and built on certain Daimler Trucks North America LLC (DTNA) chassis. On certain motorhome chassis built with a heavier, adjustable foot pedal, the brake activation signal to certain towed devices may not deactivate when the motorhome service brakes are released. If the brake activation signal to a towed device remains active when the motorhome chassis service brakes are released, the brakes on a towed device may remain engaged. As a result, the brakes could drag and overheat potentially resulting in a fire. Additionally, following drivers may be confused by the motorhome's actions, increasing the risk of a crash. Forest River will notify owners, and DTNA dealers will modify the affected brake assemblies, free of charge. The recall began on June 23, 2016. Owners may contact DTNA customer service at 1-800-547-0712. Forest River's number for this recall is 40-05132016-0196.

**16V-330**

National Van Builders, Inc. (National Van) is recalling certain model year 2015 Ford Transit vehicles manufactured July 1, 2015, to October 30, 2015, and equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts by Ricon. The platform side plate of the affected wheelchair lifts may crack. Additionally, the lifts are equipped with folding link arms that may have pivot holes that are too big, allowing the bearings to move out of position. If the platform side plates crack or the platform mounting fails from

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

out-of-position bearings, the lift platform can separate from the lift and come to rest against the vehicle's lift door. When the vehicle's doors are opened, the platform may fall onto the lift operator, increasing their risk of injury. National Van will notify owners, and dealers will inspect the link arms for damage or for displaced bearings. The platform will be inspected for cracks. Any damaged parts will be replaced, free of charge. The recall began on June 15, 2016. Owners may contact National Van customer service at 1-800-527-7477. National Van's number for this recall is Ricon 2016.

**16V-331**

Heartland Recreational Vehicles (Heartland) is recalling certain model year 2017 trailers manufactured February 29, 2016, to May 5, 2016. The certification labels have incorrect tire pressure information, failing to comply with the requirements of 49 CFR Part 567, "Certification." Improper inflation can cause the trailer tires to become overloaded, resulting in poor handling and increased risk of a crash. Heartland will notify owners, and dealers will replace the certification label, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Heartland customer service at 1-877-262-8032. Heartland's number for this recall is 99-01-25.

**16V-332**

BMW of North America, LLC (BMW) is recalling certain model year 2011-2017, X3 sDrive28i, X3 xDrive28i, X3 xDrive35i, X3 xDrive35 manufactured July 2, 2010 to April 14, 2016i, 2015-2017 X3 xDrive28d manufactured March 10, 2014 to March 31, 2016, 2015-2017 x4 xDrive28i, X4 xDrive35i, X4 xDriveM40i manufactured March 3, 2014 to April 15, 2016. The affected vehicles have an inboard lower anchor for child restraints that may become damaged over-time during vehicle operation or due to excessive stresses. If the child seat is not properly attached to the lower anchors, it can increase the child's risk of injury in the event of a crash. BMW will notify owners, and dealers will weld a reinforcing bracket to the lower anchor bars and the vehicle body. free of charge. The recall is expected to begin on July 12, 2016. Owners may contact BMW customer service at 1-800-525-7417.

**16V-333**

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain model year 2006-2007 Lancer and Lancer Evolution vehicles manufactured June 29, 2005, to June 19, 2007, equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating air bag deployment, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. MMNA will notify owners, and dealers will replace the passenger frontal air bag inflator, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-16-002.

**16V-334**

Mercedes-Benz USA, LLC (MBUSA) is recalling one 2016 CLA45 AMG vehicle manufactured November 10, 2015. This vehicle is equipped with a dual clutch transmission that may have a defective weld between the dual clutch disk and hub. This weld may crack and result in a loss of power to the wheels, causing the vehicle to

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

stop. A sudden loss of power can increase the risk of a crash. MBUSA will notify the owner, and a dealers will replace the dual clutch, free of charge. The recall is expected to begin in June 2016. Owners may contact MBUSA customer service at 1-800-367-6372.

**16V-335**

Forest River, Inc. (Forest River) is recalling certain model year 2016-2017 Forester and Sunseeker recreational vehicles manufactured from February 29, 2016, through April 20, 2016. These vehicles are equipped with a shower door that may not meet the flammability standards. Thus, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 302, "Flammability of Interior Materials." Failure to meet the flammability standard of FMVSS 302 could enhance the spread of a flame in the event of a fire, increasing the risk serious injury. Forest River will notify owners, and dealers will replace the shower doors, free of charge. The recall is expected to begin on, or about, July 12, 2016. Owners may contact Forest River customer service at 1-574-206-7600 Forest River's number for this recall is 34-05052016-0184.

**16V-336**

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2016 Golf R vehicles manufactured March 17, 2016 to March 23, 2016. The affected vehicles may be equipped with a Federal Certification Label that lists an incorrect rear axle weight limit. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." The listed weight limit is low enough that the vehicle owner may ignore the weight limits and overload the vehicle and exceed the Gross Vehicle Weight Rating (GVWR), thereby increasing the risk of a crash. Volkswagen will notify owners, and dealers will install a corrected certification label, free of charge. The recall is expected to begin during July 2016. Volkswagen's number for this recall is 01B5.

**16V-337**

Stoughton Trailers, LLC (Stoughton) is recalling certain model year 2015-2017 trailers manufactured March 13, 2014, to April 28, 2016, equipped with certain Bendix SR5 spring brake valves. These valves may have been improperly machined which may cause the parking brake chamber to fail while the trailer is parked. If the parking brake chamber fails while the trailer is parked, the trailer may roll away, increasing the risk of crash or injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Stoughton customer service at 1-608-873-2500.

**16V-338**

Ducati North America (Ducati) is recalling certain model year 2014 1199 Superleggera motorcycles manufactured April 8, 2014, through November 13, 2014. On the affected motorcycles, the damper plate assembled between the primary driven gear and the clutch basket assembly could break due to fatigue, and result in the engine seizing, and therefore, the rear wheel locking up. A rear wheel lock up may cause a loss of control and increase the risk of a crash. Ducati will notify owners, and dealers will install a new clutch assembly, free of charge. The recall is expected to begin on July 18, 2016. Owners may contact Ducati customer service at 1-800-231-6696. Ducati's number for this recall is SRV-RCL-16-002.

**16V-339**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2008-2011 Scion xB and Lexus IS F, 2009-2011 Toyota Corolla and Corolla Matrix, 2006-2011 Toyota Yaris, Lexus IS250 and Lexus IS350, 2010-2011 Toyota 4Runner, Lexus IS250C, Lexus IS350C and Lexus GX460, 2011 Sienna, 2007-2011 Lexus ES350, and 2009-2010 Pontiac Vibe vehicles, originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, unless included in "Zone A" above, Toyota is recalling certain model year 2008 Scion xB and Lexus IS F, 2007-2008 Toyota Yaris, 2006-2008 Lexus IS250 and Lexus IS350 and 2007-2008 Lexus ES350 vehicles, originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Vehicles of these model years and models that were not originally sold or ever registered in either Zones A or B are not subject to this safety recall.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

**16V-340**

Ferrari North America, Inc. (Ferrari) is recalling certain model year 2009-2011 Ferrari California vehicles manufactured February 16, 2009, to July 8, 2011, and model year 2010-2011 458 Italia vehicles manufactured March 5, 2010, to July 29, 2011. These vehicles are equipped with air bag inflators assembled as part of the passenger frontal air bag modules, used as original equipment or replacement equipment. In the event of a crash necessitating air bag deployment, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Ferrari will notify owners, and dealers will replace the passenger frontal air bag assembly, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Ferrari customer service at 1-866-551-2828. Ferrari's number for this recall is 60.

**16V-341**

Daimler Vans USA, LLC (DVUSA) is recalling certain 2016 Mercedes Benz Metris vehicles manufactured from September 1, 2015, through December 31, 2015. The affected vehicles have rear differential gears that may have been improperly welded. The weld may fail and result in a loss of power to the wheels, increasing the risk of a crash. DVUSA will notify owners, and dealers will replace the rear differential gears, free of charge. The recall began June 2016. Owners may contact DVUSA customer service at 1-877-762-8267.

**16V-342**

Ford Motor Company (Ford) is recalling certain model year 2016 Lincoln MKX vehicles manufactured

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

September 24, 2015. An incorrect seat back trim cover was installed on the affected vehicles, blocking the child seat tether anchors in the second row center seating position. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 225, "Child restraint anchorage systems." An improperly anchored child seat can increase the risk of injury in a crash. Ford will notify owners, and dealers will replace the seat back trim cover and tether cover bezel on the second row, free of charge. The recall began on June 16, 2016. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16C09.

**16V-343**

Honda (American Honda Motor Co.) is recalling certain model year 2003-2006 Acura MDX, 2005-2011 Acura RL, 2005-2006 Honda CR-V, 2003-2011 Element, 2007-2008 Fit, 2003-2008 Pilot, 2002-2004 Odyssey, and 2006-2011 Ridgeline vehicles originally sold, or that have ever been registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, unless included in "Zone A" above, Honda is recalling certain model year 2003-2006 Acura MDX, 2005-2008 Acura RL, 2005-2006 Honda CR-V, 2003-2008 Element, 2007-2008 Fit, 2003-2008 Pilot, 2002-2004 Odyssey, and 2006-2008 Ridgeline vehicles originally sold, or that have ever been registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Lastly, unless included in "Zone A" or "Zone B" above, Honda is recalling model year 2002-2004 Odyssey and model year 2003-2004 Acura MDX, Honda Element, and Honda Pilot vehicles originally sold, or registered, in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

**16V-344**

Ford Motor Company (Ford) is recalling certain model year 2013-2014 F-150 vehicles manufactured August 1, 2013, to August 31, 2014 equipped with 3.5L engines. The master cylinder rear cup seal may roll, resulting in brake fluid leakage from the primary reservoir into the brake booster. Loss of brake fluid from the primary reservoir results in a complete loss of front brake function, increasing the risk of a crash. Ford will notify owners, and dealers will replace the brake master cylinder and, if necessary, the brake booster, free of charge. The recall is expected to begin on July 11, 2016. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16S24.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

**16V-345**

Honda (American Honda Motor Co.) is recalling certain model year 2009-2011 Acura TSX, 2011 TSX Wagon, 2010-2011 Acura ZDX, 2008-2011 Honda Accord, 2010-2011 Accord Crosstour, 2006-2011 Civic, Civic Hybrid, and Civic GX, 2007-2011 CR-V, 2010-2011 FCX Clarity and Insight, and 2009-2011 Fit, and Pilot vehicles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, unless already included in "Zone A" above, Honda is recalling certain model year 2008 Honda Accord, 2006-2008 Civic, Civic Hybrid and Civic GX, and 2007-2008 CR-V vehicles originally sold, or ever registered, in Arizona, Arkansas, Delaware, the District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Vehicles not originally sold or ever registered in either Zones A or B are not subject to this safety recall.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

**16V-346**

Honda (American Honda Motor, Inc.) is recalling certain model year 2006-2010 Honda GL1800 (Gold Wing) motorcycles manufactured February 8, 2006, to May 14, 2009 originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, unless included in "Zone A" above, Honda is recalling certain model year 2006-2008 Honda GL 1800 (Gold Wing) motorcycles manufactured May 10, 2007, to May 14, 2009 originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Motorcycles not originally sold or ever registered in either Zones A or B are not subject to this safety recall.

These motorcycles are equipped with an air bag inflator assembled as part of the air bag module, used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the air bag, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the rider resulting in serious injury or death. Honda will notify owners, and dealers will replace the air bag module containing the inflator, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Honda customer



**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

service at 1-866-784-1870. Honda's number for this recall is KA8.

**16V-347**

Hyundai Motor Company (Hyundai) is recalling certain model year 2016 Tucson vehicles manufactured May 19, 2015 to March 14, 2016. In the affected vehicles, if the primary hood latch has been released, and the vehicle is driven, the secondary hood latch may not hold adequately secure the hood to prevent it from opening while the vehicle is in motion. If the primary hood latch is inadvertently released and the secondary latch cannot secure the hood, the hood may unexpectedly open while driving, increasing the risk of a crash. Hyundai will notify owners, and dealers will replace the secondary hood latch, free of charge. The recall is expected to begin July 15, 2016. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 145.

**16V-348**

Nissan North America, Inc. (Nissan) is recalling certain model year 2003-2008 Infiniti FX35 and FX45, 2003-2004 Infiniti I35, 2006-2010 Infiniti M35 and M45, and 2007-2011 Nissan Versa vehicles, originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, unless included in "Zone A" above, Nissan is recalling certain model year 2005-2008 Infiniti FX35 and FX45, 2003-2004 Infiniti I30 and I35, 2006-2008 Infiniti M35 and M45, and 2007-2008 Nissan Versa vehicles, originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Lastly, unless included in "Zone A" or "Zone B" above, Nissan is recalling certain model year 2003-2004 Infiniti I30 and I35 vehicles originally sold, or registered, in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. These inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

**16V-349**

New England Wheels (New England) is recalling certain model year 2006-2014 Ford E-250, E-350, and 2015 Ford Transit vans equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts by Ricon. The platform side plate of the affected wheelchair lifts may crack. Additionally, the lifts are equipped with folding link arms that may have pivot holes that are too big, allowing the bearings to move out of position. If the platform side plates crack or the platform mounting fails from out-of-position bearings, the lift platform can separate from the lift and come to rest against the vehicle's lift door. When the vehicle's doors are opened, the platform may fall onto the lift operator, increasing their risk of injury. New England will notify owners, and Ricon dealers will inspect the link arms for damage or for displaced bearings. The platform will be

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

inspected for cracks. Any damaged parts will be replaced, free of charge. The recall began on June 29, 2016. Owners may contact New England customer service at 1-800-886-9247. New England's number for this recall is 16E-020.

**16V-350**

Daimler Vans USA, LLC (DVUSA) is recalling certain model year 2015-2016 Mercedes-Benz Sprinter 2500 and 3500 vehicles manufactured May 31, 2015, to April 30, 2016, and 2015-2016 Freightliner Sprinter 2500 and 3500 vehicles manufactured May 1, 2015, to April 30, 2016. The affected vehicles are configured to have super-high roofs, but may not be equipped with the required crash pads. If the required crash pads are missing, it can increase the risk of injury to a front passenger seat occupant if they are unbelted. DVUSA will notify owners, and dealers will install the required crash-pads, free of charge. The recall is expected to begin in June 2016. Owners may contact DVUSA customer service at 1-877-762-8267.

**16V-351**

Chrysler (FCA US LLC) is recalling certain model year 2004-2008 RAM 1500, 2005-2009 RAM 2500, 2006-2009 RAM 3500, 2007-2010 RAM 3500 Cab Chassis, 2008-2010 RAM 4500 and 5500 Cab Chassis, 2004-2009 Dodge Durango, 2007-2009 Chrysler Aspen, 2007-2012 Jeep Wrangler, 2008-2012 Dodge Challenger, 2005-2008 Dodge Magnum, 2005-2012 Chrysler 300, 2006-2012 Dodge Charger, 2005-2011 Dodge Dakota, and 2006-2009 Mitsubishi Raider vehicles originally sold, or ever registered, in AL, CA, FL, GA, HI, LA, MS, SC, TX, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, unless included in "Zone A" above, Chrysler is also recalling 2004-2008 RAM 1500, 2005-2009 RAM 2500, 2006-2009 RAM 3500, 2007-2009 RAM 3500 Cab Chassis, 2008-2009 RAM 4500 and 5500 Cab Chassis, 2004-2009 Dodge Durango, 2007-2009 Chrysler Aspen, 2007-2009 Jeep Wrangler, 2008-2009 Dodge Challenger, 2005-2008 Dodge Magnum, 2005-2009 Chrysler 300, 2006-2009 Dodge Charger, 2005-2009 Dodge Dakota and 2006-2009 Mitsubishi Raider vehicles originally sold, or ever registered, in AZ, AR, DE, Washington D.C., IL, IN, KS, KY, MD, MO, NE, NV, NJ, NM, NC, OH, OK, PA, TN, VA, and WV, or "Zone B."

Lastly, unless included in "Zone A" or "Zone B" above, Chrysler is recalling certain 2005-2008 RAM 2500, 2006-2008 RAM 3500, 2007-2008 RAM 3500 Cab Chassis, 2008 RAM 4500 and 5500 Cab Chassis, 2004-2008 Dodge Durango, 2007-2008 Chrysler Aspen, 2007-2008 Jeep Wrangler, 2008 Dodge Challenger, 2005-2008 Dodge Magnum, 2005-2008 Chrysler 300, 2006-2008 Dodge Charger, 2005-2008 Dodge Dakota, and 2006-2008 Mitsubishi Raider vehicles originally sold, or registered, in AK, CO, CT, ID, IA, ME, MA, MI, MN, MT, NH, NY, ND, OR, RI, SD, UT, VT, WA, WI, and WY.

**16V-352**

Rosenbauer Motors (Rosenbauer) is recalling certain 2012-2016 Commander vehicles manufactured January 2, 2012, to May 16, 2016. The affected vehicles have Battalion air suspension seats that may separate from its base in a frontal collision. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 207, "Seating Systems." If the seat detaches from its base in the event of a

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

crash, there is an increased risk of injury to the occupant. Rosenbauer will notify owners, and dealers will attach two tethers from the seat to the cab, free of charge. The recall is expected to begin during July 2016. Owners may contact Rosenbauer customer service at 1-651-462-1000.

**16V-353**

Mazda North American Operations (Mazda) is recalling certain model year 2004-2011 RX-8, 2004-2006 MPV, 2003-2008 Mazda6, and 2006-2007 Mazdaspeed6 vehicles, originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, unless included in "Zone A" above, Mazda is recalling certain model year 2004-2008 RX-8, 2004-2006 MPV, 2003-2008 Mazda6 vehicles, originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Lastly, unless included in "Zone A" or "Zone B" above, Mazda is recalling certain model year 2004 Mazda RX-8 and MPV, 2003-2004 Mazda6 vehicles originally sold, or registered, in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

**16V-354**

Grand Design RV, LLC (Grand Design) is recalling certain model year 2016-2017 Imagine and Reflection recreational trailers manufactured January 15, 2016 to May 4, 2016. The regulators on these vehicles may allow propane gas to leak into the plastic gas level indicator window causing it to degrade and crack. If the indicator window cracks, propane gas may leak out, increasing the risk of a fire. Grand Design will notify owners, and dealers will replace the LP regulator kit, free of charge. The recall began on June 6, 2016. Owners may contact Grand Design customer service at 1-574-825-9679. Grand Design's number for this recall is 910006.

**16V-355**

Mazda North America Operations (Mazda) is recalling certain model year 2009-2011 Mazda6, 2007-2011 CX-7 and CX-9 vehicles, originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, unless included in "Zone A" above, Mazda is recalling certain model year 2007-2008 CX-7 and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

CX-9 vehicles, originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Vehicles of these model years and models that were not originally sold or ever registered in either Zones A or B are not subject to this safety recall.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Mazda will notify owners, and dealers will replace the passenger frontal air bag inflator, free of charge. The recall is expected to begin July 15, 2016. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 9516E.

**16V-356**

Manac Trailers USA, Inc. (MANAC) is recalling certain model year 2014-2015 Darkwing Aluminum Flatbed 5 or 8 axle trailers manufactured May 19, 2014 to June 5, 2015. The affected trailers have a coupling plate that may separate from the trailer. If the coupling plate separates from the trailer, the trailer could disconnect from the towing vehicle, increasing the risk of a crash. MANAC has notified owners, and dealers will install a new coupling plate and repair all cracked frame webs, free of charge. The recall began on June 8, 2016. Owners may contact MANAC customer service at 1-800-361-7900.

**16V-357**

Subaru of America, Inc. (Subaru) is recalling certain model year 2003-2004 Legacy, Outback, 2009-2011 Legacy, Outback, Forester, 2006-2011 Impreza, Tribeca, 2003-2006 Baja, and 2006 Saab 9-2x vehicles originally sold or that have ever been registered in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

These vehicles may be equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Subaru will notify their owners. General Motors will notify Saab owners. Dealers will replace the passenger frontal air bag inflator, free of charge. A notification schedule has not yet been provided. Owners may contact Subaru customer service at 1-856-488-8500. Saab owners may contact GM at 1-800-955-9007. Subaru's number for this recall is TKA-16.

**16V-358**

Subaru of America, Inc. (Subaru) is recalling certain model year 2003-2004 Legacy, Outback, 2006-2008 Impreza, Tribeca, 2006 Saab 9-2x, and 2003-2006 Baja vehicles originally sold or that have ever been

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

registered in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

These vehicles may be equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Subaru will notify owners, and dealers will replace the passenger frontal air bag inflator, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Subaru customer service at 1-856-488-8500. Subaru's number for this recall is TKB-16.

Note: This notice is only for vehicles that were not covered by 16V-358 for Zone A.

**16V-359**

Forest River, Inc. (Forest River) is recalling certain model year 2016 Stealth Evo recreational vehicle trailers, models CSJT280RKS and CSJT290QBS, manufactured January 7, 2016, to March 18, 2016. The affected vehicles may have had tires of the wrong load range installed which may result in premature tire failure. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims and Motor Home/Recreation Vehicle Trailer Load Carrying Capacity Information for Motor Vehicles with a GVWR of 4,536 kilograms (10,000 pounds) or less." Unexpected tire failure increases the risk of a crash. Forest River will notify owners, and dealers will supply new correct tires and rims, free of charge. The recall is expected to begin July 18, 2016. Owners may contact Forest River customer service at 1-909-873-3777 extension 52. Forest River's number for this recall is 67-05192016-0199.

**16V-360**

Subaru of America, Inc. (Subaru) is recalling certain model year 2003-2004 Legacy, Outback, and Baja vehicles originally sold or that have ever been registered in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming, or "Zone C."

These vehicles may be equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Subaru will notify owners, and dealers will replace the passenger frontal air bag inflator, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Subaru customer service at 1-856-488-8500. Subaru's number for this recall is TKC-16.

Note: This recall covers vehicles that were not previously covered in 16V-358 for Zone A or 16V-359 for

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

Zone B.

**16V-361**

PACCAR Incorporated (PACCAR) is recalling certain model year 2016 Kenworth W900 trucks manufactured May 19, 2015, to December 21, 2015. The affected vehicles may have a temporary loss of headlights when being switched from low beam to high beam mode. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." A loss of headlights while switching to high beams will reduce the driver's visibility, increasing the risk of a crash. Kenworth will notify owners, and dealers will alter the wiring harness to enable the high beams to illuminate, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Kenworth customer service at 1-425-828-5000. Kenworth's number for this recall is 16KWA.

**16V-362**

Mercedes-Benz USA, LLC (MBUSA) is recalling certain model year 2008-2011 C300 Sedan, C300 4matic Sedan, C350 Sedan, C63 AMG Sedan vehicles, 2010-2011 GLK350, GLK350 4-Matic and E350 Coupe vehicles, 2011 SLS AMG, E350 Convertible, E550 Coupe and E550 Convertible vehicles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, unless included in "Zone A" above, MBUSA is recalling certain model year 2008 C300 Sedan, C350 Sedan, C63 AMG Sedan and C300 4-Matic Sedan vehicles originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Vehicles not originally sold or ever registered in either Zones A or B are not subject to this safety recall.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. MBUSA will notify owners, and dealers will replace the passenger frontal air bag modules, free of charge. Parts are not currently available. Owners will be sent an interim notification in July 2016. A second notice will be mailed when remedy parts are available. Owners may contact MBUSA customer service at 1-877-496-3691.

**16V-363**

BMW of North America, LLC (BMW) is recalling certain model year 2007-2011 X5 xDrive30i, X5 xDrive35i, X5 xDrive48i, X5 xDrive50i and X5M vehicles, 2009-2011 X5 xDrive35d vehicles, 2008-2011 X6 xDrive35i, X6 xDrive50i and X6 M vehicles, and 2010-2011 X6 ActiveHybrid vehicles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico,

## **SAFETY DEFECT/NONCOMPLIANCE NOTICES RECEIVED DURING MAY 2016**

*Published July 11, 2016*

American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, unless included in "Zone A" above, BMW is recalling certain model year 2007-2008 X5 xDrive30i, X5 xDrive35i, X5 xDrive48i, X5 xDrive50i and X5M vehicles, and 2008 BMW X6 xDrive35i, X6 xDrive50i and X6 M vehicles originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Vehicles of these model years and models that were not originally sold or ever registered in either Zones A or B are not subject to this safety recall.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. BMW will notify owners, and dealers will replace the passenger frontal air bag inflator or air bag module, free of charge. The recall is expected to begin July 18, 2016. Owners may contact BMW customer service at 1-800-525-7417.

**16V-364**

Transportation Collaborative, Inc. (Transportation Collaborative) is recalling certain model year 2014-2016 Trans Tech Student Safety Transporter (SST) and ST Aero school buses manufactured from January 2, 2014, through January 1, 2016, and equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts by Ricon. The platform side plate of the affected wheelchair lifts may crack. Additionally, the lifts are equipped with folding link arms that may have pivot holes that are too big, allowing the bearings to move out of position. If the platform side plates crack or the platform mounting fails from out-of-position bearings, the lift platform can separate from the lift and come to rest against the vehicle's lift door. When the vehicle's doors are opened, the platform may fall onto the lift operator, increasing their risk of injury. Transportation Collaborative will notify owners, and Ricon dealers will inspect the link arms for damage or for displaced bearings. The platform will be inspected for cracks. Any damaged parts will be replaced, free of charge. The recall began on June 28, 2016. Owners may contact Transportation Collaborative customer service at 1-845-988-0419.

**16V-365**

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2015-2016 FCCC XBP, XBR, XCM, XCR, XCL, and XCP trucks manufactured May 1, 2014, to June 16, 2015, equipped with certain ZF RL77 / 80EM independent front steering axles equipped with Bosch 8018 steering boxes. The boxes were manufactured using incorrect internal spacers that can cause premature wear in the connection between the steering wheel and the front axle. The steering wheel's connection to the front axle could fail resulting in a sudden loss of steering ability, increasing the risk of a crash. DTNA will notify owners, and dealers will inspect and replace the steering box if necessary, free of charge. Owners are urged not to drive their vehicles until they have been inspected. The recall began on May 31, 2016. Owners may contact DTNA customer service at 1-800-

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

547-0712. DTNA's number for this recall is FL-712.

**16V-366**

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2015 Yaris vehicles manufactured January 13, 2015, to February 27, 2015. The front strut mounting bearings can be damaged when a high load is applied to the strut, such as driving over a large bump. A damaged strut mounting bearing may cause the strut rod to separate, causing a loss of vehicle stability and increasing the risk of a crash. Toyota will notify owners, and dealers will replace the strut mounting bearings and, as necessary, replace the strut and front suspension support sub-assembly, free of charge. Remedy parts are currently unavailable. Interim notices will be mailed to owners beginning July 24, 2016. Owners will receive a second notice when remedy parts become available. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is G0S.

**16V-367**

Dejana Truck & Equipment Co, Inc. (Dejana) is recalling certain model year 2013-2016 Dominator-Propane, Dominator I, Dominator II, Dominator III, and Dominator IV vehicles manufactured April 23, 2013, to January 22, 2016, equipped with IMT cranes, models 6000, 7500, 8600, 9500, 10000, 12000, or 14000. The affected cranes have a valve bank cover that may crack and fall from the crane while the crane is being transported. If the valve bank cover detaches from the crane it could be a road hazard, increasing the risk of a crash. Dejana will notify owners, and dealers will replace the valve bank cover with a thicker cover, free of charge. Owners may contact Dejana customer service at 1-888-836-0649. Dejana's number for this recall is TB2016001/TB2016002.

**16V-368**

Supreme Corporation (Supreme) is recalling certain model year 2008-2014 Startrans Activity Bus, Azure Hybrid, Candidate, Senator, Senator HD, Senator II, President, President S2, Sentinel Van, and Trolley shuttle buses manufactured May 9, 2008, to August 9, 2014, equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts by Ricon. The platform side plate of the affected wheelchair lifts may crack. Additionally, the lifts are equipped with folding link arms that may have pivot holes that are too big, allowing the bearings to move out of position. If the bearings move out of position, the stowed platform may have excessive movement resulting in failure of the platform mounting. This failure could cause the wheel chair lift platform to fall out of the vehicle when the doors are opened, increasing the risk of injury for the lift operator. Supreme will notify owners and advise them to contact Ricon, and Ricon dealers will inspect the link arms for damage or for displaced bearings. The platform will be inspected for cracks. Any damaged parts will be replaced, free of charge. The recall began on June 29, 2016. Owners may contact Supreme customer service at 1-800-642-4889 or Ricon customer service at 1-800-322-2884.

**16V-369**

Ducati North America (Ducati) is recalling certain model year 2016 XDiavel S motorcycles manufactured November 25, 2015 to May 18, 2016. The affected motorcycles have a rear wheel that may have been incorrectly installed on the hub. If the rear wheel was incorrectly installed, the drive pins may fail, resulting in a loss of braking and a loss of power transmission from the engine. These conditions increase the risk of a crash.



**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

Ducati will notify owners, and dealers will remove the rear wheel and install rubber inserts to prevent the wheel from being improperly installed. Any wheel that is found to have been improperly installed will be replaced. These repairs will be performed free of charge. The recall is expected to begin on July 18, 2016. Owners may contact Ducati customer service at 1-800-231-6696. Ducati's number for this recall is SRV-RCL-16-001.

**16V-370**

Terex Advance (Terex) is recalling certain model year 2015-2016 Mixer FD3000, FD4000, and FD6000B vehicles manufactured August 1, 2014, to September 30, 2015, and equipped with drive axles manufactured by Marmon-Herrington. The affected axles may have hex nuts on the flange yoke that may not have been properly tightened. If the hex nuts are not tightened to specification, the driveshaft may disconnect from the drive axle, resulting in a loss of propulsion and increasing the risk of a crash. Terex will notify owners. A remedy plan has not yet been provided. The manufacturer has not yet provided a notification schedule. Owners may contact Terex customer service at 1-800-433-6691.

**16V-371**

Kovatch Mobile Equipment Corp. (KME) is recalling certain model year 2015-2016 Predator Severe Service vehicles manufactured August 28, 2014, to January 27, 2016. The affected vehicles are equipped with Pelican 9410L flashlights, part number 9410-021-245 or 9410-021-110, with lithium ion battery packs, part number 9413-301-001, which may overheat. If the flashlight battery pack overheats, it can increase the risk of a fire. KME will notify owners to inspect the flashlights and battery packs, and request replacements from Pelican, as necessary, free of charge. The recall began on June 16, 2016. Owners may contact KME customer service at 1-800-235-3926.

**16V-372**

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain model year 2009-2011 Jaguar XF vehicles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands.

Vehicles not originally sold or ever registered in these states are not subject to this safety recall.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Jaguar will notify owners, and dealers will replace the passenger frontal air bag assemblies, free of charge. Parts are not currently available. Owners will be sent an interim notification around July 31, 2016. A second notice will be mailed when remedy parts are available. Owners may contact Jaguar Land Rover customer service at 1-800-452-4827. Jaguar's number of this recall is J069.

**16V-373**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain model year 2007-2011 Land Rover Range Rover vehicles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, unless included in "Zone A" above, Land Rover is recalling certain model year 2007-2008 Land Rover Range Rover vehicles, originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Vehicles not originally sold or ever registered in either Zones A or B are not subject to this safety recall.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

**16V-374**

Coach and Equipment Mfg Corp. (Coach and Equipment) is recalling certain model year 2014-2015 Metro Lite buses manufactured October 1, 2014, to October 31, 2015, 2015 Pegasus buses manufactured August 1, 2015, to August 31, 2015, and 2014-2015 Phoenix buses manufactured September 1, 2014, to November 30, 2015, equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts by Ricon. The platform side plate of the affected wheelchair lifts may crack. Additionally, the lifts are equipped with folding link arms that may have pivot holes that are too big, allowing the bearings to move out of position. If the platform side plates crack or the platform mounting fails from out-of-position bearings, the lift platform can separate from the lift and come to rest against the vehicle's lift door. When the vehicle's doors are opened, the platform may fall onto the lift operator, increasing their risk of injury. Coach and Equipment will notify owners, and Ricon dealers will inspect the link arms for damage or for displaced bearings. The platform will be inspected for cracks. Any damaged parts will be replaced, free of charge. The recall began on June 29, 2016. Owners may contact Coach and Equipment customer service at 1-800-724-8464.

**16V-375**

Volkswagen Group of America, Inc. (VW) is recalling certain model year 2008-2009 Audi A4, A5, and Q5 vehicles. In the affected vehicles, the air bag control units may corrode and fail. If the air bag control unit fails, the air bags may not deploy in the event of a crash, increasing the risk of occupant injury. Audi will notify owners, and dealers will replace the air bag control unit, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 6901.

**16V-376**

Forest River, Inc. (Forest River) is recalling certain model year 2015-2016 Glaval Concorde and Concorde II transit buses manufactured December 30, 2015, to May 13, 2016 and built on Ford chassis. The clip that

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

connects the hand operated parking brake actuator cable to the intermediate parking brake cable may fail. If the parking brake cable connector clip fails, the vehicle may unexpectedly roll, increasing the risk of a crash. Forest River will notify owners, and Ford dealers will replace the parking brake cable connector clip, free of charge. The recall is expected to begin on, or about, July 21, 2016. Owners may contact Ford customer service at 1-866-436-7332. Forest River's number for this recall is 35-05242016-0200.

**16V-377**

Vermeer Manufacturing Company (Vermeer) is recalling certain model year 2012-2016 BC900XL wood chippers manufactured June 8, 2012, to May 31, 2016. The chassis of the affected wood chippers may have improper welds which could result in separation of the wood chipper from the tow vehicle. If the brush chipper separates from the tow vehicle, there would be an increased risk of a crash. Vermeer will notify owners, and dealers will remove the current fixed tongue and bolt on a new fixed tongue, free of charge. The recall is expected to begin in July 2016. Owners may contact Vermeer customer service at 1-800-829-0051 extension 7060. Vermeer's number for this recall is IK3304.

**16V-378**

Daimler Vans USA, LLC (DVUSA) is recalling certain model year 2010-2011 Mercedes-Benz Sprinter, 2009-2011 Freightliner Sprinter, and 2009 Dodge Sprinter vehicles, originally sold, or that have ever been registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands.

Vehicles not originally sold or ever registered in these states are not subject to this safety recall.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. DVUSA will notify the Freightliner owners, Mercedes-Benz will notify their owners and Fiat Chrysler will notify the Dodge owners. Dealers will replace the passenger frontal air bag modules, free of charge. Parts are not currently available. Owners will be sent an interim notification around June 30, 2016. A second notice will be mailed when remedy parts are available. Freightliner owners may contact DVUSA customer service at 1-877-762-8267. Mercedes-Benz owners may contact Mercedes-Benz customer service at 1-800-367-6372. Dodge owners may contact Fiat Chrysler customer service at 1-800-853-1403.

**16V-379**

Nissan North America, Inc. (Nissan) is recalling certain model year 2013-2014 Pathfinder vehicles manufactured June 20, 2012, to June 13, 2013. The brake light switch may have been installed incorrectly causing the relay to make intermittent contact and repeatedly cycle. This may result in the relay remaining in the "ON" position, causing the brake lights to remain illuminated even when the brakes are not applied. Additionally, the brake light switch may interfere with the brake-shift interlock, allowing the driver to shift the vehicle out of the "Park" position, without depressing the brake pedal. If the brake lights remain illuminated, other drivers may fail to stop

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

when the vehicle actually brakes, increasing the risk of a crash. If the driver inadvertently shift the vehicle out of the "PARK" position without depressing the brake, the vehicle may rollaway, increasing the risk of injury. Nissan will notify owners, and dealers will inspect the brake light switch and, as necessary, replace the relay, free of charge. The recall is expected to begin on July 25, 2016. Owners may contact Nissan customer service at 1-800-647-7261.

**16V-380**

General Motors LLC (GM) is recalling certain model year 2007-2011 Cadillac Escalade, Escalade ESV and Escalade EXT, Chevrolet Avalanche, Silverado 1500, Suburban and Tahoe, GMC Sierra 1500, Yukon and Yukon XL vehicles, and 2009-2011 Chevrolet Silverado 2500 and 3500 and GMC Sierra 2500 and 3500 vehicles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands.

Vehicles not originally sold or ever registered in these states are not subject to this safety recall but may be covered under recall 16V-383, depending on the vehicle model year and the vehicle's sale and registration locations.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. GM has not yet provided a remedy plan nor a notification schedule. Owners may contact Cadillac customer service at 1-800-458-8006, Chevrolet Customer service at 1-800-222-1020, or GMC customer service at 1-800-462-8782. GM's number for this recall is 49151.

**16V-381**

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2004-2008 Audi A4, and 2005-2011 Audi A6 vehicles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, unless included in "Zone A" above, Volkswagen is recalling certain model year 2004-2008 Audi A4, and 2005-2008 Audi A6 vehicles originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Lastly, unless included in "Zone A" or "Zone B" above, Volkswagen is recalling model year 2004 Audi A4 vehicles originally sold, or registered, in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

**16V-382**

General Motors LLC (GM) is recalling certain model year 2007-2008 Cadillac Escalade, Escalade ESV, Escalade EXT, Chevrolet Avalanche, Silverado 1500, Suburban, Tahoe, GMC Sierra 1500, Yukon, and Yukon XL vehicles originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia.

Vehicles not originally sold or ever registered in these states are not subject to this safety recall but may be covered under recall 16V-381 depending on the vehicle model year and the vehicle's sale and registration locations.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. GM has not yet determined a remedy plan nor provided a notification schedule. Owners may contact Cadillac customer service at 1-800-458-8006, Chevrolet customer service at 1-800-222-1020, or GMC customer service at 1-800-462-8782. GM's number for this recall is 49152.

**16V-383**

Ford Motor Company (Ford) is recalling certain model year 2007-2011 Ford Ranger vehicles, 2006-2011 Ford Fusion, Mercury Milan and Lincoln Zephyr/MKZ vehicles, 2007-2010 Ford Edge, Lincoln MKX vehicles, 2005-2006 Ford GT vehicles, and 2005-2011 Ford Mustang vehicles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, unless included in "Zone A" above, Ford is recalling certain model year 2007-2008 Ford Ranger, Edge and Lincoln MKX vehicles, 2006-2008 Ford Fusion, Mercury Milan and Lincoln Zephyr/MKZ vehicles, 2005-2006 Ford GT vehicles and 2005-2008 Ford Mustang vehicles originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Any vehicle not included in "Zone A", or "Zone B" is not included in the safety recall.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING MAY 2016**

*Published July 11, 2016*

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Ford will notify owners, and dealers will replace the passenger frontal air bag inflator, free of charge. The recall is expected to begin July 11, 2016. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16S26.

**16V-384**

Winnebago Industries, Inc (Winnebago) is recalling certain model year 2015-2016 Winnebago Tour and Itasca Ellipse motor homes manufactured August 29, 2014, to November 4, 2015 and built on a Freightliner chassis. In the affected vehicles, the steering box may have been manufactured with an incorrect spacer with insufficient height that can cause too much play, causing the connection to wear between the steering wheel and the front axle. The steering wheel's connection to the front axle could fail resulting in a sudden loss of steering ability, increasing the risk of a crash. Winnebago will notify owners, and Freightliner dealers will inspect and replace the steering gears, as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Note: Owners are urged not to drive their vehicles until they have been inspected. Owners may contact Winnebago customer service at 1-641-585-3535 or Freightliner at 1-800-547-0712.

**16V-385**