

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

CHILD SEATS:

None during June 2016.

EQUIPMENT:

M.B. Sturgis, Inc. (M.B. Sturgis) is recalling certain Auto Changeover Propane Gas Regulators, part number 108260, manufactured June 25, 2015, to July 17, 2015. In the affected regulators, the plastic fuel level gauge window may crack, allowing propane gas to leak out. A propane gas leak in the presence of an ignition source increases the risk of a fire. M.B. Sturgis has notified the vehicle manufacturers that purchased the regulators, and their dealers will replace the regulator, free of charge. The recall began on May 23, 2016. Owners may contact M.B. Sturgis customer service at 1-888-291-6665. M.B. Sturgis' number for this recall is 250615 0012.

16E-051

Meritor, Inc. (Meritor) is recalling certain FF967 Non-Drive Front Steer axles, part number 3100H7860, manufactured March 24, 2012, to April 11, 2012. The affected front axles may have been incorrectly heat treated. If the front axle was not properly heated treated, it may fracture and a loss of vehicle control may occur, increasing the risk of a crash. Meritor will notify the truck manufacturer that purchased the axles, and their dealers will inspect the axles for specific heat code and serial numbers. Axles meeting the criteria will be replaced, free of charge. The recall began on June 8, 2016. Owners may contact Meritor customer service at 1-866-668-7221.

16E-052

Thule (Thule Inc.) is recalling certain Sprint bicycle carriers, models 569/569000 and 528, manufactured December 1, 2013 through April 1, 2016. The fork clamping mechanism may not properly secure the bike fork to the carrier, allowing the bike to detach from the vehicle. If the bike detaches from the vehicle while it is being driven, it could become a road hazard, increasing the risk of a crash. Thule has notified the registered owners, and dealers will exchange the affected bicycle carriers for an improved replacement carrier, free of charge. Consumers are advised not to use the existing carriers. The recall began on June 8, 2016. Owners may contact Thule's customer service at 1-844-361-8939.

16E-053

1888653 Ontario Inc. (Ontario) is recalling certain EVOS Full Face Modular Helmets, model number ST-818-6F-L, size Large, manufactured June 8, 2014, to July 10, 2014. The affected helmets may not adequately protect the wearer's head in the event of an impact. Additionally, these helmets may be missing or have incomplete information regarding the manufacturer's name as well be missing the words "Certified" and "FMVSS No. 218." As such, these helmets fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." Helmets that do properly protect the wearer's head can increase the risk of injury to the wearer in the event of a crash. Missing labeling information reduces the user's possibility of identifying the helmet in the event of a safety recall. The company will notify owners and will offer a full refund. The recall began on August 1, 2016. Owners may contact 1888653 Ontario customer service at 1-416-848-0673.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

16E-054

Hendrickson USA, L.L.C. (Hendrickson) is recalling certain Bridge Axles, part number B5R13X-04B, manufactured December 7, 2015, to January 11, 2016. The affected bridge axles have tube sleeves that may crack along the seam welds. If one tube sleeve cracks, vehicle handling may be affected. If both tube sleeves crack, the bridge axle may detach from the vehicle. Either condition increases the risk of a crash. Hendrickson notified the one vehicle manufacturer that purchased the affected axles on May 24, 2016. That manufacturer is replacing the axles under recall 16V-421, free of charge. Owners may contact Hendrickson customer service at 1-630-773-9111. Hendrickson's number for this recall is TB-H801.

16E-055

Wilson Manifolds Inc. (Wilson) is recalling certain Peter Paul 22X01031GM 12/DC solenoid valves manufactured May 1, 2015, to July 30, 2015. Due to improper welding, the affected valves may separate when under pressure either during installation or during use of the nitrous system resulting in the piston ejecting. If the piston ejects, it can increase the risk of injury to those nearby or possibly damage other nearby components. Wilson has notified owners, and has provided replacement solenoid valve stems, free of charge. The recall began on September 23, 2016. Owners may contact Wilson customer service at 1-954-771-6216.

16E-056

Triumph Motorcycles America, LTD (Triumph) is recalling certain accessory Adjustable Brake Levers, sold as part of an aftermarket lever replacement kit, part number A2021334. These brake levers are intended for installation on 2016 and 2017 Thruxton 1200, Steet Twin, Bonneville T120, and Bonneville T120 Black motorcycles. Under certain conditions, the brake levers may contact the handlebar before maximum braking force is applied. Without the ability to apply maximum front braking, the distance needed to stop the motorcycle may be lengthened, increasing the risk of a crash. Triumph will notify owners, and dealers will replace the affected brake levers, free of charge. The recall began July 7, 2016. Owners may contact Triumph customer service at 1-678-854-2010.

16E-057

Speedtech LLC (Speedtech) is recalling certain Nitrous Solenoid Valves, part number 100-2115, used in nitrous oxide systems for drag racing. Due to improper welding, the affected valves may separate when under pressure either during installation or during use of the nitrous system resulting in the piston ejecting. If the piston ejects, it can increase the risk of injury to those nearby or possibly damage other nearby components. Speedtech notified the affected owners, and replaced the valves, free of charge. The recall began on September 7, 2015. Additional owner notifications will not be sent. Owners may contact Speedtech customer service at 1-205-331-4972.

16E-058

Waterous Company (Waterous) is recalling certain Split-Shaft Transmission Shift Units manufactured April 9, 2015, to April 20, 2016. These shift units allow the user to select whether the Split-Shaft Transmission sends power to the wheels of an emergency response vehicle or powers an add-on unit such as a water pump used for fighting fires. A component within the shift unit may be damaged and as a result, the operator may not be able to

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

switch the power output. If the power output cannot be changed, once the fire truck arrives at the scene, it may not be able to pump water to aid in extinguishing the fire, increasing the risk of injury. Waterous will notify the vehicle manufacturers that purchased the shift units and will work with them to remove, repair, and reinstall the shift units, free of charge. The recall began on July 22, 2016. Owners may contact Waterous customer service at 1-651-450-5067.

16E-059

TIRES:

None during June 2016.

VEHICLES:

Forest River, Inc. (Forest River) is recalling certain model year 2014-2016 Glaval Universal, Primetime, Sport, Titan, Titan II, Entourage, Legacy transit buses manufactured January 1, 2006, to April 29, 2016, 2015-2016 Elkhart ECE3, ECE4, ECG4 transit buses manufactured October 24, 2014, to September 9, 2015, and 2006-2016 Starcraft Bus Allstar, Allstar XL, Starlite, Quest, Quest XL, and StarTrans Senator II, Senator II HD, and PS/2 vehicles manufactured January 1, 2006, to April 29, 2016. These vehicles are equipped with certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts by Ricon. The platform side plate of the affected wheelchair lifts may crack. Additionally, the lifts are equipped with folding link arms that may have pivot holes that are too big, allowing the bearings to move out of position. If the platform side plates crack or the platform mounting fails from out-of-position bearings, the lift platform can separate from the lift and come to rest against the vehicle's lift door. When the vehicle's doors are opened, the platform may fall onto the lift operator, increasing their risk of injury. Forest River will notify owners, and Ricon dealers will inspect the link arms for damage or for displaced bearings. The platform will be inspected for cracks. Any damaged parts will be replaced, free of charge. The recall began on July 7, 2016. Owners may contact Forest River's customer service at 1-800-348-7440, or Ricon customer service at 1-818-267-3000. Forest River's number for this recall is 51-05132016-0197.

16V-386

Kia Motors Corporation (Kia) is recalling certain model year 2006-2012 Kia Sedona vehicles manufactured from June 15, 2005, through August 14, 2012 and originally sold in, or currently registered in Alaska, Connecticut, Delaware, Illinois, Indiana, Iowa, Kansas, Kentucky, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, Nebraska, New Hampshire, New Jersey, New York, North Dakota, Ohio, Pennsylvania, Rhode Island, South Dakota, Utah, Vermont, West Virginia, Wisconsin and the District of Columbia. In the affected vehicles, the front lower control arms may break due to corrosion from salt water exposure such as from road salt use. A broken control arm can result in the loss of control of the vehicle, increasing the risk of a crash. Kia will notify owners and dealers will replace the front lower control arms on 2006-2007 models. 2008-2012 models will either have their front lower control arms replaced or additional anti-corrosion coating will be applied. These repairs will be performed free of charge. The recall began on July 27, 2016. Owners may

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

contact Kia at 1-800-333-4542. Kia's number for this recall is SC133.

16V-387

Terex Advance (Terex) is recalling certain model year 2016 Front Discharge Mixer trucks manufactured March 31, 2016, to May 9, 2016 equipped with a Cummins ISX12 or ISX15 engine using certain engine control modules (ECM). These ECM's may experience an internal electrical short that can cause a fuse to blow, resulting in an unexpected engine stall without the ability to restart the engine. An engine stall can increase the risk of a crash. Cummins will notify owners, and dealers will replace the existing ECM with a new ECM, free of charge. The recall began on July 8, 2016. Owners may contact Cummins customer service at 1-800-343-7357 or Terex customer service at 1-800-433-6691.

16V-388

Kia Motors Corporation (Kia) is recalling certain model year 2006-2014 Kia Sedona vehicles manufactured from June 15, 2005, through April 04, 2014. In the affected vehicles, the secondary hood latch may bind and remain in the unlatched position when the hood is closed. If the primary latch is inadvertently released and the secondary latch is not engaged, the hood could unexpectedly open while driving, increasing the risk of a vehicle crash. Kia will notify owners and dealers will replace the secondary hood latch or clean and lubricate the latch, depending on the vehicle's location and the condition of the latch. These repairs will be performed free of charge. The recall began on July 27, 2016. Owners may contact Kia at 1-800-333-4542. Kia's recall number is SC134.

16V-389

Pierce Manufacturing (Pierce) is recalling certain model year 2015-2016 Arrow XT, Enforcer, Impel, Quantum, Saber, and Velocity emergency vehicles manufactured August 4, 2015, to August 24, 2016, equipped with pumps to provide pressurized water to aid in fighting fires. These pumps have 6" intake strainers that may have been improperly soldered during production and, as a result, the strainers may come apart during use, allowing parts of the strainer and debris to enter the pump, possibly damaging the pump. If the strainer and/or debris enters the pump, and the operator is forced to shut down the pump, reducing firefighting effectiveness, there could be an increased risk of injury. Pierce will notify owners to check the strainer for missing solder at the joints. Any strainers missing solder will be replaced, free of charge. The recall began on June 16, 2016. Owners may contact Pierce customer service at 1-888-974-3723 or Hale Products Customer Service Center at 1-800-533-3569. Pierce's number for this recall is 74B272.

16V-390

KZRV, L.P. (KZ) is recalling certain model year 2016 MXT travel trailers, model 3192, manufactured December 15, 2015, to March 22, 2016. The safety chains located on the A- frame are rated for 11,700 pounds instead of chains that are rated equal or greater than the gross vehicle weight rating (GVWR). In the event that the main trailer connection fails, the weight of the trailer could break the safety chains. This would allow the trailer to separate from the vehicle, increasing the risk of a crash. KZ will notify owners, and dealers will replace the safety chains with chains that meet or exceed the GVWR, free of charge. The recall began on June 28, 2016. Owners may contact KZ customer service at 1-800-768-4016 extension 153 or 154.

16V-391

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

KYMCO (KYMCO USA) is recalling certain model year 2016 K-Pipe motorcycles manufactured March 1, 2016, to May 25, 2016. In the affected models, the gear shift pattern was assembled in a reverse sequence when compared to the standard setup. As such, these motorcycles fail to comply with Federal Motor Vehicle Safety Standard (FMVSS) number 123, "Motorcycle Controls and Displays." If the motorcycle shifts opposite of other motorcycles, a rider may be confused and may select the wrong gear, adversely affecting control of the motorcycle and increasing the risk of a crash. KYMCO will notify owners, and dealers will repair the motorcycles, free of charge. The recall began on July 13, 2016. Owners may contact KYMCO customer service at 1-888-235-3417.

16V-392

Volvo Trucks North America (Trucks) is recalling certain model year 2017 VNL trucks manufactured March 15, 2016, to April 20, 2016, equipped with a Cummins ISX12 or ISX15 engine using certain engine control modules (ECM). These ECM's may experience an internal electrical short that can cause a fuse to blow, resulting in an unexpected engine stall without the ability to restart the engine. An engine stall can increase the risk of a crash. Cummins will notify owners, and Cummins dealers will replace the existing ECM with a new ECM, free of charge. The recall began on July 11, 2016. Owners may contact Cummins customer service at 1-800-343-7357 or Volvo customer service at 1-800-528-6586. Volvo's number for this recall is RVXX1604.

16V-393

Autocar, LLC (Autocar) is recalling certain model year 2016-2017 Xpeditor vehicles manufactured March 21, 2016, to April 11, 2016, equipped with a Cummins ISX12 or ISX15 engine using certain engine control modules (ECM). These ECM's may experience an internal electrical short that can cause a fuse to blow, resulting in an unexpected engine stall without the ability to restart the engine. An engine stall can increase the risk of a crash. Cummins will notify owners, and Cummins dealers will replace the existing ECM with a new ECM, free of charge. The recall began on July 7, 2016. Owners may contact Cummins customer service at 1-800-343-7357 or Autocar customer service at 1-765-489-5499. Autocar's number for this recall is ACX-1603.

16V-394

Daimler Trucks North America LLC (DTNA) is recalling certain model year 1998-2002 Thomas Built Buses Saf-T-Liner Conventional, 2000-2002 Saf-T-Liner ER, 2000-2002 Saf-T-Liner MVP-EF, 1998-1999 Vista, 2003 Saf-T-Liner FS65, 2013 Saf-T-liner C2, 2000-2002 Saf-T-Liner MVP-ER, 2013 Saf-T-Liner HDX. In the affected vehicles, the stem that connects the outside emergency door handle to the emergency door opening mechanism may corrode. If the stem corrodes, the door handle could detach from the emergency door opening mechanism, delaying the opening of the door and the evacuation of the bus. In the event of an emergency, this may increase the risk of injury to the bus occupants. DTNA will notify owners, and dealers will either replace the stems or protect them against corrosion, free of charge. An interim notice was sent to owners on July 28, 2016. A second notice will be mailed to owners when parts become available. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-713.

16V-395

Southeast Toyota Distributors, LLC (SET) is recalling certain 2005-2011 4Runner, Highlander, Sequoia, and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

Sienna, 2005-2010 Avalon and Tundra, 2006-2008 Camry Solara, 2006-2010 Highlander hybrid, 2006-2011 Rav4 and Tacoma, 2007-2010 FJ Cruiser, 2007-2011 Camry hybrid, 2009-2010 Venza, 2010-2012 Prius, 1988-1990 and 2005-2010 Camry, and 1989 and 2009-2010 Corolla vehicles equipped with aftermarket accessory seat heaters with a copper strand heating element. The electrical wiring in the seat heaters may be damaged when the seat cushion is compressed. If damaged, the copper strand heating element may short circuit, increasing the risk of a fire. SET will notify owners, and dealers will disconnect the seat heaters, free of charge, and refund the purchase price of the seat heater accessory. The recall began on July 14, 2016. Owners may contact SET customer service at 1-866-405-4226. SET number for this recall is SET16B.

16V-396

Tiffin Motorhomes is recalling certain model year 2014-2016 Allegro Phaeton and 2015-2016 Allegro Bus trucks manufactured October 1, 2014 to August 1, 2015, equipped with certain ZF RL77 / 80EM independent front steering axles equipped with Bosch 8018 steering boxes. The boxes were manufactured using incorrect internal spacers that can cause premature wear in the connection between the steering wheel and the front axle. The steering wheel's connection to the front axle could fail resulting in a sudden loss of steering ability, increasing the risk of a crash. Tiffin will notify owners, and dealers will inspect and replace the steering box if necessary, free of charge. Owners are urged not to drive their vehicles until they have been inspected. The recall began on August 17, 2016. Owners may contact Tiffin customer service at 1-256-356-8661.

16V-397

Ameritrans Bus, Inc. (Ameritrans) is recalling certain model year 2015-2016 285 shuttle buses manufactured March 2, 2015, through December 23, 2015, built on Ford E-450 chassis and equipped with certain model S2000, S5000, and S5500, wheelchair lifts manufactured by the Ricon Corporation. The platform side plate of the affected wheelchair lifts may crack. Additionally, the lifts are equipped with folding link arms that may have pivot holes that are too big, allowing the bearings to move out of position. If the platform side plates crack or the platform mounting fails from out-of-position bearings, the lift platform can separate from the lift and come to rest against the vehicle's lift door. When the vehicle's doors are opened, the platform may fall onto the lift operator, increasing their risk of injury. Ameritrans will notify the purchasers of the lifts, and Ricon dealers will inspect the side plates for damage and for displaced bearings. The platform will be inspected for cracks. Any damaged parts will be replaced, free of charge. The recall began on June 30, 2016. Owners may contact Ameritrans customer service at 1-574-262-8935, or Ricon customer service at 1-800-322-2884.

16V-398

West-Mark is recalling certain model year 2014-2015 Sugar Tank trailers manufactured October 1, 2014, to June 30, 2015 equipped with certain Haldex Life Seal Type 30/30 Long Stroke Air Brake Actuators. The affected vehicles may experience brake drag due to an improperly seated diaphragm in the brake chamber. Brake drag may result in a wheel end fire. West-Mark has notified their affected customers, and dealers will remove and replace the Haldex Life Seal Type 30/30 long stroke actuators with Haldex Gold Seal Type 30/30 long stroke actuators, free of charge. The recall began on May 12, 2016. Owners may contact West-Mark customer service at 1-800-692-5844. Owners may also contact Haldex customer service at 1-800-752-2501 or HaldexHotline@Haldex.com.

16V-399

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

Spartan Motors (Spartan) is recalling certain model year 2015 Gladiator and MetroStar Emergency Response vehicles manufactured June 3, 2015, to March 16, 2016, equipped with pumps to provide pressurized water to aid in fighting fires. These pumps have 6" intake strainers that may have been improperly soldered during production and, as a result, the strainers may come apart during use, allowing parts of the strainer and debris to enter the pump, possibly damaging the pump. If the strainer and/or debris enters the pump, and the operator is forced to shut down the pump, reducing firefighting effectiveness, there could be an increased risk of injury. Spartan will notify owners to check the strainer for missing solder at the joints. Any strainers missing solder will be replaced, free of charge. The recall began on June 10, 2016. Owners may contact Spartan customer service at 1-800-543-5008 or Hale Products Customer Service Center at 1-800-533-3569. Spartan's number for this recall is 16012.

16V-400

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain model year 2001-2002 Chrysler Sebring and Dodge Stratus vehicles, equipped with beige interiors. The affected vehicles were previously repaired for a recall issue using an incorrect part. The incorrect part may not prevent the passenger side sun visor from detaching if the passenger frontal air bag deploys and the passenger side sun visor is folded down in a certain position. If the passenger side sun visor detaches and is propelled rearward, there is an increased risk of occupant injury. Chrysler will notify the affected owners. Dealers will install the correct tether strap to retain the passenger sun visor, free of charge. The recall began July 26, 2016, owners will be sent a second email when parts are available. Owners may contact Chrysler customer service at 1-800-853-1403.

16V-401

Keystone RV Company (Keystone) is recalling certain model year 2016-2017 Dutchmen Kodiak recreational trailers manufactured June 10, 2015 through April 6, 2016. In the affected vehicles, the two sections of LED rope lights that serve as backlighting for the countertop each have exposed ends which may short against each other, possibly resulting in an electrical short. An electrical short increases the risk of a fire. Keystone notified owners, and dealers will install a heat shrink tube over one of the LED rope light ends, free of charge. The recall began on June 8, 2016. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 16-255.

16V-402

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2016 Jetta vehicles manufactured October 31, 2015, to January 21, 2016, 2016 Passat vehicles, equipped with 1.8T engines manufactured November 13, 2015, to December 9, 2015, and 2016 Golf vehicles manufactured November 5, 2015, to November 11, 2015. In the affected vehicles, the fuel rail may detach from the cylinder head and result in a fuel leak. A fuel leak, in the presence of an ignition source, can result in a vehicle fire. Volkswagen will notify owners, and dealers will replace the cylinder heads, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Volkswagen customer service at 1-800-822-8987. Volkswagen's number for this recall is 15F7.

16V-403

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

Lakota Corporation (Lakota) is recalling certain model year 2016 Lakota Bighorn, Charger, and Livestock Edition trailers manufactured October 8, 2015, through November 10, 2015, and equipped with 17.5 inch aluminum rims. In the affected trailers, the aluminum rims may have pin holes, resulting in a loss of tire pressure. A loss of tire air pressure may result in tire failure, increasing the risk of a crash. Lakota will notify the owners, and dealers will inspect and replace any defective wheels, free of charge. The recall began on August 24, 2016. Owners may contact Lakota customer service at 1-574-848-1636.

16V-404

Blue Bird Body Company (Blue Bird) is recalling certain model year 2015-2017 All American transit buses manufactured from November 13, 2014, through May 4, 2016, and 2016-2017 Vision transit buses manufactured from May 30, 2015, through February 2, 2016, equipped with Ricon S-Series (S2005 and S5510) wheelchair lifts. In the affected vehicles the platform side plate on the wheelchair lifts may crack. Additionally, the lifts are equipped with folding link arms that may have pivot holes that are too big, allowing the bearings to move out of position. If the platform side plates crack or the platform mounting fails from out-of-position bearings, the lift platform can separate from the lift and come to rest against the vehicle's lift door. When the vehicle's doors are opened, the platform may fall onto the lift operator, increasing their risk of injury. Blue Bird will notify owners, and Ricon dealers will inspect the link arms for damage or for displaced bearings. The platform will be inspected for cracks. Any damaged parts will be replaced, free of charge. The recall began on June 27, 2016. Owners may contact Blue Bird customer service at 1-478-822-2242 or Ricon Customer Service at 1-800-322-2884. The recall number for Blue Bird is R16YR-NSB.

16V-405

Thor Motor Coach (TMC) is recalling certain model year 2015-2016 Tuscany motor homes manufactured July 28, 2014, to July 27, 2015. The affected vehicles are built on a Freightliner Custom Chassis and have steering boxes that were manufactured using incorrect internal spacers, resulting in premature wear in the connection between the steering wheel and the front axle. The steering wheel's connection to the front axle could fail resulting in a sudden loss of steering ability, increasing the risk of a crash. TMC will notify owners, and Freightliner Custom Chassis dealers will inspect and replace the steering box if necessary, free of charge. The recall began on June 10, 2016. Note: Owners are urged not to drive their vehicles until they have been inspected. Owners may contact Freightliner Custom Chassis customer service at 1-800-547-0712 or TMC customer service at 1-877-855-2867. TMC's number for this recall is RC000115.

16V-406

Daimler Trucks North America LLC (DTNA) is recalling certain model year 1998-2002 Thomas Built Buses Saf-T-Liner Conventional, 2000-2002 Saf-T-Liner ER, 2000-2002 Saf-T-Liner MVP-EF, 2000-2001 CL-960, 1998-1999 Vista, 2000-2002 Saf-T-Liner MVP-ER, and 2000-2002 TL-960 transit buses. In the affected vehicles, the stem that connects the outside emergency door handle to the emergency door opening mechanism may corrode. If the stem corrodes, the door handle could detach from the emergency door opening mechanism, delaying the opening of the door and the evacuation of the bus. In the event of an emergency, this may increase the risk of injury to the bus occupants. DTNA will notify owners, and dealers will either replace the stems or protect them against corrosion, free of charge. An interim notice was sent to owners on July 28, 2016. A second notice will be mailed to owners when parts become available. Owners may contact DTNA customer

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

service at 1-800-547-0712. DTNA's number for this recall is FL-713.

16V-407

DS Corp DBA Crossroads RV (Crossroads) is recalling certain model year 2016-2017 Hill Country and Sunset Trail recreational trailers manufactured May 13, 2015, to April 18, 2016 and equipped with an outside kitchen compartment. In the affected trailers, the inside range burners may be extinguished unintentionally when the outside kitchen compartment door is opened. With the burners extinguished, the propane may continue to flow, creating a build up of propane gas, which in the presence of an ignition source, can increase the risk of a fire and/or explosion. Crossroads has notified owners, and dealers will install a piece of trim to cover the air gap behind the inside range to the outside kitchen, free of charge. The recall began on June 9, 2016. Owners may contact Crossroads customer service at 1-855-226-7496. Crossroad's number for this recall is 16-254.

16V-409

Oshkosh Corporation (Oshkosh) is recalling certain model year 2016 S-Series Front Discharge Concrete Mixers manufactured May 16, 2016, to May 25, 2016, equipped with a Cummins ISX12 or ISX15 engine using certain engine control modules (ECM). These ECM's may experience an internal electrical short that can cause a fuse to blow, resulting in an unexpected engine stall without the ability to restart the engine. An engine stall can increase the risk of a crash. Cummins will notify owners, and dealers will replace the existing ECM with a new ECM, free of charge. The recall began on July 7, 2016. Owners may contact Oshkosh customer service at 1-888-686-7278. Owners may also contact Cummins customer service at 1-800-343-7357. Oshkosh's number for this recall is 16E047-Cummins C1792.

16V-410

Forest River, Inc. (Forest River) is recalling certain model year 2015 Glaval Synergy transit buses manufactured March 23, 2015, to April 29, 2015. The affected vehicles are built on a Freightliner Custom Chassis and have steering boxes that were manufactured using incorrect internal spacers, resulting in premature wear in the connection between the steering wheel and the front axle. The steering wheel's connection to the front axle could fail resulting in a sudden loss of steering ability, increasing the risk of a crash. Forest River will notify owners, and Freightliner dealers will inspect and replace the steering box, as necessary, free of charge. The recall began on June 10, 2016. Note: Owners are urged not to drive their vehicles until they have been inspected. Owners may contact Forest River customer service at 1-574-262-2212 or Freightliner customer service at 1-800-547-0712. Forest River's number for this recall is 35-06022016-0207.

16V-411

Nova Bus (Nova) is recalling certain model year 2012-2015 Nova LFS and LFS Artic transit buses manufactured from June 18, 2012, through October 19, 2015. The affected transit buses have destinations signs that may not be properly secured and, as a result, the sign may fall. If a sign falls, there is an increased risk of injury to anyone under or standing near the sign. Nova will notify owners, and dealers will inspect and secure the sign as necessary, free of charge. The recall began on July 20, 2016. Owners may contact Nova customer service at 1-450-472-6410. Nova's recall number for this campaign is CR3539.

16V-412

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

Terex Advance (Terex) is recalling certain model year 2016 Front Discharge Concrete Mixer trucks manufactured January 14, 2016, to May 31, 2016. The weld on the outer chute race may fail causing the main chute to detach and fall off while the vehicle is in motion. If the main chute detaches while the vehicle is being driven there would be an increased risk of a crash. Terex has notified the affected owners, and dealers will replace the main chute race assembly, free of charge. The recall began on June 13, 2016. Owners may contact Terex customer service at 1-800-678-5961. Terex's number for this recall is Construction_000278.

16V-413

Newmar Corporation (Newmar) is recalling certain model year 2014-2016 Dutch Star motorhomes manufactured from June 5, 2014, through October 16, 2015, and built on a Freightliner chassis. In the affected vehicles, the steering box may have been manufactured with an incorrect spacer with insufficient height that can cause too much play, causing the connection to wear between the steering wheel and the front axle. The steering wheel's connection to the front axle could fail resulting in a sudden loss of steering control, increasing the risk of a crash. Newmar will notify owners, and Freightliner dealers will inspect and replace the steering box if necessary, free of charge. Note: Owners are urged not to drive their vehicles until they have been inspected. The recall began on July 14, 2016. Owners may contact Freightliner customer service at 1-800-547-0712 or Newmar customer service at 1-800-731-8300. Newmar's number for this recall is 16V 366.

16V-414

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2007-2009 Audi A8 and S8 vehicles. The sunroof glass on the affected vehicles may not be properly secured to the sunroof frame. As a result, the sunroof glass may detach from the car while driving. If the glass detaches from the sunroof frame it could become a road hazard, increasing the risk of a crash. Volkswagen will notify owners, and dealers will install additional adhesive between the sunroof glass and frame, free of charge. The recall began August 4, 2016. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 60C3.

16V-415

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2017 Freightliner Cascadia, 122SD, Western Star 4900SA and 4900FA, and FCCC XCM and XCP trucks manufactured from March 14, 2016, through May 18, 2016, equipped with a Cummins ISX12 or ISX15 engine using certain engine control modules (ECM). These ECM's may experience an internal electrical short that can cause a fuse to blow, resulting in an unexpected engine stall without the ability to restart the engine. An engine stall without the ability to restart the engine can increase the risk of a crash. Cummins will notify owners, and Cummins dealers will install a new ECM, and correct ECM calibrations, free of charge. The recall began on July 8, 2016. Owners may contact DTNA customer service at 1-800-547-0712, or Cummins customer service at 1-800-343-7357. DTNA's number for this recall is FL-715.

16V-416

Honda (American Honda Motor Co.) is recalling certain model year 2015 Acura MDX 2WD manufactured September 5, 2014 through January 13, 2015, 2015 Acura MDX 4WD manufactured September 19, 2014 through November 11, 2014, 2016 Acura MDX 4WD manufactured February 26, 2015 through June 10, 2015, 2015 Honda Odyssey manufactured September 6, 2014 through July 15, 2015, 2016 Honda Odyssey

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

manufactured September 15, 2015, 2016 Honda Pilot 2WD manufactured June 11, 2015 through September 15, 2015, and 2016 Honda Pilot 4WD manufactured June 1, 2015 through October 15, 2015 vehicles. In the affected vehicles some fuel tanks were manufactured with inadequate welds which may separate and allow for fuel leakage. If the fuel tank leaks, the unexpected fuel loss may lead to an engine stall while driving, increasing the risk of a crash. A fuel leak in the presence of an ignition source may also result in a fire. Honda will notify owners, and dealers will replace the fuel tank, free of charge. Owners may contact Honda customer service at 1-888-234-2138. The recall began on July 29, 2016. Honda's numbers for this recall are KA9 and KB0.

16V-417

Daimler Trucks of North America (DTNA) is recalling certain model year 2008-2009 Sterling Bullet 4500 and 5500 chassis cab vehicles manufactured October 15, 2007, through November 10, 2008. These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. These inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity, high temperatures, and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death. Sterling will notify the owners and dealers will replace the passenger frontal air bag inflator, free of charge. An interim letter was mailed to owners on July 22, 2016. The recall is expected to begin August 1, 2016. Owners may contact Sterling customer service at 1-800-547-0712. DTNA's number for this recall is FL-714.

16V-418

Forest River, Inc. (Forest River) is recalling certain model year 2017 Georgetown motorhomes manufactured May 17, 2016, through May 9, 2016. These vehicles were accidentally equipped with two seat belt assemblies on the rear-facing dinette seat, allowing the vehicle to transport up to eight passengers instead of six passengers as the gross vehicle weight rating (GVWR) was based on. With the extra passengers, the GVWR may be exceeded and the vehicle may be overloaded, increasing the risk of a crash. Forest River has notified owners, and dealers will remove the extra seat belt assemblies, free of charge. The recall began on July 5, 2016. Owners may contact Forest River customer service at 1-574-206-7600. Forest River's number for this recall is 15-05312016-0204.

16V-419

Southeast Toyota Distributors, LLC (SET) is recalling certain model year 2016 Toyota Camry and Highlander, 2015-2016 Toyota Tundra, Scion FR-S, and tC vehicles. The Load Carrying Capacity Modification Label may not reflect the correct added weight of the installed accessories. As a result, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 110, "Tire Selection and Rims for Passenger Cars." An incorrect label may lead an owner to overload the vehicle, increasing the risk of a crash. SET will notify owners, and provide a corrected label for placement over the inaccurate label, free of charge. The recall began on July 14, 2016. Owners may contact SET customer service at 1-866-405-4226.

16V-420

McNeilus Truck & Manufacturing, Inc. (McNeilus) is recalling certain model year 2016 Bridgemaster V Concrete Mixers manufactured April 8, 2016, through May 13, 2016. The affected vehicles have bridge axle tube sleeves that may crack along the tube sleeves. If one tube sleeve cracks, vehicle handling may be affected.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

If both tube sleeves crack, the bridge axle may detach from the vehicle. Either condition increases the risk of a crash. The owners have been notified and all the affected vehicles have had the bridge axles replaced, free of charge. Therefore, an owner notification letter will not be issued for this campaign. The recall began on May 24, 2016. Owners may contact McNeilus customer service at 1-507-374-6321. McNeilus' number for this recall is Hendrickson TB-H801.

16V-421

General Motors LLC (GM) is recalling certain model year 2015-2016 Chevrolet Sonic and Trax, and 2013-2015 Spark vehicles equipped with a Bring Your Own Media radio. The affected radios may fail to provide an audible warning chime when the driver fails to fasten their seatbelt or if the driver leaves the key in the ignition. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) numbers 208 "Occupant Crash Protection" and 114 "Theft Protection." Without audible indicators, the driver may not fasten their seatbelt, increasing the risk of injury during a crash. GM will notify owners, and dealers will update the radio software, free of charge. The recall began on July 22, 2016. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 45340.

16V-422

Heartland Trailer Mfg. (Heartland) is recalling certain model year 2016 18' Carhauler dovetail trailers manufactured December 1, 2015, to April 30, 2016. The affected trailers have clearance lights that are not visible from the rear of the trailer. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Assoc. Equipment." Without visible clearance lights, the trailer is at an increased risk of a crash. Heartland will notify owners, and dealers will install P2-rated beehive-style clearance lamps on the front and rear sides of the trailer, free of charge. The recall began on July 22, 2016. Owners may contact Heartland customer service at 1-573-471-6826.

16V-423

Maserati North America, Inc. (Maserati) is recalling certain model year 2014 Quattroporte and Ghibli vehicles manufactured June 1, 2013, to February 28, 2014. The affected vehicles, equipped with an eight-speed automatic transmission and a monostable gear selector, may mislead owners about which gear the vehicle is in and may not adequately warn the driver when driver's door is opened and the vehicle is not in PARK, allowing them to exit the vehicle while the vehicle is still in gear. Drivers thinking that their vehicle's transmission is in the PARK position may be struck by the vehicle and injured if they attempt to get out of the vehicle while the engine is running and the parking brake is not engaged. Maserati will notify owners, and dealers will perform a software update, free of charge. The remedy software is currently in development. Owners will be mailed an interim notification on July 1, 2016. A second notice will be mailed when the software is available. Owners may contact Maserati customer service at 1-201-510-2369. Maserati's number for this recall is 307.

16V-424

Vermeer Manufacturing Company (Vermeer) is recalling certain 2014-2016 TG5000 Tub Grinder trailers manufactured November 23, 2013, to May 23, 2016. The spherical washers used during the assembly of the kingpin may have been installed incorrectly, possibly causing the attaching bolts to fail and therefore the kingpin

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

to detach. If the kingpin does not remain properly connected to the trailer, the trailer may detach from the vehicle, increasing the risk of a crash. Vermeer will notify owners, and dealers will inspect and repair the installation of the spherical washers, as necessary, free of charge. The recall began on August 4, 2016. Owners may contact Vermeer customer service at 1-641-628-3141.

16V-425

PACCAR Incorporated (PACCAR) is recalling certain model year 2017 Kenworth C500, T660, T680, T800, T880, and W900 vehicles manufactured March 9, 2016, to April 26, 2016 and 2017 Peterbilt 320, 365, 367, 389, 567, 579, and 587 vehicles manufactured March 10, 2016, to May 6, 2016. The affected vehicles are equipped with Cummins ISX12 or ISX15 engines and have an engine control module (ECM) that may short circuit, causing the engine to stall without warning without the ability to restart it. An engine stall can increase the risk of a crash. Cummins will notify owners, and Cummins dealers will replace the defective engine control modules, free of charge. The recall began on July 8, 2016. Owners may contact Cummins customer service at 1-800-343-7357, Kenworth customer service at 1-425-828-5000 or Peterbilt customer service at 1-940-591-4000. PACCAR's numbers for this recall are 16KWB (Kenworth) and 616-C (Peterbilt).

16V-426

Vermeer Manufacturing Company (Vermeer) is recalling certain model year 2014-2016 TG5000 vehicles manufactured November 23, 2013, to May 23, 2016. The assembly instruction manual for these vehicles called for the wrong slack adjuster pushrod length to be used, and as a result, the pushrod threads may fail, causing the trailer parking brakes to unintentionally engage. If the trailer brakes unintentionally engage it would increase the risk of a crash. Vermeer will notify owners, and dealers will reset the air brake pushrod length to the correct dimension, free of charge. The recall began on August 4, 2016. Owners may contact Vermeer customer service at 1-641-628-3141. Vermeer's number for this recall is IK3334.

16V-427

East Manufacturing Corp. (East) is recalling certain model year 2016 Hybrid and Steel Dump trailers manufactured May 16, 2016, to June 2, 2016. These trailers may have incorrect Federal Certification labels with overstated gross axle weight ratings (GAWR) and/or gross vehicle weight ratings (GVWR). As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the GAWR and/or GVWR limits are overstated, the driver may overload the trailer, increasing the risk of a crash. East will notify owners, and will supply a new Certification Label and mounting rivets, free of charge. The recall began on July 1, 2016. Owners may contact East customer service at 1-330-325-8204.

16V-428

Spartan Motors USA (Spartan) is recalling certain model year 2017 Gladiator and K3 motorhome chassis manufactured April 18, 2016, through June 7, 2016 and equipped with Cummins ISX15 engines using certain engine control modules (ECM). These ECM's may experience an internal electrical short that can cause a fuse to blow, resulting in an unexpected engine stall without the ability to restart the engine. An engine stall can increase the risk of a crash. Spartan will notify owners, and Cummins dealers will replace the defective ECM with a remedy part, free of charge. The recall began on June 9, 2016. Owners may contact Spartan customer service at 1-800-543-5008. Spartan's number for this recall is 16016.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

16V-429

Nissan North America, Inc.'s (Nissan) is recalling certain model year 2014-2016 Infiniti Q50 vehicles manufactured December 26, 2012, to December 11, 2015, and Infiniti Q50 Hybrid vehicles manufactured December 10, 2012, to December 17, 2015. The Direct Adaptive Steering system may experience an error at vehicle start up altering the vehicle's steering responsiveness and turning radius. If the vehicle does not steer as the driver anticipates, there is an increased risk of a crash. Nissan will notify owners, and dealers will reprogram the Direct Adaptive Steering ECU software, free of charge. The recall began on August 12, 2016. Owners may contact Nissan customer service at 1-800-647-7261.

16V-430

Gulf Stream Coach, Inc. (Gulf Stream) is recalling certain model year 2016-2017 Ameri-Lite and Super-Lite trailers manufactured January 11, 2016, through April 11, 2016. On the Federal Information Certification label, these trailers incorrectly list the tire size as 235/75R-15-C with a wheel size of 15x6, when the correct tire size is actually ST205/75D-14-C with a wheel size of 14x5.5. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If relying on the label, an incorrect replacement wheel and tire combination may be installed, possibly increasing the risk of a crash. Gulf Stream will notify owners, and dealers will install a corrected Federal Certification label, free of charge. The recall began on July 22, 2016. Owners may contact Gulf Stream customer service at 1-800-289-8787. Gulf Stream's number for this recall is GT060816.

16V-431

KZRV, L.P. (KZRV) is recalling certain model year 2016-2017 Spree travel trailers manufactured March 13, 2015, to May 3, 2016. The refrigerator vents on the affected trailers may be installed in an incorrect location, causing the refrigerator compartment to overheat, triggering the high temperature sensors to shut down the refrigerator. If the high temperature sensor fails to shut down the refrigerator, the refrigerator would overheat, increasing the risk of a fire. KZRV will notify owners, and dealers will install a larger refrigerator vent, and extend the internal baffle, free of charge. The recall began on July 22, 2016. Owners may contact KZRV customer service at 1-800-768-4016 extension 153 or 154.

16V-432

PJ Trailers is recalling certain model year 2015-2016 T1 single axle tilt trailers manufactured March 31, 2015, to November 17, 2015. During production, these trailers had a notch cut into steel tongue that may have been too deep and thus compromised the strength of the tongue, causing it to crack and separate from the trailer. If the trailer separates from the tongue, the rest of the trailer would not be connected to the tow vehicle, increasing the risk of a crash. PJ Trailers has notified owners, and provided each owner with a reinforcement kit to have installed, free of charge. Units were kept at the dealers until repair kits were properly installed. The recall began in November 2, 2015. Owners may contact PJ Trailers customer service at 1-866-752-8781.

16V-433

Corp. Micro Bird Inc. (Micro Bird) is recalling certain model year 2015-2016 MBII, G5, and CT-Series commercial buses manufactured August 21, 2015, to June 2, 2016. The affected buses have T-Slider window

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

frames that may allow water to accumulate inside the frame. In freezing conditions, the accumulated water can freeze, expand and put extra pressure on the window glass causing it to shatter. Shattered window glass may increase the risk of injury to the bus occupants. Micro Bird will notify owners, and dealers will seal or replace the windows, as necessary, free of charge. The recall began on July 19, 2016. Owners may contact Lippert Window customer service at 1-450-378-6722 or Micro Bird customer service at 1-819-477-2012. Micro Bird's number for this recall is 16-066-LUC.

16V-434

Terex South Dakota, Inc. (TSD) is recalling certain model year 2016 HR, HRX, LT, LTM, TL, TC, and TCX aerial devices manufactured January 1, 2016, to May 12, 2016. These aerial devices have a hydraulic motor whose shaft may fail resulting in unexpected boom rotation or winch movement. Unexpected boom rotation or winch movement may increase the risk of injury. TSD will notify owners, and instruct owners to inspect the hydraulic motor. Motors within a certain serial number range will be replaced, free of charge. The recall began on August 3, 2016. Owners may contact TSD customer service at 1-800-982-8975. TSD's number for this recall is SN641.

16V-435

Nissan North America, Inc. (Nissan) is recalling certain model year 2016 LEAF vehicles manufactured February 24, 2016, to March 23, 2016, and Sentra vehicles manufactured February 9, 2016, to March 4, 2016. The wiring harness connector may disconnect from the dual-stage passenger air bag. If the wiring harness disconnects, the passenger air bag may not to deploy during a crash, increasing the risk of injury. Nissan will notify owners, and dealers will inspect the wiring harness connector for proper engagement and, if necessary, replace the passenger air bag module and main body harness, free of charge. The recall began on August 9, 2016. Owners may contact Nissan customer service at 1-800-647-7261.

16V-436

Thor Motor Coach (TMC) is recalling certain model year 2014-2016 Tuscan motor homes manufactured February 28, 2013, to August 31, 2015 and built on chassis supplied by Daimler Trucks North America. On certain motorhome chassis built with a heavier, adjustable foot pedal, the brake activation signal to certain towed devices may not deactivate when the motorhome service brakes are released. If the brake activation signal to a towed device remains active when the motorhome chassis service brakes are released, the brakes on a towed device may remain engaged depending on brake configuration of the trailer. As a result, the brakes would drag and possibly overheat potentially resulting in a fire. Additionally, following drivers may be confused by the motorhome's actions, increasing the risk of a crash. TMC will notify owners, and Daimler Trucks dealers will modify the affected brake assemblies, free of charge. The recall began on July 21, 2016. Owners may contact TMC customer service at 1-877-855-2867 or Daimler Trucks at 1-800-547-0712. TMC's number for this recall is RC000116.

16V-437

Mercedes-Benz USA, LLC (MBUSA) is recalling certain model year 2016 C300 4Matic vehicles manufactured November 4, 2015, to March 1, 2016. In the affected vehicles, the electric power steering assist system may shutdown due to a software error. If the vehicle experiences a loss of power steering assist, extra steering effort

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

will be required at lower speeds, increasing the risk of a vehicle crash. MBUSA will notify owners, and dealers will update the software for the electric power steering control unit, free of charge. Owners may contact MBUSA customer service at 1-800-367-6372.

16V-438

Mercedes-Benz USA, LLC (MBUSA) is recalling certain model year 2016 SLK300, SLK350, SL400, SL550, and SL63 AMG vehicles manufactured from June 29, 2015, through July 13, 2015. The affected vehicles are equipped with low-beam headlights that may have been aimed incorrectly during vehicle production. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Improperly adjusted low-beam headlights may reduce the driver's visibility, increasing the risk of a crash. MBUSA will notify owners, and dealers will inspect and if necessary adjust the headlamps, free of charge. The recall began on July 22, 2016. Owners may contact MBUSA customer service at 1-800-367-6372.

16V-439

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain model year 2016 GLE450 AMG 4Matic Coupe vehicles manufactured December 10, 2014, to June 6, 2016. An error within the engine control unit (ECU) software may allow the engine to shut-down while the vehicle is braking, possibly confusing the driver into thinking the shut-down was planned due to the ECO start/stop function. If the engine shuts down unintentionally, there may be an increased risk of a crash. MBUSA will notify owners, and dealers will update the ECU software, free of charge. The recall began August 2016. Owners may contact MBUSA customer service at 1-800-367-6372.

16V-440

Eldorado National-Kansas (Eldorado) is recalling certain model year 2012-2016 Amerivan 10 vehicles manufactured November 30, 2012, to May 20, 2016. Due to an improperly installed fuel line separator, the fuel line may rub against the engine cradle and cause a fuel leak. A fuel leak in the presence of an ignition source may result in a fire. Eldorado will notify owners, and dealers will inspect the fuel line, and rework fuel line routing, free of charge. The recall began on September 7, 2016. Owners may contact Eldorado customer service at 1-913-392-2171.

16V-441

Mercedes-Benz USA, LLC (MBUSA) is recalling certain model year 2015 ML250, ML350, ML350 4Matic, ML63 AMG, and 2016 GLE450 AMG 4Matic vehicles manufactured from April 27, 2015, through May 19, 2015. The affected vehicles were manufactured with an out of specification anchor bolt installed where the rear seat belt anchor is attached. The seat belt anchor bolt may not be attached as designed. In the event of a vehicle crash with high loads on the right rear seatbelt anchor bolt, the bolt could fail and could increase the potential injury risk for occupants.

MBUSA will notify owners, and dealers will inspect and if necessary properly install the right rear anchor bolt, free of charge. The recall began on July 22, 2016. Owners may contact MBUSA customer service at 1-800-367-6372

16V-442

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

E-One Incorporated (E-One) is recalling certain model year 2014-2016 E-One Cyclone II and Typhoon vehicles manufactured January 1, 2014, to May 31, 2016, equipped with certain Class 1 Es-Key power control modules manufactured by Hale Products. The affected power control modules may not provide sufficient circuit protection depending on their combination of software and installation, possibly resulting in a short circuit. A short circuit may result in damage to components of the vehicle's electrical system, affecting their function such as causing a loss of headlights, increasing the risk of a crash. A short circuit may also increase the risk of a fire. E-One will notify owners, and dealers will upgrade the software or retrofit fuses, free of charge. The recall began on July 25, 2016. Owners may contact E-One customer service at 1-904-237-1122, or Hale customer service at 1-800-533-3569.

16V-443

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain model year 2016 Land Rover LR4 vehicles manufactured May 3, 2016 through May 10, 2016. These vehicles are equipped with certain air bag inflators assembled as part of the drivers frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the driver air bags, these inflators may fail to fully inflate due to a malformed canister.

If the air bag does not fully inflate, the driver will not be protected resulting in serious injury or death. Land Rover will notify owners, and dealers will replace the drivers air bag, free of charge. The recall began on August 5, 2016. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is P086.

16V-444

Ferrara Fire Apparatus, Inc. (Ferrara) is recalling certain model year 2015-2016 Inferno, Igniter, Cinder, Ultra, and Intruder vehicles built on Freightliner and International chassis manufactured August 3, 2015, to April 29, 2016, equipped with pumps to provide pressurized water to aid in fighting fires. These pumps have 6" intake strainers that may have been improperly soldered during production and, as a result, the strainers may come apart during use, allowing parts of the strainer and debris to enter the pump, possibly damaging the pump. If the strainer and/or debris enters the pump, and the operator is forced to shut down the pump, reducing firefighting effectiveness, there could be an increased risk of injury. Ferrara will notify owners, and owners will check the strainer for missing solder at the joints. Any strainers missing solder will be replaced, free of charge. The recall began on July 20, 2016. Owners may contact Ferrara customer service at 1-800-443-9006 or hale customer service at 1-800-533-3569.

16V-445

Indian Motorcycle Company (Indian) is recalling certain model year 2014-2016 Chief Classic, Dark Horse, Chieftain, Roadmaster, Vintage, Springfield, and Chieftain Dark Horse motorcycles manufactured April 15, 2013, to June 16, 2015. In the event of an engine misfire, unburned fuel may pass through parts of the exhaust system, raising the exhaust temperatures. Elevated exhaust temperatures may result in an increased risk of fire. Indian will notify owners, and dealers will update the engine control module (ECM) software, free of charge. The recall began July 2016. Owners may contact Indian customer service at 1-877-204-3697. Indian's number for this recall is I-16-02.

16V-446

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

Eldorado National-Kansas (Eldorado) is recalling certain model year 2016 Aerotech, Aero Elite, and Advantage shuttle buses manufactured March 4, 2016, to April 22, 2016 and built on Ford, Chevrolet, and Navistar chassis. These vehicles have a component in the electrical power distribution center that may break and result in electrical arcing. Electrical arcing increases the risk of a fire. Eldorado will notify owners, and dealers will replace the affected component within the power distribution center, free of charge. The recall began on July 29, 2016. Owners may contact Eldorado customer service at 1-800-955-4236.

16V-447

Spartan Motors USA (Spartan) is recalling certain model year 2004-2016 Gladiator tractor-drawn aerial emergency vehicles manufactured September 12, 2004, to September 30, 2015. The air brakes on these vehicles may have excessive actuation and release timing, lengthening the distance needed to stop the vehicle. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." If a longer distance is needed to stop the vehicle there would be an increased risk of a crash. Spartan will notify owners, and dealers will repair the vehicles with a new 3/8" control line, free of charge. The recall is expected to begin on October 12, 2016. Owners may contact Spartan customer service at 1-800-543-5008. Spartan's number for this recall is 16017.

16V-448

General Motors LLC (GM) is recalling certain model year 2016 Chevrolet Equinox and GMC Terrain vehicles manufactured October 16, 2015. The certification labels may have incorrect tire/rim size and cold tire pressure information. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." If the information on the certification labels is incorrect, the operator may install incorrectly sized tires or rims or may improperly inflate the tires, increasing the risk of a crash. GM will notify owners, and dealers will inspect and replace the certification label, free of charge. The recall began on July 14, 2016. Owners may contact Chevrolet customer service at 1-800-222-1050, or GMC customer service at 1-800-462-8782. GM's number for this recall is 46600.

16V-449

Forest River, Inc. (Forest River) is recalling certain model year 2016-2017 Flagstaff recreational trailers manufactured August 11, 2015, through October 27, 2015, and Work N' Play recreational trailers manufactured from October 25, 2015, through May 6, 2016. The MB Sturgis liquid propane (LP) regulator on these vehicles may allow propane gas to leak into the regulator sight glass causing it to degrade and potentially crack. If the indicator sight glass cracks, propane gas may leak out. In the presence of an ignition source, a fire could occur. Forest River will notify owners. A remedy plan has not been determined. The recall began on August 1, 2016. Owners may contact Forest River customer service at 1-888-291-6665. Forest River's number for this recall is 51-05312016-0205.

16V-450

Gillig LLC (Gillig) is recalling certain model year 2012-2016 Lowfloor diesel-electric hybrid vehicles manufactured March 6, 2012, to June 7, 2016. The affected vehicles are equipped with stop lamp activation that may inadvertently flash the rear brake lights. As such, these vehicles do not comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 108, "Lamps, Reflective Devices, and Assoc.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

Equipment." Flashing brake lights may cause confusion to other drivers, increasing the risk of a crash. Gillig will notify owners, and dealers will install a new software update, free of charge. The recall began on July 1, 2016. Owners may contact Gillig customer service at 1-800-735-1500.

16V-451

Navistar, Inc. (Navistar) is recalling certain model year 2016 IC Bus RE school buses manufactured January 25, 2016, to March 31, 2016, equipped with Freedman-brand passenger seats with integrated child seats (ICS). These seats may separate from the base frame due to bolt failure. As, such these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 222, "School Bus Passenger Seating and Crash Protection." In the event of a crash, the seat can separate from the base frame, increasing the risk of injury to the seat occupant. Navistar has already completed the repair work on the affected vehicles, free of charge to owners. Owner notifications will not be sent. Owners may contact Navistar customer service at 1-331-332-1590.

16V-452

Navistar, Inc. (Navistar) is recalling certain model year 2017 International ProStar, LoneStar, PayStar, HX, and 9900 trucks equipped with a Cummins ISX15L engine using certain engine control modules (ECM). These ECM's may experience an internal electrical short that can cause a fuse to blow, resulting in an unexpected engine stall without the ability to restart the engine. An engine stall can increase the risk of a crash. Cummins will notify owners, and Cummins dealers will replace the ECM, free of charge. The recall began on July 8, 2016. Owners may contact Cummins customer service at 1-800-343-7357 or Navistar customer service at 1-331-332-1590.

16V-453

Navistar, Inc. (Navistar) is recalling certain 2016-2017 IC Bus CE school buses manufactured June 15, 2015, to May 20, 2016, and RE school buses manufactured June 18, 2015, to April 27, 2016. These buses may have been manufactured without reflective outline tape around the emergency exit roof hatches. As a result, these vehicles fail to comply with the requirements for Federal Motor Vehicle Safety Standard (FMVSS) number 217, "Bus Emergency Exits and Window Retention and Release." Absence of the reflective outline tape may reduce conspicuity of the emergency exit roof hatches, reducing the ability of emergency personnel to identify and gain access to the emergency roof hatches, possibly increasing the passenger's risk of personal injury or death during an emergency. Navistar will notify owners, and dealers will install reflective tape around the roof hatch, free of charge. The recall began on June 18, 2016. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 16505.

16V-454

Winnebago Industries, Inc. (Winnebago) is recalling certain model year 2014-2016 Winnebago Tour motorhomes manufactured May 25, 2013, to November 25, 2015, and Itasca Ellipse motorhomes manufactured May 25, 2013, to November 18, 2015. The throttle pedal position sensor on the affected vehicles may not return to zero, causing the engine brake to suddenly not activate as expected, reducing the vehicle's deceleration ability. A sudden loss of an engine brake without warning on a motorhome may lead to a reduced brake ability, potentially increasing the risk of a crash. Winnebago has notified owners, and dealers for Daimler Trucks North

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

America, manufacturers of the motorhome chassis, will replace the throttle pedal, free of charge. An interim notification was distributed to owners on July 5, 2016. The recall began on August 15, 2016. Owners may contact Winnebago customer service at 1-641-585-3535.

16V-455

Mack Trucks, Inc. (Mack) is recalling certain model year 2013 Pinnacle (CXU) trucks manufactured April 16, 2012, to May 4, 2012. These vehicles are equipped with certain Meritor FF967 non-drive front steer axles that may have been incorrectly heat treated. The improperly heat treated axles may fracture, resulting in a loss of vehicle control and increasing the risk of a crash. Mack will notify owners, and dealers will inspect the axles for specific heat code serial numbers. The affected axles will be replaced, free of charge. The recall began on August 1, 2016. Owners may contact Mack customer service at 1-800-866-1177. Mack's number for this recall is SC0404.

16V-456

Forest River, Inc. (Forest River) is recalling certain model year 2013-2016 XLR toyhaulers manufactured August 28, 2012, to November 5, 2015. These vehicles may have an axle equalizer knurled bolt (axle shackle locating bolt) that may not be properly seated in the chassis axle hanger. If the equalizer knurled bolt is not installed properly, the bolt may not properly secure the axle, allowing it to shift and result in a loss of vehicle control, increasing the risk of a crash. Forest River will notify owners, and dealers will replace any equalizer knurled bolts and nuts that were improperly installed, free of charge. The recall began on August 16, 2016. Owners may contact Forest River customer service at 1-574-642-0431. Forest River's number for this recall is 45-06102016-0208.

16V-457

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain model year 2002-2007 Lancer, 2004 Lancer Wagon, 2003-2006 Lancer Evolution, 2003-2006 Outlander and 2007-2013 Outlander V-6 vehicles originally sold in, or ever registered in, Connecticut, Delaware, Illinois, Indiana, Iowa, Kentucky, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, Virginia, West Virginia, Wisconsin and the District of Columbia. In the affected vehicles, the front lower control arms may detach due to the front cross member corroding from salt water exposure such as from road salt use. A detached front control arm can result in the loss of control of the vehicle, increasing the risk of a crash. MMNA will notify owners, and dealers will inspect the front cross members. Depending on the level of existing corrosion, either a sealing/anti-corrosion agent will be applied or the front cross member will be replaced with a new one that has a sealing/anti-corrosion agent applied to it. These repairs will be performed free of charge. Mitsubishi issued an interim notification to owners on August 19, 2016. The manufacturer has not yet provided a notification schedule. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-16-003.

16V-458

Yamaha Motor Corporation, USA (Yamaha) is recalling certain model year 2015-2016 Yamaha YZF-R3 F/G motorcycles manufactured January 1, 2015, to April 15, 2016. Due to an oil pump problem, the oil pressure in these motorcycles may not be properly regulated. As a result, the oil pump drive gear may fail and cause the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

engine to seize from lack of oil supply. If the engine seizes from a lack of oil supply, the rear wheel may lock up suddenly, increasing the risk of a crash. Yamaha has notified owners, and dealers will replace the oil pump, free of charge. The recall began July 5, 2016. Owners may contact Yamaha customer service at 1-800-962-7926. Yamaha's number for this recall is 990105.

16V-459

Yamaha Motor Corporation (Yamaha) is recalling certain model year 2015-2016 YZF-R3 F/G motorcycles manufactured January 1, 2015, to April 15, 2016. The clutch pressure plate bearing may break due to an insufficient load rating, causing the clutch to not disengage and preventing the transmission from shifting properly. If the clutch cannot be disengaged, the rider may not be easily able to stop the motorcycle, increasing the risk of a crash. Yamaha has notified owners, and dealers will replace the clutch pressure plate bearing, free of charge. The recall began July 11, 2016. Owners may contact Yamaha customer service at 1-800-962-7926. Yamaha's number for this recall is 990105.

16V-460

Chrysler (FCA US LLC) is recalling certain model year 2015-2016 Chrysler Town & Country, Dodge Grand Caravan vehicles manufactured July 31, 2015, to April 18, 2016, 2016 Dodge Journey vehicles manufactured August 17, 2015, to January 29, 2016, and 2016 RAM ProMaster vehicles manufactured August 15, 2016, to April 15, 2016. The transmission pump may seize causing a loss of hydraulic pressure. If the transmission loses hydraulic pressure, the vehicle may lose motive power, increasing the risk of a crash. Chrysler will notify owners, and dealers will replace the transmission pump, free of charge. The recall began on August 18, 2016. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S44.

16V-461

Entegra Coach (Entegra) is recalling certain model year 2015-2016 Aspire and Aspire TK motorhomes manufactured July 14, 2014, to January 15, 2016. The throttle pedal position sensor on the affected vehicles may not return to zero, causing the engine brake to suddenly not activate as expected, reducing the vehicle's deceleration ability. A sudden loss of an engine brake without warning on a motorhome may lead to a reduced brake capacity potentially increasing the risk of a crash. Daimler Trucks North America (DTNA), manufacturer of the motorhome chassis, has notified owners, and DTNA dealers will replace the throttle pedal, free of charge. The recall began on August 15, 2016. Owners may contact Entegra customer service at 1-800-945-4787 or Daimler Warranty Campaign Department at 1-800-547-0712 or email DTNA.Warranty.Campaigns@Daimler.com.

16V-462

Entegra Coach (Entegra) is recalling certain model year 2015-2016 Aspire vehicles manufactured July 14, 2014, to January 15, 2016 and built on Daimler Trucks North America motorhome chassis. On these vehicles, equipped with a heavier, adjustable foot pedal, the brake activation signal to certain towed devices may not deactivate when the motorhome service brakes are released. If the brake activation signal to a towed device remains active when the motorhome chassis service brakes are released, the brakes on a towed device may remain engaged depending on brake configuration of the trailer. Additionally, following drivers may be confused by the motorhome's actions, increasing the risk of a crash. Daimler Trucks will notify owners, and their dealers

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

will modify the affected brake assemblies, free of charge. The recall began on June 6, 2016. Owners may contact Entegra customer service at 1-800-945-4787 or Daimler Trucks customer service at 1-800-547-0712.

16V-463

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2016 CC vehicles manufactured January 12, 2016, to February 3, 2016, Golf R and Tiguan vehicles manufactured November 25, 2015, to January 28, 2016, and e-Golf vehicles manufactured November 25, 2015, to January 11, 2016. Vibrations, such as those created by opening and closing a vehicle door, may cause the rear child door locks to disengage, allowing a child to open a rear door while inside the vehicle. If an unrestrained child unexpectedly opens a door, they may fall from the vehicle increasing their risk of injury. Volkswagen will notify owners, and dealers will inspect, and if necessary, replace the child lock(s), free of charge. The recall began on August 22, 2016. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 58C9.

16V-464

Forest River, Inc. (Forest River) is recalling certain model year 2015-2017 Forester motorhomes manufactured June 10, 2014, to May 25, 2016, Sunseeker motorhomes manufactured April 4, 2014, to May 25, 2016, 2015-2016 Solera motorhomes manufactured February 28, 2014, to September 17, 2015, and 2016 Isata motorhomes manufactured October 30, 2015, to May 26, 2016. Water may leak into the electrical module that controls the vehicle taillights, brake lights, turn signal lights, clearance lights and marker lights, making the lights inoperative. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the rear brake lights fail to illuminate, following motorists may not realize that the vehicle in front of them is stopping. Inoperative taillights, clearance lights and marker lights will make the vehicle less visible to others. Either condition can increase the risk of a crash. Forest River will notify owners, and dealers will repair the vehicles, free of charge. The recall began on August 16, 2016. Forester, Solera, and Sunseeker owners may contact Forest River customer service at 1-574-206-7600. Isata customers should call 1-574-262-3474. Forest River's number for this recall is 51-06012016-0206.

16V-465

Forest River, Inc. (Forest River) is recalling certain model year 2017 Spartan Toyhaulers, model STF3712X, manufactured March 31, 2016, to June 17, 2016. The Federal Certification Label incorrectly states that the vehicle has a third axle with two extra tires, however, the vehicle is only equipped with two axles and four tires. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the owner follows the information on the Federal Placard Label, the operator may overload the vehicle, increasing the risk of a crash. Forest River will notify owners, and dealers will install corrected Federal Placards, free of charge. The recall began on July 27, 2016. Owners may contact Forest River customer service at 1-574-862-3033. Forest River's number for this recall is 61-03032016-0211.

16V-466

Volvo Trucks North America, (Volvo) is recalling certain model year 2013 VNM and VNL trucks manufactured April 16, 2012, to May 4, 2012. These vehicles are equipped with certain Meritor FF967 non-drive front steer axles that may have been incorrectly heat treated. The improperly heat treated axles may

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

fracture, resulting in a loss of vehicle control and increasing the risk of a crash. Volvo will notify owners, and dealers will inspect the axles for specific heat code serial numbers. The affected axles will be replaced, free of charge. The recall began on August 1, 2016. Owners may contact Volvo customer service at 1-800-528-6586. Volvo's number for this recall is RVXX1605.

16V-467

Thor Motor Coach (TMC) is recalling certain model year 2016 Tuscany XTE, Palazzo, and 2016-2017 Venetian motorhomes manufactured September 9, 2015, to January 12, 2016. The front sway bar mounting brackets may not fit properly on the axle causing the mounting bolts to bend or loosen. If the sway bar bolts loosen, the sway bar may detach from the axle, affecting the handling and increasing the risk of a crash. TMC will notify owners, and Detroit Axle service centers, subsidiaries of Daimler Trucks, the manufacturer of the chassis, will modify the sway bar mounting, free of charge. The recall began on July 22, 2016. Owners may contact Thor Motor Coach Customer service department at 1-877-500-1020, or Daimler Trucks North America LLC at 1-800-547-0712, or e-mail them at DTNA.Warranty.Campaigns@Daimler.com to locate a service center. TMC's number for this recall is RC000117.

16V-468

Thor Motor Coach (TMC) is recalling certain model year 2014-2016 Tuscany motorhomes manufactured February 28, 2013, to August 31, 2015. The throttle pedal position sensor on the affected vehicles may not return to zero, causing the engine brake to suddenly not activate as expected, reducing the vehicle's deceleration ability. A sudden loss of an engine brake without warning on a motorhome may lead to a reduced brake capacity, potentially increasing the risk of a crash. TMC will notify owners, and dealers for Daimler Trucks North America (DTNA), manufacturer of the motorhome chassis, will replace the throttle pedal, free of charge. The recall began on July 15, 2016. Owners may contact TMC customer service at 1-877-500-1020 or Daimler Warranty Campaign Department at 1-800-547-0712 or by email at DTNA.Warranty.Campaigns@Daimler.com. TMC's number for this recall is RC000119.

16V-469

John Evans Mfg. (John Evans) is recalling certain 2016 Cheetah tandem trailers manufactured July 29, 2015, to August 6, 2015, equipped with certain Haldex Life Seal Type 30/30 Long Stroke Air Brake Actuators. The affected vehicles may experience brake drag due to an improperly seated diaphragm in the brake chamber. Brake drag may result in a wheel end fire. John Evans will notify owners, and dealers will replace the actuators, free of charge. The recall began on July 6, 2016. Owners may contact John Evans customer service at 1-803-436-3100.

16V-470

Harley-Davidson Motor Company (Harley-Davidson) is recalling certain model year 2016 Electric Glide Ultra Classic (FLHTCU), Electra Glide Ultra Classic Low (FLHTCUL), Ultra Limited Low (FLHTKL), Ultra Limited (FLHTK), CVO Street Glide (FLHXSE), Street Glide (FLHX), Street Glide Special (FLHXS), Road Glide Special (FLTRXS), Road Glide (FLTRX), Police Electra Glide (FLHTP), Road Glide Ultra (FLTRU), Fat Boy S (FLSTFBS), Softail Slim S (FLSS), and CVO Softail Pro Street Breakout (FXSE) motorcycles. In the affected motorcycles, the clutch master cylinder may lose the ability to generate enough lift to disengage the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

clutch, especially if the motorcycle has been parked for an extended period of time. When the engine is running and the motorcycle is in gear, if the clutch cannot be fully disengaged, the motorcycle may move unexpectedly, increasing the risk of a crash. Harley-Davidson will notify owners, and dealers will inspect the clutch master cylinder for the presence of gas in the fluid, if so, the dealer will flush the clutch system and rebuild the clutch master cylinder, free of charge. The recall began July 19, 2016. Owners may contact Harley-Davidson customer service at 1-800-258-2464. Harley-Davidson's number for this recall is 0169.

16V-471

Forest River, Inc. (Forest River) is recalling certain model year 2014-2016 Charleston vehicles manufactured September 16, 2013, to December 10, 2015 and assembled on a Freightliner chassis built by Daimler Trucks North America (DTNA). The throttle pedal position sensor on the affected vehicles may not return to zero, causing the engine brake to suddenly not activate as expected, reducing the vehicle's deceleration ability. A sudden loss of an engine brake without warning on a motorhome may lead to a reduced brake capacity, potentially increasing the risk of a crash. Forest River will notify owners, and Daimler Trucks North America dealers will replace the pedal, free of charge. The recall began on August 4, 2016. Owners may contact Daimler Trucks Customer Service Department at 1-800-547-0712 or by E-mail at DTNA.Warranty.Campaigns@Daimler.com. Forest River's number for this recall is 40-06202016-0214.

16V-472

Strick Trailers, LLC (Strick) is recalling certain model year 2015 tandem axle 53 foot van trailers manufactured August 18, 2014, to August 28, 2014, and 2017 tandem axle 53 foot van trailers manufactured November 23, 2015, to December 17, 2015, equipped with certain Bendix SR5 spring brake valves. These valves may have been improperly machined, which may cause a delay of application of the spring brakes while parking. If there is a delay of the spring brake application, the trailer may roll away after it has decoupled from the tractor, increasing the risk of a crash or injury. Stricks will contact owners and provide a remedy kit, complete with instructions, to repair any affected SR-5 trailer relay valves, free of charge. The recall began on August 22, 2016. Owners may contact Strick Trailers Customer Service Department at 1-260-692-1300.

16V-473

Cheetah Chassis Corporation (Cheetah) is recalling certain 2015-2016 Tandem Axle Extendable Chassis trailers, 2015-2016 Tandem Axle and Single Axle Straight Frame Chassis trailers, 2014-2016 Tandem Axle Gooseneck Chassis trailers, 2015 Tandem Axle Flatbed trailers, 2015-2016 Tridem Axle Bridgemaster Chassis trailers and 2016 Tandem Axle Curtain side Flatbed trailers. These trailers are equipped with certain Bendix SR5 spring brake valves which may have been improperly machined which could cause a delay of application of the spring brakes while parking. If there is a delay of the spring brake application, the trailer may roll away after it has decoupled from the tractor, increasing the risk of a crash or injury. Cheetah will contact owners and provide a remedy kit, complete with instructions, to repair any affected SR-5 trailer relay valves, free of charge. The recall began on August 22, 2016. Owners may contact Cheetah Customer Service Department at 1-570-752-2709.

16V-474

Ford Motor Company (Ford) is recalling certain model year 2016 Ford Explorer and F-150 vehicles equipped

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

with a manual recline driver's seat. The seat back frame may have insufficient welds which may not meet the requirements of Federal Motor Vehicle Safety Standard (FMVSS) numbers 202, "Head Restraints" and 207, "Seating Systems." The seat back may not adequately restrain the occupant during a crash, increasing the risk of injury. Ford will notify owners, and dealers will inspect and, if necessary, replace the seat back frame, free of charge. The recall begins on August 18, 2016. Owners may contact Ford at 1-800-392-3673. Ford's number for this recall is 16C11.

16V-475

Great Dane Trailers (Great Dane) is recalling certain model year 2015-2017 Dry Freight Van, Reefer, and Flatbed trailers manufactured January 1, 2014, to March 4, 2016, equipped with certain Bendix SR5 spring brake valves. These valves may have been improperly machined which may cause a delay of application of the spring brakes while parking. If there is a delay of the spring brake application, the trailer may roll away after it has decoupled from the tractor, increasing the risk of a crash or injury. Great Dane will contact owners and provide a remedy kit, complete with instructions, to repair any affected SR-5 trailer relay valves, free of charge. The recall began on September 9, 2016. Owners may contact Great Dane Customer Service Department at 1-912-232-4471.

16V-476

Terex South Dakota (TSD) is recalling certain model year 2015-2016 HR, HRX, TC, and TCX Aerial devices manufactured May 4, 2015, to June 15, 2016. The platform leveling cylinder on the affected vehicles may have poor welds, and as a result, platform leveling cylinder may fail at the elbow, allowing the platform to tilt. If the platform tilts, the platform occupant may fall, increasing their risk of injury. TSD will notify owners, and dealers will replace the hydraulic cylinders, free of charge. The recall began on August 22, 2016. Owners may contact TSD Customer Service Department at 1-800-982-8975. TSD's number for this recall is SN642.

16V-477

Newmar Corporation (Newmar) is recalling certain model year 2014-2016 Dutch Star and Mountain Aire and 2015-2016 London Aire and Essex motorhomes manufactured January 28, 2013, to December 14, 2015 and built on a Daimler Trucks North America (DTNA) chassis. The throttle pedal position sensor on the affected vehicles may not return to zero, causing the engine brake to suddenly not activate as expected, reducing the vehicle's deceleration ability. A sudden loss of an engine brake without warning on a motorhome may lead to a reduced brake capacity, potentially increasing the risk of a crash. Newmar will notify owners, and DTNA dealers will replace the throttle pedal, free of charge. The recall began on August 5, 2016. Owners may contact Newmar Customer Service Department at 1-800-731-8300 or Daimler Trucks North America LLC at 1-800-547-0712, or by e-mail at DTNA.Warranty.Campaigns@Daimler.com. Newmar's number for this recall is 16V321.

16V-478

Ford Motor Company (Ford) is recalling certain model year 2015-2016 Ford Focus Electric vehicles manufactured August 20, 2015, through April 13, 2016. The transmission's differential pinion gear shaft may overheat and fracture. A fractured pinion shaft could cause a loss of motive power and loss of the transmission park function, increasing the risk of a crash. Ford will notify owners, and dealers will replace the transmission

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

differential assembly, free of charge. Remedy parts are currently unavailable. Ford mailed interim notices to owners on July 28, 2016. Owners will receive a second notice when remedy parts become available. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16S28.

16V-479

Kia Motors America (Kia) is recalling certain model year 2016 Sorento vehicles. A component of the rear suspension may not be properly welded. The improper weld may break, affecting the rear suspension alignment, thereby increasing the risk of a crash. Kia will notify owners, and dealers will inspect the welds at the rear suspension cross-member, replacing the rear cross-member assembly, as necessary, free of charge. The recall began July 27, 2016. Owners may contact Kia Customer Service Department at 1-800-333-4542. Kia's number for this recall is SC137.

16V-480

Newmar Corporation (Newmar) is recalling certain model year 2017 Ventana, Ventana VL, and Dutch Star motorhomes manufactured November 1, 2015, to June 24, 2016 and built on a Freightliner Custom Chassis. In the affected vehicles, when the windshield wipers are turned off, the headlights may also turn off. Additionally, the wiper arms may stop in an incorrect location blocking the driver's view, and the wiper motor may stall when under load. If the headlights go out or the wiper system does not operate properly, the driver's visibility may be adversely affected, increasing the risk of a crash. Newmar will notify owners, and Freightliner dealers will update the wiper software, free of charge. The recall began on July 28, 2016. Owners may contact Newmar Customer Service Department at 1-800-731-8300.

16V-481

Ford Motor Company (Ford) is recalling certain model year 2016 Transit Connect vehicles manufactured February 22, 2016, through June 16, 2016. The brake Hydraulic Control Unit (HCU) pump may be contaminated with metallic debris. As such, these vehicles fail to conform to Federal Motor Vehicle Safety Standard (FMVSS) number 126, "Electronic Stability Control Systems." If the brake HCU pump is contaminated, the performance of the electronic stability control and related brake systems may degrade, increasing the risk of a crash. Ford will notify owners and dealers will replace the brake HCU pump, free of charge. The recall began on August 22, 2016. Owners may contact Ford customer service at 1-800-392-3673. Ford's number for this recall is 16C10.

16V-482

Transcraft Corporation (Transcraft) is recalling certain model year 2015-2017 Platform Trailers manufactured January 1, 2014, to March 4, 2016, equipped with certain Bendix SR5 spring brake valves. These valves may have been improperly machined which may cause a delay of application of the spring brakes while parking. If there is a delay of the spring brake application, the trailer may roll away after it has decoupled from the tractor, increasing the risk of a crash or injury. Transcraft will contact owners and provide a remedy kit, complete with instructions, to repair any affected SR-5 trailer relay valves, free of charge. Transcraft issued an interim notification to owners on August 11, 2016. The recall began on September 6, 2016. Owners may contact Transcraft Customer Service Department at 1-618-833-5151.

16V-483

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

Wabash National Corporation (Wabash) is recalling certain model year 2015-2017 Van Trailers manufactured January 1, 2014, to May 10, 2016, equipped with certain Bendix SR5 spring brake valves. These valves may have been improperly machined which may cause a delay of application of the spring brakes while parking. If there is a delay of the spring brake application, the trailer may roll away after it has decoupled from the tractor, increasing the risk of a crash or injury. Wabash will contact owners and provide a remedy kit, complete with instructions, to repair any affected SR-5 trailer relay valves, free of charge. Wabash issued an interim notification to owners on August 10, 2016. The recall began on September 6, 2016. Owners may contact Wabash Customer Service Department at 1-765-771-5300.

16V-484

Nissan North America, Inc. (Nissan) is recalling certain model year 2016 Sentra vehicles manufactured April 11, 2016, through April 26, 2016. The engine room harness may have a terminal pin too large to maintain a connection with the Engine Control Unit (ECU). If the engine room harness loses connection to the ECU, the vehicle may not start or the engine may stall, increasing the risk of a crash. Nissan will notify owners, and dealers will replace the terminal pin on the engine room harness, free of charge. The recall began on August 15, 2016. Owners may contact Nissan customer service at 1-800-647-7261.

16V-485

Vermeer Manufacturing Company (Vermeer) is recalling certain model year 2014-2016 DT6, HG4000, HC6000, HG8000, TG5000, TG7000 and WC2300XL, 2014-2015 TG9000 and 2015-2016 WC2500XL trailers, equipped with certain Bendix SR5 spring brake valves. These valves may have been improperly machined which may cause a delay of application of the spring brakes while parking. If there is a delay of the spring brake application, the trailer may roll away after it has decoupled from the tractor, increasing the risk of a crash or injury. The remedy for this recall is still under development. Vermeer issued an interim notification to owners on August 19, 2016. Owners may contact Vermeer Customer Service Department at 1-641-628-3141. Vermeer's number for this recall is IK3350.

16V-486

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2010-2012 Toyota Prius, 2010 and 2012 Toyota Prius Plug-in Hybrid, and 2011-2012 Lexus CT200h vehicles. A weld in the curtain shield air bag inflator may crack causing one or both portions of the inflator to eject into the passenger cabin. If either portion of the curtain shield air bag inflator ejects into the passenger cabin, there is an increased risk of injury to vehicle occupants. Toyota will notify owners, and dealers will install retention brackets to the curtain shield air bags, free of charge. An interim notice was sent to owners on August 5, 2016. Owners may contact Toyota Customer Service Department at 1-800-331-4331. Toyota's number for this recall is Toyota G0U, and Lexus GLJ.

16V-487

Vermeer Manufacturing Company (Vermeer) is recalling certain model year 2015-2016 Vermeer-Freeman TR620 trailers manufactured August 8, 2014, to June 17, 2016, and TR626 trailers manufactured May 5, 2015, to June 17, 2016, equipped with certain Bendix SR5 spring brake valves. These valves may have been improperly machined which may cause a delay of application of the spring brakes while parking. If there is a

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

delay of the spring brake application, the trailer may roll away after it has decoupled from the tractor, increasing the risk of a crash or injury. The remedy for this recall is still under development. Vermeer issued an interim notification to owners on August 19, 2016. Owners may contact Vermeer Customer Service Department at 1-641-628-3141. Vermeer's number for this recall is VFK3104.

16V-488

Brenner Tank, LLC (Brenner) is recalling certain model year 2015-2017 Liquid Tank trailers manufactured March 14, 2013, to March 30, 2016, equipped with certain Bendix SR-5 spring brake valves. These valves may have been improperly machined which may cause a delay of application of the spring brakes while parking. If there is a delay of the spring brake application, the trailer may roll away after it has decoupled from the tractor, increasing the risk of a crash or injury. The remedy for this recall is still under development. An interim notice was sent to owners on August 22, 2016. Owners may contact Brenner Customer Service Department at 1-800-558-8265.

16V-489

Chrysler (FCA US LLC) is recalling certain model year 2017 Pacifica vehicles manufactured February 22, 2016, through April 28, 2016. The center overhead seat belt stow clip may fracture and prevent use of the seat belt in the third-row and/or second-row center passenger seat (if so equipped). If passengers occupying the third-row and/or second-row center seats cannot use a seat belt, there is an increased risk of injury in the event of a crash. Chrysler will notify owners, and dealers will replace the third-row and, if necessary, second-row center overhead seat belt stow bezel, free of charge. The recall began on July 14, 2016. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S42.

16V-490

Moritz International, Inc. (Moritz) is recalling certain model year 2015-2016 CR-series, SR-series, DLH-series, FH-series, UDC-series, FH+10-series, ULH-series, ULH+6-series, and ULC-series trailers manufactured March 6, 2015, to June 19, 2016. The affected trailers have axles whose mounting brackets may not have been properly tightened. As a result, the axles may detach from the trailer. If an axle loosens or detaches, there would be an increased risk of a crash. Moritz will notify owners, and dealers will properly tighten the axles, free of charge. The recall began on July 22, 2016. Owners may contact Moritz Customer Service Department at 1-419-526-5222.

16V-491

Thor Motor Coach (TMC) is recalling certain model year 2017 Outlaw motorhomes manufactured January 15, 2016, to June 24, 2016. The affected vehicles are missing a warning label near the fuel fill station. This label warns operators not to smoke while in the presence of flammable vapors. An operator that smokes near the fuel fill station with flammable vapors present can increase the risk of a fire. TMC will notify owners, and dealers will install the warning label, free of charge. The recall began on August 9, 2016. Owners may contact TMC's Customer Service Department at 1-877-500-1020. TMC's number for this recall is RC000120.

16V-492

Heartland Trailer Mfg. (Heartland) is recalling certain model year 2015-2016 Revolution trailers manufactured

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JUNE 2016**

Published September 29, 2016

September 1, 2015, to April 30, 2016. The affected trailers have a rear clearance light that is covered by a brace for the rear gate. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." A blocked clearance light may make the trailer less visible to other drivers, increasing the risk of a crash. Heartland will notify owners, and dealers will remove the gate brace, free of charge. The recall began on August 9, 2016. Owners may contact Heartland Customer Service Department at 1-573-471-6826.

16V-493