

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2016**

Published October 14, 2016

CHILD SEATS:

Evenflo Company, Inc. (Evenflo) is recalling certain Evolve 3-in-1 Combination Booster Seats, model number 34411700 manufactured February 26, 2015, to February 9, 2016 and model number 34411741 manufactured May 27, 2015, to February 9, 2016. The affected seats have a button for adjusting the harness tightness. The child in the seat can access this button and loosen the harness without the caregiver's knowledge. If the child is able to loosen the harness, they may not be properly secured in the event of a crash, increasing their risk of injury. Evenflo will notify the registered owners, and will provide a remedy kit with a replacement harness adjustment button, free of charge. The recall began on September 28, 2016. Owners may contact Evenflo at www.evolve.evenflo.com or 1-800-233-5921.

16C-007

EQUIPMENT:

EVS, Ltd. (EVS) is recalling certain EVS emergency vehicle seats, model numbers 1880, 1870, 1780, 1770, 1740, 1750, 1800, 1850, 1900, and 2000. The affected seats are equipped with Dometic/Atwood slide tracks that may not properly engage, allowing seats to move in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 207, "Seating Systems," and 210, "Seat Belt Assembly Anchorages." If the seat moves in the event of a crash, the seat occupant would be at an increased risk of injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact EVS customer service at 1-800-364-3218.

16E-071

Stellar Industries, Inc. (Stellar) is recalling certain 3200-series cranes manufactured December 26, 2012, to July 25, 2016. The proportional control valve can fail and the valve post may eject from the valve housing. If the valve post ejects, it may be a projectile, injuring the crane operator or others nearby. Stellar will notify owners, and dealers will install a retaining bracket to keep the valve from ejecting, free of charge. The recall began on October 10, 2016. Owners may contact Stellar customer service at 1-800-321-3741. Stellar's number for this recall is TBT-1601.

16E-072

Porsche Cars North America, Inc. (Porsche) is recalling certain 1L containers of Porsche-brand Brake Fluid, part number 00004330552, as well as 30L containers of Brake Fluid, part number 00004330553, manufactured September 1, 2015, to August 31, 2016. These bottles of brake fluid state "DOT" and not the required "DOT 4." As such, these bottles of brake fluid fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 116, "Motor Vehicle Brake Fluids." If the brake fluid isn't labeled in accordance with the regulations, the brake fluid may unintentionally be used in a vehicle brake system that is incompatible with that type of fluid, affecting brake performance and increasing the risk of a crash. Porsche will notify dealers, and have the the brake fluid containers relabeled, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Porsche customer service at 1-800-767-7243.

16E-073

TruckCraft Corporation (TruckCraft) is recalling certain TC-505 Lynx Plus 96" wide X 140" long tow bodies,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2016**

Published October 14, 2016

part number D1-06074, manufactured March 9, 2012, to September 22, 2016. The steel understructure of the affected tow bodies may crack, possibly resulting in an attached trailer disconnecting from the tow vehicle. If a towed trailer disconnects from the tow vehicle, there would be an increased risk of a crash. TruckCraft will notify owners, and dealers will install a bolt on upgrade kit, free of charge. The recall is expected to begin October 21, 2016. Owners may contact TruckCraft customer service at 1-800-755-3867.

16E-074

Meritor Inc. (Meritor) is recalling certain 71000 Series Drum Axles, 71000 Series Disc Brake Axles, and 79000 Series Disc Brake Axles manufactured April 22, 2016, to September 9, 2016. The affected axles may have insufficient grease at the wheel ends, possibly resulting in bearing failure. Bearing failure may increase the risk of a crash. Meritor will notify the vehicle manufacturers that purchased the axles. Those manufacturers will notify the vehicle owners, and their dealers will inspect and the grease the wheel ends, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Meritor customer service at 1-248-435-1725. Note: Meritor is advising that vehicles with the affected axles are removed from operation until the recall has been remedied.

16E-075

Thieman Tailgates (Thieman) is recalling certain TVL125, TVL125A, TVL16, TVL16A, and SP TVL125A AL 75X48+18+6 D/FACS liftgates manufactured September 25, 2014, to July 2, 2015. The roller chains on the affected liftgates may fail. If a supporting chain fails unexpectedly during operation, one side of the platform would drop, increasing the risk of an injury to someone on the liftgate or those nearby. Thieman has notified the truck equipment distributors/dealers, body manufacturers, and owners that purchased the affected liftgates and Thieman distributors will replace the roller chains, free of charge. The recall began August 24, 2016. Owners may contact Alan Freeman in Thieman customer service at 1-800-524-5210 extension 104.

16E-076

TIRES:

Goodyear Tire & Rubber Company (Goodyear) is recalling certain G399A LHS tires, size 295/75R22.5 LRG, manufactured January 24, 2016, to May 28, 2016. Due to an anomaly during the curing press set-up operation, incomplete adhesion between the tread and the top belt may have occurred. Incomplete adhesion may result in tread separation of the tire while in use, increasing the risk of a crash. Goodyear will notify the vehicle manufacturers that purchased the tires, as well as those that purchased the tires as replacement equipment. The vehicle manufacturers will notify their owners. Dealers will replace the affected tires with a similar tires, free of charge. The recall began on October 13, 2016. Owners may contact Goodyear customer service at 1-800-592-3267.

16T-013

Tireco Inc. (Tireco) is recalling certain Milestar BS623 tires, size 225/70R 19.5 G/14, manufactured June 23, 2013, to January 24, 2015. The affected tires have incorrect markings on the sidewall, indicating both ratings as "DUAL" when the first rating should be identified as "SINGLE." As such, these tires fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 119, "New Pneumatic Tires-Other

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2016**

Published October 14, 2016

Than Passenger Cars." Incorrectly identifying the ratings on the tires may result in the operator inadvertently overloading the tires, possibly causing their failure, thereby increasing the risk of a crash. Tireco will notify owners, and provide owners with a full refund of the entire purchase price. The recall began on October 14, 2016. Owners may contact Tireco customer service at 1-800-937-9433.

16T-014

VEHICLES:

Kaufman Trailers (Kaufman) is recalling certain model year 2015-2016 Mini 5-Car Hauler trailers, model FE-3/7K-44, manufactured July 1, 2015, to August 24, 2016. During use, the suspension spring eye may break, and allow the axle to slide back and forth. If the axle is able to slide back and forth, the tires on the sliding axle can contact either the fender or the adjacent tire, adversely affecting handling and increasing the risk of a crash. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Kaufman customer service at 1-336-790-6800.

16V-635

Nissan North America, Inc. (Nissan) is recalling certain model year 2016-2017 Nissan Maxima vehicles manufactured February 10, 2015, to August 19, 2016 and equipped with Intelligent Cruise Control, 2015-2017 Murano vehicles manufactured August 22, 2014, to August 19, 2016 and equipped with Intelligent Cruise Control, and 2015-2016 Murano Hybrid vehicles manufactured August 22, 2014, to July 19, 2016. The affected vehicles have Anti-Lock Brake (ABS) actuator pumps that may allow brake fluid to leak onto an internal electrical circuit board. A brake fluid leak onto the circuit board may result in an electrical short, increasing the risk of a fire. Nissan will notify owners, and dealers will inspect the ABS Actuator, replacing it as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Nissan customer service at 1-800-647-7261. Note: When brake fluid has leaked onto the circuit board, the ABS warning lamp will remain illuminated for more than 10 seconds after engine start up. If this occurs, owners are advised to park the vehicle outdoors away from other vehicles or structures and to not drive the vehicle.

16V-636

Tiffin Motorhomes, Inc. (Tiffin) is recalling certain model year 2017 Allegro Bus motorhomes manufactured April 12, 2016, to June 21, 2016. Due to insufficient holding power of the mirror arm swivel mechanism, the passenger side mirror could move while the vehicle is in motion. If the mirror does not stay in position, it can reduce the driver's visibility, increasing the risk of a crash. Tiffin will notify owners, and dealers will install a retrofit kit to secure the passenger mirror swivel arm mechanism, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Tiffin customer service at 1-256-356-8661. Tiffin's number for this recall is TIF-103.

16V-638

Spartan Motors USA (Spartan) is recalling certain model year 2016 Utilimaster Walk-In Vans manufactured January 1, 2016, to August 24, 2016 and equipped with a reclining style seat. The driver's seat on the affected vehicles may recline unexpectedly. Unexpected reclining of the driver's seat may affect the driver's ability to control the vehicle, increasing the risk of a crash. Additionally, if the seat fails in a crash, the seat occupant would

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2016**

Published October 14, 2016

be at a greater risk of injury. Utilimaster will notify owners, and dealers will replace the seat with a non-reclining one, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Utilimaster customer service at 1-800-582-3454. Spartan's number for this recall is 16023.

16V-639

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2017 Audi Q7 vehicles manufactured August 30, 2015, to July 10, 2016. In the affected vehicles, the third row seat back may move forward under load, such as in a frontal collision. As such, the vehicles do not conform to Federal Motor Vehicle Safety Standard (FMVSS) number 207, "Seating Systems." If the third row seat does not remain in its adjusted position, there may be an increased risk of injury to an occupant in the event of a crash. Audi will notify owners, and dealers will install an additional support bracket to the seat, free of charge. The recall is expected to begin in October 2016. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 72F8.

16V-641

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2016-2017 Audi TT and TT Roadster, 2016 Audi A3 Cabrio and A3 e-tron, 2017 Audi A4 allroad, 2015-2017 Audi Q7 and 2017 Q7. The affected vehicles may have been programmed with new software that inadvertently makes the side marker lights inoperative in conjunction with the parking lights or the headlights. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." If the side marker lights do not illuminate, the vehicle may be less visible at night, increasing the risk of a crash. Volkswagen will notify owners, and dealers will upload revised software to correct the issue, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagens number for this recall is 97CB.

16V-642

Ford Motor Company (Ford) is recalling certain model year 2012-2015 Ford Focus, 2013-2015 Ford Escape and Ford C-MAX, 2015 Lincoln MKC and Ford Mustang, and 2014-2016 Ford Transit Connect vehicles. A component within the door latches may break, preventing the doors from latching and/or leading the driver or a passenger to believe a door is securely closed when, in fact, it is not. A door that is not securely latched could open while the vehicle is in motion, increasing the risk of injury to a vehicle occupant. Ford will notify owners, and dealers will replace the door latches with an improved part, free of charge. Due to a limited parts supply, each owner will be sent an interim notification beginning October 3, 2016 and will receive a second notice when parts are available in the second quarter of 2017. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16S30.

16V-643

Mazda North American Operations (Mazda) is recalling certain model year 2010-2013 Mazda3 and Mazdaspeed3 vehicles manufactured November 18, 2008, to June 8, 2013, 2012-2015 Mazda5 vehicles manufactured October 26, 2010, to June 22, 2015, 2016 CX-3 vehicles manufactured June 1, 2015, to December 26, 2015, and 2013-2016 CX-5 vehicles manufactured December 15, 2011, to December 26, 2015. On the affected vehicles, the lift gate support struts may corrode, possibly causing the struts to break

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2016**

Published October 14, 2016

and/or the lift gate to drop unexpectedly. If the lift gate falls unexpectedly, it may hit the user, increasing their risk of injury. Mazda dealers will replace the both lift gate supports, free of charge, however parts are not currently available. Mazda will send interim notifications to owners beginning November 1, 2016 and will mail a second notice when remedy parts are available. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 9916H.

16V-644

Forest River, Inc. (Forest River) is recalling certain model year 2017 Coachmen Viking recreational trailers manufactured May 31, 2016, to August 23, 2016. The affected vehicles may be missing wire clip that retains the gas lift roof struts to the mounting bracket. Without the wire retaining clip, the roof lifting strut could detach from the mounting bracket, allowing one side of the roof to drop down quickly, increasing the risk of injury. Forest River will notify owners, and dealers will install a wire clip to secure the strut, free of charge. The recall is expected to begin October 31, 2016. Owners may contact Forest River customer service at 1-269-467-8281. Forest River's number for this recall is 120-08302016-0240.

16V-645

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2012-2013 Audi A6 and Audi A7 vehicles. The affected vehicles have a fuel hose in the engine compartment that may degrade and leak fuel. A fuel leak in the presence of an ignition source increases the risk of a fire. Audi will notify owners, and dealers will replace the under hood fuel pump and fuel hose, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 24BZ.

16V-646

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2015-2016 Volkswagen Golf, Golf SportWagen, GTI, Audi A3 sedan and A3 Cabriolet vehicles. Due to a problem with the suction pump inside the fuel tank, fuel may flow into the evaporative emissions (EVAP) system. As fuel accumulates in the EVAP system, it may leak out through the charcoal canister filter element. A fuel leak in the presence of an ignition source increases the risk of a fire. Volkswagen will notify owners, and dealers will replace the suction pump, free of charge. Parts are not currently available. An interim notice will be sent to owners by early November and a second notice will be sent when parts are available. Volkswagen owners may contact Volkswagen customer service at 1-800-893-5298, Audi owners may contact Audi customer service at 1-800-253-2834. Volkswagen's numbers for this recall are 20Y6 and 20Y5.

16V-647

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2017 Audi Q7 vehicles manufactured November 11, 2015, to November 23, 2015. In the affected vehicles, the electric power steering assist control unit may short circuit resulting in a loss of power steering assist. With a loss of power steering assist, extra steering effort will be required, especially at lower speeds, increasing the risk of a crash. Audi will notify owners, and dealers will replace the steering rack, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Audi customer service at 1-800-822-2834. Volkswagen's number for this recall is 48M5.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2016**

Published October 14, 2016

16V-648

Maserati North America, Inc. (Maserati) is recalling certain model year 2015 Ghibli vehicles manufactured March 11, 2015, through May 14, 2015. The right and/or left front wheel bearings may have insufficient hardness, resulting in their premature failure. Wheel bearing failure may adversely affect vehicle handling, increasing the risk of a crash. Maserati will notify owners, and dealers will inspect the front wheel bearings, replacing them as necessary, free of charge. The recall began on September 30, 2016. Owners may contact Maserati customer service at 1-201-510-2369. Maserati's number for this recall is 310.

16V-649

Pleasant Valley Teardrop Trailers LLC (Pleasant Valley) is recalling certain model year 2013-2017 T@B travel trailers manufactured January 1, 2013 through August 31, 2016 and equipped with a 3-way refrigerator. The affected vehicles have a rubber gas hose in the refrigerator compartment that can rub against the refrigerator fins, causing the hose to wear and possibly leak propane. A propane leak increases the risk of a fire. Pleasant Valley will notify owners, and dealers will inspect, secure and replace the damaged gas hoses, as necessary, free of charge. The recall began on October 3, 2016. Owners may contact Pleasant Valley customer service at 1-330-852-4811.

16V-650

General Motors LLC (GM) is recalling certain model year 2015-2017 Chevrolet Silverado 2500 HD, 3500 HD, Tahoe, Suburban, GMC Sierra 2500 HD and 3500 HD, GMC Yukon, GMC Yukon XL, Cadillac Escalade and Cadillac Escalade ESV vehicles and 2014-2017 Chevrolet Corvette, Silverado 1500, Trax, Caprice Police Pursuit Vehicle, GMC Sierra 1500, Buick Encore, and 2014-2016 Buick Lacrosse, Chevrolet Spark EV and SS vehicles. In the affected vehicles, certain driving conditions may cause the air bag sensing and diagnostic module (SDM) software to activate a diagnostic test. During this test, deployment of the frontal air bags and the seat belt pretensioners would not occur in the event of a crash. A failure of the front air bags or seat belt pretensioners to deploy in the event of a crash necessitating deployment increases the risk of injury to the driver and front passenger. GM will notify owners, and dealers will reflash the SDM software. Vehicles that have had a previous air bag deployment will have the SDM replaced. These repairs will be performed free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Buick customer service at 1-800-521-7300, Cadillac customer service at 1-800-458-8006, Chevrolet customer service at 1-800-222-1020, or GMC customer service at 1-800-462-8782. GM's number for this recall is 16007.

16V-651

Groupe Cambli Inc. (Cambli) is recalling certain model year 2014-2015 Beverage Industry trailers manufactured January 1, 2014, to September 30, 2015, equipped with certain Bendix SR5 spring brake valves. These valves may have been improperly machined which may cause a delay of application of the spring brakes while parking. If there is a delay of the spring brake application, the trailer may roll away after it has decoupled from the tractor, increasing the risk of a crash or injury. Cambli will notify owners, and Bendix dealers will install a remedy repair kit, free of charge. The recall began on September 29, 2016. Owners may contact Cambli customer service at 1-888-358-4920.

16V-652

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2016**

Published October 14, 2016

BMW North America, LLC (BMW) is recalling certain model year 2016 BMW M2 Coupe vehicles, 2015-2017 M3 Sedan vehicles and 2015-2016 M4 Coupe and M4 Convertible vehicles. During servicing of the rear differential, the rear sub-frame bolts may have been reused instead of being replaced. Reuse of the existing bolts may cause the bolts to loosen. Loosening rear sub-frame bolts may adversely affect vehicle handling and control, increasing the risk of a crash. BMW will notify owners, and dealers will replace the rear sub-frame bolts with new bolts, free of charge. The recall is expected to begin October 24, 2016. Owners may contact BMW customer service at 1-800-525-7417.

16V-653

Daimler Trucks North America (DTNA) is recalling certain model year 2013-2016 Freightliner Custom Chassis Corporation (FCCC) XCM, XCR, and XCL motorhome chassis manufactured December 21, 2012, to December 22, 2015. On certain motorhome chassis built with a heavier, adjustable, straight foot pedal, the brake activation signal to certain towed devices may not deactivate when the motorhome service brakes are released. If the brake activation signal to a towed device remains active when the motorhome chassis service brakes are released, the brakes on a towed device may remain engaged depending on brake configuration of the trailer. As a result, the brakes would drag and possibly overheat potentially resulting in a fire. Additionally, following drivers may be confused by the motorhome's actions, increasing the risk of a crash. DTNA will notify owners, and dealers will modify the affected brake assemblies, free of charge. The recall is expected to begin November 7, 2016. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-723.

16V-654

Forest River, Inc. (Forest River) is recalling certain model year 2017 Surveyor recreational trailers, model SVT226RLDS, manufactured October 9, 2015, to March 16, 2016. These vehicles may be equipped with tires and rims that do not match the information listed on the Federal Placard. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." The operator may over-inflate the tires based on the information printed on the Federal Placard, possibly resulting in sudden tire failure, causing a loss of vehicle control and increasing the risk of a crash. Forest River will notify owners will provide them with a corrected Federal Placard, free of charge. The recall is expected to begin on November 7, 2016. Owners may contact Forest River customer service at 1-574-642-3119 extension 205. Forest River's number for this recall is 37-09082016-0242.

16V-655

Daimler Trucks North America, LLC. (DTNA) is recalling certain model year 2013-2017 Freightliner Cascadia vehicles manufactured September 24, 2012, to May 27, 2015 and equipped with compressed natural gas (CNG) engines. The affected vehicles have a Power Distribution Module (PDM) that is mounted near the CNG fuel tank. Due to its location, the PDM may be sprayed with water and contaminants from the road, possibly causing the PDM to short circuit. If the PDM short circuits, there would be an increased risk of a fire, especially if the nearby CNG tank leaks. DTNA will notify owners, and dealers will relocate the PDM, free of charge. The recall is expected to begin November 7, 2016. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-721.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2016**

Published October 14, 2016

16V-656

Daimler Trucks North America, LLC (DTNA) is recalling certain model year 2017 Thomas Built Buses Saf-T-Liner C2 school buses manufactured April 30, 2016, to July 29, 2016 and equipped with a compressed natural gas (CNG) engine. During a fast fuel fill, an internal seal on a filling valve may dislodge allowing fuel to leak after the tank has been filled. A fuel leak in the presence of an ignition source may increase the risk of a fire. DTNA has notified all affected owners and all of the vehicles have been remedied, therefore owner notification notices will not be issued for this campaign. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-720.

16V-657

Daimler Trucks North America, LLC (DTNA) is recalling certain model year 2016-2017 Freightliner M2 Business Class and 114 SD trucks manufactured March 10, 2015, to July 11, 2016. The brake caliper mounting bolts on the affected vehicles may be incorrectly torqued, allowing the bolts to loosen and detach. If the brake caliper mounting bolts loosen or detach, braking ability may be reduced, increasing the risk of a crash. DTNA will notify owners, and dealers will inspect the brake caliper mounting bolts for the proper torque and tighten them as necessary, free of charge. The recall is expected to begin November 7, 2016. Owners may contact DTNA customer service at -800-547-0712. DTNA's number for this recall is FL-722.

16V-658

Wabash National Corporation (Wabash) is recalling certain model year 2015-2016 Con-Gear Converter Dolly Trailers manufactured March 31, 2014, to August 6, 2015. In the affected trailers, the frame may crack on the counterbalance leg weld seam or the top plate. The cracks may progress and result in the counterbalance leg detaching while the trailer is being used, possibly causing the counterbalance leg to be a road hazard, increasing the risk of a crash. Wabash will notify owners, and dealers will inspect the dolly for cracks, and add welds and weld plugs on the inboard side of the counterbalance legs. If welding will not resolve the issue than the dolly frame will be replaced. These repairs will be performed free of charge. The recall began on September 26, 2016. Owners may contact Wabash customer service at 1-765-771-5404. Wabash's number for this recall is LEG201603.

16V-659

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2009-2012 Audi Q5, and 2007-2012 Audi Q7 vehicles. The fuel cap flange on the affected vehicles may crack and fail, causing a fuel leak. If there is a fuel leak in the presence of an ignition source, it increases the risk of a fire. Volkswagen will notify owners, and dealers will clean the pump flange and install a butyl rubber band to protect the pump, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 20W9.

16V-660

Honda (American Honda Motor Co.) is recalling certain model year 2014-2015 Grom 125 motorcycles manufactured June 12, 2013, to September 8, 2015, and 2014-2015 NSS300 & NSS300A motorcycles manufactured June 18, 2013 to March 19, 2015. The fuel pump assembly on the affected vehicles has a resin

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2016**

Published October 14, 2016

inlet cover that may excessively swell and interfere with rotation of the impeller, causing the engine to stall or a no start condition. If the fuel pump assembly causes engine to stall while driving, it can increase the risk of a crash. Honda will notify owners, and dealers will replace the fuel pump assembly, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is 3HV.

16V-661

Gillig LLC (Gillig) is recalling certain model year 2014-2016 Gillig 29-foot Low Floor transit buses manufactured November 20, 2014, to February 11, 2016. These buses, equipped with disc brakes, have rear brake hoses that can rub chassis components and fray. A frayed hose may leak air, causing the rear brake(s) to lock up unexpectedly, or fail to operate when the brakes are applied. Either scenario increases the risk of a crash. Gillig will provide fleets new rear brake hoses, fittings, clamps, and hardware along with instructions on how to reorient the hoses using the new fittings, and reimburse them for their labor, free of charge. The recall began on September 29, 2016. Owners may contact Gillig customer service at 1-800-735-1500.

16V-662

Smeal Fire Apparatus Co., Inc. (Smeal) is recalling certain 2015-2016 Aerial fire apparatus vehicles manufactured October 1, 2015, to August 31, 2015, equipped with Class 1 Ultraview Touchscreens manufactured by Hale Products. These touchscreens may experience false switch activations that can happen without the operator's knowledge causing accessories to turn on or off, affecting vehicle performance. The unintended turning on or off of accessories such as emergency beacons or automatic snow chains can increase the risk of a crash. Smeal will notify owners, and dealers will reprogram the unit's software, free of charge. The recall is expected to begin October 10, 2016. Owners may contact Smeal customer service at 1-877-415-8628, option 1 for Smeal, then option 4 for Direct Customer Service.

16V-663

Daimler Trucks North America, LLC (DTNA) is recalling certain model year 2016-2017 Thomas Built Buses Saf-T-Liner C2 school buses manufactured November 25, 2015, to September 8, 2016, equipped with ICU3s instrument clusters and hydraulic brakes. In the event of a brake malfunction, these clusters may illuminate the Brake System Malfunction telltale/indicator lamp with the word "PARK" instead of the word "BRAKE". As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 101, "Control and Displays," and number 105, "Hydraulic and Electric Brake Systems." If "PARK" illuminates instead of the word "BRAKE," the driver will be unaware of a braking issue or malfunction, increasing the risk of a crash. DTNA will notify owners, and dealers will replace the ICU3s instrument clusters with new clusters, free of charge. The recall is expected to begin November 11, 2016. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-724.

16V-664

Daimler Trucks North America, LLC (DTNA) is recalling certain model year 2016-2017 Freightliner Custom Chassis (FCCC) S2 chassis and Freightliner Business Class M2 trucks and non-school buses manufactured March 2, 2015, to September 8, 2016, equipped with ICU3s instrument clusters and hydraulic brakes. In the event of a brake malfunction, these clusters may illuminate the Brake System Malfunction telltale/indicator lamp

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2016**

Published October 14, 2016

with the word "PARK" instead of the word "BRAKE". As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 101, "Control and Displays," and number 105, "Hydraulic and Electric Brake Systems." If "PARK" illuminates instead of the word "BRAKE," the driver will be unaware of a braking issue or malfunction, increasing the risk of a crash. DTNA will notify owners, and dealers will replace the ICU3s instrument clusters with new clusters, free of charge. The recall is expected to begin November 11, 2016. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-724.

16V-666

Chrysler (FCA US LLC) is recalling certain model year 2016 Fiat 500 vehicles manufactured June 11, 2015, to July 27, 2016. The tire placard on the affected vehicles lists a tire inflation pressure for the spare tire that exceeds the maximum pressure listed on the sidewall. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." If the spare tire is used while overinflated, the tire may suddenly fail, increasing the risk of a crash. Fiat will notify owners, and dealers will add an overlay on the tire placard to the correct tire inflation information, free of charge. The recall is expected to begin October 28, 2016. Owners may contact Chrysler customer service at 1-888-242-6342. Chrysler's number for this recall is S69.

16V-667

Chrysler (FCA US LLC) is recalling certain model year 2011-2014 Chrysler 200, 2010 Chrysler Sebring, 2010-2012 Dodge Caliber and 2010-2014 Jeep Patriot, Compass and Dodge Avenger vehicles. The Occupant Restraint Control (OCR) module may short circuit, preventing the frontal air bags, seat belt pretensioners, and side air bags from deploying in the event of a crash. If the frontal air bags, seat belt pretensioners, and side air bags are disabled, there is an increased risk of injury to the vehicle occupants in the event of a vehicle crash that necessitates deployment of these safety systems. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S61.

16V-668

Starcraft RV (Starcraft) is recalling certain model year 2017 AR-ONE MAXX LE trailers, model 19BHLE, manufactured August 25, 2016, to September 6, 2016. The Federal label on the affected vehicles states that the trailers are built with two axles, each with a 2500 pound capacity, however, the vehicles are only built with one 2500 pound capacity axle. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." The trailer would be overloaded if the operator goes by the listed axle capacity, possibly resulting in axle or tire failure, thereby increasing the risk of a crash. Starcraft has notified the dealers who have the trailers quarantined and will provide them with a corrected Federal label, free of charge. The recall began September 19, 2016. Owners may contact Starcraft customer service at 1-800-945-4787. Starcraft's number for this recall is 9902319.

16V-669

Daimler Vans USA, LLC (DVUSA) is recalling certain model year 2016 Mercedes-Benz and Freightliner Sprinter 2500 and 3500 vehicles manufactured March 1, 2016, to May 31, 2016. The bolts connecting the

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2016**

Published October 14, 2016

lower seat belt connection to the rear bench seat may not have been properly tightened. If the bolts were not properly tightened, the seat belt may fail to secure the seat occupant in the event of a crash. DVUSA will notify owners, and Sprinter dealers will inspect the connecting bolts, tightening them as necessary, free of charge. The recall is expected to begin in October 2016. Owners may contact DVUSA customer service at 1-877-762-8267.

16V-670

Jayco, Inc. (Jayco) is recalling certain 2017 Octane Super Lite travel trailers manufactured June 22, 2016, to June 23, 2016. The labels on the affected vehicles have incorrect tire load range and tire pressure information. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." Incorrect tire pressure information may result in the tires being over inflated, which can cause their sudden failure, increasing the risk of a crash. Jayco has notified owners and provided them with a new label with the correct tire information, free of charge. The recall began on September 23, 2016. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9901320.

16V-671

Toyota Motor Engineering and Manufacturing (Toyota) is recalling certain model year 2016 Toyota Prius vehicles manufactured November 30, 2015, to June 14, 2016. An air bag inflator manufacturing error may result in the inadvertent partial inflation of the front passenger air bag. A front passenger air bag that unintentionally inflates can increase the risk of a crash or injury. Toyota will notify owners, and dealers will replace the front passenger air bag assembly, free of charge. The recall is expected to begin November 13, 2016. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is GOW.

16V-672

Forest River, Inc. (Forest River) is recalling certain model year 2017 Salem and Wildwood recreational trailers manufactured August 9, 2016, to September 6, 2016. The Federal Placard on the affected vehicles incorrectly lists the tire and rim combination. The placard states ST225/75R15 Load Range C tires with an inflation pressure of 50PSI and a rim size of 15X6.0JJ, however, the trailer is equipped with ST225/75R15 Load Range D tires that have an inflation pressure of 65PSI, installed on 15X6.0JJ rims. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." The incorrect tire information on the Federal Label may result in the operator under-inflating the tires. An underinflated tire may cause sudden tire failure, or poor handling, increasing the risk of a crash. Forest River will notify owners, and dealers will install a corrected Federal Placard, free of charge. The recall is expected to begin November 14, 2016. Salem owners may contact Forest River customer service at 1-574-534-1251. Wildwood owners may contact Forest River customer service at 1-574-533-2165. Forest River's number for this recall is 27-09082016-0243.

16V-673

Utility Trailer Manufacturing Company (Utility) is recalling certain model year 2015-2017 Flatbed trailers, model FS2CHA, manufactured January 1, 2015, to September 16, 2016, equipped with certain Conestoga XP sliding trailer tarping systems with RAD-style rear closures. In the affected trailers, the rear aerodynamic device (RAD)

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2016**

Published October 14, 2016

may separate from the rear of the tarping system, due to rivet failure. If the RAD detaches from the trailer it may be a road hazard, increasing the risk of a crash. Utility will notify owners, and dealers will replace the mounting rivets with a bolted connection, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Utility customer service at 1-818-965-1541.

16V-674

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain model year 2017 Mirage vehicles manufactured October 28, 2015, to August 4, 2016 and equipped with High Intensity Discharge (HID) headlamps. The affected vehicles may have been assembled without the headlight horizontal adjustment lockout clips properly secured. As such, these vehicles fail to comply with the requirement of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Without the horizontal adjustment locking clip being secured, the headlight can be adjusted to either reduce the driver's visibility or blind oncoming vehicles. Both conditions can increase the risk of a crash. MMNA will notify owners, and dealers will secure the horizontal locking clips as necessary, free of charge. The recall began on September 3, 2016. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-16-008.

16V-675

Spartan Motors USA (Spartan) is recalling certain model year 2010-2017 Emergency Response K3, Metrostar, and Gladiator emergency response chassis cabs and motor home chassis manufactured April 12, 2010, to August 31, 2016. The affected vehicles have a power steering pump that may have an occasional loss of output power resulting in reduced or intermittent loss of power steering assist. An intermittent loss of power steering assist could increase the risk of a crash. Spartan will notify owners, and dealers will replace the power steering pumps, free of charge. The recall is expected to begin in October 2016. Owners may contact Spartan customer service at 1-800-543-5008. Spartan's number for this recall is 16022.

16V-676

New Flyer Industries Ltd. (New Flyer) is recalling certain model year 2016 New Flyer XN60 and XN40 Xcelsior transit buses manufactured June 22, 2016, to September 14, 2016, powered by compressed natural gas (CNG). The pressure relief device (PRD) of the CNG system may fracture and separate, allowing a high pressure release of CNG. An unexpected release of CNG gas in the presence of an ignition source increases the risk of a fire. New Flyer has notified owners, and dealers will install new a vent tubing system and replace the PRD, free of charge. The recall began September 28, 2016. Owners may contact New Flyer customer service at 1-204-224-6706. New Flyer's number for this recall is R16-026. Note: Owners are advised to remove the vehicles from operation until the recall remedy can be applied.

16V-678

Ducati North America (Ducati) is recalling certain model year 2016-2017 Ducati XDiavel motorcycles manufactured July 7, 2015, to June 22, 2016. The affected motorcycles may have an insufficiently tightened final drive pulley retaining nut which may result in a loss of power transmission to the rear wheel. A loss of power transmission to the rear wheel may increase the risk of a crash. Ducati will notify owners, and dealers will install a new washer under the final drive pulley retaining nut and increase the tightening torque, free of charge. The

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2016**

Published October 14, 2016

recall is expected to begin November 7, 2016. Owners may contact Ducati customer service at 1-800-231-6696. Ducati's number for this recall is RCL-16-003.

16V-679

Porsche Cars North America, Inc. (Porsche) is recalling certain model year 2017 Macan, Macan S, Macan GTS, and Macan Turbo vehicles. In the affected vehicles, the anti-rollbar connecting links may move out of position allowing the vehicle to oversteer in certain driving conditions. Vehicle oversteer may lead to a loss of vehicle control, increasing the risk of a crash. Porsche will notify owners, and dealers will inspect, and as necessary, replace the front anti-rollbar links, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AG06.

16V-680

Forest River, Inc. (Forest River) is recalling certain model year 2016-2017 Amera-Lite cargo trailers, models ALDD610SA, ALDR610SA, ALDD612SA and ALDR612SA, manufactured February 11, 2016, to May 11, 2016. The thickness of the steel tubes used to manufacture the trailer's drawbars may be insufficient for the vehicle's Gross Vehicle Weight Rating (GVWR). The drawbars can fracture and fail during operation, potentially resulting in a loss of control or the trailer detaching from the tow vehicle. Either scenario increases the risk of a crash. Forest River will notify owners, and dealers will replace the drawbars, free of charge. The recall is expected to begin November 16, 2016. Owners may contact Forest River customer service at 1-574-848-9216. Forest River's number for this recall is 24-09142016-0244.

16V-682

BMW of North America, LLC. (BMW) is recalling certain model year 2015 BMW X3 sDrive28i, X3 xDrive28i, X3 xDrive35i, X3 xDrive28d, X4 xDrive28i and X4 xDrive35i vehicles, and model year 2014-2015 X5 xDrive35i, X5 sDrive35i, X5 xDrive50i, and 2014 X5 xDrive35d vehicles. The affected vehicles have a driver's frontal air bag inflator that may have been improperly welded. In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator housing could separate from the base plate and result in metal striking the vehicle occupants, potentially resulting in serious injury or death. BMW will notify owners, and dealers will replace the driver's front air bag, free of charge. The recall is expected to begin November 11, 2016. Owners may contact BMW customer service at 1-800-525-7417.

16V-683

Mazda Motors North American Operations (Mazda) is recalling certain model year 2014-2016 Mazda3 vehicles manufactured January 4, 2014, to September 18, 2015. The fuel tank of the affected vehicles may have been improperly handled during manufacturing and, as a result, the welded attachment of the Inlet Check Valve (ICV) may fail and allow fuel to leak. A fuel leak in the presence of an ignition source increases the risk of a fire. Mazda will notify owners, and depending on the tank lot number, dealers will inspect the ICV weld, replacing the fuel tank, as necessary, free of charge. The recall is expected to begin November 1, 2016. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 0116I.

16V-684

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2016**

Published October 14, 2016

Mazda North American Operations (Mazda) is recalling certain model year 2016 Mazda3 vehicles manufactured September 24, 2015, to October 16, 2015. During manufacturing, the fuel tanks for the affected vehicles may have deformed, resulting in a fuel leak from the recirculation pipe welded connection. A fuel leak in the presence of an ignition source increases the risk of a fire. Mazda will notify owners, and depending on the tank lot number, dealers will inspect the recirculation pipe weld, replacing the fuel tank, as necessary, free of charge. The recall is expected to begin November 1, 2016. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 0216I.

16V-685

Chrysler (FCA US LLC) is recalling certain model year 2017 Jeep Grand Cherokee manufactured August 8, 2016 through August 16, 2016. In the affected vehicles, the rear tow hook bracket or tow eye bracket may be loose. If the tow bracket is loose, the bracket may detach from the vehicle while being it is being driven, possibly becoming a road hazard. If the bracket detaches during a vehicle recovery, there may be a loss of control of the towed vehicle. Either scenario increases the risk of a crash. Chrysler will notify owners, and dealers will confirm both tow hook bracket bolts are properly tightened, free of charge. The recall is expected to begin on November 6, 2016. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S73.

16V-686

General Motors LLC (GM) is recalling certain model year 2016 Cadillac CT6 vehicles manufactured July 21, 2016, to July 22, 2016. The bolt that connects the front passenger seat belt webbing to the seat's anchor plate may be missing. Without the bolt, the seat belt webbing may detach from the seat anchor. If the seat belt webbing detaches from the seat anchor, the seat belt may not properly restrain the front seat passenger in the event of a crash, increasing the risk of injury. GM will notify owners, and dealers will replace the existing front passenger seat belt webbing anchor bolt, or install a bolt if it is missing, free of charge. The recall began on September 24, 2016. Owners may contact Cadillac customer service at 1-800-458-8006. GM's number for this recall is 16035. Note: Owners are advised not to allow an occupant to sit in the front passenger seat until the recall remedy has been performed.

16V-687

Spartan Motors USA (Spartan) certain model year 2004-2010 Emergency Response Gladiator tractor drawn aerial fire apparatus vehicles manufactured November 18, 2004, to July 26, 2010. The tiller frame of the affected vehicles may crack near the outriggers. If the tiller frame fully cracks, the vehicle may be unstable, increasing the risk of injury to someone on the ladder. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Spartan customer service at 1-517-543-6400.

16V-688

BMW of North America, LLC (BMW) is recalling certain model year 2013-2016 BMW G650GS motorcycles manufactured March 8, 2013, to October 12, 2015, and 2013-2015 BMW G650GS Sertao motorcycles manufactured March 8, 2013, to May 23, 2014. The affected motorcycles may stall during operation due to an engine control unit (ECU) software issue. If the engine stalls during operation, it increases the risk of a crash.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2016**

Published October 14, 2016

BMW will notify owners, and dealers will update the ECU software, free of charge. The recall is expected to begin November 18, 2016. Owners may contact BMW customer service at 1-800-525-7417. Note: This recall supersedes recall 15V-537. Motorcycles that were repaired under that recall need to have their software updated again as part of this campaign.

16V-689

Volvo Cars of North America, LLC (Volvo) is recalling certain model year 2016-2017 Volvo XC90 and S90 vehicles manufactured April 15, 2015 through September 19, 2016. In the affected vehicles, the drain hose for the air conditioning may leak into the passenger compartment due to a drain hose installation error during manufacturing. Significant water drainage into the passenger compartment may adversely affect air bag deployment in the event of a crash, increasing the risk of occupant injury. Volvo will notify owners, and dealers will inspect the air conditioning drain hose for proper installation, replacing the hose as necessary, free of charge. The recall is expected to begin on November the 14, 2016. Owners may contact Volvo at 1-800-458-1552. Volvo's number for this campaign is R89707.

16V-690

Piaggio Group Americas, Inc. (Piaggio) is recalling certain model year 2014-2015 Aprilia Tuono V4 1000, 2016 Tuono V4 1100, 2015 Caponord 1200 ABS/ADD, and 2016 Caponord Rally motorcycles manufactured June 18, 2013, to June 13, 2016. The affected motorcycles have a front brake master cylinder that may allow air into the hydraulic circuit, causing a longer than expected braking distance. If an abnormal distance is required to stop the motorcycle, there is an increased risk of a crash. Aprilia will notify owners, and dealers will replace the front brake master cylinder pushrod and boot assembly, free of charge. The recall is expected to begin in October 2016. Owners may contact Aprilia customer service at 1-866-705-1727.

16V-691

Tiffin Motorhomes, Inc. (Tiffin) is recalling certain model year 2015-2017 Allegro motorhomes manufactured April 1, 2015, to September 16, 2016. The affected vehicles have a tow hitch with a weight capacity sticker that may indicate an incorrect weight capacity. If the hitch is loaded to the weight on sticker, the hitch may fail and the towed vehicle can separate from the motorhome, increasing the risk of a crash. Tiffin will notify owners, and send them a corrected label to replace the incorrect label, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Tiffin customer service at 1-256-356-8661. Tiffin's number for this recall is TIF-104.

16V-692

Forest River, Inc. (Forest River) is recalling certain model year 2014-2016 Forest River Rockport delivery vehicles, models RPAF1270 and RPAA1270, manufactured November 24, 2014, to August 28, 2015. The affected vehicles are equipped with Thieman Tailgates-brand TVL 12/16 series lift gates supported with roller chains that may fail. If the roller chain fails, the lift gate may fall unexpectedly, increasing the risk of injury. Forest River will notify owners, and Thieman Lift Gate distributors will repair the lift gate, free of charge. The recall is expected to begin November 21, 2016. Owners may contact Forest River customer service at 1-888-711-1600, or Thieman customer service at 1-800-524-5210 extension 104. Forest River's number for this recall is 29-09202016-0250.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2016**

Published October 14, 2016

16V-693

Subaru of America, Inc. (Subaru) is recalling certain model year 2010-2014 Legacy vehicles manufactured November 26, 2008, to June 7, 2013, and 2010-2014 Outback vehicles manufactured January 9, 2009 to June 7, 2013. Due to contamination, components within the windshield wiper motor bottom cover may interfere with each other. If an obstruction, such as a buildup of snow or ice prevents the wiper arms from being able to stop in the parked position, the wiper motor may overheat and the bottom cover may melt. If the windshield wiper motor overheats, the wipers may fail, reducing driver visibility and increasing the risk of a crash. Additionally, the wiper motor cover may melt, increasing the risk of a fire. Subaru will notify owners, and dealers will replace the windshield wiper motor bottom cover assembly, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Subaru customer service at 1-800-782-2783. Subaru's number for this recall is WTK-71. Note: This recall supersedes recall 11V-469. All vehicles that were remedied under that campaign are affected by this campaign, and need to have their wiper motor bottom cover replaced again.

16V-694

Ford Motor Company (Ford) is recalling certain model year 2014 Transit Connect vehicles manufactured October 4, 2013, to July 14, 2014 and equipped with a Panoramic Fixed-Glass Vista roof. The panoramic roof panel may have an inadequate bond to the vehicle, possibly resulting in the panel separating from the vehicle. If the panoramic roof panel separates from the vehicle while it is being driven, it may increase the risk of a crash. Ford will notify owners, and dealers will remove, clean, and reinstall the panoramic roof panel, free of charge. The recall is expected to begin October 31, 2016. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16S35.

16V-695

Thor Motor Coach (TMC) is recalling certain model year 2016-2017 Four Winds and Chateau motorhomes manufactured June 16, 2015, to April 29, 2016. The affected motorhomes are equipped with a spare tire bracket that may loosen and detach during vehicle operation. If the spare tire bracket and spare tire detaches, it could be a road hazard, increasing the risk of a crash or injury. TMC will notify owners, and dealers will install carriage bolts to properly secure the spare tire bracket, free of charge. The recall is expected to begin October 17, 2016. Owners may contact Thor customer service at 1-877-500-1020. TMC's number for this recall is RC000122.

16V-696

Eldorado National-California, Inc. (Eldorado) is recalling certain model year 2016 Axxess transit buses manufactured May 1, 2016, to September 20, 2016. The affected buses have axles that may have insufficient grease at the wheel ends, possibly resulting in bearing failure. Bearing failure may increase the risk of a crash. Eldorado has notified owners, and dealers will inspect the wheel bearings and add grease as necessary, free of charge. The recall began on September 28, 2016. Owners may contact Eldorado customer service at 1-909-591-9557. Note: Eldorado is advising that vehicles with the affected axles are removed from operation until the recall has been remedied.

16V-697

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2016**

Published October 14, 2016

Ford Motor Company (Ford) is recalling certain model year 2013-2017 Ford Focus hatchback vehicles manufactured February 14, 2012, to August 26, 2016 and equipped with a manual transmission. The hatchback of the affected vehicles may be unlatched with a single press of the interior latch release button. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 206, "Door Locks and Door Retention Components." With only a single press needed, the driver may accidentally unlatch the hatchback, increasing the risk of injury to any unsecured passengers in the back. Ford will notify owners, and dealers will reprogram the Body Control Module with updated software, free of charge. The recall is expected to begin November 14, 2016. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16C13.

16V-698

Newmar Corporation (Newmar) is recalling certain model year 2015-2017 Canyon Star recreational vehicles manufactured June 5, 2014, to September 6, 2016. These vehicles have a wheelchair access door with a power door lock that may open while the vehicle is in motion if the keyfob button is pressed accidentally. If the wheelchair access door opens while the vehicle is being driven, it could cause a loss of vehicle control, increasing the risk of a crash. Newmar will notify owners, and dealers will add a relay harness to prevent the keyfob button from opening the door while the vehicle is in motion. The recall is expected to begin November 26, 2016. Owners may contact Newmar customer service at 1-800-731-8300.

16V-699

General Motors LLC (GM) is recalling certain model year 2016-2017 Chevrolet Express manufactured September 25, 2015, to August 22, 2016, and 2016 GMC Savana cargo and cutaway vans manufactured January 28, 2016, to May 18, 2016. The affected vehicles were manufactured without an inside rearview mirror and with a right-hand convex exterior review mirror. These vehicles are required to have either an inside rearview mirror or both left and right-hand flat exterior rearview mirrors. Thus, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 111, "Rearview Mirrors." If the driver does not have a clear unobstructed view to the back of the vehicle, it can increase the risk of a crash. GM will notify owners, and dealers will instal a right-hand flat rearview mirror, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet customer service at 1-800-222-1020, or GMC customer service at 1-800-462-8782. GM's number for this recall is 16036.

16V-700

Gillig LLC (Gillig) is recalling certain model year 2016 Low Floor transit buses manufactured May 26, 2016, to September 26, 2016. The affected buses have axles that may have insufficient grease at the wheel ends, possibly resulting in bearing failure. Bearing failure may increase the risk of a crash. Gillig service centers or the fleet services for the bus owners will inspect the wheel bearings and add grease as necessary, free of charge. The recall began on October 5, 2016. Owners may contact Gillig customer service at 1-800-735-1500. Note: Gillig is advising that vehicles with the affected axles are removed from operation until the recall has been remedied.

16V-701

Motor Coach Industries (MCI) is recalling certain model year 2017 J4500 motorcoaches manufactured March 14, 2016, to August 23, 2016. The affected vehicles may experience a multiplexing programming error that will

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2016**

Published October 14, 2016

not provide any visual or audible warnings if the vehicle's primary service brake air reservoir system has low pressure. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems." If the driver is unaware that the service brakes have low air pressure, the brakes may apply automatically, increasing the risk of a crash. MCI will notify owners, and dealers will correct the programming of the multiplexing system, free of charge. The recall is expected to begin in October 2016. Owners may contact MCI customer service at 1-800-241-2947. MCI's number for this recall is SB 439.

16V-702

Halcore Group, Inc. (Halcore) is recalling certain model year 2016-2017 American Emergency Vehicle (AEV) Traumahawk ambulances manufactured August 1, 2016, to September 28, 2016. Due to a problem with the seat tracks, the attendant seat(s) on the affected vehicles may unexpectedly move in a rapid deceleration event such as a crash. In the event of a crash, the seat may move forward at a high rate of speed, increasing the risk of injury to the seat occupant. Halcore will notify owners, and dealers will replace the seat tracks, free of charge. The recall is expected to begin October 31, 2016. Owners may contact AEV Warranty/Customer Service Department at 1-800-374-9749, or by email at warranty@aev.com.

16V-703