UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF SAFETY AND ENVIRONMENTAL ENFORCEMENT GULF OF MEXICO REGION

ACCIDENT INVESTIGATION REPORT

		For Public Release					
1.	DATE: 10-FEB-2012 TIME: 1600 HOURS	STRUCTURAL DAMAGE CRANE OTHER LIFTING DEVICE					
2.	OPERATOR: Chevron U.S.A. Inc. REPRESENTATIVE: TELEPHONE: CONTRACTOR: Nabors Drilling Inc. REPRESENTATIVE: TELEPHONE:	DAMAGED/DISABLED SAFETY SYS. INCIDENT >\$25K H2S/15MIN./20PPM REQUIRED MUSTER SHUTDOWN FROM GAS RELEASE X OTHER Oil Spill					
3.	OPERATOR/CONTRACTOR REPRESENTATIVE/SUPERVISOR ON SITE AT TIME OF INCIDENT:	6. OPERATION:					
	LEASE: G05911 AREA: GC LATITUDE: BLOCK: 205 LONGITUDE: PLATFORM: A-Genesis Spar RIG NAME: NABORS 85 (MAYRONNE 162)	PRODUCTION X DRILLING WORKOVER COMPLETION HELICOPTER MOTOR VESSEL PIPELINE SEGMENT NO. OTHER					
200	ACTIVITY: EXPLORATION (POE) DEVELOPMENT/PRODUCTION (DOCD/POD) TYPE: HISTORIC INJURY REQUIRED EVACUATION LTA (1-3 days) LTA (>3 days RW/JT (1-3 days)	EQUIPMENT FAILURE HUMAN ERROR EXTERNAL DAMAGE SLIP/TRIP/FALL WEATHER RELATED LEAK UPSET H20 TREATING OVERBOARD DRILLING FLUID					
	RW/JT (>3 days) Other Injury FATALITY POLLUTION	9. WATER DEPTH: 2590 FT. 10. DISTANCE FROM SHORE: 81 MI.					
	FIRE EXPLOSION LWC HISTORIC BLOWOUT UNDERGROUND	11. WIND DIRECTION: N SPEED: 1 M.P.H.					
	SURFACE DEVERTER SURFACE EQUIPMENT FAILURE OR PROCEDURES	12. CURRENT DIRECTION: N SPEED: 1 M.P.H.					
	COLLISION HISTORIC >\$25K <=\$25K	13. SEA STATE: 1 FT. 14. PICTURES TAKEN: NO					

MMS - FORM 2010 PAGE: 1 OF 5

15. STATEMENT TAKEN: NO

17. INVESTIGATION FINDINGS:

On 10 February 2012 the Nabors 85 unintentionally released 44 barrels of Synthetic Based Mud (SBM) which included 30 barrels oil into the Gulf of Mexico. The rig was in the process of displacing water based mud (WBM) with SBM, when it was noticed that levels were not rising as expected in pits #4 and #5. While searching for the leak source mud was noticed in the shunt line and the operation was shut down. The post incident investigation revealed that dump valves for pits #4 and #5 were partially opened to a manifold going to the overboard shunt line. These valves should have taken approximately 15 turns to open and/or close, but the employee that closed them stated that it took only 2 turns. It was also noted that the day prior to the incident an employee reported to rig management that the master dump valve (which is connected to the overboard shunt line) was hard to close. He was told to "get a bigger wrench" and no one followed up to ensure the valve was closed properly. The valve was found to have either rope or rag debris stuck in it preventing full closure.

- 18. LIST THE PROBABLE CAUSE(S) OF ACCIDENT:
 - 1) The dump valves for mud pits #4 and #5 were partially open.
 - 2) The master dump valve had a piece of debris in it which prevented full closure.
- 19. LIST THE CONTRIBUTING CAUSE(S) OF ACCIDENT:
 - 1) Poor maintenance of the valves in question.
 - 2) Rig crew (supervisors and workers) failed to ensure proper functionality of equipment.
- 20. LIST THE ADDITIONAL INFORMATION:

The 5 mud processing pits each have a dump valve. All of the dump lines are manifold into one common dump line which has a master valve that leads to the overboard shunt line.

21. PROPERTY DAMAGED:

NATURE OF DAMAGE:

Loss of 44 barrels of SBM

ESTIMATED AMOUNT (TOTAL):

\$6,600

22. RECOMMENDATIONS TO PREVENT RECURRANCE NARRATIVE:

The BSEE Houma District makes no recommendations to the Agency.

- 23. POSSIBLE OCS VIOLATIONS RELATED TO ACCIDENT: YES
- 24. SPECIFY VIOLATIONS DIRECTLY OR INDIRECTLY CONTRIBUTING. NARRATIVE:

MMS - FORM 2010 PAGE: 2 OF 5

EV2010R 28-JUN-2012

An E-100 INC issued on 3/15/2012: On February 7, 2012 the operator discharged 44 bbls of Synthetic Based Mud into the Gulf of Mexico.

25. DATE OF ONSITE INVESTIGATION: 28. ACCIDENT CLASSIFICATION:

15-MAR-2012

26. ONSITE TEAM MEMBERS:

Clint Campo / Jeramie Liner /

29. ACCIDENT INVESTIGATION PANEL FORMED: NO

OCS REPORT:

MINOR

30. DISTRICT SUPERVISOR:

Bryan Domangue

27. OPERATOR REPORT ON FILE: YES

APPROVED

APPROVED DATE: 20-JUN-2012

MMS - FORM 2010 PAGE: 3 OF 5

EV2010R 28-JUN-2012

POLLUTION ATTACHMENT

1.	VOLUME:	GAL	30	BBL					
		YARDS LONG X		YARDS	WIDE				
	APPEARANCE:								
2.	TYPE OF HYDROCARE	ON RELEASED: X	OIL						
			DIES	EL					
			COND	ENSATE					
			HYDR.	AULIC					
			NATU	RAL GAS	3				
			OTHE:	R					_
3.	SOURCE OF HYDROCA	RBON RELEASED:	Synthe	tic Ba	sed Mud	from mud	pits #	4 and	#5.
4.	WERE SAMPLES TAKE	IN? NO							
5.	WAS CLEANUP EQUIPMENT ACTIVATED? NO								
	IF SO, TYPE: SKIMMER CONTAINMENT BOOM ABSORPTION EQUIPMENT DISPERSANTS OTHER								
6.	ESTIMATED RECOVER	QY: 0 G	SAL			BBL			
7.	RESPONSE TIME:	0 HOURS							
8.	IS THE POLLUTION IN THE PROXIMITY OF AN ENVIRONMENTALLY SENSITIVE AREA (CLASS I)? NO								
9.	HAS REGION OIL SE	PILL TASK FORCE E	BEEN NO	TIFIED	? NO				
10.	CONTACTED SHORE:	NO IF YES,	, WHERE	:					
11.	WERE ANY LIVE ANI	MALS OBSERVED NE	EAR: N O						
12.	WERE ANY OILED OF	DEAD ANIMALS OF	BSERVED	NEAR :	SPILL:	NO			

MMS - FORM 2010 PAGE: 4 OF 5

MMS - FORM 2010 PAGE: 5 OF 5
EV2010R 28-JUN-2012