UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF SAFETY AND ENVIRONMENTAL ENFORCEMENT GULF OF MEXICO REGION

ACCIDENT INVESTIGATION REPORT

For Public Release

1.	OCCURRED	
	DATE:	STRUCTURAL DAMAGE
	12-FEB-2013 TIME: 1600 HOURS	CRANE
		OTHER LIFTING DEVICE
2.	OPERATOR: Walter Oil & Gas Corporation	DAMAGED/DISABLED SAFETY SYS.
	REPRESENTATIVE:	INCIDENT >\$25K
	TELEPHONE:	H2S/15MIN./20PPM
	CONTRACTOR:	REQUIRED MUSTER
	REPRESENTATIVE:	SHUTDOWN FROM GAS RELEASE
	TELEPHONE:	
		OTHER
3.	OPERATOR/CONTRACTOR REPRESENTATIVE/SUPERVISOR ON SITE AT TIME OF INCIDENT:	6. OPERATION:
		☐ PRODUCTION
		x DRILLING
4.	LEASE: G33109	H WORKOVER
	AREA: ST LATITUDE:	COMPLETION
	BLOCK: 127 LONGITUDE:	HELICOPTER
		MOTOR VESSEL
5.	PLATFORM:	PIPELINE SEGMENT NO.
	RIG NAME: HERCULES 251	OTHER
6.	ACTIVITY: EXPLORATION (POE)	8. CAUSE:
	X DEVELOPMENT/PRODUCTION	TO TOUT DATE OF THE PER
	(DOCD/POD)	X EQUIPMENT FAILURE X HUMAN ERROR
7.	TYPE:	EXTERNAL DAMAGE
	HISTORIC INJURY	SLIP/TRIP/FALL
	REQUIRED EVACUATION	WEATHER RELATED
	LTA (1-3 days)	LEAK
	x LTA (>3 days 1	UPSET H20 TREATING
	RW/JT (1-3 days)	OVERBOARD DRILLING FLUID
	RW/JT (>3 days)	OTHER
	Other Injury	_
		9. WATER DEPTH: 83 FT.
	FATALITY	
	POLLUTION	10. DISTANCE FROM SHORE: 25 MI.
	FIRE	
	EXPLOSION	11. WIND DIRECTION: N
	LWC HISTORIC BLOWOUT	SPEED: 1 M.P.H.
	UNDERGROUND	THE ALCOHOLOGICAL F
	SURFACE	12 CURRENT DIRECTION N
	DEVERTER	12. CURRENT DIRECTION: N
	SURFACE EQUIPMENT FAILURE OR PROCEDURES	SPEED: 1 M.P.H.
	COLLISION HISTORIC >\$25K <=\$25K	13. SEA STATE: 1 FT.

MMS - FORM 2010 PAGE: 1 OF 4

17. INVESTIGATION FINDINGS: -

On February 12th, 2013, a Floorman working on the Hercules 251 drilling rig was struck by a falling object while in the process of rigging down equipment in preparation of moving the rig to a new location.

On the day of the accident, the Hercules 251 drilling rig was working for Walter Oil & Gas Corporation; the rig was located at South Timbalier 127. Prior to commencing operations to rig down equipment, a Job Safety Analysis(JSA) was conducted and signed by all parties but the JSA failed to specifically mention the risk of dropped objects. The injured person (IP), an experienced Floorman, was working on the Texas deck, which is located below the drill floor. The accident occurred when the crew was pulling the mousehole up through the drill floor. While the mousehole was being lifted, a three inch ball valve located at the bottom of the mousehole broke off at the cam lock connection. How the ball valve broke off is undetermined but, it is believed to have been caused by the mousehole not being completely vertical during the lift. The ball valve glanced off the Blow out Preventers and fell 27 feet, striking the IP on the head. The IP's hard hat was dented and IP suffered a 3 inch laceration on the top right side of his head.

The IP was evacuated to shore and given medical attention, he received stitches and was then discharged after it had been determined he did not need additional treatment.

Immediately following the accident the drill crew shut down the operation and held a JSA before resuming operations. The valve assembly has since been replaced with solid pipe and, a guard has been placed over the valve to prevent similar accidents in the future.

18. LIST THE PROBABLE CAUSE(S) OF ACCIDENT:

The probable cause of the accident is that the mousehole did not remain vertical while being lifted resulting in the ball valve making contact with something and breaking it off.

19. LIST THE CONTRIBUTING CAUSE(S) OF ACCIDENT:

A contributing cause was the danger of falling objects went unrecognized resulting in the IP to be unaware of the hazards associated with working where he was when the accident occured.

20. LIST THE ADDITIONAL INFORMATION:

The valve assembly has since been replaced with solid pipe and, a guard has been placed over the valve to prevent similar accidents in the future.

21. PROPERTY DAMAGED:

NATURE OF DAMAGE:

MMS - FORM 2010 PAGE: 2 OF 4-

EV2010R 06-NOV-2013-

	ESTIMATED AMOUNT (TOTAL):						
22.	RECOMMENDATIONS TO PREVENT RECURRANCE	CE N	ARRATIV	Ε:			
	The Houma District has no recommenda	tio	ns at t	his	time.		
23.	POSSIBLE OCS VIOLATIONS RELATED TO A	ACCII	DENT: N	10			
24.	SPECIFY VIOLATIONS DIRECTLY OR INDIR	RECT	LY CONT	RIBU	TING.	NARRATIV	3
25.	DATE OF ONSITE INVESTIGATION:						
26.	ONSITE TEAM MEMBERS: / James Benetatos / James Richard /	29.	ACCIDE PANEL OCS RE	FORI	MED:	'IGATION NO	
		30.	DISTRI	ICT :	SUPERV	ISOR:	
			Bryan	A. 1	Domang	rue	
			APPROVIDATE:		04-1	10V-2013	

INJURY/FATALITY/WITNESS ATTACHMENT

OPERATOR REPRESENTATIVE		INJURY	
CONTRACTOR REPRESENTATIVE		FATALITY	
OTHER		WITNESS	
NAME:			
HOME ADDRESS:			
CITY:		STATE:	
WORK PHONE:	TOTAL OFFSHOR	RE EXPERIENCE:	YEARS
EMPLOYED BY:			
BUSINESS ADDRESS:			

MMS - FORM 2010 PAGE: 3 OF 4-

EV2010R 06-NOV-2013-

INJURY/FATALITY/WITNESS ATTACHMENT

	GT TILL	
	CITY:	STATE:
	ZIP CODE:	
1		

MMS - FORM 2010 PAGE: 4 OF 4-