

April 11, 2003

Mr. Alex Marion, Director of Engineering  
Nuclear Energy Institute  
1776 I Street, N.W., Suite 400  
Washington, D.C. 20006-3708

SUBJECT:   FLAW EVALUATION GUIDELINES

Dear Mr. Marion:

Enclosure 2 to the letter from Jack Strosnider to you dated November 21, 2001, contained flaw evaluation guidelines for control rod drive mechanism (CRDM) penetrations. These guidelines were developed by the Office of Nuclear Reactor Regulation (NRR) staff and were needed since no guidance or rules existed in the American Society of Mechanical Engineers (ASME) Code, Section XI to evaluate flaws found in the CRDM pressure boundary. While these guidelines have fulfilled a need, subsequent interactions with the industry and further information from multiple sources have rendered these guidelines obsolete. This situation was recognized in Footnote 1 to the February 11, 2003, NRC Order EA-03-009 establishing interim inspection requirements for reactor pressure vessel heads at pressurized water reactors. Footnote 1 states in part, "...The NRC has issued guidance to address flaw evaluations for RPV head penetration nozzles (see letter from J. Strosnider, NRC, to A. Marion, Nuclear Energy Institute) and will, as necessary, issue revised guidance pending the updating of the ASME code and related NRC regulations."

Attached to this letter as Enclosures 1 and 2 is revised guidance that is generally consistent with the recently approved action by Section XI at their meeting in San Francisco on February 27, 2003. That action consisted of a Code addition and an enabling Code Case to establish rules for flaw evaluation for PWR reactor vessel upper head penetration nozzles. The NRR staff, through their representation on the cognizant Section XI groups and committees, participated in the development and approval of these new flaw evaluation rules. Publication of the Code addition and Code Case and subsequent formal approval by the NRC will take time. In the interim, the staff intends to reference these guidelines in interactions with licensees during the current and future outage seasons. Note that we have modified the flaw acceptance criteria of Table 1 in Enclosure 1. Any plant specific considerations can be discussed with the staff as appropriate.

As additional information becomes available, further development or changes to these guidelines can be anticipated. The staff contact for flaw evaluation issues is Keith Wichman who can be reached at (301) 415-2785. Your continued cooperation is appreciated.

Sincerely,

**/RA/**

Richard Barrett, Director  
Division of Engineering  
Office of Nuclear Reactor Regulation

Enclosures: As stated

cc: See next page

April 11, 2003

Mr. Alex Marion, Director of Engineering  
Nuclear Energy Institute  
1776 I Street, N.W., Suite 400  
Washington, D.C. 20006-3708

SUBJECT: FLAW EVALUATION GUIDELINES

Dear Mr. Marion:

Enclosure 2 to the letter from Jack Strosnider to you dated November 21, 2001, contained flaw evaluation guidelines for control rod drive mechanism (CRDM) penetrations. These guidelines were developed by the Office of Nuclear Reactor Regulation (NRR) staff and were needed since no guidance or rules existed in the American Society of Mechanical Engineers (ASME) Code, Section XI to evaluate flaws found in the CRDM pressure boundary. While these guidelines have fulfilled a need, subsequent interactions with the industry and further information from multiple sources have rendered these guidelines obsolete. This situation was recognized in Footnote 1 to the February 11, 2003, NRC Order EA-03-009 establishing interim inspection requirements for reactor pressure vessel heads at pressurized water reactors. Footnote 1 states in part, "...The NRC has issued guidance to address flaw evaluations for RPV head penetration nozzles (see letter from J. Strosnider, NRC, to A. Marion, Nuclear Energy Institute) and will, as necessary, issue revised guidance pending the updating of the ASME code and related NRC regulations."

Attached to this letter as Enclosures 1 and 2 is revised guidance that is generally consistent with the recently approved action by Section XI at their meeting in San Francisco on February 27, 2003. That action consisted of a Code addition and an enabling Code Case to establish rules for flaw evaluation for PWR reactor vessel upper head penetration nozzles. The NRR staff, through their representation on the cognizant Section XI groups and committees, participated in the development and approval of these new flaw evaluation rules. Publication of the Code addition and Code Case and subsequent formal approval by the NRC will take time. In the interim, the staff intends to reference these guidelines in interactions with licensees during the current and future outage seasons. Note that we have modified the flaw acceptance criteria of Table 1 in Enclosure 1. Any plant specific considerations can be discussed with the staff as appropriate.

As additional information becomes available, further development or changes to these guidelines can be anticipated. The staff contact for flaw evaluation issues is Keith Wichman who can be reached at (301) 415-2785. Your continued cooperation is appreciated.

Sincerely,  
**/RA/**  
Richard Barrett, Director  
Division of Engineering  
Office of Nuclear Reactor Regulation

Enclosures: As stated

cc: See next page

Distribution:

EMCB R/F	WDTravers	JAZwolinski	MEMayfield	WDLanning, R1
SDuraiswamy	WFKane	GMHolahan	NCCChokshi	CCasto, R2
JLarkins	SJCollins	DBMatthews	AHiser	CPederson, R3
BWSheron	Athadani	BABoger	PCWen	DChamberlain, R4
	TChan	SBloom	WCullen	

**Package ML030980327; Letter ML030980322; Attachment ML030980333**

OFFICE	EMCB:DE	EMCB:DE	D:DE
NAME	K Wichman	W Bateman	R Barrett
DATE	4 / 2 / 03	4 / 8 / 03	4 / 11 / 03

cc:

Marvin Fertel, Senior Vice President  
and Chief Nuclear Officer  
Nuclear Energy Institute  
Suite 400  
1776 I Street, NW  
Washington, DC 20006-3708

Larry Mathews, MRP  
Southern Nuclear Operating Company  
Manager, Inspection and Testing Services  
P. O. Box 1295  
Birmingham, AL 35201

Frank Ammirato, EPRI  
Inspection Manager  
EPRI NDE Center  
P. O. Box 217097  
1300 W. T. Harris Blvd.  
Charlotte, NC 28221

David Steininger, EPRI MRP Manager  
Chuck Welty, EPRI MRP Manager  
Christine King, EPRI MRP Manager  
Electric Power Research Institute  
P. O. Box 10412  
3412 Hillview Ave.  
Palo Alto, CA 94303

Leslie Hartz, Chair, MRP  
Vice President - Nuclear Engineering  
Dominion Energy  
5000 Dominion Blvd.  
Glan Allen, VA 23060

Craig Harrington, Technical Chair  
RPV Head Working Group  
TXU Corporation  
Comanche Peak Plant  
PO Box 1002  
Glan Rose, TX 76043 - 1002

C. Thomas Alley, Jr., Technical Chair  
Inspection Working Group  
Duke Power Company  
Nuclear General Office  
526 South Church Street  
Mail Code EC090  
PO Box 1006  
Charlotte NC 28201

John Wilson, Technical Chair  
Repair/Mitigation Working Group  
Exelon Corporation  
Cornerstone II at Cantera  
4300 Winfield Ave.  
Warrenville, IL 60555 - 4012

## FLAW EVALUATION GUIDELINES AND ACCEPTANCE CRITERIA FOR PWR REACTOR VESSEL UPPER HEAD PENETRATION NOZZLES

PWR reactor vessel upper head penetration nozzles containing flaws may be evaluated to determine acceptability for continued service in accordance with the evaluation procedure and acceptance criteria specified herein. Application of the evaluation procedures shall be subject to review and approval by the U.S. Nuclear Regulatory Commission (NRC).

### Scope

This evaluation procedure is applicable to upper head penetration nozzles with eight inch (200 mm) nominal outside diameter and less. This procedure shall not be used for J-groove welds.

### Evaluation Procedure

- The acceptance standards of IWB-3500 of Section XI of the ASME Code (herein after referred to as Section XI) shall not be used to accept flaws in this region.
- A flaw growth analysis shall be performed on each detected flaw to determine its maximum growth due to fatigue, stress corrosion cracking or both mechanisms, when applicable, during a specified evaluation period. The minimum time interval for the flaw growth evaluation shall be until the next inspection.
- All applicable loadings shall be considered, including weld residual stress, in calculating the crack growth.
- The flaw shall be characterized in accordance with the requirements of IWA-3400 of Section XI including the proximity rules of Fig. IWA-3400-1 for surface flaws.
- The flaw shall be projected into both axial and circumferential orientations, and each orientation shall be evaluated. The axial orientation is the same for each nozzle, but the circumferential orientation will vary depending on the angle of intersection of the penetration nozzle with the head. As illustrated in Fig. I, any flaws within  $\pm 10^\circ$  of the plane formed by the J-groove weld root shall be considered pure circumferential flaws.
- The location of the flaw, relative to both the top and the bottom of the J-groove attachment weld, shall be determined.
- The flaw shall be evaluated using analytical procedures, such as those described in Appendix A (Enclosure 2), to calculate the following critical flaw parameters:

$a_f$  = the maximum depth to which the detected flaw is calculated to grow at the end of the evaluation period

$l_f$  = the maximum length to which the detected flaw is calculated to grow at the end of the evaluation period.


## Acceptance Criteria

The calculated maximum flaw dimensions at the end of the evaluation period shall be compared with the maximum allowable flaw dimensions in Table I.

<b>Table I Reactor Vessel Upper Head Penetration Nozzle Acceptance Criteria<sup>(1) (3)</sup></b>				
<b>Location</b>	<b>Axial</b>		<b>Circumference</b>	
	<b>a<sub>f</sub></b>	<b>l<sub>f</sub></b>	<b>a<sub>f</sub></b>	<b>l<sub>f</sub></b>
<b>Below Weld (ID)<sup>(2)</sup></b>	<b>t</b>	<b>No Limit</b>	<b>t</b>	<b>0.75 Circ. (4)</b>
<b>At and Above Weld (ID)</b>	<b>0.75 t</b>	<b>No Limit</b>	<b>repair</b>	<b>repair</b>
<b>Below Weld (OD)<sup>(2)</sup></b>	<b>t</b>	<b>No Limit</b>	<b>t</b>	<b>0.75 Circ. (4)</b>
<b>At and Above Weld (OD)</b>	<b>repair</b>	<b>repair</b>	<b>repair</b>	<b>repair</b>

Notes:

- (1) Surface flaws of any size in the attachment weld are not acceptable.
- (2) Intersecting axial and circumferential flaws in the nozzle are not acceptable.
- (3) t = wall thickness of head penetration nozzle
- (4) 75 percent of the circumference

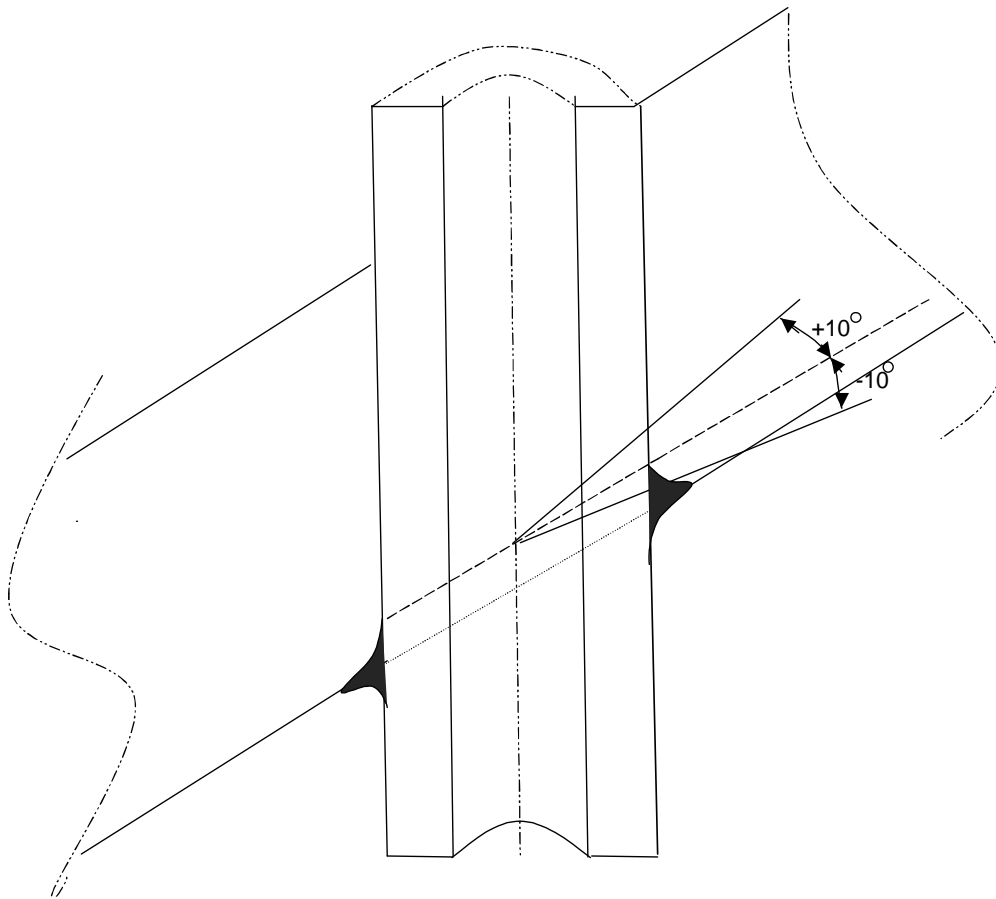

**Fig. I Definition of Circumferential Orientation for Flaw Characterization**

Note: Planar flaws within +/- 10° of the plane formed by the J-groove weld root, shown as the dashed line, shall be considered circumferential flaws.