

TFG FILES INVENTORY
DATE: 12-15-05

Box Number: 49285543
Alternate Number: 17
Other Identification: LN191

Contents Associated With:

1. Contract DACW29-94-C-0079, Daily Logs, 1180-1-1Q, Lake Pontch, LA & Vic, HLP, London Avenue, Outfall Canal, Mirabeau; Section B, Folder 5, Item 37 b.

A0006527 ✓
A0006524 ✓
A0006531 (maps to be scanned)
A0006536 (maps to be scanned)
A0006504
A0006499
A0006506
A0006507
A0006509
A0006512

A0006519
A0006522

TFG FILES INVENTORY
DATE: 12-15-05

Box Number: 49285543
Alternate Number: 17
Other Identification: LN191

Contents Associated With:

1. Contract DACW29-94-C-0079, Daily Logs, 1180-1-1Q, Lake Pontch, LA & Vic, HLP, London Avenue, Outfall Canal, Mirabeau; Section B, Folder 5, Item 37 b.

2. xxxxxxxx

3. xxxxxxxx

A0006504
A0006499
A0006527
A0006524
A0006531
A0006536
A0006506
A0006507
A0006509
A0006512
A0006519
A0006522

0006501

**INSPECTORS QUALITY ASSURANCE REPORT (QAR)
DAILY LOG OF CONSTRUCTION - CIVIL**
(ER 415-1-302)

THE QCR WILL BE ATTACHED TO OR FILED WITH THE QAR

REPORT NUMBER
395

TO Area Engineer, COPY TO: C/Const. Div.
CELMN-CD-NO CELMN-CD

DATE 02-Aug-1996
Friday

PROJECT Lake Pontchartrain, La. and Vicinity, London Ave. Canal,
Mirabeau Ave. to Leon C. Simon Blvd., Orleans Parish, Louisiana.

CONTRACT NUMBER
DACW29-94-C-0079

CONTRACTOR (Or hired labor) B & K Construction Company, Inc.
1905 Highway 59, Mandeville, La. 70448

WEATHER
P/C and Showers

PORTION OF SCHEDULED DAY SUITABLE FOR OPERATIONS

STRUCTURAL EXCAVATION 50 %	BORROW EXCAVATION 50 %	EMBANKMENT 50 %	CONCRETE 50 %	STRUCTURE 50 %
-------------------------------	---------------------------	--------------------	------------------	-------------------

TEMPERATURE	
MINIMUM 74	MAXIMUM 96

HAS ANYTHING DEVELOPED ON THE WORK WHICH MIGHT LEAD TO A CHANGE ORDER OR FINDING OF FACT? NO YES (Explain)

24 HOUR PRECIPITATION	
INCHES .50	ENDING 1530p M

NUMBER OF GOVERNMENT EMPLOYEES

SUPERVISORY	OFFICE	LAYOUT	INSPECTION 1-8	TOTAL 1-8	LABOR
-------------	--------	--------	-------------------	--------------	-------

Canal RIVER STAGE	
FEET 1.8	TIME 1.8 M

NUMBER OF CONTRACTOR'S EMPLOYEES

SUPERVISORY 1-8	SKILLED 11-79	LABORERS 13-98	TOTAL 34-259	NUMBER OF SHIFTS <input checked="" type="checkbox"/> 1 <input type="checkbox"/> 2 <input type="checkbox"/> 3
--------------------	------------------	-------------------	-----------------	---

FROM 700a M	TO 1630p M	FROM M	TO M	FROM M	TO M
----------------	---------------	-----------	---------	-----------	---------

Attach list of the following: (a) Major items of equipment either idle or working, and (b) Number and classification of contractor personnel onsite.
Note: If the contractor's Quality Control Report (QCR) contains the information it need not be repeated.

CONTRACTOR/SUBCONTRACTORS AND AREA OF RESPONSIBILITY FOR WORK PERFORMED TODAY

- a. B & K Const. Co., Inc. -
- b. Accent Const. Co., Inc.,
- c. H&H Const. Co. Inc.,
- Walter Barnes Electrical

WORK PERFORMED TODAY (Indicate location and description of work performed. Refer to work performed by prime and/or subcontractors by letter in Table above)

- a. Floodwall
- b. Finish
- c. Painting
- d. Electrical

Days of no work and reasons for same:
100% days lost-0
50% days lost-aug-1,2,-1996

Information on progress of work, causes for delays and extent of delays, Plant, material, etc.
Some progressive work performed but afternoon showers cause shutdown of all work.

DATE SET FOR COMPLETION: 21-Aug-96

PERCENT PROJECT COMPLETE: 86.50
PERCENT TIME ELAPSED: 87.75

QCR INSPECTION PHASES ATTENDED AND INSTRUCTIONS GIVEN:

- Floodwall- No instruction given.
- Finishing - No instruction given.
- Painting - No work performed.
- Electrical- No work performed.

RESULTS OF QA INSPECTIONS AND TESTS, DEFICIENCIES OBSERVED, ACTIONS TAKEN AND CORRECTIVE ACTION OF CONTRACTOR INCLUDE COMMENT PERTAINING TO CONTRACTORS CQC ACTIVITIES

Floodwall- Construction of wall at siphon continues with the protected side of wall completed. Sheet pile loading to be removed to offside location. Sheet pile extraction was completed today.

Finishing- Wall finishing continues from the siphon on Westside to Robert E. Lee on floodside with the contractor nearing completion and from the siphon to to Filmore on the protected side.

VERBAL INSTRUCTIONS GIVEN TO CONTRACTOR (include names, reactions and remarks)
None

CONTROVERSIAL MATTERS IN DETAIL.
None

INFORMATION, INSTRUCTIONS OR ACTIONS TAKEN NOT COVERED IN OCR REPORT OR DISAGREEMENTS.
None

Contractor's Quality Control Report (submitted/not submitted) for this (date/period).

REMARKS (include visitors to project and miscellaneous remarks pertinent to work)

NAMES	GOVERNMENT PERSONNEL ON SITE		
	DESIGNATION	HRS. ON SITE	DUTIES
H. Lemoine	QAR REP	8	QA Insp.

SAFETY (include any infractions of approved safety plan, safety manual or instructions from Government personnel Specify corrective action taken.)

Visual observation of contractor personnel during the loading of sheet pile ensuring proper handsignals were being used and that flagmen were in place to direct traffic during access and egress of trucks.

INSPECTOR'S SIGNATURE <i>Howard Lemoine</i>	DATE 8/5/96	SUPERVISOR'S INITIALS <i>WJ</i>	DATE 8/7 8/4/96
--	----------------	------------------------------------	-----------------------

QUALITY CONTROL REPORT
 DACW29-94-C-0079
 LONDON AVENUE OUTFALL CANAL
 B & K CONSTRUCTION JOB NO. 9402

DATE: 8/2/96

REPORT NO.: 482

SKIES: PARTLY CLOUDY

RAIN: 1/4" IN. TEMP.: 74 MIN 92 MAX

DUST: NONE

LEEVE CONDITION: WET CANAL GAUGE: (1.5) NOISE: MODERATE

WORK PERFORMED/LOCATION

B&K CONSTRUCTION: COMPLETED PULLING SHEET PILING FROM STATION 87+90 TO THE FILMORE TIE IN ON THE WEST SIDE - CONTINUED FORMING THE SIPHON MONOLITH - RAIN DELAYED WORK THROUGHOUT THE DAY UNTIL WE FINALLY RAINED OUT

ACCENT CONSTRUCTION: REPAIRED PROTECTED SIDE MONOLITHS FILMORE / SIPHONS WEST UNTIL RAIN OUT

BARNES ELECTRIC: NO WORK TODAY

H&H PAINTING: TOO WET TO WORK

CONTRACTOR/SUBCONTRACTORS AND
 AREAS OF RESPONSIBILITY
 COMPANY

NO	TRADE	HOURS	COMPANY	LOCATION/WORK DESCRIPTION
11	Unskilled	88	B+K Const.	(SEE ABOVE)
8	Skilled	67	"	
1	Supt.	8	"	
	Q.C. Rep.		"	
3	SKILLED	15	ACCENT CONST.	
2	UNSKILLED	10	"	

EQUIPMENT

DESCRIPTION	ARR/DEP	SAFETY CHECK	HRS USED	IDLE	REPAIR
Komatsu 200 Excavator 1	—	YES	1	7	—
Komatsu D37P Dozer	—	NO	0	8	—
Bobcat excavator	—	YES	2	6	—
Case 580 Backhoe	—	NO	0	8	—
MKT Vibro Hammer	—	YES	8	0	—
Fiat-Allis MotorGrader	—	NO	0	8	—
Mantis 3612 Crane	—	YES	2	6	—
KOMATSU EXC. 200 #2	—	YES	8	0	—
Case 580 BACKHOE #2	—	—	—	—	—
WELDING MACHINE	—	YES	4	4	—
KOEHRING 405 CRANE	—	YES	8	0	—

MATERIALS RECEIVED

NO MATERIALS RECEIVED OR HAULED OFF TODAY

TESTS PERFORMED

(As required by plans/specifications)

DELTA TESTING MONITORED THE SHEET PILE PULLING OPERATION FOR EXCESSIVE VIBRATIONS - NONE WERE DETECTED TODAY

QUALITY CONTROL REPORT
INSPECTIONS PERFORMED

NO PRODUCTION WORK TO CHECK TODAY

JOB SAFETY.

CHECKED RIGGING USED TO PULL THE SHEET PILING AND FOUND IT TO BE IN GOOD CONDITION - REMINDED THE CRANE OPERATOR TO KEEP HIS BRAKES DRY OR TO STOP WORK IF THEY GET WET

REMARKS

I certify to the best of knowledge that this report is complete and correct, and that all work methods, materials and equipment are in accordance with plans and specifications except as noted.

Rife Tassin

8/5/96

Representative

Date

**INSPECTORS QUALITY ASSURANCE REPORT (QAR)
DAILY LOG OF CONSTRUCTION - CIVIL**
(ER 415-1-302)

THE OCR WILL BE ATTACHED TO OR FILED WITH THE QAR

REPORT NUMBER 394

TO Area Engineer, COPY TO: C/Const. Div.
CELMN-CD-NO CELMN-CD

DATE Thursday
01-Aug-1996

PROJECT Lake Pontchartrain, La. and Vicinity, London Ave. Canal,
Mirabeau Ave. to Leon C. Simon Blvd., Orleans Parish, Louisiana.

CONTRACT NUMBER
DACW29-94-C-0079

CONTRACTOR (Or hired labor) B & K Construction Company, Inc.
1905 Highway 59, Mandeville, La. 70448

WEATHER
P/C, Hot & Showers

PORTION OF SCHEDULED DAY SUITABLE FOR OPERATIONS

STRUCTURAL EXCAVATION	BORROW EXCAVATION	EMBANKMENT	CONCRETE	STRUCTURE
50 %	50 %	50 %	50 %	50 %

TEMPERATURE	
MINIMUM	MAXIMUM
73	94

HAS ANYTHING DEVELOPED ON THE WORK WHICH MIGHT LEAD TO A CHANGE ORDER OR FINDING OF FACT? NO YES (Explain)

24 HOUR PRECIPITATION	
INCHES	ENDING
1.0	1530p M

NUMBER OF GOVERNMENT EMPLOYEES

SUPERVISORY	OFFICE	LAYOUT	INSPECTION	TOTAL	LABOR
			1-8	1-8	

Canal RIVER STAGE	
FEET	TIME
1.6	900 a M

NUMBER OF CONTRACTOR'S EMPLOYEES

SUPERVISORY	SKILLED	LABORERS	TOTAL	FROM	TO	FROM	TO	FROM	TO
1-6	11-66	13-78	34-204	0700a M	1530p M				

NUMBER OF SHIFTS 1 2 3

Attach list of the following: (a) Major items of equipment either idle or working, and (b) Number and classification of contractor personnel onsite.
Note: If the contractor's Quality Control Report (QCR) contains the information it need not be repeated.

CONTRACTOR/SUBCONTRACTORS AND AREA OF RESPONSIBILITY FOR WORK PERFORMED TODAY

- a. B & K Const. Co., Inc. -
- b. Accent const. Co. Inc.,
- c. H&H Const. Co. Inc

Walters Barnes Electrical

WORK PERFORMED TODAY (Indicate location and description of work performed. Refer to work performed by prime and/or subcontractors by letter in Table above)

- a. Floodwall
- b. finishing
- c. Painting
- d. Electrical

Days of no work and reasons for same:

100% days lost-0
50% days lost-Aug- 01-1996

Information on progress of work, causes for delays and extent of delays, Plant, material, etc.

Some progressive work completed but heavy rains and thunderstorms impeded work on this date.

PERCENT PROJECT COMPLETE: 86.50

PERCENT TIME ELAPSED: 87.75

DATE SET FOR COMPLETION: 21 Aug-1996

QOC INSPECTION PHASES ATTENDED AND INSTRUCTIONS GIVEN:

- Floodwall- No instruction given.
- Finishing- No instruction given.
- Painting - No work performed.
- Electrical- No work performed.

RESULTS OF QA INSPECTIONS AND TESTS, DEFICIENCIES OBSERVED, ACTIONS TAKEN AND CORRECTIVE ACTION OF CONTRACTOR INCLUDE COMMENT PERTAINING TO CONTRACTORS QCC ACTIVITIES

Floodwall- Contractor still continues to construct forms at the siphon at pumping station #4. Sheet piling being removed from site to offsite location at a rate of 120 piles per day. Sheet extraction continues with about 150ft. remaining to be pulled.

Finishing- Finishing continues from siphon Westside on floodside toward Robert E. Lee and from siphon on both protected side and floodside Filmore.

VERBAL INSTRUCTIONS GIVEN TO CONTRACTOR (include names, reactions and remarks)

None

CONTROVERSIAL MATTERS IN DETAIL.

None

INFORMATION, INSTRUCTIONS OR ACTIONS TAKEN NOT COVERED IN QCR REPORT OR DISAGREEMENTS.

None

Contractor's Quality Control Report (submitted/not submitted) for this (date/period).

REMARKS (include visitors to project and miscellaneous remarks pertinent to work)

NAMES	GOVERNMENT PERSONNEL ON SITE		
	DESIGNATION	HRS. ON SITE	DUTIES
H. Lemoine	QAR REP	8	nsp.

SAFETY (include any infractions of approved safety plan, safety manual or instructions from Government personnel Specify corrective action taken.)

Visually observed contractor personnel for for all required safety equipment and proper clothing attire while ensuring a hazardous free working environment was being provided during all phases of work.

INSPECTOR'S SIGNATURE

DATE

SUPERVISOR'S INITIALS

DATE

Howard J. Lemoine

8/02/96

Y

8/7
W 8/6/96

QUALITY CONTROL REPORT
 DACW29-94-C-0079
 LONDON AVENUE OUTFALL CANAL
 B & K CONSTRUCTION JOB NO. 9402

DATE: 8/11/96

REPORT NO.: 482

SKIES: PARTLY CLOUDY

RAIN: 3/4

IN. TEMP.: 74 MIN 85 MAX

DUST: NONE

LEEVE CONDITION: WET CANAL GAUGE: (1.7) NOISE: MODERATE

WORK PERFORMED/LOCATION

B&K CONSTRUCTION: PULLED EXISTING SHEET PILING FROM STATION 88+50 TO 87+90 WEST FILMURE / SIPHONS - TOO WET TO LOAD AND HAUL OFF SHEET PILING TODAY - CONTINUED FORMING SIPHON MONOLITH - RAINED OUT

ACCENT CONST. - REPAIRING PROTECTED SIDE MONOLITHS FILMURE / SIPHONS WEST

BARNES ELECTRIC - NO WORK TODAY

H&H PAINTING - TOO WET TO WORK

CONTRACTOR/SUBCONTRACTORS AND
 AREAS OF RESPONSIBILITY

NO	TRADE	HOURS	COMPANY	LOCATION/WORK DESCRIPTION
11	Unskilled	66	B+K Const.	(SEE ABOVE)
8	Skilled	48	"	
1	Supt.	6	"	
	Q.C. Rep.		"	
3	SKILLED	28	ACCENT CONST.	
2	UNSKILLED	12	"	

EQUIPMENT

DESCRIPTION	ARR/DEP	SAFETY CHECK	HRS USED	IDLE	REPAIR
Komatsu 200 Excavator 1	—	YES	1	7	—
Komatsu D37P Dozer	—	YES	4	4	—
BOBCAT excavator	—	NO	0	8	—
Case 580 Backhoe	—	YES	2	6	—
MKT Vibro Hammer	—	YES	4	4	—
Fiat-Allis MotorGrader	—	YES	2	6	—
Mantis 3612 Crane	—	YES	1	7	—
KOMATSU EXC. 200 *2	—	NO	0	8	—
Case 580 BACKHOE *2	—	—	—	—	—
WELDING MACHINE	—	YES	4	4	—
KOEHRING 405 CRANE	—	YES	4	2	—

MATERIALS RECEIVED

NO MATERIALS RECEIVED ON HAULED OFF

TESTS PERFORMED

(As required by plans/specifications)

DELTA TESTING MONITORED THE SHEET PILE PULLING OPERATION FOR EXCESSIVE VIBRATIONS - NONE WERE DETECTED TODAY

QUALITY CONTROL REPORT
INSPECTIONS PERFORMED

NO PRODUCTION WORK TO CHECK TODAY

JOB SAFETY.

REMINDED EVERYONE THAT THEY MUST WEAR THEIR
HARD HAT AT ALL TIMES AND STEEL TOE BOOTS

REMARKS

I certify to the best of knowledge that this report is complete
and correct; and that all work methods, materials and equipment are
in accordance with plans and specifications except as noted.

Mike Lane
Authorized Q C Representative

8/2/96
Date

**INSPECTORS QUALITY ASSURANCE REPORT (QAR)
DAILY LOG OF CONSTRUCTION - CIVIL**
(ER 415-1-302)

THE QCR WILL BE ATTACHED TO OR FILED WITH THE QAR

REPORT NUMBER
393

TO: [REDACTED] COPY TO: C/Const. Div.
CELMN-CD

DATE
Wednesday
31-Jul-96

PROJECT Lake Pontchartrain, La. and Vicinity, London Ave. Canal,
Mirabeau Ave. to Leon C. Simon Blvd., Orleans Parish, Louisiana.

CONTRACT NUMBER
DACW29-94-C-0079

CONTRACTOR (Or hired labor) B & K Construction Company, Inc.
1905 Highway 59, Mandeville, La. 70448

WEATHER
p/C & Hot & Showers

PORTION OF SCHEDULED DAY SUITABLE FOR OPERATIONS

STRUCTURAL EXCAVATION 50 %	BORROW EXCAVATION 50 %	EMBANKMENT 50 %	CONCRETE 50 %	STRUCTURE 50 %
-------------------------------	---------------------------	--------------------	------------------	-------------------

TEMPERATURE	
MINIMUM 74	MAXIMUM 96

HAS ANYTHING DEVELOPED ON THE WORK WHICH MIGHT LEAD TO A CHANGE ORDER OR FINDING OF FACT? NO YES (Explain)

24 HOUR PRECIPITATION	
INCHES .50	ENDING 1530p

NUMBER OF GOVERNMENT EMPLOYEES

SUPERVISORY	OFFICE	LAYOUT	INSPECTION 1-8	TOTAL	LABOR
-------------	--------	--------	-------------------	-------	-------

Canal RIVER STAGE	FEET 1.9	TIME 900a
-------------------	-------------	--------------

NUMBER OF CONTRACTOR'S EMPLOYEES

SUPERVISORY 1-6.5	SKILLED 8-71.5	LABORERS 13-90	TOTAL 22-222
----------------------	-------------------	-------------------	-----------------

NUMBER OF SHIFTS

<input checked="" type="checkbox"/> 1		<input type="checkbox"/> 2	<input type="checkbox"/> 3
FROM 0700a	TO 1330p	FROM M	TO M

Attach list of the following: (a) Major items of equipment either idle or working, and (b) Number and classification of contractor personnel onsite. Note: If the contractor's Quality Control Report (QCR) contains the information it need not be repeated.

CONTRACTOR/SUBCONTRACTORS AND AREA OF RESPONSIBILITY FOR WORK PERFORMED TODAY

- a. B & K Const. Co., Inc. -
 - b. Accent const. Co. Inc.,
 - c. H&H Const. Co. Inc.,
- Walter Barnes Electrical

WORK PERFORMED TODAY (Indicate location and description of work performed. Refer to work performed by prime and/or subcontractors by letter in Table above)

- a. Floodwall
- b. Finishing
- c. Painting
- d. Electrical

Days of no work and reasons for same:

100% days lost-0
50% days lost-Jun-7,12,13,14,15,21,27,28,29-Jul-8,14,17,24,25,26,31,-1996

Information on progress of work, causes for delays and extent of delays, Plant, material, etc.

Some progressive performed on this date.

DATE SET FOR COMPLETION: 21-Aug-1996

PERCENT PROJECT COMPLETE: 86.50
PERCENT TIME ELAPSED: 87.75

COC INSPECTION PHASES ATTENDED AND INSTRUCTIONS GIVEN:

- Floodwall- No instruction given.
- Finishing- No instruction given.
- Painting - No instruction given.
- Electrical- No instruction given.

RESULTS OF QA INSPECTIONS AND TESTS, DEFICIENCIES OBSERVED, ACTIONS TAKEN AND CORRECTIVE ACTION OF CONTRACTOR INCLUDE COMMENT PERTAINING TO CONTRACTORS QCC ACTIVITIES

Floodwall- Contractor continues to work on forms at the siphon having completed the P/S (fractured fin side) and is now working on the floodside. Sheetpile extraction continues on the P/S to Filmore and should be completed with the removal of piles within the next two (2) working days. Sheet pile removal to offsite location continues; with the removal of 120 pieces.

Finishing- Repair continues from Robert E.Lee Westside floodside to siphon pipe and from the siphon protected side to Filmore.

Painting- No work performed access road to wet to work off of.

Electrical- Waiting for painter to finish wall to complete feeder attachment.

VERBAL INSTRUCTIONS GIVEN TO CONTRACTOR (Include names, reactions and remarks)
None

CONTROVERSIAL MATTERS IN DETAIL.
None

INFORMATION, INSTRUCTIONS OR ACTIONS TAKEN NOT COVERED IN QCR REPORT OR DISAGREEMENTS.
None

Contractor's Quality Control Report (submitted/not submitted) for this (date/period).

REMARKS (include visitors to project and miscellaneous remarks pertinent to work)

NAMES	GOVERNMENT PERSONNEL ON SITE		
	DESIGNATION	HRS. ON SITE	DUTIES
H.Lemoine	QAR Rep.	8	QA Insp

SAFETY (include any infractions of approved safety plan, safety manual or instructions from Government personnel Specify corrective action taken.)

Observed flagmen during the loading and accessing of road for the removal of piles ensuring that all barricades were in place and that flagman were position to address any traffic problems.

INSPECTOR'S SIGNATURE <i>Howard J. Lemoine</i>	DATE <i>8/01/97</i>	SUPERVISOR'S INITIALS <i>ym</i>	DATE <i>8/7 1/4/97</i>
---	------------------------	------------------------------------	---------------------------

QUALITY CONTROL REPORT
 DACW29-94-C-0079
 LONDON AVENUE OUTFALL CANAL
 B & K CONSTRUCTION JOB NO. 9402

DATE: 7/31/96

REPORT NO.: 481

SKIES: PARTLY CLOUDY

RAIN: 1/2

IN. TEMP.: 75 MIN 90 MAX

DUST: NONE

LEVEE CONDITION: WET CANAL GAUGE: (1.7) NOISE: MODERATE

WORK PERFORMED/LOCATION

B&K CONSTRUCTION: PULLED EXISTING SHEET PILING FROM STATION 89+40 TO 88+50 WEST FILMORE/SIPHONS - LOADED AND HAULED OFF 120 PCS. OF SAME - CONTINUED DISASSEMBLY OF I WALL FORMS - DRESSED ACCESS ROADWAYS TO TRY AND DRY THINGS UP. - CONTINUED WORK ON I WALL FORMS FOR THE SIPHON MONOLITH
 • RAINED OUT

BARNES ELECTRIC - NO WORK TODAY

H&H PAINTING - EQUIPMENT BROKE DOWN WAITING ON PARTS

CONTRACTOR/SUBCONTRACTORS AND

AREAS OF RESPONSIBILITY

NO	TRADE	HOURS	COMPANY	LOCATION/WORK DESCRIPTION
11	Unskilled	71	B+K Const.	(SEE ABOVE)
8	Skilled	52	"	
1	Supt.	6 1/2	"	
	ac. rep.		"	
3	SKILLED	19 1/2	ACCENT CONST.	
2	UNSKILLED	13	"	

EQUIPMENT

DESCRIPTION	ARR/DEP	SAFETY CHECK	HRS USED	IDLE	REPAIR
Komatsu 200 Excavator 1	—	YES	2	6	—
Komatsu D37P Dozer	—	YES	4	4	—
BOBCAT Excavator	—	NO	0	8	—
Case 580 Backhoe	—	YES	2	6	—
MKT Vibro Hammer	—	YES	6	2	—
Fiat-Allis MotorGrader	—	YES	4	4	—
Mantis 3612 Crane	—	YES	2	6	—
KOMATSU EXC. 200 #2	—	NO	0	8	—
Case 580 BACKHOE #2	—	—	—	—	—
WELDING MACHINE	—	YES	5	3	—
KOEHRING 405 CRANE	—	YES	6	2	—

MATERIALS RECEIVED

NO MATERIALS RECEIVED TODAY — LOADED AND HAULED
120 PCS. OF MP 112 SHEET PILING FROM FILLMORE/
SIPHONS

TESTS PERFORMED

(As required by plans/specifications)

DELTA TESTING MONITORED SHEET PILE PULLING
OPERATION FOR EXCESSIVE VIBRATIONS —

QUALITY CONTROL REPORT
INSPECTIONS PERFORMED

NO PRODUCTION WORK TO CHECK

JOB SAFETY.

CLEANED ROADWAYS ADJACENT TO ACCESSES TO LEVEE
OF MUD AND DEBRIS TRACKED THERE BY OUR
EQUIPMENT AND VEHICLES

REMARKS

I certify to the best of knowledge that this report is complete
and correct; and that all work methods, materials and equipment are
in accordance with plans and specifications except as noted.


Authorized QC Representative

8/1/96
Date

**INSPECTORS QUALITY ASSURANCE REPORT (QAR)
DAILY LOG OF CONSTRUCTION - CIVIL**
(ER 415-1-302)

THE QCR WILL BE ATTACHED TO OR FILED WITH THE QAR

REPORT NUMBER
392

TO Area Engineer; COPY TO: C/Const. Div.
CELMN-CD-NO CELMN-CD

DATE 30-Jul-96
Tuesday

PROJECT Lake Pontchartrain, La. and Vicinity, London Ave. Canal,
Mirabeau Ave. to Leon C. Simon Blvd., Orleans Parish, Louisiana.

CONTRACT NUMBER
DACW29-94-C-0079

CONTRACTOR (Or hired labor) B & K Construction Company, Inc.
1905 Highway 59, Mandeville, La. 70448

WEATHER
P/C and HOT

PORTION OF SCHEDULED DAY SUITABLE FOR OPERATIONS

TEMPERATURE

STRUCTURAL EXCAVATION 100%	BORROW EXCAVATION 100%	EMBANKMENT 100%	CONCRETE 100%	STRUCTURE 100%
-------------------------------	---------------------------	--------------------	------------------	-------------------

MINIMUM 74	MAXIMUM 96
---------------	---------------

HAS ANYTHING DEVELOPED ON THE WORK WHICH MIGHT LEAD TO A CHANGE ORDER OR FINDING OF FACT? NO YES (Explain)

24 HOUR PRECIPITATION

INCHES Traces	ENDING 1100a
------------------	-----------------

NUMBER OF GOVERNMENT EMPLOYEES

Canal RIVER STAGE

SUPERVISORY	OFFICE	LAYOUT	INSPECTION 1-8	TOTAL 1-8	LABOR
-------------	--------	--------	-------------------	--------------	-------

FEET 1.8	TIME 0800a
-------------	---------------

NUMBER OF CONTRACTOR'S EMPLOYEES

NUMBER OF SHIFTS

1 2 3

SUPERVISORY 1-8.5	SKILLED 11-104	LABORERS 13-104	TOTAL 25-216.5	FROM 0700a M	TO 1630P M	FROM M	TO M	FROM M	TO M
----------------------	-------------------	--------------------	-------------------	-----------------	---------------	-----------	---------	-----------	---------

Attach list of the following: (a) Major items of equipment either idle or working, and (b) Number and classification of contractor personnel onsite.
Note: If the contractor's Quality Control Report (QCR) contains the information it need not be repeated

CONTRACTOR/SUBCONTRACTORS AND AREA OF RESPONSIBILITY FOR WORK PERFORMED TODAY

- a. B & K Const. Co., Inc. -
- Accent const. Co. Inc.,
- b. H&H Const Co. Inc.,
- c. Walter Barnes Electrical

WORK PERFORMED TODAY (Indicate location and description of work performed. Refer to work performed by prime and/or subcontractors buy letter in Table above)

- a. Floodwall
- b. Finsishing
- c. Painting
- d. Electrical

Days of no work and reasons for same:

100 % days lost -0
50 % days lost- Jun-7,12,13,14,15,21,27,28,29-Jul-8,14,17,24,25,26-1996

Information on progress of work, causes for delays and extent of delays, Plant, material, etc.
Progressive work completed on this date.

DATE SET FOR COMPLETION: 21-Aug-96

PERCENT PROJECT COMPLETE: 86.50
PERCENT TIME ELAPSED: 87.75

QCR INSPECTION PHASES ATTENDED AND INSTRUCTIONS GIVEN:

Floodwall- No instruction given.
Finsishing- No instruction given.
Electrical- No work performed
Painting - No work performed

RESULTS OF QA INSPECTIONS AND TESTS, DEFICIENCIES OBSERVED, ACTIONS TAKEN AND CORRECTIVE ACTION OF CONTRACTOR INCLUDE COMMENT PERTAINING TO CONTRACTORS COC ACTIVITIES

Floodwall- Contractor continues to assemble forms for the retro fit of siphon pipe at pumping station # 4. Contractor is removing forms and accessories while making preparation to remove from site. Contractor is at present removing sheet piles from the Westside and hauling to offsite location. Sheetpile removal continues progressing approximately 80 to 90 feet per day with the Koering 405 crane and Vibratory hammer.

Finishing- Finishing continues on the Westside both on the protected and floodside from Robert E. Lee to siphon and from siphon to Filmore.

Painting- No painting still, due to wet access road conditions.

VERBAL INSTRUCTIONS GIVEN TO CONTRACTOR (include names, reactions and remarks)
None

CONTROVERSIAL MATTERS IN DETAIL.
None

INFORMATION, INSTRUCTIONS OR ACTIONS TAKEN NOT COVERED IN QCR REPORT OR DISAGREEMENTS.
None

Contractor's Quality Control Report (submitted/not submitted) for this (date/period).

REMARKS (include visitors to project and miscellaneous remarks pertinent to work)

NAMES	GOVERNMENT PERSONNEL ON SITE		DUTIES
	DESIGNATION	HRS. ON SITE	
H.Lemoine	QA Rep.	8	QA Insp.
C.Wagner	P.E.	1	

SAFETY (include any infractions of approved safety plan, safety manual or instructions from Government personnel Specify corrective action taken.)

Observed worker during bruning and welding operation ensuring that the proper clothing attire and all related safety equipment were being provided and used properly. Compliance was met in this area.

INSPECTOR'S SIGNATURE <i>Howard J. Lemoine</i>	DATE <i>7/31/96</i>	SUPERVISOR'S INITIALS <i>hw</i>	DATE <i>8/7</i> <i>8/5/96</i>
---	------------------------	------------------------------------	-------------------------------------

QUALITY ASSURANCE REPORT SUPPLEMENT

QA Inspections Performed & Results:

Observed ^{existing} sheet piling removal operations including the loading of sheets on truck to be removed from site. Carpenters working on forms under siphon pipes & finishers observed rubbing walls in order to correct imperfections from forms. Checked finished Firewall between R.E. Lee & Pumping Sta. No. 4 on west side & found finish to be O.K. but many walls had broken concrete & chips due to equipment hitting the walls. These will have to be repaired prior to painting.

Instructions to CQC/Remarks:

None today

Chris J. Wagner
Name

Proj Engr
Title

QUALITY CONTROL REPORT
 DACW29-94-C-0079
 LONDON AVENUE OUTFALL CANAL
 B & K CONSTRUCTION JOB NO. 9402

DATE: 7/30/96

REPORT NO.: 480

SKIES: PARTLY CLOUDY

RAIN: TRACE IN. TEMP.: 74 MIN 95 MAX

DUST: NONE

LEEVE CONDITION: WET CANAL GAUGE: (1.5) NOISE: MODERATE

WORK PERFORMED/LOCATION

B&K CONSTRUCTION: PULLED EXISTING SHEET PILING FROM STATION 90+90 TO 89+40 WEST FILMORE / SIPHONS - LOADED AND HAULED OFF 60 PCS. OF SAME - COMPLETED FORMS ON THE LANDSIDE OF THE SIPHON MONO AND STARTED INSTALLING FRACTURED FIN PANELS TO SAME - DISASSEMBLED I WALL FORMS THAT ARE NO LONGER IN USE - DRESSED ALL ACCESS ROADWAYS SO THAT THEY COULD DRY OUT

ACCENT CONSTRUCTION: REPAIRING PROTECTED SIDE MONOLITHS FILMORE / SIPHONS WEST BANK

BARNES ELECTRIC - NO WORK TODAY
 HELM PAINTING - EQUIPMENT BROKE DOWN WAITING ON PARTS

CONTRACTOR/SUBCONTRACTORS AND
 AREAS OF RESPONSIBILITY

NO	TRADE	HOURS	COMPANY	LOCATION/WORK DESCRIPTION
11	Unskilled	88	B+K Const.	(SEE ABOVE)
8	Skilled	64	"	
1	Supt.	8 1/2	"	
	QC Rep.		"	
3	SKILLED	24	ACCENT CONSL	
2	UNSKILLED	16	"	

EQUIPMENT

DESCRIPTION	ARR/DEP	SAFETY CHECK	HRS USED	IDLE	REPAIR
Komatsu 200 Excavator 1	—	YES	4	4	—
Komatsu D37P Dozer	—	YES	1	7	—
BOBCAT Excavator	—	YES	1	7	—
Case 580 Backhoe	—	YES	4	4	—
MKT Vibro Hammer	—	YES	8	0	—
Fiat-Allis MotorGrader	AAA	YES	2	6	—
Mantis 3612 Crane	—	YES	8	0	—
KOMATSU EXC. 200 #2	—	NO	0	8	—
CASE 580 BACKHOE #2	—	—	—	—	—
WELDING MACHINE	—	YES	8	0	—
KOEHRING 405 CRANE	—	YES	8	0	—

MATERIALS RECEIVED

NO MATERIAL RECEIVED TODAY - HAULED OFF
60 PCS. OF MP112 SHEET PILING PULLED FROM FILMORE/
SIMONS WEST

TESTS PERFORMED

(As required by plans/specifications)

DELTA TESTING MONITORED SHEET PILE PULLING
OPERATION FOR EXCESSIVE VIBRATIONS - (NONE DETECTED
TODAY)

QUALITY CONTROL REPORT
INSPECTIONS PERFORMED

CHECKED ON REPAIRS MADE BY THE CEMENT FINISHERS TO THE FLOODSIDE MONOLITHS ROBERT E. LEE / SIPHONS WEST 110 A THRU 130 - THE 4' FORM LINE IS BEING FLOATED OUT AND THESE MONOLITHS ARE READY TO BE COATED - SITE CONDITIONS ARE STILL WET BUT DRESS UP WORK IS BEING DONE TO MAKE SOME AREAS ACCESSABLE - THE FORMS THAT WERE PLACED FOR THE PROTECTED SIDE OF THE SIPHON MONOLITH ARE PLUMB AND TO LINE - THEY HAVE BEEN MODIFIED TO FIT AROUND THE 2 SIPHON PIPES - FRACTURED FIN PANELS ARE BEING RE-INSTALLED TO THE FORMS - AN 8" SMOOTH AREA WILL BE CREATED AROUND THE PIPES TO MATCH THE FRAMING AROUND THE FRACTURED FIN ON THE TYPICAL MONOLITHS

JOB SAFETY.

RADIO COMMUNICATION IS BEING USED TO DIRECT THE CRANE OPERATOR WHEN FORMS ARE BEING SET FLOODSIDE OF THE SIPHON MONOLITH BECAUSE OF THE BLIND SPOT CREATED BY THE PIPES

REMARKS

I certify to the best of knowledge that this report is complete and correct; and that all work methods, materials and equipment are in accordance with plans and specifications except as noted.


Authorized & C Representative

7/31/96
Date

**INSPECTORS QUALITY ASSURANCE REPORT (QAR)
DAILY LOG OF CONSTRUCTION - CIVIL**
(ER 415-1-302)

THE OCR WILL BE ATTACHED TO OR FILED WITH THE QAR

REPORT NUMBER
391

TO Area Engineer, COPY TO: C/Const. Div.
CELMN-CD-NO CELMN-CD

DATE Sat, Sun & Mon
27, 28, 29, -Jun-1996

PROJECT Lake Pontchartrain, La. and Vicinity, London Ave. Canal,
Mirabeau Ave. to Leon C. Simon Blvd., Orleans Parish, Louisiana.

CONTRACT NUMBER
DACW29-94-C-0079

CONTRACTOR (Or hired labor) B & K Construction Company, Inc.
1905 Highway 59, Mandeville, La. 70448

WEATHER
P/C and Hot

PORTION OF SCHEDULED DAY SUITABLE FOR OPERATIONS

TEMPERATURE

STRUCTURAL EXCAVATION 100 %	BORROW EXCAVATION 100 %	EMBANKMENT 100 %	CONCRETE 100 %	STRUCTURE 100 %
--------------------------------	----------------------------	---------------------	-------------------	--------------------

MINIMUM 74	MAXIMUM 96
---------------	---------------

HAS ANYTHING DEVELOPED ON THE WORK WHICH MIGHT LEAD TO A CHANGE ORDER OR FINDING OF FACT? NO YES (Explain)

24 HOUR PRECIPITATION

INCHES .00	ENDING 1530a	M
---------------	-----------------	---

NUMBER OF GOVERNMENT EMPLOYEES

Canal RIVER STAGE

SUPERVISORY	OFFICE 1-2	LAYOUT	INSPECTION 1-8	TOTAL 2-10	LABOR
-------------	---------------	--------	-------------------	---------------	-------

FEET 1.7	TIME 900a	M
-------------	--------------	---

NUMBER OF CONTRACTOR'S EMPLOYEES

NUMBER OF SHIFTS

1 2 3

SUPERVISORY 1-8	SKILLED 13-95	LABORERS 10-80	TOTAL 24-183
--------------------	------------------	-------------------	-----------------

FROM 0700a	TO 1630p	FROM M	TO M	FROM M	TO M
---------------	-------------	-----------	---------	-----------	---------

Attach list of the following: (a) Major items of equipment either idle or working, and (b) Number and classification of contractor personnel onsite.
Note: If the contractor's Quality Control Report (OCR) contains the information it need not be repeated.

CONTRACTOR/SUBCONTRACTORS AND AREA OF RESPONSIBILITY FOR WORK PERFORMED TODAY

- a. B & K Const. Co., Inc. -
- b. Accent const. co. Inc.,
- c. H&H Construction Co. Inc.,
- d. Water Barnes Electric Inc.

WORK PERFORMED TODAY (Indicate location and description of work performed. Refer to work performed by prime and/or subcontractors buy letter in Table above)

- a. Floodwall
- b. Refinishing
- c. Electrical
- d. Painting

Days of no work and reasons for same:

100days lost-0
50%days lost-Jun7,12,13,14,15,21,27,28,29-Jul-8,14,17,24,25,26-1996

Information on progress of work, causes for delays and extent of delays. Plant, material, etc.
Progressive performed on this date.

DATE SET FOR COMPLETION: 21-Aug-1996

PERCENT PROJECT COMPLETE: 86.50
PERCENT TIME ELAPSED: 87.75

COC INSPECTION PHASES ATTENDED AND INSTRUCTIONS GIVEN:

- Floodwall- No instruction given.
- Finishing- No instruction given.
- Painting - No work performed access road condition to wet.
- Electrical- No work performed awaiting wall to be painted.

RESULTS OF QA INSPECTIONS AND TESTS, DEFICIENCIES OBSERVED, ACTIONS TAKEN AND CORRECTIVE ACTION OF CONTRACTOR INCLUDE COMMENT PERTAINING TO CONTRACTORS QCC ACTIVITIES

Floodwall- Contractor continues to assemble the forms at the siphon at Pumping station # 4. Sheet pile removal continues on the Westside protected side with the Koering 405 and Mkt Vibro HAMMER. Contractor is removing about 80 to 90 ft. perday placing and stacking piles for removal at a later time.

Refinishing- Wall repair on Westside floodside from pumping station to Robert E. Lee and from the pumping station to Filmore.

*Note- No electrical work is being performed due to the Sub-contractor is awaiting for the painter to be able to access the roads next to wall to complete his last application of paint. Wall has to be painted before feeder can be hung.

VERBAL INSTRUCTIONS GIVEN TO CONTRACTOR (include names, reactions and remarks)

None

CONTROVERSIAL MATTERS IN DETAIL

None

INFORMATION, INSTRUCTIONS OR ACTIONS TAKEN NOT COVERED IN QCR REPORT OR DISAGREEMENTS

None

Contractor's Quality Control Report (submitted/not submitted) for this (date/period).

REMARKS (include visitors to project and miscellaneous remarks pertinent to work)

NAMES	GOVERNMENT PERSONNEL ON SITE		DUTIES
	DESIGNATION	HRS. ON SITE	
H.Lemoine	QAR Rep.	8	QA Insp.
C.Wagner	P.E.	2	

SAFETY (include any infractions of approved safety plan, safety manual or instructions from Government personnel Specify corrective action taken.)

Observed the Mantis 3612 crawler crane for fireextinguisher, back up alarm and that there were no broken glass. Found this equipment to be in compliance during this inspection.

INSPECTOR'S SIGNATURE <i>Howard J. Lemoine</i>	DATE <i>7/30/96</i>	SUPERVISOR'S INITIALS <i>gp</i>	DATE <i>8/7 8/5/96</i>
---	------------------------	------------------------------------	---------------------------

QUALITY ASSURANCE REPORT SUPPLEMENT

QA Inspections Performed & Results: Observed contractor personnel pulling existing sheet piling near Filmore Ave on north side. Piling being stacked on levee for removal @ later date. Carpenters continuing to assemble form under the siphon pipes @ P.S. #4 (west side). Also observed subcontractor (Barcus Electric) re-installing feeder line to wall on east side near Filmore Ave. Sub unable to continue due to wall not being completely painted.

Instructions to CQC/Remarks: None

Chris J. Wagner
Name

Proj Engr
Title

QUALITY CONTROL REPORT
 DACW29-94-C-0079
 LONDON AVENUE OUTFALL CANAL
 B & K CONSTRUCTION JOB NO. 9402

DATE: 7/29/96

REPORT NO.: 479

SKIES: PARTLY CLOUDY

RAIN: TRACE IN. TEMP.: 72 MIN 94 MAX

DUST: NONE

LEEVE CONDITION: WET CANAL GAUGE: (1.5) NOISE: MODERATE

WORK PERFORMED/LOCATION

7-27-96 7-28-96 TOO WET TO WORK
 B&K CONSTRUCTION PULLED EXISTING SHEET PILING FROM
 STATION 92+70 TO 90+90 WEST FILMORE/SIPHONS
 TOO WET TO LOAD AND HAUL SHEET PILING TODAY -
 CONTINUED WORKING ON FORMS FOR THE SIPHON PIPES
 MONOLITH - COMPLETED CLEANING THE THREADS OF THE
 STAINLESS STEEL ANCHOR BOLTS FOR THE 340 FEEDER CABLE
 FILMORE/PS 4 EAST

ACCENT CONSTRUCTION: REPAIRING PROTECTED SIDE MONOLITHS
 FILMORE/SIPHONS WEST BANK

BARNES ELECTRIC: INSTALLED FEEDER 340 TO (11)
 MONOLITHS FILMORE/PS 4 EAST - THE LEEVE
 ROADWAY BEYOND THAT POINT WAS NOT ACCESSABLE DUE
 TO WET CONDITIONS

M&H PAINTING: TOO WET TO WORK

CONTRACTOR/SUBCONTRACTORS AND

AREAS OF RESPONSIBILITY

NO	TRADE	HOURS	COMPANY	LOCATION/WORK DESCRIPTION
8	Unskilled	64	B+K Const.	(SEE ABOVE)
7	Skilled	56	"	
1	Supt.	8	"	
	Q.C. Rep.		"	
3	SKILLED	24	ACCENT CONST	
2	UNSKILLED	16	"	
3	SKILLED	15	BARNES ELECT	

EQUIPMENT

DESCRIPTION	ARR/DEP	SAFETY CHECK	HRS USED	IDLE	REPAIR
Komatsu 200 Excavator 1	~	YES	2	6	—
Komatsu D37P Dozer	—	YES	1	7	—
BOBCAT Excavator	—	YES	4	4	—
Case 580 Backhoe	—	YES	2	6	—
MKT Vibro Hammer	—	YES	8	0	—
Fiat-Allis MotorGrader	—	—	—	—	—
Mantis 3612 Crane	—	YES	4	4	—
KOMATSU EXC. 200 #2	—	NO	0	8	—
Case 580 BACKHOE #2	—	—	—	—	—
WELDING MACHINE	—	YES	8	0	—
KOEHRLING 405 CRANE	—	YES	8	0	—

MATERIALS RECEIVED

NO MATERIALS RECEIVED OR HAULED OFF TODAY

TESTS PERFORMED

(As required by plans/specifications)

DELTA TESTING MONITORED SHEET PILE PULLING OPERATION FOR EXCESSIVE VIBRATIONS

QUALITY CONTROL REPORT
INSPECTIONS PERFORMED

SITE CONDITIONS EXTREMELY WET - ATTEMPTED TO
DRESS OFF WORK AREAS TO MAKE THEM LESS SLOPPY -
TOO WET TO ACCESS TRUCKS FOR HAULING OFF SHEET PILING
TOO WET TO BACKFILL OR COMPACT - TOO WET FOR
PAINTER TO ACCESS LEVEE FOR REPAIR WORK THAT
NEEDS TO BE DONE FILMORE / P 5 4 EAST PROTECTED SIDE

JOB SAFETY.

REMINDED EVERYONE WORKING ON THE FLOODSIDE SLOPE
PAVING TO BE CAREFULL NOT TO SLIP IN THE WATER
AND THAT LIFE VESTS ARE AVAILABLE FOR THEM TO
USE IF THEY SO DESIRE

REMARKS

I certify to the best of knowledge that this report is complete
and correct; and that all work methods, materials and equipment are
in accordance with plans and specifications except as noted.


Authorized & C Representative

7/30/96
Date

INSPECTORS QUALITY ASSURANCE REPORT (QAR)
DAILY LOG OF CONSTRUCTION - CIVIL
 (ER 415-1-302)

THE QCR WILL BE ATTACHED TO OR FILED WITH THE QAR

REPORT NUMBER
390

TO Area Engineer, COPY TO: C/Const. Div.
 CELMN-CD-NO CELMN-CD

DATE Friday
26-Jul-1996

PROJECT Lake Pontchartrain, La. and Vicinity, London Ave. Canal,
 Mirabeau Ave. to Leon C. Simon Blvd., Orleans Parish, Louisiana.

CONTRACT NUMBER
DACW29-94-C-0079

CONTRACTOR (Or hired labor) B & K Construction Company, Inc.
 1905 Highway 59, Mandeville, La. 70448

WEATHER
P/C and Showers

PORTION OF SCHEDULED DAY SUITABLE FOR OPERATIONS

TEMPERATURE

STRUCTURAL EXCAVATION 50 %	BORROW EXCAVATION 50 %	EMBANKMENT 50 %	CONCRETE 50 %	STRUCTURE 50 %
-------------------------------	---------------------------	--------------------	------------------	-------------------

MINIMUM 75	MAXIMUM 94
---------------	---------------

HAS ANYTHING DEVELOPED ON THE WORK WHICH MIGHT LEAD TO A CHANGE ORDER OR FINDING OF FACT? NO YES (Explain)

24 HOUR PRECIPITATION

INCHES .90	ENDING 1530p	M
---------------	-----------------	---

NUMBER OF GOVERNMENT EMPLOYEES

Canal RIVER STAGE

SUPERVISORY	OFFICE	LAYOUT	INSPECTION 1-8	TOTAL 1-8	LABOR
-------------	--------	--------	-------------------	--------------	-------

FEET 1.8	TIME 1000a	M
-------------	---------------	---

NUMBER OF CONTRACTOR'S EMPLOYEES

NUMBER OF SHIFTS 1 2 3

SUPERVISORY 1-6	SKILLED 13-63	LABORERS 13-63	TOTAL 27-1 44	FROM 700a	TO 1330p	FROM	TO	FROM	TO
--------------------	------------------	-------------------	------------------	--------------	-------------	------	----	------	----

M	M	M	M	M	M	M	M	M	M
---	---	---	---	---	---	---	---	---	---

Attach list of the following: (a) Major items of equipment either idle or working, and (b) Number and classification of contractor personnel onsite.
 Note: If the contractor's Quality Control Report (QCR) contains the information it need not be repeated

CONTRACTOR/SUBCONTRACTORS AND AREA OF RESPONSIBILITY FOR WORK PERFORMED TODAY

- a. B & K Const. Co., Inc. -
- b. Accent Const. Co. Inc.,
- c. H&H Const. Co. Inc.,
- Walter Barnes Electric Co. Inc.,

WORK PERFORMED TODAY (Indicate location and description of work performed. Refer to work performed by prime and/or subcontractors by letter in Table above)

- A. Floodwall
- B. Refinishing
- C. Painting
- D. Electrical

Days of no work and reasons for same:

100% days lost -0
 50% days lost - Jun 7, 12, 13, 14, 15, 21, 27, 28, 29, Jul-8, 14, 15, 17, 24, 25, 26-1996

Information on progress of work, causes for delays and extent of delays, Plant, material, etc.

Some progressive performed on this date

Revised 18th Partial Payment Estimate
 DATE SET FOR COMPLETION: 21-Aug-1996

PERCENT PROJECT COMPLETE: 86.50
 PERCENT TIME ELAPSED: 87.75

QCR INSPECTION PHASES ATTENDED AND INSTRUCTIONS GIVEN:

- Floodwall- No instruction given.
- Finsihing- No instructions given.
- Electrical- No work performed
- Painting - No work performed.

RESULTS OF QA INSPECTIONS AND TESTS, DEFICIENCIES OBSERVED, ACTIONS TAKEN AND CORRECTIVE ACTION OF CONTRACTOR INCLUDE COMMENT PERTAINING TO CONTRACTORS QCC ACTIVITIES

Floodwall- Contractor continues to proceed with the form construction at pump station. Forms have to be dismantled & reassembled to accomodate the siphon pipe. Sheet Pile extraction continues from the siphon to to Filmore ,progressing about 90ft to 100 ft. per day.

Finishing- Refinishing continues from the Pump station #4 to Filmore West-side both on the protected side and floodside of I-Wall.

VERBAL INSTRUCTIONS GIVEN TO CONTRACTOR (include names, reactions and remarks)

None

CONTROVERSIAL MATTERS IN DETAIL.

None

INFORMATION, INSTRUCTIONS OR ACTIONS TAKEN NOT COVERED IN QCR REPORT OR DISAGREEMENTS.

None

Contractor's Quality Control Report (submitted/not submitted) for this (date/period).

REMARKS. (include visitors to project and miscellaneous remarks pertinent to work)

GOVERNMENT PERSONNEL ON SITE			
NAMES	DESIGNATION	HRS. ON SITE	DUTIES
H. Lemoine	QAR REP.	8	QA Insp.

SAFETY: (include any infractions of approved safety plan, safety manual or instructions from Government personnel. Specify corrective action taken.)

Visual observation of contractor for all proper safety equipment were being used during all phases of work and that a proper and safe hazardous free environment was being provided. Compliance was met.

INSPECTOR'S SIGNATURE

DATE

SUPERVISOR'S INITIALS

DATE

H. Lemoine

7/29/96

HL

7/31
7/31/96

QUALITY CONTROL REPORT
 DACW29-94-C-0079
 LONDON AVENUE OUTFALL CANAL
 B & K CONSTRUCTION JOB NO. 9402

DATE: 7/12/96

REPORT NO.: 478

SKIES: PARTLY CLOUDY / RAIN. RAIN: 3/4 IN. TEMP.: 72 MIN 85 MAX

DUST: NONE LEVEE CONDITION: WET CANAL GAUGE: (1.2) NOISE: MODERATE

WORK PERFORMED/LOCATION

B&K CONSTRUCTION: PULLED EXISTING SHEET PILING FROM STATION 93+60 TO 92+70 WEST FILMORE / SIPHONS - TOO WET TO LOAD AND HAUL SHEET PILING TODAY - CONTINUED WORKING ON FORMS FOR THE SIPHON PIPES MONOLITH UNTIL RAIN OUT

ACCENT CONSTRUCTION: REPAIRING PROTECTED SIDE MONOLITHS FILMORE / SIPHONS WEST BANK

BARNES ELECTRIC: TOO WET TO ACCESS FILMORE / PUMP STA # 4 EAST

H&H PAINTING: TOO WET TO WORK

CONTRACTOR/SUBCONTRACTORS AND
 AREAS OF RESPONSIBILITY

NO	TRADE	HOURS	COMPANY	LOCATION/WORK DESCRIPTION
11	Unskilled	55	B+K Const.	(SEE ABOVE)
9	Skilled	54	"	
1	Supt.	6	"	
1	Q.C. Rep.	4	"	
3	SKILLED	15	ACCENT	
2	UNSKILLED	10	"	

EQUIPMENT

DESCRIPTION	ARR/DEP	SAFETY CHECK	HRS USED	IDLE	REPAIR
Komatsu 200 Excavator 1	—	YES	2	6	—
Komatsu D37P Dozer	—	YES	2	6	—
BOBCAT Excavator	—	YES	5	3	—
Case 580 Backhoe	—	YES	1	7	—
MKT Vibro Hammer	—	YES	5	3	—
Fiat-Allis MotorGrader	—	—	—	—	—
Mantis 3612 Crane	—	YES	2	6	—
KOMATSU EXC. 200 #2	—	YES	1	7	—
Case 580 BACKHOE #2	—	—	—	—	—
WELDING MACHINE	—	YES	4	4	—
KOEHRING 405 CRANE	—	YES	5	3	—

MATERIALS RECEIVED

NO MATERIALS RECEIVED NOR HAULED OFF TODAY

TESTS PERFORMED

(As required by plans/specifications)

DELTA TESTING - MONITORED SHEET PILE DRIVING OPERATION FOR EXCESSIVE VIBRATIONS

QUALITY CONTROL REPORT
INSPECTIONS PERFORMED

SITE CONDITIONS EXTREMELY WET - NO REAL
PRODUCTION WORK TO INSPECT

JOB SAFETY.

WE ARE STILL USING THE LOCKOUT TAG OUT
PROCEDURE FOR THE S&WB FEEDER CABLES - EVEN
THOUGH THE LINES ARE BEING DEMARGINED WE STILL TREAT
THEM AS IF THEY ARE HOT - REMINDED EVERYONE
TO BE CAREFUL TODAY BECAUSE OF THE WET
CONDITION OF THE LEVER

REMARKS

I certify to the best of knowledge that this report is complete
and correct; and that all work methods, materials and equipment are
in accordance with plans and specifications except as noted.


Authorized J C Representative

7/29/96
Date

**INSPECTORS QUALITY ASSURANCE REPORT (QAR)
DAILY LOG OF CONSTRUCTION - CIVIL
(ER 415-1-302)**

THE OCR WILL BE ATTACHED TO OR FILED WITH THE QAR

REPORT NUMBER
389

TO: Area Engineer, COPY TO: C/Const. Div.
CELMN-CD-NO CELMN-CD

DATE
Thursday
25-July-1996

PROJECT Lake Pontchartrain, La. and Vicinity, London Ave. Canal,
Mirabeau Ave. to Leon C. Simon Blvd., Orleans Parish, Louisiana.

CONTRACT NUMBER
DACW29-94-C-0079

CONTRACTOR (Or hired labor) B & K Construction Company, Inc.
1905 Highway 59, Mandeville, La. 70448

WEATHER
P/C and Rain

PORTION OF SCHEDULED DAY SUITABLE FOR OPERATIONS

STRUCTURAL EXCAVATION 50 %	BORROW EXCAVATION 50 %	EMBANKMENT 50 %	CONCRETE 50 %	STRUCTURE 50 %
-------------------------------	---------------------------	--------------------	------------------	-------------------

TEMPERATURE	
MINIMUM 75	MAXIMUM 96

HAS ANYTHING DEVELOPED ON THE WORK WHICH MIGHT LEAD TO A CHANGE ORDER OR FINDING OF FACT? NO YES (Explain)

24 HOUR PRECIPITATION
INCHES 1.0 ENDING 1530p M

NUMBER OF GOVERNMENT EMPLOYEES

SUPERVISORY	OFFICE	LAYOUT	INSPECTION 1-8	TOTAL	LABOR
-------------	--------	--------	-------------------	-------	-------

Canal RIVER STAGE
FEET 1.7 TIME 1100a M

NUMBER OF CONTRACTOR'S EMPLOYEES

SUPERVISORY 1-1	SKILLED 9-9	LABORERS 11-11	TOTAL 20-20	FROM 0700a M	TO 1630p M	FROM M	TO M	FROM M	TO M
--------------------	----------------	-------------------	----------------	--------------	------------	--------	------	--------	------

NUMBER OF SHIFTS 1 2 3

Attach list of the following: (a) Major items of equipment either idle or working, and (b) Number and classification of contractor personnel onsite.
Note: If the contractor's Quality Control Report (QCR) contains the information it need not be repeated.

CONTRACTOR/SUBCONTRACTORS AND AREA OF RESPONSIBILITY FOR WORK PERFORMED TODAY

- a. B & K Const. Co., Inc. -
- b. H&H Const Co. Inc.,
- c. Accent Const. Co. Inc.,
- Walter Barnes Electric Co.,

WORK PERFORMED TODAY (Indicate location and description of work performed. Refer to work performed by prime and/or subcontractors by letter in Table above)

- a. Floodwall
- b. Finsihing
- c. Painting
- d. Electrical

Days of no work and reasons for same:

100% days lost-0
50% days lost-Jun-7,12,13,14,15,21,27,28,29, Jul-8,14,15,17,24,25-1996

Information on progress of work, causes for delays and extent of delays, Plant, material, etc.
No progressive done on this date.

DATE SET FOR COMPLETION: 06-Aug-1996

PERCENT PROJECT COMPLETE: 85.50
PERCENT TIME ELAPSED: 87.75

QAR INSPECTION PHASES ATTENDED AND INSTRUCTIONS GIVEN:

- Floodwall - No work performed
- Painting - No work performed
- Finsishing - No work performed
- Electrical - No work performed

RESULTS OF QA INSPECTIONS AND TESTS, DEFICIENCIES OBSERVED, ACTIONS TAKEN AND CORRECTIVE ACTION OF CONTRACTOR INCLUDE COMMENT PERTAINING TO CONTRACTORS QCC ACTIVITIES

* No work was performed on this date due to heavy thunderstorms which prevailed throughout the day.

VERBAL INSTRUCTIONS GIVEN TO CONTRACTOR (Include names, reactions and remarks)

None

CONTROVERSIAL MATTERS IN DETAIL

None

INFORMATION, INSTRUCTIONS OR ACTIONS TAKEN NOT COVERED IN QCR REPORT OR DISAGREEMENTS

None

Contractor's Quality Control Report (submitted/not submitted) for this (date/period).

REMARKS (Include visitors to project and miscellaneous remarks pertinent to work)

NAMES	GOVERNMENT PERSONNEL ON SITE			DUTIES
	DESIGNATION	HRS. ON SITE		
H. Lemoine	QAR REP	8		QA Insp.

SAFETY (Include any infractions of approved safety plan, safety manual or instructions from Government personnel Specify corrective action taken.)

Visual site inspection to ensure that the contractor had secured all areas of work within the limits of project. Compliance met.

INSPECTOR'S SIGNATURE <i>Harold Lemoine</i>	DATE <i>7/26/96</i>	SUPERVISOR'S INITIALS <i>W</i>	DATE <i>7/30/96</i>
--	------------------------	-----------------------------------	------------------------

EQUIPMENT

DESCRIPTION	ARR/DEP	SAFETY CHECK	HRS USED	IDLE	REPAIR
Komatsu 200 Excavator 1		NO	0	8	—
Komatsu D37P Dozer		NO	0	8	—
BOBCAT Excavator		NO	0	8	—
Case 580 Backhoe		NO	0	8	—
MKT Vibro Hammer		NO	0	8	—
Fiat-Allis MotorGrader		+	—	—	—
Mantis 3612 Crane		NO	0	8	—
KOMATSU EXC. 200 #2		NO	0	8	—
Case 580 BACKHOE #2		—	—	—	—
WELDING MACHINE		NO	0	8	—
KOEHRING 405 CRANE		NO	0	8	—

MATERIALS RECEIVED

NO MATERIALS RECEIVED OR HAULED OFF

TESTS PERFORMED

(As required by plans/specifications)

NO TESTING TODAY

QUALITY CONTROL REPORT
INSPECTIONS PERFORMED

NO WORK TO BE INSPECTED TODAY

JOB SAFETY.

NO WORK TODAY

REMARKS

I certify to the best of knowledge that this report is complete and correct; and that all work methods, materials and equipment are in compliance with plans and specifications except as noted.


Authorized Q C Representative

7/26/96
Date

**INSPECTORS QUALITY ASSURANCE REPORT (QAR)
DAILY LOG OF CONSTRUCTION - CIVIL**
(ER 415-1-302)

THE OCR WILL BE ATTACHED TO OR FILED WITH THE QAR

REPORT NUMBER
388

TO Area Engineer, COPY TO: C/Const. Div.
CELMN-CD-NO CELMN-CD

DATE
Wednesday
24-Jul-1996

PROJECT Lake Pontchartrain, La. and Vicinity, London Ave. Canal,
Mirabeau Ave. to Leon C. Simon Blvd., Orleans Parish, Louisiana.

CONTRACT NUMBER
DACW29-94-C-0079

CONTRACTOR (Or hired labor) B & K Construction Company, Inc.
1905 Highway 59, Mandeville, La. 70448

WEATHER
P/C and Hot & Showers

PORTION OF SCHEDULED DAY SUITABLE FOR OPERATIONS

STRUCTURAL EXCAVATION 50 %	BORROW EXCAVATION 50%	EMBANKMENT 50%	CONCRETE 50 %	STRUCTURE 50 %
-------------------------------	--------------------------	-------------------	------------------	-------------------

TEMPERATURE	
MINIMUM 74	MAXIMUM 96

HAS ANYTHING DEVELOPED ON THE WORK WHICH MIGHT LEAD TO A CHANGE ORDER OR FINDING OF FACT?
 NO YES (Explain)

24 HOUR PRECIPITATION	
INCHES 0.50	ENDING 1530p M

NUMBER OF GOVERNMENT EMPLOYEES

SUPERVISORY	OFFICE	LAYOUT	INSPECTION 1-8	TOTAL 1-8	LABOR
-------------	--------	--------	-------------------	--------------	-------

FEET 1.8	TIME 900a M
-------------	-------------------

Canal RIVER STAGE

NUMBER OF CONTRACTOR'S EMPLOYEES

SUPERVISORY 1-5	SKILLED 15-80	LABORERS 13-65	TOTAL 38-195
--------------------	------------------	-------------------	-----------------

NUMBER OF SHIFTS

FROM 0700a M		TO 1300p M		FROM M		TO M		FROM M		TO M	
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>

Attach list of the following: (a) Major items of equipment either idle or working, and (b) Number and classification of contractor personnel onsite.
Note: If the contractor's Quality Control Report (QCR) contains the information it need not be repeated

CONTRACTOR/SUBCONTRACTORS AND AREA OF RESPONSIBILITY FOR WORK PERFORMED TODAY

- a. B & K Const. Co., Inc. -
- Accent Const. Co. Inc.,
- b. H&H Const. Inc.,
- c. Walter Barnes Electrical

WORK PERFORMED TODAY (Indicate location and description of work performed. Refer to work performed by prime and/or subcontractors buy letter in Table above)

- a. Floodwall
- b. Finishing
- c. Painting
- d. Electrical

Days of no work and reasons for same:
100% days lost-0
50% days lost- Jun7,12,13,14,15,21,27,28,29-Jul,8,14,15,17,24-1996

Information on progress of work, causes for delays and extent of delays, Plant, material, etc.
Some Progressive work completed on this date.

DATE SET FOR COMPLETION: 06-Aug-1996

PERCENT PROJECT COMPLETE: 85.50
PERCENT TIME ELAPSED: 87.75

CQC INSPECTION PHASES ATTENDED AND INSTRUCTIONS GIVEN:
Floodwall- No instruction given.
Finishing- No instruction given.
Painting- No work on this date.
Electrical- No instruction given.

RESULTS OF QA INSPECTIONS AND TESTS, DEFICIENCIES OBSERVED, ACTIONS TAKEN AND CORRECTIVE ACTION OF CONTRACTOR INCLUDE COMMENT PERTAINING TO CONTRACTORS QCC ACTIVITIES

Floodwall- Contractor continues to reconstruct forms to adapte to siphon pipe at pumping station. Sheet pile extraction continues progressing about 80 ft. on this date from the Pumping station # 4 to Filmore.

Finishing- Wall repair continues from the pump station on Westside to Filmore on both the floodside and protected side.

Electrical- Sub-contractor continues to assist in the exccacation of feeder cable on the Eastside on protected side. Contractor is also removing debris that wascreated during the wall construction.

*Afternoon showers occurred requiring work to to cease .

VERBAL INSTRUCTIONS GIVEN TO CONTRACTOR (include names, reactions and remarks)

None

CONTROVERSIAL MATTERS IN DETAIL

None

INFORMATION, INSTRUCTIONS OR ACTIONS TAKEN NOT COVERED IN QCR REPORT OR DISAGREEMENTS:

None

Contractor's Quality Control Report (submitted/not submitted) for this (date/period).

REMARKS (include visitors to project and miscellaneous remarks pertinent to work)

NAMES	GOVERNMENT PERSONNEL ON SITE		
	DESIGNATION	HRS. ON SITE	DUTIES
H.Lemoine	QAR REP	8	QA Insp.

SAFETY (include any infractions of approved safety plan, safety manual or instructions from Government personnel Specify corrective action taken.)

Observed contractor removing oxygen and aceytlene cylinders from different areas throughout the jobsite and placing in bottle racks in their proper upright position.

INSPECTOR'S SIGNATURE

DATE

SUPERVISOR'S INITIALS

DATE

Howard Lemoine

7/25/96

HL

W

7/30/96

7/31

QUALITY CONTROL REPORT
 DACW29-94-C-0079
 LONDON AVENUE OUTFALL CANAL
 B & K CONSTRUCTION JOB NO. 9402

DATE: 7/24/96

REPORT NO.: 476

SKIES: PARTLY CLOUDY / CLOUDY RAIN: 5/8" IN. TEMP.: 74 MIN 95 MAX

DUST: NONE LEVEE CONDITION: DRY/WET CANAL GAUGE: (1.0) NOISE: MODERATE

WORK PERFORMED/LOCATION

B&K CONSTRUCTION: PULLED EXISTING SHEET PILING FROM STATION 94+20 TO 93+60 WEST FILMORE / SIPHONS LOADED AND HAULED 60 PCS. OF PULLED SHEETS. CONTINUED WORK ON FORM MODIFICATION AT THE SIPHON PIPES - COMPLETED UNCOVERING THE 340 FEEDER CABLE FROM FILMORE TO PUMP STATION # 4 EAST BANK FLOODSIDE - (RAINED OUT)

ACCENT CONSTRUCTION: REPAIRING PROTECTED SIDE MONOLITHS FILMORE / SIPHONS WEST BANK (RAINED OUT)

BARNES ELECTRIC: INSTALLING CLAMPS FOR FEEDER # 340 ON 11 MONOLITHS FILMORE / PS4 EAST FLOODSIDE (RAIN OUT)

M&H PAINTING: DID NOT WORK TODAY

CONTRACTOR/SUBCONTRACTORS AND
 AREAS OF RESPONSIBILITY

NO	TRADE	HOURS	COMPANY	LOCATION/WORK DESCRIPTION
11	Unskilled	55	B+K Const.	(SEE ABOVE)
9	Skilled	45	"	
1	Supt.	5	"	
	Ge. Rep.		"	
3	SKILLED	15	ACCENT CONST.	
2	UNSKILLED	10	"	
3	SKILLED	15	BARNES ELECT.	

EQUIPMENT

DESCRIPTION	ARR/DEP	SAFETY CHECK	HRS USED	IDLE	REPAIR
Komatsu 200 Excavator 1	—	YES	2	6	—
Komatsu D37P Dozer	—	NO	0	8	—
BUDCAT Excavator	—	YES	5	3	—
Case 580 Backhoe	—	YES	5	3	—
MKT Vibro Hammer	—	YES	5	3	—
Fiat-Allis MotorGrader	—	—	—	—	—
Mantis 3612 Crane	—	YES	5	3	—
KOMATSU EXC. 200 #2	—	YES	2	6	—
Case 580 BACKHOE #2	—	—	—	—	—
WELDING MACHINE	—	YES	5	3	—
KOEHRLING 405 CRANE	—	YES	5	3	—

MATERIALS RECEIVED

NO MATERIALS RECEIVED — MAILED OFF 60 PCS OF EXISTING MP 112 SHEET PILING

TESTS PERFORMED

(As required by plans/specifications)

DELTA TESTING MONITORED SHEET PILE PULLING OPERATION FOR EXCESSIVE VIBRATIONS

QUALITY CONTROL REPORT
INSPECTIONS PERFORMED

INSPECTED THE EXPOSED FEEDER CABLE AND THERE WAS NO EVIDENCE OF IT BEING DAMAGED BY THE EXCAVATION CREW

INSPECTED THE FINISHING WORK DONE AT ROBERT LEE / SIPHONS WEST FLOODSIDE - THE 4' FORM LINE IS BEING FLOATED OUT AND ALL THE HOLES ARE BEING PATCHED

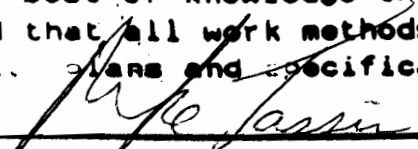
WORK BEING DONE TO THE FORMS AT THE SIPHON PIPES IS SLOW - EVERYTHING THAT HAS BEEN INSTALLED IS ON LINE AND GRADE AND THE FRACTURED FIN PANELS ARE BEING MODIFIED TO FIT THE SIPHON PIPES

JOB SAFETY.

CAUTIONED THE CREW EXPOSING THE 390 FEEDER CABLE NOT TO CONTACT THE CABLE WITH THE EXCAVATOR - ALL FINISH WORK SHOULD BE DONE BY HAND SHOVEL TO AVOID BREAKING THE CABLE

REMARKS

I certify to the best of knowledge that this report is complete and correct; and that all work methods, materials and equipment are in compliance with plans and specifications except as noted.


Authorized Q C Representative

7/25/96
Date

**INSPECTORS QUALITY ASSURANCE REPORT (QAR)
DAILY LOG OF CONSTRUCTION - CIVIL**
(ER 415-1-302)

THE QCR WILL BE ATTACHED TO OR FILED WITH THE QAR

REPORT NUMBER
387

TO Area Engineer, COPY TO: C/Const. Div.
CELMN-CD-NO CELMN-CD

DATE Sat, Sun, Mon, & Tue
20, 21, 22, 23, Jun-96

PROJECT Lake Pontchartrain, La. and Vicinity, London Ave. Canal,
Mirabeau Ave. to Leon C. Simon Blvd., Orleans Parish, Louisiana.

CONTRACT NUMBER
DACW29-94-C-0079

CONTRACTOR (Or hired labor) B & K Construction Company, Inc.
1905 Highway 59, Nannenville, La. 70448

WEATHER
Clear and Hot

PORTION OF SCHEDULED DAY SUITABLE FOR OPERATIONS

STRUCTURAL EXCAVATION	BORROW EXCAVATION	EMBANKMENT	CONCRETE	STRUCTURE
100 %	100 %	100 %	100 %	100 %

TEMPERATURE

MINIMUM	MAXIMUM
74	96

HAS ANYTHING DEVELOPED ON THE WORK WHICH MIGHT LEAD TO A CHANGE ORDER OR FINDING OF FACT? NO YES (Explain)

24 HOUR PRECIPITATION
INCHES 0.00 ENDING 1530p M

NUMBER OF GOVERNMENT EMPLOYEES

SUPERVISORY	OFFICE	LAYOUT	INSPECTION	TOTAL	LABOR
	1-1		1-8	2-9	

Canal RIVER STAGE
FEET 1.7 TIME 900a M

NUMBER OF CONTRACTOR'S EMPLOYEES

SUPERVISORY	SKILLED	LABORERS	TOTAL
1-8.5	16-131	14-113	31-252

NUMBER OF SHIFTS

1 2 3
FROM 0700a TO 1630p FROM TO FROM TO
M M M M M M

Attach list of the following: (a) Major items of equipment either idle or working, and (b) Number and classification of contractor personnel onsite.
Note: If the contractor's Quality Control Report (QCR) contains the information it need not be repeated

CONTRACTOR/SUBCONTRACTORS AND AREA OF RESPONSIBILITY FOR WORK PERFORMED TODAY

- a. B & K Const. Co., Inc. -
- b. Accent Const. Inc.,
- c. Walters Barnes Electrical
H&H Con Const. Inc.,

WORK PERFORMED TODAY (Indicate location and description of work performed. Refer to work performed by prime and/or subcontractors buy letter in Table above)

- a. Floodwall
- b. Painting
- c. Electrical
- d. finishing

Days of no work and reasons for same:

100% days lost-0
50% days lost-0 Jun 7,12,13,14,15,21,27,28,29-Jul,8,14,15,17-1996

Information on progress of work, causes for delays and extent of delays, Plant, material, etc.

Progressive work completed on this date.

DATE SET FOR COMPLETION: 06-AUG-1996

PERCENT PROJECT COMPLETE: 85.50
PERCENT TIME ELAPSED: 87.75

QCR INSPECTION PHASES ATTENDED AND INSTRUCTIONS GIVEN:

- Floodwall- No instruction given.
- Painting- No work performed.
- Finishing- No instruction given.
- Electrical- No instruction given.

RESULTS OF QA INSPECTIONS AND TESTS, DEFICIENCIES OBSERVED, ACTIONS TAKEN AND CORRECTIVE ACTION OF CONTRACTOR INCLUDE COMMENT PERTAINING TO CONTRACTORS QCC ACTIVITIES

- Floodwall- Contractor continues to reconstruct formwork to accomodate the siphon pipe at the pumping station # 4.. Sheetpile removal continues on the East side to Filmore progressing approximately about 90 to 120 ft: perday.
- Finishing- Wall repair continues from Pumpstation station on the F/S toward Robert E. Lee next to siphon pipe and from the Siphon on the West side on both the F/S and P/S .
- Electrical- Sub-Contractor assisting in the excavation of the 340 feeder making necessary observation to ensure that the cable is not cut or damaged during this portion of work.
- Painting- Contractor completed the Eastside from Filmore to P/S #4 with first coat of cementous finsish and has only completed only one Mono at Filmore with paint stating that he would not paint the floodside until the Floodside had been leveled.

VERBAL INSTRUCTIONS GIVEN TO CONTRACTOR (Include names, reactions and remarks)

None

CONTROVERSIAL MATTERS IN DETAIL.

None

INFORMATION, INSTRUCTIONS OR ACTIONS TAKEN NOT COVERED IN QCR REPORT OR DISAGREEMENTS.

None

Contractor's Quality Control Report (submitted/not submitted) for this (date/period).

REMARKS (Include visitors to project and miscellaneous remarks pertinent to work)

NAMES	GOVERNMENT PERSONNEL ON SITE		
	DESIGNATION	HRS. ON SITE	DUTIES
H.Lemoine	QAR REP	8	QA Insp.
C.Wagner	P.E.	1	

SAFETY (Include any infractions of approved safety plan, safety manual or instructions from Government personnel Specify corrective action taken.)

Instructed the site foreman that all sub-contractors were to maintain all safety regulations as that of his employer and that at no time were they to deviate from his safety plan. Contractor acknowledge by reminding all Subs of their obligation.

INSPECTOR'S SIGNATURE

DATE

SUPERVISOR'S INITIALS

DATE

H. Lemoine

7/24/96

YWS

7/29/96

QUALITY ASSURANCE REPORT SUPPLEMENT

QA Inspections Performed & Results: Inspected Painted I-wells
between Filmora & Pump STA. No. 4 on east
side of canal. Some were O.K but some
needed to be repaired since they were
inconsistent non-uniform & lacking paint in
certain areas. Some also were splashed with
mud & repainted over the mud. Also
observed the pulling of existing sheet piling
between P.S. #4 & Filmora on west side.
Some difficulty observed when pulling due to
cheats being welded when they were cut to
el. 6.5'

Instructions to CQC/Remarks: None given.

Chris J. Wagner Proj Engr
 Name Title

QUALITY CONTROL REPORT
 DACW29-94-C-0079
 LONDON AVENUE OUTFALL CANAL
 B & K CONSTRUCTION JOB NO. 9402

DATE: 7 12 31 96

REPORT NO.: 475

SKIES: CLEAR

RAIN: 0 IN. TEMP.: 73 MIN 95 MAX

DUST: MINIMAL

LEEVE CONDITION: DRY CANAL GAUGE: (1.0) NOISE: MODERATE

WORK PERFORMED/LOCATION

B&K CONSTRUCTION: PULLED EXISTING SHEET PILING FROM STATION 94+80 TO 94+20 WEST-FILMORE / SIPHONS - LOADED AND HAULED 600'S OF PULLED SHEETS - CONTINUED WORK ON MODIFICATIONS TO T WALL FORMS AT THE SIPHON PIPES - ASSISTED BARNES ELECTRIC IN EXPOSING THE #340 FEEDER CABLE FROM THE FILMORE BRIDGE TO PUMP STA #4 EAST BANK FLOODSIDE

ACCENT CONSTRUCTION: REPAIRING PROTECTED SIDE MONOLITHS FILMORE / SIPHONS WEST BANK

BARNES ELECTRIC: REPLACED STAINLESS STEEL STUDBS IN THE #4 MONOLITH MURRAY / FILMORE EAST THAT WERE INSTALLED 9" TOO LOW - WORKED WITH B&K TO EXPOSE FEEDER #340 FILMORE / PS 4 EAST FLOODSIDE

M&H PAINTING - ELECTED NOT TO PAINT UNTIL FURTHER DRESS UP WORK COULD BE DONE TO FILMORE / PS 4 EAST FLOODSIDE AND TILL THE COMPLETE REACH ROBERT E. LEE / SIPHONS WEST

CONTRACTOR/SUBCONTRACTORS AND
 AREAS OF RESPONSIBILITY

NO	TRADE	HOURS	COMPANY	LOCATION/WORK DESCRIPTION
11	Unskilled	92	B+K Const.	(SEE ABOVE)
9	Skilled	80	"	
1	Supt.	8 1/2	"	
	Q.C. Rep.		"	
3	SKILLED	24	ACCENT CONST.	
2	UNSKILLED	16	"	
3	SKILLED	24	BARNES ELECT.	
1	SKILLED	3	M&H PAINT	
1	UNSKILLED	3		

EQUIPMENT

DESCRIPTION	ARR/DEP	SAFETY CHECK	HRS USED	IDLE	REPAIR
Komatsu 200 Excavator 1	—	YES	2	6	—
Komatsu D37P Dozer	—	YES	1	7	—
Bobcat Excavator	—	YES	8	0	—
Case 580 Backhoe	—	YES	4	4	—
MKT Vibro Hammer	—	YES	8	0	—
Fiat-Allis MotorGrader	—	—	—	—	—
Mantis 3612 Crane	—	YES	2	6	—
KOMATSU EXC. 200 #2	—	YES	1	7	—
Case 580 BACKHOE #2	—	—	—	—	—
WELDING MACHINE	—	YES	8	0	—
KOEHRLING 405 CRANE	—	YES	8	0	—

MATERIALS RECEIVED

NO MATERIALS RECEIVED — 60 Pcs HALLED OFF
OF EXISTING MP 112 SHEET PILING

TESTS PERFORMED

(As required by plans/specifications)

DELTA TESTING MONITORED SHEET PILE PULLING OPERATION
FOR EXCESSIVE VIBRATIONS

QUALITY CONTROL REPORT
INSPECTIONS PERFORMED

INSPECTED THE EXPOSING OF FEEDER # 340
FILMORE JPS 9 EAST FLOORSIDE - THE BOBCAT EXCAVATOR
WAS BEING USED TO REMOVE THE BULK OF THE MATERIAL
AND A LABORER WITH A SHOVEL WAS USED TO CAREFULLY
EXPOSE THE CABLE - A STRAP WAS THEN USED TO
LIFT THE CABLE OUT OF THE TRENCH AND PLACE IT
ADJACENT TO THE NEW I WALL - EXTREME CARE WAS
EXERCISED WHEN IN THE VICINITY OF A SPLICE -

MET WITH HAZARD ELECTRIC AND CLAYTON PERKINS OF THE
SEWB ABOUT THE 422 FEEDER - EVERYONE AGREED ON
THE ANGLE AND POSITION THAT WAS USED IN CROSSING THE
I WALL

JOB SAFETY.

CAUTIONED WORKERS LOADING THE SHEET PILINGs TO
WATCH OUT FOR EACH OTHER WHEN THE BUNDLES ARE
BEING FLOWN FROM THE GROUND TO THE TOWER - ALSO TO
WEAR GLOVES WHEN HANDLING THE CABLES - TOLD THE
OPERATOR NOT TO FLY ANY LOADS OVER ANYONE

REMARKS

I certify to the best of knowledge that this report is complete
and correct; and that all work methods, materials and equipment are
in compliance with plans and specifications except as noted.


Authorized Q C Representative

2/24/96
Date

QUALITY CONTROL REPORT
 DACW29-94-C-0079
 LONDON AVENUE OUTFALL CANAL
 B & K CONSTRUCTION JOB NO. 9402

DATE: 7/22/96

REPORT NO.: 474

SKIES: CLEAR

RAIN: 0

IN. TEMP.: 74 MIN 95 MAX

DUST: NONE LEVEE CONDITION: DRY CANAL GAUGE: (1.2) NOISE: MODERATE

WORK PERFORMED/LOCATION

B&K CONSTRUCTION: PULLED EXISTING SHEET PILING FROM STATION 96+00 TO 94+80 WEST FILMORE / SIPHONS (120') CONTINUED WORK ON MODIFICATION OF I WALL FORMS TO FIT AROUND THE SIPHON PIPES. CLEANED FLOODSIDE WESTBANK ROBERTELLE / PS. 4 SIPHONS FOR PAINTER ACCESS

ACCENT CONSTRUCTION: REPAIRING PROTECTED SIDE MONOLITHS FILMORE / SIPHONS WEST

BARNES ELECTRIC: STARTED EXPOSING FEEDER # 340 FROM THE FILMORE BUNGE TOWARD PUMP STA. # 4 ON THE EAST BANK FLOODSIDE

H&H PAINT - COMPLETED PROTECTED SIDE MONOLITHS FILMORE TO PS 4 EAST BANK - FLOODSIDE HAS (D) COMPLETE - THE REMAINING WALLS WILL BE COATED AFTER B&K DRESSES UP THE FLOODSIDE FOR ACCESS

CONTRACTOR/SUBCONTRACTORS AND
 AREAS OF RESPONSIBILITY

NO	TRADE	HOURS	COMPANY	LOCATION/WORK DESCRIPTION
11	Unskilled	88	B+K Const.	(SEE ABOVE)
9	Skilled	72	"	
1	Supt.	8 1/2	"	
	Q.C. Rep.		"	
3	SKILLED	24	ACCENT CONST.	
2	UNSKILLED	16	"	
3	SKILLED	24	BARNES ELEC	
1	SKILLED	8	H&H PAINT	
1	UNSKILLED	8	"	

EQUIPMENT

DESCRIPTION	ARR/DEP	SAFETY CHECK	HRS USED	IDLE	REPAIR
Komatsu 200 Excavator 1	—	YES	4	4	—
Komatsu D37P Dozer	—	YES	3	5	YES
BOBCAT excavator	—	YES	8	0	—
Case 580 Backhoe	—	YES	8	0	—
MKT Vibro Hammer	—	YES	8	0	—
Fiat-Allis MotorGrader	DEP	YES	1	7	—
Mantis 3612 Crane	—	YES	8	0	—
KOMATSU EXC. 200 #2	—	YES	2	6	—
Case 580 BACKHOE #2	—	—	—	—	—
WELDING MACHINE	—	YES	8	0	—
KOEHRING 405 CRANE	—	YES	8	0	—

MATERIALS RECEIVED

NO MATERIALS RECEIVED TODAY

TESTS PERFORMED

(As required by plans/specifications)

DELTA TESTING MONITORED SHEET PILE PULLING OPERATION FOR EXCESSIVE VIBRATION

QUALITY CONTROL REPORT
INSPECTIONS PERFORMED

INSPECTED COATED I WALLS FROM FILMORE TO PUMP STA #4
EAST SIDE PROTECTED SIDE - ALL FINISHED MONOLITHS
ARE COATED EVENLY BUT THERE ARE ABOUT (10) MONOS
THAT ARE SPLASHED WITH MUD THAT NEEDS TO BE
REMOVED AND THE WALLS WILL HAVE TO BE RECOATED

INSPECTED FORM MODIFICATION WORK BEING DONE AT
THE SIPHONS - THE HAUNCH PORTION OF THE FORMS
HAS BEEN SET AND THE MODIFICATIONS MADE FOR THE
422' FEEDER CABLE'S PASSAGE THROUGH THE WALL -
NO TOP SECTIONS OF THE FORM HAVE BEEN MODIFIED AS YET
TO FIT AROUND THE SIPHON PIPES

JOB SAFETY.

SPOKE WITH ALL CREWS AND WARNED EVERYONE NOT
TO TAMPER WITH THE WATER COOLERS - THERE WAS
ONE INSTANCE WHERE A WORKER REMOVED THE TOP OF
A WATER COOLER TO SCOOP OUT SOME ICE WITH HIS CUP - THIS
WILL NOT BE TOLERATED

REMARKS

I certify to the best of knowledge that this report is complete
and correct; and that all work methods, materials and equipment are
in accordance with plans and specifications except as noted


Authorized Q C Representative

7/23/96
Date

**INSPECTORS QUALITY ASSURANCE REPORT (QAR)
DAILY LOG OF CONSTRUCTION - CIVIL**
(ER 415-1-302)

THE OCR WILL BE ATTACHED TO OR FILED WITH THE QAR

REPORT NUMBER
386

COPY TO: C/Const. Div.
CELMN-CD

DATE Friday
19-Jul-96

PROJECT Lake Pontchartrain, La. and Vicinity, London Ave. Canal,
Mirabeau Ave. to Leon C. Simon Blvd., Orleans Parish, Louisiana.

CONTRACT NUMBER
DACW29-94-C-0079

CONTRACTOR (Or hired labor) B & K Construction Company, Inc.
1905 Highway 59, Mandeville, La. 70448

WEATHER
P/C & Hot

PORTION OF SCHEDULED DAY SUITABLE FOR OPERATIONS

TEMPERATURE

STRUCTURAL EXCAVATION 100 %	BORROW EXCAVATION 100 %	EMBANKMENT 100 %	CONCRETE 100 %	STRUCTURE 100 %
--------------------------------	----------------------------	---------------------	-------------------	--------------------

MINIMUM 74	MAXIMUM 96
---------------	---------------

HAS ANYTHING DEVELOPED ON THE WORK WHICH MIGHT LEAD TO A CHANGE ORDER OR FINDING OF FACT? NO YES (Explain)

24 HOUR PRECIPITATION
INCHES 0.00
ENDING 1530p M

NUMBER OF GOVERNMENT EMPLOYEES

Canal RIVER STAGE

SUPERVISORY	OFFICE	LAYOUT	INSPECTION 1-8	TOTAL 1-8	LABOR
-------------	--------	--------	-------------------	--------------	-------

FEET 1.7	TIME 1000a M
-------------	--------------------

NUMBER OF CONTRACTOR'S EMPLOYEES

NUMBER OF SHIFTS 1 2 3

SUPERVISORY 1=7	SKILLED 21-168	LABORERS 12-86	TOTAL 44-249	FROM 0700aM	TO 1630pM	FROM M	TO M	FROM M	TO M
--------------------	-------------------	-------------------	-----------------	----------------	--------------	-----------	---------	-----------	---------

Attach list of the following: (a) Major items of equipment either idle or working, and (b) Number and classification of contractor personnel onsite.
Note: If the contractor's Quality Control Report (QCR) contains the information it need not be repeated.

CONTRACTOR/SUBCONTRACTORS AND AREA OF RESPONSIBILITY FOR WORK PERFORMED TODAY

- a. B & K Const. Co., Inc. -
- b. Accent Const. Co., Inc.,
- c. H&H Const Co.Inc.,
- Walter Barnes Electrical.

WORK PERFORMED TODAY (Indicate location and description of work performed. Refer to work performed by prime and/or subcontractors buy letter in Table above)

- a. Floodwall
- b. Refinishing
- c. Painting
- d. Electrical

Days of no work and reasons for same:

100% days lost-0
50% days lost-Jun7,12,13,14,15,21,27,28,29 Jul,8,14,15,17,-1996

Information on progress of work, causes for delays and extent of delays, Plant, material, etc.

Progressive performed on this date.

DATE SET FOR COMPLETION: 06-Aug-1996

PERCENT PROJECT COMPLETE: 85.50
PERCENT TIME ELAPSED: 85.75

CQC INSPECTION PHASES ATTENDED AND INSTRUCTIONS GIVEN:

- Floodwall- No instruction given.
- Finishing- No instruction given.
- Painting- No instruction given.
- Electrical- No instruction given.

RESULTS OF QA INSPECTIONS AND TESTS, DEFICIENCIES OBSERVED, ACTIONS TAKEN AND CORRECTIVE ACTION OF CONTRACTOR INCLUDE COMMENT PERTAINING TO CONTRACTORS QCC ACTIVITIES

Floodwall- Contractor continues to reconstruct forms to accomadate the siphon pipes at the pumping station #4. Forms have to be completely dismantled to allow for the pipes placement. Sheet pile extraction continues on the Westside P/S toward Filmore progressing about 50 to 60ft. per day. Completed all but one of the tie-in collar at Mirabeau on the West side of bridge. Concrete placement has not yet been scheduled.

Painting- Contractor applying the 1st coat of cementious finish on the F/S ,East bank between P/S #4 to Filmore should be completed before end of day.

Finishing- Floodwall repair continues on the Westside from P/S#4 on both the protected side and floodsidetoward Filmore.

Electrical- Contractor has completed hanging the feeder cable from Mirabeau to Filmore. Electrical contractor is awaiting feeder cable to be excavated from Filmore topumping station. Also has to wait for wall to be painted.

VERBAL INSTRUCTIONS GIVEN TO CONTRACTOR (include names, reactions and remarks)

None

CONTROVERSIAL MATTERS IN DETAIL.

None

INFORMATION, INSTRUCTIONS OR ACTIONS TAKEN NOT COVERED IN QCR REPORT OR DISAGREEMENTS.

None

Contractor's Quality Control Report (submitted/not submitted) for this (date/period).

REMARKS (include visitors to project and miscellaneous remarks pertinent to work)

NAMES	GOVERNMENT PERSONNEL ON SITE		
	DESIGNATION	HRS. ON SITE	DUTIES
H.Lemoine	QAR REP	8	QA Insp.

SAFETY (include any infractions of approved safety plan, safety manual or instructions from Government personnel Specify corrective action taken.)

Visual site inspection of workers and equipment to determine if a safe working environment was being provided during all phases of work. Compliance was met in these areas. Reminded contractor personnel take extra precautions during excessive heat, to also drink plenty fluids while working.

INSPECTOR'S SIGNATURE <i>Howard J. Lemoine</i>	DATE <i>7/23/96</i>	SUPERVISOR'S INITIALS <i>gw</i>	DATE <i>7/29/96</i>
---	------------------------	------------------------------------	------------------------

QUALITY CONTROL REPORT
 DACW29-94-C-0079
 LONDON AVENUE OUTFALL CANAL
 B & K CONSTRUCTION JOB NO. 9402

DATE: 7/19/96

REPORT NO.: 473

SKIES: CLEAR

RAIN: 0

IN. TEMP.: 74 MIN 95 MAX

DUST: NONE

LEVEE CONDITION: DRY CANAL GAUGE: (1.6) NOISE: MODERATE

WORK PERFORMED/LOCATION

B&K CONSTRUCTION: PULLED EXISTING SHEET PILING FROM STATION 96+90 TO 96+00 WEST FILMORE / SIPHONS 90' - CONTINUED WORK ON MODIFICATION OF I WALL FORMS TO FIT AROUND THE SIPHON PIPES - COMPLETED WELDING OF THE 422 FEEDER CABLE CASING - BACKFILLED FOR SECOND LIFT ROBERTELLE / LEON C. SIMON EAST BANK FLOODSIDE

ACCENT CONSTRUCTION: REPAIRING PROTECTED SIDE MONOLITHS FILMORE / SIPHONS WEST

BARNES ELECTRIC - COMPLETED INSTALLATION OF FEEDER 340 FROM MIRABEAU TO FILMORE ON THE EAST BANK FLOODSIDE EXCEPT FOR AT THE (2) TIE IN COLLARS

HEH PAINTING - COMPLETED BASE COAT APPLICATION FROM FILMORE TO PUMP STA 4 EAST BANK BOTH SIDES OF THE WALL

CONTRACTOR/SUBCONTRACTORS AND
 AREAS OF RESPONSIBILITY

NO	TRADE	HOURS	COMPANY	LOCATION/WORK DESCRIPTION
11	Unskilled	27	B+K Const.	(SEE ABOVE)
13	Skilled	91	"	
1	Supt.	7	"	
	Q.C. Rep.		"	
3	SKILLED	24	ACCENT CONST	
2	SKILLED	16	"	
3	SKILLED	24	BARNES ELEC	
1	SKILLED	8	HEH PAINTING	
1	UNSKILLED	8	"	

EQUIPMENT

DESCRIPTION	ARR/DEP	SAFETY CHECK	HRS USED	IDLE	REPAIR
Komatsu 200 Excavator 1	—	YES	4	4	—
Komatsu D37P Dozer	—	YES	4	4	BROKE DOWN
BOBCAT Excavator	—	YES	8	0	—
Case 580 Backhoe #1	—	—	—	—	—
MKT Vibro Hammer	—	YES	8	0	—
Fiat-Allis MotorGrader	—	YES	4	4	—
Mantis 3612 Crane	—	YES	8	0	—
KOMATSU EXC. 200 #2	—	YES	3	5	—
Case 580 BACKHOE #2	—	YES	8	0	—
WELDING MACHINE	—	YES	7	1	—
KOEHRING 405 CRANE	—	YES	7	1	—

MATERIALS RECEIVED

NO MATERIALS RECEIVED TODAY

TESTS PERFORMED

(As required by plans/specifications)

DELTA TESTING MONITORED SHEET PILE PULLING OPERATION FOR EXCESSIVE VIBRATIONS

QUALITY CONTROL REPORT
INSPECTIONS PERFORMED

INSPECTED ALL MONOLITHS FROM FILMORE TO PUMP STA # 4 AND ALL MONOLITHS ARE OK TO APPLY FINISH COAT TO THEM

INSPECTED THE WELDS ON THE CASING FOR THE 422 FEEDER LINE AND FOUND IT TO BE COMPLETE ALSO THE WELDS WERE COATED WITH COAL TAR EPOXY

MOBILIZED EQUIPMENT FOR UNCOVERING FEEDER # 390 FROM FILMORE TO PS 4 EAST FLOODSIDE - THE CABLE IS SEMI EXPOSED THROUGHOUT THIS REACH AND NEEDS TO BE UNCOVERED SO THAT IT CAN BE LIFTED ON TO THE WALL

JOB SAFETY.

CAUTIONED THE WALL CREW WORKING AT THE SIPHON PIPES TO BE CAREFULL WHEN TAKING THE FORMS APART AND REWORKING THEM TO DIFFERENT CONFIGURATIONS BECAUSE SOME LOOSE PIECES MAY FALL OFF WHILE THEY ARE BEING FLOWN BY THE CRANE.

REMARKS

I certify to the best of knowledge that this report is complete and correct; and that all work methods, materials and equipment are in compliance with plans and specifications except as noted.


Authorized Q C Representative

7/22/96
Date

**INSPECTORS QUALITY ASSURANCE REPORT (QAR)
DAILY LOG OF CONSTRUCTION - CIVIL**
(ER 415-1-302)

THE QCR WILL BE ATTACHED TO OR FILED WITH THE QAR

REPORT NUMBER

385

TO Area Engineer,
CELMN-CD-NO

COPY TO: C/Const. Div.
CELMN-CD

DATE Thursday
18-Jul-1996

PROJECT Lake Pontchartrain, La. and Vicinity, London Ave. Canal,
Mirabeau Ave. to Leon C. Simon Blvd., Orleans Parish, Louisiana.

CONTRACT NUMBER
DACW29-94-0079

CONTRACTOR (Or hired labor) B & K Construction Company, Inc.
1905 Highway 59, Mandeville, La. 70448

WEATHER
P/C Hot

PORTION OF SCHEDULED DAY SUITABLE FOR OPERATIONS

TEMPERATURE

STRUCTURAL EXCAVATION	BORROW EXCAVATION	EMBANKMENT	CONCRETE	STRUCTURE
100 %	100 %	100 %	100 %	100 %

MINIMUM	MAXIMUM
74	95

HAS ANYTHING DEVELOPED ON THE WORK WHICH MIGHT LEAD TO A CHANGE ORDER OR FINDING OF FACT? NO YES (Explain)

24 HOUR PRECIPITATION

INCHES	ENDING
	M

NUMBER OF GOVERNMENT EMPLOYEES

Canal RIVER STAGE

SUPERVISORY	OFFICE	LAYOUT	INSPECTION	TOTAL	LABOR
			1-8	1-8	

FEET	TIME
1.6	900a
	M

NUMBER OF CONTRACTOR'S EMPLOYEES

NUMBER OF SHIFTS

1 2 3

SUPERVISORY	SKILLED	LABORERS	TOTAL	FROM	TO	FROM	TO	FROM	TO
1-9	20173	21-182	41-355	0700a	1630p				
				M	M	M	M	M	M

Attach list of the following: (a) Major items of equipment either idle or working, and (b) Number and classification of contractor personnel onsite. Note: If the contractor's Quality Control Report (QCR) contains the information it need not be repeated.

CONTRACTOR/SUBCONTRACTORS AND AREA OF RESPONSIBILITY FOR WORK PERFORMED TODAY

- a. B & K Const. Co., Inc. - e. Arcadia Re-Steel
- b. Accent Const. Co. Inc.,
- c. H&H Const. Co. Inc.,

Walter Barnes Electrical Cont. Inc.,

WORK PERFORMED TODAY (Indicate location and description of work performed. Refer to work performed by prime and/or subcontractors by letter in Table above.)

- a. Floodwall
- b. Refinishing
- c. Painting
- d. Electrical
- e. Re-Bar

Days of no work and reasons for same.

100% days lost-0
50% Days lost-Jun-7,12,13,14,15,21,27,28,29-Jul8,13,14,15,17-1996

Information on progress of work, causes for delays and extent of delays. Plant, material, etc.

Progressive work performed on this date.

PERCENT PROJECT COMPLETE: 85.50
PERCENT TIME ELAPSED: 87.75

DATE SET FOR COMPLETION: 06-Aug-96

QCR INSPECTION PHASES ATTENDED AND INSTRUCTIONS GIVEN:

- Floodwall- No instruction given.
- Refinishing- No instruction given.
- Painting - No work performed.
- Electrical - No instruction given.
- Re-Steel - No work performed.

RESULTS OF QA INSPECTIONS AND TESTS, DEFICIENCIES OBSERVED, ACTIONS TAKEN AND CORRECTIVE ACTION OF CONTRACTOR INCLUDE COMMENT PERTAINING TO CONTRACTORS QCC ACTIVITIES

Floodwall- Contractor reconstructing forms to accomadate placement at the siphon pipes at P/S #4. Sheet pile extraction continues from the P.I.'S toward Filmore progressing approximately 50ft. per day.
 Refinishing- Contractor making repairs to floodside wall from the P/S #4 to Filmore .
 Electrical-Feeder attachment continues on the floodside on Eastbank of canal. at station 85+00 .

VERBAL INSTRUCTIONS GIVEN TO CONTRACTOR (include names, reactions and remarks)

None

CONTROVERSIAL MATTERS IN DETAIL:

None

INFORMATION, INSTRUCTIONS OR ACTIONS TAKEN NOT COVERED IN QCR REPORT OR DISAGREEMENTS:

None

Contractor's Quality Control Report (submitted/not submitted) for this (date/period).

REMARKS (include visitors to project and miscellaneous remarks pertinent to work)

NAMES	GOVERNMENT PERSONNEL ON SITE		
	DESIGNATION	HRS. ON SITE	DUTIES
H.Lemoine	QAR Rep.	8	QA Insp.

SAFETY (include any infractions of approved safety plan, safety manual or instructions from Government personnel Specify corrective action taken.)

Observed contractor during the loading and offloading of 350 CASE dozer to ensure that all traffic barrels were in safe distance of loading area and that all dirt and debris were cleaned up after equipment was moved. Compliance was met.

INSPECTOR'S SIGNATURE

DATE

SUPERVISOR'S INITIALS

DATE

H. Lemoine

7/18/96

YL

7/30
7/25/96

QUALITY CONTROL REPORT
 DACW29-94-C-0079
 LONDON AVENUE OUTFALL CANAL
 B & K CONSTRUCTION JOB NO. 9402

DATE: 7/18/96

REPORT NO.: 472

SKIES: CLEAR

RAIN: 1/4

IN. TEMP.: 73 MIN 95 MAX

DUST: NONE

LEEVE CONDITION: WET CANAL GAUGE: (1.9) NOISE: MODERATE

WORK PERFORMED/LOCATION

B&K CONSTRUCTION - WRECKED FORMS FROM I WALL MONOLITH # 107 - STARTED DISASSEMBLY OF FORMS FOR SIPHONS MODIFICATION - COORDINATED WITH HAZARD ELECTRIC FOR FEEDER 422 PASSAGE THROUGH THE SIPHON MONO - INSTALLED THE GALV. CASING THROUGH THE SHEET PILING FOR FEEDER 422 - PULLED 135' OF EXISTING SHEET PILING FROM STA 98+25 TO 96+90 -

ACCENT CONST. - REPAIRING PROTECTED SIDE MONOLITHS FILMORE / SIPHONS WEST

BARNES ELECTRIC - INSTALLING FEEDER 340 MIRABEAU / FILMORE EAST

HEH PAINTING - APPLIED BASE COAT

CONTRACTOR/SUBCONTRACTORS AND
 AREAS OF RESPONSIBILITY
 COMPANY

NO	TRADE	HOURS	COMPANY	LOCATION/WORK DESCRIPTION
11	UNSKILLED	99	B&K Const.	(SEE ABOVE)
13	SKILLED	117	"	
1	Supt.	9	"	
	B&K		"	
3	SKILLED	24	ACCENT CONST.	
2	UNSKILLED	16	"	
3	SKILLED	24	BARNES ELECT.	
1	SKILLED	8	HEH PAINT	
1	UNSKILLED	8	"	

EQUIPMENT

DESCRIPTION	ARR/DEP	SAFETY CHECK	HRS USED	IDLE	REPAIR
Komatsu 200 Excavator 1	—	YES	4	4	—
Komatsu D5/P Dozer	—	YES	4	4	—
Kubota 141 Excavator	—	—	—	—	—
Case 580 Backhoe	—	YES	8	0	—
Koehring 535 Crane	—	—	—	—	—
MKT Vibro Hammer	—	YES	8	0	—
Fiat-All Motor Grad	—	—	—	—	—
Mantec 4012 Crane	—	YES	8	0	—
KOMATSU EXC. 200 #2	—	YES	5	3	—
Case 580 BACKHOE #2	—	—	—	—	—
WELDING MACHINE	—	YES	8	0	—
KOEHRING 535 CRANE	—	—	—	—	—
KOEHRING 405 CRANE	—	YES	8	0	—

MATERIALS RECEIVED

NO MATERIALS RECEIVED TODAY

TESTS PERFORMED

(As required by plans/specifications)

DELTA TESTING MONITORED THE SHEET PILE PULLING OPERATION FOR EXCESSIVE VIBRATION

QUALITY CONTROL REPORT
INSPECTIONS PERFORMED

INSPECTED MONOLITHS FROM ROBERT E. LEE TO THE SIPHON PIPES WEST BANK FLOODSIDE AND SOME ADDITIONAL FINISHING WORK WILL BE REQUIRED BEFORE THEY CAN BE COATED

DECIDED ON THE PROPER LOCATION ALONG WITH HAZARD ELECTRIC FOR THE SEWB FEEDER # 422 PASSING THROUGH THE SIPHON MONO - THE CASING WAS POSITIONED SO THAT IT WILL BE ABOVE THE STABILIZATION SLAB AND THE FLOODSIDE SLOPE PAVING AND ON AN ANGLE THAT WILL NOT STRESS THE FLOODSIDE SPLICE

JOB SAFETY.

WHILE WORKING ON THE SLOPE PAVING FLOODSIDE AT THE SIPHONS LIFE VESTS WERE MADE AVAILABLE FOR THOSE WORKERS WHO WISHED TO USE THEM

REMARKS

I certify to the best of knowledge that this report is complete and correct; and that all work methods, materials and equipment are in compliance with plans and specifications except as noted.


Authorized Q C Representative

7/19/96
Date

**INSPECTORS QUALITY ASSURANCE REPORT (QAR)
DAILY LOG OF CONSTRUCTION - CIVIL
(ER 415-1-302)**

THE QAR WILL BE ATTACHED TO OR FILED WITH THE QAR

REPORT NUMBER
384

TO Area Engineer, COPY TO: C/Const. Div.
CELMN-CD-NO CELMN-CD

DATE
Wednesday
17-Jul-96

PROJECT Lake Pontchartrain, La. and Vicinity, London Ave. Canal,
Mirabeau Ave. to Leon C. Simon Blvd., Orleans Parish, Louisiana.

CONTRACT NUMBER
DACW29-94-C-0079

CONTRACTOR (Or hired labor) B & K Construction Company, Inc.
1905 Highway 59, Mandeville, La. 70448

WEATHER
P/C and Showers

PORTION OF SCHEDULED DAY SUITABLE FOR OPERATIONS

STRUCTURAL EXCAVATION	BORROW EXCAVATION	EMBANKMENT	CONCRETE	STRUCTURE
50 %	50 %	50 %	50 %	50 %

TEMPERATURE

MINIMUM	MAXIMUM
74	96

HAS ANYTHING DEVELOPED ON THE WORK WHICH MIGHT LEAD TO A CHANGE ORDER OR FINDING OF FACT? NO YES (Explain)

24 HOUR PRECIPITATION

INCHES	ENDING
.50	1730p

NUMBER OF GOVERNMENT EMPLOYEES

SUPERVISORY	OFFICE	LAYOUT	INSPECTION	TOTAL	LABOR
	1-2		18	2-10	

Canal RIVER STAGE

FEET	TIME
1.8	900p

NUMBER OF CONTRACTOR'S EMPLOYEES

SUPERVISORY	SKILLED	LABORERS	TOTAL
1-8	21-187	13-120	35-308

NUMBER OF SHIFTS 1 2 3

FROM	TO	FROM	TO	FROM	TO
M	0700a	M	1630p	M	M

Attach list of the following: (a) Major items of equipment either idle or working, and (b) Number and classification of contractor personnel onsite.
Note: If the contractor's Quality Control Report (QCR) contains the information it need not be repeated.

CONTRACTOR/SUBCONTRACTORS AND AREA OF RESPONSIBILITY FOR WORK PERFORMED TODAY

- a. B & K Const. Co., Inc. -
- b. Accent Constr. Co., Inc.,
- c. H&H Const. Co., Inc.,

WORK PERFORMED TODAY (Indicate location and description of work performed. Refer to work performed by prime and/or subcontractors buy letter in Table above)

- a. Floodwall
- b. Refinishing
- c. Painting
- d. Electrical
- e. Re-Steel

Days of no work and reasons for same:

100% days lost-0
50% days lost-Jun7,12,13,14,15,21,27,28,29,-Jul 8,13,14,15,17-1996

Information on progress of work, causes for delays and extent of delays, Plant, material, etc.

Progressive performed on this date.

PERCENT PROJECT COMPLETE: 85.50
PERCENT TIME ELAPSED: 87.75

DATE SET FOR COMPLETION: 06-Aug-1996

QAR INSPECTION PHASES ATTENDED AND INSTRUCTIONS GIVEN:

Floodwall- No instruction given.
Finishing- No instruction given.
Painting - No instruction given.
Electrical-No instruction given.
Re-Steel - No work performed.

RESULTS OF QA INSPECTIONS AND TESTS, DEFICIENCIES OBSERVED, ACTIONS TAKEN AND CORRECTIVE ACTION OF CONTRACTOR INCLUDE COMMENT PERTAINING TO CONTRACTORS QCC ACTIVITIES

Flood wall- Contractor completed erection of forms for the Mono #107 and placed concrete at the Siphon of P/S #4. Sheetpile extraction continues from the P.Is on the Weside of P/S going Southward toward Filmore , with progress being rather slow due to closness of Vibratory Hammer to the Wall during removal.

Finsihing- Met the Accent Const. Sup. to discuss the repairs of wall from the P.I.'s toward Filmore. Visually indicated to the Sup. what needed to be corrected . He indicated corrections would be made

Painting- Contractor completed the 1st coat of the Cementious finish on the floodside I-Wall on East bank ,progressing only to about half the distance wall, then stopping 3 hrs for lunch.

Electrical- Continues to complete the spilce in the 340 feeder line and will continue the wall attachment on the Westside of Wsll approximatel station 84+01.

VERBAL INSTRUCTIONS GIVEN TO CONTRACTOR (include names, reactions and remarks)

None

CONTROVERSIAL MATTERS IN DETAIL.

None

INFORMATION, INSTRUCTIONS OR ACTIONS TAKEN NOT COVERED IN QCR REPORT OR DISAGREEMENTS.

None

Contractor's Quality Control Report (submitted/not submitted) for this (date/period).

REMARKS (include visitors to project and miscellaneous remarks pertinent to work)

NAMES	GOVERNMENT PERSONNEL ON SITE		
	DESIGNATION	HRS. ON SITE	DUTIES
H. Lemoine	QAR Rep	8	Insp.
C. Wagner	P.E.	2	

SAFETY (include any infractions of approved safety plan, safety manual or instructions from Government personnel Specify corrective action taken.)

During the sheetpile extraction personnel were observed to ensure safe practices and procedures were being used , and hand signals were visually coordinated with the operator.

INSPECTOR'S SIGNATURE

DATE

SUPERVISOR'S INITIALS

DATE

H. Lemoine

7/18/96

W

7/30
7/24/96

QUALITY CONTROL REPORT
 DACH29-94-C-0079
 LONDON AVENUE OUTFALL CANAL
 B & K CONSTRUCTION JOB NO. 9402

DATE: 7/17/96

REPORT NO.: 471

SKIES: CLOUDY

RAIN: 1/8

IN. TEMP.: 73 MIN 94 MAX

DUST: NONE

LEVEE CONDITION: WET CANAL GAUGE: (2.0) NOISE: MODERATE

WORK PERFORMED/LOCATION

B&K CONSTRUCTION - COMPLETED FORMING T WALL MONOLITH # 107 SET RESTEEL AND POURED SAME - PULLED EXISTING SHEET PILING FROM STATION 99+30 TO STATION 98+25 FILMORE/SIPHONS WEST - WORKED ON PATCHING BROKEN SECTIONS OF EXISTING FLOODWALL FILMORE SOUTHWEST

ACCENT CONST. - REPAIRING PROTECTED SIDE MONOLITHS FILMORE/SIPHONS WEST

BARNES ELECTRIC - INSTALLING FEEDER 340 MILABEAU/FILMORE EAST

W&H PAINTING - APPLIED BASECOAT TO 14 FLOODSIDE MONOLITHS FILMORE/P 54 EAST

CONTRACTOR/SUBCONTRACTORS AND
 AREAS OF RESPONSIBILITY
 COMPANY

NO	TRADE	HOURS	COMPANY	LOCATION/WORK DESCRIPTION
11	UNSKILLED	104	B&K Const.	(SEE ABOVE)
13	SKILLED	123	"	
1	Supt.	8	"	
	Q.C. Rep.		"	
3	SKILLED	24	ACCENT CONST.	
2	UNSKILLED	16	"	
3	SKILLED	24	BARNES ELEC.	
1	SKILLED	8	W&H PAINT	
1	SKILLED	8	"	

EQUIPMENT

DESCRIPTION	ARR/DEF	SAFETY CHECK	HRS USED	IDLE	REPAIR
Komatsu 200 Excavator 1	—	YES	8	0	—
Komatsu D5/P Dozer	—	NO	0	8	—
Kubota 141 Excavator	—	—	—	—	—
Case 580 Backhoe	—	YES	8	0	—
Koehring 535 Crane	—	—	—	—	—
MKT Vibro Hammer	—	YES	8	0	—
Fiat-Ail Motor Grader	—	NO	0	8	—
Mantec 4012 Crane	—	YES	8	0	—
KOMATSU EXC. 200 #2	—	NO	0	8	—
CASE 580 BACKHOE #2	DEF	YES	8	8	—
WELDING MACHINE	—	YES	8	0	—
KOEHRING 535 CRANE	—	—	—	—	—
KOEHRING 405 CRANE	—	YES	8	0	—

MATERIALS RECEIVED

RECEIVED 11 CY. YARDS OF MIX # 44C CONCRETE FROM LAFARGE CONCRETE

TESTS PERFORMED

(As required by plans/specifications)

MADE TEST CYLINDERS - DID SLUMP AND AIR CONTENT TESTS - MONITORED TEMPERATURE ON CONCRETE RECEIVED FROM LAFARGE

DELTA TESTING MONITORED SHEET PILE PULLING OPERATION FOR EXCESSIVE VIBRATIONS

QUALITY CONTROL REPORT
INSPECTIONS PERFORMED

INSPECTED FLOODSIDE OF THE MONOLITHS FINISHED BY ACCENT CONSTRUCTION. THERE ARE SEVERAL AREAS WHERE THEIR SCAFFOLDING BRACKETS PREVENTED PROPER FINISHING OF THE F WALL AND THEY WILL HAVE TO GO BACK AND PATCH THEM - THIS WAS WITNESSED BY DUHELAMONIE CO & INSP. ROBERT MARTIN OF ACCENT CONST, AND MIHET ASSIN (SEIT) SUPERINTENDENT

INSPECTED FORMS AND RESTEEL USED FOR F WALL MONOLITH # 107, AND EVERYTHING CHECKED OUT OK.

INSPECTED PAINTED MONOLITHS TO SEE IF THE 4' LINE THAT WAS FEATHERED OUT WAS VISABLE - THE ADDITIONAL FINISHING WORK SEEMS TO HAVE SOLVED THIS PROBLEM

JOB SAFETY.

WARNED THE WORKERS PULLING THE SHEET PILING TO WEAR HEARING PROTECTION AROUND THE POWER PACK FOR THE MIT VS VIBRO HAMMER - ALSO WARNED THIS CREW NOT TO TAKE THEIR EYES OFF THE SHEET PILES BEING STACKED UNTIL THEY ARE FLAT ON THE GROUND, BECAUSE NOT PAYING ATTENTION MAY GET SOMEONE HURT

REMARKS

I certify to the best of knowledge that this report is complete and correct; and that all work methods, materials and equipment are in compliance with plans and specifications except as noted.


Authorized QC Representative

2/18/96
Date

FORM CHECK OUT FOR STRUCTURES
 REINFORCED CONCRETE FLOODWALL

JOB *London Ave One Fall Canal*

CONTRACT NO. *00029-9420079*

MONOLITH # *WEST 107*

LIFT NO. *ONE*

ELEVATION *3.00-14.40*

DATE OF POUR *7-17-96*

ITEM	INSPECTED BY CONTRACTOR			REVIEWED BY C.O.E.		
	NAME	DATE	TIME	NAME	DATE	TIME
A. SHEET PILING	<i>P. J. T.</i>	<i>7-17-96</i>	<i>11:00</i>	<i>A. J. Tommie</i>	<i>7/17/96</i>	<i>12:00</i>
VERTICAL	✓	"	"			
ALIGNMENT	✓	"	"			
CLEANLINESS	✓	"	"	✓	✓	✓
B. CONCRETE PILING	<i>P. J. T.</i>	<i>7-17</i>	<i>11:00</i>	<i>A. J. Tommie</i>	<i>7/17/96</i>	<i>12:00</i>
ANGLE	✓	"	"			
HEADS	✓	"	"	✓	✓	✓
C. STAB. SLAB/JOINTS	<i>P. J. T.</i>	<i>7-17</i>	<i>11:00</i>	<i>A. J. Tommie</i>	<i>7/17/96</i>	<i>12:00</i>
CLEANLINESS	✓	"	"			
WATERED	✓	"	"			
WATERJET (JOINT)	✓	"	"	✓	✓	✓
D. STEEL REINFORCING	<i>P. J. T.</i>	<i>7-17</i>	<i>11:05</i>	<i>A. J. Tommie</i>	<i>7/17/96</i>	<i>12:00</i>
VERTICAL	✓	"	"			
HORIZONTAL	✓	"	"			
SPACING	✓	"	"			
CLEARANCES	✓	"	"			
STEEL SCHEDULE	✓	"	"			
SHOP DRAWINGS	✓	"	"			
TIE WIRES	✓	"	"			
#6 BAR WELDED	✓	"	"			
CLEANLINESS	✓	"	"			
WATERED	✓	"	"	✓	✓	✓
E. FORMWORK	<i>P. J. T.</i>	<i>7-17</i>	<i>11:10</i>	<i>A. J. Tommie</i>	<i>7/17/96</i>	<i>12:00</i>
CONDITION	✓	"	"	✓	✓	✓

ITEM	INSPECTED BY CONTRACTOR			REVIEWED BY C.O.E.				
	NAME	DATE	TIME	NAME	DATE	TIME		
E. FORMWORK (CONT)								
ALIGNMENT	<i>[Signature]</i>	7-17	11:10	<i>[Signature]</i>	7/17/96	1200		
CLEANLINESS	✓	"	"					
RELEASING AGENT	✓	"	"					
TIES AND BOLTS	✓	"	"					
LENGTH 18.04'	✓	"	"					
WIDTH 1.75'-1.00'	✓	"	"					
HEIGHT 11.40'	✓	"	"					
WATERSTOPS	✓	"	"					
CHAMFER STRIPS	✓	"	"					
F. WEATHER PROTECTION	<i>[Signature]</i>	7-17	11:15	<i>[Signature]</i>	7/17/96	1200		
G. SAFETY (LIST)	<i>[Signature]</i>	7-17	11:15	<i>[Signature]</i>	7/17/96	1200		
1. Ladder	✓	"	"					
2. Scaffolding	✓	"	"					
3. Rigging	✓	"	"					
H. OTHER CHECKS PER SPECIFIC JOB	<i>[Signature]</i>	7-17	11:20	<i>[Signature]</i>	7/17/96	1200		
EXP. MATERIAL	✓	"	"					
I. EQUIPMENT USED	NO.	TYPE	TIME	HOURS	NO.	TYPE	TIME	HOURS
MANTIS 3612	1	CRANE	12:56	1.75				
BUCKET	1	1.25 yrd.	"	"				
Vibrator	1	18' shaft	"	"				
GENERATOR	1	GAS	"	"				
J. REMARKS	SLUMP = 4.5" - 4.25" AIR ENTR = 5.8 - 5.0 % CONCRETE TEMPS = 87° - 86° AIR TEMPS = 93° - 93° 3 test CYLINDERS (LA-214)							
FINAL CLEARANCE								
CONTRACTOR REPRS: <i>[Signature]</i>				C.O.E. REPRS: <i>[Signature]</i> 7/17/96				
INSTRUCTIONS								
CONCRETE PLACING SHALL NOT BEGIN UNTIL EVERY ITEM IS CHECKED AND THE FINAL CLEARANCE IS SIGNED. IF ANY ITEM IS NOT APPLICABLE IT SHALL BE NOTED "NA" AND SIGNED. BEFORE APPROVING THE SAFETY REQUIREMENTS ITEM, A FINAL INSPECTION SHALL BE MADE OF ALL WORKING FACILITIES FOR CONCRETE PLACING SUCH AS SCAFFOLDS, LADDERS, PLATFORMS, ACCESS WAYS, ETC. TO ASSURE THAT THEY ARE ADEQUATE, SAFELY CONSTRUCTED AND IN READINESS. FINAL INSPECTION SUBJECT TO REVOCATION IF SUBSEQUENT INSPECTION REVEALS ANY DEFICIENCIES. IF SUMMONED BY THE CONTRACTOR TO CHECK AN ITEM AND IT IS FOUND TO BE UNSATISFACTORY, STATE IN THE REMARKS COLUMN THE TIME SUMMONED AND THE TIME REJECTED. ITEMS UNDER BLOCK "H" SHALL BE DETERMINED BY THE GOVERNMENT QUALITY ASSURANCE PERSONNEL AS THESE ITEMS APPLY TO THIS SPECIFIC CONTRACT OR STRUCTURE.								

B & K CONSTRUCTION COMPANY, INC
 LONDON AVENUE CANAL FLOODWALL PROJECT
 CONCRETE FIELD DATA SUMMARY

DATE: 7-17-96

Pour Location West I-Wall Monolith #107

Supplier - LAFARGE CONCRETE COMPANY

Type of Mix used #44-C

Required Strength 3000 P.S.I.
at 90 days

TICKET NO	TIME ARRVD	TIME CMPLTD	SLUMP/ARRVD	WATER ADDED	SLUMP AS PLCD	TEMP. CON/AIR	% AIR	CYL'S MOLDED	TIME SAMPLED	C. Y.	
343011	12:56	1:48	3.75°	5 Gal.	4.5 ^x	87°	93°	5.8	3	1:03	7
343043	2:11	2:45	3.25°	5 Gal.	4.25 ^x	86°	93°	5.0	-	2:20	4

Test Cylinder Set #LA-214

NOTE: "x" = Actual Slump Determination
 "o" = Visual Slump Determination

TECHNICIAN:
Steve Thome

**INSPECTORS QUALITY ASSURANCE REPORT (QAR)
DAILY LOG OF CONSTRUCTION - CIVIL**
(ER 415-1-302)

THE OCR WILL BE ATTACHED TO OR FILED WITH THE QAR

REPORT NUMBER
383

TO Area Engineer, COPY TO: C/Const. Div.
CELMN-CD-NO CELMN-CD

DATE
Tuesday
16-Jul-1996

PROJECT Lake Pontchartrain, La. and Vicinity, London Ave. Canal,
Mirabeau Ave. to Leon C. Simon Blvd., Orleans Parish, Louisiana.

CONTRACT NUMBER
DACW29-94-C-0079

CONTRACTOR (Or hired labor) B & K Construction Company, Inc.
1905 Highway 59, Mandeville, La. 70448

WEATHER
P/C & Hot

PORTION OF SCHEDULED DAY SUITABLE FOR OPERATIONS

TEMPERATURE

STRUCTURAL EXCAVATION	BORROW EXCAVATION	EMBANKMENT	CONCRETE	STRUCTURE
100 %	100 %	100 %	100 %	100 %

MINIMUM	MAXIMUM
74	95

HAS ANYTHING DEVELOPED ON THE WORK WHICH MIGHT LEAD TO A CHANGE ORDER OR FINDING OF FACT? NO YES (Explain)

24 HOUR PRECIPITATION	
INCHES	ENDING
0.00	1530 M

NUMBER OF GOVERNMENT EMPLOYEES

Canal RIVER STAGE

SUPERVISORY	OFFICE	LAYOUT	INSPECTION	TOTAL	LABOR
			1-8	1-8	

FEET	TIME
1.9	800a M

NUMBER OF CONTRACTOR'S EMPLOYEES

NUMBER OF SHIFTS 1 2 3

SUPERVISORY	SKILLED	LABORERS	TOTAL
1-9	20-181	17-145	38-371

FROM	TO	FROM	TO	FROM	TO
0700a M	1630p M	M	M	M	M

Attach list of the following: (a) Major items of equipment either idle or working, and (b) Number and classification of contractor personnel onsite.
Note: If the contractor's Quality Control Report (OCR) contains the information it need not be repeated.

CONTRACTOR/SUBCONTRACTORS AND AREA OF RESPONSIBILITY FOR WORK PERFORMED TODAY

- a. B & K Const. Co., Inc. -
- b. Accent construction Co., Inc.
- c. H&H Construction Co., Inc.
- , Walter Barnes Electric

WORK PERFORMED TODAY (Indicate location and description of work performed. Refer to work performed by prime and/or subcontractors by letter in Table above)

- a. Floodwall
- b. Refinishing
- c. Painting
- d. Electrical
- e. Resteel

Days of no work and reasons for same:

100% days lost-0
50% days lost- Jun, 7, 12, 13, 14, 15, 21, 27, 28, 29-Jul 8, 13, 14, 15, 1996

Information on progress of work, causes for delays and extent of delays, Plant, material, etc.

Progressive work completed on this date.

DATE SET FOR COMPLETION: 06-Aug-1996

PERCENT PROJECT COMPLETE: 85.50
PERCENT TIME ELAPSED: 87.75

QC INSPECTION PHASES ATTENDED AND INSTRUCTIONS GIVEN:

- Floodwall- No instruction given.
- Painting- No work performed.
- Refinishing- No instruction given.
- Electrical- No instruction given.
- Re-Steel - No work performed.

RESULTS OF QA INSPECTIONS AND TESTS, DEFICIENCIES OBSERVED, ACTIONS TAKEN AND CORRECTIVE ACTION OF CONTRACTOR INCLUDE COMMENT PERTAINING TO CONTRACTORS QOC ACTIVITIES

Floodwall- Contractor erecting and modifying forms for placement of Mono at P/S#4 No. 107. Sheetpile removal from the Siphon on the Eastside to filmore. Damage to the Stab. Slab was observed at Mirabeau on the P/S where piles had be previously removed for a distance of 10 Mono's. Slab was damage by placing the Vibratory hammer and removed piles on top of slab. Contractor was was advised to take more precautions and stop this practice. Contractor acknowledged and will make provision to correcte this problem.

Refinishing- Completed the Eastside F/S I-Wall and this side is ready to have the 1st coat application .Westside I-Wall at Filmore to Siphon will have to be reworked before paint and cementious coat applicatio

Electrical- Feeder line attachment to I-Wall continues and the making of of a permanent splice to the 340 line at the midway point of wall.

VERBAL INSTRUCTIONS GIVEN TO CONTRACTOR (include names, reactions and remarks)

None

CONTROVERSIAL MATTERS IN DETAIL.

None

INFORMATION, INSTRUCTIONS OR ACTIONS TAKEN NOT COVERED IN QCR REPORT OR DISAGREEMENTS:

None

Contractor's Quality Control Report (submitted/not submitted) for this (date/period).

REMARKS (include visitors to project and miscellaneous remarks pertinent to work)

NAMES	GOVERNMENT PERSONNEL ON SITE		
	DESIGNATION	HRS. ON SITE	DUTIES
H.Lemoine	QAR Rep	8	QA Insp
C.Wagner	P.E	2	

SAFETY: (include any infractions of approved safety plan, safety manual or instructions from Government personnel Specify corrective action taken.)

Visual observation of personnel to ensure that all proper safety equipment was being worn at all times during all phases of work. Compliance was met.

INSPECTOR'S SIGNATURE <i>Howard J. Lemoine</i>	DATE 7/17/96	SUPERVISOR'S INITIALS <i>yr</i>	DATE 7/23/96
---	-----------------	------------------------------------	-----------------

QUALITY ASSURANCE REPORT SUPPLEMENT

QA Inspections Performed & Results: Observed contractor setting
up to begin pulling of existing sheet piling
between Pump Sta. #4 to Filmore. Also
checked area between Mirabeau to Filmore
on west side where piles were pulled. It
appears ground underneath slab (P/S)
has settled leaving a void under the slab.
Contractor will need extra effort to compact
this area when backfilling.

Instructions to CQC/Remarks: None today.

Chris J. Wagner Proj Engr
Name Title

QUALITY CONTROL REPORT
 DAGW29-94-C-0079
 LONDON AVENUE OUTFALL CANAL
 B & K CONSTRUCTION JOB NO. 9402

DATE: 7/16/96

REPORT NO.: 470

SKIES: CLOUDY/RAIN RAIN: TRACE IN. TEMP.: 79 MIN 92 MAX

DUST: NONE LEVEE CONDITION: WET CANAL GAUGE: (1.9) NOISE: MODERATE

WORK PERFORMED/LOCATION

B&K CONSTRUCTION - WORKED ON THE FORMS FOR MONOLITH #107 SOUTH OF THE SIPHON PIPES - FEATHERED OUT THE 41 LINE ON THE FLOODSIDE FILMORE TO PS 4 EAST - STARTED PULLING EXISTING SHEET PILING FILMORE/SIPHONS AT STATION 99+60 WEST AND PULLED TO STATION 99+30 WEST

ACCENT CONST. - COMPLETED FLOODSIDE REPAIRS TO THE MONOLITHS FILMORE/SIPHONS STATION 85+59 TO STATION 100+32

ARCADIA REBAR - NO WORK TODAY
 NEW PAINTING TOO WET TO WORK

BARNES ELECTRIC - MAKING PERMANENT SPLICE TO FEEDER 340 MIRABEAU/FILMORE EAST

CONTRACTOR/SUBCONTRACTORS AND AREAS OF RESPONSIBILITY

NO	TRAUL	HOURS	COMPANY	LOCATION/WORK DESCRIPTION
11	UNSKILLED	99	B&K Const.	(SEE ABOVE)
13	SKILLED	117	"	
1	Supt.	9	"	
	Q.C. Rep.		"	
3	SKILLED	24	ACCENT CONST	
2	UNSKILLED	16	"	
4	SKILLED	40	BARNES ELECT.	
2	UNSKILLED	20	"	

EQUIPMENT

DESCRIPTION	ARR/DEF	SAFETY CHECK	HRS USED	IDLE	REPAIR
Komatsu 200 Excavator 1	—	NO	0	8	—
Komatsu D57P Dozer	—	NO	0	8	—
Kubota 141 Excavator	—	—	—	—	—
Case 580 Backhoe	—	YES	8	0	—
Koehring 535 Crane	—	—	—	—	—
MKT Vibro Hammer	—	YES	8	0	—
Fiat-Al. Motor Grad.	—	NO	0	8	—
Mantis 1012 Crane	—	YES	8	0	—
KOMATSU EXC. 200 #2	—	YES	4	4	—
CASE 580 BACKHOE #2	—	NO	0	8	—
WELDING MACHINE	—	YES	8	0	—
KOEHRING 535 CRANE	—	—	—	—	—
KOEHRING 405 CRANE	—	YES	8	0	—

MATERIALS RECEIVED

RECEIVED THE MAKE UP RESTEEL FROM LULICH STEEL

TESTS PERFORMED

(As required by plans/specifications)

NO TESTING TODAY

QUALITY CONTROL REPORT
INSPECTIONS PERFORMED

INSPECTED FLOOD SIDE OF MONOLITHS FILMORE / PS 4 EAST THAT WERE REFINISHED - THE 'H' JOINT WAS FEATHERED OUT AND ALL MONOLITHS ARE READY TO BE COATED

INSPECTED THE SPICE WORK DONE TO FEEDER 340 - THE AUTHORIZED SPlicer FROM HAZARD ELECTRIC DID THE REPAIRS - ALL WORK SEEMED TO BE DONE PROPERLY

INSPECTED FORMS THAT WERE BEING MODIFIED FOR THE SHORT MONOLITH #107 SOUTH OF THE SIPHON PIPES EASTSIDE - ALL FORMS WERE OK AND TO THE PROPER DIMENSIONS

JOB SAFETY.

CAUTIONED ALL WORKERS TO BE CAREFULL WHEN WORKING IN THESE WET CONDITIONS, TOLD ALL OPERATORS TO MAKE SURE THEIR BOOTS WERE FREE FROM ANY MUD THAT MAY CAUSE THEIR FOOT TO SLIP FROM THE PEDALS OF THE MACHINERY

REMARKS

I certify to the best of knowledge that this report is complete and correct; and that all work methods, materials and equipment are in compliance with plans and specifications except as noted.


Authorized Q C Representative

7/17/96
Date

**INSPECTOR'S QUALITY ASSURANCE REPORT (QAR)
DAILY LOG OF CONSTRUCTION - CIVIL**
(ER 415-1-302)

THE OCR WILL BE ATTACHED TO OR FILED WITH THE QAR

REPORT NUMBER
382

TO Area Engineer, COPY TO: C/Const. Div.
CELMN-CD-NO CELMN-CD

DATE Sat, Sun & Mon
13, 14, 15 Jul 96

PROJECT Lake Pontchartrain, La. and Vicinity, London Ave. Canal,
Mirabeau Ave. to Leon C. Simon Blvd., Orleans Parish, Louisiana.

CONTRACT NUMBER
DACW29-94-C-0079

CONTRACTOR (Or hired labor) B & K Construction Company, Inc.
1905 Highway 59, Mandeville, La. 70448

WEATHER
P/C and Showers

PORTION OF SCHEDULED DAY SUITABLE FOR OPERATIONS

TEMPERATURE

STRUCTURAL EXCAVATION	BORROW EXCAVATION	EMBANKMENT	CONCRETE	STRUCTURE
50 %	50 %	50 %	50 %	50 %

MINIMUM	MAXIMUM
74	95

HAS ANYTHING DEVELOPED ON THE WORK WHICH MIGHT LEAD TO A CHANGE ORDER OR FINDING OF FACT? NO YES (Explain)

24 HOUR PRECIPITATION
INCHES 1.5
ENDING 1530p M

NUMBER OF GOVERNMENT EMPLOYEES

Canal RIVER STAGE

SUPERVISORY	OFFICE	LAYOUT	INSPECTION	TOTAL	LABOR
	1-1		1-8	2-9	

FEET	TIME
1.9	0900a M

NUMBER OF CONTRACTOR'S EMPLOYEES

NUMBER OF SHIFTS 1 2 3

SUPERVISORY	SKILLED	LABORERS	TOTAL	FROM	TO	FROM	TO
				0700a M	1630p M		

FROM	TO	FROM	TO

Attach list of the following: (a) Major items of equipment either idle or working, and (b) Number and classification of contractor personnel onsite.
Note: If the contractor's Quality Control Report (QCR) contains the information it need not be repeated

CONTRACTOR/SUBCONTRACTORS AND AREA OF RESPONSIBILITY FOR WORK PERFORMED TODAY

- a. B & K Const. Co., Inc. - e. Arcadia Rebar Inc.
- b. H&H Construction Co. Inc.
- c. Accent Construction Co. INC

WORK PERFORMED TODAY (Indicate location and description of work performed. Refer to work performed by prime and/or subcontractors by letter in Table above)

- a. Floodwall
- b. Painting
- c. Refinishing
- d. Electrical
- e. steel -Rebar

Days of no work and reasons for same.

100% days lost-0
50% days lost-Jun 7, 12, 13, 14, 15, 21, 27, 28, 29-Jul 3, 8, 13, 14, 15-1996

Information on progress of work, causes for delays and extent of delays, Plant, material, etc.

Some Progressive performed on this date.

PERCENT PROJECT COMPLETE: 85.50
PERCENT TIME ELAPSED: 87.75

DATE SET FOR COMPLETION: 6-Aug-1996

QCR INSPECTION PHASES ATTENDED AND INSTRUCTIONS GIVEN

- Floodwall- No instruction given
- Painting - No work performed
- Refinishing- No instruction given
- Electrical - No instruction given.
- Re-Steel - No work performed

RESULTS OF QA INSPECTIONS AND TESTS, DEFICIENCIES OBSERVED, ACTIONS TAKEN AND CORRECTIVE ACTION OF CONTRACTOR INCLUDE COMMENT PERTAINING TO CONTRACTORS CQC ACTIVITIES

Floodwall- Contractor wrec ked forms on the Mono 110b and and make preparation for the placement of Mono # 110a at the P/S. Contractor tracked dragline and related equipment to theWest side at P/S #4 to begin sheet pile extraction. Work continues at the Tie-In collar at Filmore on Eastsideat bridge.

Electrical- Contractor proceded wi;th the attachment of the electrical feeders on East side floodwall progressing a distance of approx. 80ft.

* Contractor had to stop all work operation due to heavy thunderstorms which presisted in the area.

VERBAL INSTRUCTIONS GIVEN TO CONTRACTOR (include names, reactions and remarks)

None

CONTROVERSIAL MATTERS IN DETAIL:

None

INFORMATION, INSTRUCTIONS OR ACTIONS TAKEN NOT COVERED IN QCR REPORT OR DISAGREEMENTS:

None

Contractor's Quality Control Report (submitted/not submitted) for this (date/period).

REMARKS (include visitors to project and miscellaneous remarks pertinent to work)

NAMES	GOVERNMENT PERSONNEL ON SITE		
	DESIGNATION	HRS. ON SITE	DUTIES
H.Lemoine	QAR Rep.	8	QAR
C.Wagner	P.E.	1	

SAFETY (include any infractions of approved safety plan, safety manual or instructions from Government personnel Specify corrective action taken)

Checked trackhoe and crawler crane for motions alarms to ensure that they were functioning properly during the concrete placement. Visuallyverified proper handsignals were being used and that operator had visual contract at all times. Compliance met.

INSPECTOR'S SIGNATURE

DATE

SUPERVISOR'S INITIALS

DATE

Howard J. Romo

7/16/96

rw

7/30
7/23/96

QUALITY ASSURANCE REPORT SUPPLEMENT

QA Inspections Performed & Results: Observed subcontractor Barnes electric installing feeder line to new Irwell from Mirebau to Filmore on east side of canal. Continuing to rub Irwells on west side filling pits & voids with sand cement grout. Sub needs to perform additional work on wells to remove form line ridges & laitance from areas repaired

Instructions to CQC/Remarks: Rain fell in afternoon shutting down contractor's activities

Chris J. Wagner
Name

Proj Engr
Title

QUALITY CONTROL REPORT
 DACH29-94-C-0079
 LONDON AVENUE OUTFALL CANAL
 B & K CONSTRUCTION JOB NO. 9402

DATE: 7/15/96 REPORT NO.: 469
 SKIES: PARTLY CLOUDY / CLOUDY RAIN: 1 3/4 IN. TEMP.: 74 MIN 93 MAX
 DUST: NONE LEVEL CONDITION: WET CANAL GAUGE: (1.8) NOISE: MODERATE

WORK PERFORMED/LOCATION

(SUNDAY 7/14/96 NO WORK TODAY) 1" RAIN

7/15/96 B&K CONSTRUCTION - POUNED 1 WALL MONOLITH # 109 - WORKED ON PATCHING THE DAMAGED AREAS OF THE EXISTING CONCRETE FLOODWALL AT THE GAS LINE XING AND THE TIE IN COLLAR AT FILMORE SOUTHEAST - MOVED THE 405 BOEHRING CRANE FROM MIRABEAU / FILMORE WEST TO FILMORE / SIPHONS WEST TO START PULLING EXISTING SHEET PILING

ACCENT CONST. - FINISHING CONCRETE I WALLS FLOODSIDE FILMORE / PS 9 SIPHONS WEST

HEH PAINT } NO WORK TODAY
 ARCADIA REBAR }

BARNES ELECTRIC - INSTALLING FEEDER 340 FROM MIRABEAU TO FILMORE EAST

CONTRACTOR/SUBCONTRACTORS AND
 AREAS OF RESPONSIBILITY
 COMPANY

NO	TRAD.	HOURS	COMPANY	LOCATION/WORK DESCRIPTION
10	UNSKILLED	50	B&K Const.	(SEE ABOVE)
13	SKILLED	6.5	"	
1	Supt.	5	"	
	Q.C. REP.		"	
3	SKILLED	15	ACCENT CONST.	
2	UNSKILLED	10	"	
2	SKILLED	22	BARNES ELEC.	
2	UNSKILLED	22		

EQUIPMENT

DESCRIPTION	ARR/DEF	SAFETY CHECK	HRS USED	IDLE	REPAIR
Komatsu 200 Excavator 1	—	YES	5	3	—
Komatsu D57P Dozer	—	NO	0	8	—
Kubota 191 Excavator	—	—	—	—	—
Case 580 Backhoe	—	YES	5	3	—
Koehring 535 Crane	—	—	—	—	—
MKT Vibro Hammer	—	NO	0	8	—
Fiat-All Motor Grader	—	NO	0	8	—
Mantec 4012 Crane	—	YES	5	3	—
KOMATSU EXC. 200 *2	—	YES	5	3	—
CASE 580 BACKHOE *2	—	NO	0	8	—
WELDING MACHINE	—	YES	5	3	—
KOEHRLING 535 CRANE	—	—	—	—	—
KOEHRLING 405 CRANE	—	YES	5	3	—

MATERIALS RECEIVED

RECEIVED 17 CY OF MIX # 44C CONCRETE
FROM LAFARGE CONCRETE

TESTS PERFORMED

(As required by plans/specifications)

MADE TEST CYLINDERS - PERFORMED SLUMP, AIR
CONTENT AND TEMPERATURE TESTS ON THE 17 CY
RECEIVED FROM LAFARGE CONCRETE

QUALITY CONTROL REPORT
INSPECTIONS PERFORMED

THE 41 LINE ON THE FLOODSIDE KILMORE TO PS 4
EAST IS BEING FLOATED OUT AND CAN NO LONGER
BE SEEN - ALL BUT (2) MONOLITHS HAVE BEEN
REPAIRED

SITE EXTREMELY WET - TOO WET TO
CONTINUE BACKFILLING ROBERT E. LEE / L.C.
SIMON EAST

JOB SAFETY.

THE LOCK OUT - TAG OUT PROCEDURE IS BEING
USED WHEN WE HAVE TO WORK ON OR NEAR
THE SEWB FEEDER CABLES

REMARKS

I certify to the best of knowledge that this report is complete
and correct; and that all work methods, materials and equipment are
in compliance with plans and specifications except as noted.

W. E. Lasser
Authorized Q C Representative

7/16/96
Date

FORM CHECK OUT FOR STRUCTURES REINFORCED CONCRETE FLOODWALL

JOB *London Ave. Out Fall Canal*

CONTRACT NO. *DACW29-940079*

MONOLITH # *WEST 109*

LIFT NO. *ONE*

ELEVATION *3.00-14.40*

DATE OF POUR *[REDACTED]*

ITEM	INSPECTED BY CONTRACTOR			REVIEWED BY C.O.E.		
	NAME	DATE	TIME	NAME	DATE	TIME
A. SHEET PILING	<i>M/T</i>	<i>7-15-96</i>	<i>8:00</i>	<i>[Signature]</i>	<i>7/15/96</i>	<i>8:30</i>
VERTICAL	<i>✓</i>	<i>"</i>	<i>"</i>			
ALIGNMENT	<i>✓</i>	<i>"</i>	<i>"</i>			
CLEANLINESS	<i>✓</i>	<i>"</i>	<i>"</i>	<i>✓</i>		
B. CONCRETE PILING	<i>M/T</i>	<i>7-15</i>	<i>8:00</i>	<i>[Signature]</i>	<i>7/15/96</i>	<i>8:20</i>
ANGLE	<i>✓</i>	<i>"</i>	<i>"</i>			
HEADS	<i>✓</i>	<i>"</i>	<i>"</i>			
C. STAB. SLAB/JOINTS	<i>M/T</i>	<i>7-15</i>	<i>8:00</i>	<i>[Signature]</i>	<i>7/15/96</i>	<i>8:20</i>
CLEANLINESS	<i>✓</i>	<i>"</i>	<i>"</i>			
WATERED	<i>✓</i>	<i>"</i>	<i>"</i>			
WATERJET (JOINT)	<i>✓</i>	<i>"</i>	<i>"</i>			
D. STEEL REINFORCING	<i>M/T</i>	<i>7-15</i>	<i>8:05</i>	<i>[Signature]</i>	<i>7/15/96</i>	<i>8:20</i>
VERTICAL	<i>✓</i>	<i>"</i>	<i>"</i>			
HORIZONTAL	<i>✓</i>	<i>"</i>	<i>"</i>			
SPACING	<i>✓</i>	<i>"</i>	<i>"</i>			
CLEARANCES	<i>✓</i>	<i>"</i>	<i>"</i>			
STEEL SCHEDULE	<i>✓</i>	<i>"</i>	<i>"</i>			
SHOP DRAWINGS	<i>✓</i>	<i>"</i>	<i>"</i>			
TIE WIRES	<i>✓</i>	<i>"</i>	<i>"</i>			
#6 BAR WELDED	<i>✓</i>	<i>"</i>	<i>"</i>			
CLEANLINESS	<i>✓</i>	<i>"</i>	<i>"</i>			
WATERED	<i>✓</i>	<i>"</i>	<i>"</i>			
E. FORMWORK	<i>M/T</i>	<i>7-15</i>	<i>8:10</i>	<i>[Signature]</i>	<i>7/15/96</i>	<i>8:20</i>
CONDITION	<i>✓</i>	<i>"</i>	<i>"</i>			

ITEM	- INSPECTED BY CONTRACTOR			REVIEWED BY C.O.E.				
	NAME	DATE	TIME	NAME	DATE	TIME		
E. FORMWORK (CONT)								
ALIGNMENT	<i>[Signature]</i>	7-15	8:10	<i>[Signature]</i>	7/15/96	0820		
CLEANLINESS	✓	"	"					
RELEASING AGENT	✓	"	"					
TIES AND BOLTS	✓	"	"					
LENGTH 28.86'	✓	"	"					
WIDTH 1.75-1.00'	✓	"	"					
HEIGHT 11.40'	✓	"	"					
WATERSTOPS	✓	"	"					
CHAMFER STRIPS	✓	"	"					
F. WEATHER PROTECTION	<i>[Signature]</i>	7-15	8:10	<i>[Signature]</i>	7/15/96	0820		
G. SAFETY (LIST)		7-15	8:10	<i>[Signature]</i>	7/15/96	0820		
1. Ladder	✓	"	"					
2. SCAFFOLD	✓	"	"					
3. RIGGING	✓	"	"					
H. OTHER CHECKS PER SPECIFIC JOB	<i>[Signature]</i>	7-15	8:15	<i>[Signature]</i>	7/15/96	0820		
EXP. MATERIAL	✓	"	"					
I. EQUIPMENT USED	NO.	TYPE	TIME	HOURS	NO.	TYPE	TIME	HOURS
MANTIS 3612	1	CRANE	9:30	2.0				
BUCKET	1	1.0 yrd.	"	"				
VIBRATOR	1	18" shaft	"	"				
GENERATOR	1	BAS	"	"				
J. REMARKS	SLUMP: 4.0" - 4.5" AIR ENTR: 5.6% - 5.1% CONCRETE TEMP: 85° AIR TEMP: 90° 3 TEST CYLINDERS (LA 213)							
FINAL CLEARANCE								
CONTRACTOR REPRS: <i>[Signature]</i>				C.O.E. REPRS: <i>[Signature]</i> 7/15/96				
INSTRUCTIONS								
CONCRETE PLACING SHALL NOT BEGIN UNTIL EVERY ITEM IS CHECKED AND THE FINAL CLEARANCE IS SIGNED. IF ANY ITEM IS NOT APPLICABLE IT SHALL BE NOTED "NA" AND SIGNED. BEFORE APPROVING THE SAFETY REQUIREMENTS ITEM, A FINAL INSPECTION SHALL BE MADE OF ALL WORKING FACILITIES FOR CONCRETE PLACING SUCH AS SCAFFOLDS, LADDERS, PLATFORMS, ACCESS WAYS, ETC. TO ASSURE THAT THEY ARE ADEQUATE, SAFELY CONSTRUCTED AND IN READINESS. FINAL INSPECTION SUBJECT TO REVOCATION IF SUBSEQUENT INSPECTION REVEALS ANY DEFICIENCIES. IF SUMMONED BY THE CONTRACTOR TO CHECK AN ITEM AND IT IS FOUND TO BE UNSATISFACTORY, STATE IN THE REMARKS COLUMN THE TIME SUMMONED AND THE TIME REJECTED. ITEMS UNDER BLOCK "H" SHALL BE DETERMINED BY THE GOVERNMENT QUALITY ASSURANCE PERSONNEL AS THESE ITEMS APPLY TO THIS SPECIFIC CONTRACT OR STRUCTURE.								

QUALITY CONTROL REPORT
 DACW29-94-C-0079
 LONDON AVENUE OUTFALL CANAL
 B & K CONSTRUCTION JOB NO. 9402

DATE: 7/13/96

REPORT NO.: 468

SKIES: CLEAR / CLOUDY RAIN: 2 IN. TEMP.: 72 MIN 95 MAX

DUST: NONE LEVEE CONDITION: WET CANAL GAUGE: (1.7) NOISE: MODERATE

WORK PERFORMED/LOCATION

B&K CONSTRUCTION - WRECKED FORMS FROM I WALL MONOLITH # 110 A AND SET FORMS AND RESTEEL FOR MONOLITH # 109 BUT DID NOT POUR IT - CHIPPED EXISTING CONCRETE FLOODWALLS BACK TO SAW CUT JOINTS FOR FUTURE REPAIRS. - CEMENT FINISHERS REPAIRED 4' LINE FLOODSIDE FILMORE/PSY EAST

ACCIDENT
 H&H
 ARCADIA
 BARNES

NO WORK TODAY

CONTRACTOR/SUBCONTRACTORS AND
 AREAS OF RESPONSIBILITY
 COMPANY

NO TRADE HOURS LOCATION/WORK DESCRIPTION

NO	TRADE	HOURS	COMPANY	LOCATION/WORK DESCRIPTION
5	unskilled	40	B&K Const.	SEE ABOVE
7	skilled	57	"	
1	Supt.	8	"	
	Q.C. Rep.		"	

QUALITY CONTROL REPORT
INSPECTIONS PERFORMED

NO INSPECTIONS TODAY.

JOB SAFETY.

REMINDED EVERYONE TO WEAR THEIR HAND
MATS AT ALL TIMES AND SAFETY GLASSES
WHEN NECESSARY -

REMARKS

I certify to the best of knowledge that this report is complete
and correct; and that all work methods, materials and equipment are
in compliance with plans and specifications except as noted.


Authorized Q C Representative

7/15/96
Date

EQUIPMENT

DESCRIPTION	ARR/DEF	SAFETY CHECK	HRS USED*	IDLE	REPAIR
Komatsu 200 Excavator 1	—	NO	0	8	—
Komatsu D57P Dozer	—	NO	0	8	—
Kubota 191 Excavator	—	—	—	—	—
Case 580 Backhoe	—	YES	4	4	—
Koehring 535 Crane	—	—	—	—	—
MKT Vibro Hammer	—	NO	0	8	—
Fiat-Ail Motor Grader	—	NO	0	8	—
Mantis 4012 Crane	—	YES	8	0	—
KOMATSU EXC. 200 #2	—	NO	0	8	—
CASE 580 BACKHOE #2	—	NO	0	8	—
WELDING MACHINE	—	YES	8	0	—
KOEHRING 535 CRANE	—	—	—	—	—
KOEHRING 405 CRANE	—	NO	0	8	—

MATERIALS RECEIVED

NO MATERIALS RECEIVED TODAY

TESTS PERFORMED

(As required by plans/specifications)

NO TESTING TODAY

PERMANENT ELECTRICAL FEEDER RELOCATION
PREPARATORY AGENDA

DACW 29-94-C-0079

7-9-96

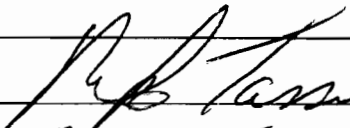
- 1) CHECK TO INSURE THAT ALL NECESSARY PERSONNEL ARE PRESENT
- 2) REVIEW CONTRACT DRAWINGS, SPECIFICATIONS, AND SUBMITTALS
- 3) DISCUSS METHODS OF ACCOMPLISHING THIS PART OF THE WORK
- 4) DISCUSS QUALITY CONTROL INSPECTIONS AND REPORTING REQUIRED FOR THIS PHASE.
- 5) REVIEW JOB HAZARD ANALYSIS AND ALL SAFETY REQUIREMENTS
- 6) HAVE ALL PARTIES SIGN THE ATTENDANCE REGISTER

MCW 29-94-CMO 79
PERMANENT ELECTRICAL FEEDER RELOCATION
PREPARATORY MEETING
7/9/96

A PREPARATORY MEETING WAS HELD TODAY IN THE TRAILER OF INSPECTOR DUKE LAMONIE TO DISCUSS THE PERMANENT INSTALLATION OF THE S&WB FEEDER CABLES TO THE NEW CONCRETE I WALL. PRESENT FOR THIS MEETING WERE PROJECT INSPECTOR DUKE LAMONIE, PROJECT ENGINEER CHRIS WAGNER, CONTRACTOR'S SUPERINTENDENT MIKE TASSIN, AND THE SUB CONTRACTOR'S FOREMAN.

THE ANCHOR BOLTS BEING USED TO ATTACH THE CLAMPS TO THE NEW I WALL HAVE BEEN CAST INTO EACH MONOLITH AS IT WAS BEING Poured. THERE WILL BE SOME PLACES WHERE ADDITIONAL ANCHOR BOLTS WILL BE NEEDED AND WEDGE ANCHORS WILL BE USED. THE ANCHOR BOLTS AND 5" CLAMPS HAVE BEEN SUBMITTED ON AND APPROVED. THE SUB CONTRACTOR BARNES ELEC. WILL USE HIS BOOM TRUCK TO LIFT THE FEEDER CABLE FROM ITS RESTING POSITION APPROXIMATELY 6' FLOODSIDE OF THE NEW I WALL TO ITS NEW LOCATION BELOW THE HAUNCH LINE. SPECIAL CABLE ROLLERS WILL BE USED TO SADDLE THE ELECTRIC FEEDER WHEN IT IS BEING LIFTED, ALSO A SPLICE HOLDING BEAM WILL BE USED WHEN A SPLICE IS ENCOUNTERED.

CLAYTON PERRET OFF THE S&WB
ELECTRICAL DIVISION WAS NOTIFIED 24 HRS.
AHEAD OF WORK BEGINNING. CENTRAL
CONTROL OF THE S&WB WAS ALSO NOTIFIED
OF OUR INTENT TO PERMANENTLY INSTALL
THE 340 FEEDER TO THE NEW I WALL
STARTING AT MIRABEAU ON THE EAST BANK
WORKING NORTH TO FILMORE.


MIKE TASSIN
B&K CONST.
Hardy Lemone OAR COE