Reinspection of ET Plus End Treatment

SR 4 WB Near Laurel Rd.

Contra Costa Co. California

N 37.97269, W 121.73937

Friday, January 30, 2015





Looking down at extruder head Note lack of any obvious damage to face or "wings" of extruder head



Chute width measurements made at 5 locations \rightarrow at roughly equal spacing, top to bottom:

TOP 1 13/16 in 1 13/16 in 1 13/16 in DIAPHRAGM 1 13/16 in 1 13/16 in BOTTOM 1 3/4 in

View of exit chute from back side; Extruder head on left; Note scuff marks on curve in chute




Diaphragm

Another view of exit chute from back side of installation; Note scuff marks on curve in chute



Closer view of exit chute from back side of installation; Note scuff marks on curve in chute

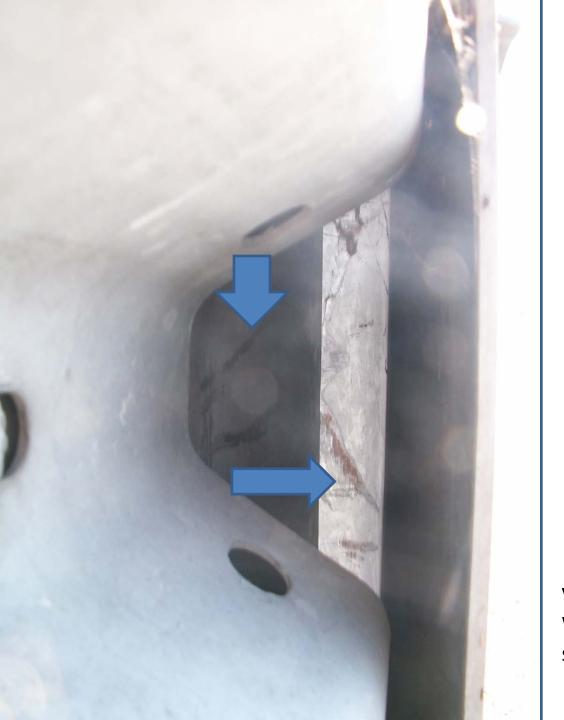

View of exit chute from face of W-beam looking toward traffic; Note scuff marks on <u>both</u> sides of chute



Another view of exit chute from face of W-beam looking toward traffic; Note scuff marks on <u>both</u> sides of chute