


Davis-Besse

1Q/2000 Performance Indicators

Licensee's General Comments: none

Unplanned Scrams per 7000 Critical Hrs

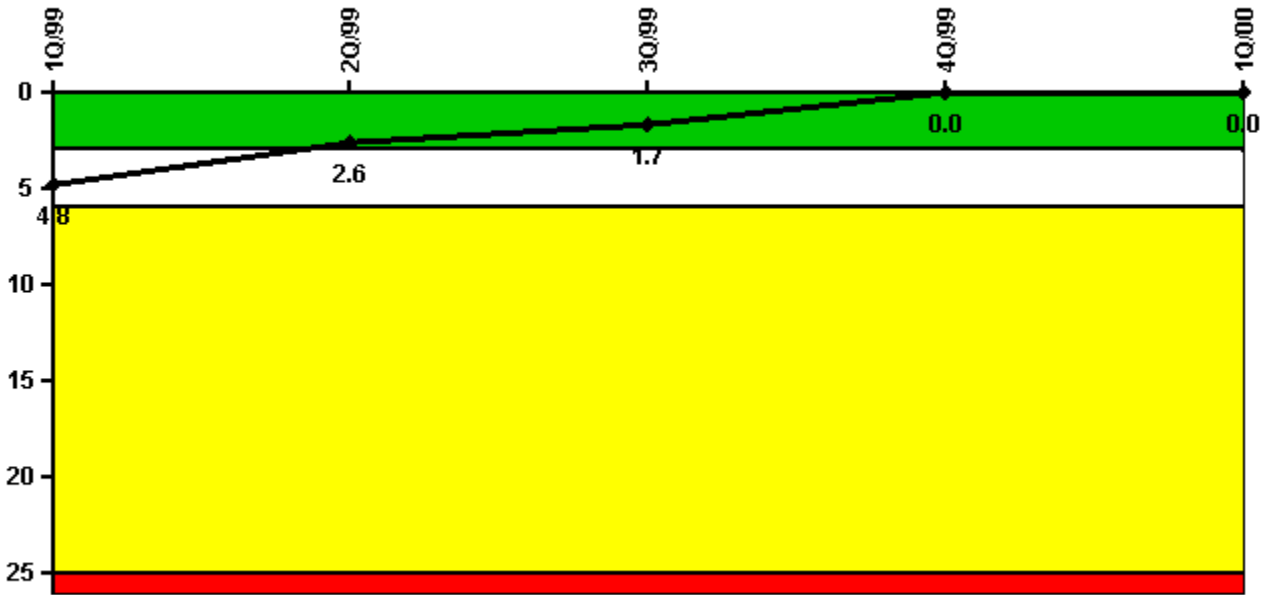

Thresholds: White > 3.0 Yellow > 6.0 Red > 25.0

Notes

Unplanned Scrams per 7000 Critical Hrs	1Q/99	2Q/99	3Q/99	4Q/99	1Q/00
Unplanned scrams	0	0	0	0	0
Critical hours	2160.0	1798.3	2208.0	2209.0	2184.0
Indicator value	4.8	2.6	1.7	0	0

Licensee Comments: none

Scrams with Loss of Normal Heat Removal




Thresholds: White > 2.0 Yellow > 10.0 Red > 20.0

Notes

Scrams with Loss of Normal Heat Removal	1Q/99	2Q/99	3Q/99	4Q/99	1Q/00
Scrams	0	0	0	0	0
Indicator value				2.0	2.0

Licensee Comments: none

Unplanned Power Changes per 7000 Critical Hrs

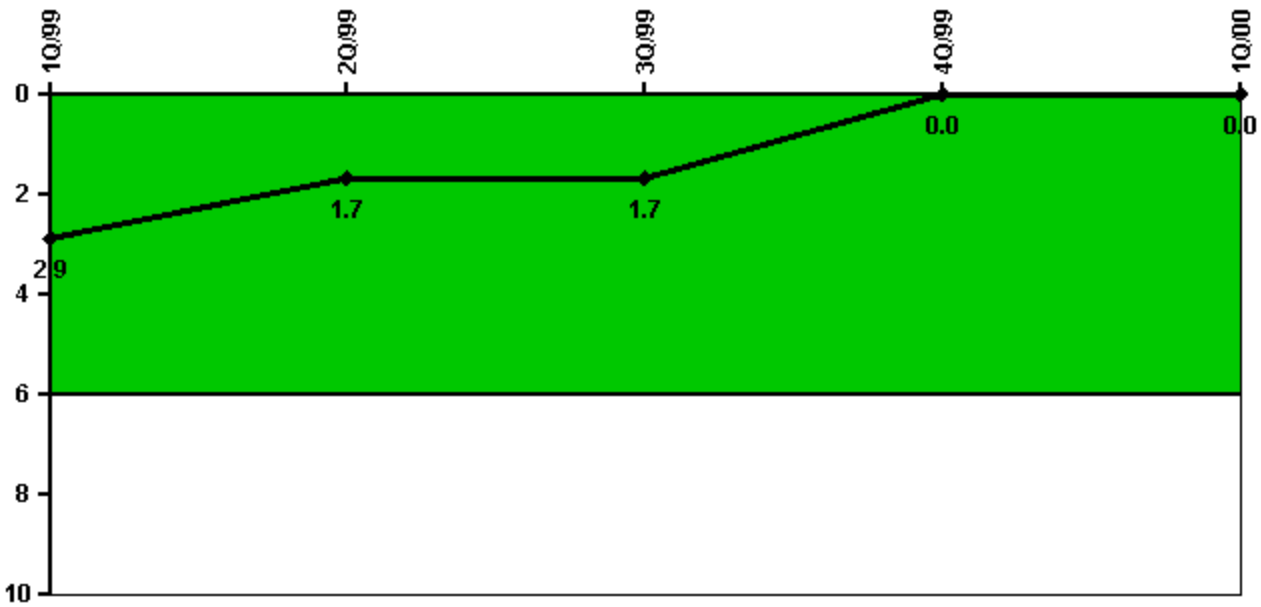


Thresholds: White > 6.0

Notes

Unplanned Power Changes per 7000 Critical Hrs	1Q/99	2Q/99	3Q/99	4Q/99	1Q/00
Unplanned power changes	0	0	0	0	0
Critical hours	2160.0	1798.3	2208.0	2209.0	2184.0
Indicator value	2.9	1.7	1.7	0	0

Licensee Comments: none

Safety System Unavailability, Emergency AC Power

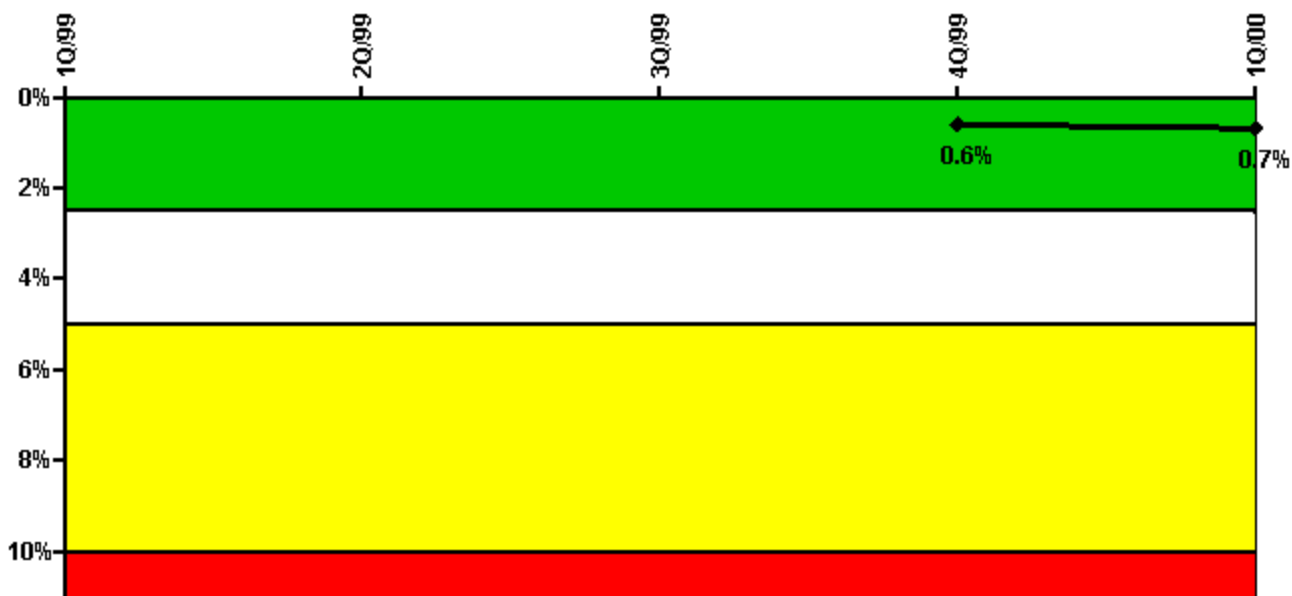

Thresholds: White > 2.5% Yellow > 5.0% Red > 10.0%


Notes

Safety System Unavailability, Emergency AC Power	1Q/99	2Q/99	3Q/99	4Q/99	1Q/00
Train 1					
Planned unavailable hours	2.50	0.90	22.50	0.93	18.18
Unplanned unavailable hours	0	0	7.20	0	0
Fault exposure hours	0	0	0	0	0
Effective Reset hours	0	0	0	0	0
Required hours	2160.00	2183.00	2208.00	2209.00	2184.00
Train 2					
Planned unavailable hours	5.20	115.80	1.40	24.35	0.77
Unplanned unavailable hours	0	15.10	0	0	0
Fault exposure hours	4.20	0	0	0	0
Effective Reset hours	0	0	0	0	0
Required hours	2160.00	2183.00	2208.00	2209.00	2184.00
Indicator value				0.6%	0.7%

Licensee Comments:

4Q/98: Hours trains required revised to reflect Daylight Savings Time (i.e. from 2208 to 2209 hours)

Safety System Unavailability, High Pressure Injection System (HPSI)

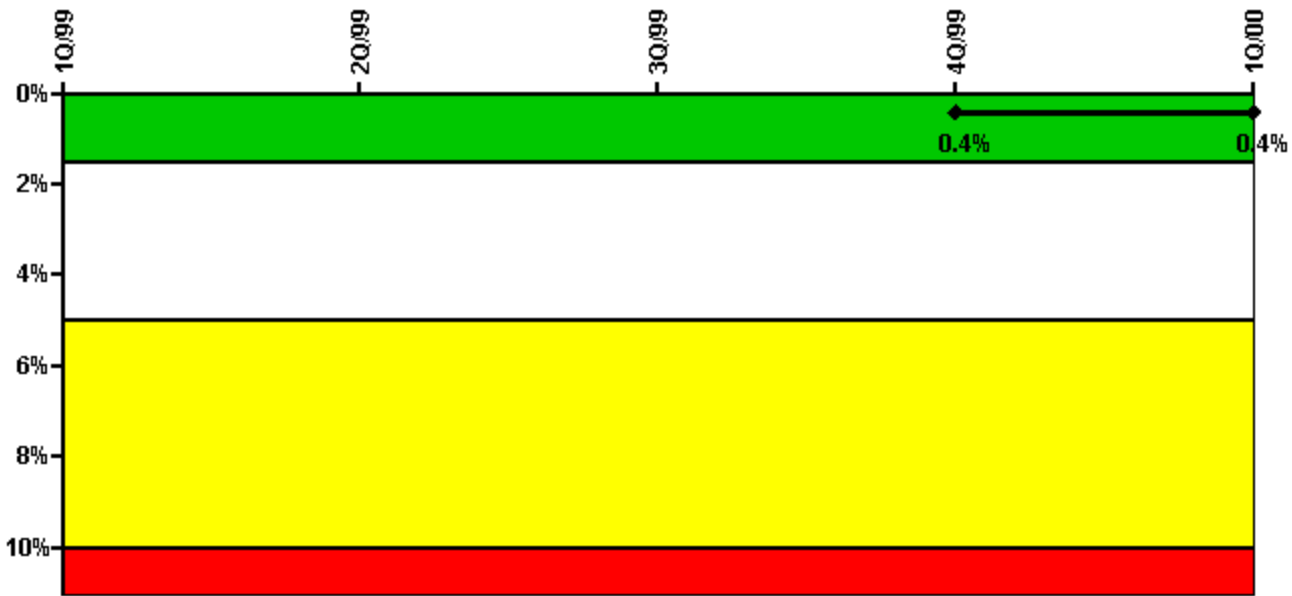


Thresholds: White > 1.5% Yellow > 5.0% Red > 10.0%

Notes

Safety System Unavailability, High Pressure Injection System (HPSI)	1Q/99	2Q/99	3Q/99	4Q/99	1Q/00
Train 1					
Planned unavailable hours	2.90	1.80	15.63	12.17	12.83
Unplanned unavailable hours	0	0	0	0	0
Fault exposure hours	0	0	0	0	0
Effective Reset hours	0	0	0	0	0
Required hours	2160.00	1868.82	2208.00	2209.00	2184.00
Train 2					
Planned unavailable hours	4.50	2.30	5.50	7.31	21.37
Unplanned unavailable hours	40.00	0	0	0	0
Fault exposure hours	0	0	0	0	0
Effective Reset hours	0	0	0	0	0
Required hours	2160.00	1868.82	2208.00	2209.00	2184.00
Indicator value				0.4%	0.4%

Licensee Comments: none

Safety System Unavailability, Heat Removal System (AFW)

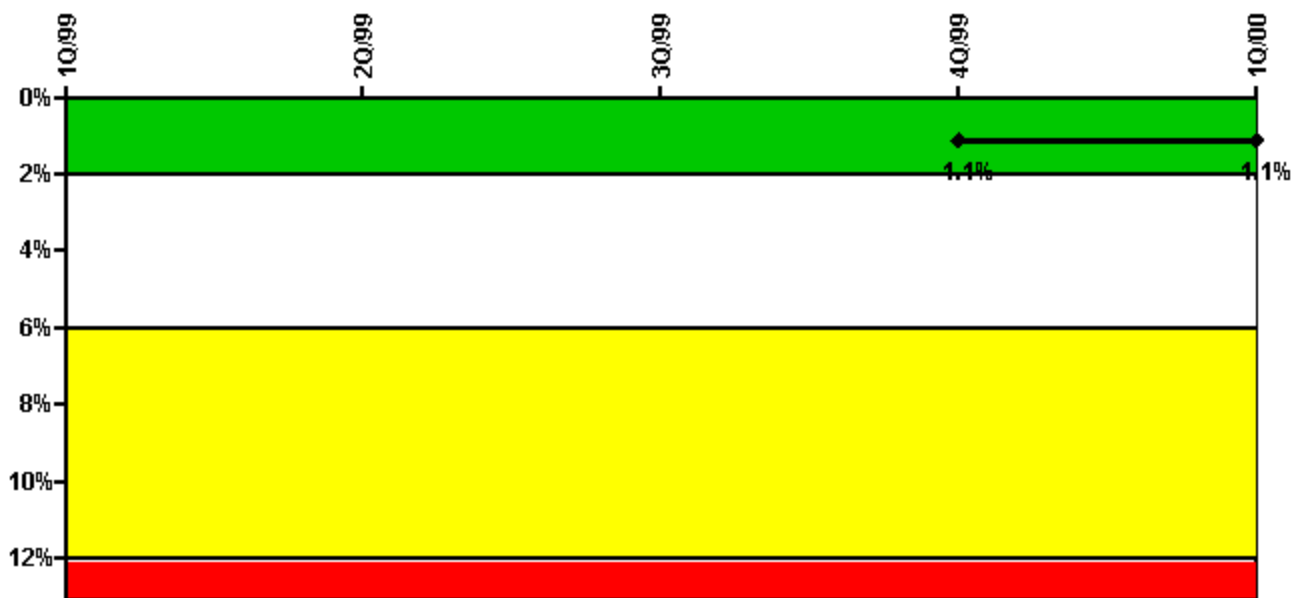


Thresholds: White > 2.0% Yellow > 6.0% Red > 12.0%

Notes

Safety System Unavailability, Heat Removal System (AFW)	1Q/99	2Q/99	3Q/99	4Q/99	1Q/00
Train 1					
Planned unavailable hours	0	4.12	0	46.60	3.47
Unplanned unavailable hours	0	0	0	0	1.17
Fault exposure hours	0	0	0	0	0
Effective Reset hours	0	0	0	0	0
Required hours	2160.00	1861.00	2208.00	2209.00	2184.00
Train 2					
Planned unavailable hours	0	0	0	9.45	2.54
Unplanned unavailable hours	0	5.30	0	0	0
Fault exposure hours	0	0	0	0	0
Effective Reset hours	0	0	0	0	0
Required hours	2160.00	1861.00	2208.00	2209.00	2184.00
Train 3					
Planned unavailable hours	1.12	3.00	0	0	2.23
Unplanned unavailable hours	0	0	0	0	0
Fault exposure hours	0	0	0	0	0
Effective Reset hours	0	0	0	0	0
Required hours	2160.00	1861.00	2208.00	2209.00	2184.00
Indicator value				1.1%	1.1%

Licensee Comments: none

Safety System Unavailability, Residual Heat Removal System

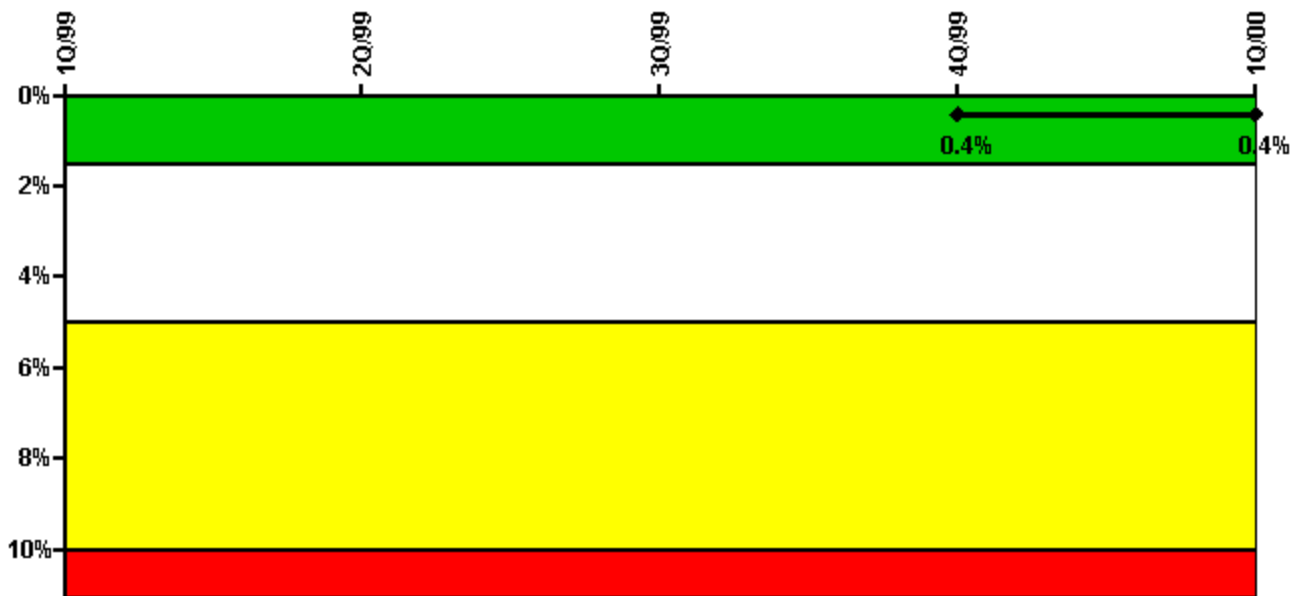

Thresholds: White > 1.5% Yellow > 5.0% Red > 10.0%

Notes

Safety System Unavailability, Residual Heat Removal System	1Q/99	2Q/99	3Q/99	4Q/99	1Q/00
Train 1					
Planned unavailable hours	3.00	7.50	13.47	13.02	19.11
Unplanned unavailable hours	0	0	0	0	0
Fault exposure hours	0	0	0	0	0
Effective Reset hours	0	0	0	0	0
Required hours	2160.00	2183.00	2208.00	2209.00	2184.00
Train 2					
Planned unavailable hours	1.50	31.90	6.90	2.97	26.33
Unplanned unavailable hours	0	0	0	0	0
Fault exposure hours	0	0	0	0	0
Effective Reset hours	0	0	0	0	0
Required hours	2160.00	2183.00	2208.00	2209.00	2184.00
Indicator value				0.4%	0.4%


Licensee Comments:

2Q/99: Corrected data entry error for hours required for service for 2Q1999. This minor change did not affect the color of the indicator.

4Q/98: Corrected data entry errors for planned unavailable hours for 4Q1998. These minor changes did not affect the color of the indicator.

2Q/98: Corrected due to reporting more hours unavailable during refueling outage in 2Q1998 than required per NEI 99-02. This change did not affect the color of the indicator.

Safety System Functional Failures (PWR)

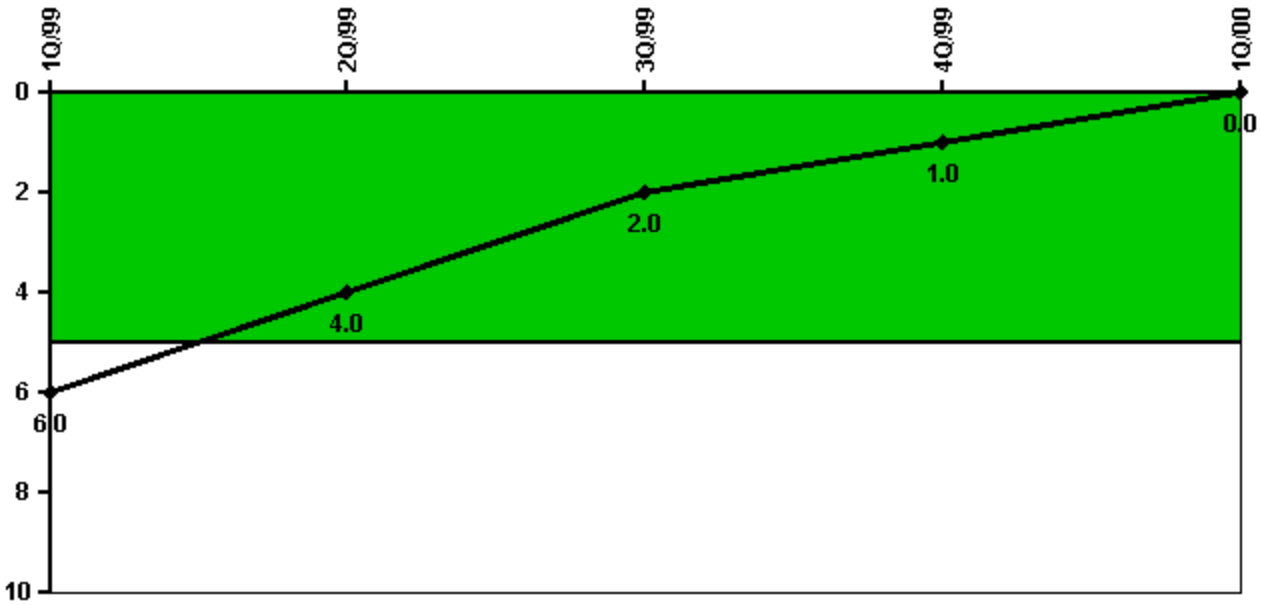


Thresholds: White > 5.0

Notes

Safety System Functional Failures (PWR)	1Q/99	2Q/99	3Q/99	4Q/99	1Q/00
Safety System Functional Failures	1	0	0	0	0
Indicator value	6	4	2	1	0

Licensee Comments: none

Reactor Coolant System Activity

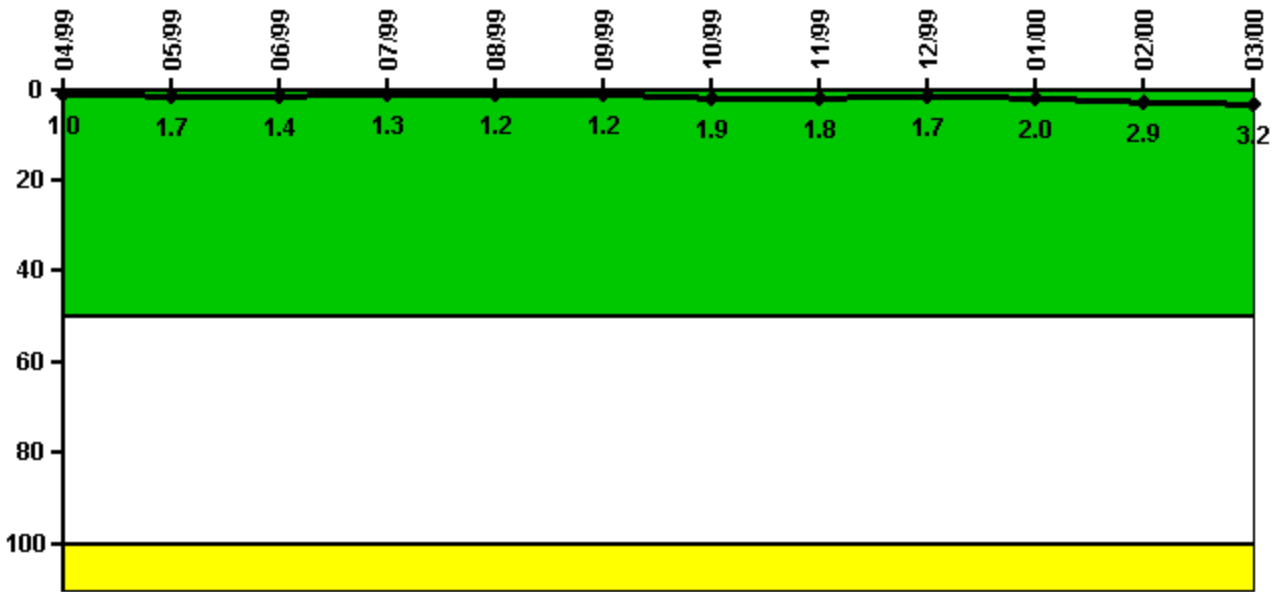


Thresholds: White > 50.0 Yellow > 100.0

Notes

Reactor Coolant System Activity	4/99	5/99	6/99	7/99	8/99	9/99	10/99	11/99	12/99	1/00	2/00	3/00
Maximum activity	0.010200	0.016500	0.014200	0.013100	0.011900	0.012100	0.019000	0.018000	0.017000	0.020200	0.029250	0.032100
Technical specification limit	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0
Indicator value	1.0	1.7	1.4	1.3	1.2	1.2	1.9	1.8	1.7	2.0	2.9	3.2

Licensee Comments: none

Reactor Coolant System Leakage

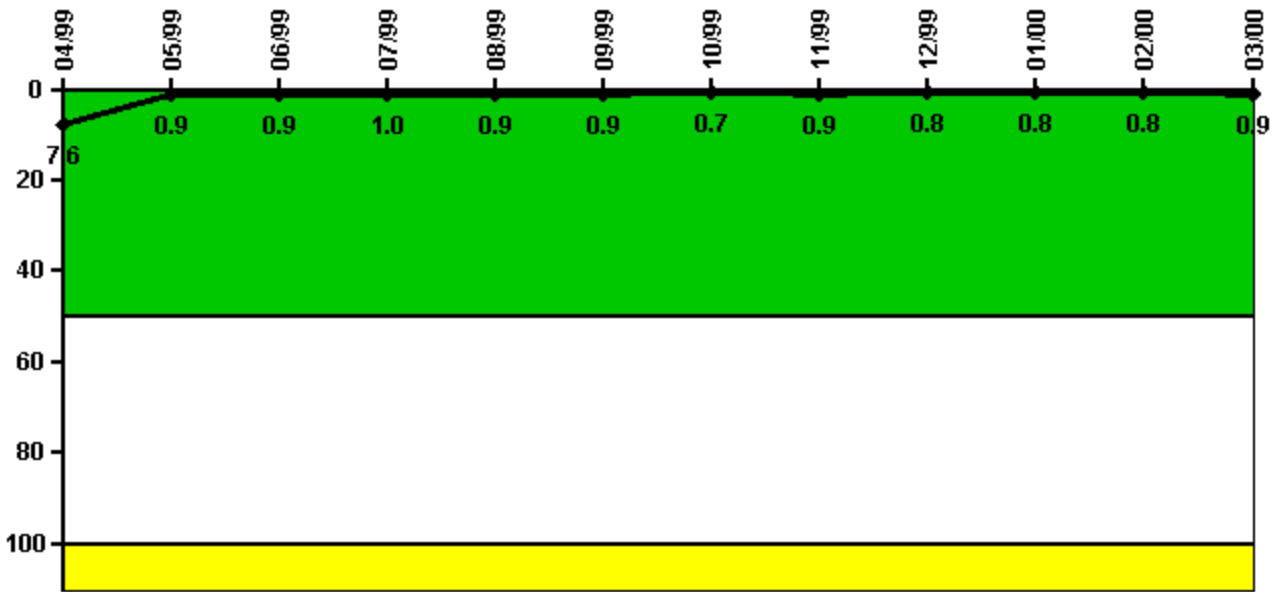


Thresholds: White > 50.0 Yellow > 100.0

Notes

Reactor Coolant System Leakage	4/99	5/99	6/99	7/99	8/99	9/99	10/99	11/99	12/99	1/00	2/00	3/00
Maximum leakage	0.760	0.090	0.090	0.100	0.090	0.090	0.070	0.090	0.080	0.076	0.075	0.094
Technical specification limit	10.0	10.0	10.0	10.0	10.0	10.0	10.0	10.0	10.0	10.0	10.0	10.0
Indicator value	7.6	0.9	0.9	1.0	0.9	0.9	0.7	0.9	0.8	0.8	0.8	0.9

Licensee Comments: none

Drill/Exercise Performance

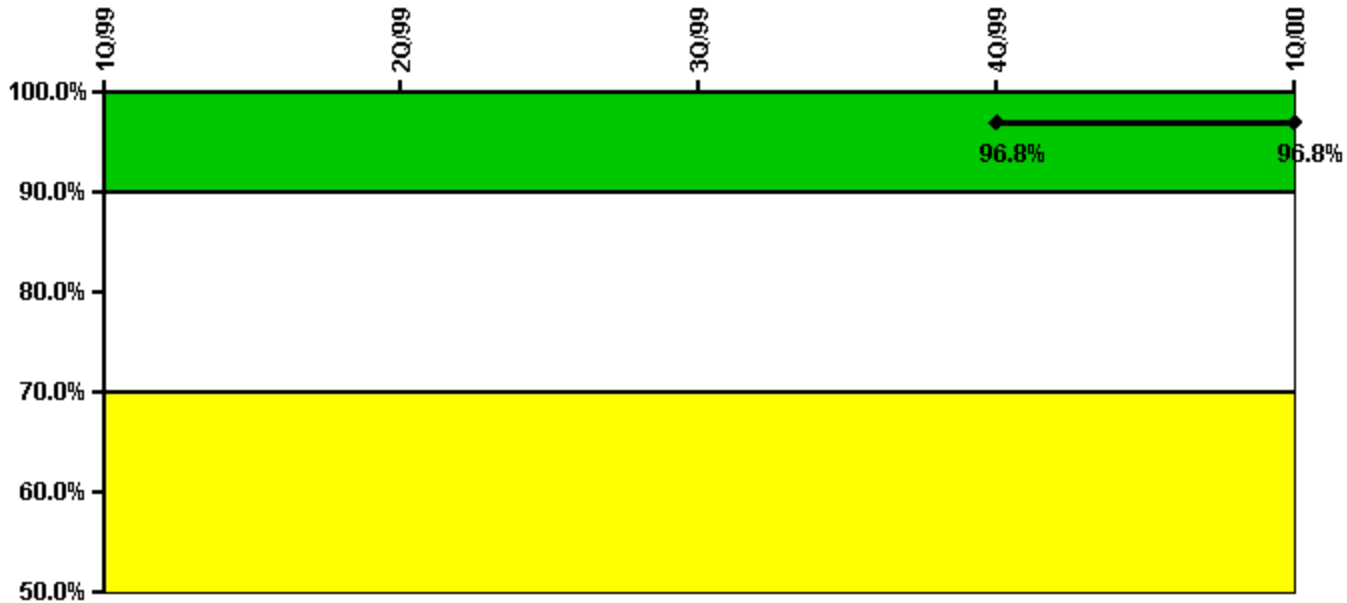

Thresholds: White < 90.0% Yellow < 70.0%

Notes


Drill/Exercise Performance	1Q/99	2Q/99	3Q/99	4Q/99	1Q/00
Successful opportunities	5.0	18.0	0	49.0	0
Total opportunities	5.0	18.0	0	50.0	0
Indicator value				96.8%	96.8%

Licensee Comments:

1Q/00: Historical data was revised and re-submitted in March 2000. The revised data changes the fourth quarter 1999 indicator from white to green.

4Q/99: Data has been revised following a review of historical drill information and clarification of when indications are available for EAL classification. Data revision has been discussed with the Senior Resident Inspector.

ERO Drill Participation

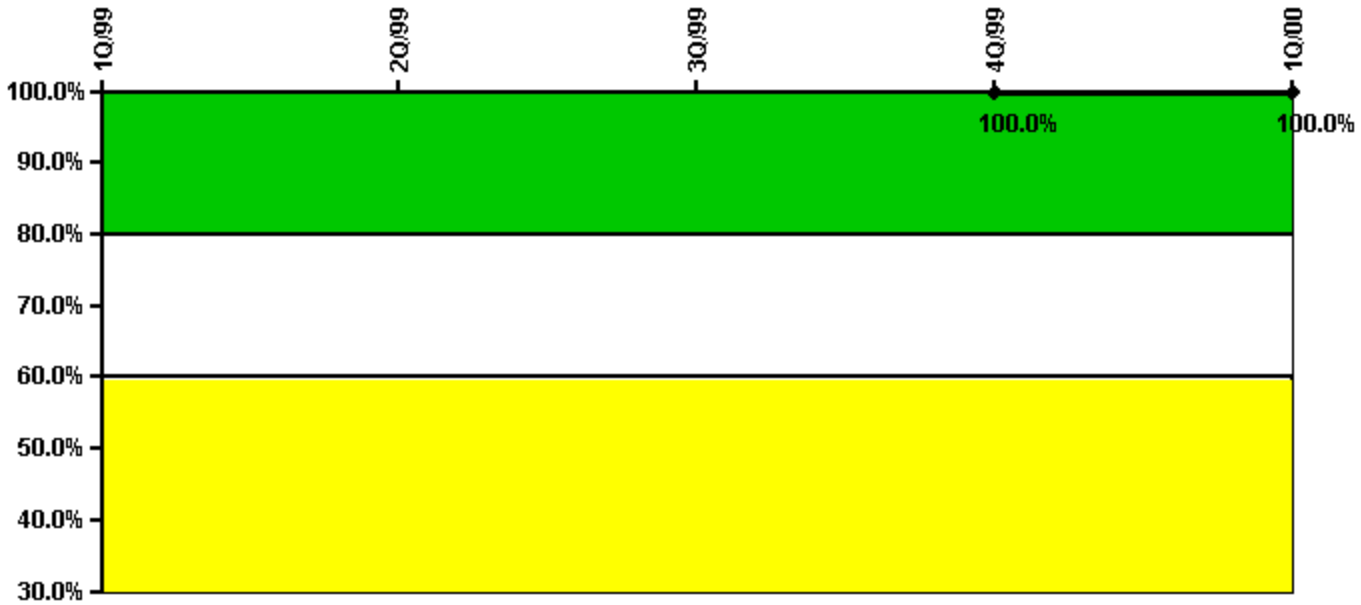


Thresholds: White < 80.0% Yellow < 60.0%

Notes

ERO Drill Participation	1Q/99	2Q/99	3Q/99	4Q/99	1Q/00
Participating Key personnel				68.0	68.0
Total Key personnel				68.0	68.0
Indicator value				100.0%	100.0%

Licensee Comments: none

Alert & Notification System

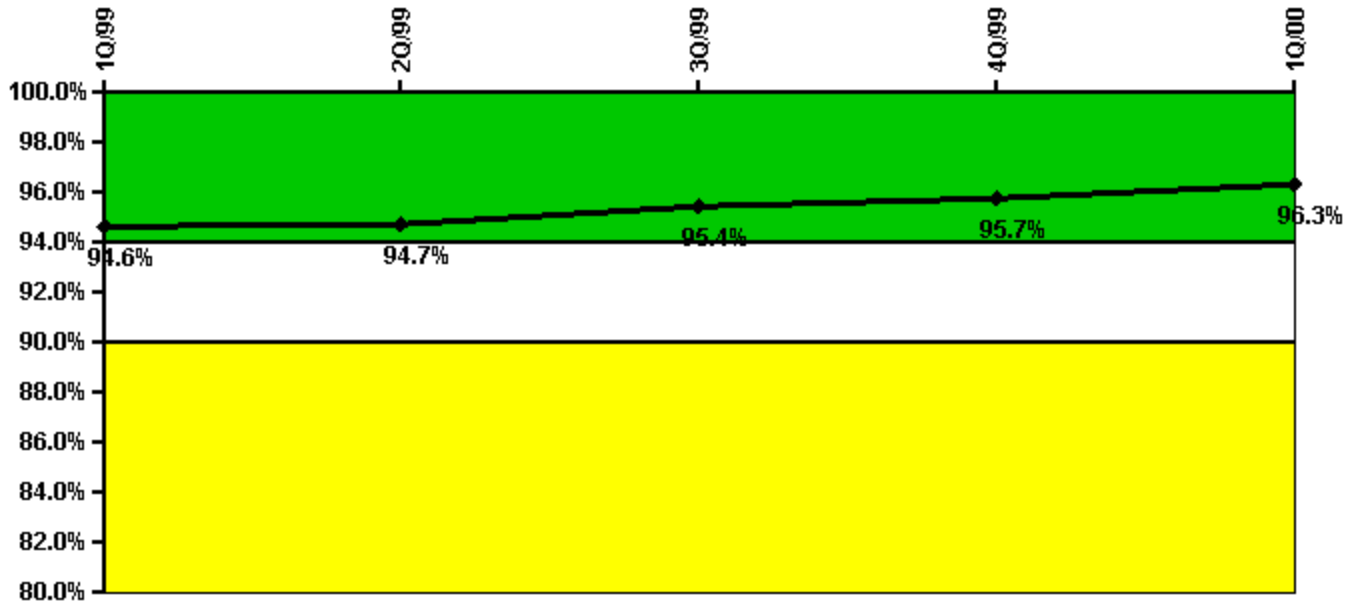

Thresholds: White < 94.0% Yellow < 90.0%


Notes

Alert & Notification System	1Q/99	2Q/99	3Q/99	4Q/99	1Q/00
Successful siren-tests	207	156	154	155	159
Total sirens-tests	216	162	162	162	162
Indicator value	94.6%	94.7%	95.4%	95.7%	96.3%

Licensee Comments:

4Q/99: 4Q1999: Corrected data entry error for number of ANS sirens tested during quarter. This correction did not result in a change to the PI color.

Occupational Exposure Control Effectiveness

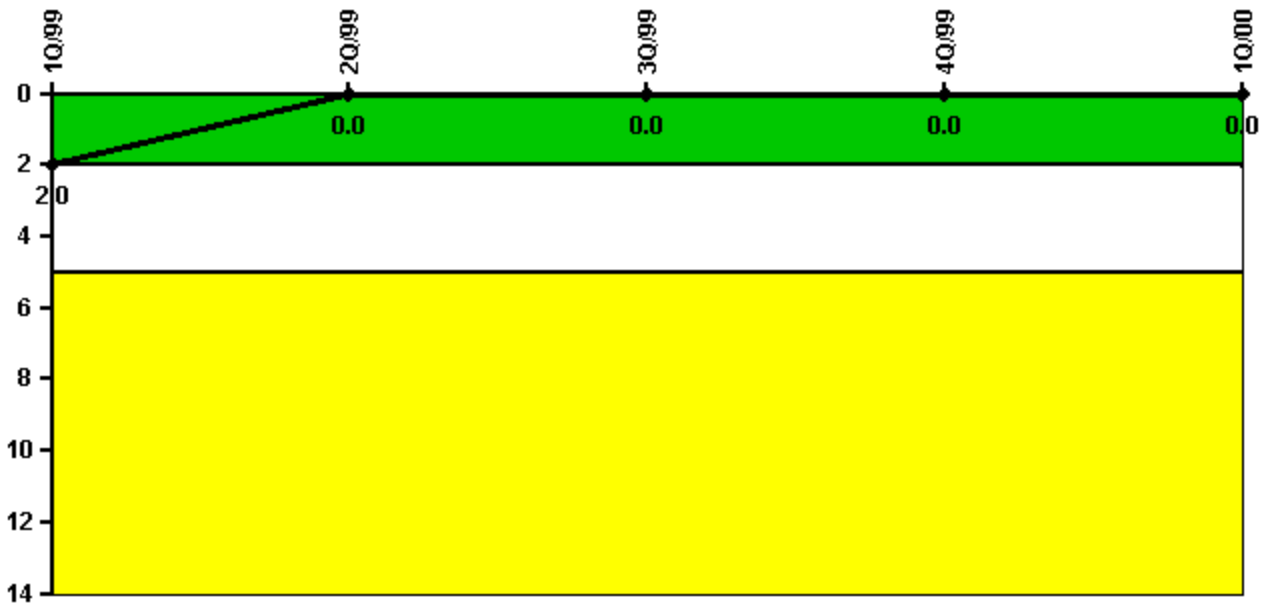


Thresholds: White > 2.0 Yellow > 5.0

Notes

Occupational Exposure Control Effectiveness	1Q/99	2Q/99	3Q/99	4Q/99	1Q/00
High radiation area occurrences	0	0	0	0	0
Very high radiation area occurrences	0	0	0	0	0
Unintended exposure occurrences	0	0	0	0	0
Indicator value	2	0	0	0	0

Licensee Comments: none

RETS/ODCM Radiological Effluent

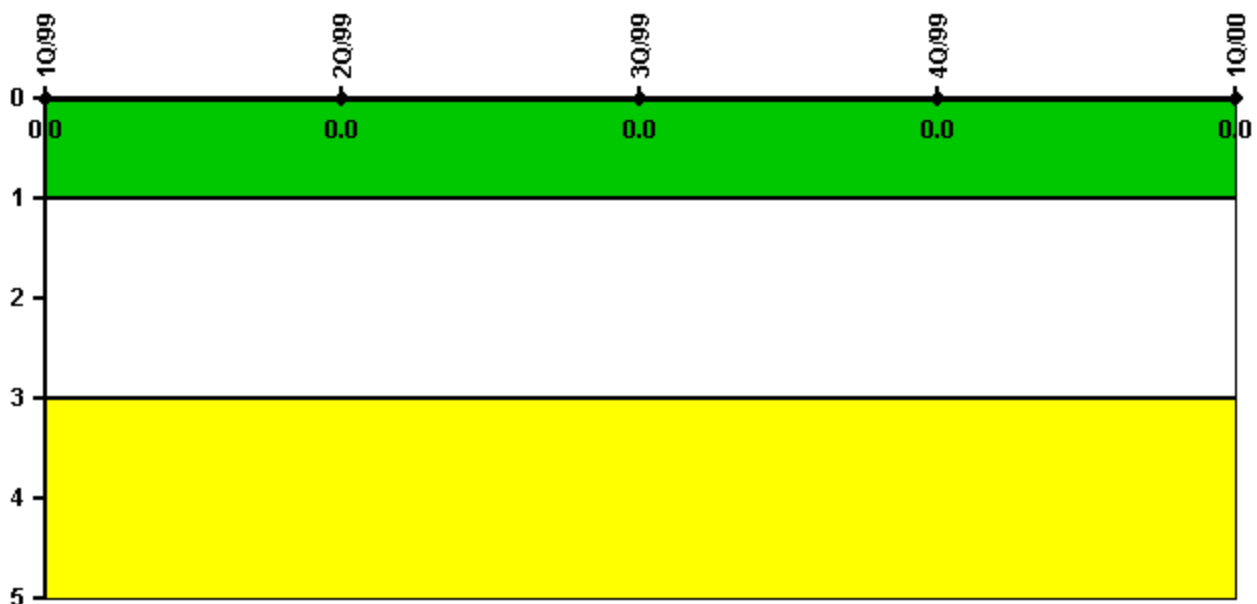


Thresholds: White > 1.0 Yellow > 3.0

Notes

RETS/ODCM Radiological Effluent	1Q/99	2Q/99	3Q/99	4Q/99	1Q/00
RETS/ODCM occurrences	0	0	0	0	0
Indicator value	0	0	0	0	0

Licensee Comments: none

Protected Area Security Performance Index

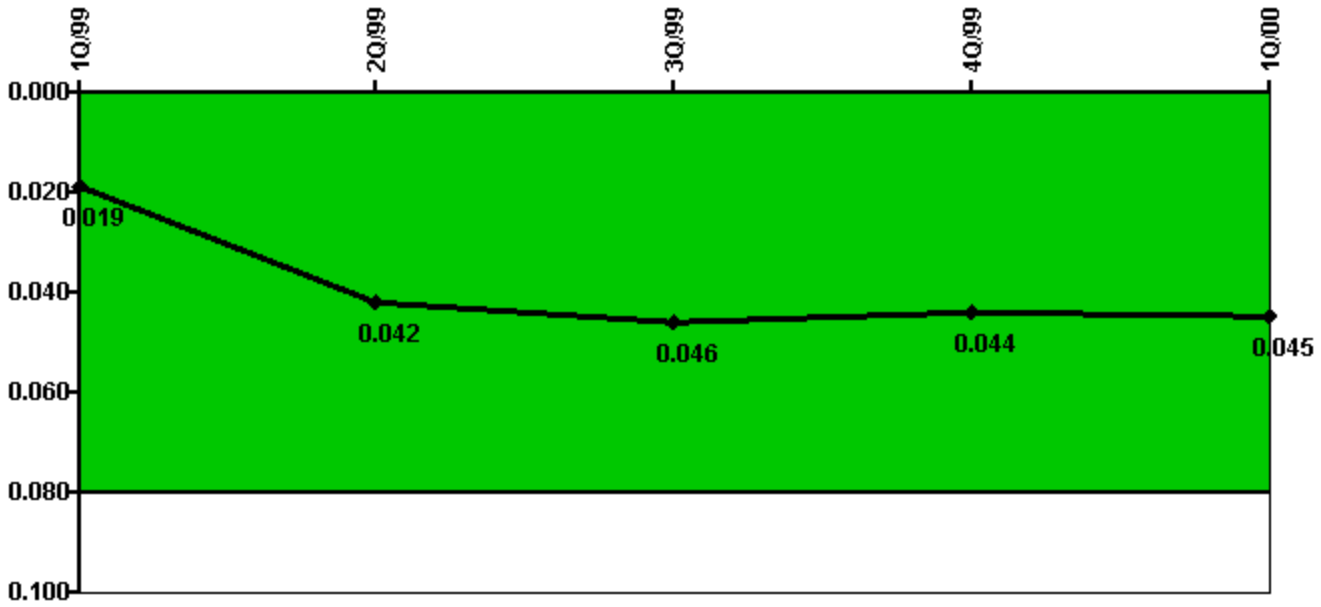


Thresholds: White > 0.080

Notes

Protected Area Security Performance Index	1Q/99	2Q/99	3Q/99	4Q/99	1Q/00
IDS compensatory hours	157.00	26.60	146.10	40.40	157.30
CCTV compensatory hours	0	411.3	2.5	8.0	0
IDS normalization factor	1.00	1.00	1.00	1.00	1.00
CCTV normalization factor	1.0	1.0	1.0	1.0	1.0
Index Value	0.019	0.042	0.046	0.044	0.045

Licensee Comments: none

Personnel Screening Program

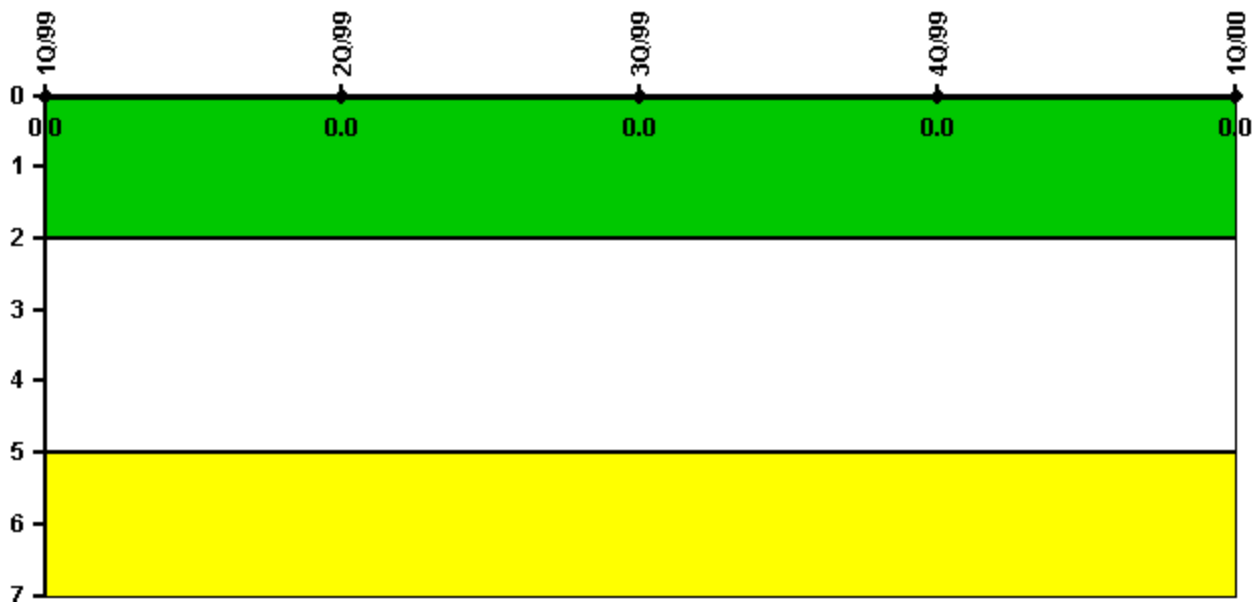


Thresholds: White > 2.0 Yellow > 5.0

Notes

Personnel Screening Program	1Q/99	2Q/99	3Q/99	4Q/99	1Q/00
Program failures	0	0	0	0	0
Indicator value	0	0	0	0	0

Licensee Comments: none

FFD/Personnel Reliability

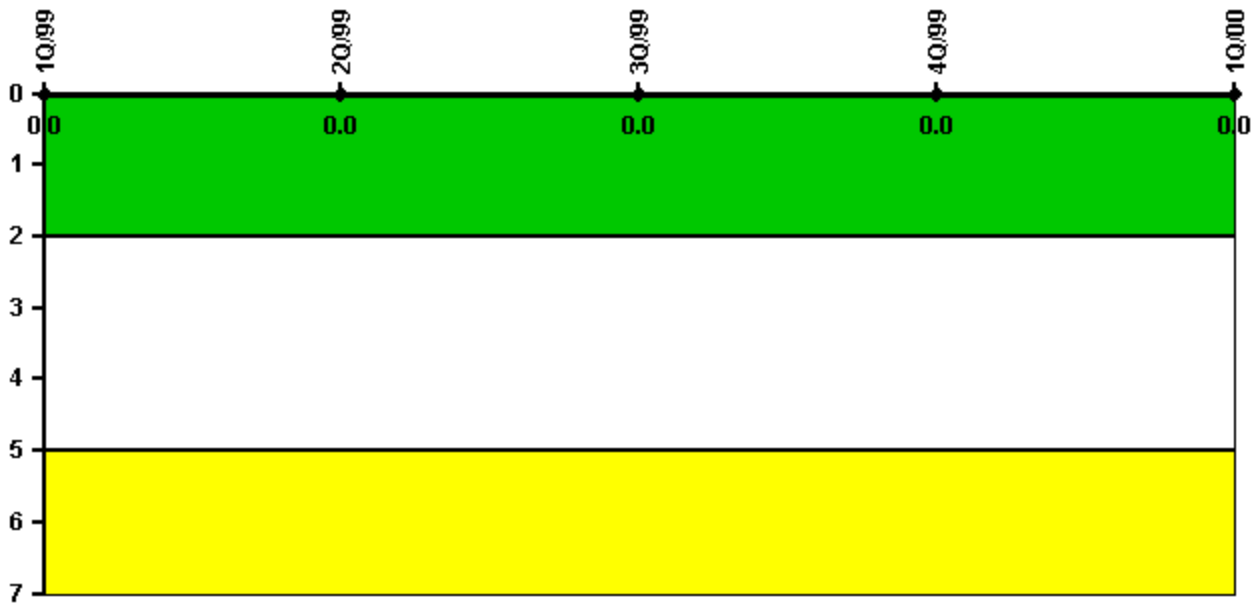

Thresholds: White > 2.0 Yellow > 5.0

Notes

FFD/Personnel Reliability	1Q/99	2Q/99	3Q/99	4Q/99	1Q/00
Program Failures	0	0	0	0	0
Indicator value	0	0	0	0	0

Licensee Comments: none

▲ [PI Summary](#) | [Inspection Findings Summary](#) | [Reactor Oversight Process](#)

Last Modified: April 1, 2002