


La Salle 1

2Q/2004 Performance Indicators

Licensee's General Comments: none

Unplanned Scrams per 7000 Critical Hrs

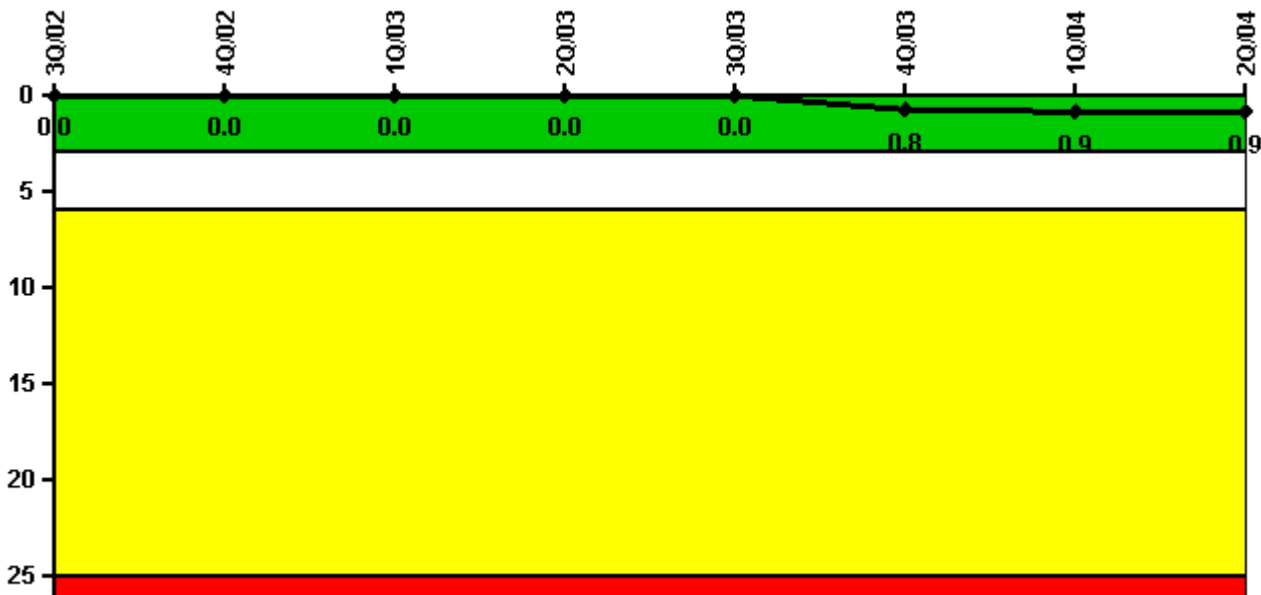


Thresholds: White > 3.0 Yellow > 6.0 Red > 25.0

Notes

Unplanned Scrams per 7000 Critical Hrs	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04	2Q/04
Unplanned scrams	0	0	0	0	0	1.0	0	0
Critical hours	2208.0	2209.0	2160.0	2183.0	2208.0	2179.8	1489.1	2183.0
Indicator value	0	0	0	0	0	0.8	0.9	0.9

Licensee Comments: none

Scrams with Loss of Normal Heat Removal

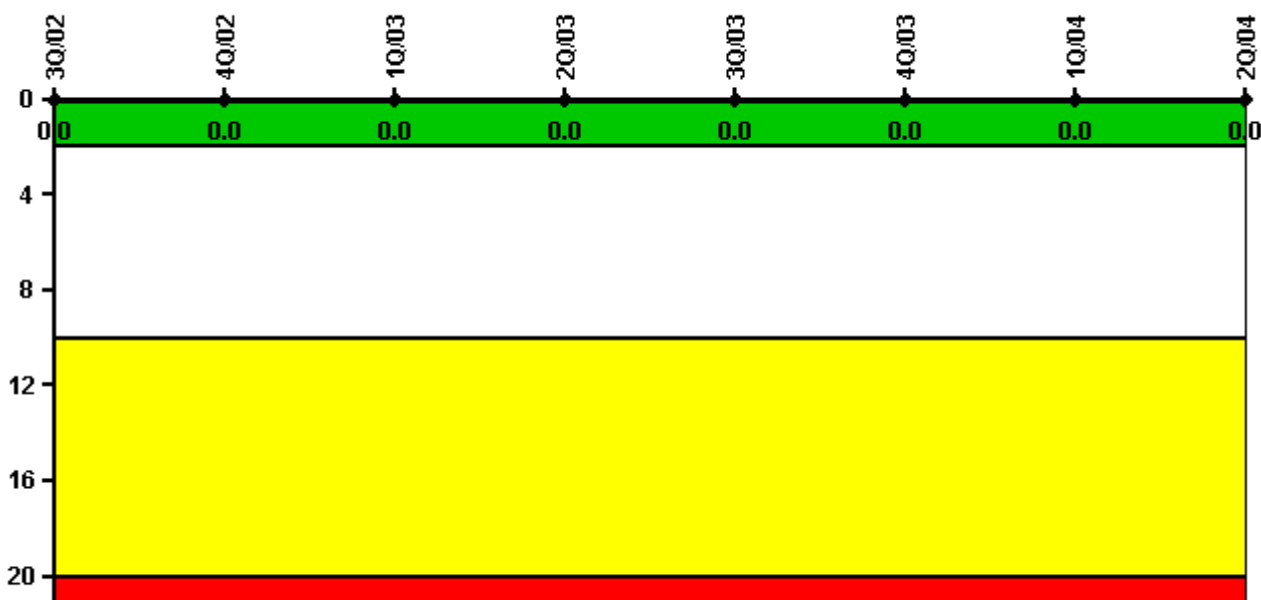


Thresholds: White > 2.0 Yellow > 10.0 Red > 20.0

Notes

Scrams with Loss of Normal Heat Removal	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04	2Q/04
Scrams	0	0	0	0	0	0	0	0
Indicator value	0	0	0	0	0	0	0	0

Licensee Comments: none

Unplanned Power Changes per 7000 Critical Hrs

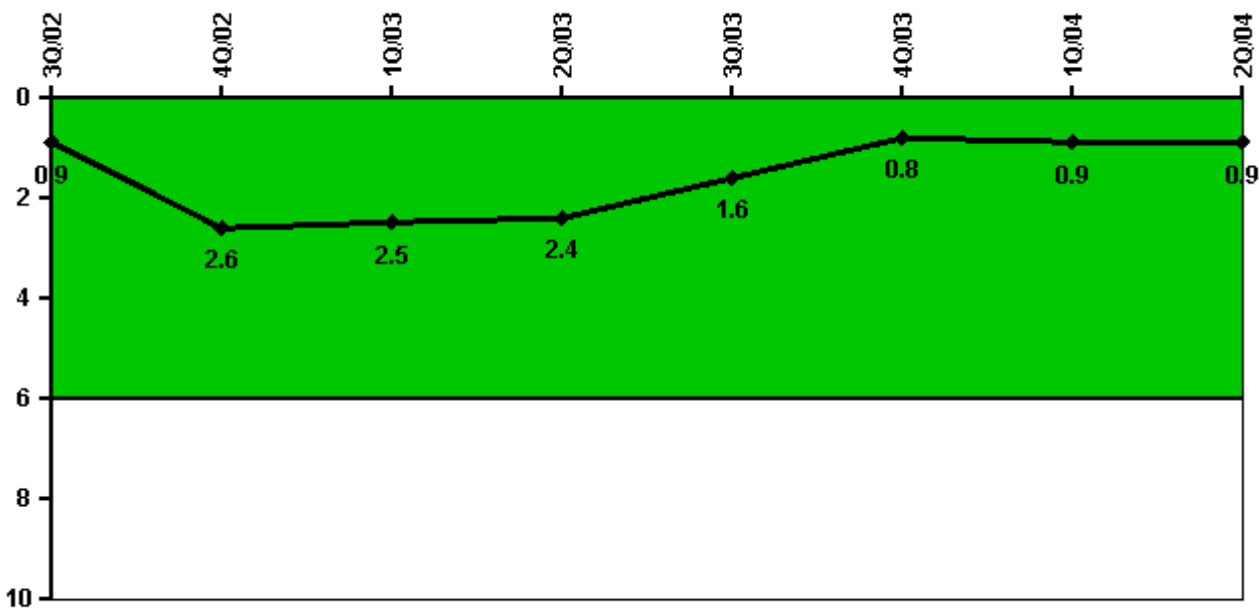


Thresholds: White > 6.0

Notes

Unplanned Power Changes per 7000 Critical Hrs	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04	2Q/04
Unplanned power changes	1.0	2.0	0	0	0	1.0	0	0
Critical hours	2208.0	2209.0	2160.0	2183.0	2208.0	2179.8	1489.1	2183.0
Indicator value	0.9	2.6	2.5	2.4	1.6	0.8	0.9	0.9

Licensee Comments: none

Safety System Unavailability, Emergency AC Power, >2EDG

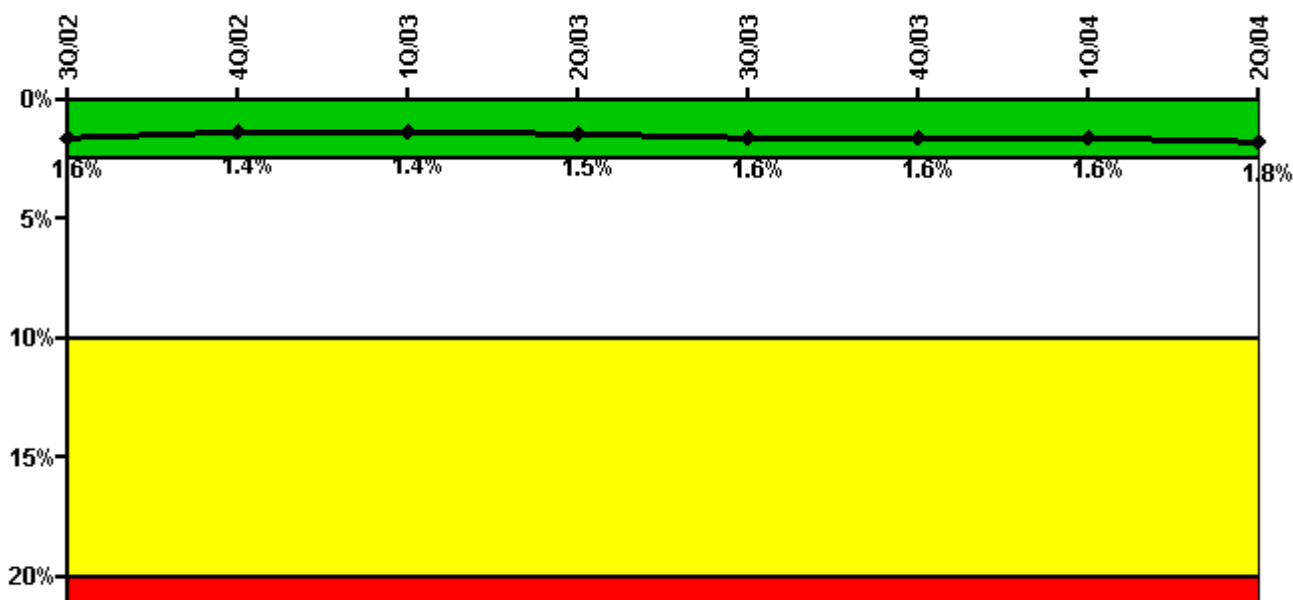


Thresholds: White > 2.5% Yellow > 10.0% Red > 20.0%

Notes

Safety System Unavailability, Emergency AC Power, >2EDG	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04	2Q/04
Train 1								
Planned unavailable hours	82.40	1.13	33.00	21.60	43.63	7.52	0.50	58.03
Unplanned unavailable hours	28.00	0	0	51.15	0	0	0	0
Fault exposure hours	0	0	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0	0	0
Required hours	2208.00	2209.00	2160.00	2183.00	2208.00	2209.00	2184.00	2183.00
Train 2								
Planned unavailable hours	1.00	1.00	69.53	23.13	7.30	15.66	83.49	0.75
Unplanned unavailable hours	0	0	0	0.87	0	0	0	0
Fault exposure hours	0	0	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0	0	0
Required hours	2208.00	2209.00	2160.00	2183.00	2208.00	2209.00	2184.00	2183.00
Train 3								
Planned unavailable hours	0.75	0.98	1.12	104.83	0.75	45.03	0.75	91.30
Unplanned unavailable hours	0	0	0	0	0	0	0	0
Fault exposure hours	0	0	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0	0	0
Required hours	2208.00	2209.00	2160.00	2183.00	2208.00	2209.00	2184.00	2183.00
Indicator value	1.6%	1.4%	1.4%	1.5%	1.6%	1.6%	1.6%	1.8%

Licensee Comments: none

Safety System Unavailability, High Pressure Injection System (HPCS)

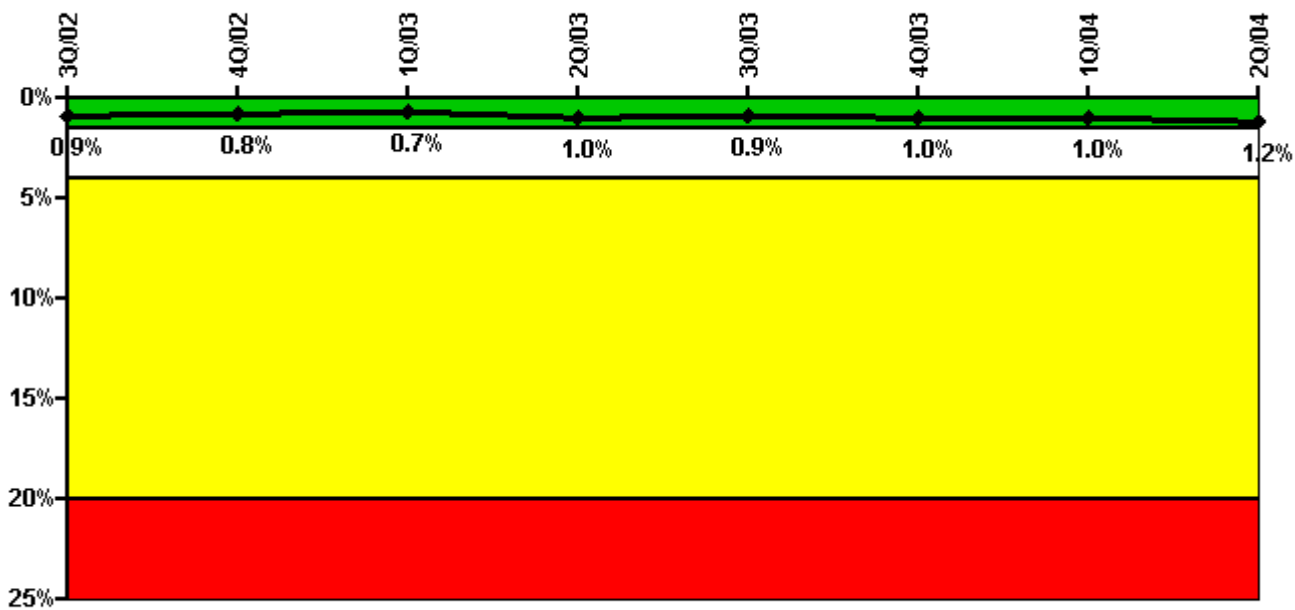


Thresholds: White > 1.5% Yellow > 4.0% Red > 20.0%

Notes

Safety System Unavailability, High Pressure Injection System (HPCS)	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04	2Q/04
Train 1								
Planned unavailable hours	0	0	0	62.85	0	20.57	0	85.17
Unplanned unavailable hours	0	0.60	0	0	0	0	0	0
Fault exposure hours	0	0	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0	0	0
Required hours	2208.00	2209.00	2160.00	2183.00	2208.00	2179.80	1489.03	2183.00
Indicator value	0.9%	0.8%	0.7%	1.0%	0.9%	1.0%	1.0%	1.2%

Licensee Comments: none

Safety System Unavailability, Heat Removal System (RCIC)

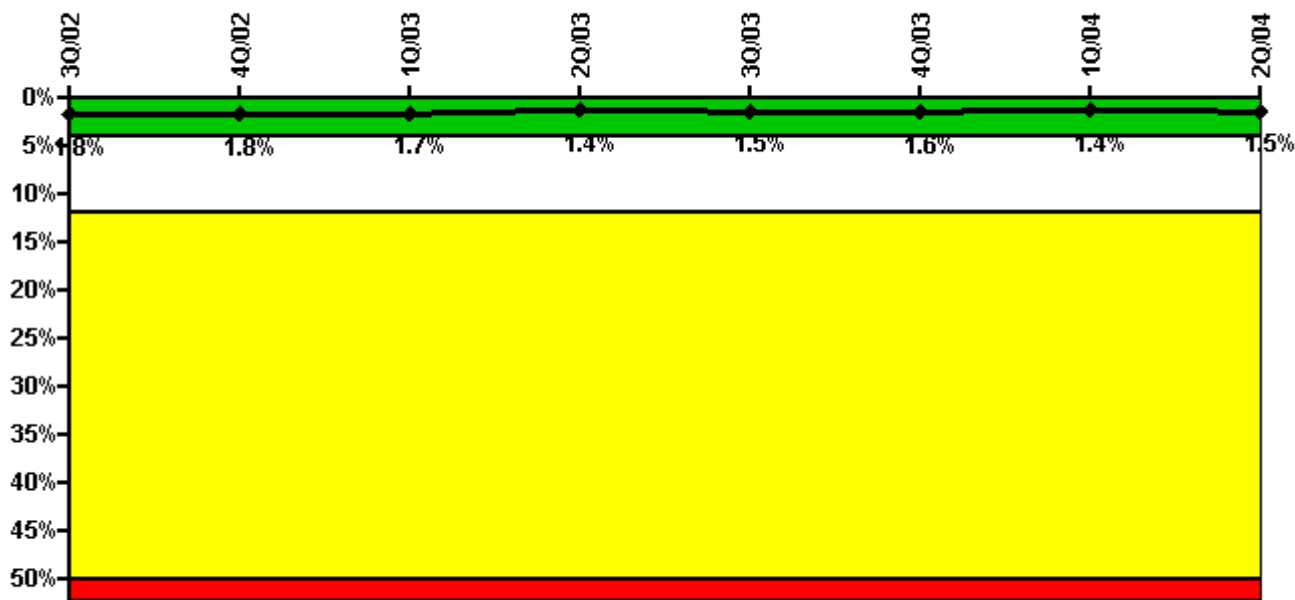


Thresholds: White > 4.0% Yellow > 12.0% Red > 50.0%

Notes

Safety System Unavailability, Heat Removal System (RCIC)	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04	2Q/04
Train 1								
Planned unavailable hours	61.30	15.90	0.30	40.40	15.12	37.50	18.03	16.95
Unplanned unavailable hours	20.10	0.40	0	6.60	9.10	0	2.12	0
Fault exposure hours	0	0	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0	0	0
Required hours	2208.00	2209.00	2160.00	2183.00	2208.00	2179.80	1489.03	2183.00
Indicator value	1.8%	1.8%	1.7%	1.4%	1.5%	1.6%	1.4%	1.5%

Licensee Comments: none

Safety System Unavailability, Residual Heat Removal System

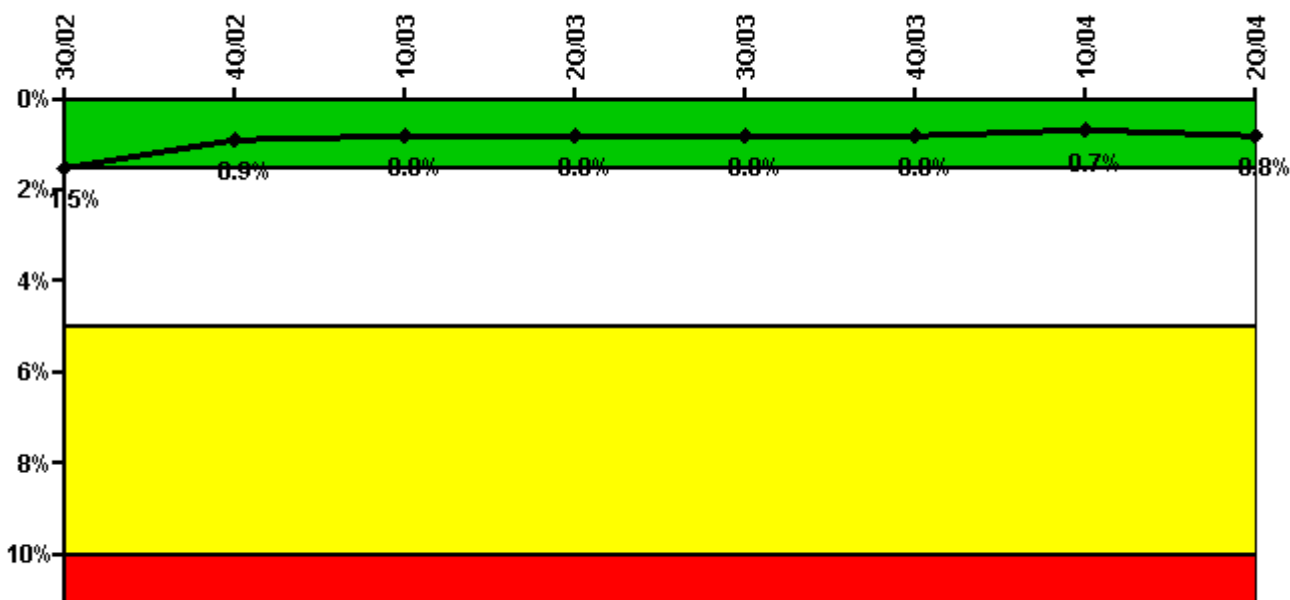


Thresholds: White > 1.5% Yellow > 5.0% Red > 10.0%

Notes

Safety System Unavailability, Residual Heat Removal System	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04	2Q/04
Train 1								
Planned unavailable hours	42.00	11.40	0	45.40	0	0	0	13.27
Unplanned unavailable hours	20.10	0.30	0	0	0	0	11.87	0
Fault exposure hours	0	0	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0	0	0
Required hours	2208.00	2209.00	2160.00	2183.00	2208.00	2209.00	2184.00	2183.00
Train 2								
Planned unavailable hours	16.80	0	0	13.70	17.30	0	14.49	32.97
Unplanned unavailable hours	0	1.10	0.80	1.00	0	0	0	0
Fault exposure hours	0	0	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0	0	0
Required hours	2208.00	2209.00	2160.00	2183.00	2208.00	2209.00	2184.00	2183.00
Indicator value	1.5%	0.9%	0.8%	0.8%	0.8%	0.8%	0.7%	0.8%

Licensee Comments: none

Safety System Functional Failures (BWR)

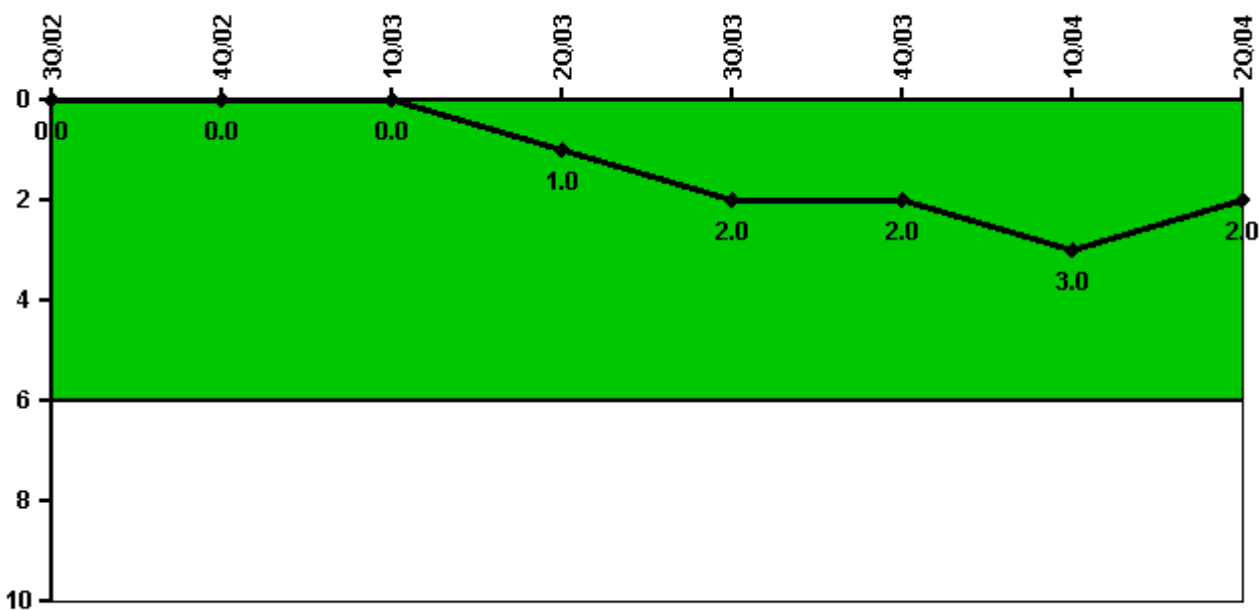


Thresholds: White > 6.0

Notes

Safety System Functional Failures (BWR)	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04	2Q/04
Safety System Functional Failures	0	0	0	1	1	0	1	0
Indicator value	0	0	0	1	2	2	3	2

Licensee Comments: none

Reactor Coolant System Activity

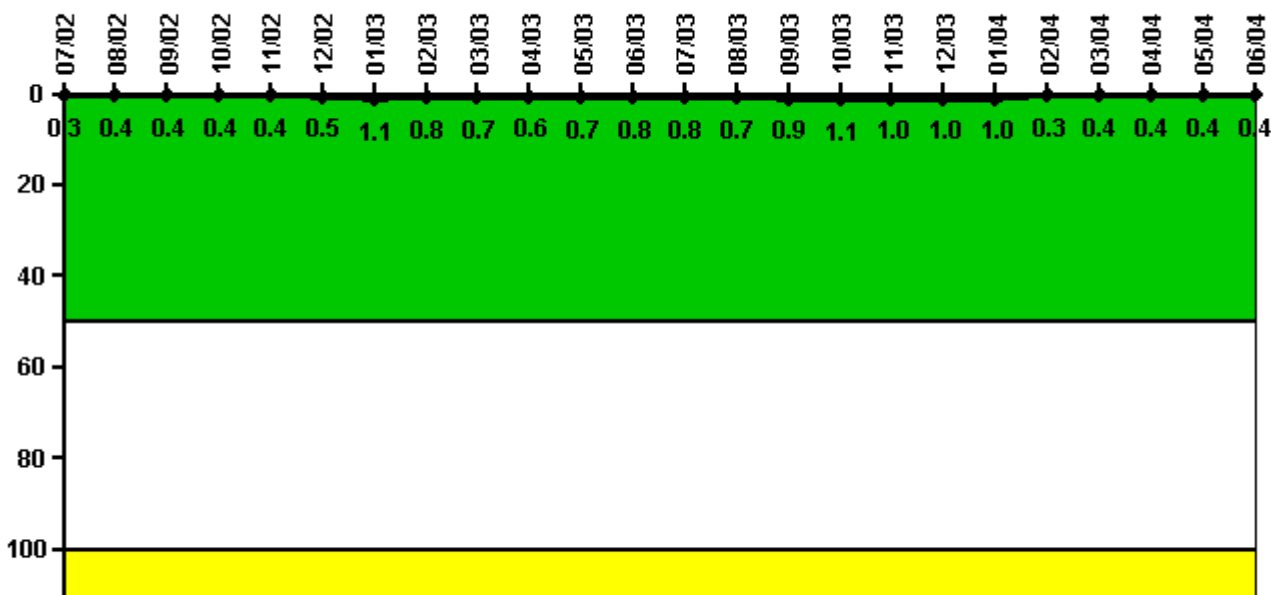


Thresholds: White > 50.0 Yellow > 100.0

Notes

Reactor Coolant System Activity	7/02	8/02	9/02	10/02	11/02	12/02	1/03	2/03	3/03	4/03	5/03	6/03
Maximum activity	0.000685	0.000764	0.000771	0.000804	0.000800	0.000912	0.002110	0.001690	0.001350	0.001140	0.001310	0.001550
Technical specification limit	0.2	0.2	0.2	0.2	0.2	0.2	0.2	0.2	0.2	0.2	0.2	0.2
Indicator value	0.3	0.4	0.4	0.4	0.4	0.5	1.1	0.8	0.7	0.6	0.7	0.8
Reactor Coolant System Activity	7/03	8/03	9/03	10/03	11/03	12/03	1/04	2/04	3/04	4/04	5/04	6/04
Maximum activity	0.001610	0.001480	0.001810	0.002250	0.001950	0.002030	0.001920	0.000680	0.000898	0.000854	0.000748	0.000809
Technical specification limit	0.2	0.2	0.2	0.2	0.2	0.2	0.2	0.2	0.2	0.2	0.2	0.2
Indicator value	0.8	0.7	0.9	1.1	1.0	1.0	1.0	0.3	0.4	0.4	0.4	0.4

Licensee Comments: none

Reactor Coolant System Leakage

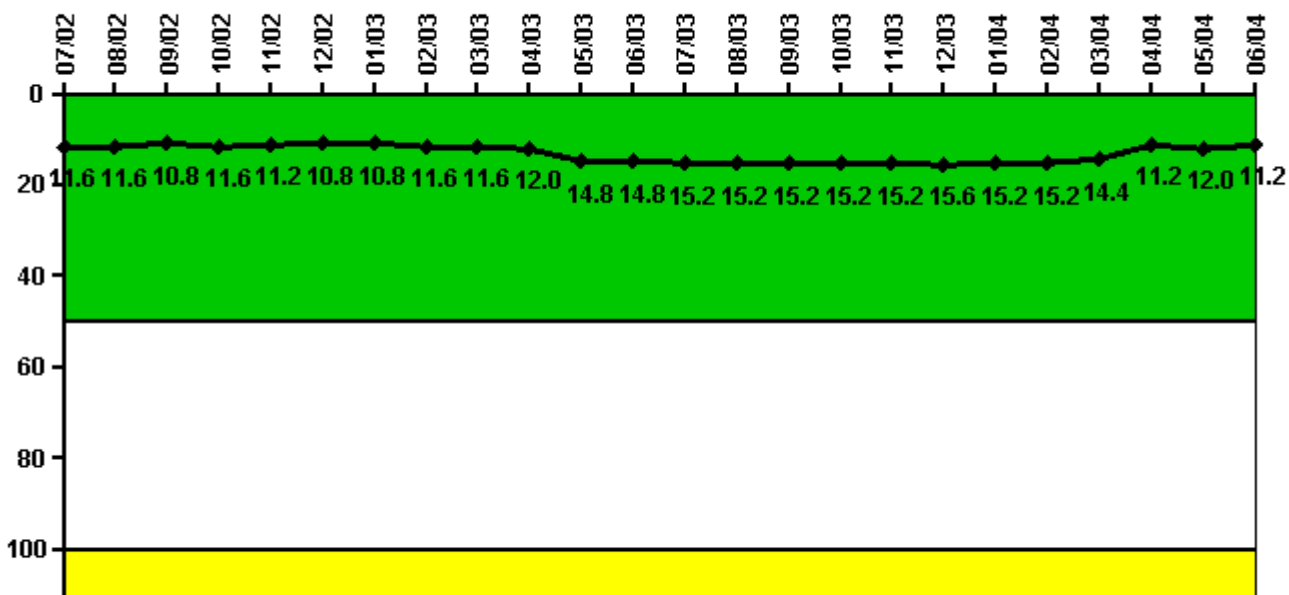

Thresholds: White > 50.0 Yellow > 100.0


Notes

Reactor Coolant System Leakage	7/02	8/02	9/02	10/02	11/02	12/02	1/03	2/03	3/03	4/03	5/03	6/03
Maximum leakage	2.900	2.900	2.700	2.900	2.800	2.700	2.700	2.900	2.900	3.000	3.700	3.700
Technical specification limit	25.0	25.0	25.0	25.0	25.0	25.0	25.0	25.0	25.0	25.0	25.0	25.0
Indicator value	11.6	11.6	10.8	11.6	11.2	10.8	10.8	11.6	11.6	12.0	14.8	14.8

Reactor Coolant System Leakage	7/03	8/03	9/03	10/03	11/03	12/03	1/04	2/04	3/04	4/04	5/04	6/04
Maximum leakage	3.800	3.800	3.800	3.800	3.800	3.900	3.800	3.800	3.600	2.800	3.000	2.800
Technical specification limit	25.0	25.0	25.0	25.0	25.0	25.0	25.0	25.0	25.0	25.0	25.0	25.0
Indicator value	15.2	15.2	15.2	15.2	15.2	15.6	15.2	15.2	14.4	11.2	12.0	11.2

Licensee Comments: none

Drill/Exercise Performance

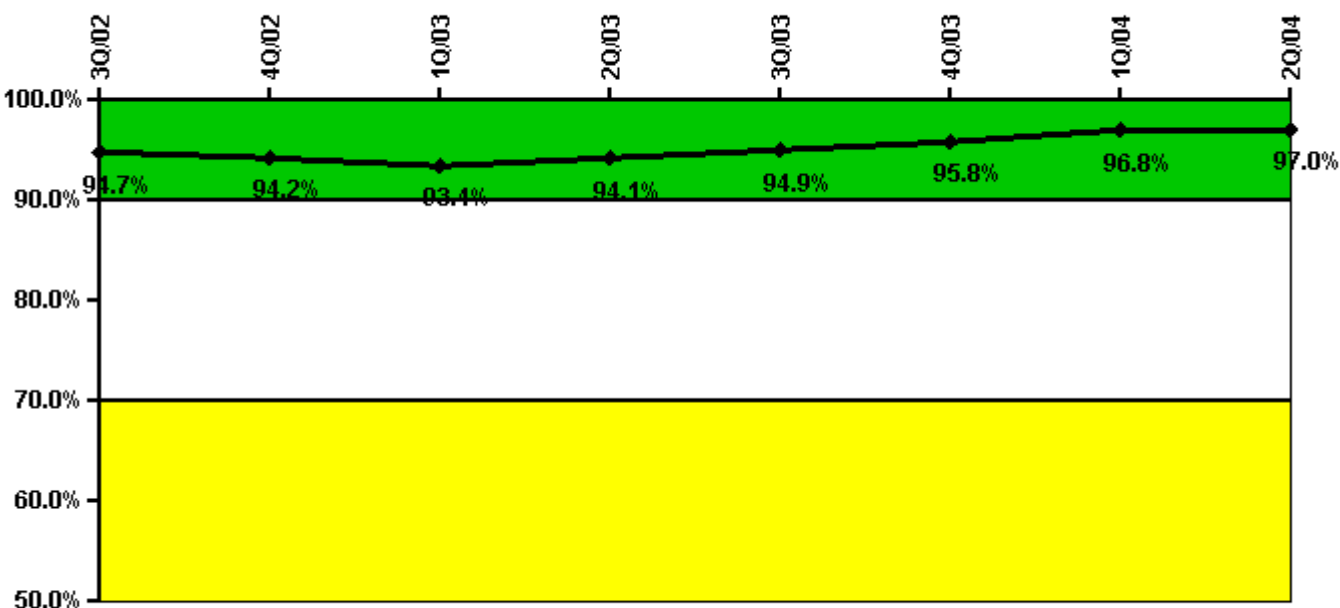


Thresholds: White < 90.0% Yellow < 70.0%

Notes

Drill/Exercise Performance	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04	2Q/04
Successful opportunities	47.0	17.0	13.0	46.0	45.0	32.0	30.0	29.0
Total opportunities	48.0	18.0	14.0	47.0	48.0	32.0	30.0	30.0
Indicator value	94.7%	94.2%	93.4%	94.1%	94.9%	95.8%	96.8%	97.0%

Licensee Comments: none

ERO Drill Participation

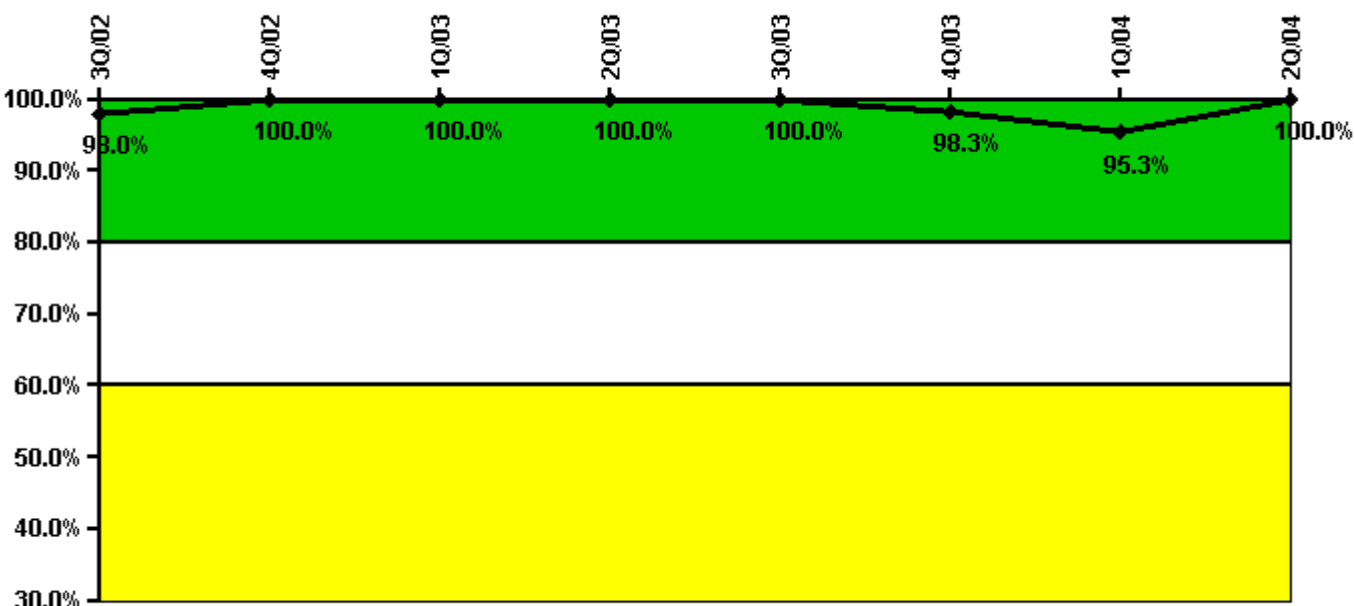

Thresholds: White < 80.0% Yellow < 60.0%


Notes

ERO Drill Participation	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04	2Q/04
Participating Key personnel	50.0	51.0	54.0	53.0	56.0	59.0	61.0	65.0
Total Key personnel	51.0	51.0	54.0	53.0	56.0	60.0	64.0	65.0
Indicator value	98.0%	100.0%	100.0%	100.0%	100.0%	98.3%	95.3%	100.0%

Licensee Comments:

2Q/04: The number of key ERO members and the number that have participated in the previous 24 months has been revised upwards by two (2) for the period November 2003 - March 2004. A Shift Manager had been qualified that the EP organization had not been made aware of. Shift Managers are also credited in the Emergency Communicator position. This occurrence has been entered into the Station's corrective action program.

Alert & Notification System

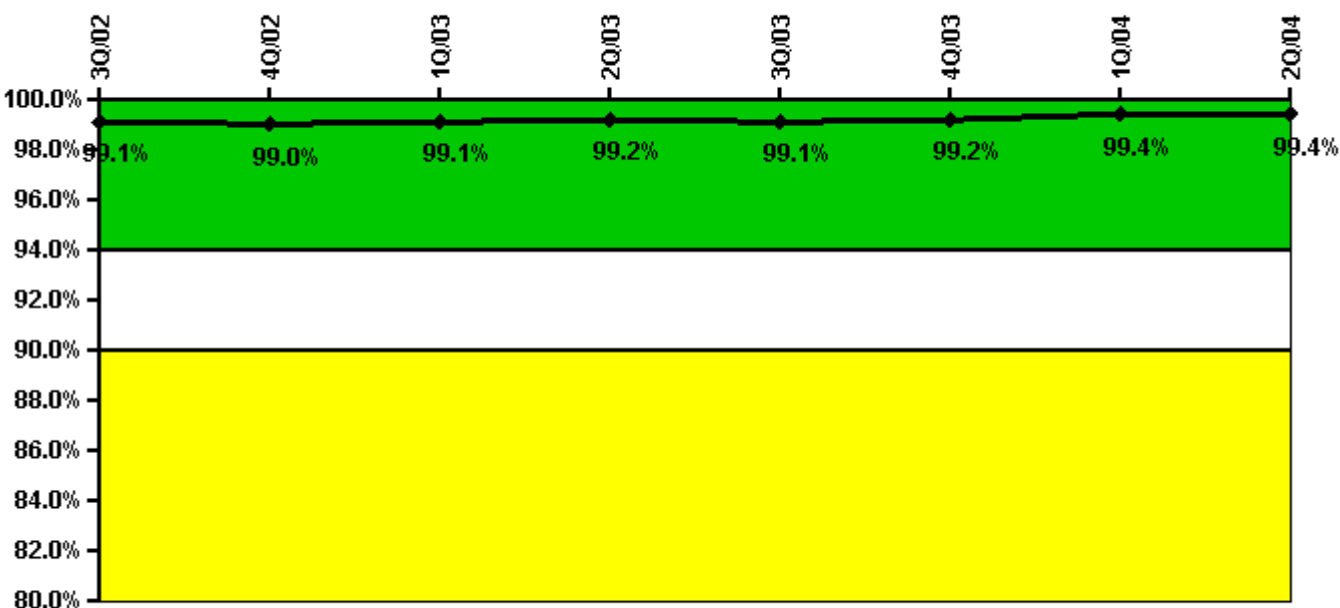


Thresholds: White < 94.0% Yellow < 90.0%

Notes

Alert & Notification System	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04	2Q/04
Successful siren-tests	2160	2489	3129	3173	3159	3192	3194	3180
Total sirens-tests	2176	2512	3150	3200	3200	3200	3200	3200
Indicator value	99.1%	99.0%	99.1%	99.2%	99.1%	99.2%	99.4%	99.4%

Licensee Comments: none

Occupational Exposure Control Effectiveness

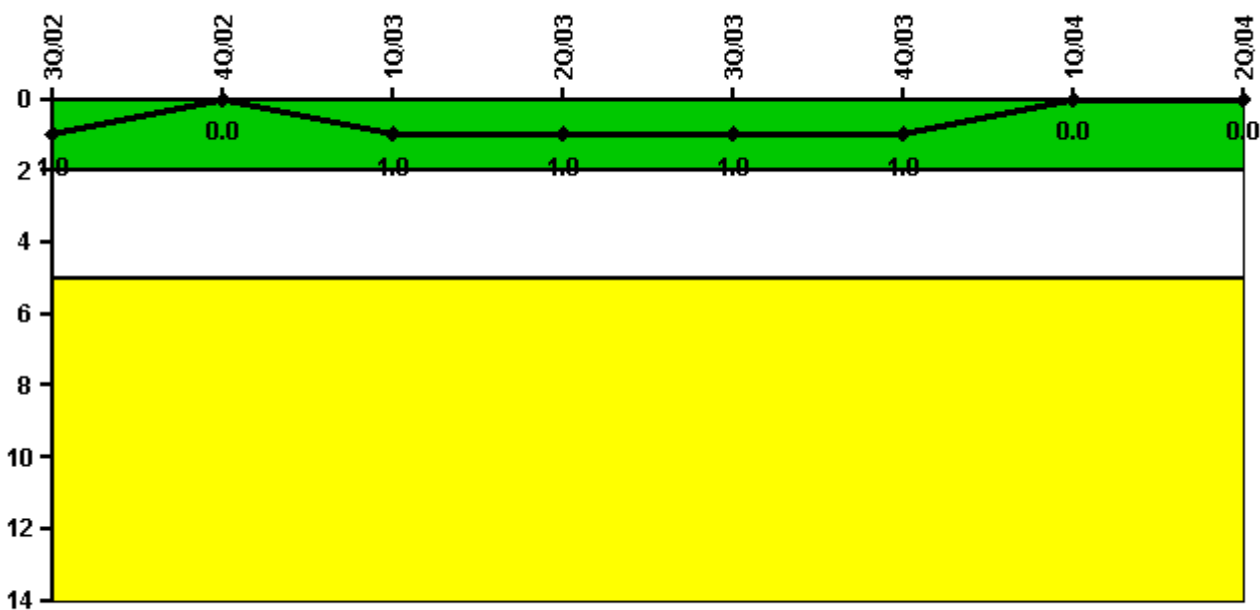

Thresholds: White > 2.0 Yellow > 5.0

Notes

Occupational Exposure Control Effectiveness	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04	2Q/04
High radiation area occurrences	0	0	1	0	0	0	0	0
Very high radiation area occurrences	0	0	0	0	0	0	0	0
Unintended exposure occurrences	0	0	0	0	0	0	0	0
Indicator value	1	0	1	1	1	1	0	0

Licensee Comments: none

RETS/ODCM Radiological Effluent



Thresholds: White > 1.0 Yellow > 3.0

Notes

RETS/ODCM Radiological Effluent	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04	2Q/04
RETS/ODCM occurrences	0	0	0	0	0	0	0	0
Indicator value	0	0	0	0	0	0	0	0

Licensee Comments: none

[Physical Protection](#) information not publicly available.

▲ [Action Matrix Summary](#) | [Inspection Findings Summary](#) | [PI Summary](#) | [Reactor Oversight Process](#)

Last Modified: September 8, 2004