
NASA- CR--183940

TWR-18898

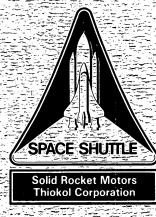

# Qualification of the RSRM Case Membrane Case-to-Insulation Bondline Inspection Using the Thiokol Corporation Ultrasonic RSRM Bondline Inspection System

**Final Test Report** 

## April 1990

Contract No NAS8-30490 DR No 5-3 WBS No 48102-10-10 ECS No SS2412

Thickol CORPORATION

SPACE OPERATIONS

Publications No. 90509

P.O. Box 707, Brigham City, UT. 84302-0707, (801) 863-3511

(NASA-CR-183940)QUALIFICATION OF THE RSRMN90-22602CASE MEMBRANE CASE-TO-INSULATION BONDLINEINSPECTION USING THE THIOKOL CORPORATIONULTRASONIC RSRM BONDLINE INSPECTION SYSTEMUnclasULTRASONIC RSRM BONDLINE INSPECTION SYSTEMUnclasUnclasFinal Test Report (Thiokol Corp.)43 pH1/20U278782

COLOR ILL.

Thickol corporation SPACE OPERATIONS

١

**TWR-18898** 

Qualification of the RSRM Case Membrane **Case-to-Insulation Bondline Inspection** Using the Thiokol Corporation Ultrasonic **RSRM Bondline Inspection System** Final Test Report

Prepared by:

**ORIGINAL CONTAINS COLOR ILLUSTRATIONS** 

Mant look 27 MAR 90

Test Planning and Reports Systems Engineer

Approved by:

**Requirements** Manager

Program Management

System Integration Engineer

90\_ uner 27 Mar Design Engineer

MARDAT Program Management

-90 System Safet

29-90 Data Management

ECS No. SS2412

ORIGINAL PAGE IS OF POOR QUALITY

Thickol corporation SPACE OPERATIONS

### ABSTRACT

Qualification testing of Combustion Engineering's Amdata Intraspect/98 Data Acquisition and Imaging System that applies to the redesigned solid rocket motor case membrane case-to-insulation bondline inspection was performed on 29 Jan 1990. Testing was performed at M-67, the Thiokol Corporation RSRM Assembly Facility. The purpose of the inspection is to verify the integrity of the case membrane caseto-insulation bondline.

The case membrane scanner was calibrated on the redesigned solid rocket motor case segment calibration standard, which had an intentional 1.0 by 1.0-in. case-toinsulation unbond. The case membrane scanner was then used to scan a 20 by 20-in. membrane area of the case segment. Calibration of the scanner was then rechecked on the calibration standard to ensure that the calibration settings did not change during the case membrane scan. This procedure was successfully performed five times to qualify the unbond detection capability of the case membrane scanner.

DOC NO.	TWR-18898		VOL
SEC		PAGE	ii

REVISION \_\_\_\_\_

Thickol corporation space operations

4

,

## CONTENTS

<u>Section</u>		Page
1	INTRODUCTION	1
	1.1 TEST ARTICLE DESCRIPTION	1
2	OBJECTIVES	5
3	EXECUTIVE SUMMARY	6
	3.1 SUMMARY	6
	3.2 CONCLUSIONS	6
	3.3 RECOMMENDATIONS	8
4	INSTRUMENTATION	9
5	PHOTOGRAPHY	9
6	RESULTS AND DISCUSSION	10
	6.1 TEST ARTICLE COMPONENT DESCRIPTION	10
	6.2 INSPECTION SCAN PARAMETERS	10
	6.3 TEST DESCRIPTION, RESULTS, AND DISCUSSION	11
7	APPLICABLE DOCUMENTS	37

DOC NO. TWR-18898		VOL
SEC	PAGE	iii

REVISION \_\_\_\_\_\_ 90509-1.2

Thickol corporation SPACE OPERATIONS

### **FIGURES**

#### Figure Page Case Membrane Scanner (without transducer assembly) ..... Case Membrane Scanner Transducer Configuration Case Membrane Scanner Configuration Calibration Block Setup Case Membrane Scanner Installation Case Membrane Scanner Calibration Run ..... Workstand and Segment Couplant Recovery System Configuration Vacuum Track Installation on Segment Case Membrane Scanner Installation on Vacuum Track Case Membrane Scanning Sequence on Segment ..... Calibration-in Sequence--Scan Run No. 1 ..... Scanning Sequence--Scan Run No. 1 ..... Calibration-out Sequence--Scan Run No. 1 ..... Calibration-in Sequence--Scan Run No. 2 Scanning Sequence--Scan Run No. 2 ..... Calibration-out Sequence--Scan Run No. 2 Calibration-in Sequence--Scan Run No. 3 ..... Scanning Sequence--Scan Run No. 3 ..... Calibration-out Sequence--Scan Run No. 3 ..... Calibration-in Sequence--Scan Run No. 4 ..... Scanning Sequence--Scan Run No. 4 ..... Calibration-out Sequence--Scan Run No. 4 Calibration-in Sequence--Scan Run No. 5 Scanning Sequence--Scan Run No. 5 Calibration-out Sequence--Scan Run No. 5

DOC NO.	TWR-18898		VOL
SEC		PAGE	iv

Thickol corporation space operations

э

.

## **ACRONYMS**

RF	radio frequency
RSRM	redesigned solid rocket motor
URBIS	ultrasonic RSRM bondline inspection system

DOC NO. TWR-18898		VOL
SEC	PAGE	v

REVISION \_\_\_\_\_ 90509-1.4

Thickol CORPORATION SPACE OPERATIONS

1

### INTRODUCTION

This report presents the procedures, performance, and results of the qualification test for Combustion Engineering's Amdata Intraspect/98 Data Acquisition and Imaging System that apply to the redesigned solid rocket motor (RSRM) case membrane case-to-insulation bondline inspection. The purpose of the inspection is to verify the integrity of the case membrane area case-to-insulation bondline. The inspection is performed at Thiokol Corporation's Space Operations facility in Utah. The Intraspect/98 system is referred to as the Thiokol Corporation Ultrasonic RSRM Bondline Inspection System (URBIS) (C77-0479).

Testing was conducted in accordance with CTP-0088, Qualification Plan for the Ultrasonic Inspection of the RSRM Membrane Case/Insulation Bondline Utilizing the Thiokol Corporation Ultrasonic RSRM Bondline Inspection System. Testing was performed on 30 Jan 1990 at M-67, Thiokol's RSRM Assembly Facility.

The URBIS functions by transmitting ultrasonic signals (pulse-echo) from the transducer surface to the case surface through a liquid couplant. A return signal is then received by the transducer. This return signal is amplified, filtered, digitized, and processed for display. During an inspection, a well-bonded case-to-insulation interface will reflect a small signal, while an air-backed unbonded region will reflect a larger signal.

Qualification testing of the URBIS components that are generic to all inspections (capture feature, clevis, pinholes, and membrane) has been performed under CTP-0100 and is documented in TWR-18894. It is recommended that these documents and CTP-0088 be referred to for additional explanation of URBIS components and test procedures.

#### 1.1 TEST ARTICLE DESCRIPTION

The case membrane scanner consists of a transducer assembly and the Amaps 2090 scanner (scanner arm and drive mechanism) (Figures 1 and 2). An ultrasonic

DOC NO.	TWR-18898		VOL
SEC		PAGE	1


90509-1.3

REVISION

Thickol corporation SPACE OPERATIONS

Top View

Side View

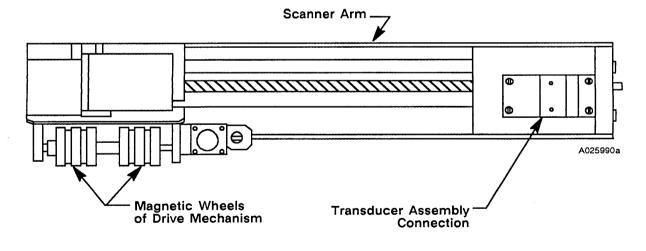


Note: Not to scale

Figure 1. Case Membrane Scanner (without transducer assembly)

REVISION	DOC NO.	TWR-18898	3	VOL
	SEC		PAGE	2

Thickol CORPORATION

SPACE OPERATIONS

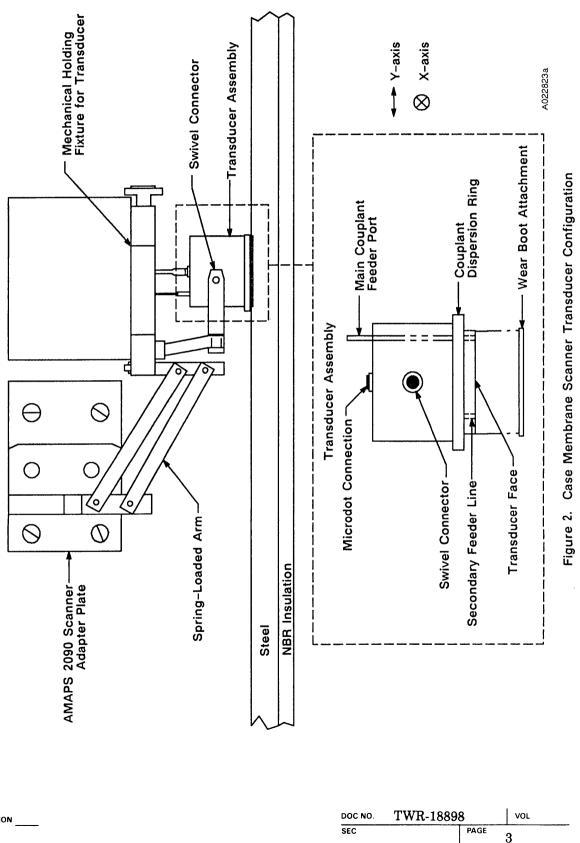

REVISION

Thickol CORPORATION SPACE OPERATIONS

transducer is positioned and held in place within the transducer assembly. The 0.50-in.-diameter broadband transducer has a center frequency of 5.0 MHz. Couplant feeder ports are integrated directly into the transducer assembly to provide a conductive interface between the transducer and the RSRM case. During a case scan, couplant is captured by a plastic retrieval system. The transducer is coil spring-loaded within the nylon transducer assembly. A vacuum track is attached directly to the case to guide the scanner. The case membrane scanner is part of the URBIS (C77-0479). The URBIS was assembled under 2U129431.

Testing was performed on the RSRM Flight 13A aft loaded segment (P/N 1U76676-07, S/N 0000005) (newly designated as the Flight 12B aft loaded segment). A calibration standard consisting of a section of RSRM case with intentional case-to-insulation unbonds was used to calibrate the case membrane scanner/URBIS. The calibration standard was assembled under 2U129702.

A detailed configuration of the generic URBIS components (Amdata Intraspect 98/Data Acquisition and Imaging System) used in association with the URBIS case membrane case-to-insulation bondline inspection qualification is documented in CTP-0100.

DOC NO.	TWR-18898		VOL
SEC		PAGE	4

REVISION

Thickol CORPORATION SPACE OPERATIONS

#### 2

### **OBJECTIVES**

The objectives of CTP-0088 were intended to qualify the tooling and techniques used in the RSRM case membrane case-to-insulation bondline inspection. The objectives were:

- a. Verify that the ultrasonic inspection kit has the capability of detecting 1.0 by 1.0-in. unbonded surfaces, which are not detectable by visual inspection (CDW2-3452, Para. 3.2.1.1).
- b. Verify that the ultrasonic inspection kit interfaces with the membrane region of the segment and requires no special tools for attachment and release (CDW2-3452, Para. 3.2.1.2).
- c. Verify that the ultrasonic inspection kit can be transported (CDW2-3452, Para. 3.2.8).

DOC NO.	TWR-18898		VOL
SEC		PAGE	5

REVISION

Thickol CORPORATION SPACE OPERATIONS

3

### EXECUTIVE SUMMARY

#### 3.1 SUMMARY

This section contains an executive summary of the key results from test data evaluation. Additional information and details can be found in Section 6.

The case membrane scanner was calibrated on the RSRM case segment calibration standard, which had an intentional 1.0 by 1.0-in. case-to-insulation unbond. The case membrane scanner was then used to scan a 20 by 20-in. membrane area of the case segment. Calibration of the scanner was then rechecked on the calibration standard to ensure that the calibration settings did not change during the case membrane scan. This procedure was successfully performed five times to qualify the unbond detection capability of the case membrane scanner. No unbonds were detected on the case membrane. During the test, the case membrane scanner and the case segment were not degraded.

#### 3.2 CONCLUSIONS

The following columns list the conclusions as they relate specifically to the objectives. Additional information to support each conclusion can be found in Section 6.

DOC NO.	TWR-18898		VOL
SEC		PAGE	6

90509-1.6

REVISION

#### Thickol CORPORATION SPACE OPERATIONS

#### Objective

Verify that the ultrasonic а. inspection kit has the capability of detecting 1.0 by 1.0-in. unbonded surfaces that are not detectable by visual inspection.

- b. Verify that the ultrasonic inspection kit interfaces with the membrane region of the segment and requires no special tools for attachment and release.
- Verify that the ultrasonic C. inspection kit can be transported.

#### CDW2-3452 Paragraph

Para. 3.2.1.1, General Performance. This inspection tool provides a means of detecting subsurface bondline failures that are not detectable by visual inspection. (Compressed "kissing" unbonds are not detectable.) The ultrasonic tool shall have the capability of detecting unbonds of 1.0 by 1.0-in. Use of this tool shall permit unbonds to be detected and repaired before stacking. Use of the inspection kit shall not affect the reusability requirements for the case segment and associated equipment denoted in CPW1-3600, Table IV.

Para. 3.2.1.2. Installation Function. The ultrasonic case to insulation bondline inspection kit shall interface with the field joint (membrane) of segment. Attachment and release of fixture shall be efficient and require no special tools.

Para. 3.2.8, Transportability/Transportation. The case-to-insulation bondline inspection kit, ultrasonic, shall be capable of being handled and transported manually. The kit shall also be capable of being handled and transported by any suitable means during transportation to the launch site. The RSRM segment case-to-insulation bondline inspection kit, ultrasonic, shall be packaged in accordance with NHB 6000.1 to protect it from the shipping environment.

#### Conclusion

Verified. The case membrane scanner was calibrated over an intentional 1.0 by 1.0-in. unbond, then used to scan a 20 by 20-in. area of a case membrane, and then checked for calibration accuracy. This procedure was successfully performed five times. This test qualified the unbond detection capability of the case membrane scanner/ URBIS.

Verified. The case membrane scanner successfully interfaced with the case membrane throughout the scanning procedure, without the aid of additional tools. During the test, the case membrane scanner and the case segment were not degraded.

Verified. The complete URBIS is designed to be broken down into components which are placed in protective cases for transportability. This testing verified the transportability of the case membrane scanner/ URBIS.

DOC NO. TWR-18898 VOL SEC PAGE 7

REVISION

Thickol CORPORATION SPACE OPERATIONS

e

.

#### 3.3 RECOMMENDATION

Based on the successful completion of testing under CTP-0088, the case membrane scanner/URBIS should be considered qualified for RSRM inspections at Thiokol Corporation's Utah Space Operations.

N	DOC NO.	TWR-18898		VOL
9-1.8	SEC		PAGE	8

REVISIO

Thickol CORPORATION SPACE OPERATIONS

,

#### 4

## **INSTRUMENTATION**

Test instruments were electrically zeroed and calibrated in accordance with MIL-STD-45662.

## 5

## PHOTOGRAPHY

Still black and white photographs of the test setup were taken. Copies of the photographs taken (series No. 115650) are available from the Thiokol Corporation Photographic Services department.

DOC NO.	TWR-18898		VOL
SEC		PAGE	9

REVISION

Thickol corporation SPACE OPERATIONS

#### 6

## **RESULTS AND DISCUSSION**

#### 6.1 TEST ARTICLE COMPONENT DESCRIPTION

The following inspection components were used during the CTP-0088 qualification:

Component	Part No.	<u>Serial No.</u>
URBIS	2U129431-01	S-A51868
Amaps 2090 scanner		S-A51869-7
Ultrasonic transducer	TS-196	T8353

Prior to testing, the URBIS used in conjunction with the case membrane inspection was qualified under CTP-0100. The URBIS qualification consisted of routine maintenance, calibration, and an evaluation of the performance of the system.

#### 6.2 INSPECTION SCAN PARAMETERS

The scan parameters used during the calibration sequences and during the case membrane scan are described below. (Additional information on unbond detection is presented in CTP-0100.)

C-scan: This inspection scan presents a planar view of the bondline, giving both unbond size and location within this view. This scan is performed first, primarily to show the location of unbonds.

B-scan: The B-scan inspection presents a cross-sectional view of the test article with respect to the depth of the unbond. This inspection scan is used to measure the intensity of a signal response, enabling the operator to clearly distinguish between bonded and unbonded surfaces. The B-scan is also used to size unbonds.

Radio frequency (RF) waveform: This waveform presents the transducer response signal, in which larger amplitudes indicate unbonds.

DOC NO.	TWR-18898		VOL
SEC		PAGE	10

REVISION

#### Thickol CORPORATION SPACE OPERATIONS

#### 6.3 TEST DESCRIPTION, RESULTS, AND DISCUSSION

Qualification of the case membrane tool and inspection technique consisted of the following three steps:

- 1. The case membrane scanner and the inspection technique were calibrated on the ultrasonic calibration standard (P/N 2U129702), which contained an intentional 1.0 by 1.0-in. case-to-insulation unbond. This calibration, known as "calibration in," enabled operators to clearly distinguish the 1.0 by 1.0-in. unbond from the bonded regions.
- 2. The case membrane scanner was then used to scan a 20 by 20-in. membrane area of the RSRM-13A aft/center segment (P/N 1U76676-07, S/N 0000005). The 20 by 20-in, area was located at the top dead center of the case to allow gravityinduced loads to assist in revealing potential unbonds.
- 3. Calibration of the case membrane scanner and technique (on the calibration standard) was repeated upon completion of the case membrane scanning. This calibration, known as "calibration out", ensured that the initial calibration settings did not change during the case scan.

The three stages of the case membrane scan sequence were successfully performed five times over the same 20 by 20-in. case membrane area to qualify the unbond detection capability of the case membrane scanner. No unbonds were detected on the case membrane.

Photographic coverage of the qualification test is shown in Figures 3 through 11 (photographs of the calibration-out were not taken because this sequence is the same as the calibration-in sequence).


The inspection results are presented in Figures 12 through 26. Each scan sequence run includes the C-scan, the B-scan, and the RF waveform for the calibration-in, the segment scan, and the calibration-out. Figure 12 shows the C and B-scan presentations (unbonded regions shown in red) and the RF waveform unbond signal response for the run No. 1 calibration-in sequence. Figure 13 shows the same information for the 20 by 20-in. case scan (no unbonds were detected). Figure 14 shows the C and B-scan presentations and the RF waveform unbond signal response for the run No 1 calibration-out sequence. Figures 15 through 26 present

DOC NO.	TWR-18898	5	VOL
SEC		PAGE	11

REVISION

Thiokol CORPORATION SPACE OPERATIONS

## ORIGINAL PAGE BLACK AND WHITE PHOTOGRAPH

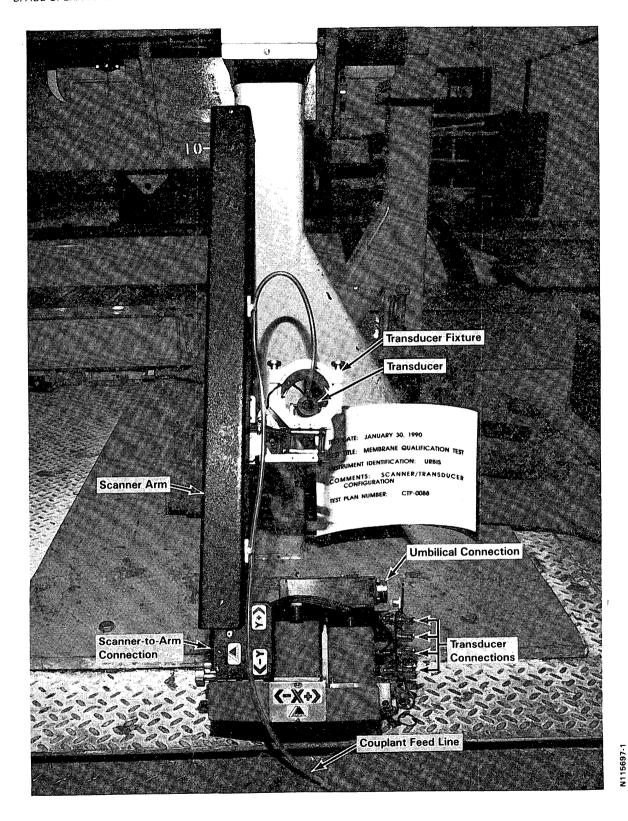

### Figure 3. Case Membrane Scanner Configuration


	DOC NO. TWR-18898	VOL
ORIGINAL PAGE IS	SEC	PAGE 19
OF POOR QUALITY		12

REVISION

90509-2.1



ORIGINAL PAGE BLACK AND WHITE PHOTOGRAPH

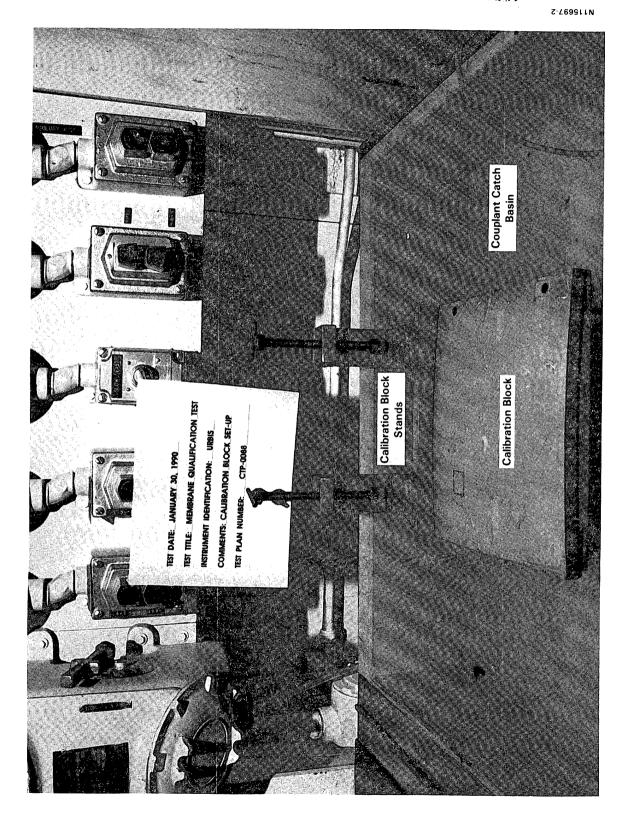

90509-2.18


REVISION

## ORIGINAL PAGE IS OF POOR QUALITY

DOC NO.	TWR-18898		VOL
SEC		PAGE	13

Thickol corporation space operations






Original page is	DOC NO. TWR-18898	VOL
of poor quality	SEC PAC	<sup>3E</sup> 14

90509-2.2



ORIGINAL PAGE BLACK AND WHITE PHOTOGRAPH

7-269911N

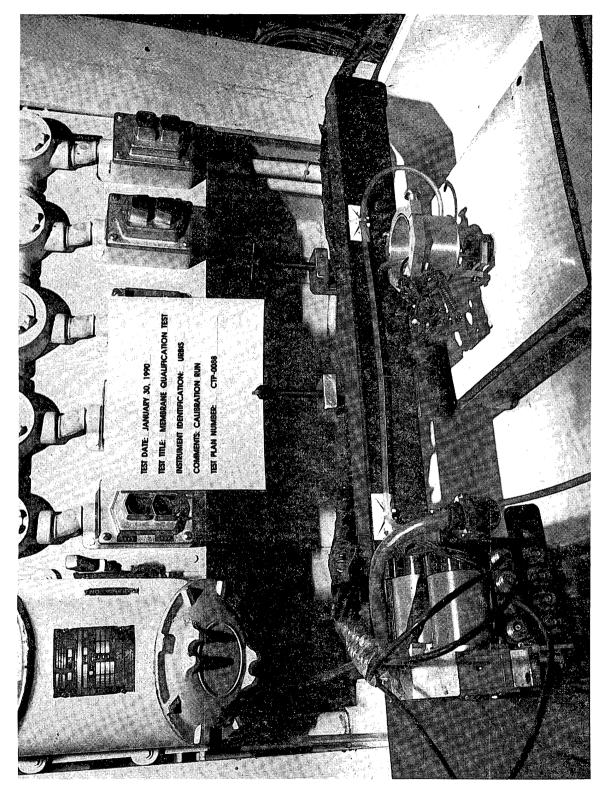

90509-2.19

REVISION

### ORIGINAL PAGE IS OF POOR QUALITY

 DOC NO.
 TWR-18898
 VOL

 SEC
 PAGE
 15

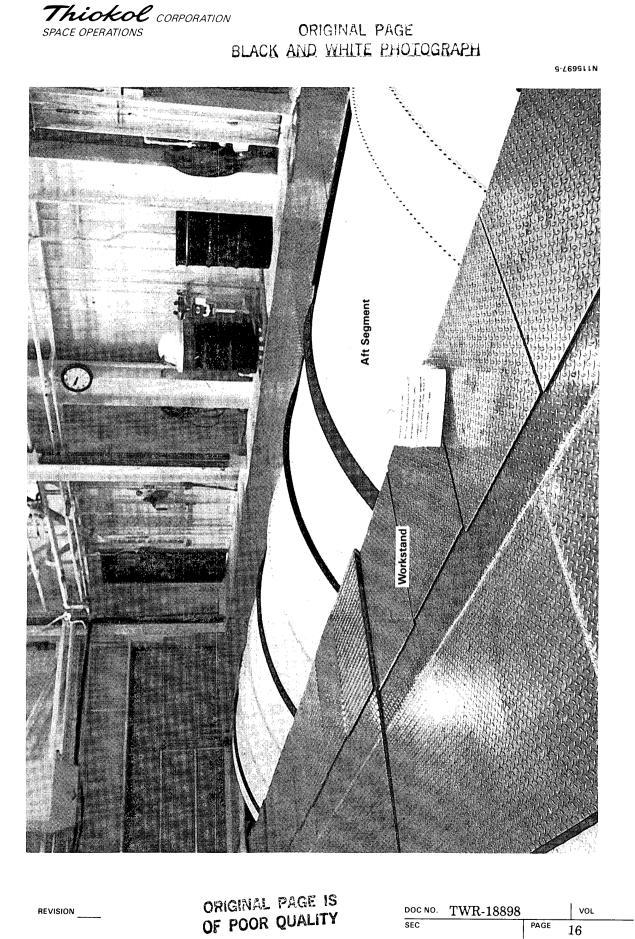


Figure 7. Workstand and Segment

90509-2.20

VOL

16

PAGE


DOC NO. TWR-18898

SEC

REVISION



BLACK AND WHITE PHOTOGRAPH

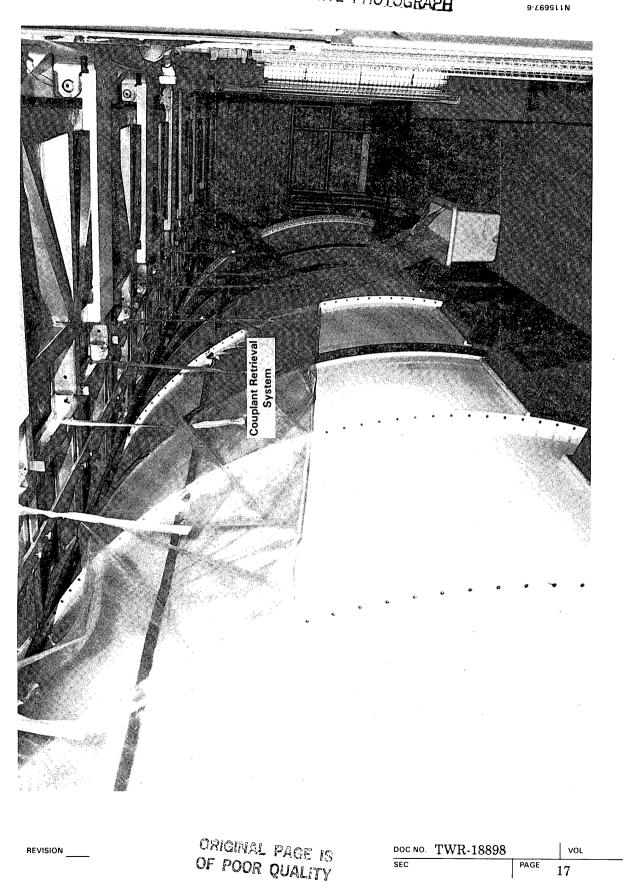

SEC

PAGE

17

Figure 8. Couplant Recovery System Installation

90509-2.21


REVISION



REVISION

## ORIGINAL PAGE BLACK AND WHITE PHOTOGRAPH

2-269911N

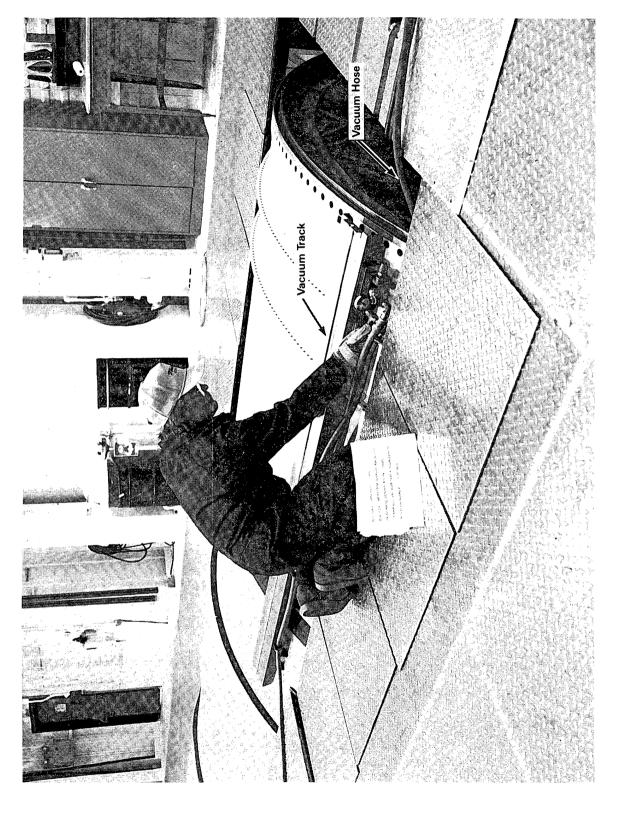

ORIGINAL PAGE IS

OF POOR QUALITY

DOC NO. TWR-18898

SEC


Figure 9. Vacuum Track Installation on Segment

90509-2.22

VOL

18

PAGE

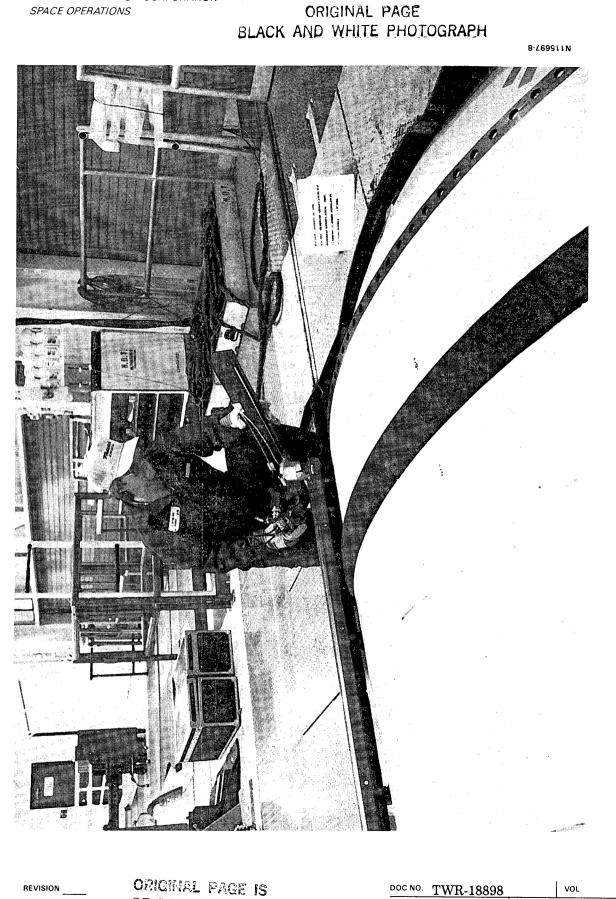

DOC NO. TWR-18898

SEC

Thickol CORPORATION

REVISION

OF POOR QUALITY

Figure 10. Case Membrane Scanner Installation on Vacuum Track

90509-2.23

VOL

19

PAGE



## ORIGINAL PAGE BLACK AND WHITE PHOTOGRAPH

6-269911N


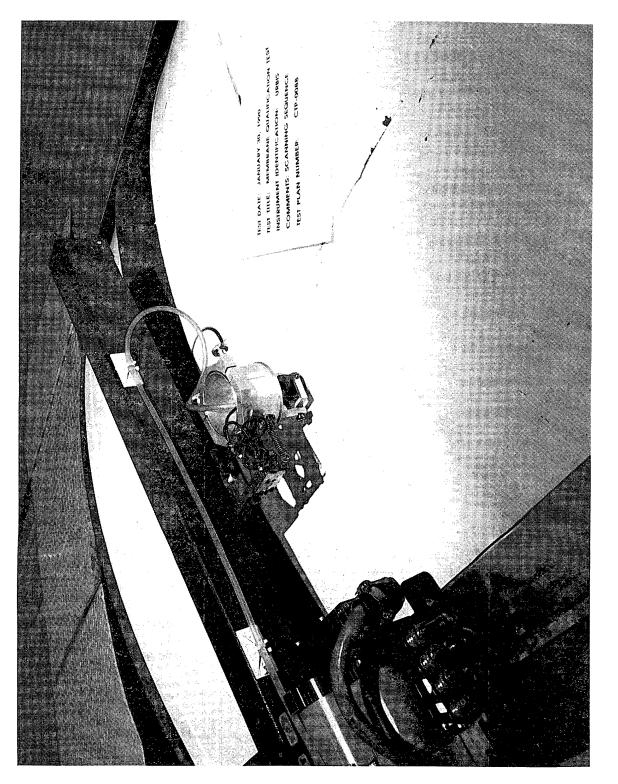



Figure 11. Case Membrane Scanning Sequence on Segment


90509-2.24

ORIGINAL PAGE IS OF POOR QUALITY



Thickol CORPORATION SPACE OPERATIONS

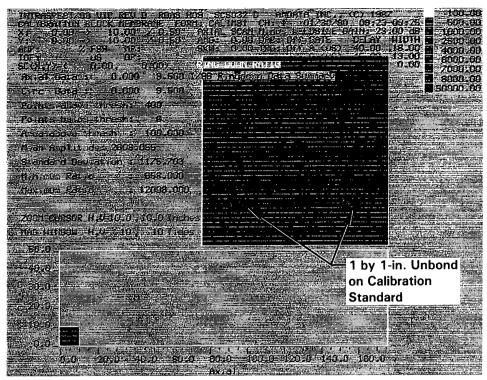

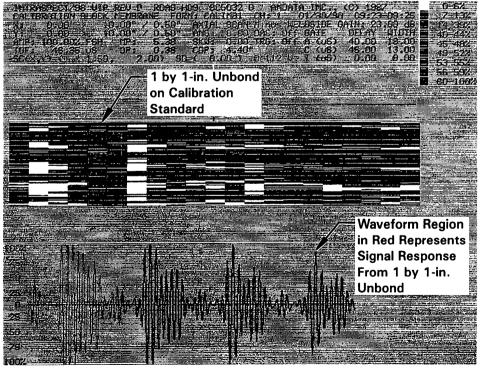

**B-scan Presentation** 

Figure 12. Calibration-in Sequence --- Scan Run No. 1


REVISION


DOC NO.	TWR-18898		VOL
SEC		PAGE	21

90509-2.3

ORIGINAL PAGE COLOR PHOTOGRAPH

Thickol corporation SPACE OPERATIONS

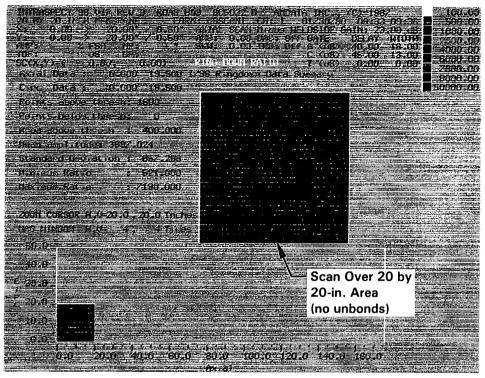

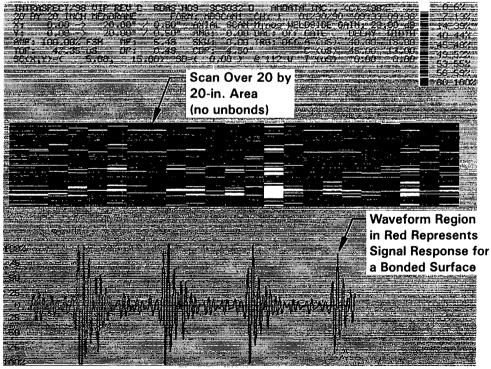

**B-scan Presentation** 

Figure 13. Scanning Sequence --- Scan Run No. 1

REVISION

ADIONIAL DUAT IC	DOC NO. TWR-18898		VOL
ORIGINAL PAGE IS	SEC	PAGE	22
OF POOR QUALITY	I		22

90509-2.4

ORIGINAL PAGE COLOR PHOTOGRAPH



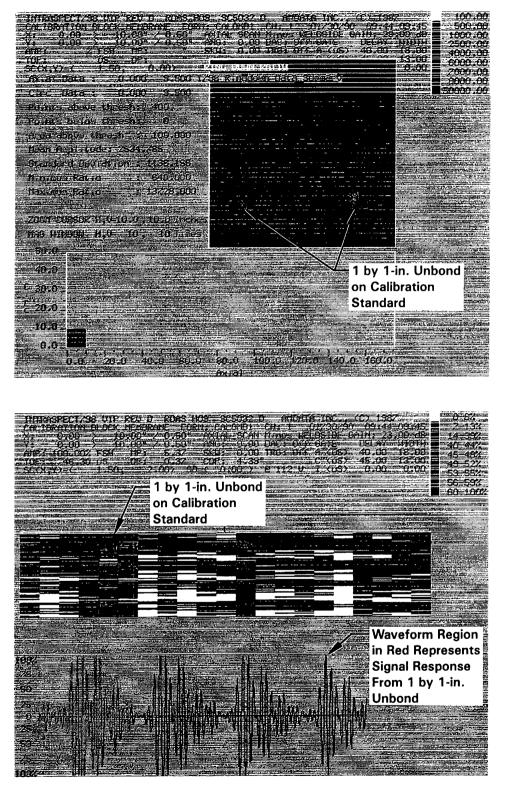


Figure 14. Calibration-out Sequence --- Scan Run No. 1

REVISION


90509-2.5

ORIGINAL PAGE IS OF POOR QUALITY


TWR-18898			VOL
	PAGE	2	23
	TWR-18898		PACE

Thickol CORPORATION SPACE OPERATIONS


ORIGINAL PAGE COLOR PHOTOGRAPH

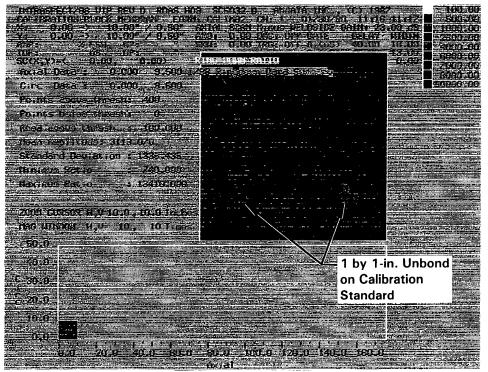

**C-scan Presentation** 

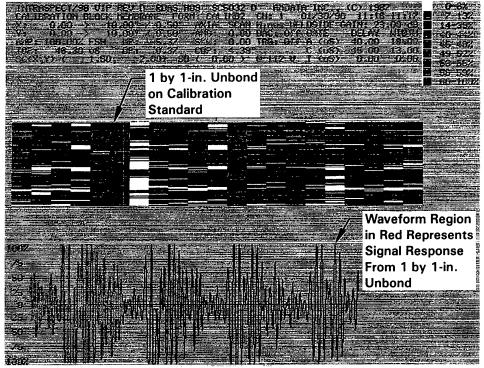

**B-scan Presentation** 




 ORIGINAL PAGE IS
 DOC NO. TWR-18898
 VOL

 6
 OF POOR QUALITY
 SEC
 PAGE
 24


REVISION

Thickol corporation SPACE OPERATIONS

ORIGINAL PAGE

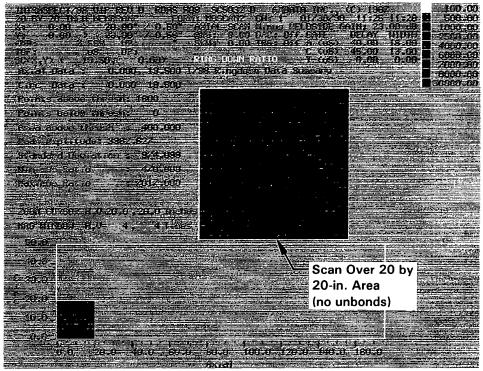

**C-scan Presentation** 

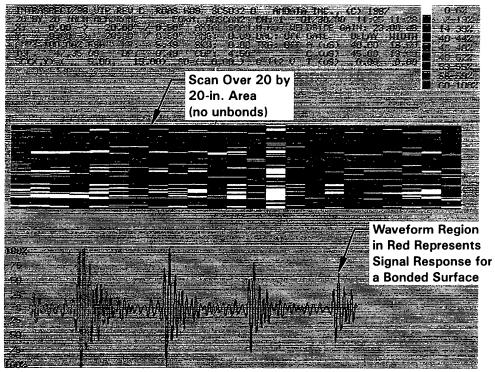


**B-scan Presentation** 

Figure 16. Scanning Sequence --- Scan Run No. 2


90509-2.7

DOC NO.	TWR-18898			VOL
SEC		PAGE	2	25


Thickol corporation space operations

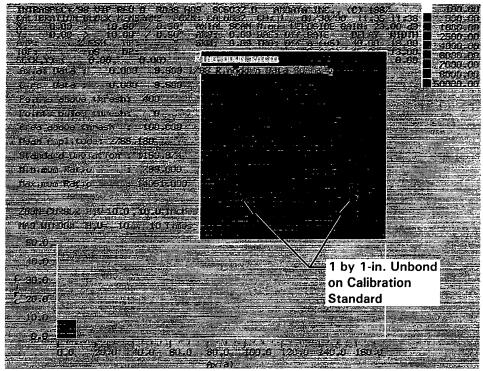

**C-scan Presentation** 

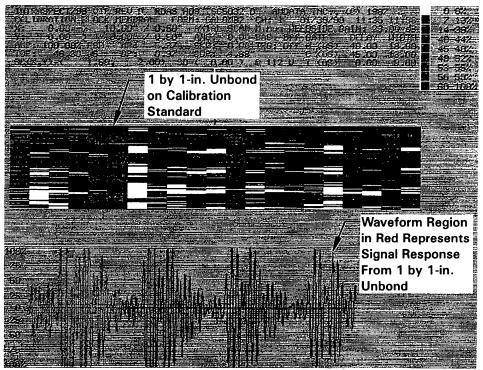



**B-scan Presentation** 



REVISION	State Bate Institute (1)	DOC NO. TWR-188	98	VOL
90509-2.8	of poor Quality	SEC	PAGE	26

Thickol corporation space operations

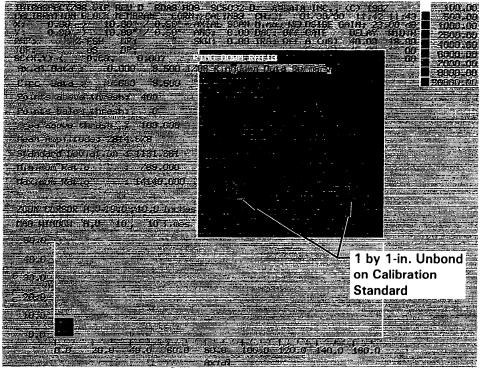

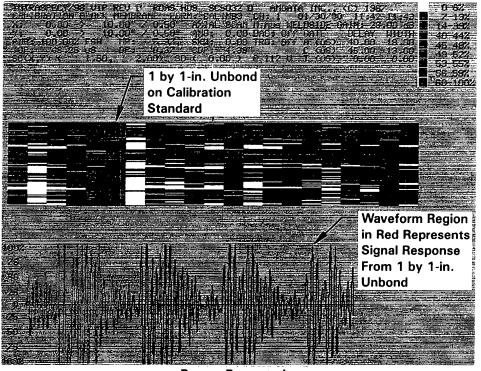


**B-scan Presentation** 


Figure 18. Calibration-in Sequence --- Scan Run No. 3

 REVISION
 ORIGINAL Propies
 DOC NO. TWR-18898
 Vol

 90509-2.9
 OF POOR QUALITY
 PAGE 27



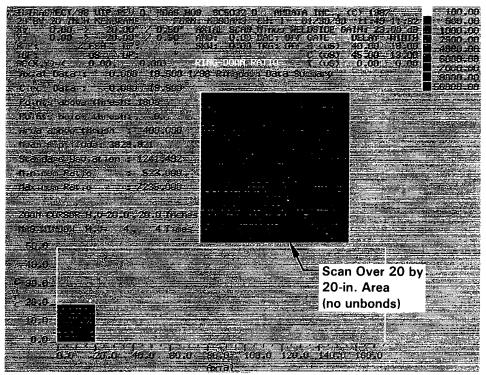

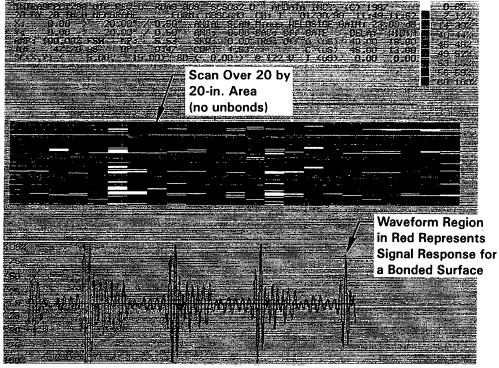



**B-scan Presentation** 

Figure 19. Scanning Sequence --- Scan Run No. 3


REVISIONORIGINAL PAGE ISDOC NO.TWR-18898VOL90509-2.10OF POOR QUALITYSECPAGE 28

Thickol CORPORATION SPACE OPERATIONS

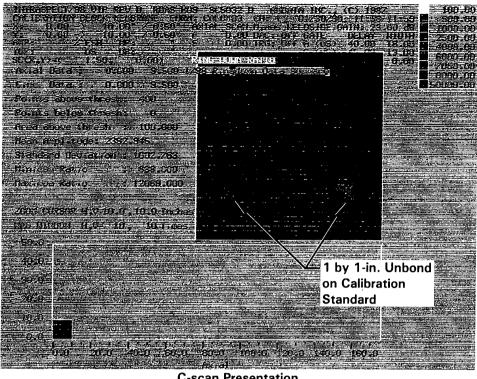

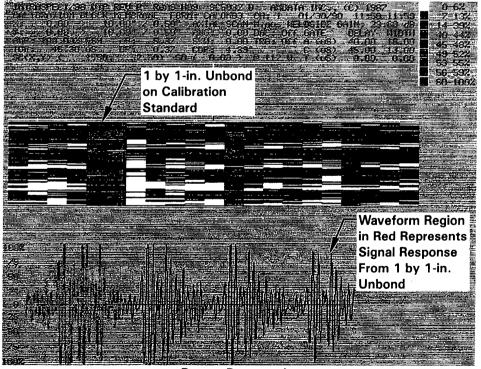


**B-scan Presentation** 




REVISION	ORIGINAL PAGE IS	DOC NO. TWR-18898 VOL		
	of poor quality	SEC	PAGE 29	
90509-2.11			29	

#### ORIGINAL PAGE COLOR PHOTOGRAPH

Thickol CORPORATION SPACE OPERATIONS

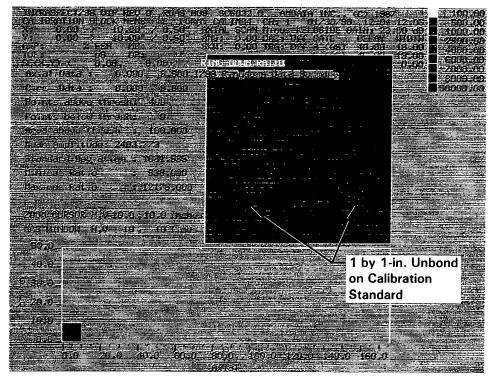

**C-scan Presentation** 

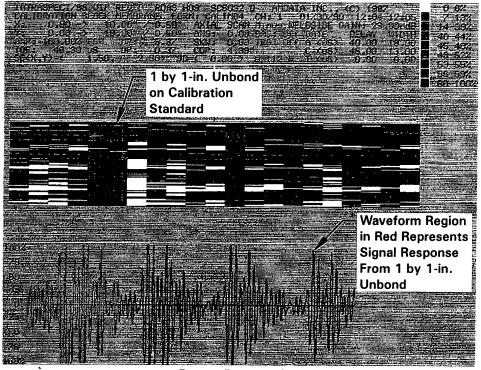


**B-scan Presentation** 

Figure 21. Calibration-in Sequence --- Scan Run No. 4


REVISION \_\_\_\_\_O.NGINAL PAGE ISDOC NO. TWR-18898VOL90509-2.12OF POOR QUALITYSECPAGE 30

Thickol CORPORATION SPACE OPERATIONS

ORIGINAL PAGE COLOR PHOTOGRAPH

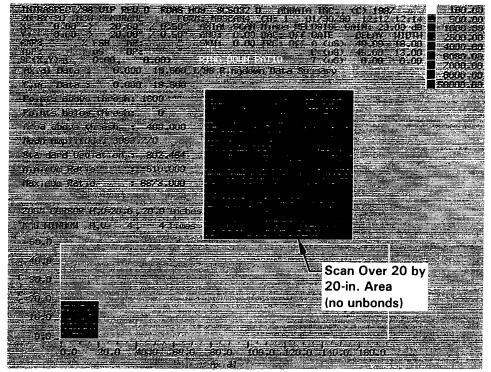

**C-scan Presentation** 

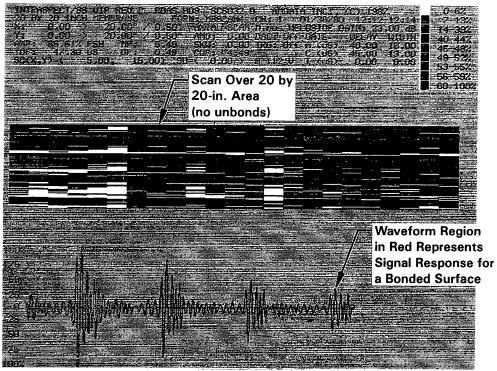


**B-scan Presentation** 

Figure 22. Scanning Sequence --- Scan Run No. 4


REVISION	ORGRAL PAGE IS	DOC NO.	TWR-18898		VOL
90509-2.13	OF POOR OHAT ITY	SEC		PAGE	31

Thickol CORPORATION SPACE OPERATIONS


ORIGINAL PAGE

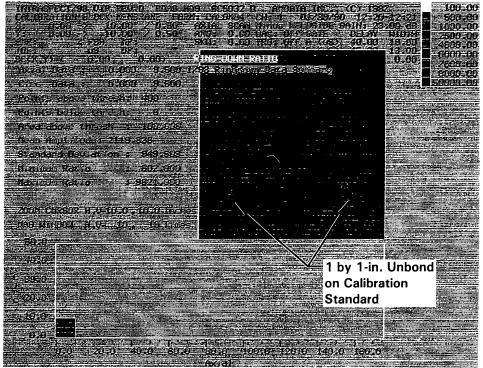

**C-scan Presentation** 

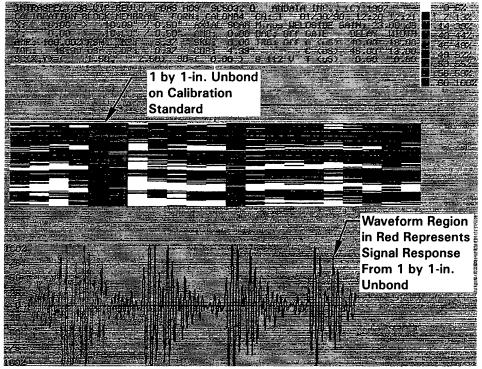

**B-scan Presentation** 




 REVISION
 DOC NO.
 TWR-18898
 VOL


 90509-2.14
 Sec
 PAGE
 32

## ORIGINAL PAGE COLOR PHOTOGRAPH



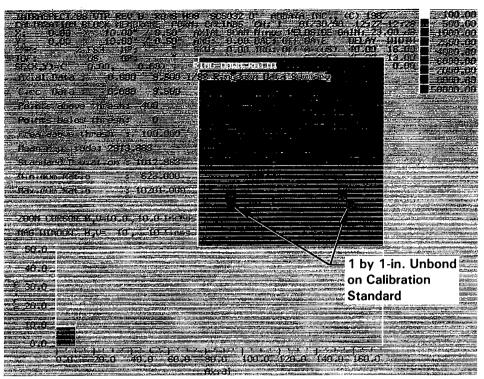

**C-scan Presentation** 

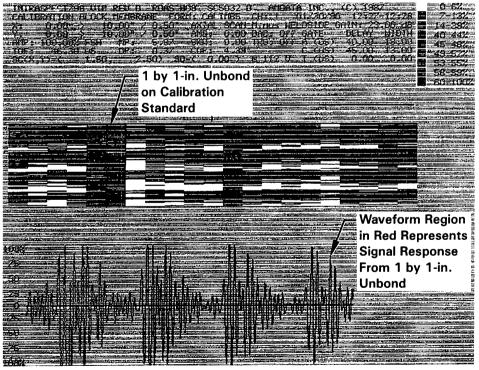

**B-scan Presentation** 




 Bevision
 Doc No. TWR-18898
 Vol


 90509-2.15
 PAGE 33




**≰**)

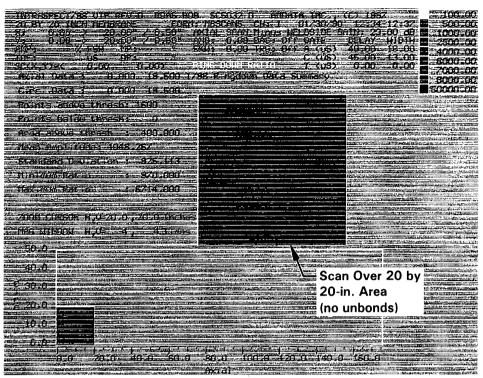

**C-scan Presentation** 

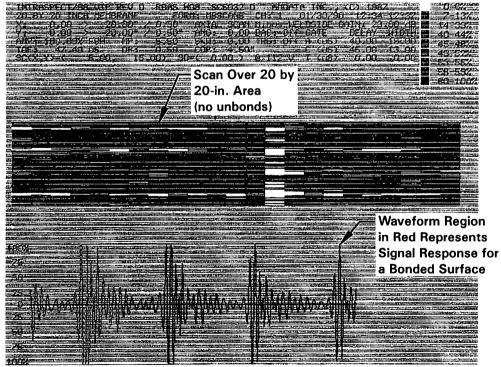

#### **B-scan Presentation**




 REVISION
 DOC NO.
 TWR-18898
 VOL

 90509-2.16
 07
 POOR CORDIN
 SEC
 PAGE
 34


Thickol CORPORATION SPACE OPERATIONS

,


ORIGINAL PAGE

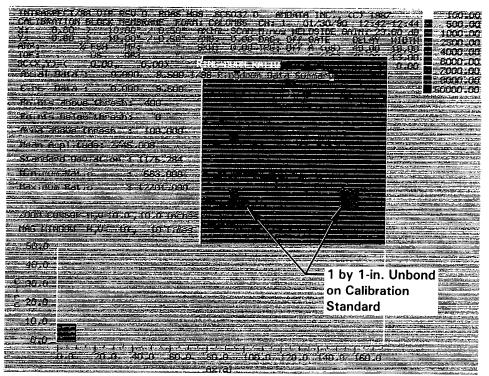

**C-scan Presentation** 

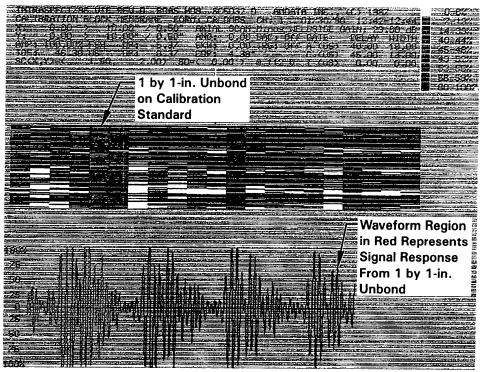

**B-scan Presentation** 



REVISION		DOC NO. TWR-18898		VOL
90509-2.17	A FOCK CURENY	SEC	PAGE	35

# **Thickol** corporation space operations

identical information for qualification runs 2 through 5. Measurement repeatability of the case membrane scanner/URBIS was demonstrated by the identical results from each test run.

The case membrane scanner successfully interfaced with the case membrane throughout the scanning procedure. Figure 11 shows the scanner/case membrane interface. During the test, neither the case membrane scanner nor the case membrane were degraded.

The complete URBIS is designed to be broken down into components which are placed in protective cases for transportability. This testing verified the transportability of the case membrane scanner/URBIS.

DOC NO.	TWR-18898		VOL
SEC		PAGE	36

REVISION

Thickol corporation space operations

......

Ċ

~

### 7

\_\_\_\_\_

## **APPLICABLE DOCUMENTS**

Document No.	Title
CPW1-3600	Prime Equipment Contract End Item (CEI) Detail Specifications
CDW2-3452	Performance, Design, and Verification Requirements Case-to- Insulation Bondline Inspection Kit, Ultrasonic Model Designator, C77-0479
CTP-0088	Qualification Plan for the Ultrasonic Inspection of the RSRM Membrane Case/Insulation Bondline Utilizing the Thiokol Corporation Ultrasonic RSRM Bondline Inspection System
CTP-0100	Qualification Test Plan for the Generic System Components of the MTI Ultrasonic RSRM Bondline Inspection System (URBIS)
NHB 6000.1	NASA Requirements for Packaging, Handling, and Transportation (for aeronautical and space systems, equipment, and associated components)
TWR-18894	Generic System Components of the RSRM Case-to-Insulation Bondline Inspection System Final Test Report
Military <u>Standard</u>	
MIL-STD-45662	Calibration System Requirements
Drawing No.	
2U129702	NDE Calibration Kit, SRM
2U129431	SRM PLI/Case UT Inspection Tool Arrangement

DOC NO.	TWR-18898		VOL	
SEC		PAGE	3	37

REVISION

Thickol corporation space operations

.+

<u>e</u>^

## DISTRIBUTION LIST

	No. of	
<u>Name</u>	<u>Copies</u>	<u>Mail Stop</u>
L. Allred	1	L72
D. Anderson	1	827
N. Black	1	L71
B. Bruce	1	E06
M. Cook	4	L71
G. Donikowski	1	877
F. Duersch	1	851
P. Karner	1	827
G. Lebaron	1	L72
D. Marsh	1	E63
M. Martersteck	1	827
D. Noble	1	THI-711 (KSC)
R. Papasian	45	$\mathbf{E05}$
G. Paul	1	L71
H. Reed	1	827
K. Sanofsky	1	851
Print Crib	5	282
Data Management	5	L74B

DOC NO.	TWR-18898		VOL	
SEC	P	AGE	38	

REVISION