


GO AROUND - REJECTED LANDING

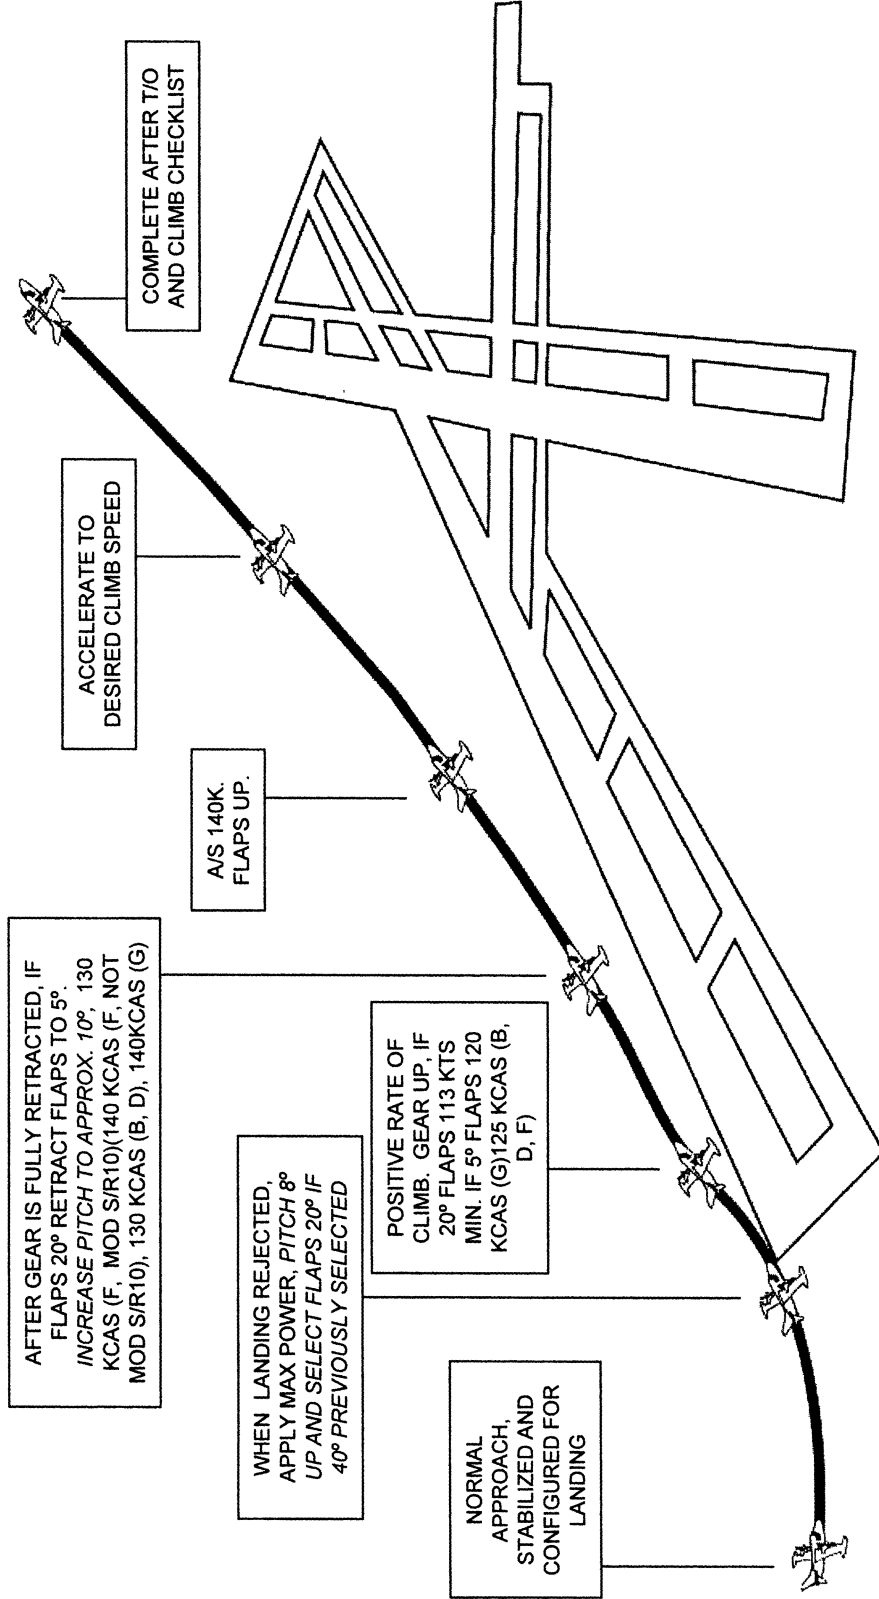

AFTER GEAR IS FULLY RETRACTED, IF FLAPS 20° RETRACT FLAPS TO 5°. INCREASE PITCH TO APPROX. 10°. 130 KCAS (F, MOD S/R10)(140 KCAS (F, NOT MOD S/R10), 130 KCAS (B, D), 140KCAS (G)

WHEN LANDING REJECTED, APPLY MAX POWER, PITCH 8° UP AND SELECT FLAPS 20° IF 40° PREVIOUSLY SELECTED

POSITIVE RATE OF CLIMB. GEAR UP, IF 20° FLAPS 113 KTS MIN. IF 5° FLAPS 120 KCAS (G) 125 KCAS (B, D, F)

A/S 140K. FLAPS UP.

ACCELERATE TO DESIRED CLIMB SPEED

COMPLETE AFTER T/O AND CLIMB CHECKLIST

NORMAL APPROACH, STABILIZED AND CONFIGURED FOR LANDING