



Quality Assurance Site Information for Lake Gregory (Crestline)

This page updated February 10, 2005

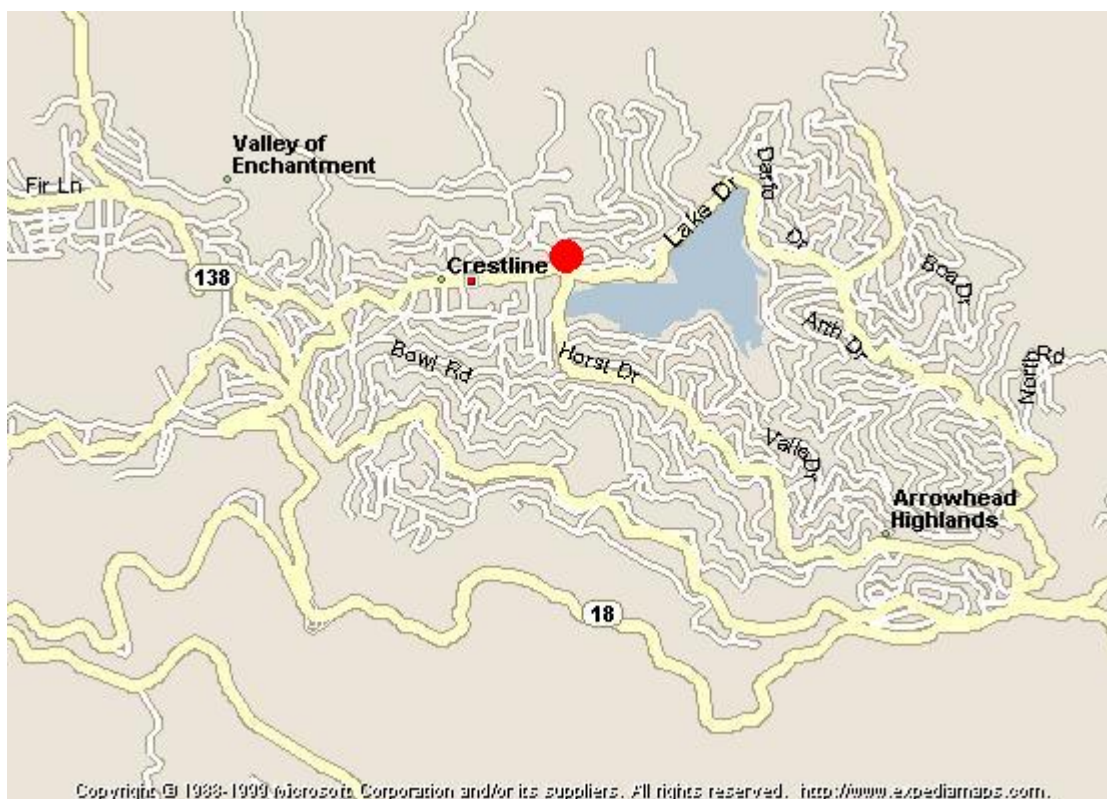

AIRS Number	ARB Number	Site Start Date	Reporting Agency and Agency Code
060710005	36181	10/1/73	South Coast AQMD (061)

Site Address	County	Air Basin	Latitude	Longitude	Elevation
24171 Lake Dr, Crestline CA 92325	San Bernardino	South Coast	34° 14' 29"	117° 16' 32"	1387

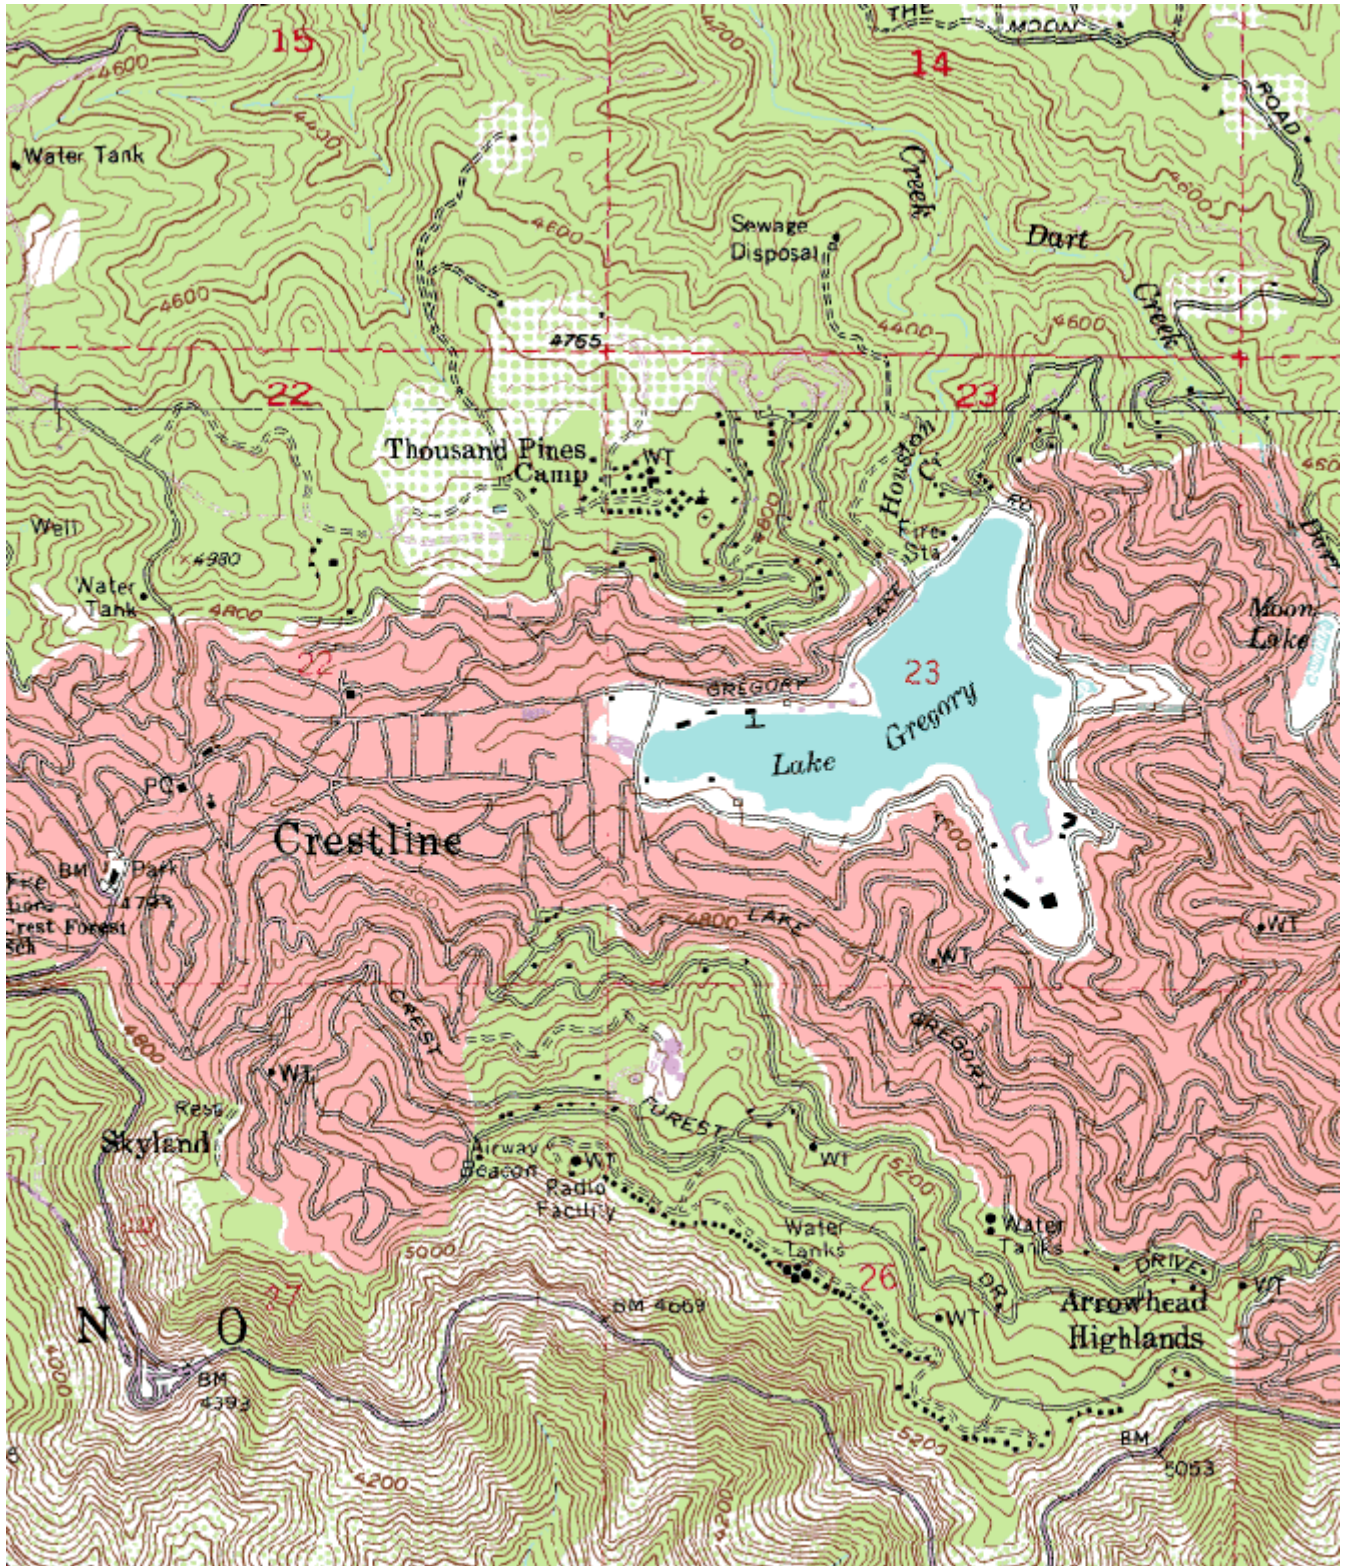

Site Survey Report

Siting Information

Site Name: Lake Gregory (Crestline)	Audit Date: 2005-08-23	ARB Number: 36181	AIRS Number: 060710005
Address: 24171 Lake Dr Crestline, CA 92325	Latitude: 34° 14' 29"	Longitude: 117° 16' 32"	Elevation (m): 1387
	Auditors: Don Fitzell Long Liu	Site Technician: Don Kho	Site Phone:
Operating Agency: South Coast AQMD		Site Report: Yes	Site Photos: Yes

General Siting Conditions

Station Temperature Controlled: Yes Recorded: Yes Inside Temp: 25 Degrees Celsius	Traffic Description: Residential Distance: 25 meters Count (Veh/Day): 500	Topography Site: mountainous Region: mountainous	Predominant Wind Direction: Southwest
			Arc Air Flow (Deg): 180 Degrees
		Meteorology Located With Instruments: Yes Shadowing: No Boom Orientation (Deg): 345 Temp(Motor/Natural): Natural	Non-vehicular Local Sources Description: None Distance: N/A Direction: N/A
Urbanization: Remote	Manifold Clean: Yes		
	Ground Cover: dirt		
Site Survey Complete: Yes	Autocalibrator Type: Sabio 4010		
Logbook Up To Date: Yes			

Action Items

Comments

Site Survey Report (Cont.)

Monitor Type	Ozone	Ozone	PM10-SSI
Manufacturer/Model	API/Teledyne 400	API/Teledyne 400	Sierra Andersen 1200
Serial Number	532-S	12660	4982
POC	1		1
Data For Record?	Yes	No	No
Purpose			
Objective			
Scale			
Height Above Ground	3.0	3.0	2.5
Height Above Platform			1.5
Sampler Spacing			
Current Manual Available?	Yes	Yes	Yes
Instrument Log Up-to-date?	Yes	Yes	Yes
In-line Filter Change Date	Not Available	Not Available	
Cal. Gas Cert. Date			
Calibration Current?	Yes	Yes	Yes
Calibration Date	2005-06-20	2005-06-08	2005-04-25
Cal. Equipment Cert. Date	Not Available	Not Available	2004-12-07
Obstacle Description	Tree	Tree	None
Distance to Obstacle	1.0	1.0	-
Height Above Inlet	15.0	15.0	-
Distance to Walls, etc.	-	-	-
Distance to Dripline	1.0	1.0	-
Dominant Influence	Vehicular	Vehicular	
Residence Time (sec)	14.4	14.4	