



*Environmental Programs*  
P.O. Box 1663, MS M991  
Los Alamos, New Mexico 87545  
(505) 606-2337/FAX (505) 665-1812



*National Nuclear Security Administration*  
Los Alamos Site Office, MS A316  
Environmental Restoration Program  
Los Alamos, New Mexico 87544  
(505) 667-4255/FAX (505) 606-2132



*Date:* March 31, 2008  
*Refer To:* EP2008-0139

Mr. James Bearzi, Bureau Chief  
Hazardous Waste Bureau  
New Mexico Environment Department  
2905 Rodeo Park Drive East, Building 1  
Santa Fe, NM 87505-6303

**Subject: Submittal of the Investigation Work Plan and the Historical Investigation Report for Upper Sandia Canyon Aggregate Area**

Dear Mr. Bearzi:

Enclosed please find two hard copies with electronic files of the Investigation Work Plan for Upper Sandia Canyon Aggregate Area and the Historical Investigation Report for the Upper Sandia Canyon Aggregate Area. The Upper Sandia Canyon Aggregate Area includes a total of 180 solid waste management units and areas of concern located in Technical Areas 03, 60, and 61. Of these 180 sites, 91 have been investigated previously and/or remediated and have been approved for no further action. Site descriptions, previous investigations, and analytical results for the remaining 89 sites are included in the historical investigation report. Proposed investigation activities at these sites are discussed in the investigation work plan.

This document was prepared before your comments in the March 24, 2008, approval with modifications letter were received regarding the Upper Mortandad Canyon Aggregate Area work plan. Issues you identified in that work plan may be applicable to this plan; however, we were not able to schedule a meeting with you to address your concerns before this work plan was submitted. We will contact your staff to schedule a meeting in the near future.

If you have any questions, please contact Kent Rich at (505) 665-4272 (krich@lanl.gov) or Cheryl Rodriguez at (505) 665-5330 (crodriguez2@doeal.gov).

Sincerely,

Susan G. Stiger, Associate Director  
Environmental Programs  
Los Alamos National Laboratory

Sincerely,

David R. Gregory, Project Director  
Environmental Operations  
Los Alamos Site Office

SS/DG/DM/KR:sm

- Enclosures: 1) Two hard copies with electronic files - Investigation Work Plan for Upper Sandia Canyon Aggregate Area (EP2008-0139)  
2) Two hard copies with electronic files - Historical Investigation Report for Upper Sandia Canyon Aggregate Area (EP2008-0140)

Cy: (w/enc.)  
Cheryl Rodriguez, DOE-LASO, MS A316  
Kent Rich, EP-CAP, MS M992  
RPF, MS M707 (with two CDs)  
Public Reading Room, MS M992

Cy: (Letter and CD only)  
Laurie King, EPA Region 6, Dallas, TX  
Steve Yanicak, NMED-OB, White Rock, NM  
Kim Birdsall, North Wind  
Peggy Reneau, EP-WES, MS M992  
EP-CAP File, MS M992

Cy: (w/o enc.)  
Tom Skibitski, NMED-OB; Santa Fe, NM  
Bonita Eichorst, DOE-LASO (date-stamped letter emailed)  
Susan G. Stiger, ADEP, MS M991  
Alison M. Dorries, EP-WES, MS M992  
Dave McInroy, EP-CAP, MS M992  
IRM-RMMSO, MS A150



LA-UR-08-1851  
March 2008  
EP2008-0140

# Historical Investigation Report for Upper Sandia Canyon Aggregate Area


Prepared by the Environmental Programs Directorate

Los Alamos National Laboratory, operated by Los Alamos National Security, LLC, for the U.S. Department of Energy under Contract No. DE-AC52-06NA25396, has prepared this document pursuant to the Compliance Order on Consent, signed March 1, 2005. The Compliance Order on Consent contains requirements for the investigation and cleanup, including corrective action, of contamination at Los Alamos National Laboratory. The U.S. government has rights to use, reproduce, and distribute this document. The public may copy and use this document without charge, provided that this notice and any statement of authorship are reproduced on all copies.


# Historical Investigation Report for Upper Sandia Canyon Aggregate Area

March 2008

Responsible project leader:

Kent Rich		Project Leader	Environmental Programs	3/24/08
Printed Name	Signature	Title	Organization	Date

Responsible LANS representative:

Susan G. Stiger		Associate Director	Environmental Programs	3-31-08
Printed Name	Signature	Title	Organization	Date

Responsible DOE representative:

David R. Gregory		Project Director	DOE-LASO	3/31/08
Printed Name	Signature	Title	Organization	Date



## **EXECUTIVE SUMMARY**

The Upper Sandia Canyon Aggregate Area includes a total of 180 solid waste management units (SWMUs) and areas of concern (AOCs) located in Technical Area 03 (TA-03), TA-60, and TA-61 at Los Alamos National Laboratory. Of these 180 sites, 91 have been previously investigated and/or remediated and have been approved for no further action. For the remaining 89 sites under investigation, 78 are located in TA-03, 7 are in TA-60, and 4 are located in TA-61. This historical investigation report provides site descriptions, summarizes previous investigations, and presents analytical results. The background information and supporting data form the basis for the proposed sampling design necessary to complete the site investigations as presented in the Upper Sandia Canyon Aggregate Area investigation work plan.



## CONTENTS

<b>1.0</b>	<b>INTRODUCTION</b> .....	<b>1</b>
1.1	Data Overview .....	2
<b>2.0</b>	<b>SITES UNDER INVESTIGATION IN TA-03</b> .....	<b>2</b>
2.1	SWMU 03-002(c), Former Storage Area .....	2
2.2	SWMU 03-003(c), Equipment Storage Area—PCB Site .....	3
2.3	AOC 03-003(d), Transformer Area—PCB Site .....	4
2.4	AOC 03-003(f), Transformer Area—PCB Site .....	4
2.5	AOC 03-003(g), Transformer Area—PCB Site .....	4
2.6	AOC 03-003(o), Capacitor Bank Area—PCB Site .....	5
2.7	Consolidated Unit 03-009(a)-00, Asphalt Batch Plant .....	5
2.7.1	SWMU 03-009(a), Surface Disposal (Soil Fill) .....	5
2.7.2	SWMU 03-028, Surface Impoundment .....	6
2.7.3	SWMU 03-029, Landfill .....	6
2.7.4	SWMU 03-036(a), Aboveground Storage Tanks .....	7
2.7.5	SWMU 03-036(c), Aboveground Storage Tanks .....	7
2.7.6	SWMU 03-036(d), Underground Storage Tanks .....	8
2.7.7	AOC 03-043(b), Aboveground Storage Tank .....	8
2.7.8	AOC 03-043(d), Aboveground Storage Tank .....	9
2.7.9	AOC 03-043(h), Aboveground Storage Tank .....	9
2.7.10	SWMU 03-045(g), Storm Drain .....	9
2.8	SWMU 03-009(i), Surface Disposal Site .....	9
2.9	Consolidated Unit 03-012(b)-00, Power Plant .....	10
2.9.1	SWMU 03-012(b), Operational Release and Outfall .....	11
2.9.2	SWMU 03-014(q), Holding Tank .....	12
2.9.3	SWMU 03-045(b), Operational Release .....	12
2.9.4	SWMU 03-045(c), Outfall .....	12
2.10	Consolidated Unit 03-013(a)-00 .....	12
2.10.1	SWMU 03-013(a), Storm Drain .....	12
2.10.2	SWMU 03-052(f), Outfall .....	13
2.11	AOC 03-013(b), Floor Drains .....	14
2.12	SWMU 03-013(i), Operational Release .....	14
2.13	Consolidated Unit 03-014(a)-99, Wastewater Treatment Plant .....	15
2.13.1	SWMU 03-014(a), Structure Associated with Former WWTP .....	16
2.13.2	SWMU 03-014(b), Structure Associated with Former WWTP .....	17
2.13.3	AOC 03-014(b2), Outfall .....	17
2.13.4	SWMU 03-014(c), Structure Associated with Former WWTP .....	18
2.13.5	AOC 03-014(c2), Outfall .....	18
2.13.6	SWMU 03-014(d), Structure Associated with Former WWTP .....	19
2.13.7	SWMU 03-014(e), Structure Associated with Former WWTP .....	19
2.13.8	SWMU 03-014(f), Structure Associated with Former WWTP .....	19
2.13.9	SWMU 03-014(g), Structure Associated with Former WWTP .....	20
2.13.10	SWMU 03-014(h), Structure Associated with Former WWTP .....	20
2.13.11	SWMU 03-014(i), Structure Associated with Former WWTP .....	20
2.13.12	SWMU 03-014(j), Structure Associated with Former WWTP .....	20
2.13.13	SWMU 03-014(k), Structure Associated with Former WWTP .....	20

2.13.14	SWMU 03-014(l), Structure Associated with Former WWTP.....	21
2.13.15	SWMU 03-014(m), Structure Associated with Former WWTP .....	21
2.13.16	SWMU 03-014(n), Structure Associated with Former WWTP .....	22
2.13.17	SWMU 03-014(o), Structure Associated with Former WWTP .....	23
2.13.18	SWMU 03-014(p), Structure Associated with Former WWTP .....	23
2.13.19	SWMU 03-014(u), Structure Associated with Former WWTP .....	23
2.13.20	SWMU 03-056(d), Drum Storage .....	24
2.14	SWMU 03-014(r), Lift Station Associated with Former WWTP .....	24
2.15	SWMU 03-014(s), Lift Station Associated with Former WWTP .....	24
2.16	AOC 03-014(v), Drain Associated with Former WWTP.....	24
2.17	AOC 03-014(y), Drain Associated with Former WWTP.....	25
2.18	Consolidated Unit 03-015-00.....	25
2.18.1	SWMU 03-015, Outfall .....	25
2.18.2	AOC 03-053, Operational Facility .....	26
2.19	AOC C-03-016, Oil Metal Bin .....	26
2.20	SWMU 03-021, Outfall.....	27
2.21	AOC 03-027, Lift Wells .....	28
2.22	AOC 03-036(b), Former Aboveground Storage Tanks.....	28
2.23	SWMU 03-037, Underground Storage Tanks .....	29
2.24	AOC 03-038(c), Waste Lines.....	29
2.25	AOC 03-038(d), Waste Lines .....	30
2.26	AOC 03-043(a), Aboveground Storage Tank.....	30
2.27	AOC 03-043(f), Aboveground Storage Tank.....	30
2.28	AOC 03-043(g), Aboveground Storage Tank .....	30
2.29	SWMU 03-045(a), Outfall .....	30
2.30	SWMU 03-045(e), Outfall .....	31
2.31	SWMU 03-045(f), Outfall .....	31
2.32	SWMU 03-045(h), Drainlines and Outfalls .....	31
2.33	SWMU 03-046, Aboveground Wastewater Treatment Tank.....	32
2.34	AOC 03-047(d), Storage Area .....	32
2.35	AOC 03-047(g), Drum Storage.....	32
2.36	AOC 03-051(c), Soil Contamination—Vacuum Pump Leak.....	33
2.37	AOC 03-052(b), Storm Drainage .....	33
2.38	SWMU 03-054(c), Outfall .....	34
2.39	SWMU 03-056(a), Storage Area .....	34
2.40	SWMU 03-056(c), Transformer Storage Area—PCB Site.....	35
2.41	AOC 03-056(h), Container Storage Area .....	36
2.42	AOC 03-056(k), Container Storage Area.....	37
2.43	SWMU 03-056(l), Storage Area.....	37
2.44	Consolidated Unit 03-059-00.....	38
2.44.1	AOC 03-003(n), One-Time Spill—PCB Site.....	38
2.44.2	SWMU 03-059, Storage Area—PCB Site .....	38
2.45	AOC C-03-022, Kerosene Tanker Trailer .....	39
<b>3.0</b>	<b>SITES UNDER INVESTIGATION IN TA-60 .....</b>	<b>39</b>
3.1	SWMU 60-002, Storage Area.....	39
3.2	AOC 60-004(b), Storage Area.....	40
3.3	AOC 60-004(d), Storage Area.....	41



3.4	AOC 60-004(f), Storage Area .....	41
3.5	SWMU 60-006(a), Septic System.....	42
3.6	SWMU 60-007(a), Release .....	42
3.7	SWMU 60-007(b), Release .....	43
<b>4.0</b>	<b>SITES UNDER INVESTIGATION IN TA-61 .....</b>	<b>43</b>
4.1	SWMU 61-002, Transformer Storage Area—PCB Site.....	43
4.2	SWMU 61-005, Landfill.....	44
4.3	SWMU 61-006, Waste-Oil Tank .....	44
4.4	AOC C-61-002, Subsurface Contamination .....	45
<b>5.0</b>	<b>REFERENCES AND MAP DATA SOURCES .....</b>	<b>45</b>
5.1	References .....	45
5.2	Map Data Sources .....	50

## Figures

Figure 1.0-1	Upper Sandia Canyon Aggregate Area Map Key .....	51
Figure 2.1-1	Map A site location.....	52
Figure 2.1-2	Map A inorganic chemical sampling locations and results detected above BVs.....	53
Figure 2.1-3	Map A organic chemical sampling locations and detected results .....	54
Figure 2.1-4	Map A radionuclide sampling locations.....	55
Figure 2.2-1	Map B site location.....	56
Figure 2.2-2	Map B organic chemical sampling locations and detected results .....	57
Figure 2.3-1	Map C site location.....	58
Figure 2.3-2	Map C inorganic chemical sampling locations and results detected above BVs.....	59
Figure 2.3-3	Map C organic chemical sampling locations.....	60
Figure 2.3-4	Map C radionuclide sampling locations .....	61
Figure 2.4-1	Map D site location.....	62
Figure 2.4-2	Map D inorganic chemical sampling locations and results detected above BVs.....	63
Figure 2.4-3	Map D organic chemical sampling locations and detected results .....	64
Figure 2.4-4	Map D radionuclide sampling locations and results detected above FVs/BVs.....	65
Figure 2.7-1	Map E site location.....	66
Figure 2.7-2	Map E inorganic chemical sampling locations and results detected above BVs.....	67
Figure 2.7-3	Map E organic chemical sampling locations.....	68
Figure 2.7-4	Map E radionuclide sampling locations.....	69
Figure 2.30-1	Map F site location .....	70
Figure 2.8-1	Map G site location .....	71
Figure 2.8-2	Map G inorganic chemical sampling locations and results detected above BVs .....	72
Figure 2.8-3	Map G organic chemical sampling locations .....	73
Figure 2.9-1	Map H site location.....	74
Figure 2.9-2	Map H inorganic chemical sampling locations and results detected above BVs.....	75
Figure 2.9-3	Map H organic chemical sampling locations and detected results .....	76
Figure 2.9-4	Map H radionuclide sampling locations .....	77

Figure 2.10-1	Map I site location .....	78
Figure 2.10-2	Map J site location .....	79
Figure 2.10-3	Map J inorganic chemical sampling locations.....	80
Figure 2.10-4	Map J organic chemical sampling locations .....	81
Figure 2.10-5	Map J radionuclide sampling locations .....	82
Figure 2.12-1	Map K site location.....	83
Figure 2.12-2	Map K inorganic chemical sampling locations and results detected above BVs.....	84
Figure 2.12-3	Map K organic chemical sampling locations and detected results .....	85
Figure 2.13-1	Map L site location .....	86
Figure 2.13-2	Map L inorganic chemical sampling locations and results detected above BVs .....	87
Figure 2.13-3	Map L organic chemical sampling locations and detected results.....	88
Figure 2.13-4	Map L radionuclide sampling locations and results detected above FVs/BVs .....	89
Figure 2.16-1	Map M site location .....	90
Figure 2.16-2	Map M inorganic chemical sampling locations and results detected above BVs .....	91
Figure 2.16-3	Map M organic chemical sampling locations and detected results.....	92
Figure 2.24-1	Map N site location.....	93
Figure 2.25-1	Map O site location .....	94
Figure 2.38-1	Map P site location.....	95
Figure 2.38-2	Map P inorganic chemical sampling locations and results detected above BVs.....	96
Figure 3.1-1	Map Q site location .....	97
Figure 3.1-2	Map Q inorganic chemical sampling locations and results detected above BVs .....	98
Figure 3.1-3	Map Q organic chemical sampling locations .....	99
Figure 3.1-4	Map Q radionuclide sampling locations .....	100
Figure 3.1-5	Map R site location.....	101
Figure 3.1-6	Map R inorganic chemical sampling locations and results detected above BVs.....	102
Figure 3.1-7	Map R organic chemical sampling locations and detected results .....	103
Figure 3.1-8	Map S site location.....	104
Figure 3.1-9	Map S inorganic chemical sampling locations and results detected above BVs.....	105
Figure 3.1-10	Map S organic chemical sampling locations and detected results .....	106
Figure 3.1-11	Map S radionuclide sampling locations.....	107
Figure 3.7-1	Map T site location .....	108
Figure 3.7-2	Map T inorganic chemical sampling locations .....	109
Figure 3.7-3	Map T organic chemical sampling locations .....	110
Figure 3.7-4	Map T radionuclide sampling locations.....	111
Figure 4.1-1	Map U site location.....	112
Figure 4.2-1	Map V site location.....	113

**Tables**

Table 1.0-1	SWMUs and AOCs within the Upper Sandia Area Aggregate Area .....	115
Table 2.0-1	Decision-Level Data from TA-03 Site Samples Collected and Analyses Requested .....	125
Table 2.0-2	Screening-Level Data from TA-03 Site Samples Collected and Analyses Requested...	133
Table 2.0-3	Summary of Inorganic Chemicals Above BVs for TA-03 Sites .....	137
Table 2.0-4	Summary of Detected VOCs for TA-03 Sites .....	143
Table 2.0-5	Summary of Detected SVOCs for TA-03 Sites .....	145
Table 2.0-6	Summary of Detected PCBs, Herbicides, and TPH for TA-03 Sites .....	147
Table 2.0-7	Summary of Radionuclides Detected or Detected Above BVs/FVs for TA-03 Sites .....	150
Table 2.0-8	Summary of Inorganic Chemicals Detected in Debris and Engineered Material for TA-03 Sites .....	150
Table 2.0-9	Summary of Organic Chemicals Detected in Debris and Sludge for TA-03 Sites .....	151
Table 2.0-10	Summary of Radionuclides Detected in Engineered Material for TA-03 Sites .....	151
Table 2.0-11	Summary of Inorganic Chemical Screening-Level Results for TA-03 Sites .....	152
Table 2.0-12	Summary of VOC Screening-Level Results for TA-03 Sites .....	154
Table 2.0-13	Summary of SVOC Screening-Level Results for TA-03 Sites .....	155
Table 2.0-14	Summary of PCB Screening-Level Results for TA-03 Sites .....	156
Table 2.0-15	Summary of Radionuclide Screening-Level Results for TA-03 Sites .....	157
Table 3.0-1	Decision-Level Data from TA-60 Site Samples Collected and Analyses Requested .....	159
Table 3.0-2	Screening-Level Data from TA-60 Site Samples Collected and Analyses Requested...	160
Table 3.0-3	Summary of Inorganic Chemicals Detected Above BVs for TA-60 Sites .....	162
Table 3.0-4	Summary of Detected Organic Chemicals for TA-60 Sites.....	163
Table 3.0-5	Summary of Inorganic Chemical Screening-Level Results for TA-60 Sites .....	164
Table 3.0-6	Summary of Organic Chemical Screening-Level Results for TA-60 Sites.....	165
Table 3.0-7	Summary of Radionuclide Screening-Level Results for TA-60 Sites .....	165

**Appendixes**

Appendix A	Acronyms and Abbreviations, Glossary, Metric Conversion Table, and Data Qualifier Definitions
Appendix B	Analytical Suites and Results (on CD included with this document)

**Plate**

Plate 1	Upper Sandia Canyon Aggregate Area
---------	------------------------------------



## 1.0 INTRODUCTION

Los Alamos National Laboratory (LANL or the Laboratory) is a multidisciplinary research facility owned by the U.S. Department of Energy (DOE) and managed by the Los Alamos National Security, LLC. The Laboratory is located in north-central New Mexico approximately 60 mi northeast of Albuquerque and 20 mi northwest of Santa Fe. The Laboratory site covers 40 mi<sup>2</sup> of the Pajarito Plateau (Figure 1.0-1), which consists of a series of finger-like mesas separated by deep canyons containing perennial and intermittent streams running from west to east. Mesa tops range in elevation from approximately 6200 to 7800 ft. The location of Upper Sandia Canyon Aggregate Area with respect to the Laboratory technical areas (TAs) is shown in Figure 1.0-1.

The Laboratory's Environmental Programs (EP) Directorate, which includes the former Environmental Restoration (ER) Project, is participating in a national effort by DOE to clean up sites and facilities. The goal of EP is to ensure that past operations do not threaten human or environmental health and safety in and around Los Alamos County, New Mexico. To achieve this goal, EP is currently investigating sites potentially contaminated by past Laboratory operations. The sites under investigation are designated as either solid waste management units (SWMUs) or areas of concern (AOCs).

This historical investigation report (HIR) describes operational histories, previous investigations, and analytical data for SWMUs and AOCs in TA-03, TA-60, and TA-61 at the Laboratory within the Upper Sandia Canyon Aggregate Area. All the sites addressed in this HIR are potentially contaminated with both hazardous and radioactive chemicals. Information on radioactive materials and radionuclides, including the results of sampling and analysis of radioactive constituents, is voluntarily provided to the New Mexico Environment Department (NMED) in accordance with DOE policy.

Corrective actions at the Laboratory are subject to the Compliance Order on Consent (the Consent Order) signed on March 1, 2005. The Consent Order was issued pursuant to the New Mexico Hazardous Waste Act (NMHWA), New Mexico Statutes Annotated (NMSA) 1978, § 74-4-10, and the New Mexico Solid Waste Act, NMSA 1978, § 74-9-36(D). NMED has authority under the NMHWA over cleanup of hazardous wastes and hazardous constituents.

The purpose of this HIR is to provide supporting information for the activities necessary to complete the investigation as presented in the Upper Sandia Canyon Aggregate Area investigation work plan. The SWMUs and AOCs are presented in this document on the basis of their regulatory status. Table 1.0-1 provides a summary of all sites within the aggregate area and their regulatory status.

Sections 2 to 4 of this HIR provide site descriptions and operational histories, previous investigations, and analytical data for site(s) that are under investigation in TA-03, TA-60, and TA-61, respectively. For each site, the location, historical operations, and current status are described first, followed by descriptions of historical investigations with dates and activities conducted. The results of analytical data obtained from previous investigation are summarized. Figure 1.0-1 shows the locations of the sites that are under investigation in the Upper Sandia Canyon Aggregate Area.

Appendix A includes a list of acronyms and abbreviations, a glossary, a metric conversion table, and a table for data qualifier definitions. Appendix B presents decisions-level and screening-level quality data from past investigations (included on compact disk).

## 1.1 Data Overview

Data evaluated in this report include historical data collected from 1993 and 1997, as well as subsequent investigations, remediations as part of Resource Conservation and Recovery Act facility investigation (RFI), and other corrective actions. In EP Directorate's database, all data records include a vintage code field denoting how and where samples were submitted for analyses. All historical data evaluated in this report are validated or revalidated by current quality control metrics.

Analytical samples described in this report have undergone analyses at both on-site and off-site laboratories. Because analytical practices and documentation of analyses vary in quality and completeness, analytical data presented are either screening-level or decision-level quality. Screening-level data are appropriate for applications that only require determination of gross contamination areas and/or for site characterization. Screening-level data are also often used to specify areas to collect decision-level data. Decision-level data are used to quantify the nature and extent of releases and to perform risk assessments. Decision-level data presented in this report have been qualified and/or validated for such use. These decision-level and screening-level data provide supporting information for the investigation activities proposed in the work plan.

Inorganic chemical and radionuclide data from previous investigations were compared with background values (BVs) and fallout values (FVs) (LANL 1998, 059730, p. 6-24). Organic chemicals and anthropogenic radionuclides in soil greater than a depth of 6 in. or in rock are determined to be present if detected.

Information on radioactive materials and radionuclides, including the results of sampling and analyses of radioactive constituents, is voluntarily provided to NMED in accordance with DOE policy.

## 2.0 SITES UNDER INVESTIGATION IN TA-03

TA-03 occupies a large area located near the western end of South Mesa between Los Alamos Canyon to the north and Twomile Canyon to the south (Plate 1). Sandia and Mortandad Canyons originate within TA-03 and divide the eastern two thirds of the area into finger-like mesas. TA-03 contains most of the Laboratory's administrative buildings and public and corporate access facilities. In addition, TA-03 houses several Laboratory activities such as experimental sciences, special nuclear materials, theoretical/computations, and physical support operations.

Laboratory analyses requested for TA-03 samples having decision-level quality data are presented in Table 2.0-1. Laboratory analyses requested for TA-03 samples having screening-level quality data are presented in Table 2.0-2. Decision-level quality data for TA-03 is provided in Tables 2.0-3 to 2.0-10. Screening-level quality data for TA-03 is provided in Tables 2.0-11 to 2.0-15. All laboratory analytical data (both decision-level quality and screening-level quality) are also provided in Appendix B.

### 2.1 SWMU 03-002(c), Former Storage Area

SWMU 03-002(c) is the site of a former 19-ft × 15-ft wood storage shed (structure 03-1494) located 100 ft west of the former Johnson Controls, Inc. administrative office (building 03-0070) (Figure 2.1-1). From the early 1960s to 1984, the shed was used to store containers of liquid and powdered pesticides and possibly herbicides. The shed was removed in 1989 and the floor was disposed of as hazardous waste. Between 1994 and 1996, the original concrete pad beneath the shed was surrounded by a new concrete pad that covered the site (LANL 1996, 052930, p. 41). Asphalt paving for a new roadway was placed over the eastern portion of this site in 2006 (LANL 2008, 099214).

A Phase I RFI was conducted at SWMU 03-002(c) in 1994 to determine if there had been a release of pesticides from the storage shed (LANL 1996, 052930, p. 41). Six soil samples, including one duplicate, were collected from five locations. At four locations under the concrete pad, samples were collected from a depth of 0 to 0.5 ft below ground surface (bgs). At the fifth location, down gradient of the bermed pad, the sample was collected from a depth of 0 to 0.25 ft bgs. All samples were submitted for laboratory analyses of metals, semivolatile organic chemicals (SVOCs), polychlorinated biphenyls (PCBs), pesticides, herbicides, gross alpha, beta, and gamma radiation, and tritium. One sample collected from the 0- to 0.5-ft interval was also submitted for laboratory analysis of volatile organic chemicals (VOCs) (LANL 1996, 052930, p. 44). Requested analyses are presented in Table 2.0-2.

Data are of screening-level quality and are presented in Table 2.0-11. Sampling locations are shown in Figures 2.1-2, 2.1-3, and 2.1-4. Cadmium, manganese, mercury, and silver were each detected in one sample above BVs; zinc and calcium were each detected above BVs in two and three samples, respectively. Organic chemicals and radionuclides were not detected.

## **2.2 SWMU 03-003(c), Equipment Storage Area—PCB Site**

SWMU 03-003(c) was a temporary equipment storage area for used dielectric fluids and capacitors located on the south side of former building 03-0287 (LANL 1993, 020947, p. 6-24) (Figure 2.2-1). Building 03-0287 was constructed between 1966 and 1968 to house a magnetic confinement experiment for the heating and confinement of hot plasmas. The experiment, known as the Scyllac Project, was constructed from 1968 to 1972 and operated from 1972 to 1978. The experiment was energized by a capacitor bank housing 3300 sealed non-PCB capacitors. The sealed capacitors contained non-PCB dielectric oil and each of the associated spark-gap switches required approximately 2 qt of non-PCB mineral oil for electrical insulation (LANL 1995, 057590, p. 6-69). Before the mid-1980s decommissioning of this experiment, oil samples from spark gap switches and swipe samples from numerous surfaces within the room where the equipment was housed were analyzed for PCBs. PCBs results were less than 2 parts per million (ppm). During the decommissioning of the experiment, some of the capacitors were temporarily stored outside the building at SWMU 03-003(c). Swipe samples collected from the pavement were found to be free of PCBs (LANL 1995, 051878, p. 2-15). Before the remodeling of building 03-0287 in late 1992 and early 1993, a single surface soil sample was collected from the south side of building 03-0287 to supplement the previous PCB survey of the building's interior. No PCBs were detected (LANL 1993, 020947, p. 6-24).

In 2003 and 2004, building 03-0287 underwent decontamination and decommissioning (D&D) activities to make way for the National Security Science Building (NSSB), building 03-1400. Following the removal of building 03-0287 and all surrounding asphalt, including the location of SWMU 03-003(c), approximately 10 ft of clean fill was placed over the entire site to accommodate the NSSB (LANL 2008, 099214).

In 2001 (before D&D of building 03-0287), three asphalt samples were collected from three locations at SWMU 03-003(c), and three fill samples were collected from beneath the asphalt at a depth of 0 to 0.5 ft bgs (LANL 2001–2002, 100703, p. 13). Observations recorded by field personnel during sample collection activities indicated no staining or odors. Samples were submitted for laboratory analysis of PCBs (LANL 2005, 100704, p. 3). The requested analysis is presented in Table 2.0-1.

Data are of decision-level quality and are presented in Tables 2.0-6 and 2.0-9. Sampling locations and detected results are shown on Figure 2.2-2. Aroclor-1254 was detected in two fill samples and two asphalt samples.

### **2.3 AOC 03-003(d), Transformer Area—PCB Site**

AOC 03-003(d) is a concrete pad located east of building 03-0141 where two former PCB-containing transformers, structures 03-0146 and 03-0176, were formerly located (Figure 2.3-1). These transformers (PCB identification numbers 5008 and 5009) contained PCB concentrations greater than 500 ppm and were removed in 1991 and 1992, respectively, in accordance with the DOE/Albuquerque Operations Office Environmental Restoration and Waste Management Five-Year Plan (LANL 1995, 057590). Under this plan, any evidence of a release was sampled and cleaned up in accordance with Toxic Substance Control Act (TSCA) requirements (40 Code of Federal Regulations [CFR] 761). Because no stains were visible on the concrete pad after the transformers were removed, the area was considered free of contamination and new non-PCB transformers were relocated on the same concrete pad. Additional concrete was added to extend the existing pad in 1993 (LANL, 1995, 057590, p. 6-63).

Samples have not been collected at this AOC. Although there is no data specific to this AOC, the location of the AOC in relation to other sampling locations and detected results is shown on Figures 2.3-2, 2.3-3, and 2.3-4.

### **2.4 AOC 03-003(f), Transformer Area—PCB Site**

AOC 03-003(f) is an area in the basement of the Sigma building (building 03-0066) where nine PCB-containing transformers were formerly located (Figure 2.4-1). The transformers were removed in 1991 in accordance with the DOE/Albuquerque Operations Office Environmental Restoration and Waste Management Five-Year Plan (LANL 1995, 057590). Under this plan, any evidence of a release was sampled and cleaned up in accordance with TSCA requirements (40 CFR 761). For all but one of the PCB-containing transformers, samples collected following their removal indicated that PCB concentrations were less than 10 ppm, the U.S. Environmental Protection Agency (EPA) TSCA cleanup standard. Stained concrete slabs for all the transformers were removed in 1992 and taken to TA-54, Area G. Soil and gravel samples collected from beneath the excavated concrete pads in building 03-0066 indicated PCB concentrations less than 1.6 ppm. New concrete pads were poured at these sites and non-PCB transformers were installed in 1992. One area remained a concern because of a spill of PCB containing oil that occurred in 1991. Approximately 3 gal. of PCB-containing dielectric fluid were spilled during efforts to remove a 1500 kilovolt (kV) transformer from the building 03-0066 basement. The floor was subsequently encapsulated with plasite, a pigmented epoxy (LANL 1995, 057590, pp. 6-65, 6-66).

Swipe samples were collected from four areas of the basement floor of building 03-0066 and analyzed for PCBs. PCB concentrations were below  $2.5 \mu\text{g}/100 \text{ cm}^2$ , less than the EPA TSCA cleanup standard of  $10 \mu\text{g}/100 \text{ cm}^2$  (LANL 1995, 057590, p. 6-66).

Additional samples have not been collected at this AOC. Although there is no data specific to this AOC, the location of the AOC in relation to other sampling locations and detected results is shown on Figures 2.4-2, 2.4-3, and 2.4-4.

### **2.5 AOC 03-003(g), Transformer Area—PCB Site**

AOC 03-003(g) is the former location of a PCB-containing transformer located in the basement of building 03-0035 (Figure 2.4-1). The transformer contained PCBs greater than 500 ppm and was replaced with a non-PCB transformer in 1984 in accordance with the DOE/Albuquerque Operations Office Environmental Restoration and Waste Management Five-Year Plan (LANL 1995, 057590). Under this plan, any evidence of a release was sampled and cleaned up in accordance with TSCA requirements



(40 CFR 761). Oil staining was not present on the concrete upon removal of the transformer. Archival research revealed no record of releases (LANL 1995, 057590, p. 6-65). Building 03-0035 was constructed in 1953 and housed operations to fabricate enriched uranium-loaded graphite and carbide fuel elements. The building was additionally used for the fabrication of cable assemblies in support of the weapons program, rack mechanics, the Meson Physics Facility, and service programs (LANL 1999, 064617, p. 2-19).

Samples have not been collected at this AOC.

## **2.6 AOC 03-003(o), Capacitor Bank Area—PCB Site**

AOC 03-003(o) was a storage area in former building 03-0287 (Figure 2.2-1) for a 60 kV capacitor bank used during the Scyllac Project (see section 2.2) (LANL 1995, 057590, p. 6-69). During the decommissioning of building 03-0287, the capacitors were temporarily stored south of the building at AOC 03-003(o). Swipe samples were collected from the pavement at AOC 03-003(o) and were free of PCB contamination (LANL 1995, 057590, p. 6-69).

Additional samples have not been collected at this AOC.

## **2.7 Consolidated Unit 03-009(a)-00, Asphalt Batch Plant**

Consolidated Unit 03-009(a)-00 includes SWMUs 03-009(a), 03-028, 03-029, 03-036(a), 03-036(c), 03-036(d), 03-045(g) and AOCs 03-043(b), 03-043(d), and 03-043(h) (Figure 2.1-1) and is related to the former asphalt batch plant operations. According to the RFI Work Plan addendum (LANL 1995, 057590), AOCs 03-043(d) and 03-043(h) are duplicates of SWMU 03-036(a). SWMU 03-036(a) consists of two former asphalt emulsion tanks; each duplicate AOC describes one of these tanks (LANL 1995, 057590, p. 6-19).

This consolidated unit consists of disposal sites associated with normal construction and infrastructure maintenance at the former asphalt batch plant (building 03-0073). These disposal sites contained items such as concrete, cured asphalt, and soil. Components of these materials include asphalt, petroleum hydrocarbons, water, and light distillates (LANL 1995, 057590, p. 6-15).

Each of the SWMUs and AOCs in this consolidated unit is discussed individually in sections 2.7.1 to 2.7.10.

### **2.7.1 SWMU 03-009(a), Surface Disposal (Soil Fill)**

SWMU 03-009(a) is a 30-ft × 300-ft fill area located on the rim of a small tributary of Sandia Canyon south of the former TA-03 asphalt batch plant (LANL 1993, 020947, p. 6-16) (Figure 2.1-1). The fill was generated by asphalt plant operations and contained small amounts of concrete, building materials, and asphalt road-construction debris. The depth of the fill is unknown. A 20-ft section of asbestos pipe was observed at SWMU 03-009(a) in 1990; however, evidence of this pipe was not observed during a 1992 site visit (LANL 1993, 020947, p. 6-17).

During the RFI activities performed in 2003, one tuff sample was collected at one location from a depth of 4 to 5 ft bgs; one fill and one tuff sample were collected from a second location at depths of 14.5 to 15 ft bgs and 19.5 to 20 ft bgs, respectively; and two tuff samples were collected from a third location at depths of 4 to 5 ft bgs and 19.5 to 20 ft bgs. Samples were submitted for laboratory analyses of metals, VOCs, SVOCs, and total petroleum hydrocarbons (TPH). Requested analyses are presented in Table 2.0-1.

Data are of decision-level quality and are presented in Tables 2.0-3 and 2.0-4. Sampling locations and detected results are shown in Figures 2.1-2 and 2.1-3. Selenium was detected above BV in two tuff samples, methylene chloride was detected in the fill sample and two tuff samples, and tetrachloroethene (PCE) was detected in the fill sample. SVOCs and TPH were not detected.

### **2.7.2 SWMU 03-028, Surface Impoundment**

SWMU 03-028 is a former 12-ft- x 15-ft- x 6-ft-deep concrete holding pond at the northeast corner of the asphalt batch plant (Figure 2.1-1). The site was used as a settling pond for mineral dust and particulates captured by scrubber water from the plant. Water from the pond was recycled to the scrubber system and was replenished with potable water. Discharge from the pond to the SWMU 03-045(g) outfall (see section 2.7.10) was intermittent and averaged 300 gal./d when the plant was operational. Discharges from the outfall ceased in 1990 (LANL 1999, 064617, p. 2-7). In 2003, the empty and dry concrete pond was filled with pea gravel and the surface of the site was paved with asphalt for use as a parking lot (LANL 2008, 099214).

RFI activities were performed during 2003 (LANL 2003, 079741). One soil and three tuff samples were collected from two boreholes in the former holding pond. The soil sample and one tuff sample were collected from one borehole at depths of 5 to 5.5 ft bgs and 19 to 19.5 ft bgs; the remaining two tuff samples were collected from the second borehole at depths of 7.5 to 8 ft bgs and 19.5 to 20 ft bgs. Samples were submitted for laboratory analyses of metals, SVOCs, VOCs, and TPH (Shaw Environmental Inc. 2003, 085517, p. 10, 26). Requested analyses are presented in Table 2.0-1.

Data are of decision-level quality and are presented in Tables 2.0-3, 2.0-4 and 2.0-5. Sampling locations and detected results are shown in Figures 2.1-2 and 2.1-3. Aluminum, arsenic, barium, calcium, copper, lead, magnesium, and nickel were detected above BVs in one tuff sample. Selenium was detected above BV in all three tuff samples. Acetone and methylene chloride were detected in two tuff samples; bis(2-ethylhexyl)phthalate was detected in the soil sample; and benzoic acid was detected in one soil and one tuff sample. TPH was not detected.

### **2.7.3 SWMU 03-029, Landfill**

SWMU 03-029 is a 30-ft x 70-ft former landfill located approximately 300 ft south of building 03-0271 near the rim of Sandia Canyon (LANL 1999, 064617, p. 2-17) (Figure 2.7-1). Historically, this landfill received excess asphalt from the batch plant and was subsequently covered with sand. The fill raised and leveled the surface areas at the mesa rim. Visual observation shows the debris at this SWMU to be asphalt pieces sized less than 1 ft<sup>2</sup>. NMED issued a notice of violation to LANL in November 1990 concerning pieces of asphalt and an oily sheen found in the Sandia Canyon watercourse below building 03-0073 (LANL 1995, 057590, p. 6-23). LANL completed a required corrective action at SWMU 03-029 in early 1993 to remove the asphalt within the drainage and on the associated slope, regrade the watercourse and slope to support vegetation, extend the drainage, and construct a concrete berm to prevent additional exposure of asphalt buried in the fill. Dense grass cover was seeded and maintained on all fill slopes and disturbed areas (LANL 1995, 057590, p. 6-24). Water samples collected from the storm drain indicated that oil, grease, or other compounds typically associated with asphalt plant operations were not present (LANL 1995, 057590, p. 6-24).

An accelerated corrective action (ACA) was proposed for completing the investigation and remediation of SWMU 03-029 in 2004 to accommodate the Laboratory's security perimeter project. SWMU 03-029 was situated in the proposed location for the security perimeter road (LANL 2004, 087474, p. 1). In May 2005, a geophysical survey was conducted at SWMU 03-029 consisting of ground penetrating radar (GPR) and

electromagnetic (EM) surveys. The survey results identified two possible locations for buried waste, which were further investigated by trenching. In July 2005, a total of 12 trenches were excavated to the top of bedrock, approximately 2 to 4 ft bgs, and varied in length from 20 ft to greater than 100 ft. Buried waste was not encountered in any of the trenches (LANL 2005, 091150, p. 10). Because buried waste was not encountered, the remaining proposed ACA activities for SWMU 03-029 were not completed (LANL 2005, 091150, p. 29).

Samples have not been collected at this SWMU. Although there is no data specific to this SWMU, the location of the SWMU in relation to other sampling locations and detected results is shown on Figures 2.7-2, 2.7-3, and 2.7-4.

#### **2.7.4 SWMU 03-036(a), Aboveground Storage Tanks**

SWMU 03-036(a) is the location of two former asphalt emulsion product tanks (structures 03-0075 and 03-0076) located at the former asphalt batch plant (Figure 2.1-1). Structures 03-0075 and 03-0076 are also designated as SWMUs 03-043(d) and 03-043(h) in the 1993 RFI Work Plan (LANL 1993, 020947). The tanks were approximately 25 to 30 ft in diameter and 8 to 12 ft high, with a capacity of 30,000 to 50,000 gal. (LANL 1993, 020947, p. 6-30). The tanks stored asphalt emulsion and were located within a soil-bermed secondary containment area approximately 225 ft southwest of building 03-0070 (LANL 1995, 057590, p. 6-19). Each tank was located within its own containment area, which measured approximately 50 ft in diameter. Plant operations resulted in some small spills that were contained within the berms. In 1987, structure 03-0075 ruptured near its base and released 1500 gal. of asphalt emulsion. The spill was contained within the berm, mixed with sand, and disposed of at the Los Alamos County landfill. Between October 1988 and April 1989, both tanks were removed, cut up, and deposited in the Los Alamos County landfill. All soil around and beneath the tanks was also removed, mixed with sand, hardened, and deposited at the Los Alamos County landfill (LANL 1993, 020947, p. 6-30). The area was then used for storage and preparation of crack-sealing machines until batch plant operations ceased in 2002. The surface of the site was paved with asphalt for use as a parking lot in 2003 (LANL 2008, 099214).

Before paving the site, sampling activities were conducted in 2003 to characterize the impact of several SWMUs in the vicinity (LANL 2003, 080912, p. 1). During the investigation, one shallow borehole was drilled at SWMU 03-036(a) and two tuff samples were collected at depths of 8.5 to 9 ft and 19.5 to 20 ft bgs. Samples were submitted for laboratory analyses of metals, VOCs, SVOCs, TPH-diesel range organic (DRO), and TPH-gasoline range organic (GRO) (Shaw Environmental Inc., 2003, 085517, pp. 10, 26). Requested analyses are presented in Table 2.0-1.

Data are of decision-level quality and are presented in Tables 2.0-3, 2.0-4, and 2.0-5. Sampling locations and detected results are shown in Figures 2.1-2 and 2.1-3. Selenium was detected in one sample above BV. Acetone, PCE, and benzoic acid were also detected in one sample. TPH was not detected.

#### **2.7.5 SWMU 03-036(c), Aboveground Storage Tanks**

SWMU 03-036(c) is the location of a former 30,000-gal. asphalt emulsion tank, structure 03-0178 (Figure 2.1-1). Structure 03-0178 was relocated to TA-03 from TA-49 in 1963 to replace the underground asphalt emulsion storage tank, structure 03-0074 [AOC 03-043(a)]. Structure 03-0178 was formerly located approximately 150 ft southwest of building 03-0070. While in use, the tank was partially buried with sand and gravel packed around the base. In 1989, the tank was removed, cut apart, and disposed of at the Los Alamos County landfill. An inspection determined the tank had not leaked (LANL 1995, 057590, p. 6-19). The former tank location was used to store aggregate and to mix feed for the asphalt

batch plant until the plant was decommissioned in 2002. In 2003, the surface of the site was paved with asphalt for use as a parking lot (LANL 2008, 099214).

Before paving the site, sampling was conducted in 2003 to characterize the impact of several SWMUs in the vicinity (LANL 2003, 080912, p. 1). During the investigation, one shallow borehole was drilled at SWMU 03-036(c) and two tuff samples were collected at depths of 3 to 4 ft and 19.5 to 20 ft bgs. Samples were submitted for laboratory analyses of metals, VOCs, SVOCs, TPH-DRO, and TPH-GRO (Shaw Environmental Inc., 2003, 085517, pp. 10, 26). Requested analyses are presented in Table 2.0-1.

Data are of decision-level quality and are presented in Tables 2.0-3 and 2.0-4. Sampling locations and detected results are shown in Figures 2.1-2 and 2.1-3. Arsenic and selenium were detected above BVs in one sample. Acetone was detected in one sample.

### **2.7.6 SWMU 03-036(d), Underground Storage Tanks**

SWMU 03-036(d) is the location of a former 10,000-gal. underground steel storage tank, structure 03-0335, that stored asphalt emulsion. Structure 03-0335 was located approximately 12 ft north of structure 03-0178 [SWMU 03-036(c)] (Figure 2.1-1). The tank was installed in 1967 and measured 8 ft in diameter x 28 ft long. In 1989, the tank was cleaned out, removed, cut apart, and disposed of at the Los Alamos County landfill. An inspection determined the tank had not leaked (LANL 1995, 057590, p. 6-19). The former tank location was used to store aggregate and to mix feed for the asphalt batch plant until the plant was decommissioned in 2002. In 2003, the surface of the site was paved with asphalt for use as a parking lot (LANL 2008, 099214).

Before paving the site, sampling was conducted in 2003 to characterize the impact of several SWMUs in the vicinity (LANL 2003, 080912, p. 1). During the investigation, one shallow borehole was drilled at SWMU 03-036(d) and one tuff sample was collected at a depth of 4.5 to 5 ft bgs. The sample was submitted for laboratory analyses of metals, VOCs, SVOCs, TPH-DRO, and TPH-GRO (Shaw Environmental Inc., 2003, 085517, pp. 10, 26). Requested analyses are presented in Table 2.0-1.

Data are of decision-level quality and are presented in Tables 2.0-3, 2.0-4, and 2.0-6. The sampling location and detected results are shown in Figures 2.1-2 and 2.1-3. Lead and selenium were detected above BVs in one sample and PCE and TPH-GRO were detected in one sample. SVOCs and TPH-DRO were not detected.

### **2.7.7 AOC 03-043(b), Aboveground Storage Tank**

AOC 03-043(b) is the location of a former 10,000-gal. asphalt emulsion storage tank, structure 03-0077, installed in 1948 (Figure 2.1-1). The tank was partially buried with sand and gravel packed around the base. In 1980, the tank was cleaned out, removed, cut up, and disposed of at the Los Alamos County landfill. Stained soil beneath and around the tank was excavated and taken to the landfill (LANL 1995, 057590, p. 6-18). The former tank location was used to store aggregate and to mix feed for the asphalt batch plant until it was decommissioned in 2002. In 2003, the surface of the site was paved with asphalt for use as a parking lot (LANL 2008, 099214).

Before paving the site, sampling was conducted in 2003 to characterize the impact of several SWMUs in the vicinity (LANL 2003, 080912, p. 1). During the investigation, two shallow boreholes were drilled at AOC 03-043(b). Two tuff samples were collected from one borehole at depths of 9.5 to 10 ft bgs and 19.5 to 20 ft bgs. One tuff sample was collected from the second borehole at a depth of 19.5 to 20 ft bgs. Samples were submitted for laboratory analyses of metals, VOCs, SVOCs, TPH-DRO, and TPH-GRO (Shaw Environmental Inc., 2003, 085517, pp. 10, 26). Requested analyses are presented in Table 2.0-1.

Data are of decision-level quality and are presented in Tables 2.0-3 and 2.0-4. Sampling locations and detected results are shown in Figures 2.1-2 and 2.1-3. Aluminum, arsenic, barium, chromium, iron, lead, magnesium, nickel, and zinc were detected above BVs in one sample. Selenium was detected above BV in two samples. Acetone was detected in one sample. SVOCs and TPH were not detected.

### **2.7.8 AOC 03-043(d), Aboveground Storage Tank**

AOC 03-043(d) is a duplicate of SWMU 03-036(a). Refer to section 2.7.4 for more information.

### **2.7.9 AOC 03-043(h), Aboveground Storage Tank**

AOC 03-043(h) is a duplicate of SWMU 03-036(a). Refer to section 2.7.4 for more information.

### **2.7.10 SWMU 03-045(g), Storm Drain**

SWMU 03-045(g) consists of a closed and locked storm drain that connected to an inactive outfall, formerly permitted under the EPA National Pollutant Discharge Elimination System (NPDES) as EPA 04A109 (LANL 1993, 020947, p. 6-12). The outfall discharged to a tributary of Sandia Canyon directly south of the former asphalt batch plant (Figure 2.1-1). The storm drain has been closed and locked since late 1990. Outfall 04A109 had been permitted for the discharge of non-contact cooling water and was removed from the NPDES permit in 1994 (LANL 1999, 064617, p. 2-7). Since 1987, the only intentional discharge from the asphalt plant to the outfall was from a former holding pond (SWMU 03-028) used to collect dust from batching operations. Stormwater from parking lots, roads, and roof drains located west of the former asphalt batch plant also discharged to the outfall along with intermittent discharges from the former holding pond and a one-time oil emulsion spill from AOC 03-005 (LANL 1995, 057590, p. 6-25).

In 2003, four sediment samples were collected within the catch basin of the closed storm drain (located approximately 150 ft north of the outfall). The four sediment samples were collected from two locations at depths of 0 to 0.5 ft bgs and 1.5 to 2 ft bgs using a hand auger. Samples were submitted for laboratory analyses of metals, VOCs, SVOCs, TPH-DRO, and TPH-GRO (Shaw Environmental Inc., 2003, 085517, pp. 10, 26). Requested analyses are presented in Table 2.0-1.

Data are of decision-level quality and are presented in Tables 2.0-3, 2.0-4, 2.0-5, and 2.0-6. Sampling locations and detected results are shown in Figures 2.1-2 and 2.1-3. Arsenic and lead were detected above BVs in one sample. Cadmium, cobalt, iron, manganese, potassium, and sodium were detected above BVs in two samples. Barium, copper, vanadium, and zinc were detected above BVs in three samples. Calcium, chromium, magnesium, and nickel were detected above BVs in all four samples. Butylbenzene(n-), isopropyltoluene(4-), trichloroethene (TCE), trimethylbenzene(1,2,4-), and trimethylbenzene(1,3,5-), and TPH-GRO were detected in one sample. Benzo(g,h,i)perylene was detected in two samples. Benzo(a)anthracene, benzo(a)pyrene, benzo(b)fluoranthene, benzo(k)fluoranthene, chrysene, indeno(1,2,3-cd)pyrene, and phenanthrene were detected in three samples. Methylene chloride, bis(2-ethylhexyl)phthalate, fluoranthene, and pyrene were detected in all four samples. TPH-DRO was not detected.

## **2.8 SWMU 03-009(i), Surface Disposal Site**

SWMU 03-009(i) is an inactive construction debris surface disposal site located east of the liquid and compressed gas facility (building 03-0170) (Figure 2.8-1). Construction debris at the site consists of crushed tuff, pieces of concrete, rock, and piles of fill. Use of this surface disposal site was discontinued in 1980 (LANL 1995, 057590, p. 6-4).

Samples have not been collected at this SWMU. Although there is no data specific to this SWMU, the location of the SWMU in relation to other sampling locations and detected results is shown on Figures 2.8-2 and 2.8-3.

## 2.9 Consolidated Unit 03-012(b)-00, Power Plant

Four SWMUs form Consolidated Unit 03-012(b)-00: SWMUs 03-014(q), 03-045(c), 03-012(b), and 03-045(b) (Figure 2.9-1). SWMU 03-045(b) is a duplicate of 03-012(b). The SWMUs within this consolidated unit are associated with the TA-03 power plant (building 03-0022) operations. SWMU 03-014(q) is a cooling water holding tank; SWMUs 03-045(c), 03-012(b), and 03-045(b) are outfalls that discharge into a small tributary of Sandia Canyon directly south of the steam power (LANL 1996, 052930, p. 57). Each SWMU is discussed individually in sections 2.9.1 to 2.9.4.

Available records indicate that the cooling tower for the TA-03 power plant (building 03-0022) used the largest amounts of potassium dichromate at the Laboratory. Chromium usage at the power plant averaged 35.9 lb/d from 1950 to the mid-1970s (DOE 1987, 008663; DOE 1987, 008664). This amount was discharged into Upper Sandia Canyon through NPDES-permitted outfall EPA 01A001 [SWMU 03-012(b)] with blowdown water volumes ranging from 128,000 to 288,000 gal./d. Hexavalent chromium concentrations up to 34 ppm were reported in the discharge; average stream concentrations of 10 to 15 ppm were also reported (DOE 1987, 008663; DOE 1987, 008664). A gas turbine generator was installed on the eastern side of the power plant within the boundary of Consolidated Unit 03-012(b)-00 in 2007 (LANL 2008, 099214).

Based on Phase I RFI results, inorganic chemicals including chromium are the primary contaminants for Consolidated Unit 03-012(b)-00 near the cooling towers. Because the cooling towers produced an over spray that fell to the ground around the towers, the soil in the vicinity of the cooling towers may contain elevated chromium concentrations (Caporuscio 2003, 088444, p. 1).

In 2002, soil samples were collected around the mesa top structures of Consolidated Unit 03-012(b)-00 to characterize the site conditions and for waste characterization purposes before installation of a gas turbine generator and associated utilities. The sampling objective was to determine if there had been any releases to the mesa top soil from the cooling towers. Sampling was conducted within the anticipated footprint of the proposed utility corridor for the new gas turbine cooling towers (Caporuscio 2003, 088444, pp. 1, 2). Twenty-eight fill samples were collected from fourteen locations at depths of 0 to 0.5 ft and 0.5 to 1 ft; four fill samples were collected at four locations from a depth of 0.5 to 1 ft. The samples were analyzed for metals and hexavalent chromium. Requested analyses are presented in Table 2.0-1.

Data are of decision-level quality and are presented in Table 2.0-3. Sampling locations and detected results are shown in Figure 2.9-2. Mercury was detected above BV in one fill sample; copper was detected above BV in two fill samples; cadmium was detected above BV in three fill samples; chromium, silver, and zinc were detected above BVs in 6, 5, and 10 fill samples, respectively. Hexavalent chromium was detected in 17 fill samples. Detection limits for antimony, cadmium, silver, and thallium were greater than BVs in one fill sample.

In 2004, eighteen soil samples were collected from nine locations at the planned location of a new utility trench for the gas turbine generator. The sampling activities included the collection of surface and subsurface soil samples from the mesa top directly north and east of a former cooling tower (structure 03-0025). Sixteen samples were collected from eight locations at depths of 0 to 0.5 ft and 3.5 to 4 ft bgs; two samples were collected from a ninth location at depths of 0.8 to 1.3 ft and 1.8 to 2.8 ft bgs. All samples were analyzed for metals and hexavalent chromium. Four surface soil samples were also

analyzed for PCBs (LANL 2003, 080102, p. 1; LANL 2003, 100705, pp. 2–20). Requested analyses are presented in Table 2.0-1.

Data are of decision-level quality and are presented in Tables 2.0-3 and 2.0-6. Sampling locations and detected results are shown in Figures 2.9-2 and 2.9-3. Zinc was detected above BV in three samples; chromium and silver were detected above BVs in four and five samples, respectively. Hexavalent chromium was detected in five samples. The detection limit for cadmium was greater than BV in numerous samples. Aroclor-1254 and aroclor-1260 were detected in three and four samples, respectively.

### 2.9.1 SWMU 03-012(b), Operational Release and Outfall

SWMU 03-012(b) is the outfall associated with the TA-03 power plant, building 03-0022 (Figure 2.9-1). From 1951 to 1985, SWMU 03-012(b) discharged cooling water originating from treated effluent generated by the TA-03 Wastewater Treatment Plant (WWTP) [Consolidated Unit 03-014(a)-99]. In the past, water from the WWTP was treated with chromates before being used as cooling water at the power plant. The NPDES permit number for the outfall was previously identified as EPA 01A001, but is currently permitted as 001 on the 2007 NPDES authorization permit (EPA 2007, 099009). The outfall is currently authorized to discharge power plant waste water from cooling towers, boiler blowdown drains, demineralizer backwash, floor and sink drains, and treated sanitary reuse to Sandia Canyon (EPA 2007, 099009, p. 1). The outfall discharges onto sand and gravel southeast of building 03-0022 and into a small tributary of Sandia Canyon. Discharge from another permitted outfall (13S) at the TA-46 Sanitary Wastewater Systems Consolidation (SWSC) plant is pumped to the TA-03 power plant for reuse and eventually discharges to SWMU 03-012(b). The outfall received effluent from two power plant cooling towers (structures 03-0025 and 03-0058) and also the chlorine building (structure 03-0024). One cooling tower (structure 03-0025) was demolished in 1990, but until 1998 when a new cooling tower (structure 03-0592) was constructed at the same location (LANL 2008, 099214), the concrete foundation of structure 03-0025 collected stormwater that discharged to the outfall (LANL 1996, 052930, p. 56). The two cooling tower structures (03-0058 and 03-0592) are currently in operation and continue to discharge to SWMU 03-012(b) (LANL 2008, 099214).

A one-time release of sulfuric acid to the SWMU 03-012(b) outfall from the power plant holding tank, structure 03-0336 [SWMU 03-014(q)], occurred in 1990 (LANL 1995, 057590, p. 5-27-1). Low potential of hydrogen (pH) values were observed in a 2.5-mi section of the watercourse below the outfall. Soda ash was added along the watercourse to raise the pH. A subsequent pH survey detected no measurements below pH 6.9 (LANL 1996, 052930, p. 56).

RFI activities were conducted at SWMU 03-012(b) in 1994. Eleven soil and sediment samples were collected from five locations at a depth of 0 to 0.5 ft bgs. Four of the samples were collected from two locations (three from one location and one from another) near the outfall. Seven samples were collected from three downstream locations (three samples each from two locations and one from a third) to characterize the sediment in the outfall channel. All samples were submitted for laboratory analyses of PCBs, gross alpha, beta, and gamma radiation, and tritium; eight samples were submitted for laboratory analyses of herbicides; five samples were submitted for laboratory analysis of metals, VOCs, SVOCs, pesticides, and gamma spectroscopy; one sample was submitted for laboratory analyses of isotopic plutonium, uranium, and strontium-90 (LANL 1996, 052930, pp. 57–60). Requested analyses are presented in Table 2.0-2.

Data are of screening-level quality and are presented in Tables 2.0-11, 2.0-13, 2.0-14, and 2.0-15. Sampling locations are shown in Figures 2.9-2, 2.9-3, and 2.9-4. Arsenic, cadmium, lead, and nickel were

detected in one sample above BVs. Chromium and silver were detected in two samples above BVs. Anthracene, benzo(a)anthracene, benzo(a)pyrene, benzo(b)fluoranthene, benzo(g,h,i)perylene, benzo(k)fluoranthene, chrysene, dibenz(a,h)anthracene, indeno(1,2,3-cd)pyrene, phenanthrene, pyrene, and total PCBs were detected in one sample. Fluoranthene was detected in two samples. Aroclor-1260 was detected in three samples. Plutonium-238, plutonium-239/240, uranium-234, uranium-235, and uranium-236 were detected above BVs/FVs in one sample. Tritium was detected in three samples.

### **2.9.2 SWMU 03-014(q), Holding Tank**

SWMU 03-014(q) (Figure 2.9-1) is the former effluent sewage storage tank (structure 03-0336) for the power plant (building 03-0022) (LANL 1990, 007511, p. 3-014). Between 1951 and 1985, the tank received and stored effluent from the former WWTP for use as cooling water for the power plant cooling towers (structures 03-0025 and 03-0058). The effluent was pumped to the holding tank and treated to hinder bacteria growth. In the past, chromates were used to treat the effluent (LANL 1993, 020947, p. 5-48).

Although samples have not been collected at this SWMU, soil and fill samples were collected within the vicinity of the SWMU during the 2002 and 2004 sampling activities for Consolidated Unit 03-012(b)-00 discussed in section 2.9. Requested analyses for Consolidated Unit 03-012(b)-00 are presented in Table 2.0-1. Data for Consolidated Unit 03-012(b)-00 are presented in Tables 2.0-3 and 2.0-6. Sampling locations and detected results for Consolidated Unit 03-012(b)-00 are shown in Figures 2.9-2 and 2.9-3.

### **2.9.3 SWMU 03-045(b), Operational Release**

SWMU 03-045(b) is a duplicate of SWMU 03-012(b). Refer to section 2.9.1 for more information.

### **2.9.4 SWMU 03-045(c), Outfall**

SWMU 03-045(c) is a NPDES-permitted outfall (EPA 03A027), located approximately 55 ft east of SWMU 03-012(b) (LANL 1996, 052930, p. 56) (Figure 2.9-1). SWMU 03-045(c) receives effluent from a cooling tower (structure 03-0285), which serves the generators that power LANL's computer system. SWMU 03-045(c) may have received chromate-treated water (LANL 1996, 052930, p. 56-57). Outfall 03A027 is currently permitted for the discharge of cooling tower blowdown water and other wastewater from structure 03-0285 (EPA 2007, 099009).

Sampling has not been conducted at SWMU 03-045(c).

## **2.10 Consolidated Unit 03-013(a)-00**

Consolidated Unit 03-013(a)-00 consists of SWMU 03-013(a) and SWMU 03-052(f). SWMU 03-013(a) is a storm drain that served building 03-0038 (Figure 2.10-1); SWMU 03-052(f) is the associated outfall located northeast of building 03-0207 (Figure 2.10-2) that ultimately discharged into Sandia Canyon (LANL 1996, 052930, p. 73). SWMU 03-013(b) (building 03-0038 floor drains, see section 2.11) formerly drained into SWMU 03-052(f), but was rerouted to the sanitary sewer system in 1987 (LANL 1995, 057590, p. 5-25-1).

### **2.10.1 SWMU 03-013(a), Storm Drain**

SWMU 03-013(a) is a 1500-ft long corrugated metal pipe storm drain that served building 03-0038 (LANL 1996, 052930, p. 73) (Figure 2.10-1). The storm drain ran underground around building 03-0038,



east along the south side of the Otowi Building (building 03-0261), and connected to four other storm drains before daylighting 100 ft east of the Otowi Building where it became an open concrete and rock-lined ditch (LANL 1993, 020947, p. 5-92). The open drain continued past transportable office buildings (buildings 03-1616 and 03-1617) and passed beneath streets and sidewalks to a point northeast of the Oppenheimer Study Center (structure 03-0207) where it discharged to formerly NPDES-permitted outfall EPA 03A023 [SWMU 03-052(f)] (Figure 2.10-2) and emptied into Sandia Canyon (LANL 1993, 020947, p. 5-92).

Most of SWMU 03-013(a) was removed in 2004 to accommodate the construction of the NSSB and a new parking structure (LANL 2008, 099214). The corrugated metal pipe was managed as nonhazardous/nonradioactive industrial waste. Inspection of the drainline trench showed no evidence of a release from the drainpipe. A new storm drainline was installed west of SWMU 03-052(f) to manage stormwater runoff from the new NSSB parking structure.

RFI activities were conducted for SWMU 03-013(a) in the summer of 1994 as part of the RFI for Consolidated Unit 03-013(a)-00. Seven sediment samples (five samples plus one field duplicate and one collocated sample) were collected from five locations (at depths ranging from 0 to 0.6 ft) along the sides and within the SWMU 03-052(f) outfall channel 10 to 50 ft downstream from the outfall pipe (LANL 1995, 057590, p. 5-25-3). Sampling locations were biased to areas where sediment could be collected (LANL 1996, 052930, p. 75). Samples were field screened and analyzed for gross alpha, beta, and gamma radiation, tritium, metals, PCBs, VOCs, and SVOCs. Requested analyses are presented in Table 2.0-2.

Data are of screening-level quality and are presented in Tables 2.0-11 and 2.0-14,. Sampling locations are shown in Figures 2.10-3, 2.10-4, and 2.10-5. Chromium, copper, and mercury were detected above BVs in one sample. Lead was detected above BVs in three samples and zinc in six samples. Aroclor-1254 and total PCBs were detected in one sample. VOCs, SVOCs, and radionuclides were not detected.

### **2.10.2 SWMU 03-052(f), Outfall**

SWMU 03-052(f) is a formerly NPDES-permitted outfall (EPA 03A023) (Figure 2.10-2) that received wastewater from floor drains [AOC 03-013(b)], sinks, water fountains and a storm drain [SWMU 03-013(a)] that served building 03-0038 (Figure 2.10-1) until 1987 when the drains in building 03-0038 were rerouted to the TA-03 sanitary sewer system. Stoddard solvents, dry acid, and caustic materials from the maintenance shop were discarded through sinks and floor drains to this outfall. Spent paint solvents and cutting oils contaminated with machined beryllium particles may also have been released to the floor drains during the 1960s and 1970s. In addition, cooling water for welding torches was discharged directly to the drains. The welding torch wastewater may have contained lead, chromium, nickel, and other inorganic chemicals. Two spills from building 03-0287 may have entered the drain system. The first spill was approximately 200 gal. of water/waste oil mixture that was discharged when an automatic compressor blowdown mechanism failed. A second spill from a ruptured air compressor oil line resulted in the release of approximately 1 qt of compressor oil to the drain. This spill produced an oily sheen on the surface of the water at the outfall (LANL 1995, 057590, p. 5-25-1). A third spill occurred when approximately 15 gal. of diesel fuel was released from a ruptured truck fuel line into the utilities construction trench between buildings 03-1793 and 03-1794. On the same day, a clay sewer pipe in the utility trench broke, releasing approximately 2000 gal. of wastewater into the excavation. A sump was used to remove the wastewater from the excavation and the wastewater was discharged to SWMU 03-013(a). The diesel-contaminated asphalt and soil was removed and disposed of at Sigma Mesa. Runoff from parking lots and the surrounding areas also discharge to the outfall (LANL 1995,

057590, p. 5-25-2). Outfall 03A023 was also authorized to discharge cooling tower water and wastewater and was deleted from the NPDES permit July 11, 1997.

RFI activities conducted at SWMU 03-052(f) are the same activities conducted for SWMU 03-013(a), which was part of the 1994 RFI for Consolidated Unit 03-013(a)-00 (LANL 1996, 052930, pp. 73, 74, and 77). Sampling conducted for SWMU 03-013(a) is reported in section 2.10.1. Requested analyses are presented in Table 2.0-2. Data is presented in Tables 2.0-11 and 2.0-14. Sampling locations are shown in Figures 2.10-3, 2.10-4, and 2.10-5.

### **2.11 AOC 03-013(b), Floor Drains**

AOC 03-013(b) is the floor drains in the basement of building 03-0038 (LANL 1993, 020947, p. 5-92) (Figure 2.10-1). The floor drains were located in the plasma-burning machine area, the metals-cutting room, and the pipe-fabrication shop. Until 1987, the floor drains emptied into a storm drain [SWMU 03-013(a)] (LANL 1993, 020947, p. 5-93). SWMU 03-013(b) and SWMU 03-013(a) ultimately discharged to the outfall at SWMU 03-052(f) (Figure 2.10-2) (LANL 1996, 052930, pp. 73, 74). The piping for SWMU 03-013(b) was rerouted to the sanitary sewer line in 1987. During the 1960s and 1970s, spent paint solvents and cutting oils contaminated with machined beryllium particles may have been released to the floor drains. The extent of possible contamination associated with this AOC, if any, was unknown when the RFI work plan was written (LANL 1993, 020947, p. 5-93).

RFI activities conducted at AOC 03-013(b) are the same activities conducted for SWMU 03-013(a), which was part of the 1994 RFI for Consolidated Unit 03-013(a)-00. (LANL 1996, 052930, pp. 73, 74, and 77). Sampling conducted for SWMU 03-013(a) is reported in section 2.10.1. Requested analyses are presented in Table 2.0-2. Data is presented in Tables 2.0-11 and 2.0-14. Sampling locations are shown in Figures 2.10-3, 2.10-4, and 2.10-5.

### **2.12 SWMU 03-013(i), Operational Release**

SWMU 03-013(i) is soil and gravel contaminated from historical releases of hydraulic oil at buildings 03-0246 and 03-0247 (Figure 2.12-1). These buildings housed operations that involved testing the tensile strength of various steel cables used in conjunction with underground nuclear test assemblies. The cable control building (building 03-0246) and the cable stress building (building 03-0247) were collectively referred to as the Pull Test Facility. The facility was constructed before 1967 and operated until the mid-1980s when a replacement facility was constructed on Sigma Mesa. Building 03-0246 was a corrugated metal building constructed on a concrete slab that contained the controls for the pull test equipment, as well as a hydraulic oil compressor and storage tank. Building 03-0247 was a corrugated metal building constructed on a concrete curb surrounding a gravel floor that contained two hydraulic rams used to perform the tensile strength testing. Hydraulic oil was provided to the rams through underground pipes between the buildings (LANL 2005, 091540, pp. 1, 2).

Hydraulic oil appeared to have been released to the concrete slab floor inside building 03-0246 and to have subsequently flowed beneath the building walls and onto the soil surrounding the building. Soil staining was evident along the north side of the building and along the northeast and northwest corners. The gravel floor inside building 03-0247 was visibly stained with oil in several locations beneath the hydraulic ram assembly (LANL 2004, 087406, p. 1). Building 03-0247 and its contents were demolished and removed in 2005. The contents and the concrete slab of building 03-0246 were also demolished and removed in 2005. Following the demolition and removal of the concrete slab, approximately 144 ft<sup>2</sup> of potentially contaminated soil was excavated from the footprint of building 03-0246. Following the demolition and removal of building 03-0247 and its gravel floor, an 8-in. concrete slab was exposed that

was connected to the building foundation on the north and west sides. The slab was removed by over-excavation of the area surrounding the foundation. Stained soil and debris were also removed from SWMU 03-013(i). Confirmation samples were collected at both locations after demolition and removal and the excavation was backfilled and graded (LANL 2005, 091540, p. 1-4).

Eight fill samples were collected from four locations following the excavation of the footprint of building 03-0246. Samples were collected from depths of 0 to 0.5 ft and at 1.5 ft bgs. Four confirmatory fill samples were also collected from two locations downgradient of former building 03-0246 at depths of 0 to 0.5 ft and at 1.5 ft bgs. Four additional fill samples were collected at two locations within the footprint of building 03-0247 at depths of 0 to 0.5 ft and at 1.5 ft bgs (LANL 2005, 091540, p. 4-5). A total of 16 samples were submitted for laboratory analyses of metals, SVOCs, PCBs, TPH-DRO, and TPH-GRO. Each of the samples collected from 1.5 ft bgs were also submitted for VOCs. Requested analyses are presented in Table 2.0-1.

Data are of decision-level quality and are presented in Tables 2.0-3, 2.0-4, 2.0-5, and 2.0-6. Sample locations are shown in Figures 2.12-2 and 2.12-3. Barium, copper, and nickel were detected above BVs in one sample; antimony, lead, and zinc were detected above BVs in three, seven, and eight samples, respectively; cadmium was detected above BV in eight samples. The detection limits for cadmium were greater than BVs in three samples and the detection limit for selenium was greater than BV in most samples. Acenaphthene and butanone(2-) were detected in one sample. Acenaphthylene, anthracene, isopropyltoluene(4-), and methylnaphthalene(2-) were detected in two samples. Benzoic acid, bis(2-ethylhexyl)phthalate, fluorene, and pyrene were detected in three samples. Acetone, fluoranthene, and phenanthrene were detected in four samples. Aroclor-1260 and aroclor-1254 were detected in 10 and 12 samples, respectively. TPH-GRO and TPH-DRO were detected in 10 and 16 samples, respectively.

### **2.13 Consolidated Unit 03-014(a)-99, Wastewater Treatment Plant**

Thirty SWMUs and AOCs were assigned to the components and outfalls of the former WWTP that operated at TA-03 from 1951 to 1992 until the Laboratory's SWSC Plant became active in 1992 (LANL 1993, 020947, p. 5-46). Consolidated Unit 03-014(a)-99 is comprised of 20 of the 30 WWTP SWMUs and AOCs. The former WWTP is adjacent to and east of the utilities control center (building 03-0223) on the southern rim (near the head) of Sandia Canyon. The WWTP served TA-03, TA-43, TA-59, and TA-60, the trailer park on West Jemez Road, and holding tank and septic system wastes throughout LANL. The WWTP also began treating sanitary wastes from TA-02 and TA-41 in 1990 and TA-21 in 1992. The WWTP had two parallel systems, the north plant (Plant 1) built in 1951, and the south plant (Plant 2) built in 1964. Each system consisted of entrance works, Imhoff tanks, dosing siphons, trickling filters, and final clarifying tanks. The plants were different in some physical dimensions but essentially functioned identically. The WWTP was designed with a 750,000 gal./d combined capacity (LANL 1993, 020947, p. 5-45). Although no longer operational, SWMUs and AOCs associated with Consolidated Unit 03-014(a)-99 are still present, locations of which are shown in Figure 2.13-1.

Upon entering each plant, raw sewage was first metered at a splitter box (structure 03-0677), where the flow was diverted to either Plant 1 or Plant 2. The water passed through a comminutor that shredded large solid material. Manually-cleaned bar racks were available for both plants when the comminutors were down for repair. Effluent flow was approximately 150,000 gal./d (LANL 1993, 020947, pp. 5-45-5-47). The splitter box, comminutor, and bar racks are collectively identified as SWMU 03-014(i) (LANL 1993, 020947, p. 5-46).

Water passed from the entrance works directly to the Imhoff tanks, structures 03-0049 and 03-0192 [SWMUs 03-014(a) and 03-014(e)], which functioned as settling/digestion tanks. Effluent water flowed from the Imhoff tanks to dosing siphons, structures 03-0048 and 03-0193 [SWMUs 03-014(b) and 03-014(f)], then to the trickling filters, structures 03-0047 and 03-0194 [SWMUs 03-014(c) and 03-014(g)], where organic waste was biologically digested through bacterial growth on rock media (LANL 1993, 020947, p. 5-47). Material sloughed from the trickling filter media settled in final clarifying tanks, structures 03-0046 and 03-0195 [SWMUs 03-014(d) and 03-014(h)]; the resulting sludge was then recirculated back to the head of the plant to allow solids to settle out in the Imhoff tanks (LANL 1993, 020947, p. 5-47).

Sludge collected in the Imhoff tanks was ultimately siphoned to four sludge drying beds, structures 03-0196, 03-0197, 03-0198, and 03-0199 [SWMUs 03-014(k), 03-014(l), 03-014(m), and 03-014(n)] located immediately north of the Imhoff tanks. Three of the four beds were used for sludge drying, while the fourth was used as a skimmer bed. Overflow sludge was directed to three additional sludge drying beds, structure 03-1871 [SWMU 03-014(o)], located north and downslope of the four sludge drying beds, and west of the chlorine contact chamber [SWMU 03-014(j)] (LANL 1993, 020947, p. 5-47). The four sludge drying beds, constructed in 1965, are referred to as the "upper" beds, while the other three sludge drying beds, constructed in 1987, are referred to as the "lower beds" (LANL 1993, 020947, p. 5-46; LANL 1997, 056660.4, p. 57).

Effluent from the sludge beds flowed from a subsurface drain system to a holding tank, structure 03-1901 [SWMU 03-014(u)]. The contents of the tank were recirculated by truck to the head of the plant for additional treatment. From the late 1950s to the late 1970s, dried sludge was added to the soil around the entrance works as a soil amendment (LANL 1993, 020947, p. 5-47).

Additional AOCs and SWMUs addressed as part of Consolidated Unit 03-014(a)-99 include AOCs 03-014(b2) and 03-014(c2), historical outfalls associated with the former WWTP; SWMU 03-014(p), a lift station associated with the former WWTP; and SWMU 03-056(d), a drum storage area located on the north side and adjacent to SWMU 03-014(c) trickling filter (structure 03-0047).

RFI activities were performed at the former WWTP in 1994 and 1997. In 1994, the area around the Imhoff tanks and the two historical outfalls were sampled. The Imhoff tanks were sampled because treated sludge was directly applied to the soil in the grassy areas around the tanks. The historical outfalls [AOC 03-014(b2) and AOC 03-014(c2)] were sampled because AOC 03-014(b2) was an active outfall for the WWTP and AOC 03-014(c2) was believed to be an out-of-service outfall trench, but was subsequently identified as a storm drain trench and overflow outlet pipe outfall (LANL 1996, 052930, p. 83). In 1997, the sludge drying beds [SWMUs 03-014(k), 03-014(l), 03-014(m), and 03-014(o)] were sampled. SWMU 03-014(n) was scheduled for sampling; however, oil was discovered in the bed, which was subsequently remediated in early September 1997 (LANL 1997, 056660.4, p. 60). RFI activities for SWMUs and AOCs in Consolidated Unit 03-014(a)-99 are discussed in more detail in sections 2.13.1 to 2.13.20.

### **2.13.1 SWMU 03-014(a), Structure Associated with Former WWTP**

SWMU 03-014(a) is the Imhoff tank (structure 03-0049) for Plant 1 of the former WWTP (Figure 2.13-1). Water and effluent passed from the entrance works directly to the Imhoff tank, which functioned as a settling/digestion tank (LANL 1993, 020947, p. 5-47).

A Phase I RFI was performed at SWMU 03-014(a) and SWMU 03-014(e) (section 2.13.7) in 1994. The area around these SWMUs, (structures 03-0049 and 03-0192) was sampled to determine whether

contaminants were released as a result of sludge application to the soil or from tank overflow (LANL 1996, 052930, p. 85).

Twelve soil samples (including two duplicates) were collected from five locations between and downgradient from the SWMUs. Two samples were collected from each location at depths of 0 to 1 ft bgs and 1 to 1.5 ft bgs. Samples from the 0- to 1-ft interval were submitted for laboratory analyses of metals, SVOCs, PCBs, pesticides, herbicides, gross alpha, beta, and gamma radiation, gamma spectroscopy, isotopic plutonium and uranium, and tritium. Samples from the 1- to 1.5-ft interval were submitted for laboratory analyses of cyanide, VOCs, gross alpha, beta, and gamma radiation, and tritium. (LANL 1996, 052930, p. 85). Requested analyses are presented in Table 2.0-2.

Data are of screening-level quality and are provided in Tables 2.0-11, 2.0-14, and 2.0-15. Sample locations are shown in Figures 2.13-2, 2.13-3, and 2.13-4. Cyanide was detected above BV in three samples. Cadmium, chromium, copper, lead, mercury, silver, and zinc were each detected above BVs in five samples. Aroclor-1260 was detected in four samples at concentrations less than 1 ppm. Americium-241, uranium-235, and uranium-238 were detected above BVs/FVs in one sample. Uranium-234 was detected above BV/FV in four samples. Plutonium-239/240 and plutonium-238 and were detected above BVs/FVs in four and five samples, respectively. VOCs, SVOCs, pesticides, and herbicides were not detected.

### **2.13.2 SWMU 03-014(b), Structure Associated with Former WWTP**

SWMU 03-014(b) is the dosing siphon (structure 03-0048) for Plant 1 of the former WWTP (Figure 2.13-1). Effluent from the Imhoff tank (structure 03-0049) flowed to the dosing siphon, which dispersed accumulated effluent water in an amount sufficient to run the trickling filter (structure 03-0047) rotary arms. The dosing siphon maintained the moisture throughout the trickling filter's rock media beds (LANL 1993, 020947, p. 5-47).

SWMU 03-014(b) was not specifically sampled as part of historical RFI activities, but soil samples collected as part of the 1994 RFI activities for SWMUs 03-014(a) and 03-014(e) were within the vicinity of SWMU 03-014(b). Samples for SWMU 03-014(a) are discussed in section 2.13.1. Requested analyses are presented in Table 2.0-2. Data are provided in Tables 2.0-11, 2.0-14, and 2.0-15. Sample locations are shown in Figures 2.13-2, 2.13-3, and 2.13-4.

### **2.13.3 AOC 03-014(b2), Outfall**

AOC 03-014(b2) is an inactive, formerly NPDES-permitted outfall (EPA SSS01S) for the former WWTP (Figure 2.13-1). The outfall received treated effluent from a flow-measurement weir north of the WWTP chlorination system [SWMU 03-014(j), see section 2.13.12] dosing and contact chamber via a 1.5-ft-diameter x 300-ft-long corrugated metal pipe. The outfall discharged to a rocky outcrop at the edge of Sandia Canyon (LANL 1993, 020947, p. 5-49). Outfall SSS01S was permitted for the discharge of wastewater and was removed from the NPDES permit in 1994 (LANL 1999, 064617, p. 2-7).

AOC 03-014(b2) received effluent from the former WWTP from 1989 until 1992, when the WWTP was decommissioned. AOC 03-014(b2) received treated effluent from the SWSC plant at TA-46 from 1992 until 1998 when the effluent was switched to the outfall at the power plant, building 03-0027. AOC 03-014(b2) was monitored three times per month for biochemical oxygen demand, total suspended solids (TSS), pH, fecal coliform, total chlorine, and radioactive constituents. From 1989 to 1993, radioactive constituents were reported over the detection limits (LANL 1993, 020947, p. 5-49).

A Phase I RFI was performed at AOC 03-014(b2) in 1994 to determine whether discharge to the outfall resulted in the release of any contaminants to the site. Twelve sediment samples were collected from four locations along the outfall channel and in the outfall flow path in areas where sediment accumulated. Samples were submitted for laboratory analyses of metals, VOCs, SVOCs, PCBs, pesticides, herbicides, gross alpha, beta, and gamma radiation, gamma spectroscopy, and tritium (LANL 1996, 052930, pp. 95–98). Requested analyses are presented in Table 2.0-2.

Data are of screening-level quality and are provided in Tables 2.0-11, 2.0-12, 2.0-13, and 2.0-15. Sample locations are shown in Figures 2.13-2, 2.13-3, and 2.13-4. Chromium was detected above BV in one sample. Lead and silver were detected above BVs in two samples. 4-isopropyltoluene, toluene, and bis(2-ethylhexyl)phthalate were detected in one sample. Cesium-137 was detected above BV/FV in one sample. Cobalt-60 was detected in one sample. Gross alpha and beta radiation were detected in four samples.

#### **2.13.4 SWMU 03-014(c), Structure Associated with Former WWTP**

SWMU 03-014(c) is the trickling filter (structure 03-0047) for Plant 1 of the former WWTP (Figure 2.13-1). The trickling filter received effluent from the Imhoff tank (structure 03-0049) and dosing siphon (structure 03-0048) where organic waste was digested through bacterial growth on filter media. The filter bed is 72 ft in diameter × 6 ft deep with a design capacity of 325,000-gal./d (LANL 1993, 020947, p. 5-47).

SWMU 03-014(c) has not been sampled.

#### **2.13.5 AOC 03-014(c2), Outfall**

AOC 03-014(c2) is an abandoned overflow outfall that received treated effluent from the former WWTP from 1975 until the WWTP chlorination system [SWMU 03-014(j), see section 2.13.12] was constructed in 1985 (LANL 1993, 020947, pp. 5-48, 5-49). The outfall was not permitted and was located on the north side of the chlorination system pump pit (structure 03-0166) (Figure 2.13-1). Effluent for this outfall discharged as sheet flow onto a steep slope containing an erosion channel from stormwater runoff. The channel eventually trends northeast into Sandia Canyon. Soil and sediment were occasionally cleaned out of the channel with a backhoe and piled onto the upslope channel bank (LANL 1996, 052930, p. 103). Following the construction of the chlorination system, the outfall was rerouted underground from the pump pit (structure 03-0166) to the chlorination dosing and contact chamber where the final effluent discharged freely into Sandia Canyon from a flow measurement weir north of the contact chamber. This outfall was abandoned in 1988 or 1989 when the WWTP effluent was routed to a new outfall, AOC 03-014(b2) (section 2.13.3) (LANL 1993, 020947, p. 5-49).

An evaluation of the former WWTP blueprints during 1994 RFI activities identified the location of the original treated effluent outfall approximately 20 to 30 ft west of the original AOC 03-014(c2) outfall (LANL 1996, 052930, p. 116).

A Phase I RFI was performed at AOC 03-014(c2) in 1994. The sampling strategy was designed to determine whether discharge from the pump pit (structure 03-0166) over flow pipe resulted in the release of contaminants. Twenty sediment samples (including one duplicate) were collected at nine locations from depths of 0 to 1 ft bgs and 1 to 1.5 ft bgs. Samples from the 0- to 1-ft interval were submitted for laboratory analyses of metals, SVOCs, PCBs, pesticides, herbicides, gross alpha, beta, and gamma radiation, gamma spectroscopy, isotopic plutonium and uranium, strontium-90, and tritium. Samples from the 1- to 1.5-ft. interval were submitted for laboratory analyses of cyanide, VOCs, gross alpha, beta, and

gamma radiation, and tritium (LANL 1996, 052930, p. 106). Requested analyses are presented in Table 2.0-2.

Data are of screening-level quality and are provided in Tables 2.0-11, 2.0-13, 2.0-14, and 2.0-15. Sample locations are shown in Figures 2.13-2, 2.13-3, and 2.13-4. Calcium and zinc were detected above BVs in one sample. Lead and nickel were detected above BVs in three samples. Cadmium, chromium, copper, cyanide, mercury, and silver were detected above BVs in six samples. Benzo(a)pyrene, benzo(b)fluoranthene, benzo(g,h,i)perylene, benzo(k)fluoranthene, chrysene, fluoranthene, indeno(1,2,3-cd)pyrene, phenanthrene, and pyrene were detected in one sample. Aroclor-1260 was detected in eight samples below 1 ppm. Plutonium 239/240 and plutonium-238 were detected above BVs/FVs in one and six samples, respectively. Europium-152 and tritium were detected in two samples. VOCs, pesticides, and herbicides were not detected.

### **2.13.6 SWMU 03-014(d), Structure Associated with Former WWTP**

SWMU 03-014(d) is the secondary clarifier (structure 03-0046) for Plant 1 of the former WWTP (Figure 2.13-1). Material sloughed from the trickling filter media settled in the secondary clarifying tank. The resulting sludge was subsequently recirculated back to the head of the plant (LANL 1993, 020947, p. 5-47).

SWMU 03-014(d) has not been sampled.

### **2.13.7 SWMU 03-014(e), Structure Associated with Former WWTP**

SWMU 03-014(e) is the Imhoff tank (structure 03-0192) for Plant 2 of the former WWTP (Figure 2.13-1). Water and effluent passed from the entrance works directly to the Imhoff tank, which functioned as a settling/digestion tank (LANL 1993, 020947, p. 5-47).

A Phase I RFI was performed at SWMUs 03-014(e) and 03-014(a) (section 2.13.1) in 1994. The area around the Imhoff tanks, structures 03-0192 and 03-0049, were sampled to determine whether contaminants were released to the environment as a result of sludge application to the soil or from tank overflow (LANL 1996, 052930, p. 85).

The 1994 RFI sampling activities and results relevant to SWMU 03-014(e) are discussed in section 2.13.1. Requested analyses are presented in Table 2.0-2. Data are provided in Tables 2.0-11, 2.0-14, and 2.0-15. Sample locations are shown in Figures 2.13-2, 2.13-3, and 2.13-4.

### **2.13.8 SWMU 03-014(f), Structure Associated with Former WWTP**

SWMU 03-014(f) is the dosing siphon (structure 03-0193) for Plant 2 of the former WWTP (Figure 2.13-1). Effluent from the Imhoff tank (structure 03-0192) flowed to the dosing siphon, which dispersed, accumulated effluent water in an amount sufficient to run the trickling filter (structure 03-0194) rotary arms. The dosing siphon maintained the moisture throughout the trickling filter's rock media beds (LANL 1993, 020947, p. 5-47).

SWMU 03-014(f) was not specifically sampled as part of historical RFI activities, but samples collected from SWMUs 03-014(a) (section 2.13.1) and 03-014(e) are within the vicinity of SWMU 03-014(f). Requested analyses for SWMU 03-014(a) are presented in Table 2.0-2. Data are provided in Tables 2.0-11, 2.0-14, and 2.0-15. Sample locations are shown in Figures 2.13-2, 2.13-3, and 2.13-4.

### **2.13.9 SWMU 03-014(g), Structure Associated with Former WWTP**

SWMU 03-014(g) is the trickling filter (structure 03-0047) for Plant 2 of the former WWTP (Figure 2.13-1). The trickling filter received effluent from the Imhoff tank (structure 03-0192) and dosing siphon (structure 03-0193) where organic waste was digested through bacterial growth on filter media. The filter bed is 72 ft in diameter x 6 ft deep with a design capacity of 325,000-gal./d (LANL 1993, 020947, p. 5-47).

SWMU 03-014(g) has not been sampled.

### **2.13.10 SWMU 03-014(h), Structure Associated with Former WWTP**

SWMU 03-014(h) is the secondary clarifier (structure 03-0195) for Plant 2 of the former WWTP (Figure 2.13-1). Material sloughed from the trickling filter media settled in the secondary clarifying tank where resulting sludge was subsequently recirculated back to the head of the plant (LANL 1993, 020947, p. 5-47).

SWMU 03-014(h) has not been sampled.

### **2.13.11 SWMU 03-014(i), Structure Associated with Former WWTP**

SWMU 03-014(i) consists of three structures including a splitter box (structure 03-0677) where raw sewage is first metered and split between Plant 1 or Plant 2, a comminutor where large objects and material are shredded, and a bar screen, these structures were built in 1951 (LANL 1993, 020947, pp. 5-45–5-47) (Figure 2.13-1).

SWMU 03-014(i) has not been sampled.

### **2.13.12 SWMU 03-014(j), Structure Associated with Former WWTP**

SWMU 03-014(j) is the chlorination system for the former WWTP and consists of two structures including a pump pit, structure 03-2209 (formerly identified as structure 03-0166) and a dosing and contact chamber. Both structures are located approximately 100 ft north of structure 03-0166 (Figure 2.13-1). The pump pit is a 9-ft- x 11-ft- x 10-ft-deep concrete pit that contains an effluent pump with a steel grating cover. The dosing and contact chamber is a 15-ft x 15-ft x 6-ft concrete pit with a concrete flow weir that is 225 ft<sup>2</sup> (LANL 1990, 007511, p. 3-014). When the chlorination system became active in 1985, SWMU 03-014(c2), the original WWTP outfall, was abandoned (LANL 1993, 020947, p. 5-49).

SWMU 03-014(j) has not been sampled.

### **2.13.13 SWMU 03-014(k), Structure Associated with Former WWTP**

SWMU 03-014(k), structure 03-0196, is one of four unlined sludge drying beds [SWMUs 03-014(k), 03-014(l), 03-014(m), and 03-014(n)] located north of the Imhoff tanks (Figure 2.13-1). These beds received sludge siphoned from the Imhoff tanks. Three of the four beds were used for sludge drying, while the fourth bed, SWMU 03-014(n), was used as a skimmer bed (LANL 1993, 020947, pp. 5-46, 5-47).

SWMU 03-014(k) is an unlined sludge drying bed excavated into the tuff. The sludge bed measures 35 ft x 10 ft (LANL 1990, 007511, p. 3-014). A 3-ft-high soil berm covered with 2 in. of asphalt separates the upper beds. The asphalt is broken and cracked in various places exposing the underlying soil/tuff (LANL 1997, 056660.4, p. 58).



A Phase I RFI was conducted in 1997 at SWMU 03-014(k). One sampling location was selected for SWMU 03-014(k) near the inlet pipes on the south side of the drying bed. Three samples were collected from three depths: one from filter (fill) material within the bed and two from successive 1-ft intervals (in tuff) beneath the bed. All samples were submitted for laboratory analyses of metals, SVOCs, PCBs, pesticides, herbicides, isotopic plutonium and uranium, strontium-90, and tritium. One tuff sample was also submitted for laboratory analysis of VOCs. Requested analyses are presented in Table 2.0-1.

Data are of decision-level quality and are presented in Table 2.0-3. Sample locations and detected results are shown in Figures 2.13-2, 2.13-3, and 2.13-4. Mercury and silver were each detected above BVs in the fill sample; copper was detected above BV in one tuff sample; chromium, nickel, and zinc were each detected above BVs in the two tuff samples. The detection limits for antimony and cadmium were greater than BVs in several samples. Organic chemicals and radionuclides were not detected.

#### **2.13.14 SWMU 03-014(l), Structure Associated with Former WWTP**

SWMU 03-014(l), structure 03-0197, is one of four unlined sludge drying beds [SWMUs 03-014(k), 03-014(l), 03-014(m), and 03-014(n)] located north of the Imhoff tanks (Figure 2.13-1) that received sludge siphoned from the Imhoff tanks (LANL 1993, 020947, pp. 5-46–5-47). SWMU 03-014(l) is an unlined sludge drying bed excavated into the tuff. The sludge bed measures 40 ft x 20 ft (LANL 1990, 007511, p. 3-014). A 3-ft-high soil berm covered with 2 in. of asphalt separates the upper beds. The asphalt is broken and cracked in various places exposing the underlying soil/tuff (LANL 1997, 056660.4, p. 58).

A Phase I RFI was conducted in 1997 at SWMU 03-014(l). One sampling location was selected from the middle of the drying bed SWMU 03-014(l). Three samples were collected from three depth intervals at the sample location: one from filter (fill) material within the bed and two from successive 1-ft intervals (in tuff) beneath the bed. All samples were submitted for laboratory analyses of metals, SVOCs, PCBs, pesticides, herbicides, isotopic plutonium and uranium, strontium-90, and tritium. One tuff sample was also submitted for laboratory analysis of VOCs. Requested analyses are presented in Table 2.0-1.

Data are of decision-level quality and are presented in Tables 2.0-3, 2.0-4, 2.0-6, and 2.0-7. Sample locations and detected results are shown in Figures 2.13-2, 2.13-3, and 2.13-4. Copper, mercury, and silver were each detected above BVs in the fill sample; copper and nickel were detected above BVs in one tuff sample; chromium was detected above BV in the two tuff samples. The detection limits for antimony and cadmium were greater than BVs. Toluene was detected in one tuff sample and arochlor-1254 was detected in the fill sample. Tritium was detected in one tuff sample. Pesticides herbicides, isotopic plutonium and uranium, and strontium-90 were not detected.

#### **2.13.15 SWMU 03-014(m), Structure Associated with Former WWTP**

SWMU 03-014(m), structure 03-0198, is one of four unlined sludge drying beds [SWMUs 03-014(k), 03-014(l), 03-014(m), and 03-014(n)] located north of the Imhoff tanks (Figure 2.13-1) (LANL 1993, 020947, pp. 5-46, 5-47). SWMU 03-014(m) is an unlined sludge drying excavated into the tuff. The sludge bed measures 40 ft x 20 ft (LANL 1990, 007511, p. 3-014). A 3-ft-high soil berm covered with 2 in. of asphalt separates the upper beds. The asphalt is broken and cracked in various places exposing the underlying soil/tuff (LANL 1997, 056660.4, p. 58).

A Phase I RFI was conducted in 1997 at SWMU 03-014(m). Ten samples were collected from three locations. At one location, one sample was collected from filter (fill) material within the bed and two samples were collected from successive 1-ft intervals (in tuff) beneath the bed. All samples from this

location were submitted for laboratory analyses of metals, SVOCs, PCBs, herbicides, pesticides, isotopic plutonium and uranium, strontium-90, and tritium. One tuff sample from this location was also submitted for laboratory analysis of VOCs. Filter material samples were collected from the second locations at three successive 0.5-ft intervals and submitted for laboratory analyses of SVOCs and PCBs. Filter material samples were collected from the final location at four successive 6-in. intervals and submitted for laboratory analyses of SVOCs and PCBs. Requested analyses are presented in Table 2.0-1.

Data are of decision-level quality and are presented in Tables 2.0-3, 2.0-5, and 2.0-6. Sample locations and detected results are shown in Figures 2.13-2, 2.13-3, and 2.13-4. Cadmium, chromium, copper, lead, mercury, silver, and zinc were detected above BVs in one fill sample; copper was detected above BV in one tuff sample; and chromium and nickel were detected above BVs in the two tuff samples. The detection limits for antimony were greater than BV in all samples. Acenaphthene, anthracene, benzo(a)anthracene, benzo(a)pyrene, benzo(b)fluoranthene, benzo(g,h,i)perylene, carbazole, chrysene, dibenz(a,h)anthracene, dibenzofuran, dichlorobenzene(1,4-), fluoranthene, fluorene, indeno(1,2,3-cd)pyrene, naphthalene, phenanthrene, pyrene, and aroclor-1254 were each detected in one fill sample. Aroclor-1260 was detected in three fill samples. Herbicides, pesticides, isotopic plutonium and uranium, strontium-90, and tritium were not detected.

#### **2.13.16 SWMU 03-014(n), Structure Associated with Former WWTP**

SWMU 03-014(n), structure 03-0199, is one of four unlined sludge drying beds [SWMUs 03-014(k), 03-014(l), 03-014(m), and 03-014(n)] located north of the Imhoff tanks (Figure 2.13-1) (LANL 1993, 020947, pp. 5-46, 5-47). SWMU 03-014(n) is unlined and was excavated into the tuff. The bed measures 40 ft x 20 ft (LANL 1990, 007511, p. 3-014). A 3-ft-high soil berm covered with 2 in. of asphalt separates the upper beds. The asphalt is broken and cracked in various places exposing the underlying soil/tuff (LANL 1997, 056660.4, p. 58).

During RFI sampling activities at SWMU 03-014(n), oil was discovered in the bed, which was subsequently remediated in September 1997 (LANL 1997, 056660.4, p. 60). Four samples were collected from two locations. At the first location, one sample was collected from the filter (fill) material within the bed and two samples were collected from successive 1-ft intervals (in tuff) beneath the bed; each of these samples were submitted for laboratory analyses of metals, VOCs, SVOCs, PCBs, herbicides, pesticides, TPH-DRO, isotopic plutonium and uranium, strontium-90, and tritium. At the second location, one sample was collected from the filter material and submitted for laboratory analyses of metals, VOCs, SVOCs, herbicides, pesticides, and TPH-DRO. Four additional soil, fill, and sludge samples were collected from a depth of 0 to 0.5 ft bgs following remediation activities and submitted for analysis of TPH-DRO. Requested analyses are presented in Table 2.0-1.

Data are of decision-level quality and are presented in Tables 2.0-3, 2.0-4, 2.0-5, 2.0-6, and 2.0-9. Sample locations and detected results are shown in Figures 2.13-2, 2.13-3, and 2.13-4. Antimony, barium, cadmium, calcium, chromium, lead, and nickel were detected above BVs in one fill sample. Copper, mercury, silver, and zinc were detected above BVs in two fill samples. Chromium, mercury, nickel, and silver were detected above BVs in one tuff sample. Copper was detected above BV in two tuff samples. The detection limits for antimony and selenium were greater than BVs in the tuff samples. Acetone was detected in one fill and one tuff sample; butylbenzylphthalate was detected in one fill sample; and bis(2-ethylhexyl)phthalate was detected in on two fill samples and one tuff sample. TPH-DRO was detected in three fill samples and two tuff samples; and TPH-lubrication range organics (LRO) was detected in one soil, one sludge, and two fill samples. No radionuclides were detected.

### 2.13.17 SWMU 03-014(o), Structure Associated with Former WWTP

SWMU 03-014(o) consists of three polypropylene-lined sludge drying beds (structure 03-1871) excavated into tuff. SWMU 03-014(o) is located north and downslope of the four upper sludge drying beds [SWMUs 03-014(k), 03-014(l), 03-014(m), and 03-014(n)] (Figure 2.13-1). The drying beds were constructed in 1987 and each bed measures 22 ft x 60 ft and accommodated approximately 8000 gal. of liquid sludge (LANL 1993, 020947, pp. 5-46, 5-47). Berms separating the beds are covered with asphalt and deterioration of the asphalt has not occurred (LANL 1997, 056660.4, p. 58).

A Phase I RFI was performed at SWMU 03-014(o) in 1997. One sample location was selected for each of the three beds at SWMU 03-014(o). Two locations were near the inlet pipes on the south side of the two outer beds and the third location was near the center of the middle bed. Samples were collected from three depth intervals at each location: one from filter (fill) material within the bed and two from successive 1-ft intervals (in tuff) beneath the bed. Nine samples were collected from the three locations and submitted for laboratory analyses of metals, SVOCs, PCBs, pesticides, herbicides, isotopic plutonium and uranium, strontium-90, and tritium. Three tuff samples collected from the deepest interval at each location were also submitted for laboratory analysis of VOCs (LANL 1997, 056660.4, pp. 59–62). Requested analyses are presented in Table 2.0-1.

Data are of decision-level quality and are presented in Tables 2.0-3, 2.0-4, 2.0-5, 2.0-6, and 2.0-7. Sample locations and detected results are shown in Figures 2.13-2, 2.13-3, and 2.13-4. Lead was detected above BV in one fill sample; cadmium, chromium, and zinc were detected above BVs in two fill samples; and copper, mercury, and silver were detected above BVs in three fill samples. Copper was detected above BV in one tuff sample; silver was detected above BV in two tuff samples; nickel was detected above BV in three tuff samples; chromium was detected above BV in five tuff samples. The detection limits for antimony and cadmium were greater than BVs in numerous samples. Acetone was detected in one tuff sample; acenaphthylene, anthracene, benzoic acid, carbazole, dibenz(a,h)anthracene, aroclor-1260, methyl chlorophenoxy acetic acid (MCPA), and 2-(2-methyl-4-chlorophenoxy)propionic acid (MCPA) were each detected in one fill sample; benzo(a)anthracene, benzo(a)pyrene, benzo(b)fluoranthene, benzo(g,h,i)perylene, benzo(k)fluoranthene, chrysene, fluoranthene, indeno(1,2,3-cd)pyrene, phenanthrene, and pyrene were detected in two fill samples. Uranium-234 was detected above BV/FV in one fill sample; strontium-90 was detected above BVs/FVs in one fill and one tuff sample; and plutonium-239/240 was detected above BVs/FVs in one tuff and two fill samples. Tritium was detected in two fill samples.

### 2.13.18 SWMU 03-014(p), Structure Associated with Former WWTP

SWMU 03-014(p) is a sewage lift station (structure 03-0265) associated with the former WWTP and the SWSC (Figure 2.13-1). The lift station was constructed in 1966 of reinforced concrete built over a 42-in. diameter cast iron basin. The structure measures 6 ft x 10 ft x 5 ft (LANL 1990, 007511, p. 3-014). SWMU 03-014(p) is active, currently associated with SWSC (LANL 2008, 099214).

SWMU 03-014(p) has not been sampled.

### 2.13.19 SWMU 03-014(u), Structure Associated with Former WWTP

SWMU 03-014(u) is a former 1500-gal. holding tank (structure 03-1901) that collected effluent from the former WWTP sludge beds [SWMUs 03-014(k), 03-014(l), 03-014(m), 03-014(n), and 03-014(o)]. SWMU 03-014(u) is located approximately 50 ft northeast of the chlorination system dosing and contact chamber (Figure 2.13-1). The holding tank was installed in 1988 (LANL 1990, 007511, p. 3-014).

Effluent from the sludge beds flowed through a subsurface drain system to the holding tank. The contents of the holding tank were recirculated by truck to the head of the plant for additional treatment (LANL 1993, 020947, p. 5-47). SWMU 03-014(u) was abandoned in 1992 following the decommissioning of the WWTP (LANL 2008, 099214).

SWMU 03-014(u) has not been sampled.

### **2.13.20 SWMU 03-056(d), Drum Storage**

SWMU 03-056(d) was a drum-storage area located on the northeast side of the Plant 1 trickling filter (SWMU 03-014(c) (Figure 2.13-1)). The area has been in use since about 1965 and consists of two bermed areas that measure 25 ft x 5 ft x 10 in. deep. The berms were constructed in 1989. Before 1989, only containers of lubricating oil were stored on pallets over bare soil. Active containers were mounted in racks with drip pans beneath. In 1993, lubricating oil and a partially full 55-gal. container of motor oil were stored at the site. Stains were noted within the bermed area but none were observed outside the berm. The asphalt floor of the bermed area was covered with oil-absorbing material (LANL 1995, 057590, p. 6-48).

SWMU 03-056(d) has not been sampled.

### **2.14 SWMU 03-014(r), Lift Station Associated with Former WWTP**

SWMU 03-014(r) is a sewage lift station (structure 03-0693) located south of building 03-0271 (Figure 2.7-1) associated with the former WWTP and the SWSC. The lift station was built in the 1970s and consisted of two 7½ horsepower pumps (LANL 1990, 007511, p. 3-014). SWMU 03-014(r) is active, currently associated with SWSC (LANL 2008, 099214).

SWMU 03-014(r) has not been sampled.

### **2.15 SWMU 03-014(s), Lift Station Associated with Former WWTP**

SWMU 03-014(s) is a sewage lift station (structure 03-1693) associated with the former WWTP and the SWSC. The lift station was built in the 1970s and is located south of the university house (building 03-0443) (Figure 2.10-2). The lift station contains two pumps and measures 5 ft in diameter x 11 ft deep (LANL 1990, 007511, p. 3-014). SWMU 03-014(s) is active, currently associated with SWSC (LANL 2008, 099214).

SWMU 03-014(s) has not been sampled.

### **2.16 AOC 03-014(v), Drain Associated with Former WWTP**

AOC 03-014(v) was a floor drain within a former garage (building 03-0036) (Figure 2.16-1). The drain was connected to the sanitary sewer line, which flowed to the WWTP. The drain was installed in 1953 (LANL 1990, 007511, p. 3-014).

Building 03-0036 was removed in 1999 in preparation for construction of building 03-2327, the Nicholas C. Metropolis Computing Center. During the task of demolishing the gas station, three AOCs [03-014(v), 03-027, and C-03-015] were removed. Soil surrounding AOC C-03-015 (a former underground storage tank) and below the building footprint was excavated. Approximately 60 yd<sup>3</sup> of contaminated soil were removed during the demolition project. Additional soil was subsequently excavated from the area to accommodate the foundation of building 03-2327. LANL personnel who witnessed construction activities

throughout the construction cycle of building 03-2327 indicated that the area was excavated to a depth of approximately 20 to 25 ft below the original grade (Madsen 2008, 099213).

Following the demolition of building 03-0036, and prior to the excavation of the foundation for building 03-2327, two fill samples were collected from one location associated with the floor drain at depths of 3 to 3.5 ft bgs and 4 to 4.5 ft bgs and submitted for laboratory analyses of metals, VOCs, PCBs, and TPH. Requested analyses are presented in Table 2.0-1.

Data are of decision-level quality and are presented in Tables 2.0-3 and 2.0-6. Sample locations and detected results are shown in Figures 2.16-2 and 2.16-3. Cobalt was detected slightly above its BV in one sample and TPH-DRO was detected in both samples.

### **2.17 AOC 03-014(y), Drain Associated with Former WWTP**

AOC 03-014(y) is a floor drain in the basement of the press building (building 03-0035) (Figure 2.4-1) that formerly discharged to the sanitary sewer. The drain was installed in 1954 and became inactive in 1981 (LANL 1993, 020947, p. 5-46). Building 03-0035 was constructed in 1953 and housed operations to fabricate enriched uranium-loaded graphite and carbide fuel elements. Enriched uranium (uranium-235) was processed in an area located in the northern portion of the first floor of the building. The rest of the building was used for the fabrication of cable assemblies in support of the weapons program, rack mechanics, the Meson Physics Facility, and service programs. Storage areas for radioactive materials, mostly uranium-235, were located throughout the building. There is no documentation regarding releases from the storage areas (LANL 1995, 057590, p. 6-28). As described in section 2.5, the basement of building 03-0035 held a PCB-containing transformer [AOC 03-003(g)] (LANL 1995, 064617, p. 2-19).

SWMU 03-014(y) has not been sampled.

### **2.18 Consolidated Unit 03-015-00**

Consolidated Unit 03-015-00 includes SWMU 03-015 and AOC 03-053 (Figure 2.3-1). SWMU 03-015 is a former NPDES-permitted outfall that received effluent from janitorial sinks and roof and floor drains from building 03-0141 until the lines to the outfall were decommissioned in early 1993 (LANL 1996, 052930, p. 121). AOC 03-053 is the basement of building 03-0141, which housed electrochemical and depleted uranium (DU) processing facilities. The floor drains in this area previously discharged to SWMU 03-015 and were rerouted to the TA-50 radioactive liquid waste (RLW) line before 1992 (LANL 1995, 057590, p. 5-24-1).

#### **2.18.1 SWMU 03-015, Outfall**

SWMU 03-015 is an outfall located between Eniwetok Road and the security fence northeast of the building 03-0141 (Figure 2.3-1) (LANL 1996, 052930, p. 121). This SWMU was formerly NPDES-permitted outfall EPA 04A140 and was removed from the permit in 1995 (LANL 1999, 064617, p. 2-7). The outfall historically received effluent from janitorial sinks as well as from floor and roof drains of building 03-0141. Building 03-0141 housed electrochemical and DU processing facilities from 1962 to 1990. Powder characterization, plasma flame spray processing, beryllium processing, and DU processing operations also took place. It is not known if releases to the environment occurred through the basement floor drains (AOC 03-053, section 2.18.2). The basement floor drains in building 03-0141 were rerouted to the TA-50 RLW line and the roof drains were rerouted to an existing storm sewer outfall in Mortandad Canyon in 1992. Lines draining to SWMU 03-015 were decommissioned in 1993 (LANL 1995, 057590, p. 5-24-1).

RFI activities were conducted at SWMU 03-015 in 1994. Four surface soil samples and one sediment sample were collected from five locations downgradient of the outfall in the associated drainage channel. The samples were each collected from a depth 0 to 1.5 ft bgs. Three soil samples were analyzed for metals, SVOCs, gross alpha, beta, and gamma radiation, gamma spectroscopy, isotopic plutonium and uranium, and tritium. The fourth soil sample was analyzed for metals, SVOCs, gross alpha, beta, and gamma radiation, and tritium. The sediment sample was analyzed for metals, gross alpha, beta, and gamma radiation, and tritium (LANL 1996, 052930, pp. 121–124). Requested analyses are presented in Tables 2.0-1 and 2.0-2.

Data are of both decision-level and screening-level quality and are presented in Tables 2.0-3, 2.0-11, 2.0-13, and 2.0-15. Sample locations and detected results are shown in Figures 2.3-2, 2.3-3, and 2.3-4. Barium and lead were detected above BVs in the sediment sample; lead, mercury, nickel, and silver were detected above BVs in one soil sample. The detection limit for selenium was greater than BV in one sample. Acenaphthene, anthracene, benzo(a)anthracene, benzo(a)pyrene, benzo(b)fluoranthene, benzo(g,h,i)perylene, benzo(k)fluoranthene, chrysene, dibenz(a,h)anthracene, dibenzofuran, fluorene, indeno(1,2,3-cd)pyrene, naphthalene, and phenanthrene were detected in one soil sample; fluoranthene and pyrene were detected in two soil samples. Uranium-234, uranium-235, and uranium-238 were detected above BV/FV in one soil sample. Europium-152 and gross alpha radiation were detected in one soil sample; gross beta radiation was detected in two soil samples.

### **2.18.2 AOC 03-053, Operational Facility**

AOC 03-053 (Figure 2.3-1) is designated as the basement area of building 03-0141. Floor drains in this area historically discharged to SWMU 03-015 (section 2.18.1), but were rerouted to the TA-50 RLW line before 1992. From 1962 to 1990, building 03-0141 housed electrochemical and DU processing facilities. Powder characterization, plasma flame spray processing, beryllium processing, and DU processing operations also took place (LANL 1995, 057590, p. 5-24-1).

Samples collected from SWMU 03-015 during the 1994 RFI were used to evaluate potential contamination at AOC 03-053 (LANL 1996, 052930, p. 121). Requested analyses are presented in Tables 2.0-1 and 2.0-2. Data are of both decision-level and screening-level quality and are presented in Tables 2.0-3, 2.0-11, 2.0-13, and 2.0-15. Sample locations and detected results are shown in Figures 2.3-2, 2.3-3, and 2.3-4.

### **2.19 AOC C-03-016, Oil Metal Bin**

AOC C-03-016 was an oil cleanout bin located within the former asphalt batch plant (Figure 2.1-1). The bin was approximately 4 ft wide x 16 ft long x 3 ft deep, had a hinged lid, and was buried with the top flush with the ground surface. The bin was installed in the mid-1970s and contained used asphalt emulsion oil, which was applied to roads before laying asphalt. Photos from the 1970s and 1980s show extensive stains in the immediate vicinity of the bin. In the late 1980s, the area surrounding the oil cleanout bin was excavated and new sand and gravel fill was put around the bin (LANL 1995, 057590, pp. 6-26, 6-27). This bin and the stained soil around the bin were removed in the late 1990s (LANL 2003, 080912, p. 4). The surface of the site was paved with asphalt for use as a parking lot in 2003 (LANL 2008, 099214).

Sampling was conducted at AOC C-03-016 in 2003 before the planned construction of a new parking structure; however, the parking structure was never built. Two shallow boreholes were drilled at AOC C-03-016. Two tuff samples were collected from one borehole at depths of 1 to 1.5 ft bgs and 16 to 16.5 ft bgs. Three tuff samples were collected from the second borehole at a depth of 4 to 5 ft bgs, 9.5 to

10 ft bgs, and 19.5 to 20 ft bgs. All samples were submitted for laboratory analyses of metals, VOCs, SVOCs, TPH-DRO, and TPH-GRO (Shaw Environmental Inc., 2003, 085517, pp.1, 7, 8, 10, 26, and 27). Requested analyses are presented in Table 2.0-1.

Data are of decision-level quality and are presented in Tables 2.0-3 and 2.0-4. Sampling locations and detected results are shown in Figures 2.1-2 and 2.1-3. Aluminum, arsenic, beryllium, calcium, chromium, iron, magnesium, manganese, nickel, and vanadium were each detected above BVs in one sample. Barium and copper were detected above BVs in two samples. Lead and selenium were detected above BVs in three and five samples, respectively. Bis(2-ethylhexyl)phthalate was detected in two samples. TPH-DRO and TPH-GRO were also detected in two samples. VOCs were not detected.

## 2.20 SWMU 03-021, Outfall

SWMU 03-021 is an outfall and associated daylight channel located approximately 60 ft north of the north exterior wall of the liquid and compressed gas facility (building 03-0170) (Figure 2.8-1). The outfall is a formerly NPDES-permitted outfall (EPA 04A094) and was removed from the permit 1997 (LANL 1999, 064617, p. 2-7). The outfall discharged caustic wash and rinse water from compressed-gas cylinder cleaning operations from 1964 to 1976. Cylinders were washed and stripped of paint using a caustic soda solution before they were repainted. Washing and stripping were done in a below floor-grade pit in the northern part of building 03-0170. A 2-in. diameter iron outfall pipe in an open ditch carried the caustic wash and rinse water from the pit. Discharge from the end of the outfall pipe was directed into a northeast-trending surface ditch that continued about 180 ft to the main north-south drainage ditch. Cylinders were screened for radioactive contamination and cleaned of any exterior oil, dirt, and grease before they were brought to building 03-0170, in the adjacent parking lot. Detailed information about the chemicals and processes associated with the SWMU are not available; however, paint used at that time period typically contained heavy metals. The SWMU was not used after 1976, when the compressed gas suppliers assumed cylinder washing and painting responsibilities. The SWMU's exact location is unknown because of regrading and other construction work completed in preparation for nearby building 03-1650, the compressed-gas cylinder storage shed. Construction of building 03-1650 resulted in placement of 5 to 10 ft of fill material over the former outfall area. Potential contaminants at this SWMU are organic chemicals and inorganic chemicals (LANL 1995, 057590, pp. 5-14-1–5-14-3).

RFI activities were performed at this SWMU in 1997. One soil sample was collected from one location within the area of the former NPDES outfall area at a depth of 0 to 1 ft bgs. Ten soil samples were collected at five locations along two transects positioned across the former location of the channel (LANL 1997, 056660.4, pp. 79–82). Four samples were collected from two of the locations at depths of 2 to 3 ft bgs and 3 to 4 ft bgs; four samples were collected from two other locations at depths of 3 to 4 ft bgs and 4 to 5 ft bgs; two samples were collected from the fifth location at depths of 2.75 ft to 3.75 ft and 3.75 ft to 4.25 ft. All samples were analyzed for metals and SVOCs; one sample was also analyzed for VOCs Sample. Requested analyses are presented in Table 2.0-1.

Data are of decision-level quality and are presented in Table 2.0-3 and 2.0-4. Sampling locations and detected results are shown in Figures 2.8-2 and 2.8-3. Cobalt, copper, iron, and nickel were detected above BVs in one sample. Chromium and thallium were detected above BVs in three samples; zinc was detected above BV in six samples; lead was detected above BV in nine samples. VOCs and SVOCs were not detected. The detection limit for antimony was greater than BV in two samples.

## 2.21 AOC 03-027, Lift Wells

AOC 03-027 is two former concrete-block-lined lift wells in the floor below the hydraulic lifts at the former garage, building 03-0036 (Figure 2.16-1). The lift wells collected wash water and residual oil from the floor of vehicle maintenance bays. Lift well contents were manually pumped to 55-gal. containers that were emptied into the station's oil/water separator before being discharged to the sanitary sewer. A bottle-washing operation was conducted in building 03-0036 from 1976 to 1980. New sample vial bottles were immersed in a 35% concentration nitric acid bath and triple-rinsed with deionized water. The rinse water was reused several times before being discharged to floor drains. The floor drains eventually discharged to storm drains (LANL 1995, 057590, pp. 6-54, 6-55).

Building 03-0036 was removed in 1999 in preparation for construction of building 03-2327, the Nicholas C. Metropolis Computing Center. During the task of demolishing the gas station, three AOCs [03-014(v), a floor drain, 03-027, and C-03-015, an underground storage tank] were removed as a presumptive remedy. Soil surrounding the underground storage tank and below the building footprint was excavated. Approximately 60 yd<sup>3</sup> of TPH-contaminated soil was removed during the demolition project. Additional soil was subsequently excavated from the area to accommodate the foundation of building 03-2327. LANL personnel who witnessed construction activities throughout the construction cycle of building 03-2327 indicated that the area was excavated to a depth of approximately 20 to 25 ft below the original grade (Madsen 2008, 099213).

Following the demolition of building 03-0036, and prior to the excavation of the foundation for building 03-2327, nine fill and tuff samples were collected from six locations (two fill samples from a depth of 7 to 7.5 ft bgs; four fill samples from a depth of 7.5 to 8 ft bgs; two tuff samples from a depth of 8.5 to 9 ft bgs; and one tuff sample from a depth of 9 to 9.5 ft bgs) associated with the former lift wells. The samples were submitted for laboratory analyses of metals, VOCs, PCBs, TPH-DRO, and TPH-GRO. Requested analyses are presented in Table 2.0-1.

Data are of decision-level quality and are presented in Tables 2.0-3, 2.0-4, and 2.0-6. Sampling locations and detected results are shown in Figures 2.16-2 and 2.16-3. Aluminum, beryllium, iron, magnesium, nickel, and sodium were each detected above BVs in one fill sample; zinc was detected above BV in two fill samples. The detection limit for antimony was above the BV in three samples. Butanone(2-), isopropylbenzene, and PCE were detected in one fill sample; butylbenzene(sec-), isopropyltoluene(4-), propylbenzene(1-) and xylene were detected in two fill samples; butylbenzene(n-), trimethylbenzene (1,3,5-), and TPH-GRO were detected in three fill samples; trimethylbenzene(1,2,4-) was detected in four fill samples; TPH-DRO was detected in five fill and three tuff samples. PCBs were not detected.

## 2.22 AOC 03-036(b), Former Aboveground Storage Tanks

AOC 03-036(b) was the former location of two 25- to 50-gal. aboveground storage tanks associated with the former asphalt batch plant that contained No. 2 diesel fuel. The tanks were located 100 ft west of the former asphalt batch plant (building 03-0073) and were surrounded by a 3-ft soil berm (Figure 2.1-1). Diesel fuel from the tanks was applied to dump truck beds before they were loaded with asphalt to prevent sticking. Residual fuel was collected in an aboveground metal catch basin on the east side of the berm. Before 1989, kerosene was stored in the tanks and used for the same purpose as the No. 2 diesel fuel. Periodic drips and splashes from the tanks stained the gravel (LANL 1995, 057590, p. 6-27). The tanks began operating in 1960 (LANL 2003, 080912, p. 3) and ceased in 2003. The two tanks, soil berm, and stained soil were removed during the D&D of the former asphalt batch plant in 2002.

Sampling activities were conducted at AOC 03-036(b) in 2003 before the planned construction of a new parking structure (Shaw Environmental Inc., 2003, 085517, p. 1). As part of the sampling activities, two



boreholes were drilled at the site. Three tuff samples were collected from one borehole at depths of 11 to 11.5 ft bgs, 14.5 to 15 ft bgs, and 19.5 to 20 ft bgs; one soil and two tuff samples were collected from the second borehole at depths of 10 to 11 ft bgs, 14.5 to 15 ft bgs, and 19.5 to 20 ft bgs. All samples were field screened for organic chemicals and submitted for laboratory analyses of metals, VOCs, SVOCs, TPH-DRO, and TPH-GRO. Field screening results did not indicate elevated concentrations of organic chemicals; however, a strong odor was noted during drilling and sampling activities (Shaw Environmental Inc., 2003, 085517, pp. 7, 8, 10, and 27). Requested analyses are presented in Table 2.0-1.

Data are of decision-level quality and are presented in Tables 2.0-3, 2.0-4, 2.0-5, and 2.0-6. Sampling locations and detected results are shown in Figures 2.1-2 and 2.1-3. Barium, beryllium, calcium, copper, and zinc were detected above BVs in one tuff sample. Lead and selenium were detected above BVs in three and five tuff samples, respectively. PCE and trimethylbenzene(1,2,4-) were detected in the single soil sample; acetone, and phenanthrene were detected in one tuff sample. Methylnaphthalene(2-) and TPH-DRO were detected in two tuff samples; TPH-GRO was detected in all six samples.

### **2.23 SWMU 03-037, Underground Storage Tanks**

SWMU 03-037 is a below-grade, 9000-gal. concrete tank located in the basement of the Sigma Building, building 03-0066 (Figure 2.4-1) (LANL 1993, 020947, p. 6-11). The tank began operation in 1960 (LANL 1990, 007511, p. 3-037). The tank is divided into two 4500-gal., unlined sections that are fitted with separate covers. One section was used to store spent cyanide solution, while the other section stored nitric, sulfuric, and hydrochloric acid solutions from electroplating operations. Both sections discharged to the industrial waste line. The waste line serving the cyanide tank collapsed and leaked in 1989. The leak was repaired and two core samples collected along the route of the line were analyzed for potential contaminants. In 1991, an interim action reconnaissance survey was performed. Samples screened for gross alpha, beta, and gamma radiation were below background. Samples were also analyzed for total uranium. Analytes were below screening action levels (LANL 1993, 020947, pp. 6-11, 6-12). Sample results were not available.

Additional samples have not been collected at this site.

### **2.24 AOC 03-038(c), Waste Lines**

AOC 03-038(c) is a 2-in. cast-iron drainline that carried rinse solution from a copper electroplating bath in building 03-0028, room 46, to the industrial waste line (Figure 2.24-1). The electroplating bath initially operated in the 1960s and was used to plate very small parts of printed circuit boards. By 1971, the operation was terminated and moved to building 03-0040. During the electroplating process, water was sprayed through rows of holes in a manifold on either side of the rinse sink. Minuscule amounts of plating and acid solutions were washed off the circuit boards and down the drain. Spent plating baths and the spent acid-strip solutions were transported to TA-50 for treatment. These solutions contained cyanide, chromic sulfuric acid, and hydrochloric acid. Amounts and concentrations of contaminants are not known. The electroplating bath met EPA point source category standards until it ceased operation in the early 1970s. The drainpipe was cut and capped inside the wall to make it inaccessible. According to the building manager, there have been no documented releases from the drainpipe (LANL 1995, 057590, pp. 6-72, 6-73).

Samples have not been collected at this site.

### **2.25 AOC 03-038(d), Waste Lines**

AOC 03-038(d) is an industrial waste line associated with the liquid waste treatment system. Between the 1950s and 1970s, the industrial drains from buildings 03-0032 and 03-0034 connected the two buildings to the old industrial waste line (Figure 2.25-1), was replaced with a new line in 1986. The new line connected building 03-0034 to the RLW facility in TA-50, while the drains in building 03-0032 were connected to the sanitary sewer. The industrial waste line was completely removed between 1981 and 1986 and no releases were found (LANL 1995, 057590, p. 6-45).

Samples have not been collected at this site.

### **2.26 AOC 03-043(a), Aboveground Storage Tank**

AOC 03-043(a) is a former 20,000-gal. underground storage tank, structure 03-0074, installed in 1948 at the former asphalt batch plant for the storage of asphalt emulsion (Figure 2.1-1). The tank was removed in 1963, disassembled, disposed of at the Los Alamos County landfill, and replaced by another storage tank, structure 03-0178 [AOC 03-043(f)]. The area was used for aggregate (sand and gravel) storage and feed mixing for the former asphalt batch plant. There is no record of releases to the environment associated with this AOC. Review of historical aerial photographs revealed no staining in the area of AOC 03-043(a) (LANL 1995, 057590, pp. 6-12, 6-18). The surface of the site was paved with asphalt for use as a parking lot in 2003. Before paving, sampling was conducted to characterize the potential impact of several SWMUs in the vicinity (LANL 2003, 080912, p. 1).

Samples were collected within the vicinity of AOC 03-043(a) as part of sampling activities for SWMUs 03-036(c) and 03-36(d). Results of these sampling activities are discussed in sections 2.7.5 and 2.7.6. Data for these activities are of decision-level quality and are presented in Tables 2.0-3, 2.0-4, and 2.0-6. Sample locations and detected results are shown Figures 2.1-3 and 2.1-4.

### **2.27 AOC 03-043(f), Aboveground Storage Tank**

AOC 03-043(f) is a duplicate of SWMU 03-036(c). Refer to section 2.7.5 for more information.

### **2.28 AOC 03-043(g), Aboveground Storage Tank**

AOC 03-043(g) is a duplicate of SWMU 03-036(d). Refer to section 2.7.6 for more information.

### **2.29 SWMU 03-045(a), Outfall**

SWMU 03-045(a) is an inactive outfall from the power plant (building 03-0022), which operated from the 1950s to 1993 (Figure 2.9-1). The primary outflow from the building to SWMU 03-045(a) was noncontact water from steam condensate. In addition, water from floor drains in the basement, first floor, mezzanine, heater floor, platform, and roof drains of the steam plant previously discharged to this outfall. In 1989, an oil/water separator was installed near the outfall to prevent oil from building operations reaching the outfall. In 1993, the separator was removed and the discharge pipe was capped (LANL 1995, 057590, p. 6-71). In mid-1991, a diesel fuel release of approximately 100 to 200 gal, occurred in association with two aboveground diesel fuel tanks at building 03-0022. As the system was being pressurized a faulty fitting on a fuel line to the diesel tanks caused the release (LANL 1995, 057590, p. 6-79). The release [SWMU 03-036(j)] occurred directly above SWMU 03-045(a) and flowed down the slope south of the steam plant into the drainage channel (LANL 1996, 055035, Attachment B, p. 1, Attachment D, p. 1). The spill was contained approximately 120 yd east of the leak. The drainage was blocked and an extensive

cleanup was performed to remove diesel fuel and diesel-contaminated soil (LANL 1995, 057590, p. 6-79). The remediation included the removal of soil and sediment in and around SWMU 03-045(a) and replacing it with clean fill (LANL 1995, 057590, p. 6-71).

Samples have not been collected at this site.

### **2.30 SWMU 03-045(e), Outfall**

SWMU 03-045(e) is an inactive outfall from a floor drain in an oil pump house (structure 03-0057) located at the TA-03 power plant, building 03-0022. One line from two diesel storage tanks (structure 03-0026 and former structure 03-0027) passed through the pump house to the steam plant (Figure 2.30-1). Valves in the pump house operated each line and allowed diesel to flow from one or both storage tanks. The drain was in place to prevent the pump house from filling with diesel fuel if a valve junction should rupture or leak. The drain and associated piping were plugged in 1989. A concrete apron is located at the point where the drainline discharged to Sandia Canyon (LANL 1995, 057590, pp. 6-7, 6-8).

Samples have not been collected at this site.

### **2.31 SWMU 03-045(f), Outfall**

SWMU 03-045(f) is an inactive outfall from a sink drain that served the utilities control center (building 03-0223) from 1950 to the late 1980s (Figure 2.9-1). The outfall was located on the north side of the building and emptied into Sandia Canyon. The sink was used as a quench tank for welding and cutting. The sink contained water to cool welded metal; therefore, no leaching of metal was performed at the site. There were no known releases of hazardous wastes or constituents from the sink and SWMU 03-045(f) (LANL 1995, 057590, p. 6-8). The sink was removed in the late 1980s. In 1993, the outfall was vegetated and had no distinct erosion based on visual inspection, the outfall did not discharge large quantities of water (LANL 1996, 055035, Appendix A, p. 1).

Samples have not been collected at this site.

### **2.32 SWMU 03-045(h), Drainlines and Outfalls**

SWMU 03-045(h) is located in TA-03 and is a former NPDES-permitted outfall (EPA 03A024) located at the north perimeter of the Sigma Complex security fence, approximately 50 ft north of a cooling tower (structure 03-0187) (Figure 2.4-1). The outfall was formerly permitted for the discharge of treated cooling water and stormwater. The outfall served a former cooling tower that was replaced by a smaller cooling tower (structure 03-0187) between 1997 and 1998. The outfall was plugged in 1997 during the removal of the previous cooling tower. The outfall has been removed from the NPDES permit and was not included on the 2007 authorization to discharge (EPA 2007, 099009). Constructed in 1953, structure 03-0187 was inactive from the late 1980s and was reactivated in early 1995. The area at the outfall pipe is about 3-ft wide x 6-ft long. Effluent drained into a corrugated metal storm drainpipe that trended northeast and east of structure 03-0187 where it combined with more stormwater runoff from surrounding areas. The drainage continued south and joined a channel north of Eniwetok Drive that ultimately drained into Sandia Canyon. Routine water treatment began in 1968. Treatment included biocides and fungicides to reduce algae growth and chelating agents, such as ethylenediaminetetraacetic acid to inhibit corrosion. SWMU 03-045(h) never had hazardous constituents or hazardous wastes in its effluent (LANL 1995, 057590, pp. 6-8, 6-9).

No sampling activities have been conducted at this SWMU; however, RFI sampling activities were conducted in 1997 at AOC 03-052(b), located northeast and downgradient from the corrugated metal storm drainpipe that SWMU 03-045(h) discharged to. RFI sampling activities for AOC 03-052(b) are discussed in section 2.37.

### **2.33 SWMU 03-046, Aboveground Wastewater Treatment Tank**

SWMU 03-046 is an aboveground wastewater neutralization tank located within TA-03 approximately 60 ft southeast of LANL's steam plant, building 03-0022. The Laboratory received a certificate of completion for this SWMU from NMED during the writing of this work plan (NMED 2008, 100116). Therefore, this SWMU was removed from active investigation under this work plan

### **2.34 AOC 03-047(d), Storage Area**

AOC 03-047(d) is the location of a former container storage area located on the east side of the power plant building 03-0022 (Figure 2.9-1). The storage area consisted of an asphalt pad where drums of new motor oil, used oil, and Stoddard solvent were stored from 1954 until 1989. A new location for an upgraded materials storage area was selected in 1989. The asphalt pad was subsequently removed in 1989 when the storage area was decommissioned (LANL 1995, 057590, p. 6-83). A VCA was implemented at the site in 1995 that involved the characterization, excavation, and removal of the top 6 in. of soil. The site was subsequently restored by backfilling and compacting the excavated area, followed by revegetation (LANL 2002, 073868.138, pp. iii, 5, and 6).

In January 2002, a 6-in. main potable water supply line to the power plant ruptured, releasing approximately 250,000 gal. of water. As a result, soil and fill along the entire eastern wall of building 03-0022, including soil and fill within and around the AOC boundary, was severely eroded. Soil that washed into the excavation was subsequently removed. A concrete support pad and an emergency generator and transformer were installed at the site during the spring and summer of 2002 (LANL 2002, 073868.138, p. iii).

As part of the 1995 VCA, three soil samples were collected from the top 6 in. of the excavated area and analyzed for metals, VOCs, SVOCs, PCBs, and pesticides. Requested analyses are presented in Table 2.0-2.

Data are of screening-level quality and are presented in Tables 2.0-11, 2.0-12, 2.0-13, and 2.0-14. Sample locations are shown in Figures 2.9-2 and 2.9-3. Cadmium and lead were detected above BVs in one sample; copper, mercury, and zinc were detected above BVs in two samples. Chrysene and indeno(1,2,3-cd)pyrene were detected in one sample; acetone and methylene chloride were detected in three samples; benzo(a)pyrene, benzo(b)fluoranthene, fluoranthene, phenanthrene, pyrene, and aroclor-1260 were detected in two samples.

### **2.35 AOC 03-047(g), Drum Storage**

AOC 03-047(g) is a product drum storage area where drums of acetone, vacuum pump oil, and ethylene glycol were stored under a canopy on the north side of building 03-0141 (Figure 2.3-1). During a 1989 site reconnaissance survey, staining was found on the cement. During a site visit in September 1993, the building manager stated that the area had been used approximately 20 yr for product oil and occasionally solvent storage. Only one drum of mineral oil was stored on the pad during the 1993 site visit. The mineral oil, used for vacuum pumps, is stored in drums with a hand pump inserted into the drum bung hole. As oil is dispensed, spills have been known to occur. The stains are evident on the concrete around

the barrel; however, the staining does not continue off the concrete indicating that the small oil spills have not migrated off the concrete pad. The stains present on the concrete pad are believed to be from dispensing mineral oil (LANL 1995, 057590, p. 6-46).

Samples have not been collected at this site.

### **2.36 AOC 03-051(c), Soil Contamination—Vacuum Pump Leak**

AOC 03-051(c) consists of two stained asphalt areas attributed to vacuum pump oil operational leaks or exhaust emissions (LANL 1995, 057590, p. 6-84). One area, measuring approximately 6 ft x 6 ft, was located on the east side of building 03-0141 (Figure 2.3-1). The second area, located at the northeast corner of the building, measured approximately 10 ft x 15 ft (LANL 1996, 053780, p. 15).

A VCA was performed at this AOC in August 1995. The stained areas of asphalt were removed and soil was excavated until unstained soil was reached. Soil samples were field-screened for radioactivity, PAH, TPH, x-ray fluorescence (XRF) metals, and VOCs. The first set of XRF samples showed elevated thallium levels. After receipt of results from cleanup verification samples, cleanup activities resumed to remove an additional 2 to 3 in. of thallium-contaminated soil. Two samples collected after soil excavation was completed showed no elevated thallium levels. The excavated areas were backfilled with soil and gravel and compacted (LANL 1996, 053780, pp. 14–16). Before backfilling, four soil samples were collected from four locations (two samples at each excavation) at depths of 0 to 0.5 ft bgs to verify site cleanup. Samples were analyzed for metals, SVOCs, and pesticides. Requested analyses are presented in Table 2.0-2.

Data are of screening-level quality and are presented in Table 2.0-11. Sampling locations are shown in Figures 2.3-2 and 2.3-3. Lead and zinc were both detected above BVs in one sample. Cadmium was detected above BV in four samples. SVOCs and pesticides were not detected

### **2.37 AOC 03-052(b), Storm Drainage**

AOC 03-052(b) is five storm drain access areas located about 20 ft north and west of the Sigma Building, building 03-0066 (Figure 2.4-1). Surface runoff flows across the surrounding area into the system at two locations: the system on the northeast side of building 03-0066 discharges to a storm drain outlet just north of Eniwetok Drive and a single storm drain located on the northwest side of building 03-0066 discharges to a low-lying grassy area (LANL 1995, 057590, p. 5-15-1). This AOC was investigated with AOC 03-056(k) (see section 2.42) a container storage area and loading dock at building 03-0066. Contaminants associated with AOC 03-056(k) may have been released into the AOC 03-052(b) storm drain system. Potential contaminants were inorganic chemicals and DU (LANL 1995, 057590, pp. 5-15-3, 5-15-4).

RFI activities were performed at this AOC in 1997. Two soil and/or fill samples were collected from each of five locations and one from a fifth location corresponding to the storm drain access areas. Samples were collected from a depth of 0 to 1 ft bgs and from a depth ranging from 1 to 5 ft bgs. Two of the samples were collected at one collocated location. The samples were field-screened for radioactivity and organic chemicals. Screening did not detect organic chemicals and radioactivity was at or below background (LANL 1997, 056660.4, p. iv.) All samples were analyzed for metals and isotopic uranium. One sample was also analyzed for VOCs. Requested analyses are presented in Table 2.0-1.

Data are of decision-level quality and are presented in Table 2.0-3. Sample locations and detected results are shown in Figures 2.4-2 and 2.4-3. Cadmium, manganese, and nickel were detected above BVs in one sample; cobalt, lead, and zinc were detected above BVs in two samples. Detection limits for antimony,

cadmium, and silver were greater than BVs for most samples. Organic chemicals and radionuclides were not detected.

### **2.38 SWMU 03-054(c), Outfall**

SWMU 03-054(c) is a former cooling tower (structure 03-0156), pump house (structure 03-0163), and outfall that discharged to the storm sewer and ultimately to former NPDES-permitted outfall EPA 03A023 [SWMU03-052(f), see section 2.10.2]. The former cooling tower and pump house were located southwest of the former Sherwood Complex (building 03-0105) and northwest of the former Syllac Building (building 03-0287) (Figure 2.38-1). Structures 03-0156 and 03-0163 were used to cool an electromagnet formerly located in the Sherwood Complex. The outfall discharged to the storm sewer that was formerly located 25 ft east of the cooling tower.

LANL's former Environmental, Safety, and Health group collected two composite surface soil samples directly north of the cooling tower in 1992 and two samples from the cooling tower in 1993 to characterize the structure and surrounding soil before D&D of the structures. Samples were screened for gross alpha, beta, and gamma radiation and submitted for laboratory analysis of total chromium. Chromium was not detected above the EPA action level (LANL 1995, 057590, pp. 6-71, 6-72). There is no available data for these samples. The cooling tower and pump house were dismantled and removed leaving only the concrete pad of the former pump house at a depth of 10 ft bgs (LANL 2001, 071214).

The Syllac Building (building 03-0287) underwent D&D activities from 2003 to 2004 and the Sherwood Complex (building 03-0105) underwent D&D activities in 2001 (LANL 2002, 073868.4, Appendix B-7, p. 1). As part of the D&D of the Sherwood Complex in 2001, the former cooling tower location, including the subsurface concrete pad, the storm drain and all associated piping and pavement, were removed (LANL 2001, 071214). Seven confirmation soil and fill samples were collected from seven locations at the bottom of the SWMU 03-054(c) excavation ranging from depths of 2 to 8.5 ft bgs. One grab sample was also collected from drain line excavated material and analyzed for metals and hexavalent chromium (Tucker 2001, 100702, pp. 1-3, 13-22). Requested analyses are presented in Table 2.0-1.

Data are of decision-level quality and are presented in Table 2.0-3. Sample locations and detected results are shown in Figure 2.38-2. Calcium, lead, and zinc were each detected above BVs in one sample. The detection limit for antimony was greater than the BV in all samples. Hexavalent chromium was not detected.

In 2004, six fill samples were collected from three locations at depths of 0 to 0.5 ft bgs and 0 to 2 ft bgs. Requested analyses are presented in Table 2.0-1.

Data are of decision-level quality, but are not presented since no metals were detected above BVs. Sample locations are shown in Figure 2.38-2.

### **2.39 SWMU 03-056(a), Storage Area**

SWMU 03-056(a) was a used-oil accumulation facility built in 1986. The 12-ft × 45-ft structure is located approximately 15 ft north of building 03-0271 (Figure 2.7-1). The storage area has a concrete floor that slopes toward a sump and is surrounded by a concrete berm. The area is roofed but the sides are open. No spills from the bermed area to the environment have occurred (LANL 1993, 020947, p. 6-36).

In 2001, samples were collected to confirm the nature and extent of any residual TPH or lead contamination at the site. Four asphalt samples were collected adjacent to each side of the concrete storage pad, approximately 1 ft away from the edge of the pad. Soil samples were also collected directly

beneath the asphalt (at depths of 0.5 to 1.0 ft bgs) at each of the four asphalt sample locations for a total of eight samples (LANL 2001, 070937, p. 3). All samples were submitted for laboratory analysis of metals; the soil samples were also submitted for analysis of TPH-DRO. Requested analyses are presented in Table 2.0-1.

Data are of decision-level quality and are presented in Tables 2.0-3 and 2.0-8. Sample locations and detected results are shown in Figures 2.7-2 and 2.7-3. Calcium was detected above BV in all four soil samples; silver and zinc were detected above BVs in one soil sample. TPH was not detected in the soil samples. Antimony, cadmium, and silver were detected in one asphalt sample; with the exception of selenium and thallium (which were not detected), all remaining metals were detected in all asphalt samples.

#### **2.40 SWMU 03-056(c), Transformer Storage Area—PCB Site**

SWMU 03-056(c) is an inactive outdoor storage area located on the north side of a utilities shop, building 03-0223. The SWMU extends along the length of building 03-0223 to the south and is bounded by a security fence to the north (Figure 2.9-1) (Faulk 1995, 055741, p. 13). The outdoor storage area was used for storing electrical equipment, capacitors, and transformers with PCB-containing dielectric fluids. Waste solvents used for cleaning electrical equipment were reportedly stored there in unmarked drums (LANL 1993, 020947, pp. 5-100, 5-101). The types of solvents used at the site from 1967 to approximately 1981 are unknown. Viking R30® (1,1,1-trichloroethane) (Faulk 1995, 055741, p. 13) was used from 1981 to 1990. Beginning in 1990 and continuing to 1992, a nonhazardous citrus-based solvent was used as a substitute for solvent-based cleaners. It is unknown whether the solvents used at the site were stored onsite. In addition, Transclene®, which contains PCE, may have been stored at the site because it was used by an electrical equipment maintenance subcontractor to retrofill transformers in the field. It is believed that the maintenance crew disposed of all these waste materials at an approved waste-disposal facility. In 1991, the site's facility manager placed approximately 1 to 2 ft of clean fill on the area occupying the former storage area to elevate it and to reroute run-on drainage away from this site. In 1992, the storage area was decommissioned (LANL 2001, 071259, p. 6).

Previous investigation and cleanup activities were performed at SWMU 03-056(c) in 1994, 1995, and 1999. In 1994, a total of 21 soil samples, 19 confirmatory samples, and 3 sample splits were collected from 18 locations (LANL 1994, 040397, pp. 1-49) at depths ranging from 0 to 3 ft below grade. Samples were analyzed for metals, SVOCs, PCB/pesticides, and VOCs. Samples were also screened for gross alpha and beta, gross gamma, and tritium (LANL 2001, 071259, p. 10).

In 1995, the site was further characterized as part of an expedited cleanup to identify the lateral extent of soil containing residual PCBs. Ten samples were collected from the western slope area to better define the lateral extent of the PCB contamination. A 45-ft-diameter area was initially mapped to represent the area of suspected contamination. A 10-ft × 10-ft grid was placed over the area of suspected contamination and soil samples were collected within grid nodes. The results of the grid sampling effort were used to target areas for soil excavation. During soil excavation activities, the lateral extent of soil contamination was further defined to encompass an area approximately 130 ft long × 70 ft wide. The western slope excavation area was expanded in a northerly direction along the mesa edge. Additional site characterization samples were collected in the northern slope area of the site. PCB-contaminated soil was excavated from an area approximately 60 ft long × 70 ft wide. Also, three soil samples were collected from the ephemeral slope drainages, down slope from the north and west slope areas (LANL 2001, 071259, p. 10).

A VCA plan was developed in 1999 for removing PCB-contaminated soil from the western and northern slope areas and the ephemeral slope drainage areas. Because of the site's proximity to a watercourse, the PCB cleanup targets were less than 1 ppm of PCBs in soil. The VCA plan was approved by NMED in 2000 (LANL 2001, 071259, p. 2).

The remedial activities at the site, as specified in the VCA plan, began in August 2000. SWMU 03-056(c) was characterized using field-screening techniques, PCB EnSys Soil Test, to determine the extent of PCB contamination (LANL 2001, 071259, p. 12). After site characterization, the contaminated soil and unconsolidated tuff were excavated. Approximately 2400 yd<sup>3</sup> of contaminated soil was excavated from the SWMU. During the excavation activities, field screening was used to provide immediate confirmation that all PCB-contaminated soil and unconsolidated tuff in the excavated area had been removed to a cleanup level of less than 1 ppm. Excavation field-screening activities results determined that contamination extended beyond the original SWMU boundary (LANL 2001, 071259, pp. 17-20).

Following excavation activities, 89 confirmation samples were collected from 79 locations. All samples were submitted for laboratory analysis of PCBs. Twenty-one of these samples were also analyzed for metals and VOCs (LANL 2001, 071259, p. 17). Thirteen inorganic chemicals were detected above BVs. Seven organic chemicals were detected. Aroclor-1260 was detected at the highest frequency. In March 2001, the areas with elevated PCB detections were excavated. In April 2001, additional confirmation sampling was conducted. One sample was collected from each excavated location. All samples were analyzed for PCBs, and three samples were also analyzed for VOCs and metals (LANL 2001, 071259, p. 17). Confirmation sample results indicated the site met the EPA-mandated cleanup criterion for less than 1 ppm (LANL 2001, 071259, pp. iii, iv, and 58). Results of final VCA activities are discussed in the VCA report (LANL 2001, 071259).

The VCA report for SWMU 03-056(c) was approved by EPA in November 2001 (EPA 2001, 072810, p.1) and by NMED in September 2002 (NMED 2002, 073363).

#### **2.41 AOC 03-056(h), Container Storage Area**

AOC 3-056(h) is listed in the 1990 SWMU Report (LANL 1990, 007511) as a container storage area near former buildings 03-0105 (the Sherwood Complex) and 03-0287 (the Syllac Building) (Figure 2.38-1) (LANL 1990, 007511, p. 3-056.2). Several areas of potential contamination were identified with this AOC. Areas near former building 03-0287 were addressed under SWMU 03-003(c) and AOC 03-003(o) (sections 2.2 and 2.6, respectively). Building 03-0105 underwent D&D activities in 2001 (LANL 2002, 073868.4, Appendix B-7 p. 1). The site is currently occupied by the NSSB (building 03-1400).

Former building 03-0105 housed magnetic fusion energy experiments beginning in the mid-1950s. Before a 1992 cleanout, a number of swipe samples were collected on various surfaces throughout the building. Results revealed no PCB contamination. During the salvage cleanout of former building 03-0105, some non-PCB oil was spilled north of the building. Swipe samples collected in this area at the time of the spill revealed no PCB contamination. A cable shed, structure 03-0252, located west of building 03-0105 was also removed during the 1992 decommissioning. Swipe samples collected from oil stains on the plywood floor and from underneath the floor yielded no PCBs (LANL 1995, 057590, pp. 6-64, 6-67, and 6-68).

Another area of potential contamination was on the southeast side of former building 03-0105. During a site reconnaissance visit in 1989, two transformers were observed inside a fenced area at this location. No oil stains were present on the asphalt around the transformers (LANL 1995, 057590, pp. 6-67, 6-68).

On the west side of former building 03-0105, PCB spills were reported in September 1991 and March 1993. In the 1991 leak, soil beneath a leaking spigot was excavated until unstained soil was



reached. In the 1993 incident, an oil stain under a transformer was double washed/double rinsed. On a site visit in 1994, only one stain was noted in the vicinity. Swipe samples at the location revealed no PCB concentrations above  $2.8 \mu\text{g}/100 \text{ cm}^2$  (LANL 1995, 057590, pp. 6-67, 6-68).

The PCB-containing transformers and capacitors described above have all been removed or replaced with non-PCB equipment in accordance with the DOE/Albuquerque Operations Office Environmental Restoration and Waste Management Five-Year Plan (LANL 1995, 057590). Under this plan, any evidence of a release was sampled and cleaned up in accordance with TSCA requirements (40 CFR 761). The documented releases of PCBs were remediated in accordance with the TSCA requirements found in 40 CFR 761 (LANL 1995, 057590, p. 6–67). In addition, approximately 10 ft of clean fill was placed over the entire site to accommodate the construction of the NSSB (LANL 2008, 099214).

#### **2.42 AOC 03-056(k), Container Storage Area**

AOC 03-056(k) is a container storage area on the north side of a loading dock at the northwest corner of the Sigma Building, building 03-0066 (Figure 2.4-1). Waste oil, solvents, and radioactively-contaminated graphite were kept in the storage area (LANL 1990, 007511, p. 3-056). Four documented radiological material releases to the environment may have contributed to contamination at this AOC. Potential contaminants were inorganic chemicals and DU (LANL 1995, 057590, pp. 5-15-1, 5-15-3, and 5-15-4).

RFI activities were performed at this AOC in 1997. Ten soil and fill samples were collected from six locations at depths ranging from 0 to 4.5 ft bgs. Four asphalt samples were collected at four of the locations. Samples were field-screened for organic chemicals and radioactivity. Screening did not detect organic chemicals and radioactivity was at or below BVs (LANL 1997, 056660.4, pp. 101, 104). All samples were submitted for laboratory analysis of isotopic uranium; all soil and fill samples were submitted for laboratory analysis of metals. One asphalt sample and one fill sample were analyzed for gross alpha and beta radiation, and gamma spectroscopy. One fill sample was also analyzed for VOCs. Requested analyses are presented in Table 2.0-1.

Data are of decision-level quality and are presented in Tables 2.0-3, 2.0-4, 2.0-7, and 2.0-10. Sampling locations and detected results are shown in Figures 2.4-2, 2.4-3, and 2.4-4. Lead was detected above BV in one sample and copper was detected above BV in two fill samples. Detection limits for antimony, cadmium, and silver were greater than BVs in the ten soil and fill samples. Carbon disulfide and 2-butanone were detected in one sample. Gross alpha and beta radiation were detected in one fill sample; uranium-235 was detected above BV in one fill sample and uranium-238 was detected above BV in three fill samples. Uranium-234, uranium-235, and uranium-238 were detected in all asphalt samples; gross alpha and beta radiation, cesium-134, and cesium-137 were detected in one asphalt sample.

#### **2.43 SWMU 03-056(l), Storage Area**

SWMU 03-056(l) (Figure 2.3-1) is an outdoor storage facility adjacent to the east side of building 03-0141. Containers of disposable clothing contaminated with beryllium powder are staged there before disposal. Carboys used to store beryllium powder in water were also stored in this area. The carboys were usually in a tray that served as secondary containment. There is no history of releases from the drums or carboys to the environment (LANL 1995, 057590, p. 6-11).

Samples were collected from this SWMU before the planned construction of a new beryllium storage vault. The collection of three asphalt samples and three surface soil samples from beneath the asphalt within the former staging area on the east side of building 03-0141 were proposed in the 2003 sample notification. The samples were to be submitted for total beryllium analysis (LANL 2003, 075992). In 2003,

three asphalt samples were collected from three locations and three soil samples were collected from beneath the asphalt samples at depths of approximately 0.5 to 2.25 ft bgs (two samples) and 0.6 to 1.6 ft bgs (one sample). One soil sample was collected from a fourth location at a depth of 0 to 1.6 ft bgs. All samples were analyzed for metals rather than total beryllium. The requested analysis is presented in Table 2.0-1.

Data are of decision-level quality and are presented in Tables 2.0-3 and 2.0-8. Sample locations and detected results are shown in Figure 2.3-2. Manganese and zinc were detected above BVs in one soil sample. Calcium and copper were detected above BVs in two soil samples. Thallium and beryllium were detected in one and two asphalt samples, respectively. With the exception of antimony and silver (which were not detected in any asphalt samples), all remaining metals were detected in all three asphalt samples.

## **2.44 Consolidated Unit 03-059-00**

Consolidated Unit 03-059-00 consists of AOC 03-003(n) and SWMU 03-059. This consolidated unit is a former storage area adjacent to building 03-0271 (Figure 2.7-1). Initially, SWMU 03-059 was identified as the former salvage yard and AOC 03-003(n) was the location of a one-time PCB spill in that salvage yard. SWMU 03-059 was used to store transformers, electrical equipment, batteries, and scrap metal pending sale or reuse. The spill area [AOC 03-003(n)] is identified as being approximately 20 ft south of the northwest corner of building 03-0271.

### **2.44.1 AOC 03-003(n), One-Time Spill—PCB Site**

AOC 03-003(n) was the reported location of a one-time PCB spill in the salvage yard (SWMU 03-059) located adjacent to the south side of building 03-0271. The perimeter is fenced, except for the part that abuts building 03-0271 (Figure 2.7-1). With the exception of two small portions of the area, most of the area is asphalt-paved. The salvage yard was used to store transformers, electrical equipment, batteries, and scrap metal pending sale or reuse. Small and weather-sensitive items were stored inside building 03-0271. All other items were placed in and around the former salvage yard. The spill area identified as AOC 03-003(n) is approximately 20 ft south of the northwest corner of building 03-0271. At that location, a transformer ruptured in 1977 and leaked an estimated 10 gal. of PCB-contaminated oil into the soil. It is unclear whether the spill was cleaned up or if confirmation sampling was conducted. The drainage pattern west of building 03-0271 was altered in 1991 when the parking lot was regraded and base course was applied. The entire area received additional base course at least once since 1991. The salvage operation and materials were moved to the building 60-0002 in 1993. The former salvage yard area is used as a parking lot and storage area for empty containers (LANL 1995, 057590, pp. 5-19-1, 5-19-3).

In 1994, two soil samples were collected from two locations within the area of the PCB spill at depths of 0 to 0.8 ft bgs. The samples were analyzed for PCBs, gross alpha, beta, and gamma radiation, and tritium. Requested analyses are presented in Table 2.0-2 (as part of Consolidated Unit 03-059-00 samples). Sample locations are shown on Figures 2.7-3 and 2.7-4. Data were of screening-level quality, but no analytes were detected.

### **2.44.2 SWMU 03-059, Storage Area—PCB Site**

SWMU 03-059 was identified as the former salvage yard. The former salvage yard consisted of two areas. The first area is about 250 ft × 115 ft and is located adjacent to the south side of building 03-0271 (Figure 2.7-1). The perimeter is fenced, except for the part that abuts building 03-0271. With the exception of two small portions of the area, most of the area is asphalt-paved. The second area is about

100 ft x 60 ft, is asphalt-paved, and fenced. Paving over both areas occurred incrementally over a period of years. Equipment also was stored outside the fenced areas.

In 1994, 10 asphalt samples were collected from 10 locations within the salvage yard at depths of 0 to 0.5 ft bgs. Samples were analyzed for PCBs, gross alpha, beta, and gamma radiation, and tritium. Requested analyses are presented in Table 2.0-2 (as part of Consolidated Unit 03-059-00 samples). Data are of screening-level quality and are presented in Table 2.0-15. Sample locations are shown on Figures 2.7-3 and 2.7-4. Tritium was detected in three samples. PCBs were not detected.

#### **2.45 AOC C-03-022, Kerosene Tanker Trailer**

AOC C-03-022 is the former storage location for a tanker trailer used to store and distribute kerosene for the former asphalt batch plant operations. The tanker trailer was located in a bermed materials storage area on a hill directly north of the asphalt batch plant (Figure 2.1-1). The tanker was in service for approximately 15 yrs and supplied kerosene through a gravity feed line that had a valve near the oil distributor tank (AOC C-03-016) located approximately 12 ft south (directly below the hill) of the tanker. The tanker and gravity feed line were removed in 1989 and kerosene was replaced with diesel fuel No. 2. There is no record of release or source of contamination associated with this storage tanker. However, the area downslope where the kerosene was dispensed is adjacent to another site, AOC C-03-016, an oil distributor cleanout bin (LANL 1995, 057590, p. 6-17).

AOC C-03-022 has not been sampled.

### **3.0 SITES UNDER INVESTIGATION IN TA-60**

TA-60, also known as Sigma Site, was created from the eastern portion of TA-03 and lies Sigma Mesa between Sandia Canyon and Mortandad Canyon (Plate 1). All buildings at TA-60 are located on the western end of the mesa and contain Laboratory support and maintenance operations and subcontractor-service facilities. The Nevada Test Site (NTS) test fabrication facility (building 60-0017), the NTS test tower (building 60-0018), several small abandoned experimental areas including a solar pond and a test drill hole, and storage sites for pesticides, topsoil, and recyclable asphalt are also located at TA-60 (LANL 1999, 064617, p. 2-25).

Laboratory analyses requested for TA-60 samples having decision-level quality data are presented in Table 3.0-1. Laboratory analyses requested for TA-60 samples having screening-level quality data are presented in Table 3.0-2. Decision-level quality data for TA-60 is provided in Tables 3.0-3 and 3.0-4. Screening-level quality data for TA-60 is provided in Tables 3.0-5 to 3.0-7. All laboratory analytical data (both decision-level quality and screening-level quality) are also provided in Appendix B.

#### **3.1 SWMU 60-002, Storage Area**

SWMU 60-002 [also designated as 3-009(h) in some listings] is comprised of three storage areas (designated as western, central, and eastern) on Sigma Mesa that have been used for the storage of construction and fill materials for Laboratory support contractors from the 1960s until the present. The first area (western) measures approximately 200 ft x 300 ft and is located approximately 900 ft southeast of building 60-0002, on the north side of the unimproved road that traverses the mesa (Figure 3.1-1). The storage area contains piles of concrete blocks, cured asphalt chunks, and cables. A large mound, mainly soil with some asphalt and concrete, was historically located at the site, but is no longer present. The second area (central) is located 120 ft northwest of the pesticide storage facility (building 60-0029) and formerly contained a 50-ft-diameter mound, approximately 10 ft high, consisting of soil, rocks, concrete

fence post supports, pipe, metal strips, wood, and similar debris (Figure 3.1-5). The third area (eastern) is on the south side of the unimproved road about 100 ft west of a surface impoundment [SWMU 60-005(a)] near the end of the mesa (Figure 3.1-8). This area was used to stage piles of broken cured asphalt chunks removed from roadways and parking lots prior to recycling (LANL 2005, 100704). The eastern area is currently the site of the asphalt batch plant (Shaw Environmental Inc., 2003, 085517, p. 1).

Samples have not been collected at the western area of SWMU 60-002. Although there is no specific data for this area, the location of the SWMU in relation to other sampling locations is shown on Figures 3.1-2, 3.1-3, and 3.1-4.

Sampling was conducted at the central area of SWMU 60-002 in 2004. Six soil samples were collected from five locations at depths of 0 to 1 ft bgs and 1.5 to 2 ft bgs. Five samples were analyzed for metals, VOCs, SVOCs, PCBs, and TPH. One sample was analyzed for SVOCs, PCBs, and TPH (LANL 2005, 100704, p. 5). Requested analyses are presented in Table 3.0-1.

Data are of decision-level quality and are presented in Tables 3.0-3 and 3.0-4. Sample locations are shown in Figures 3.1-6 and 3.1-7. Manganese was detected above BV in one sample. Acenaphthene, aroclor-1254, aroclor-1260, and TPH-GRO were each detected in two samples.

Sampling was conducted at the eastern area of SWMU 60-002 in 2003 (LANL, 2003, 080912, p. 4) that included the drilling of six boreholes. Ten soil and tuff samples were collected from five boreholes at two depth intervals ranging from 3 to 6 ft bgs and 13.5 to 17 ft bgs. Three tuff samples were collected from the sixth borehole at depths of 4 to 4.5 ft bgs, 8.5 to 9 ft bgs, and 14.5 to 15 ft bgs. All samples were submitted for laboratory analyses of metals, VOCs, SVOCs, and TPH. Requested analyses are presented in Table 3.0-1.

Data are of decision-level quality and are presented in Tables 3.0-3 and 3.0-4. Sample locations and detected results are shown in Figures 3.1-9 and 3.1-10. Barium, cobalt, and zinc were each detected above BVs in one soil sample; calcium and nickel were detected above BVs in two soil samples. Beryllium, cobalt, copper, manganese, and selenium were each detected above BVs in one tuff sample; iron and lead were detected above BVs in two tuff samples; arsenic, barium, calcium, chromium, magnesium, nickel, and vanadium were detected above BVs in three tuff samples; aluminum was detected above BV in four tuff samples. Fluoranthene, fluorene, and pyrene were each detected in one soil sample; hexanone(2-), was detected in one tuff sample; acetone was detected in five tuff samples; TPH-DRO was detected in all samples. The detection limits for cadmium and selenium in numerous soil and tuff samples were higher than BVs.

### **3.2 AOC 60-004(b), Storage Area**

AOC 60-004(b) is a former storage area for 12 containers of diesel sludge from underground storage tanks removed from the power plant. The containers were stored at AOC 60-004(b) in 1988. The storage site is located northeast of the geothermal well mud pit at the east end of Sigma Mesa and is contained within the boundaries of AOC 60-004(d) (Figure 3.1-8). Potential contaminants were oil and petroleum products (LANL 1993, 020947, pp. 1-7, 5-70, and 5-76).

RFI activities were performed at AOC 60-004(b) in 1994. Two soil samples were collected from two locations at depths of 0 to 1 ft bgs and submitted for laboratory analyses of metals, SVOCs, PCBs, and pesticides (LANL 1996, 052930, pp. 149, 150). A third soil sample was collected south and adjacent to AOC 60-004 within the boundary of AOC 60-004(d). The sample was collected from a depth of 0 to 1 ft bgs and analyzed for VOCs and gross alpha, beta, and gamma radiation. Requested analyses are presented in Table 3.0-2.

Data are of screening-level quality and are presented in Tables 3.0-5 and 3.0-6. Sample locations are shown in Figures 3.1-9, 3.1-10, and 3.1-11. Mercury was detected above BV in one sample. Bis(2-ethylhexyl)phthalate, phenol, and aroclor-1254 were detected in one sample. VOCs and radionuclides were not detected.

### 3.3 AOC 60-004(d), Storage Area

AOC 60-004(d) is a former area used to dismantle decommissioned underground storage tanks and to temporarily store drums containing fluids removed from underground storage tanks. The site is located northeast of the geothermal well mud pit at the east end of Sigma Mesa (Figure 3.1-8). The area was first developed in 1979 during a drilling project for a geothermal well. The northern edge of the area was used to dispose of building rubble, concrete, and rebar. Potential contaminants were oil and petroleum products (LANL 1993, 020947, pp. 5-69, 5-70).

RFI activities performed at AOC 60-004(d) in 1994 are the same as those for AOC 60-004(b) discussed in section 3.2. Requested analyses are presented in Table 3.0-2. Data are of screening-level quality and are presented in Tables 3.0-5 and 3.0-6. Sample locations are shown in Figures 3.1-9, 3.1-10, and 3.1-11.

### 3.4 AOC 60-004(f), Storage Area

AOC 60-004(f) [formerly AOC C-60-005 (LANL 1993, 066623, p. 2)] consists of two unpaved, bermed storage pads, Pad 2 and Pad 3, used for new product storage. The pads were constructed when the maintenance warehouse (building 60-0002) was built in 1978 (Figure 3.1-1). The pads were located southeast of building 60-0002. Pad 2 was 12 ft x 65 ft and Pad 3 was 12 ft x 40 ft. Both pads stored 55-gal. containers that dispensed Stoddard solvent, antifreeze, motor oil, grease, transmission fluid, and window-washing fluid. In 1985, 6-in. asphalt berms were built at the open ends of both pads to mitigate rainfall run-on and runoff problems. In 1990, all containers were removed from the pads. Both pads were discolored and had a petroleum odor (LANL 1993, 020947, pp. 5-15, 5-16).

RFI activities were conducted at AOC 60-004(f) in 1994. Thirteen samples were collected from five locations at Pad 2, and 11 samples were collected from five locations at Pad 3. At Pad 2, four samples (one sediment, one soil, and two tuff) were collected from one location at depths ranging from 0 to 7 ft bgs; four samples (two soil and two tuff) were collected from a second location at depths ranging from 1 to 6 ft bgs; three soil samples were collected from three locations at depths ranging from 1 to 2 ft bgs; and two sediment samples were collected from two locations at depths of 0 to 1.5 ft bgs. At Pad 3, four samples (two soil and two tuff) were collected from depths ranging from 1 to 6.5 ft bgs; four samples (two soil and two tuff) were collected from a second location at depths ranging from 1 to 6 ft bgs; and three samples (two soil and one tuff) were collected at a third location at depths ranging from 2 to 6 ft bgs. All samples were analyzed for radionuclides. Approximately half the samples were submitted for laboratory analyses of metals, VOCs, SVOCs, PCBs, and pesticides (LANL 1996, 052930, pp. 167–169). Requested analyses are presented in Table 3.0-2.

Data are of screening-level quality and are presented in Tables 3.0-5, 3.0-6, and 3.0-7. Sample locations are shown in Figures 3.1-2, 3.1-3, and 3.1-4. Aluminum was detected above BV in four tuff samples; arsenic was detected above BVs in one sediment and one tuff sample; barium was detected above BVs in two sediment and five tuff samples; calcium was detected above BV in two tuff samples; chromium was detected above BV in four tuff samples; copper was detected above BVs in one sediment and one soil sample; lead was detected above BV in one tuff sample; magnesium was detected above BV in four tuff samples; manganese was detected above BV in one soil sample; mercury was detected above BV in three tuff samples; nickel was detected above BV in one tuff sample; zinc was detected above BVs in one

sediment and three soil samples. Aroclor-1254 and aroclor-1260 were detected in one tuff sample. Tritium was detected in one soil, one sediment, and eight tuff samples. VOCs, SVOCs, and pesticides were not detected.

### **3.5 SWMU 60-006(a), Septic System**

SWMU 60-006(a) is a decommissioned septic system located on Sigma Mesa near the northeast corner of the fence surrounding buildings 60-0017 and 60-0019. This septic system formerly served buildings 60-0017 (NTS Test Rack Fabrication Facility) and 60-0019 (NTS test tower) (Figure 3.1-5). The septic system consists of a 1000-gal. septic tank and associated 4-ft wide x 50-ft deep seepage pit. No outfall is associated with this system. Building 60-0017 began operating in 1986 to fabricate equipment for testing activities carried out at NTS. From 1986 to 1989, wastewater generated from facility bathrooms and seven floor drains, including one in a paint booth, was discharged to the septic system. In 1989, building 60-0017 was connected to the sanitary sewer. Potential contaminants are inorganic chemicals and organic chemicals (LANL 1993, 020947, pp. 5-63, 5-64).

RFI activities were performed at SWMU 60-006(a) in 1994 to determine whether the septic tank had been drained after its use was discontinued and, if not, whether its contents were hazardous. The tank was found to be full and two waste characterization samples were collected from the sludge in the tank (LANL1996, 052930, pp. 181, 182). The samples were analyzed for metals, SVOCs, gross alpha, beta, and gamma radiation, and tritium (LANL1996, 052930, pp. 183, 185). Requested analyses are presented in Table 3.0-2.

Data are of screening-level quality and are presented in Tables 3.0-5 and 3.0-7. There are no BVs for any analytes in sludge; therefore, metals and tritium are only reported as detected in both samples. SVOCs were not detected.

### **3.6 SWMU 60-007(a), Release**

SWMU 60-007(a) is a 50-ft x 100-ft former storage area located near the east end of Sigma Mesa (Figure 3.1-8). This area was used to store equipment for drilling a geothermal well. Oil, hydraulic fluid, and similar materials were reported to have been released to the environment. In 1992, areas of stained soil were removed, placed in containers, and disposed of by the user group. The remediated areas were covered with gravel. No sampling was conducted by the user group to confirm removal of the contamination (LANL 1996, 052930, pp. 189, 190).

RFI activities were performed at SWMU 60-007(a) in 1994. Eleven soil samples were collected from eight locations and field-screened for PCBs and organic chemicals. With the exception of one sample, PCBs were not detected using the field test kits. Organic chemicals were detected at elevated readings, but moisture interference was suspected as the reason (LANL1996, 052930, pp. 192–194). One fill and five soil samples were collected from five locations at depths of 0 to 1 ft bgs. Two samples were analyzed for metals, five were analyzed for VOCs, two were analyzed for SVOCs, and three were analyzed for PCBs. Five additional soil and fill samples were collected from four locations at depths of 0 to 1 ft bgs and analyzed for gross alpha, beta, and gamma radiation. Requested analyses are presented in Tables 3.0-1 and 3.0-2.

Data reported are of decision-level quality and are presented in Tables 3.0-3 and 3.0-4. There were no detected results for screening-level data. Sample locations and detected results are shown in Figures 3.1-9 and 3.1-10. Barium was detected above BV in one sample. Toluene was detected in one sample. SVOCs and PCBs were not detected.

Sampling was also performed at SWMU 60-007(a) in 2001 (LANL 2001, 070937, pp. 1, 4). Six fill samples were collected from six locations at depths of 0 to 0.25 ft bgs and 0 to 0.5 ft bgs. All samples were submitted for laboratory analyses of metals, PCBs, and TPH (LANL 2001–2002, 100703, pp. 2, 3). Requested analyses are presented in Table 3.0-1.

Data are of decision-level quality and are presented in Tables 3.0-3 and 3.0-4. Sample locations and detected results are shown in Figures 3.1-9 and 3.1-10. Thallium was detected above BV in one sample. TPH-DRO and TPH-LRO were detected in two and three samples, respectively. No PCBs were detected.

### **3.7 SWMU 60-007(b), Release**

SWMU 60-007(b) is a storm drainage ditch that starts north of the motor pool building (building 60-0001), and extends approximately 600 ft from a paved area directly north of building 60-0001 to the bottom of Sandia Canyon (Figure 3.7-1). Two parking lots located east of building 60-0001 drain to a ditch that eventually joins the SWMU 60-007(b) drainage ditch. Other former sources of potential contamination to the ditch are a steam-cleaning pad, a used-oil storage tank, and an oil/water separator. Equipment that used PCB-containing oil was stored on an asphalt area east of building 60-0001 (LANL 1993, 020947, pp. 5-14, 5-15). The area of the ditch visibly affected by these sources was remediated by the user group in 1986 (LANL1996, 052930, p. 195).

In 1994, RFI activities were performed at SWMU 60-007(b) to determine if any contamination remained in the sediment after the 1986 soil removal. Eight samples were collected from seven locations in the east/west drainage ditch north of building 60-0001 and field-tested for PCBs. PCBs were not detected using the field test kits. In the north/south drainage ditch east of building 60-0001, seven locations were field-screened for organic chemicals. No organic chemicals were detected. Six soil and sediment samples were collected from four locations at depths ranging from 0 to 1.5 ft bgs. Two sediment samples were analyzed for metals; one soil and one sediment sample were analyzed for VOCs; two sediment samples were analyzed for SVOCs; and two samples were analyzed for PCBs. All samples were analyzed for gross alpha, beta, and tritium (LANL1996, 052930, pp. 195–199). Requested analyses are presented in Table 3.0-2.

Data are of decision-level quality and are presented in Tables 3.0-5, 3.0-6, and 3.0-7. Sample locations are shown in Figures 3.7-2, 3.7-3, and 3.7-4. Calcium was detected above BV in one sample. Bis(2-ethylhexyl)phthalate was detected in one sample. Tritium was detected in three samples. VOCs and PCBs were not detected.

## **4.0 SITES UNDER INVESTIGATION IN TA-61**

TA-61 was created from a portion of TA-03 and is bounded on the north by Los Alamos Canyon and on the south by Sandia Canyon (Plate 1). TA-61 contains physical support and infrastructure facilities including the Los Alamos County landfill, sewer pump stations, a radio shop, general storage sheds, a blower house, a private batch concrete batch plant, a Laboratory-operated asphalt batch plant, and general warehouse storage for maintenance activities. A small parcel of private property, the Royal Crest Manufactured Home Community, is surrounded by TA-61.

### **4.1 SWMU 61-002, Transformer Storage Area—PCB Site**

SWMU 61-002 is a former storage area that was located in TA-61, east of the Radio Repair Shop (building 61-0023, formerly building 03-0282) on East Jemez Road (Figure 4.1-1). This storage area is part of a fenced area that measures 81 ft × 91 ft. The area historically was used to store capacitors and

transformers. In addition, the storage area contained several oil-filled containers and unmarked containers. Before 1985, containers of PCB-contaminated oil were stored in this area and were known to have leaked. In 1986, elevated PCB concentrations were detected in 32 soil samples collected at this area. The area was subsequently excavated, backfilled with clean soil, and paved over with asphalt. After the 1986 remediation, the east side of the storage area was used to store electrical equipment, some of which contained PCBs (LANL 1993, 020947, p. 5-101). All storage operations were discontinued in 1992. Staining was observed on the surface of the asphalt. Potential contaminants are PCBs and possibly lead (LANL1996, 052930, p. 201).

In the summer of 1994 RFI activities were performed at SWMU 61-002 to determine if PCBs were present in the stains on the asphalt or in surface soil downgradient from the site. Sample locations were selected using the stained areas and a minor drainage area as reference points. Eighteen soil samples were collected from 16 locations (0 to 6 in. bgs). Samples were field-screened for VOCs, and analyzed for SVOCs, PCBs, and metals. Zinc was detected above BV. Elevated PCB concentrations were found in two samples in the drainage pathway at the furthest downgradient locations that were sampled. The RFI report recommended further investigation at SWMU 61-002 to identify the extent of contamination (LANL1996, 052930, pp. 204, 205). In 1997, 42 samples (soil, fill, tuff, and asphalt) were collected from 19 locations (0 to 1.8 ft bgs) and submitted to an off-site analytical laboratory for analysis of PCBs. PCBs were detected in 38 of the samples. No report was written for this sampling event. In 2004, an ACA work plan was submitted for the investigation and remediation of SWMU 61-002 (LANL 2004, 087474, p. 6).

In 2005, NMED approved the ACA work plan with modifications (NMED 2005, 087835). During the 2005 investigation and remediation of residual PCB contamination, petroleum hydrocarbon contamination was discovered in the subsurface. Two underground product lines and a total of 424 yd<sup>3</sup> of soil were removed in August 2005. The contaminated area was further characterized in 2006. The results of the 2005 and 2006 sampling and remediation activities were reported in a remedy completion report (LANL 2007, 097315).

#### **4.2 SWMU 61-005, Landfill**

SWMU 61-005 is the Los Alamos County landfill. The landfill is located in TA-61 on the rim of Sandia Canyon near East Jemez Road. It consists of 400-ft<sup>2</sup> pits that are excavated into tuff (Figure 4.2-1). The pits are designed so runoff does not enter the canyon. Waste is deposited into the active pit and covered with soil daily. When full, the pit is capped and a new pit is put into service. The landfill was created in 1974 and is owned by DOE and operated by Los Alamos County for use by the public, the county, and LANL. It has a permit to manage nonhazardous solid waste and is regulated by NMED (LANL 1993, 020947, p. 6-9).

Samples have not been collected from this site.

#### **4.3 SWMU 61-006, Waste-Oil Tank**

SWMU 61-006 is an active oil recycling area located at the Los Alamos County landfill (SWMU 61-005) (Figure 4.1-1). The oil recycling area consists of an open, lined pit approximately 10-ft x 20-ft x 7-ft deep that contains a 2500-gal. holding tank. An 8-ft-long pipe leads to a filling bin at ground level. According to the 1990 SWMU report, historically there were three underground tanks in the pit. In 1989, two of the tanks were removed (LANL 1990, 007514, p. 61-006). The third tank was moved to its current location in the open, lined pit. The area where the tanks were formerly located was excavated as a disposal pit for use at the landfill (LANL 1993, 020947, p. 6-10).



The pit has been covered, a leak detection system installed on the tank, and the pit was relined with an improved liner (LANL 1993, 020947, p. 6-10). Upgrades were completed in 2000.

Samples have not been collected from this site.

#### 4.4 AOC C-61-002, Subsurface Contamination

AOC C-61-002 is subsurface contamination that was encountered in 1995 during a drill rig test. The test hole is located in TA-61, approximately 15 ft north of building 61-0016, a former storage building (former structure 03-0326) (Figure 4.1-1). During the drilling test, an odor was noted and contamination was encountered at 7 to 8 ft bgs. The contamination was suspected to be petroleum-based (e.g., diesel). A sample of the tuff was collected and the analysis showed the presence of diesel. Personnel interviews conducted after the drilling indicated that the source of the diesel may have been the previous road maintenance support work performed in the area (LANL 1995, 049550, p. 2).

Samples have not been collected from this site.

## 5.0 REFERENCES AND MAP DATA SOURCES

### 5.1 References

*The following list includes all documents cited in this report. Parenthetical information following each reference provides the author(s), publication date, and ER ID number. This information is also included in text citations. ER ID numbers are assigned by the Environmental Programs Directorate's Records Processing Facility (RPF) and are used to locate the document at the RPF and, where applicable, in the master reference set.*

*Copies of the master reference set are maintained at the NMED Hazardous Waste Bureau; the U.S. Department of Energy—Los Alamos Site Office; the U.S. Environmental Protection Agency, Region 6; and the Directorate. The set was developed to ensure that the administrative authority has all material needed to review this document, and it is updated with every document submitted to the administrative authority. Documents previously submitted to the administrative authority are not included.*

Caporuscio, F., January 29, 2003. "Soil Characterization Report for the Installation of a New Gas Turbine Generator and Utilities at the TA-3 Power Plant," report prepared for Los Alamos National Laboratory by KSL Services and Eberline Services, Albuquerque, New Mexico. (Caporuscio 2003, 088444)

DOE (U.S. Department of Energy), October 1987. "Phase I: Installation Assessment, Los Alamos National Laboratory," draft, Volume 1 of 2, Comprehensive Environmental Assessment and Response Program, Environment and Health Division, Environmental Programs Branch, Albuquerque Operations Office, Albuquerque, New Mexico. (DOE 1987, 008663)

DOE (U.S. Department of Energy), October 1987. "Phase I: Installation Assessment, Los Alamos National Laboratory," draft, Volume 2 of 2, Comprehensive Environmental Assessment and Response Program, Environment and Health Division, Environmental Programs Branch, Albuquerque Operations Office, Albuquerque, New Mexico. (DOE 1987, 008664)

- EPA (U.S. Environmental Protection Agency), November 28, 2001. "Approval of the VCA Report under the Toxic Substance and Control Act (TSCA) 761.61(c) for PCB Site 3-056(c) at Los Alamos National Laboratory (LANL)," U.S. Environmental Protection Agency letter to M. Johansen (DOE-LAAO) from D. Neleigh (EPA Region 6), Dallas, Texas. (EPA 2001, 072810)
- EPA (U.S. Environmental Protection Agency), August 16, 2004. "EPA's Prior Decisions on SWMU/AOC Sites at Los Alamos National Laboratory (LANL)," U.S. Environmental Protection Agency letter to J. Bearzi (NMED-HRMB) from L.F. King (EPA Federal Facilities Section Chief), Dallas, Texas. (EPA 2004, 087296)
- EPA (U.S. Environmental Protection Agency), January 21, 2005. "EPA's Prior Decisions on SWMU/AOC Sites at Los Alamos National Laboratory (LANL)," U.S. Environmental Protection Agency letter to J. Bearzi (NMED-HRMB) from L.F. King (EPA Federal Facilities Section Chief), Dallas, Texas. (EPA 2005, 088464)
- EPA (U.S. Environmental Protection Agency), June 8, 2007. "Authorization to Discharge under the National Pollutant Discharge Elimination System, NPDES Permit No. NM 0028355," Region 6, Dallas, Texas. (EPA 2007, 099009)
- Faulk, D., June 19, 1995. "Archaeological Status Report for Site Remediation Activities at SWMU 3-056(c)," ERM/Golder memorandum to B. Larson (LANL) from D. Faulk (ERM/Golder), Los Alamos, New Mexico. (Faulk 1995, 055741)
- LANL (Los Alamos National Laboratory), November 1990. "Solid Waste Management Units Report," Vol. IV of IV (TA-51 through TA-74), Los Alamos National Laboratory document LA-UR-90-3400, Los Alamos, New Mexico. (LANL 1990, 007514)
- LANL (Los Alamos National Laboratory), November 1990. "Solid Waste Management Units Report," Vol. I of IV (TA-0 through TA-9), Los Alamos National Laboratory document LA-UR-90-3400, Los Alamos, New Mexico. (LANL 1990, 007511)
- LANL (Los Alamos National Laboratory), July 1993. "RFI Work Plan for Operable Unit 1114," Los Alamos National Laboratory document LA-UR-93-1000, Los Alamos, New Mexico. (LANL 1993, 020947)
- LANL (Los Alamos National Laboratory), November 23, 1993. "Final Notice of Deficiency (NOD) Response for Operable Unit (OU) 1114," Los Alamos National Laboratory letter (ERWM:93-A254) to J. Vozella (DOE-LAAO) from R. Vocke (LANL), Los Alamos, New Mexico. (LANL 1993, 066623)
- LANL (Los Alamos National Laboratory), August 1994. "Los Alamos National Laboratory Environmental Restoration Chain of Custody/Request for Analysis Forms for PRS 3-056(c)," Los Alamos National Laboratory, Los Alamos, New Mexico. (LANL 1994, 040397)
- LANL (Los Alamos National Laboratory), July 1995. "RFI Work Plan for Operable Unit 1114, Addendum 1," Los Alamos National Laboratory document LA-UR-95-731, Los Alamos, New Mexico. (LANL 1995, 057590)

- LANL (Los Alamos National Laboratory), August 3, 1995. "Notification of Two New Solid Waste Management Units (SWMUs)," Los Alamos National Laboratory letter to W.K. Honker (EPA Region 6) from J. Jansen (LANL ER Project Manager) and T. Taylor (DOE-LAAO), Los Alamos, New Mexico. (LANL 1995, 049550)
- LANL (Los Alamos National Laboratory), September 1995. "Request for Permit Modification, Units Proposed for NFA," Los Alamos National Laboratory document LA-UR-95-3319, Los Alamos, New Mexico. (LANL 1995, 051878)
- LANL (Los Alamos National Laboratory), February 1996. "RFI Report for 53 Potential Release Sites in TA-3, TA-59, TA-60, TA-61," Los Alamos National Laboratory document LA-UR-96-726, Los Alamos, New Mexico. (LANL 1996, 052930)
- LANL (Los Alamos National Laboratory), February 26, 1996. "Voluntary Corrective Action Completion Report for Potential Release Sites 03-003(p), 03-047(d), 03-051(c), Revision 1," Los Alamos National Laboratory document LA-UR-96-431, Los Alamos, New Mexico. (LANL 1996, 053780)
- LANL (Los Alamos National Laboratory), September 1996. "Request for Permit Modification, Units Proposed for NFA," Vol. I, Los Alamos National Laboratory document LA-UR-96-3357, Los Alamos, New Mexico. (LANL 1996, 055035)
- LANL (Los Alamos National Laboratory), September 1997. "RFI Report for TA-3 for Potential Release Sites 3-004(c,d), 3-007, 3-014(k,l,o), 3-021, 3-049(a), 3-052(b), 3-056(k), C-3-014," Los Alamos National Laboratory document LA-UR-97-3571, Los Alamos, New Mexico. (LANL 1997, 056660.4)
- LANL (Los Alamos National Laboratory), September 22, 1998. "Inorganic and Radionuclide Background Data for Soils, Canyon Sediments, and Bandelier Tuff at Los Alamos National Laboratory," Los Alamos National Laboratory document LA-UR-98-4847, Los Alamos, New Mexico. (LANL 1998, 059730)
- LANL (Los Alamos National Laboratory), September 1999. "Work Plan for Sandia Canyon and Cañada del Buey," Los Alamos National Laboratory document LA-UR-99-3610, Los Alamos, New Mexico. (LANL 1999, 064617)
- LANL (Los Alamos National Laboratory), July 10, 2001. "Sampling Notification," Los Alamos National Laboratory letter (ER2001-00574) to J. Young (NMED-HWB) from D. McInroy (ER Project), Los Alamos, New Mexico. (LANL 2001, 070937)
- LANL (Los Alamos National Laboratory), July 16, 2001. "Sampling Notification," Los Alamos National Laboratory letter (ER2001-0584) to J. Young (NMED-HWB) from D. McInroy (ER Project), Los Alamos, New Mexico. (LANL 2001, 071214)
- LANL (Los Alamos National Laboratory), September 2001. "Voluntary Corrective Action Completion Report for Potential Release Site 03-056(c)," Los Alamos National Laboratory document LA-UR-01-5349, Los Alamos, New Mexico. (LANL 2001, 071259)

- LANL (Los Alamos National Laboratory), July 23, 2001–March 13, 2002. "Field Notebook for SWMUs 03-001(k), 03-003(c), 03-011, 03-049(e), 03-056(a), 27-003, 39-007(a), 60-002, 60-007(a), and C-09-001," Los Alamos National Laboratory, Los Alamos, New Mexico. (LANL 2001–2002, 100703)
- LANL (Los Alamos National Laboratory), September 2002. "RFI Report for Area of Concern 03-047(d) at Technical Area 03 (Former Container Storage Area)," Los Alamos National Laboratory document LA-UR-02-6158, Los Alamos, New Mexico. (LANL 2002, 073868.138)
- LANL (Los Alamos National Laboratory), September 2002. "Voluntary Corrective Action Completion Report for Area of Concern C-03-020 at Technical Area 03 (Inactive Underground Storage Tanks)," Los Alamos National Laboratory document LA-UR-02-5963, Los Alamos, New Mexico. (LANL 2002, 073868.4)
- LANL (Los Alamos National Laboratory), March 27, 2003. "Sampling Notification," Los Alamos National Laboratory letter (ER2003-0257) to J. Young (NMED-HWB) from R. Bohn (LANL), Los Alamos, New Mexico. (LANL 2003, 075992)
- LANL (Los Alamos National Laboratory), August 29, 2003. "Sampling Notification," Los Alamos National Laboratory letter (ER2003-0562) to J. Young (NMED-HWB) from R. Bohn (LANL), Los Alamos, New Mexico. (LANL 2003, 079741)
- LANL (Los Alamos National Laboratory), September 2003. "Field Implementation Plan for Asphalt Batch Plant Solid Waste Management Units and Areas of Concern at Technical Areas 3 and 60," Los Alamos National Laboratory document LA-UR-03-6161, Los Alamos, New Mexico. (LANL 2003, 080912)
- LANL (Los Alamos National Laboratory), November 2003. "Sample Collection Logs and Chain-of-Custody Forms for Consolidated Unit 03-012(b)-00," Los Alamos National Laboratory, Los Alamos, New Mexico. (LANL 2003, 100705)
- LANL (Los Alamos National Laboratory), November 12, 2003. "Sampling Notification," Los Alamos National Laboratory letter (ER2003-0721) to J. Young (NMED-HWB) from R. Bohn (LANL), Los Alamos, New Mexico. (LANL 2003, 080102)
- LANL (Los Alamos National Laboratory), September 2004. "Solid Waste Management Unit (SWMU) Assessment Plan for SWMU 03-013(i)," Los Alamos National Laboratory document LA-UR-04-6783, Los Alamos, New Mexico. (LANL 2004, 087406)
- LANL (Los Alamos National Laboratory), November 2004. "Accelerated Corrective Action Work Plan for the Investigation and Remediation of Area of Concern 03-001(i) and Solid Waste Management Units 03-029 and 61-002," Los Alamos National Laboratory document LA-UR-04-7879, Los Alamos, New Mexico. (LANL 2004, 087474)
- LANL (Los Alamos National Laboratory), October 2005. "Solid Waste Management Unit (SWMU) Assessment Report for SWMU 03-013(i)," Los Alamos National Laboratory document LA-UR-05-7420, Los Alamos, New Mexico. (LANL 2005, 091540)

- LANL (Los Alamos National Laboratory), October 2005. "Solid Waste Management Unit (SWMU) Assessment Report for SWMU 03-003(c)" and "Solid Waste Management Unit (SWMU) Assessment Report for SWMU 60-002," 70% Drafts, Los Alamos National Laboratory, Los Alamos, New Mexico. (LANL 2005, 100704)
- LANL (Los Alamos National Laboratory), December 2005. "Remedy Completion Report for the Investigation and Remediation of Area of Concern 03-001(i) and Solid Waste Management Units 03-029 and 61-002," Los Alamos National Laboratory document LA-UR-05-8863, Los Alamos, New Mexico. (LANL 2005, 091150)
- LANL (Los Alamos National Laboratory), May 2007. "Remedy Completion Report for the Investigation and Remediation of Solid Waste Management Unit 61-002 at Technical Area 61," Los Alamos National Laboratory document LA-UR-07-2745, Los Alamos, New Mexico. (LANL 2007, 097315)
- LANL (Los Alamos National Laboratory), March 21, 2008. "Structure Searches for 3-287, 3-2422, and 3-36," online search results from the MOADS internal database at Los Alamos National Laboratory, Los Alamos, New Mexico. (LANL 2008, 099214)
- Madsen, A., March 21, 2008. "Below Grade Excavation of Super Computing Center (SCC) at LANL TA-03," North Wind memorandum to file from A. Madsen, Los Alamos, New Mexico. (Madsen 2008, 099213)
- NMED (New Mexico Environment Department), December 23, 1998. "Approval: Class III Permit Modification to Remove Ninety-nine (99) Solid Waste Management Units from the Department of Energy/Los Alamos National Laboratory RCRA Permit NM 0890010515," New Mexico Environment Department letter to T. Taylor (DOE-LAAO) and J.C. Browne (LANL Director) from E. Kelley (NMED-HRMB), Santa Fe, New Mexico. (NMED 1998, 063042)
- NMED (New Mexico Environment Department), May 2, 2001. "Approval of Class III Permit Modification to Remove Thirty (30) Solid Waste Management Units from the Department of Energy / Los Alamos National Laboratory RCRA Permit NM 0890010515," New Mexico Environment Department letter to D.A. Gurule (Area Manager/LAAO) and J.C. Browne (LANL Director) from G.J. Lewis (NMED-WWMD Director), Santa Fe, New Mexico. (NMED 2001, 070010)
- NMED (New Mexico Environment Department), September 20, 2002. "Approval of VCA Completion Report for PRS 3-056(c)," New Mexico Environment Department letter to J.C. Browne (LANL Director) and E. Trollinger (DOE-OLASO) from J.E. Young (NMED-HWB), Santa Fe, New Mexico. (NMED 2002, 073363)
- NMED (New Mexico Environment Department), March 14, 2005. "Notice of Approval as Modified, Accelerated Corrective Action Work Plan for the Investigation and Remediation of Area of Concern 03-001(i) and Solid Waste Management Units 03-029 and 61-002," New Mexico Environment Department letter to D. Gregory (DOE LASO) and G.P. Nanos (LANL Director) from J. Young (NMED), Santa Fe, New Mexico. (NMED 2005, 087835)
- NMED (New Mexico Environment Department), October 13, 2006. "Certificate of Completion for Area of Concern 03-001(i), Technical Area 03," New Mexico Environment Department letter to D. Gregory (DOE-LASO) and D. McInroy (LANL) from J.P. Bearzi (NMED-HWB), Santa Fe, New Mexico. (NMED 2006, 094384)

NMED (New Mexico Environment Department), January 23, 2008. "Approval of Los Alamos National Laboratory Proposal for No Further Action," New Mexico Environment Department letter to D. Gregory (DOE-LASO) and D. McInroy (LANL) from J.P. Bearzi (NMED-HWB), Santa Fe, New Mexico. (NMED 2008, 100116)

Shaw Environmental Inc., October 7, 2003. "Field Summary Report, TA-3 and TA-60 Asphalt Batch Plant RCRA Facility Investigation," report prepared for Los Alamos National Laboratory, Los Alamos, New Mexico. (Shaw Environmental, Inc., 2003, 085517)

Tucker, K., August 10, 2001. "Sampling Activities at PRS 3-054(c)," Washington Group International, Inc., PMC Environmental, Science and Engineering Associates, Inc. (WGII/PMC/SEA), Los Alamos Team memorandum to file from K. Tucker (SEA), Los Alamos, New Mexico. (Tucker 2001, 100702)

## 5.2 Map Data Sources

Legend Item	Data Source
2-ft elevation contour	Hypsography, 2-ft Contour Interval; Los Alamos National Laboratory, ENV Environmental Remediation and Surveillance Program; 1991.
10-ft elevation contour	Hypsography, 10-ft Contour Interval; Los Alamos National Laboratory, ENV Environmental Remediation and Surveillance Program; 1991.
20-ft elevation contour	Hypsography, 20-ft Contour Interval; Los Alamos National Laboratory, ENV Environmental Remediation and Surveillance Program; 1991.
100-ft elevation contour	Hypsography, 100-ft Contour Interval; Los Alamos National Laboratory, ENV Environmental Remediation and Surveillance Program; 1991.
Upper Sandia Canyon Aggregate Area	Aggregate Areas; Los Alamos National Laboratory, ENV Environmental Remediation & Surveillance Program, ER2005-0496; 1:2,500 Scale Data; 22 September 2005.
Fence	Security and Industrial Fences and Gates; Los Alamos National Laboratory, KSL Site Support Services, Planning, Locating and Mapping Section; 06 January 2004; as published 27 April 2007.
Former Structure	Structures; Los Alamos National Laboratory, Facilities and Waste Operations Division; as published 20 March 2001.
Structure	Structures; Los Alamos National Laboratory, KSL Site Support Services, Planning, Locating and Mapping Section; 06 January 2004; as published 10 September 2007.
SWMU or AOC Consolidated Unit 03-012(b)-00 boundary	Potential Release Sites; Los Alamos National Laboratory, RRES Remediation Services Project, ER2005-0403; 1:2,500 Scale Data; 21 June 2005. Change control requests pending.
Paved road	Paved Road Arcs; Los Alamos National Laboratory, KSL Site Support Services, Planning, Locating and Mapping Section; 06 January 2004; as published 27 April 2007.
Unpaved road	Dirt Road Arcs; Los Alamos National Laboratory, KSL Site Support Services, Planning, Locating and Mapping Section; 06 January 2004; as published 27 April 2007.
TA boundary	Technical Area Boundaries; Los Alamos National Laboratory, Site Planning & Project Initiation Group, Infrastructure Planning Division; 21 December, 2006.



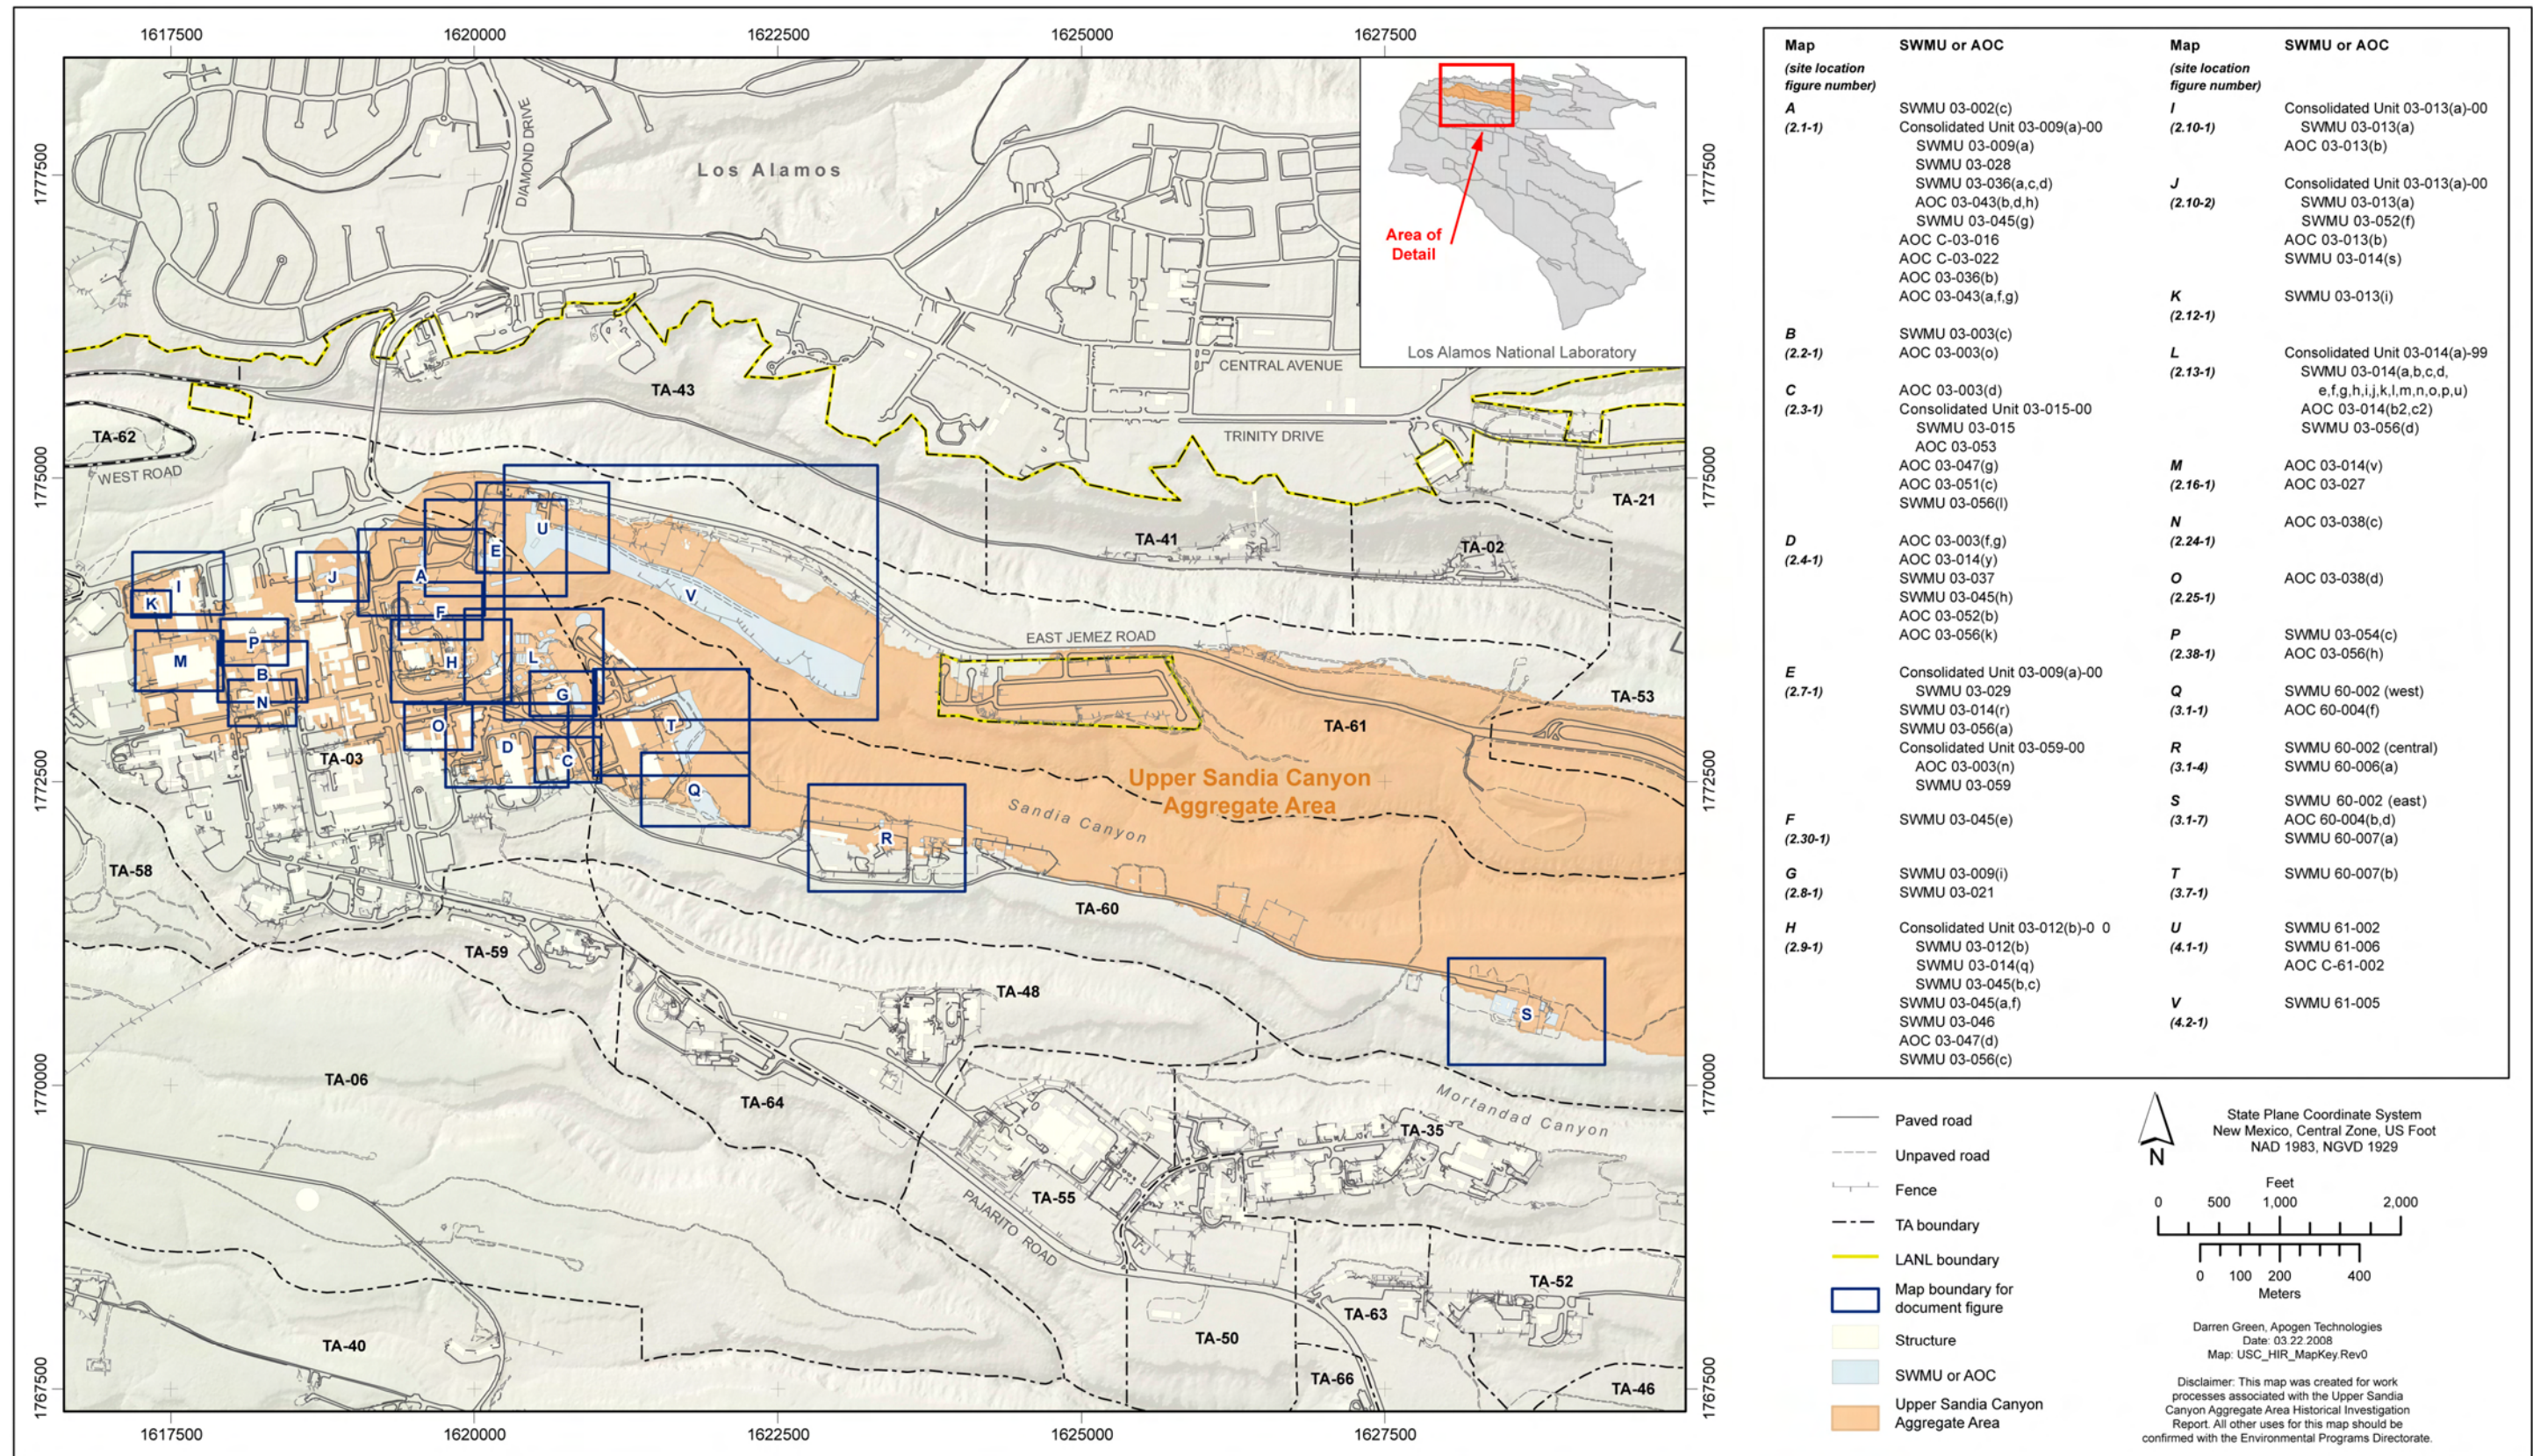


Figure 1.0-1 Upper Sandia Canyon Aggregate Area map key



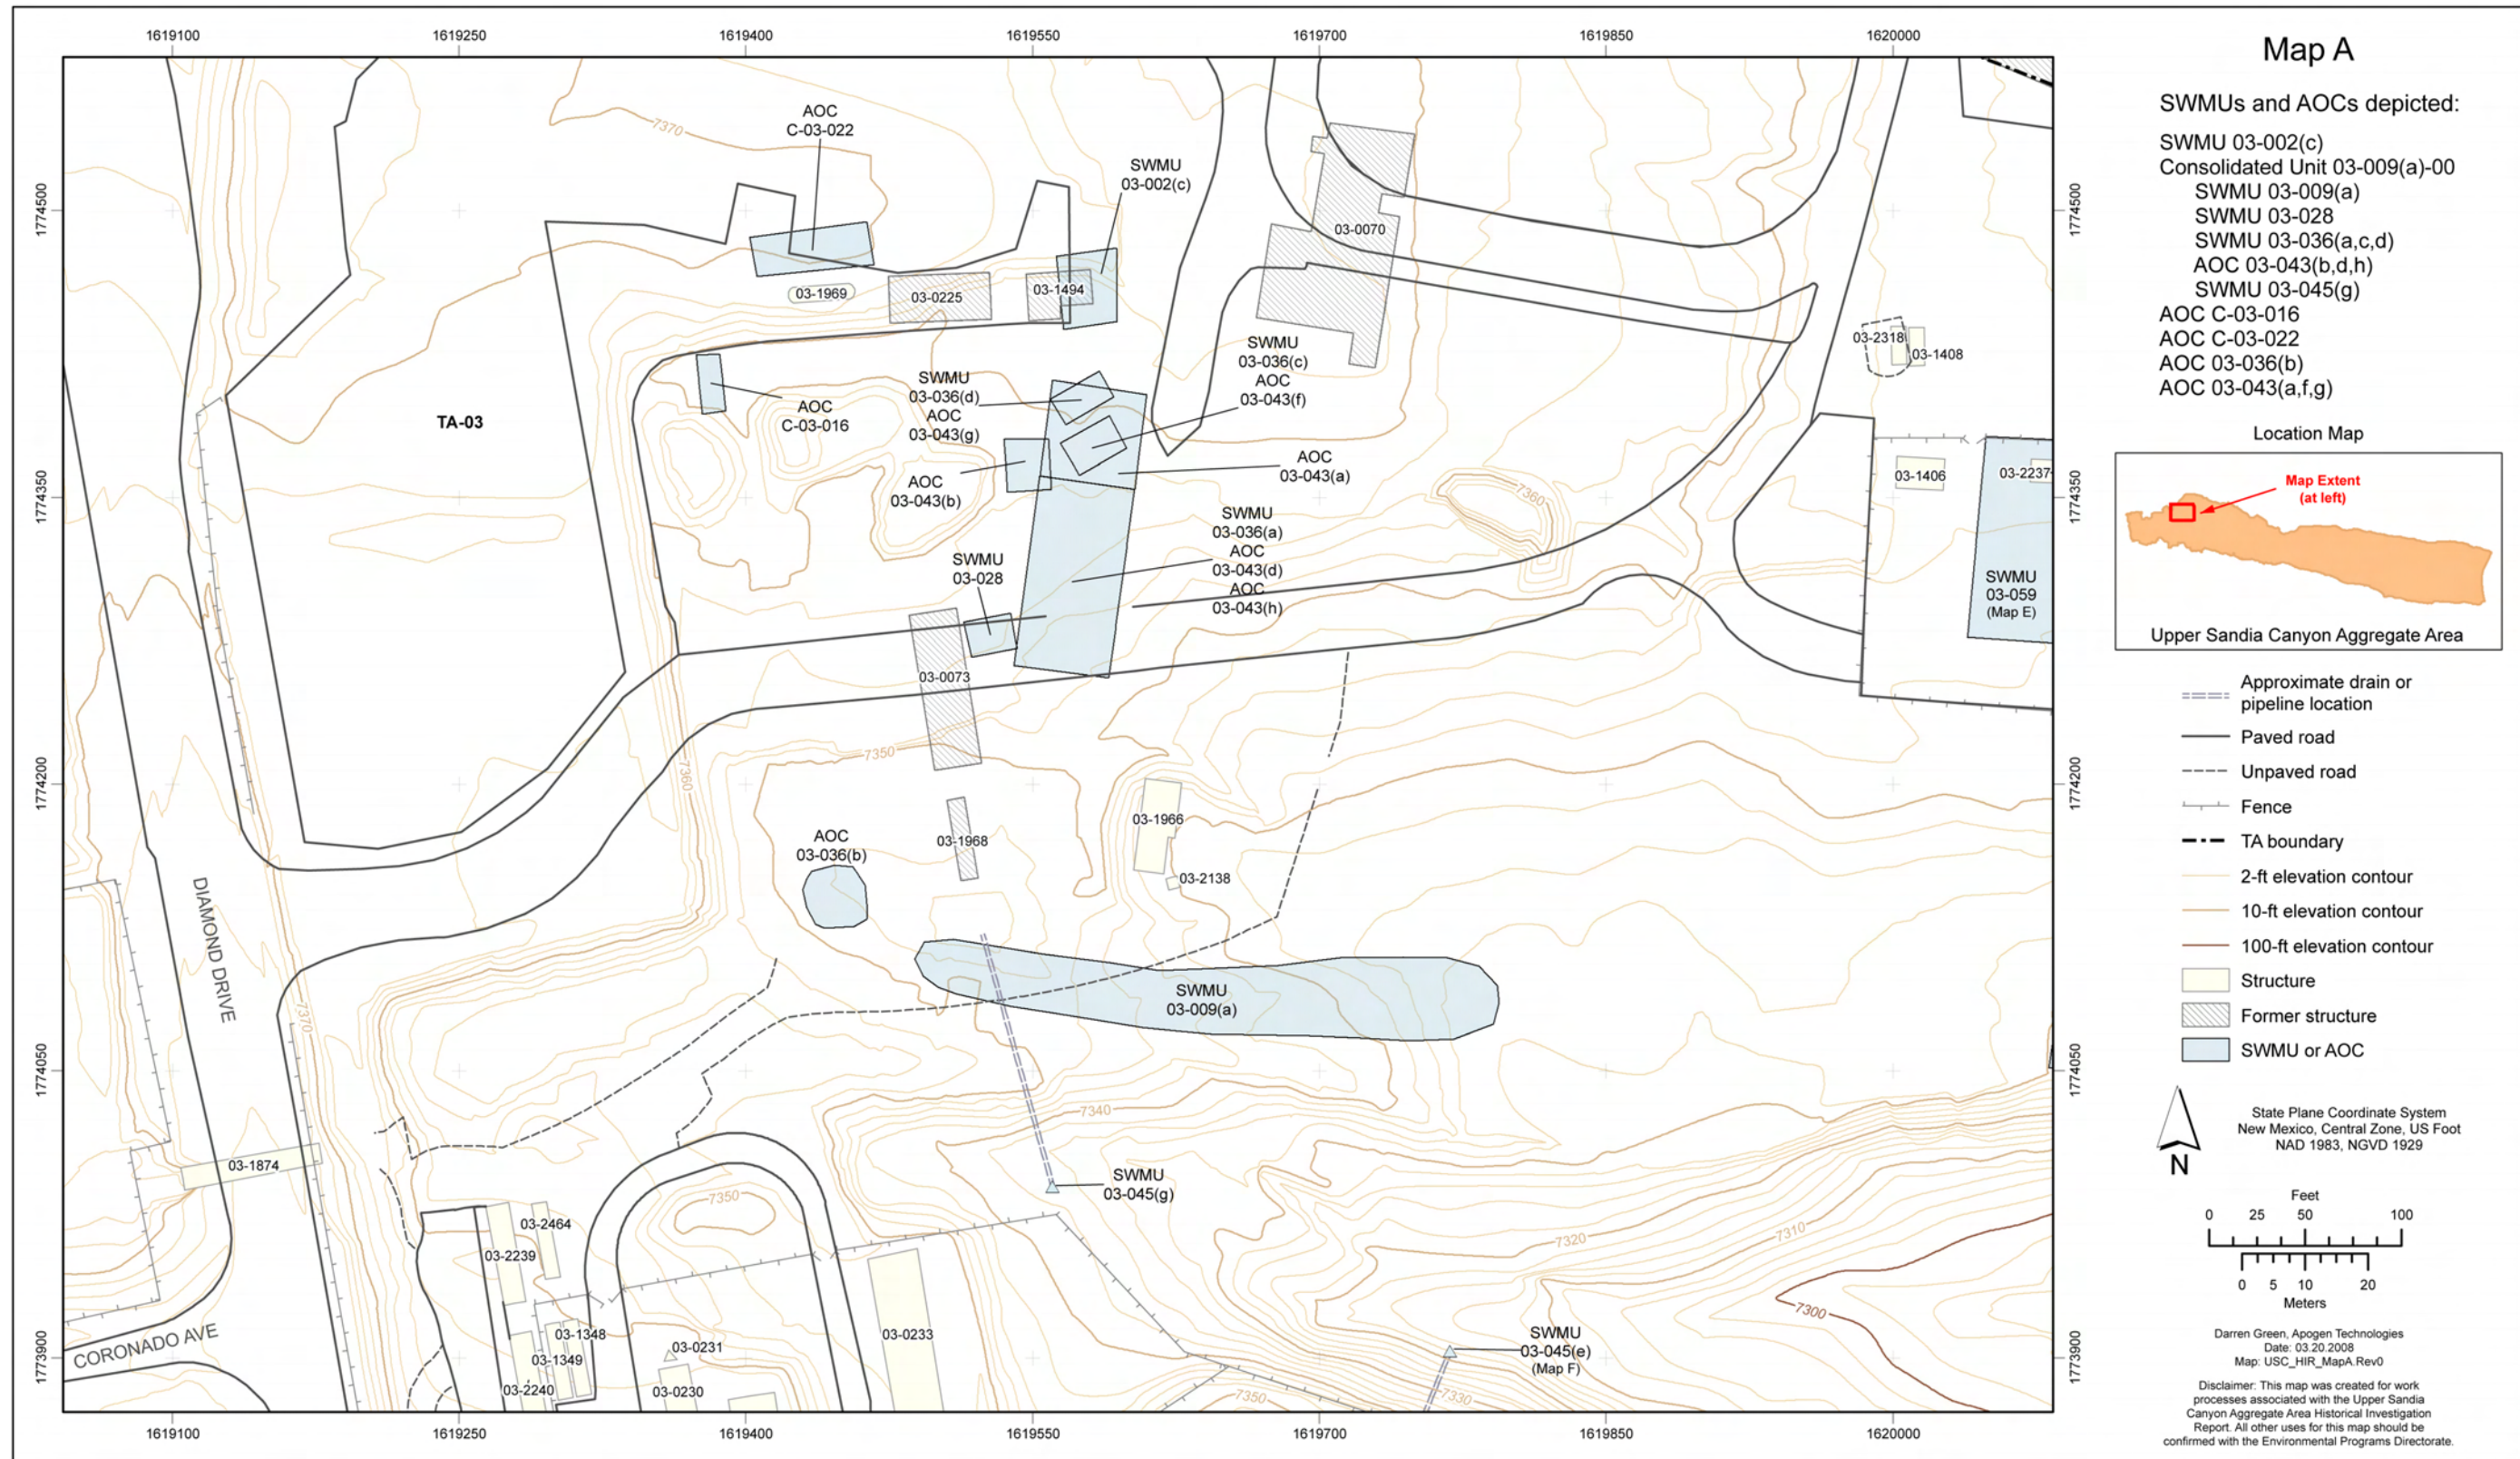


Figure 2.1-1 Map A site location



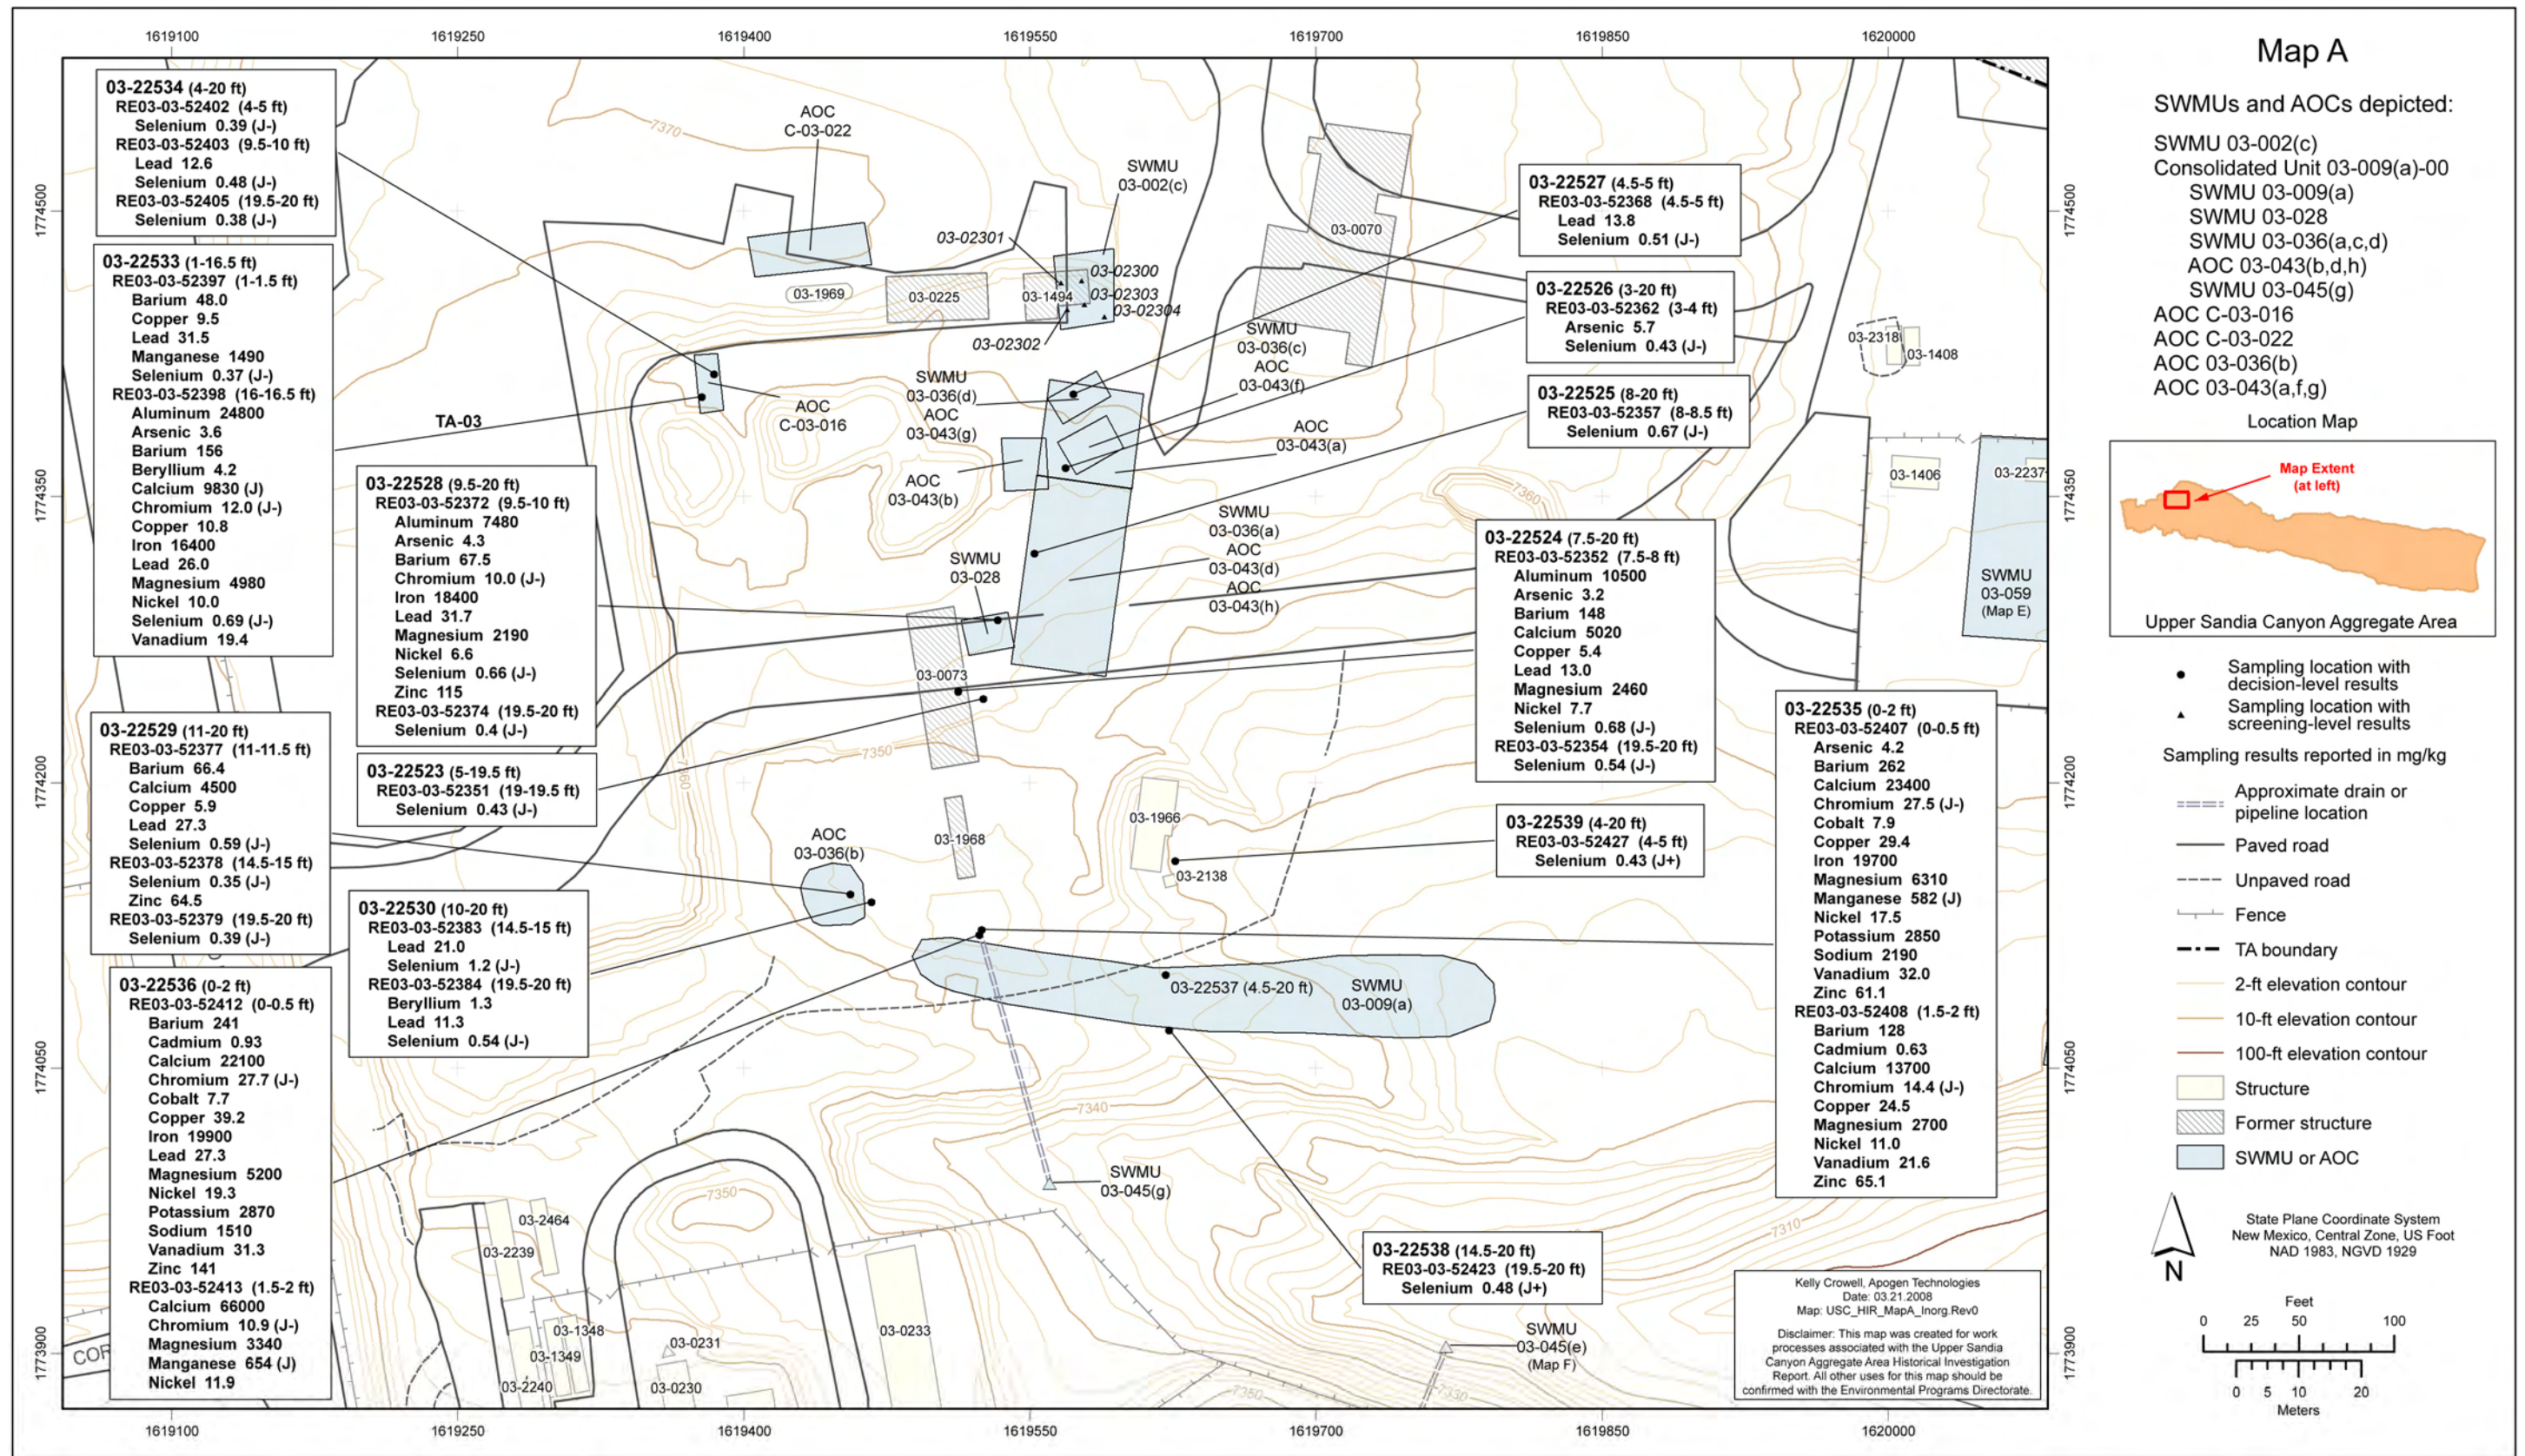


Figure 2.1-2 Map A inorganic chemical sampling locations and results detected above BVs



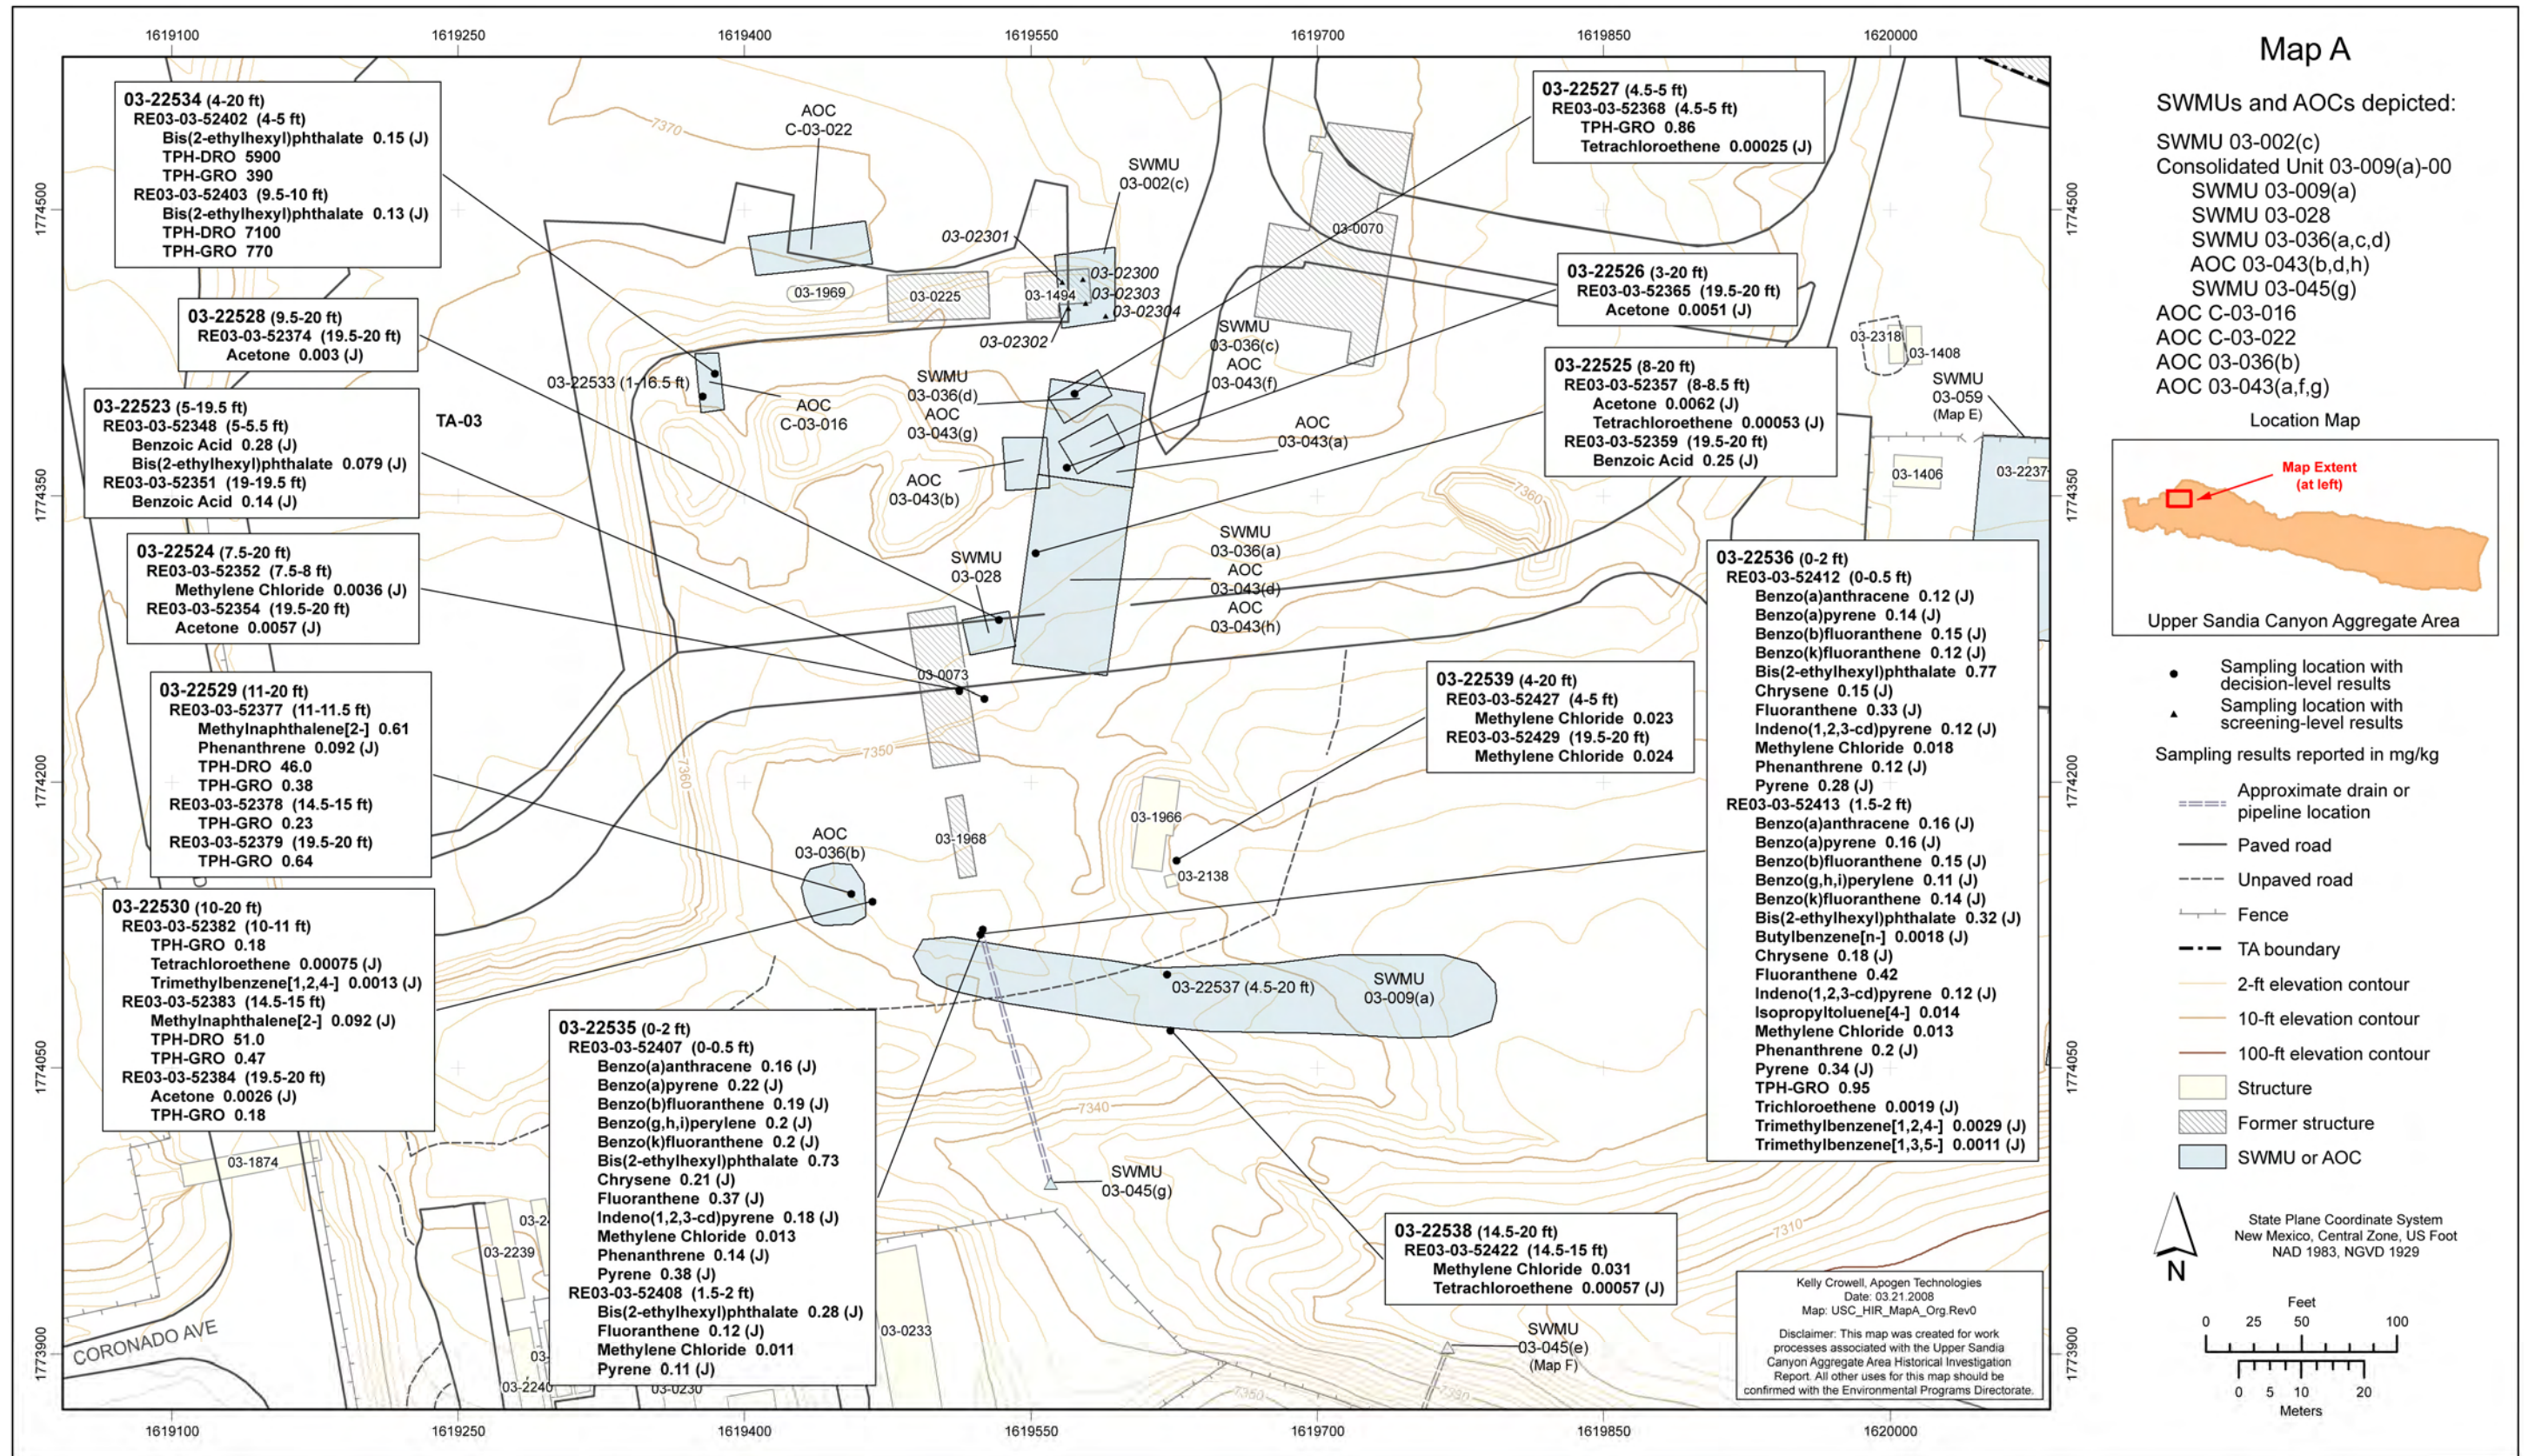


Figure 2.1-3 Map A organic chemical sampling locations and detected results



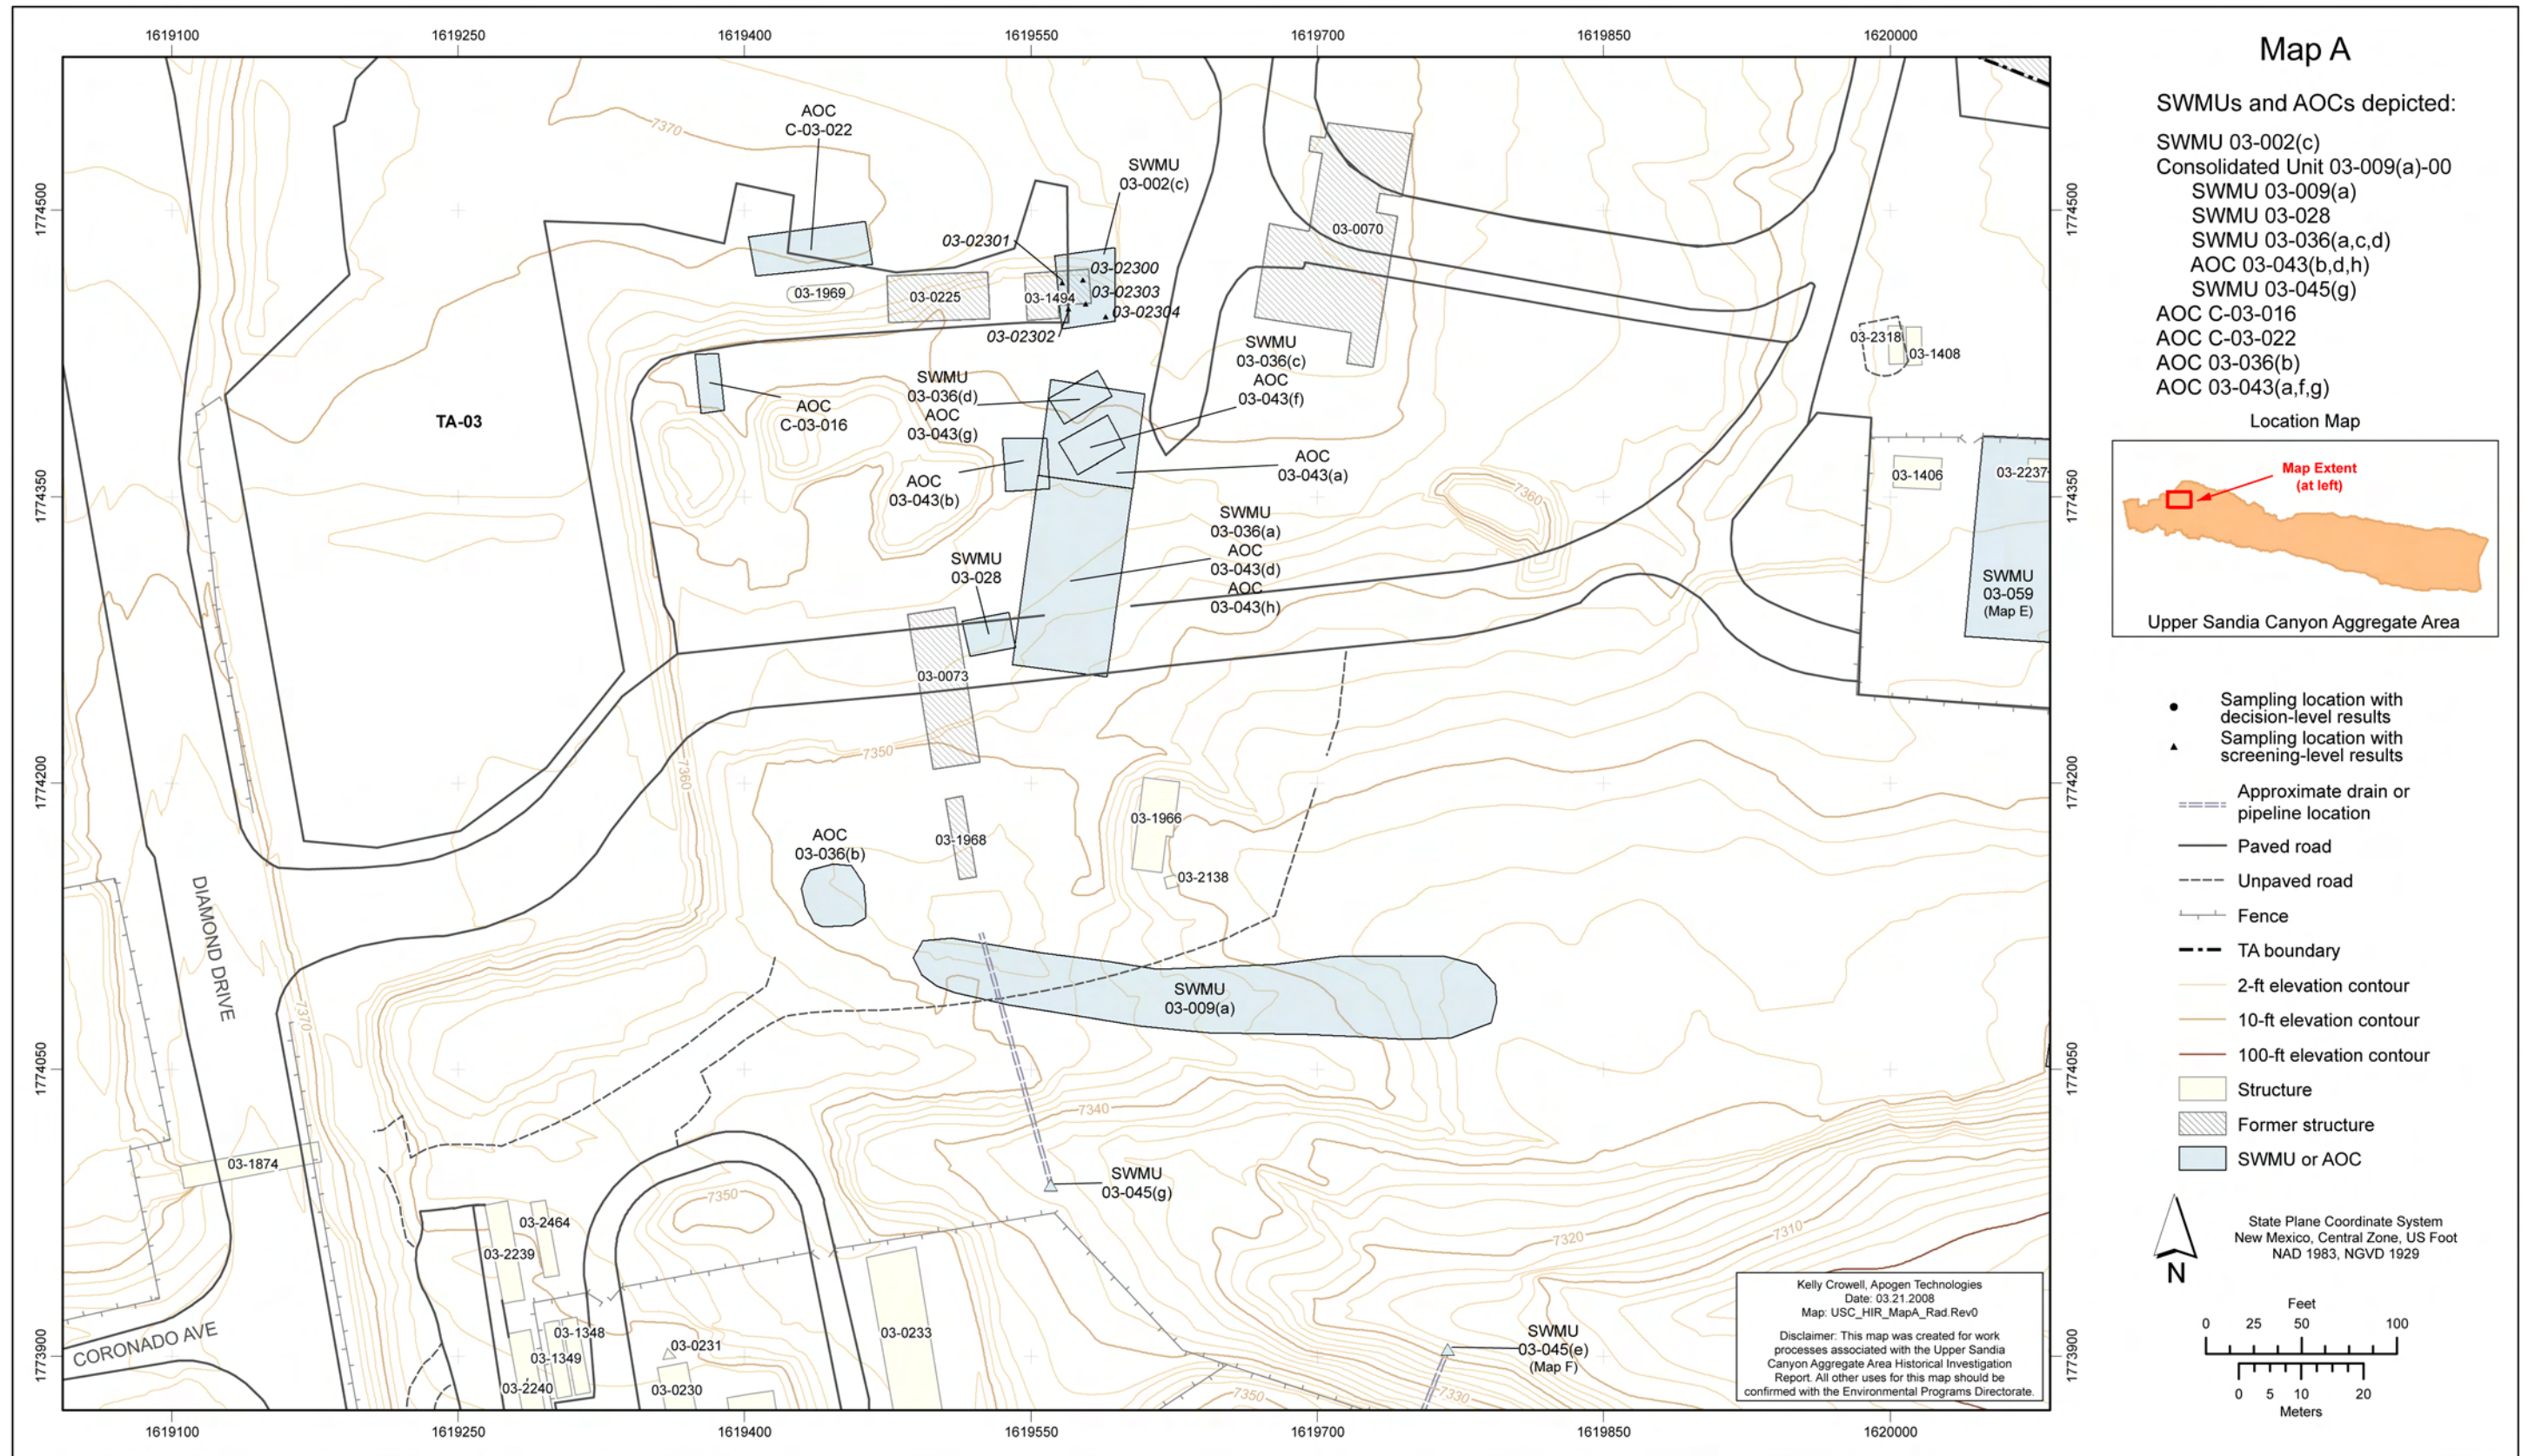


Figure 2.1-4 Map A radionuclide sampling locations



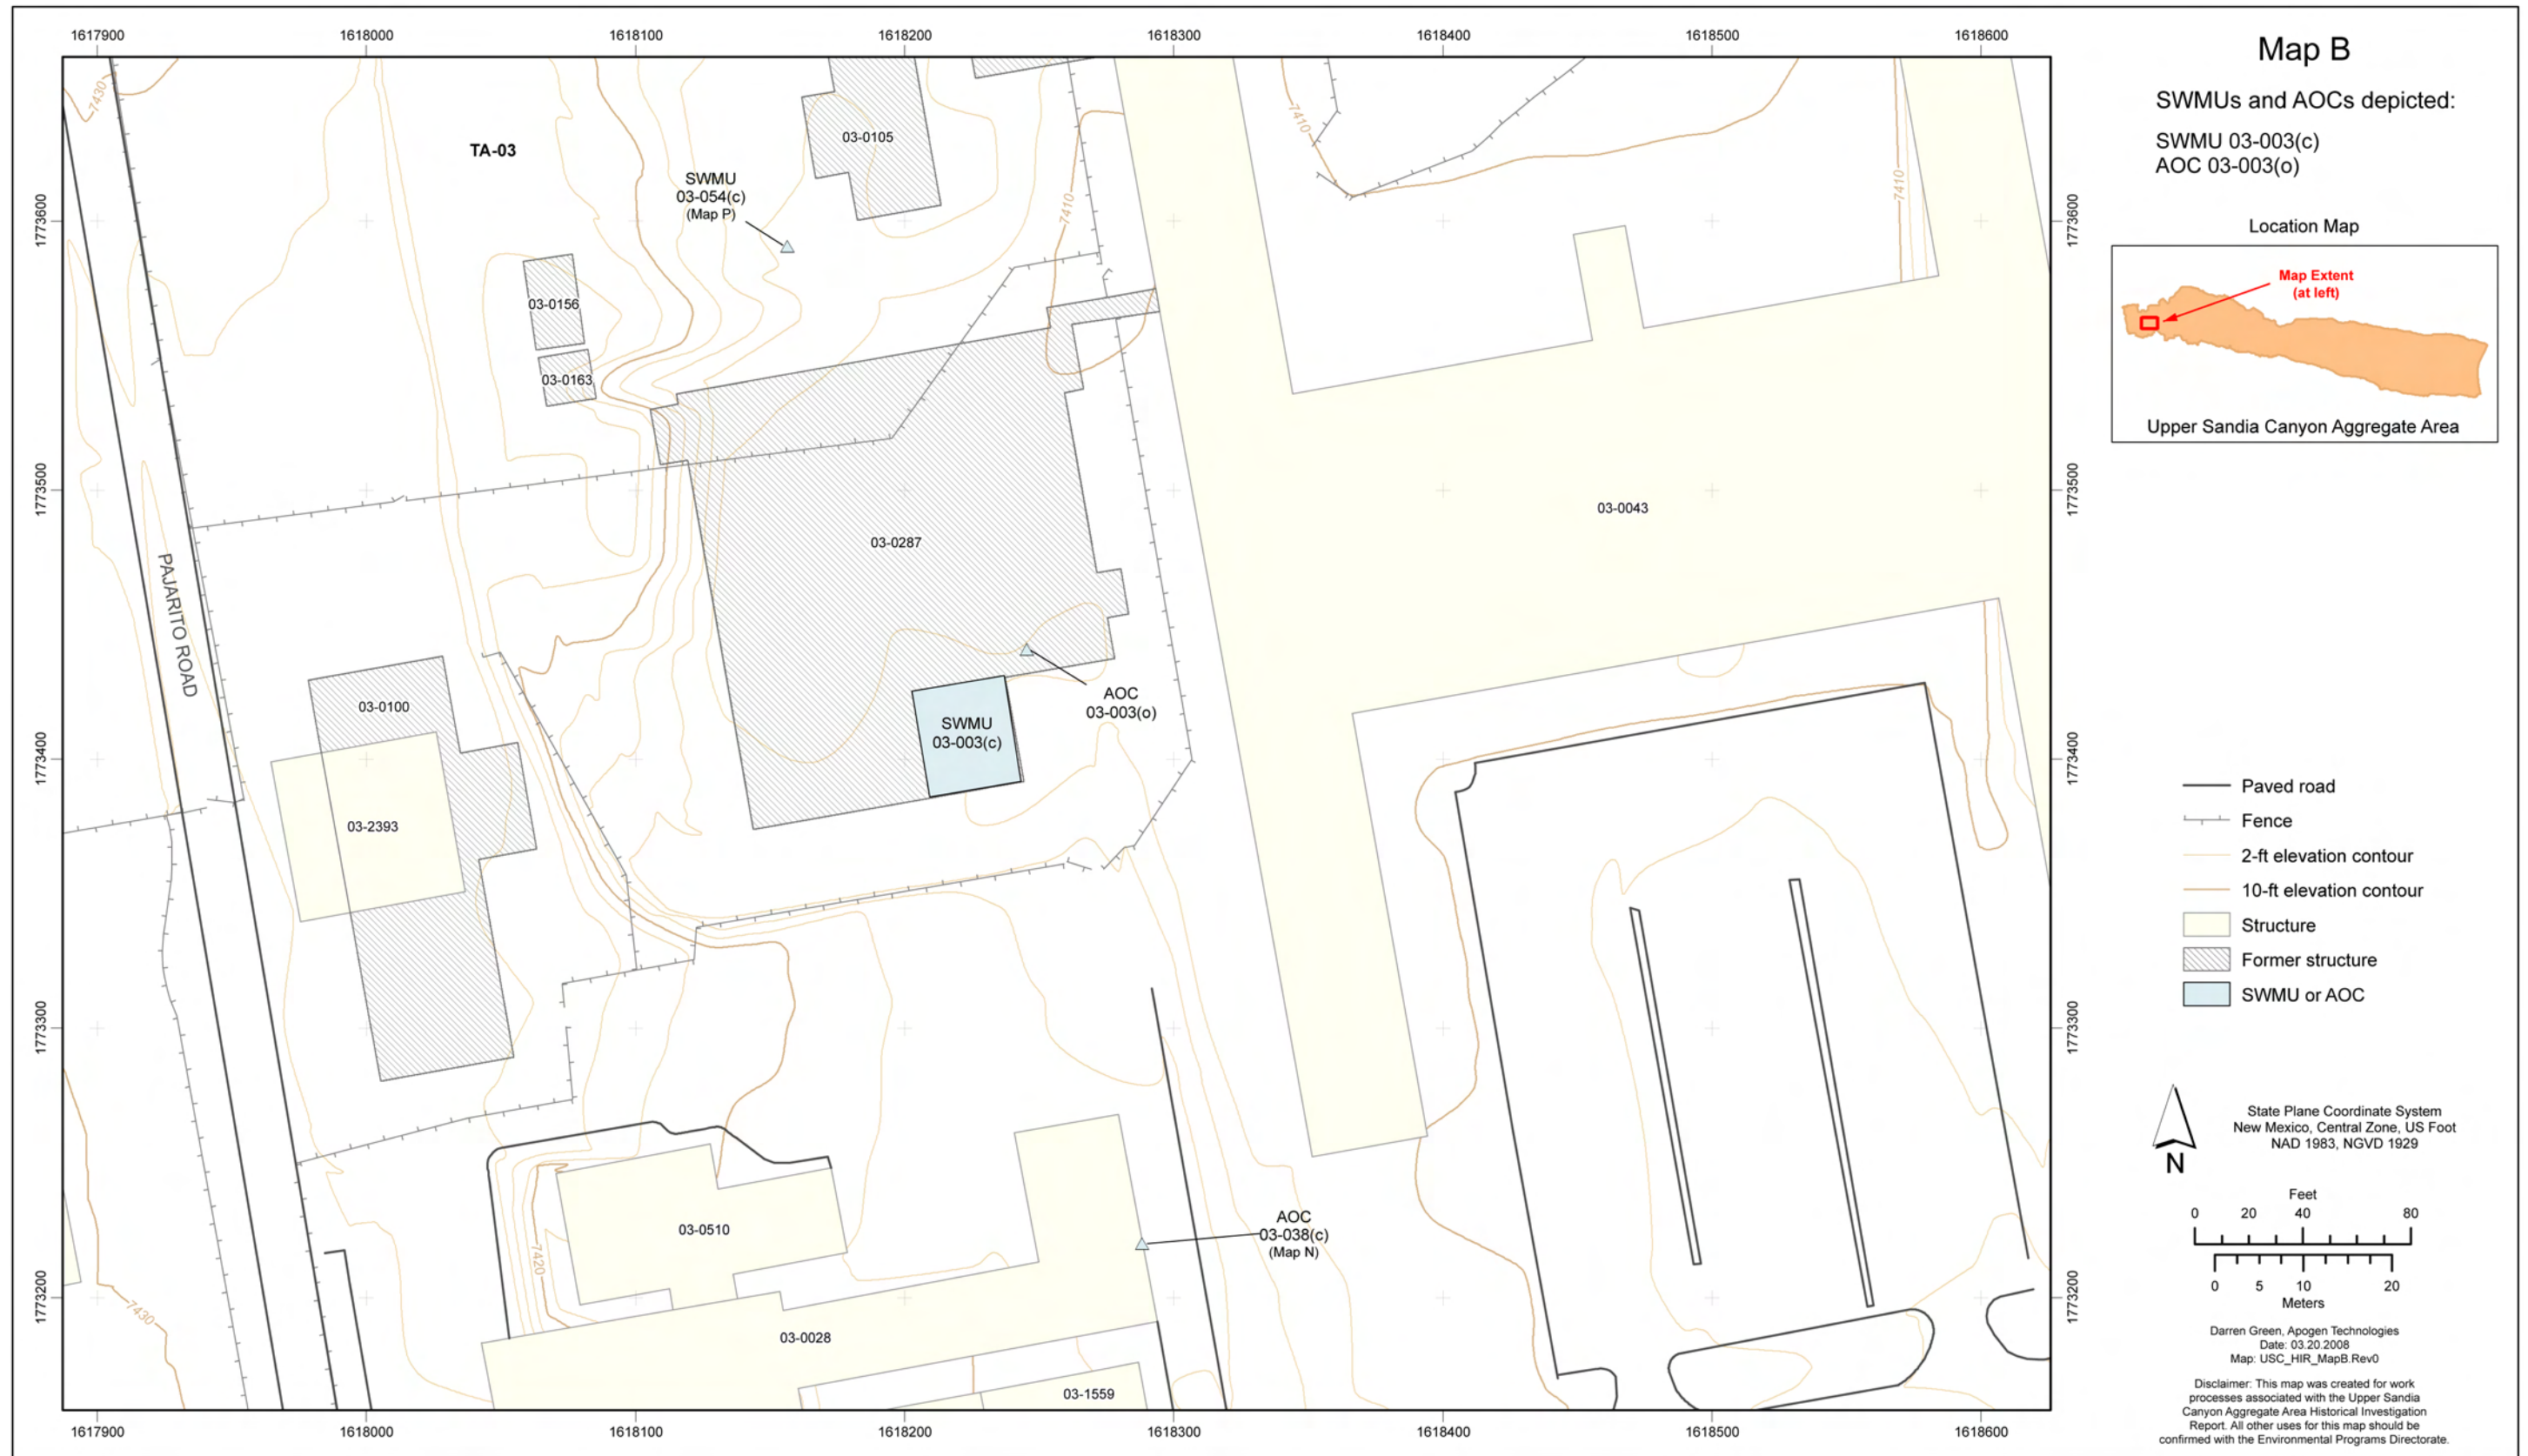


Figure 2.2-1 Map B site location



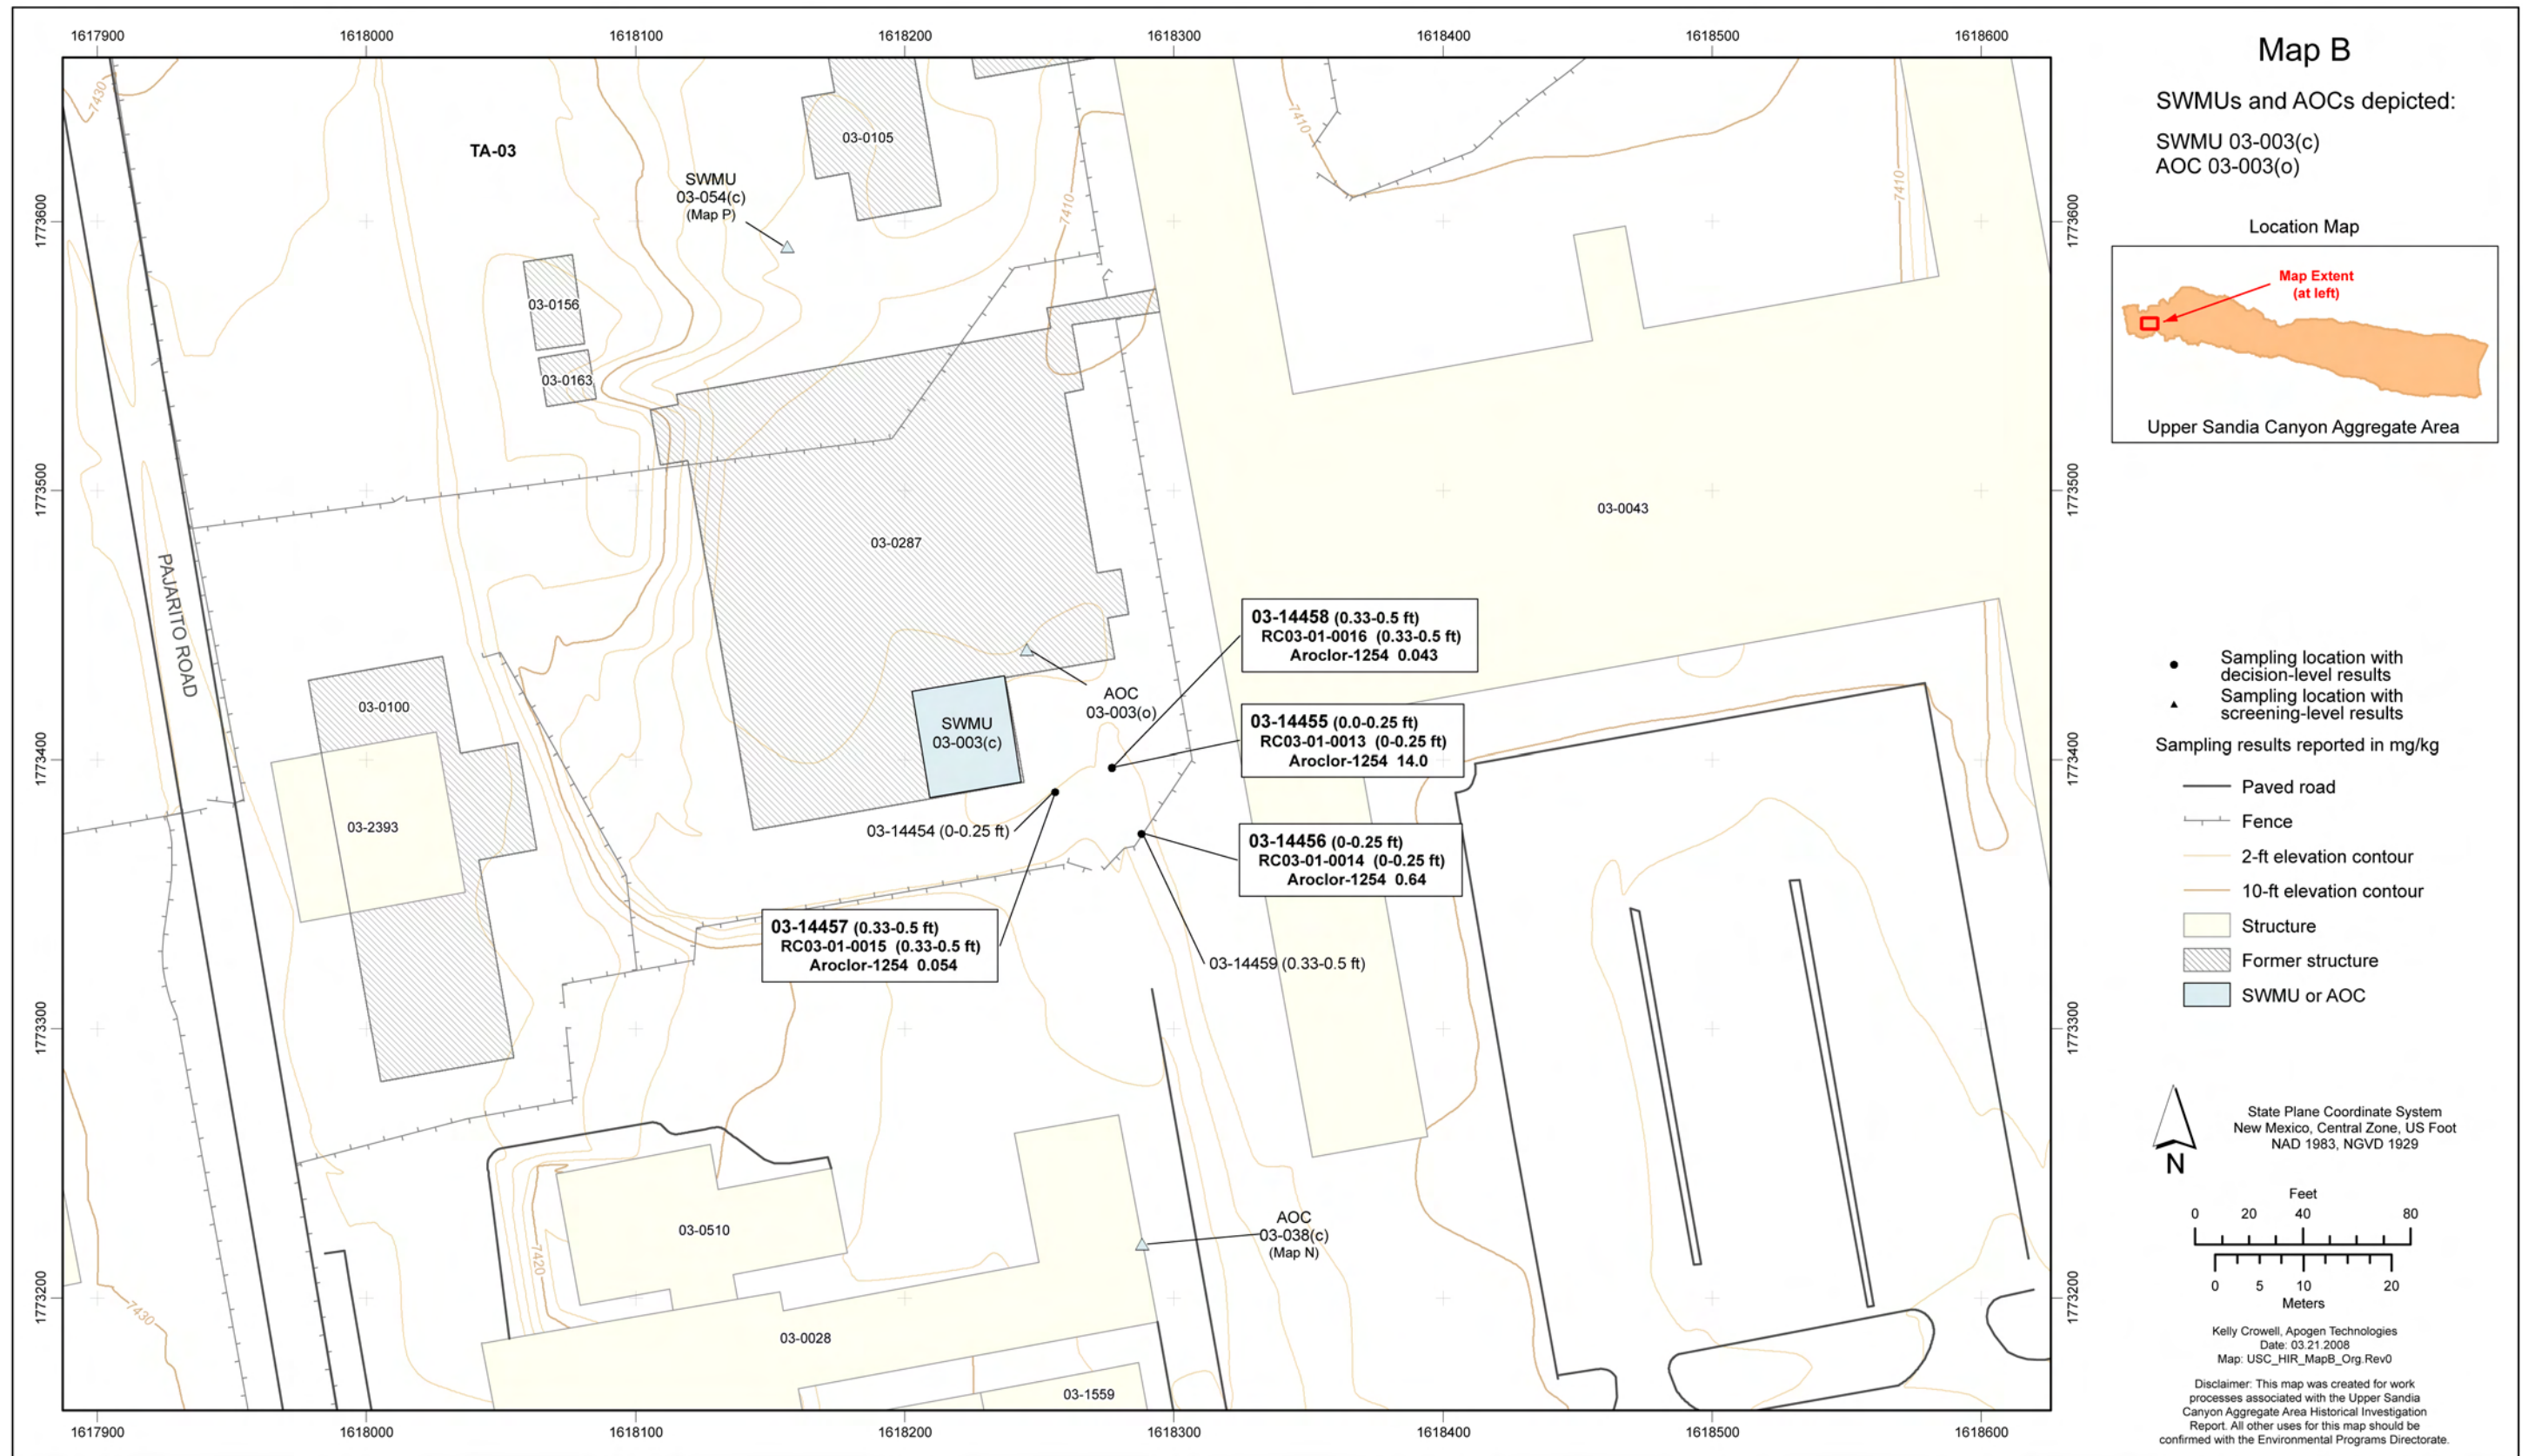


Figure 2.2-2 Map B organic chemical sampling locations and detected results



Figure 2.3-1 Map C site location



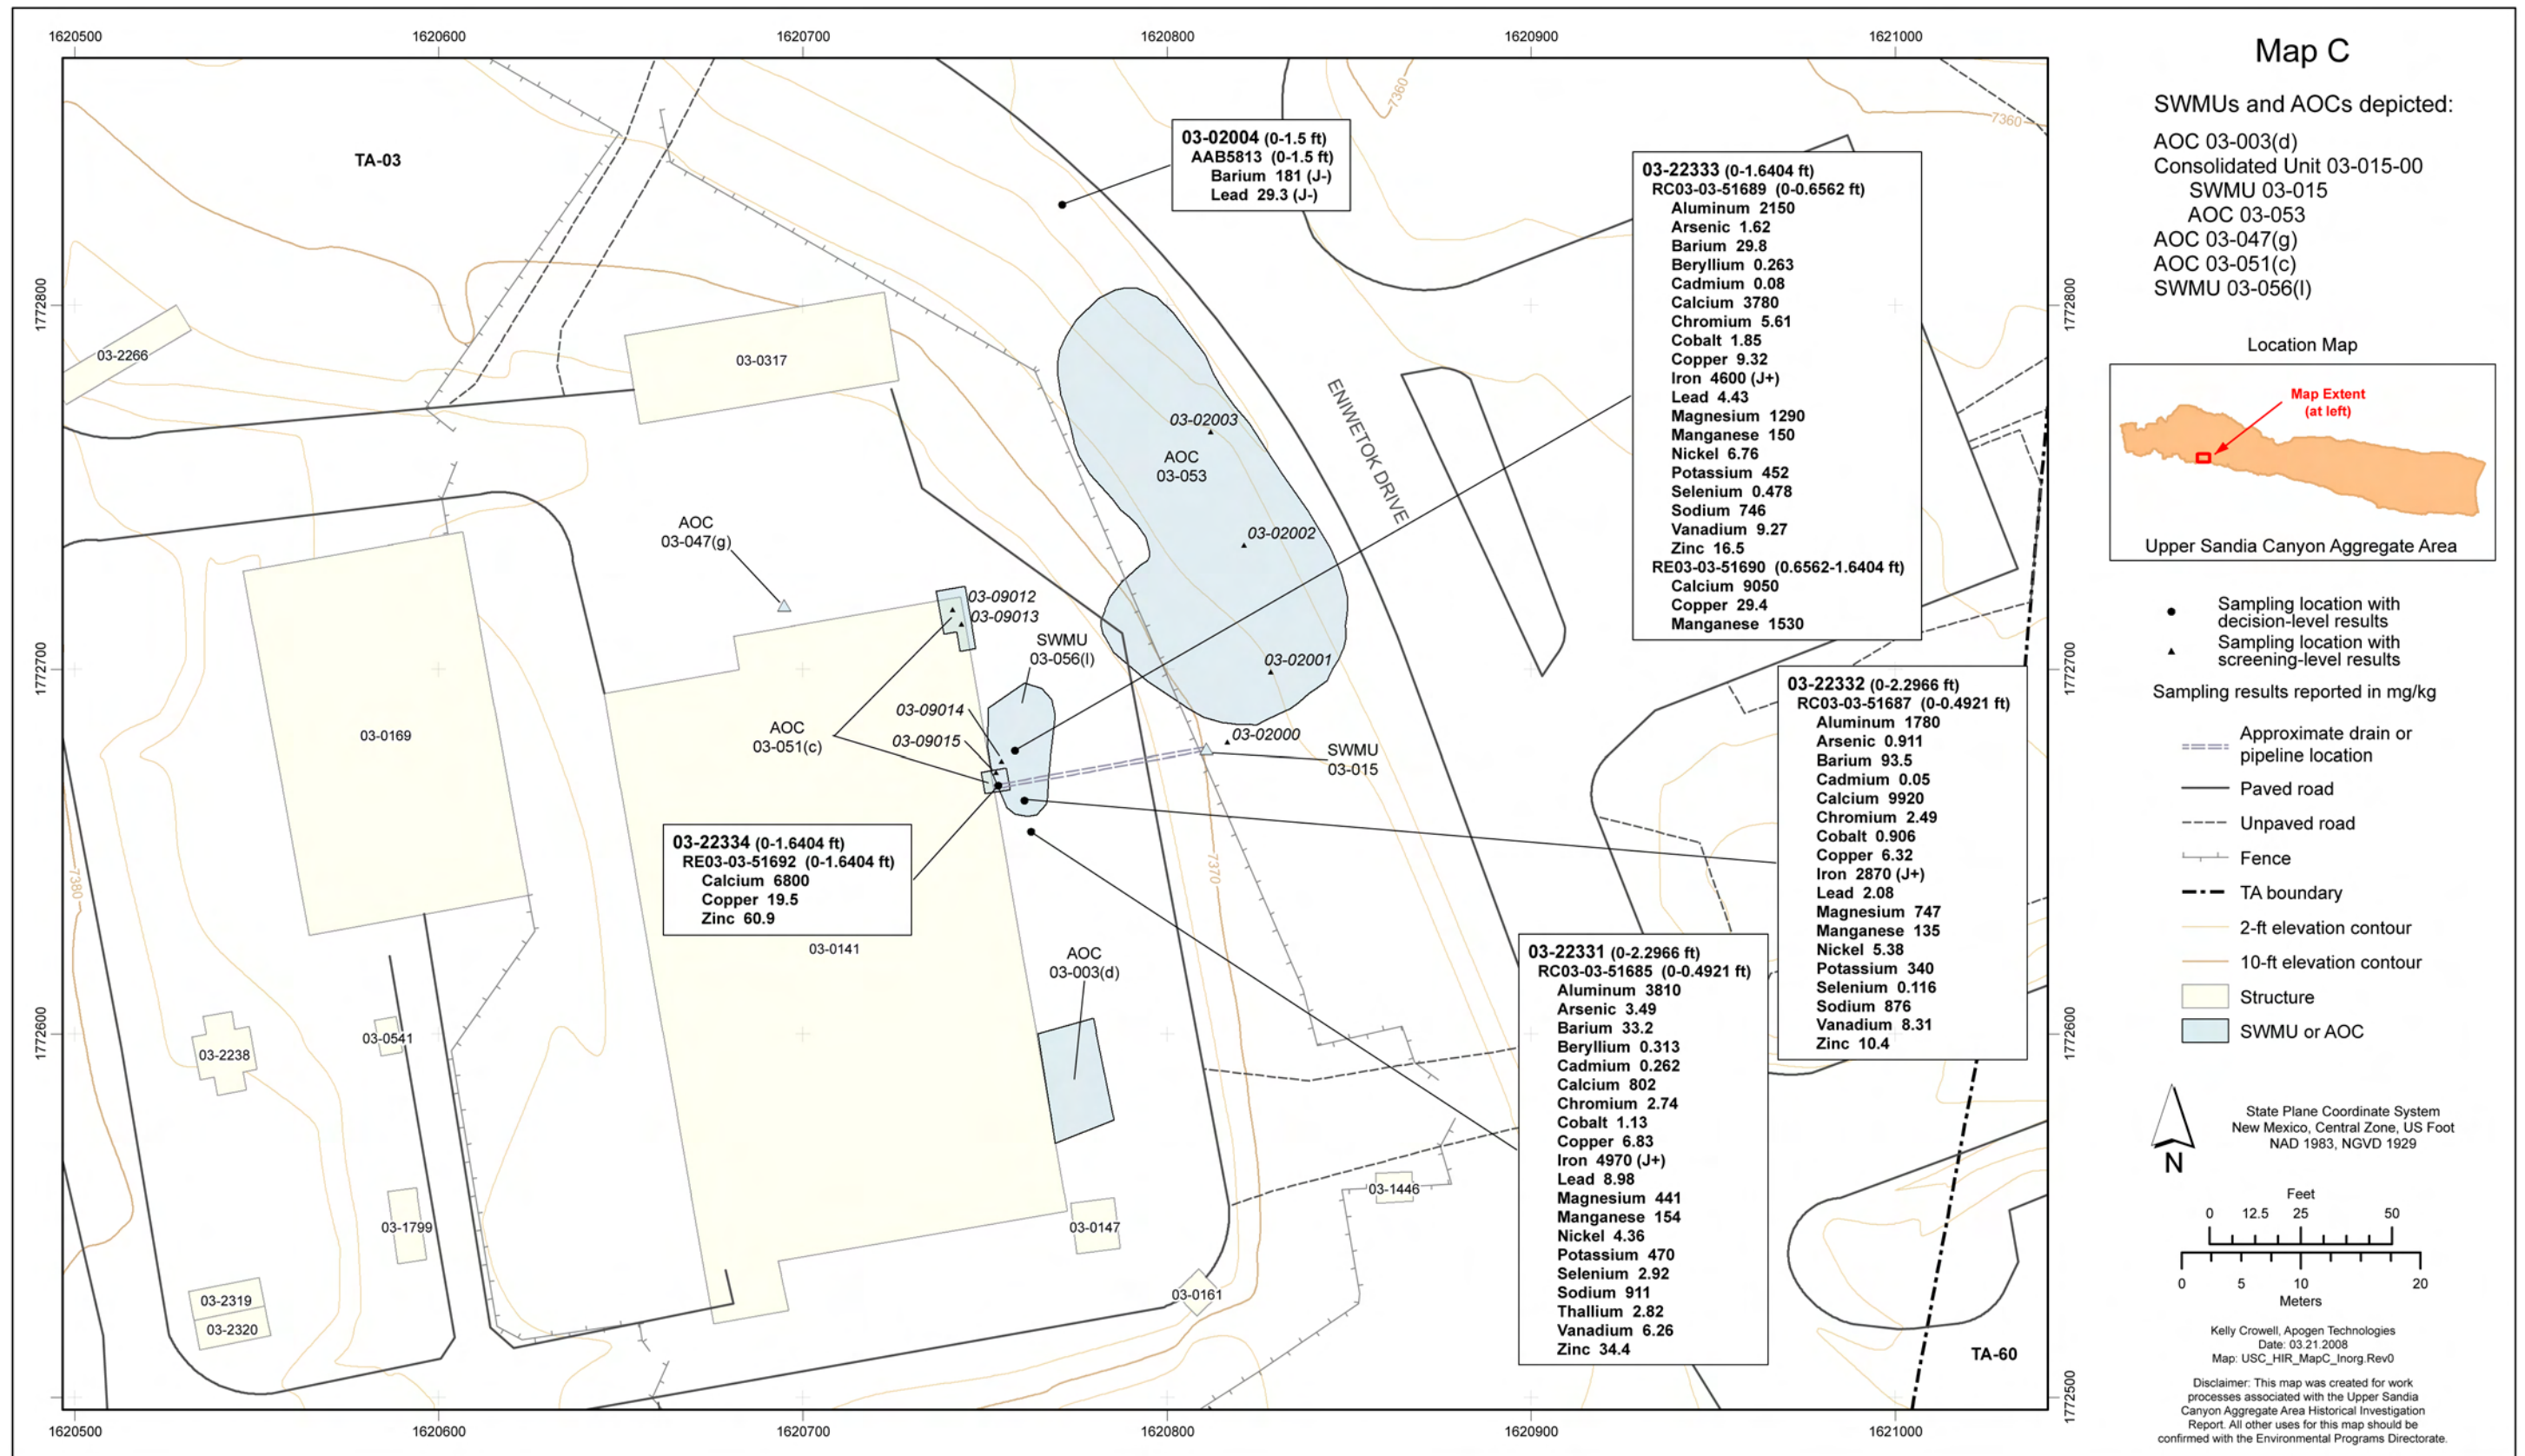


Figure 2.3-2 Map C inorganic chemical sampling locations and results detected above BVs



Figure 2.3-3 Map C organic chemical sampling locations





Figure 2.3-4 Map C radionuclide sampling locations



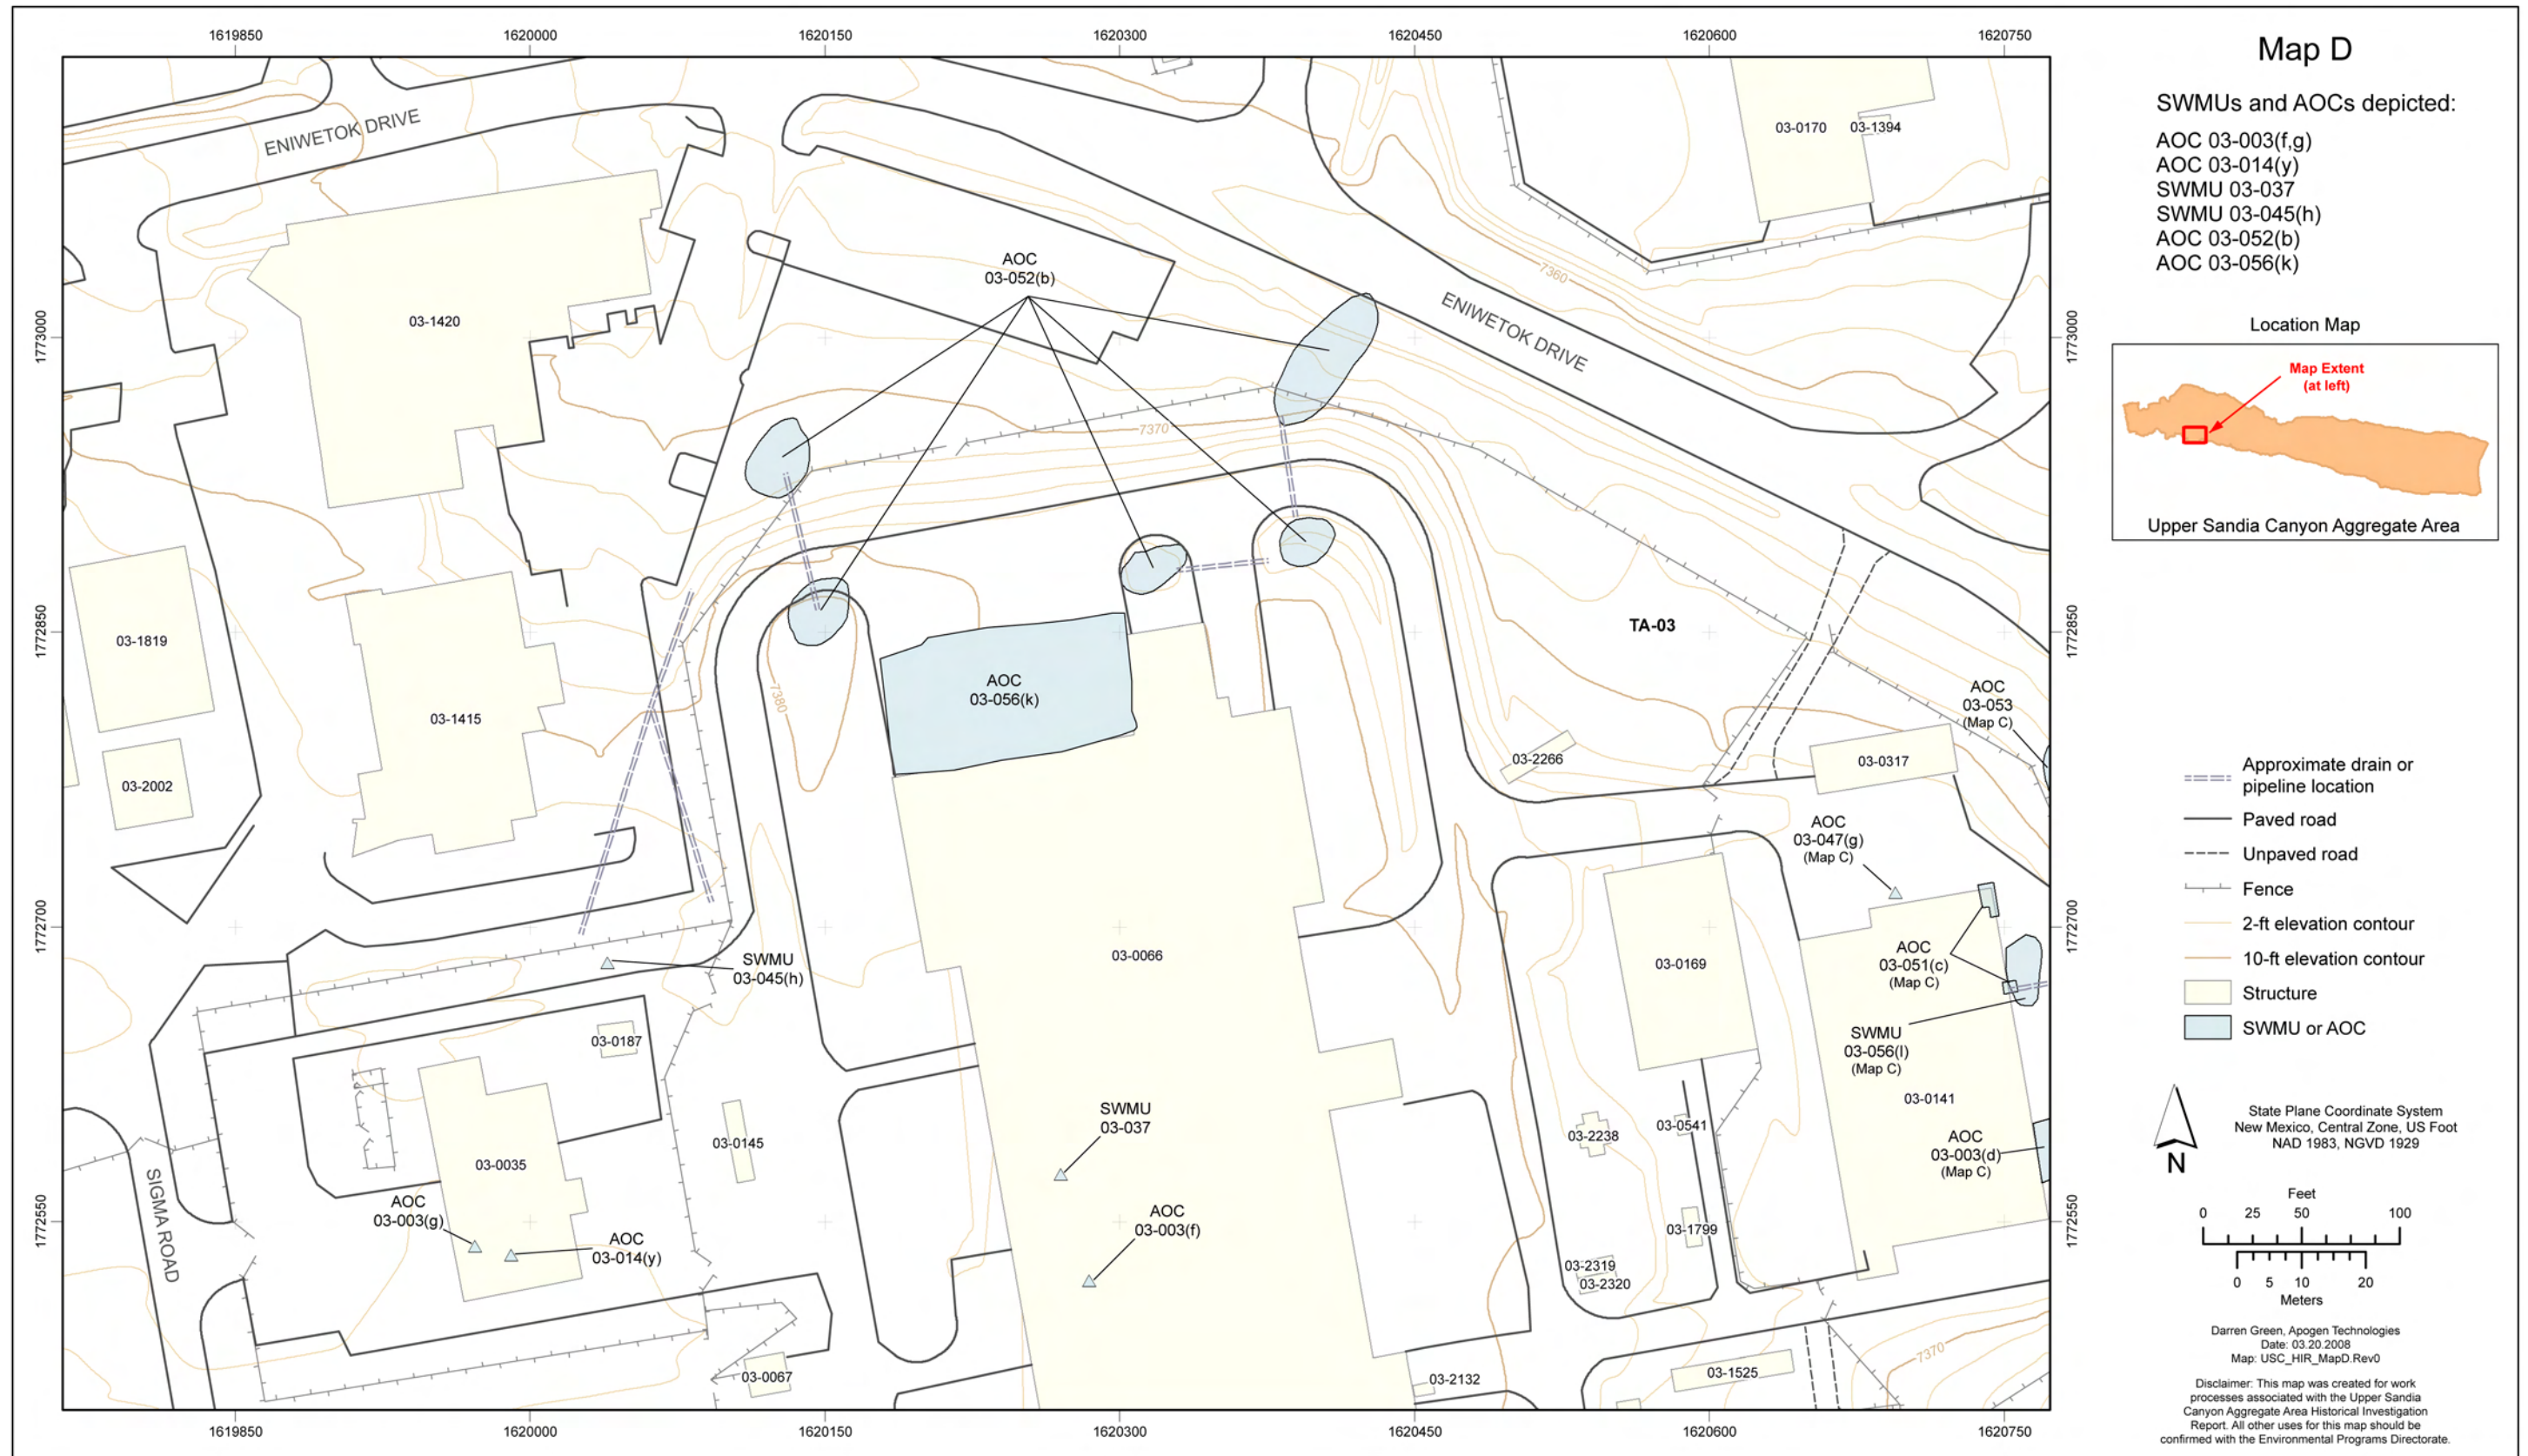


Figure 2.4-1 Map D site location



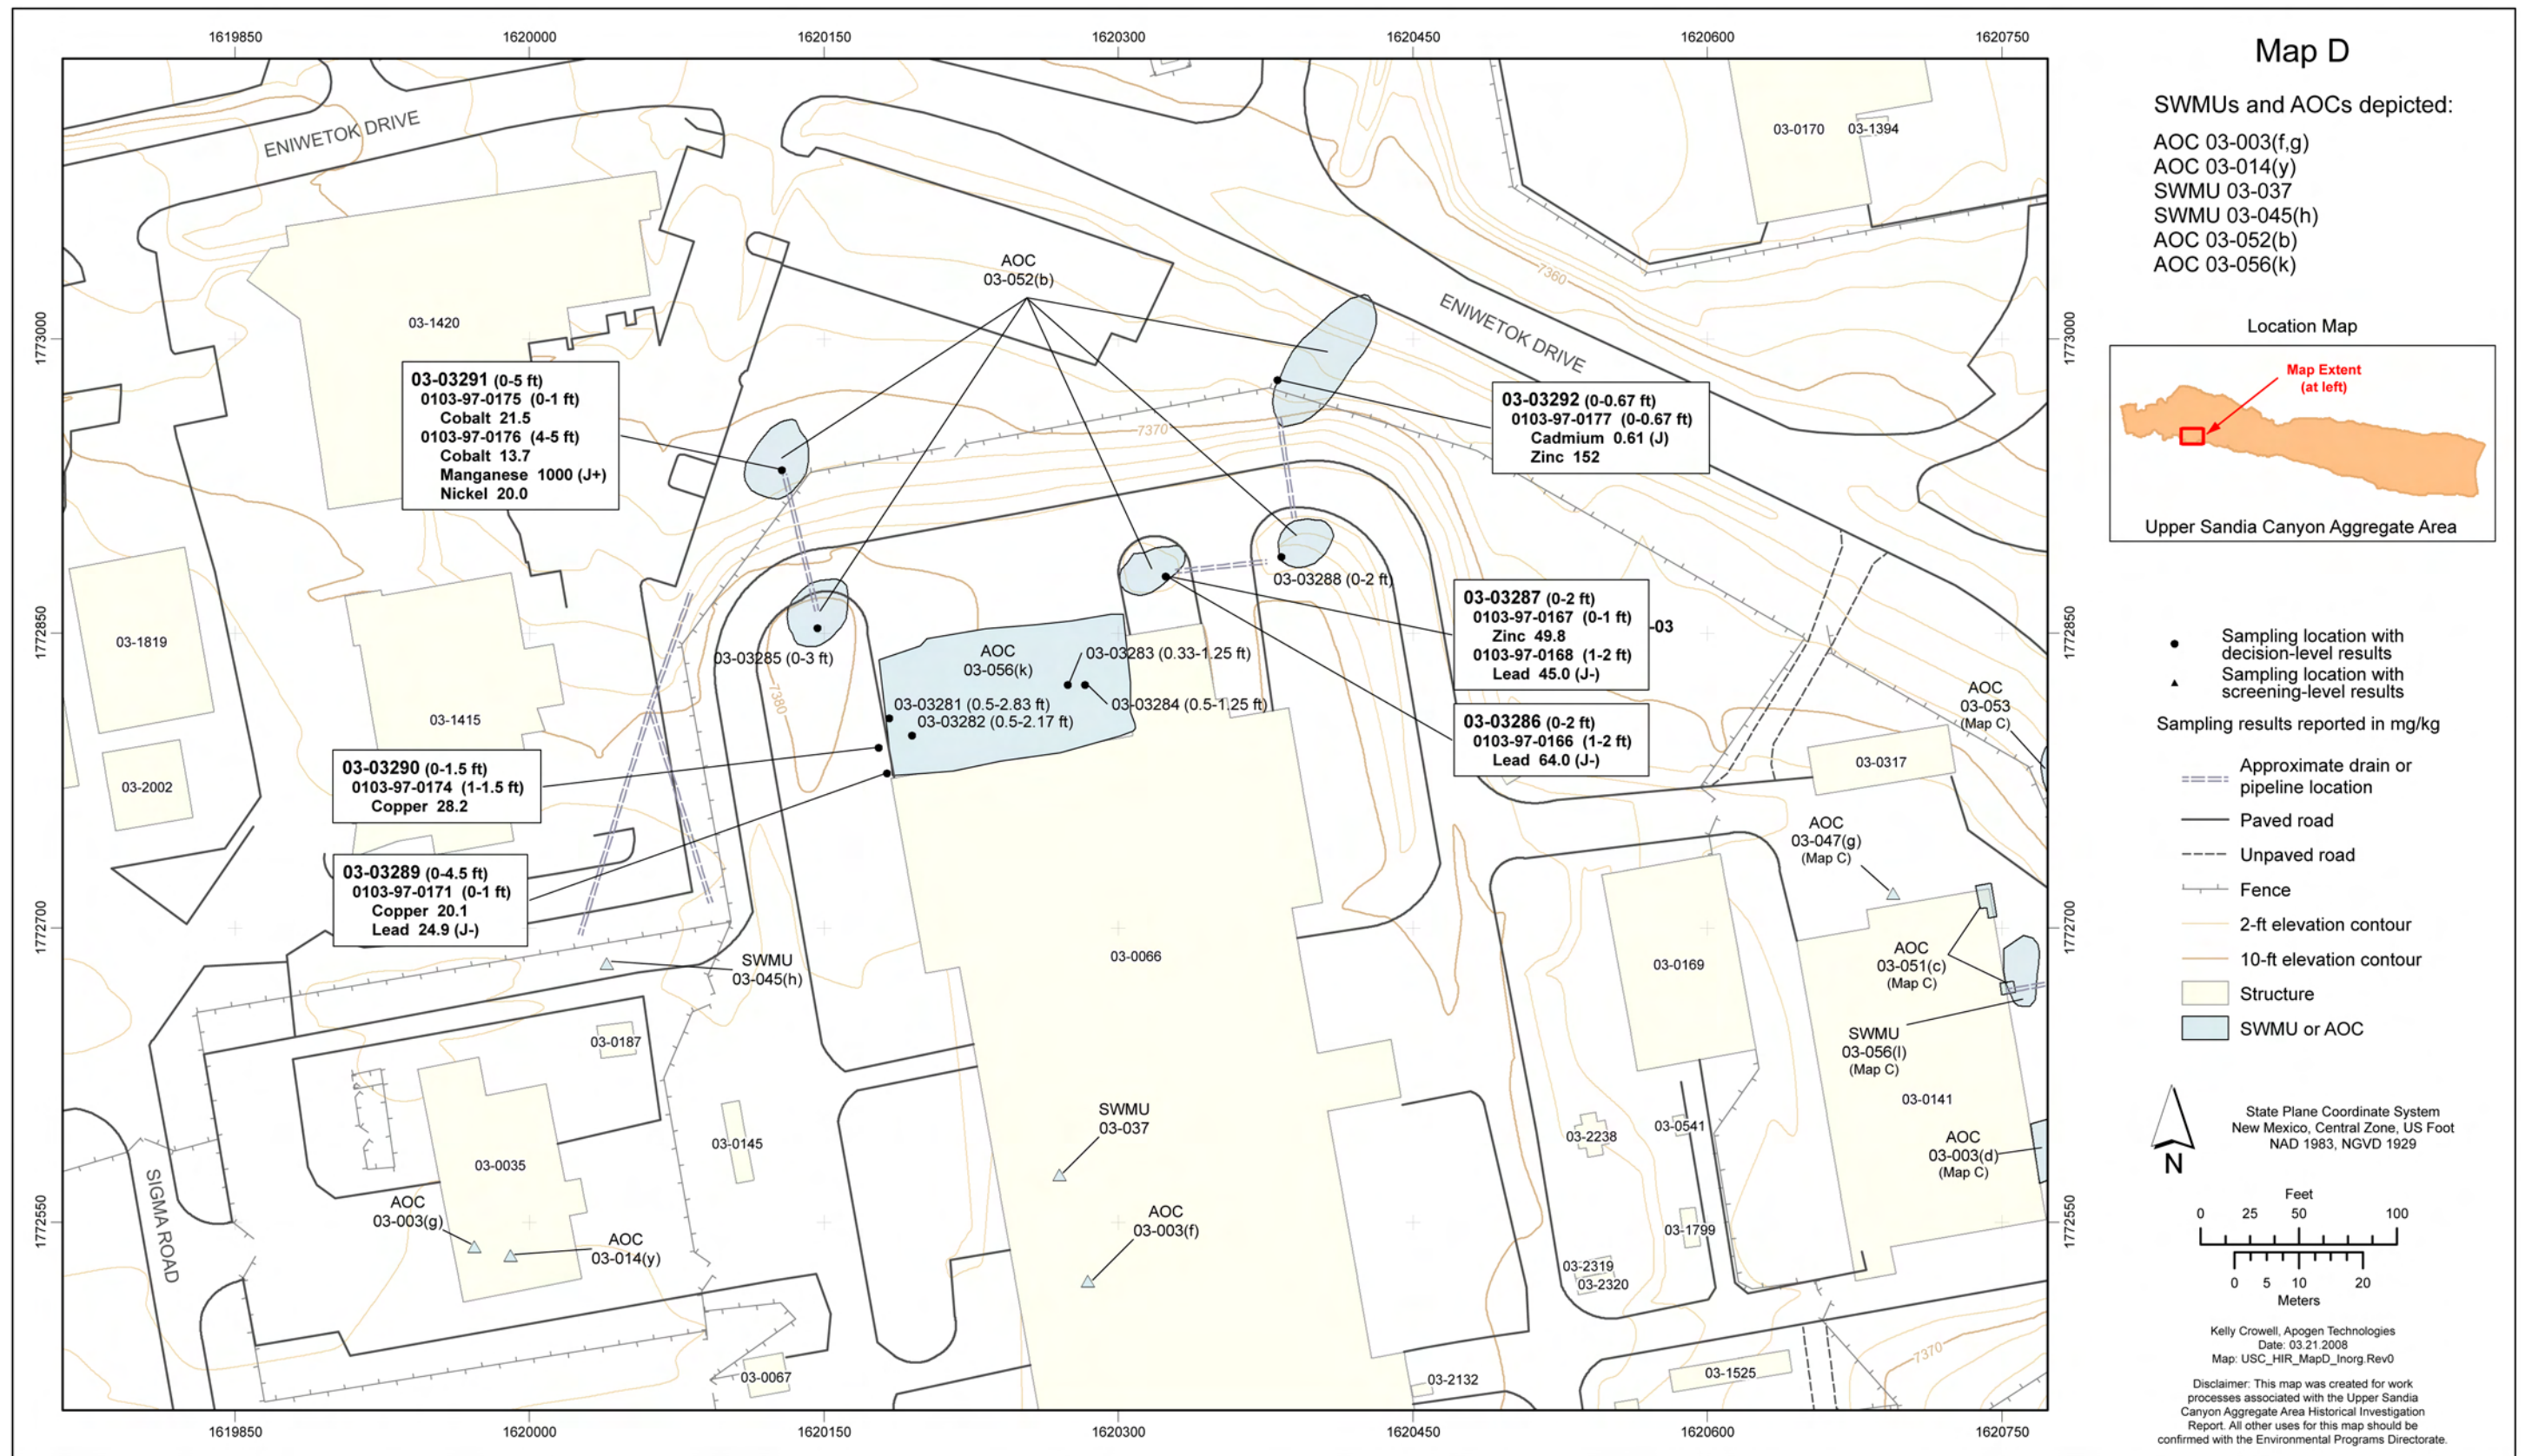


Figure 2.4-2 Map D inorganic chemical sampling locations and results detected above BVs



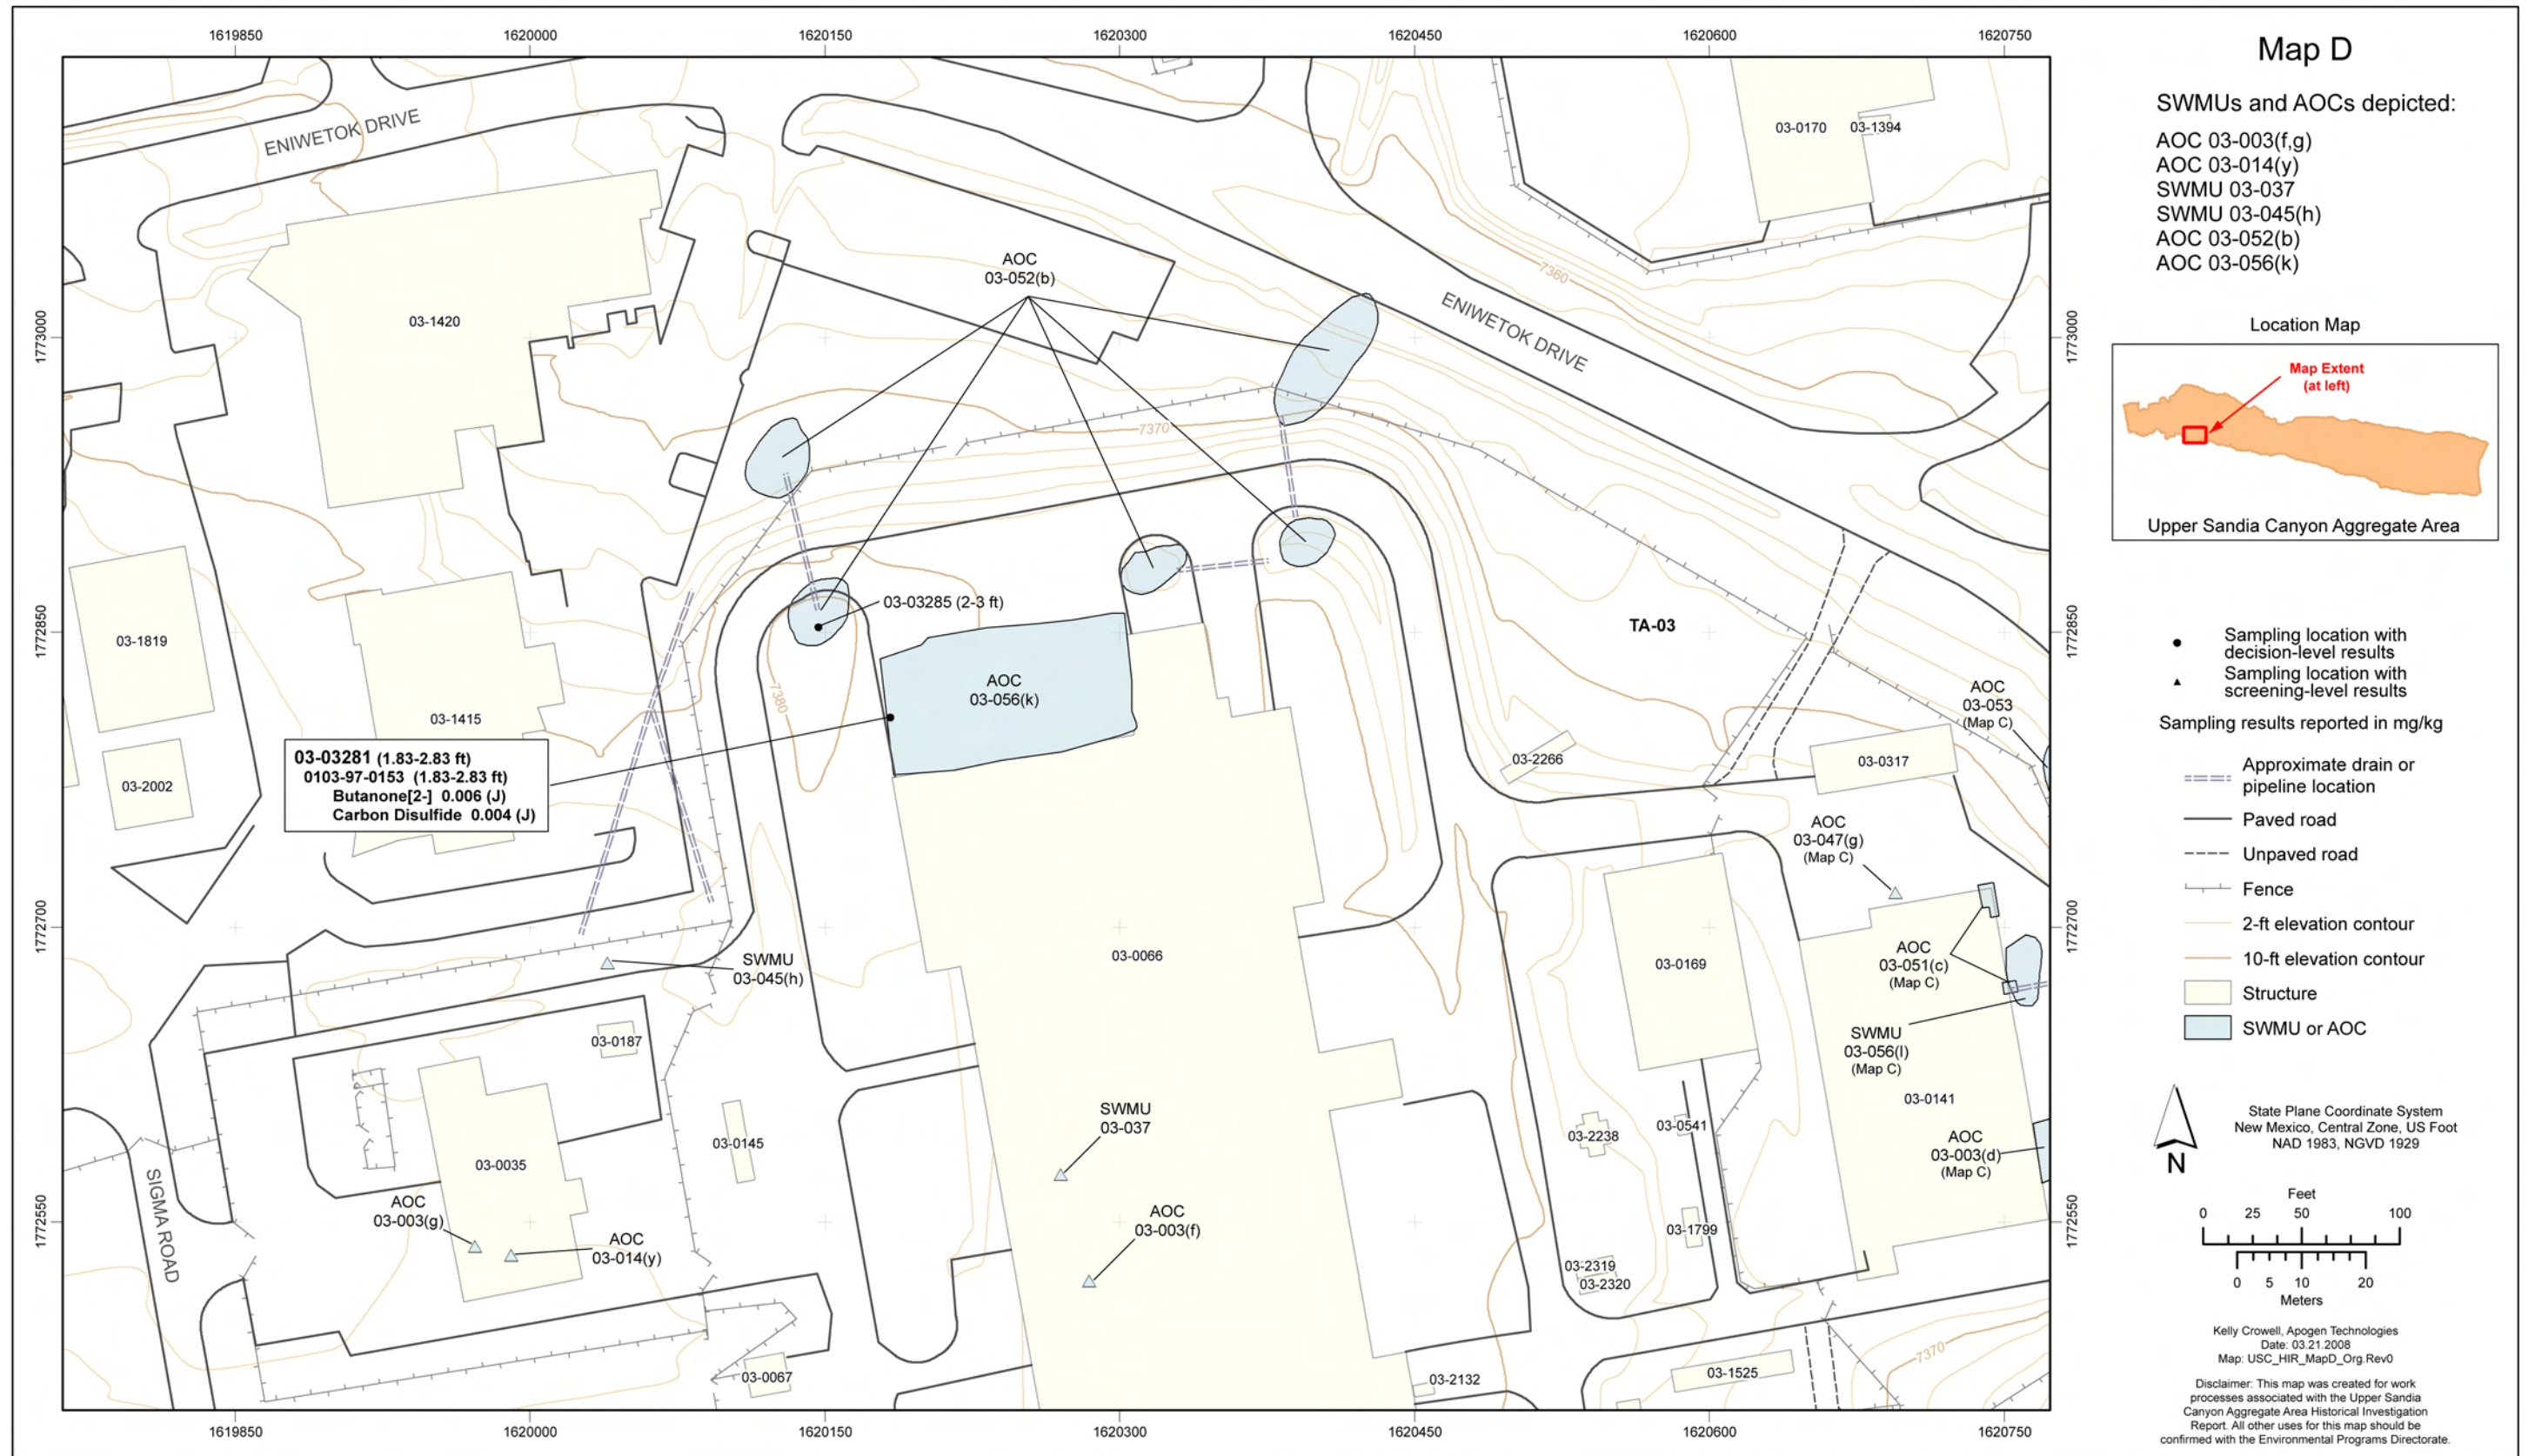


Figure 2.4-3 Map D organic chemical sampling locations and detected results



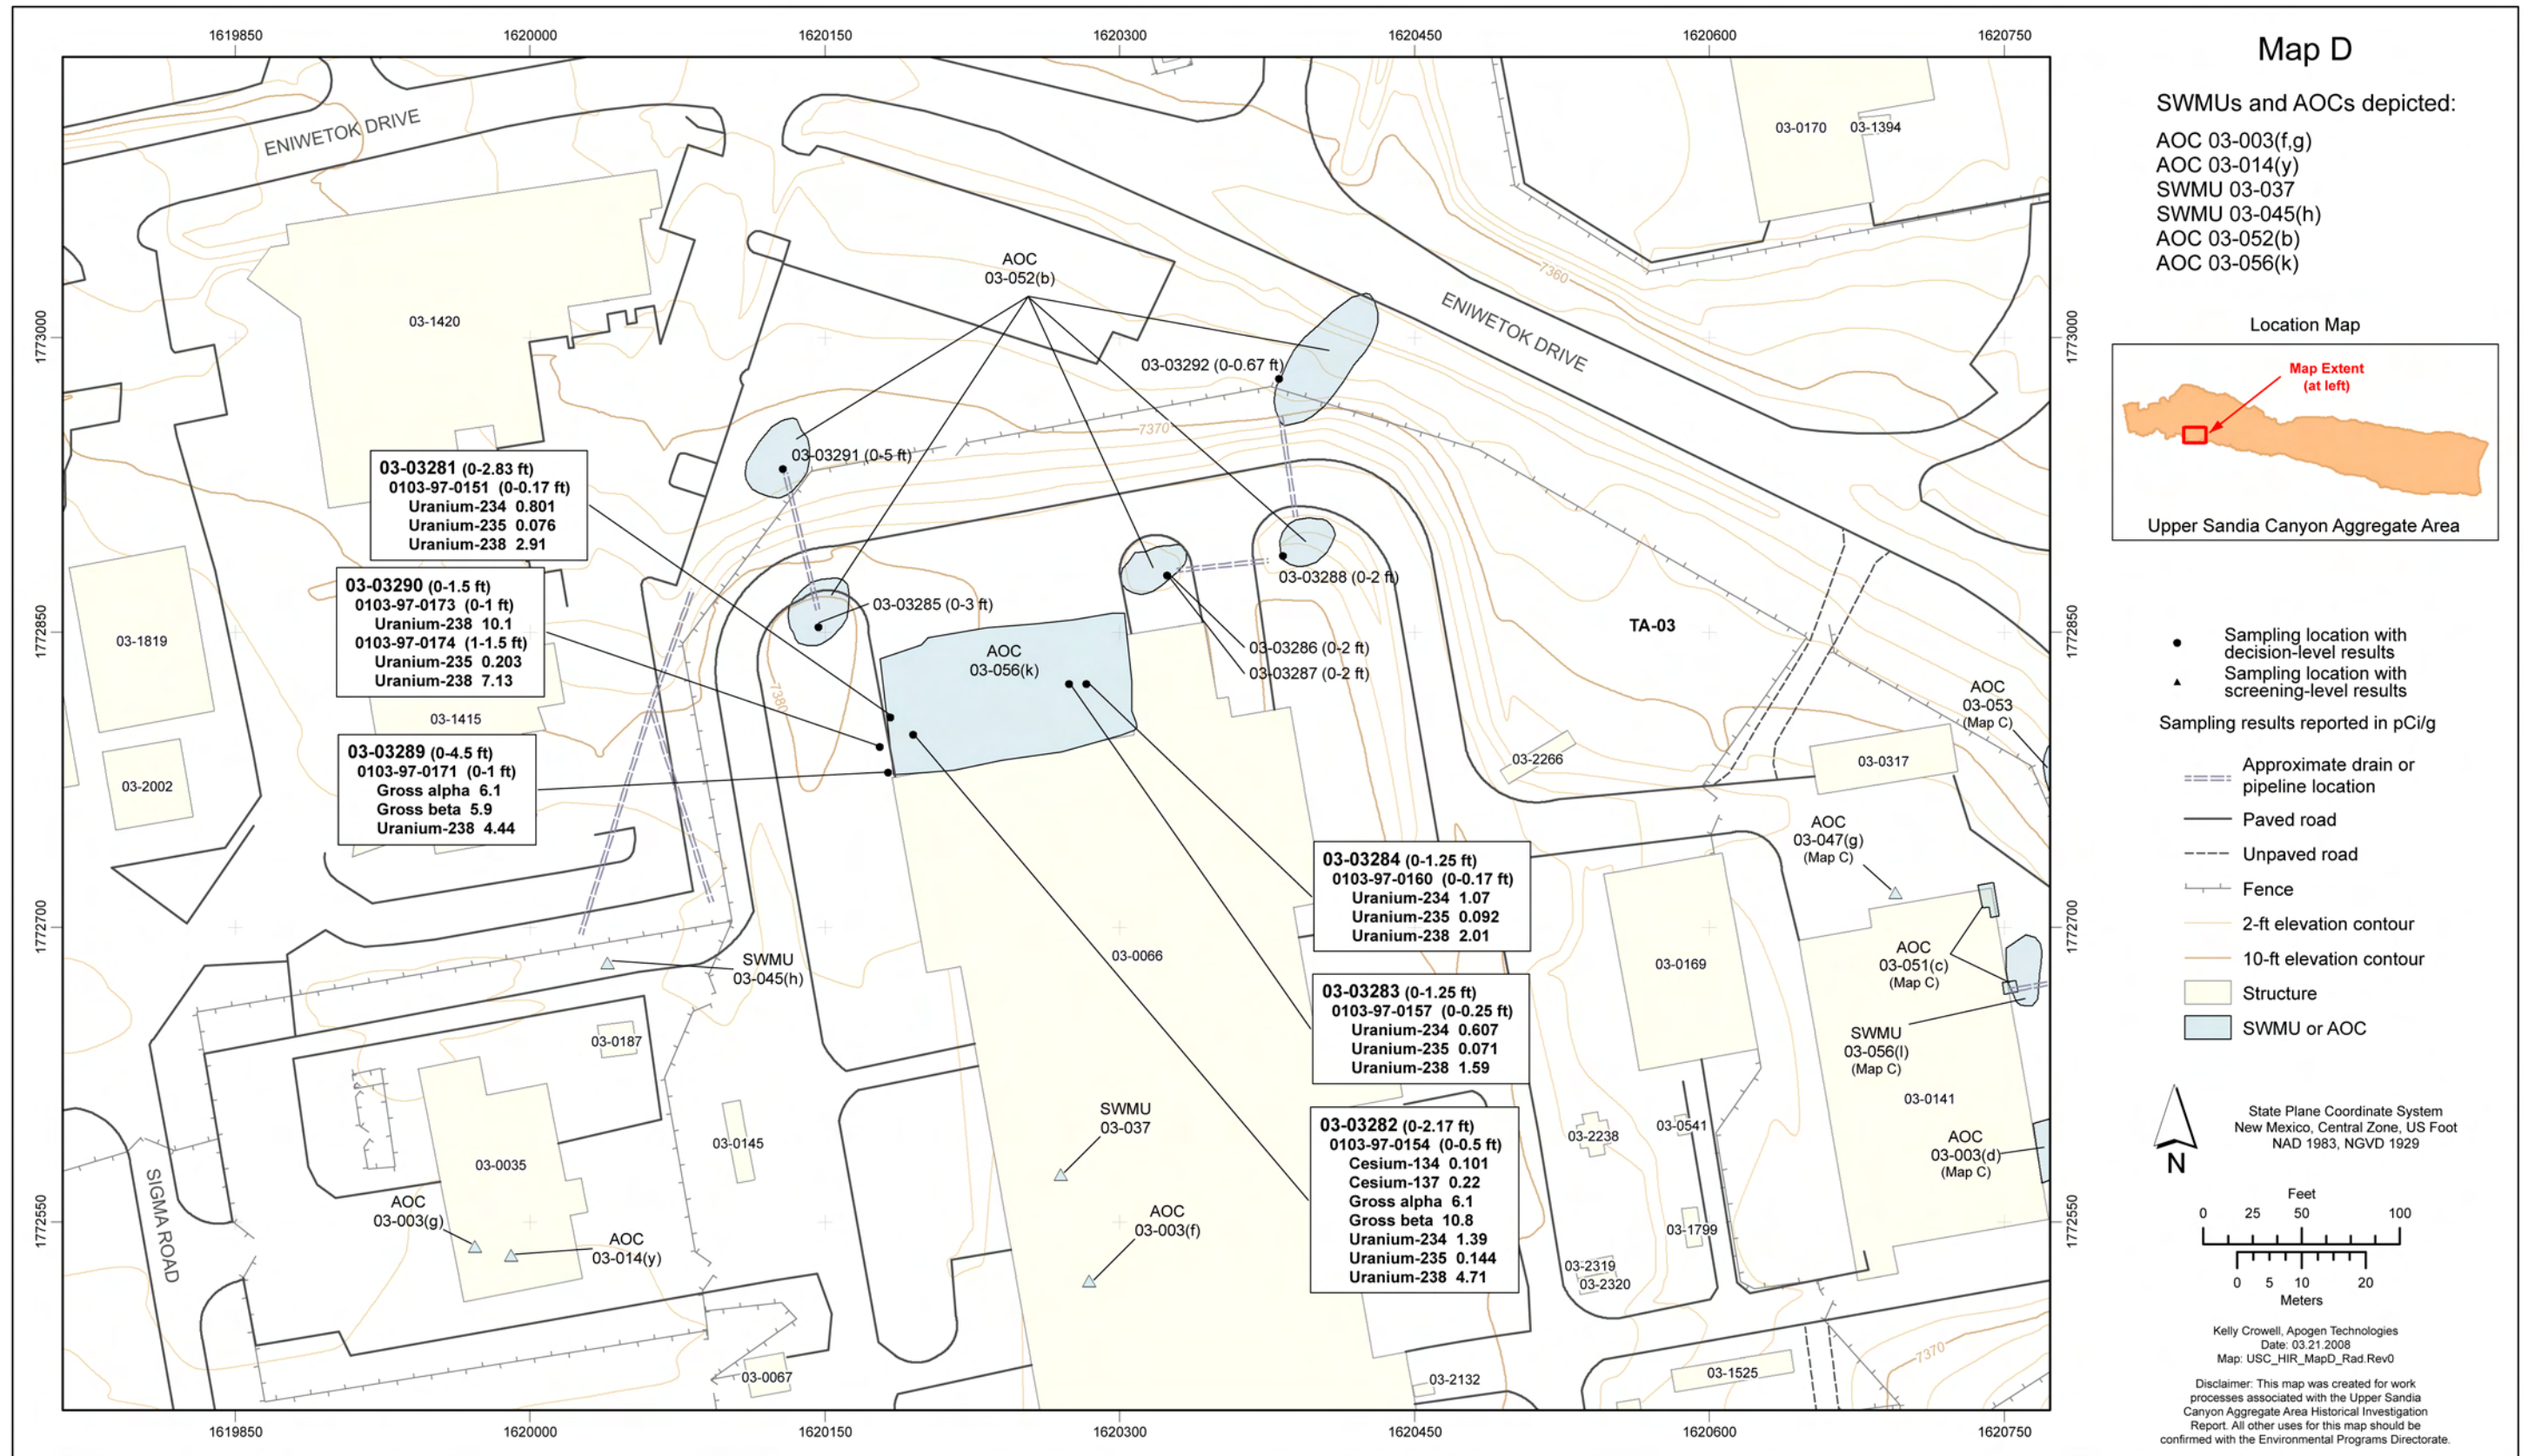


Figure 2.4-4 Map D radionuclide sampling locations and results detected above FVs/BVs



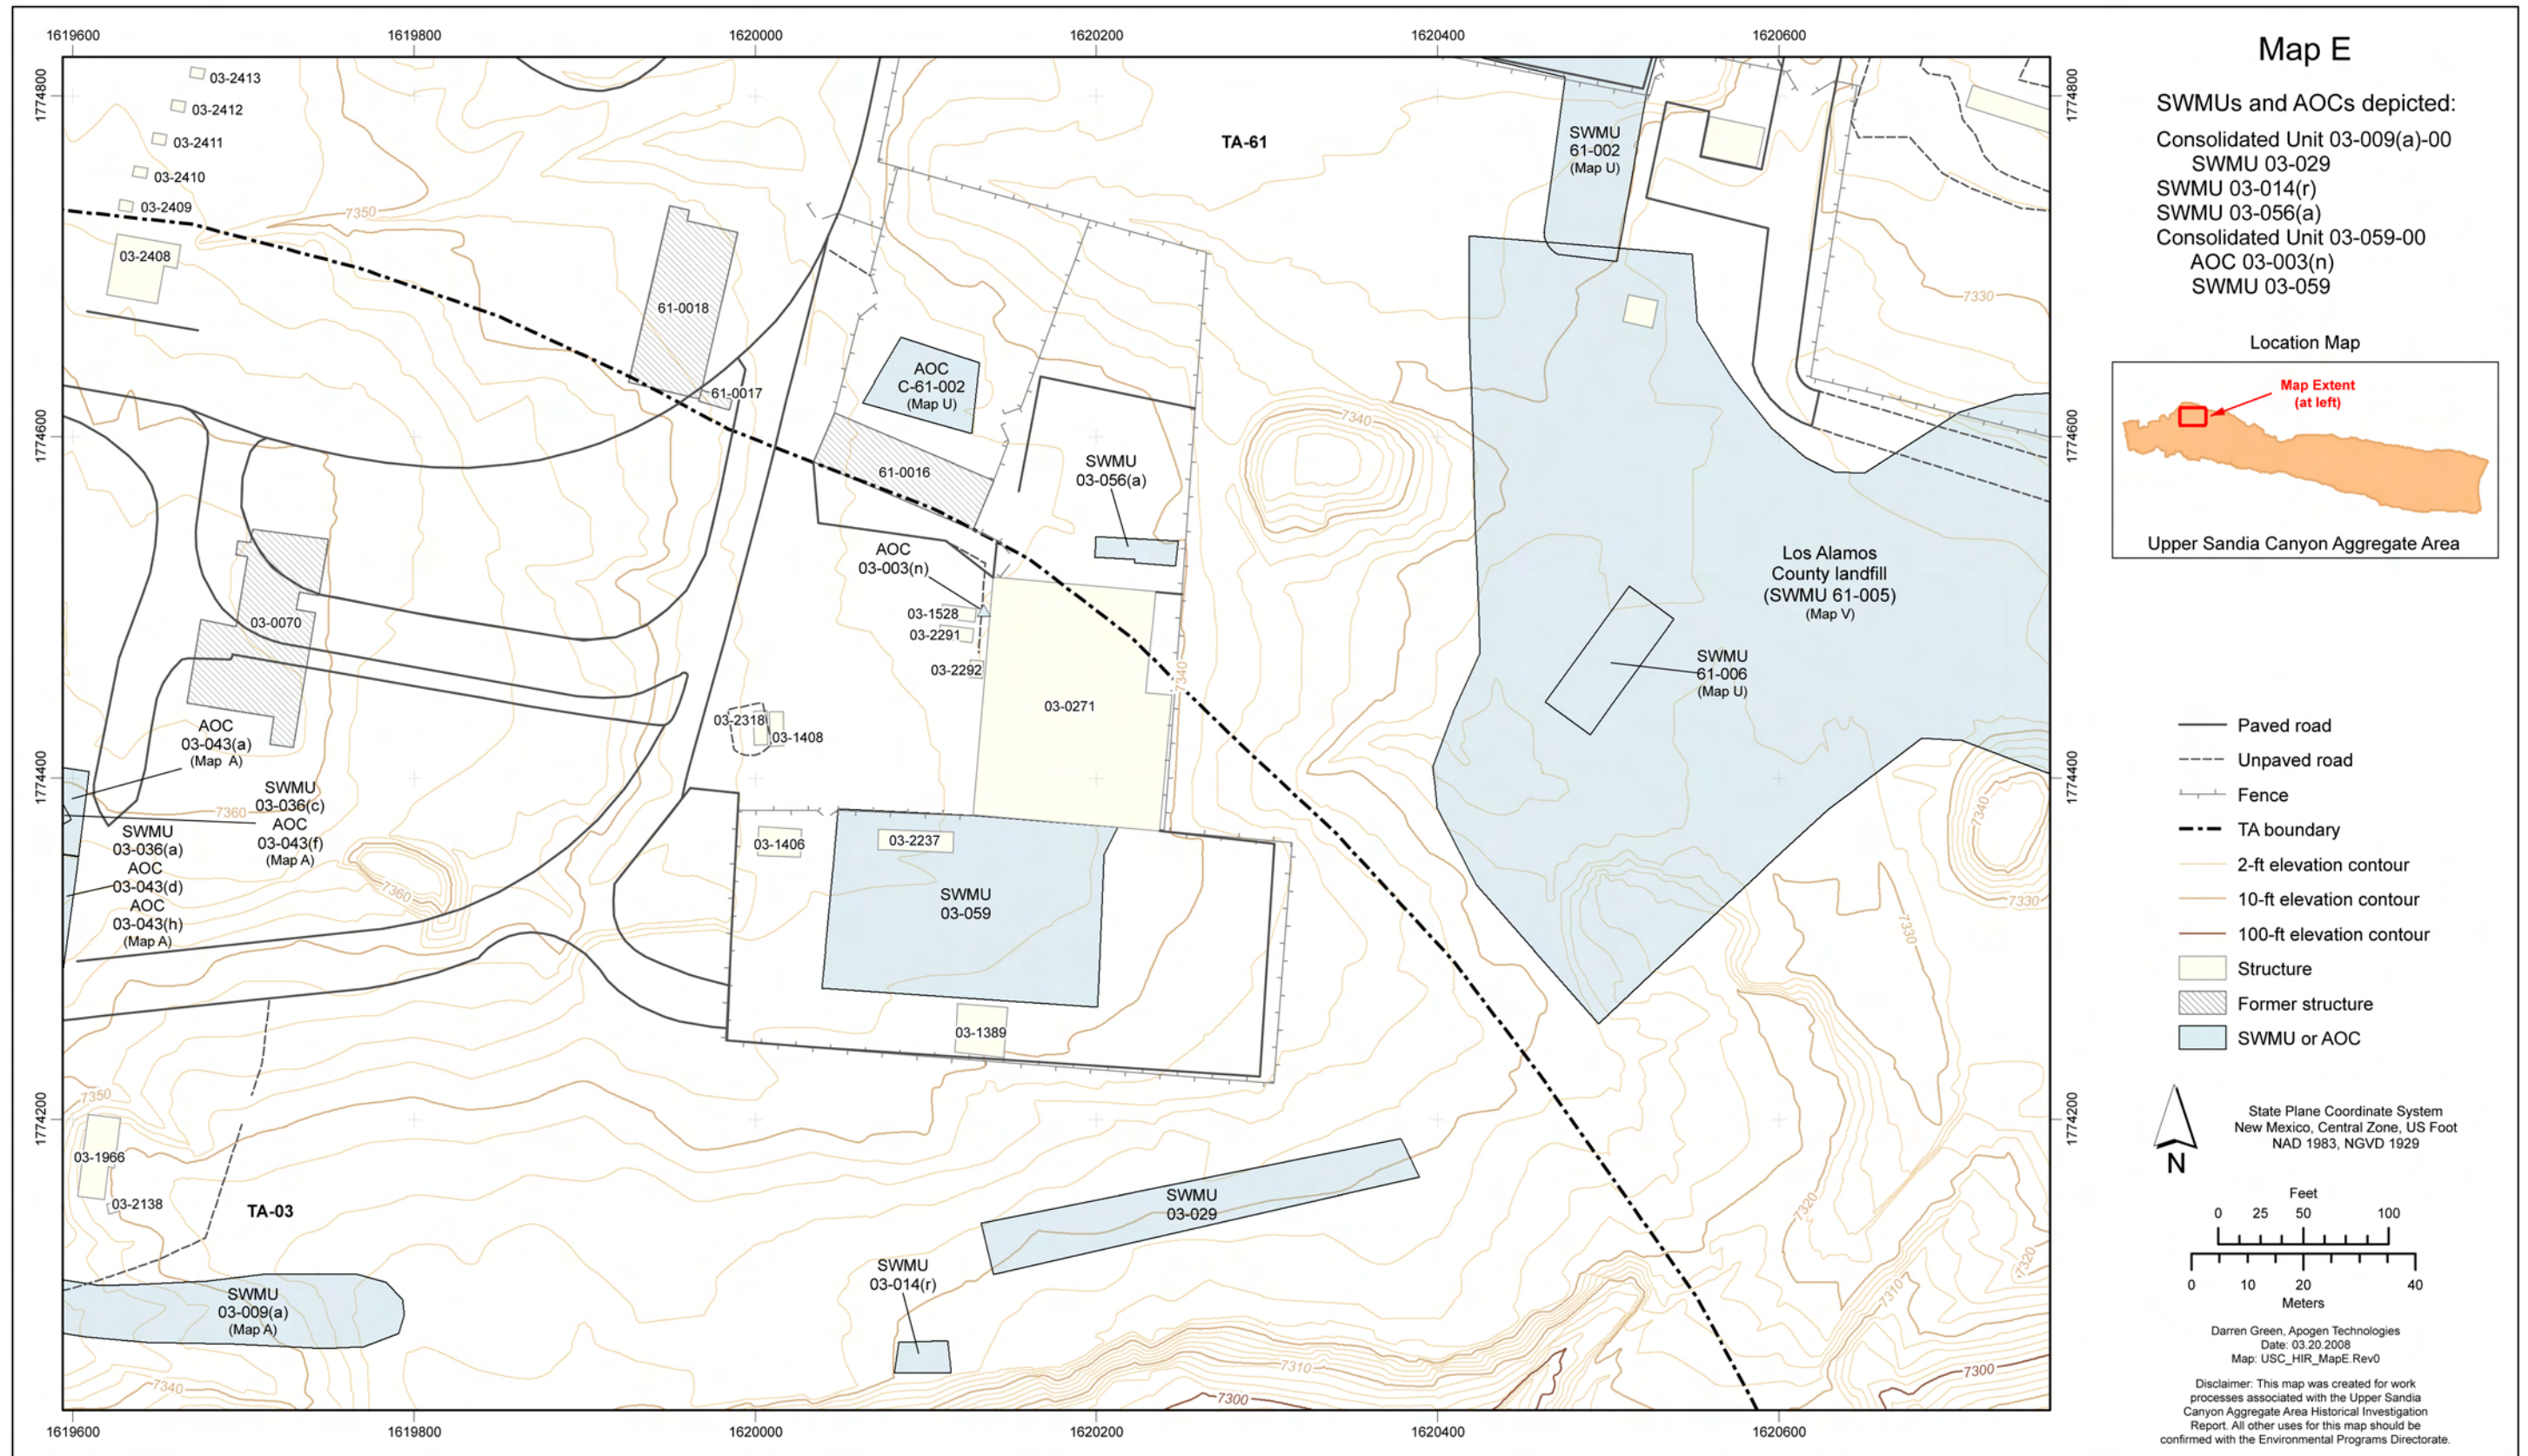


Figure 2.7-1 Map E site location



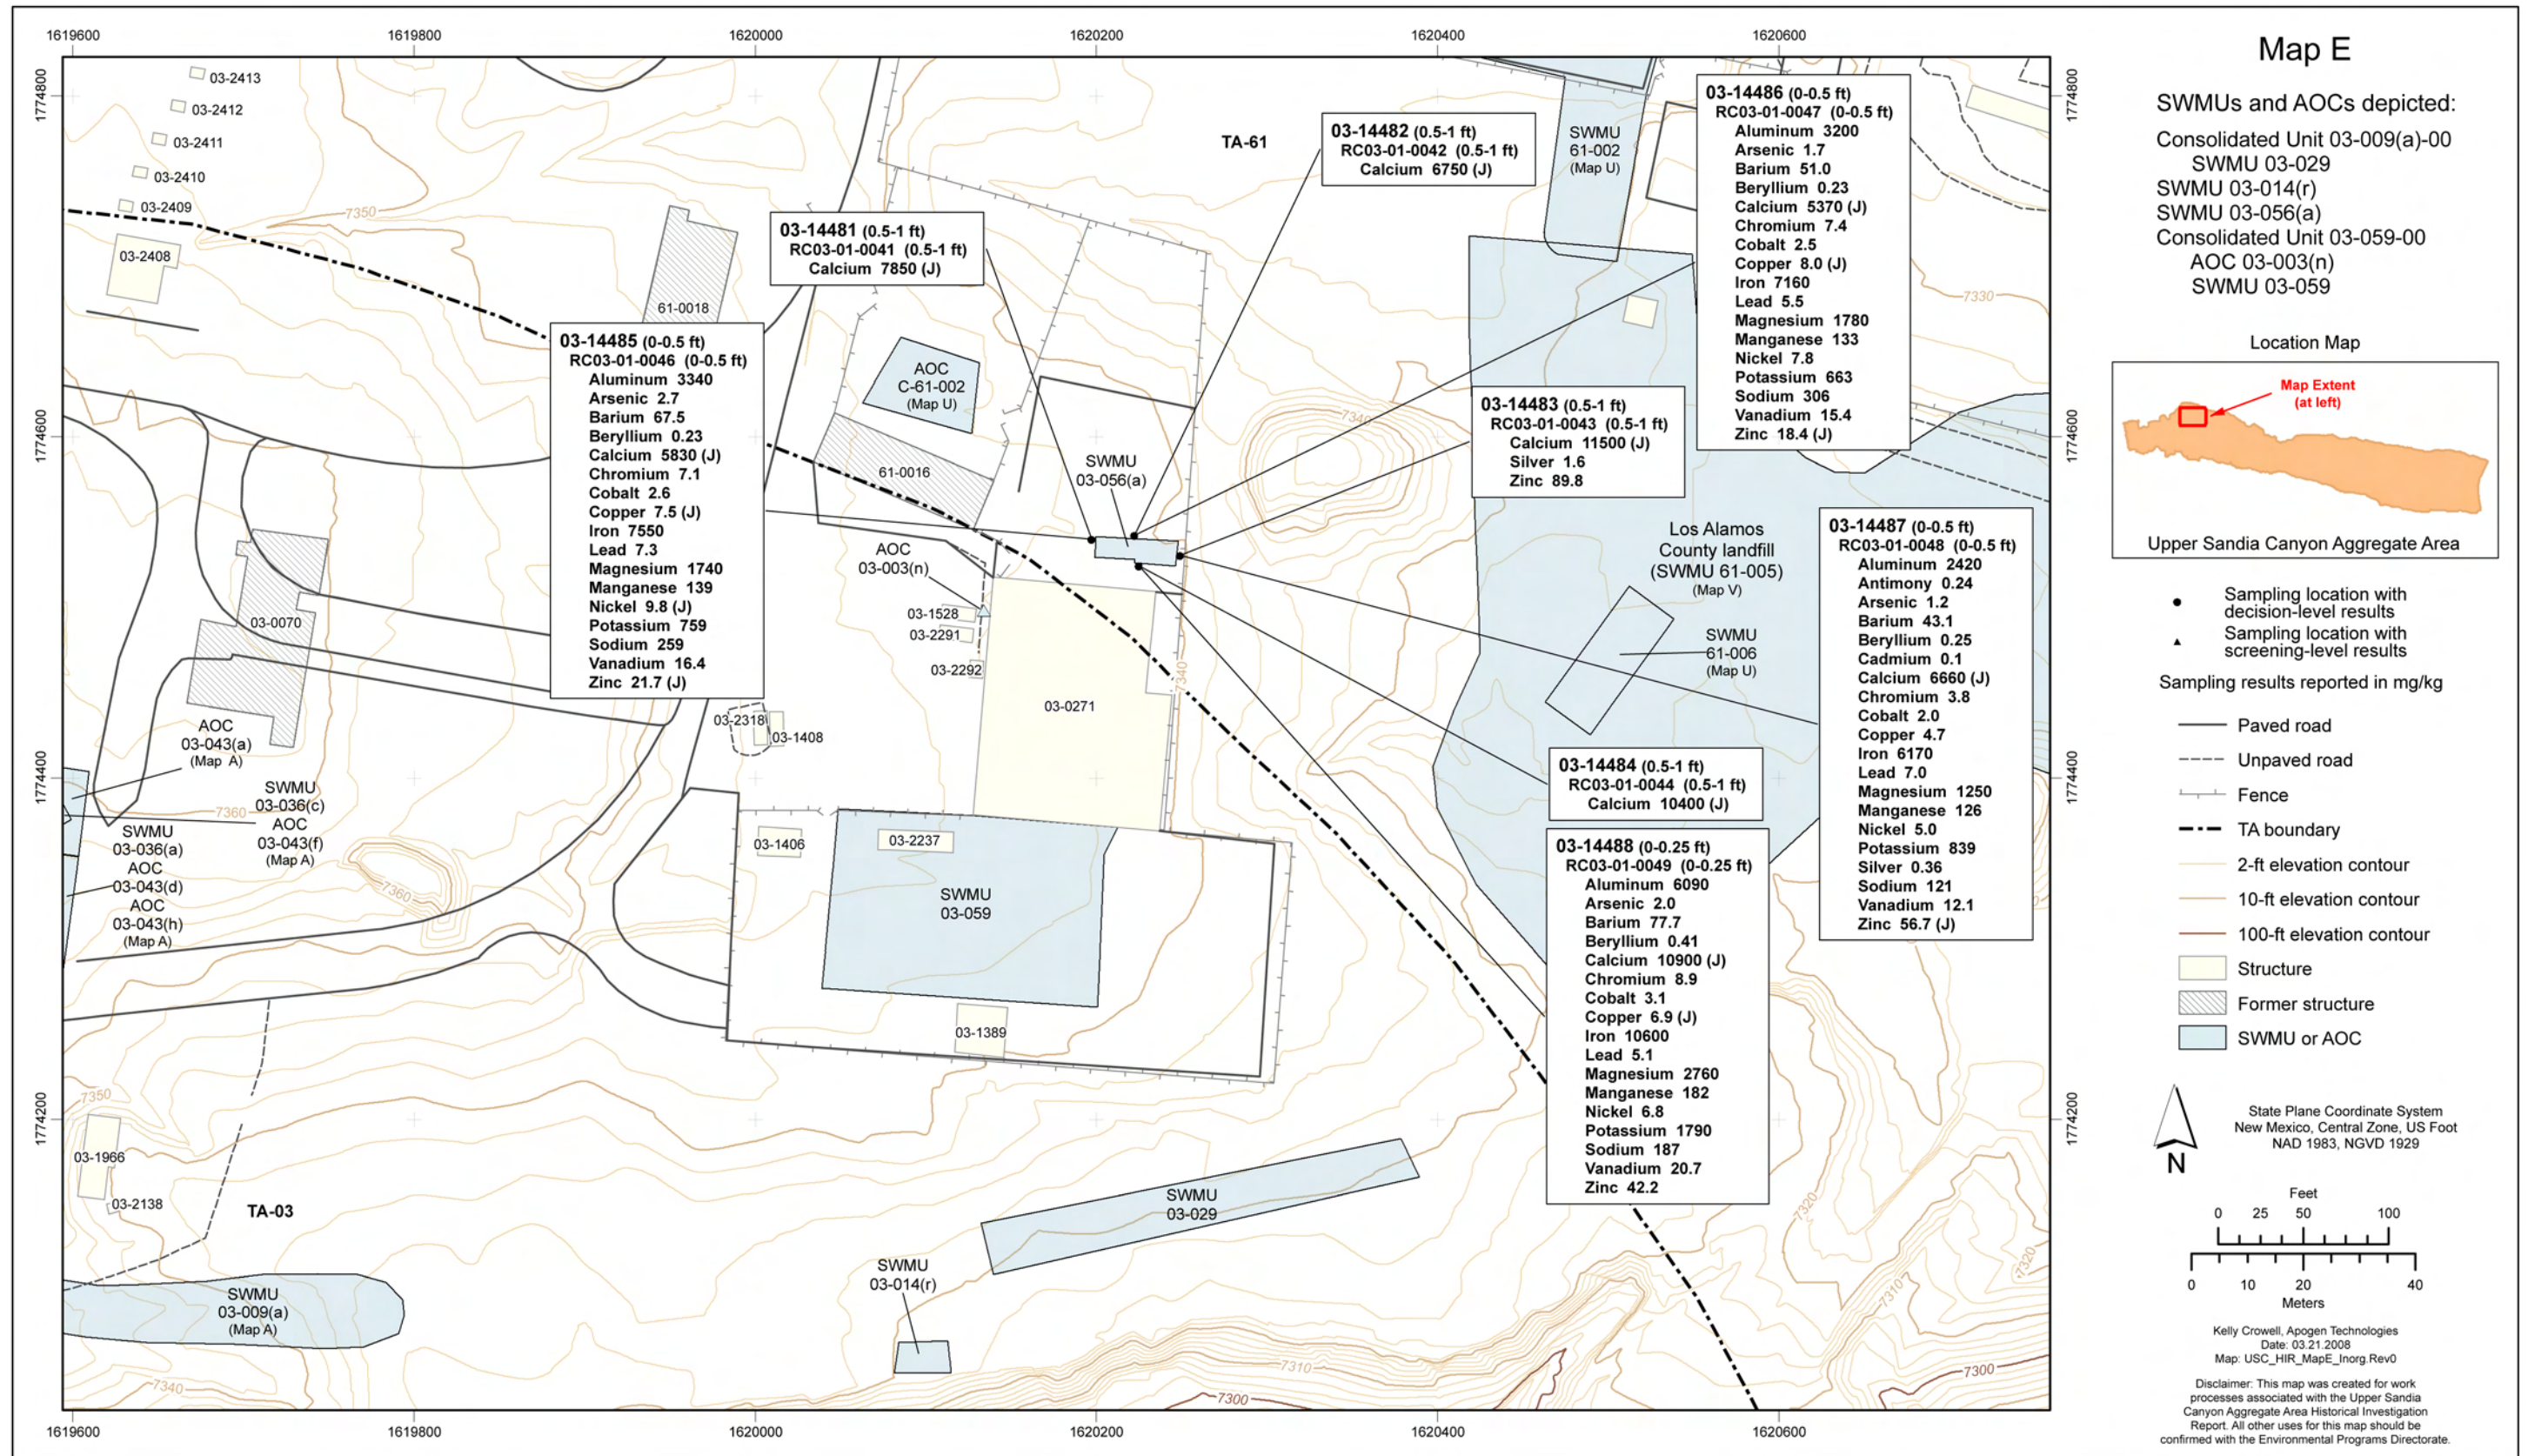


Figure 2.7-2 Map E inorganic chemical sampling locations and results detected above BVs



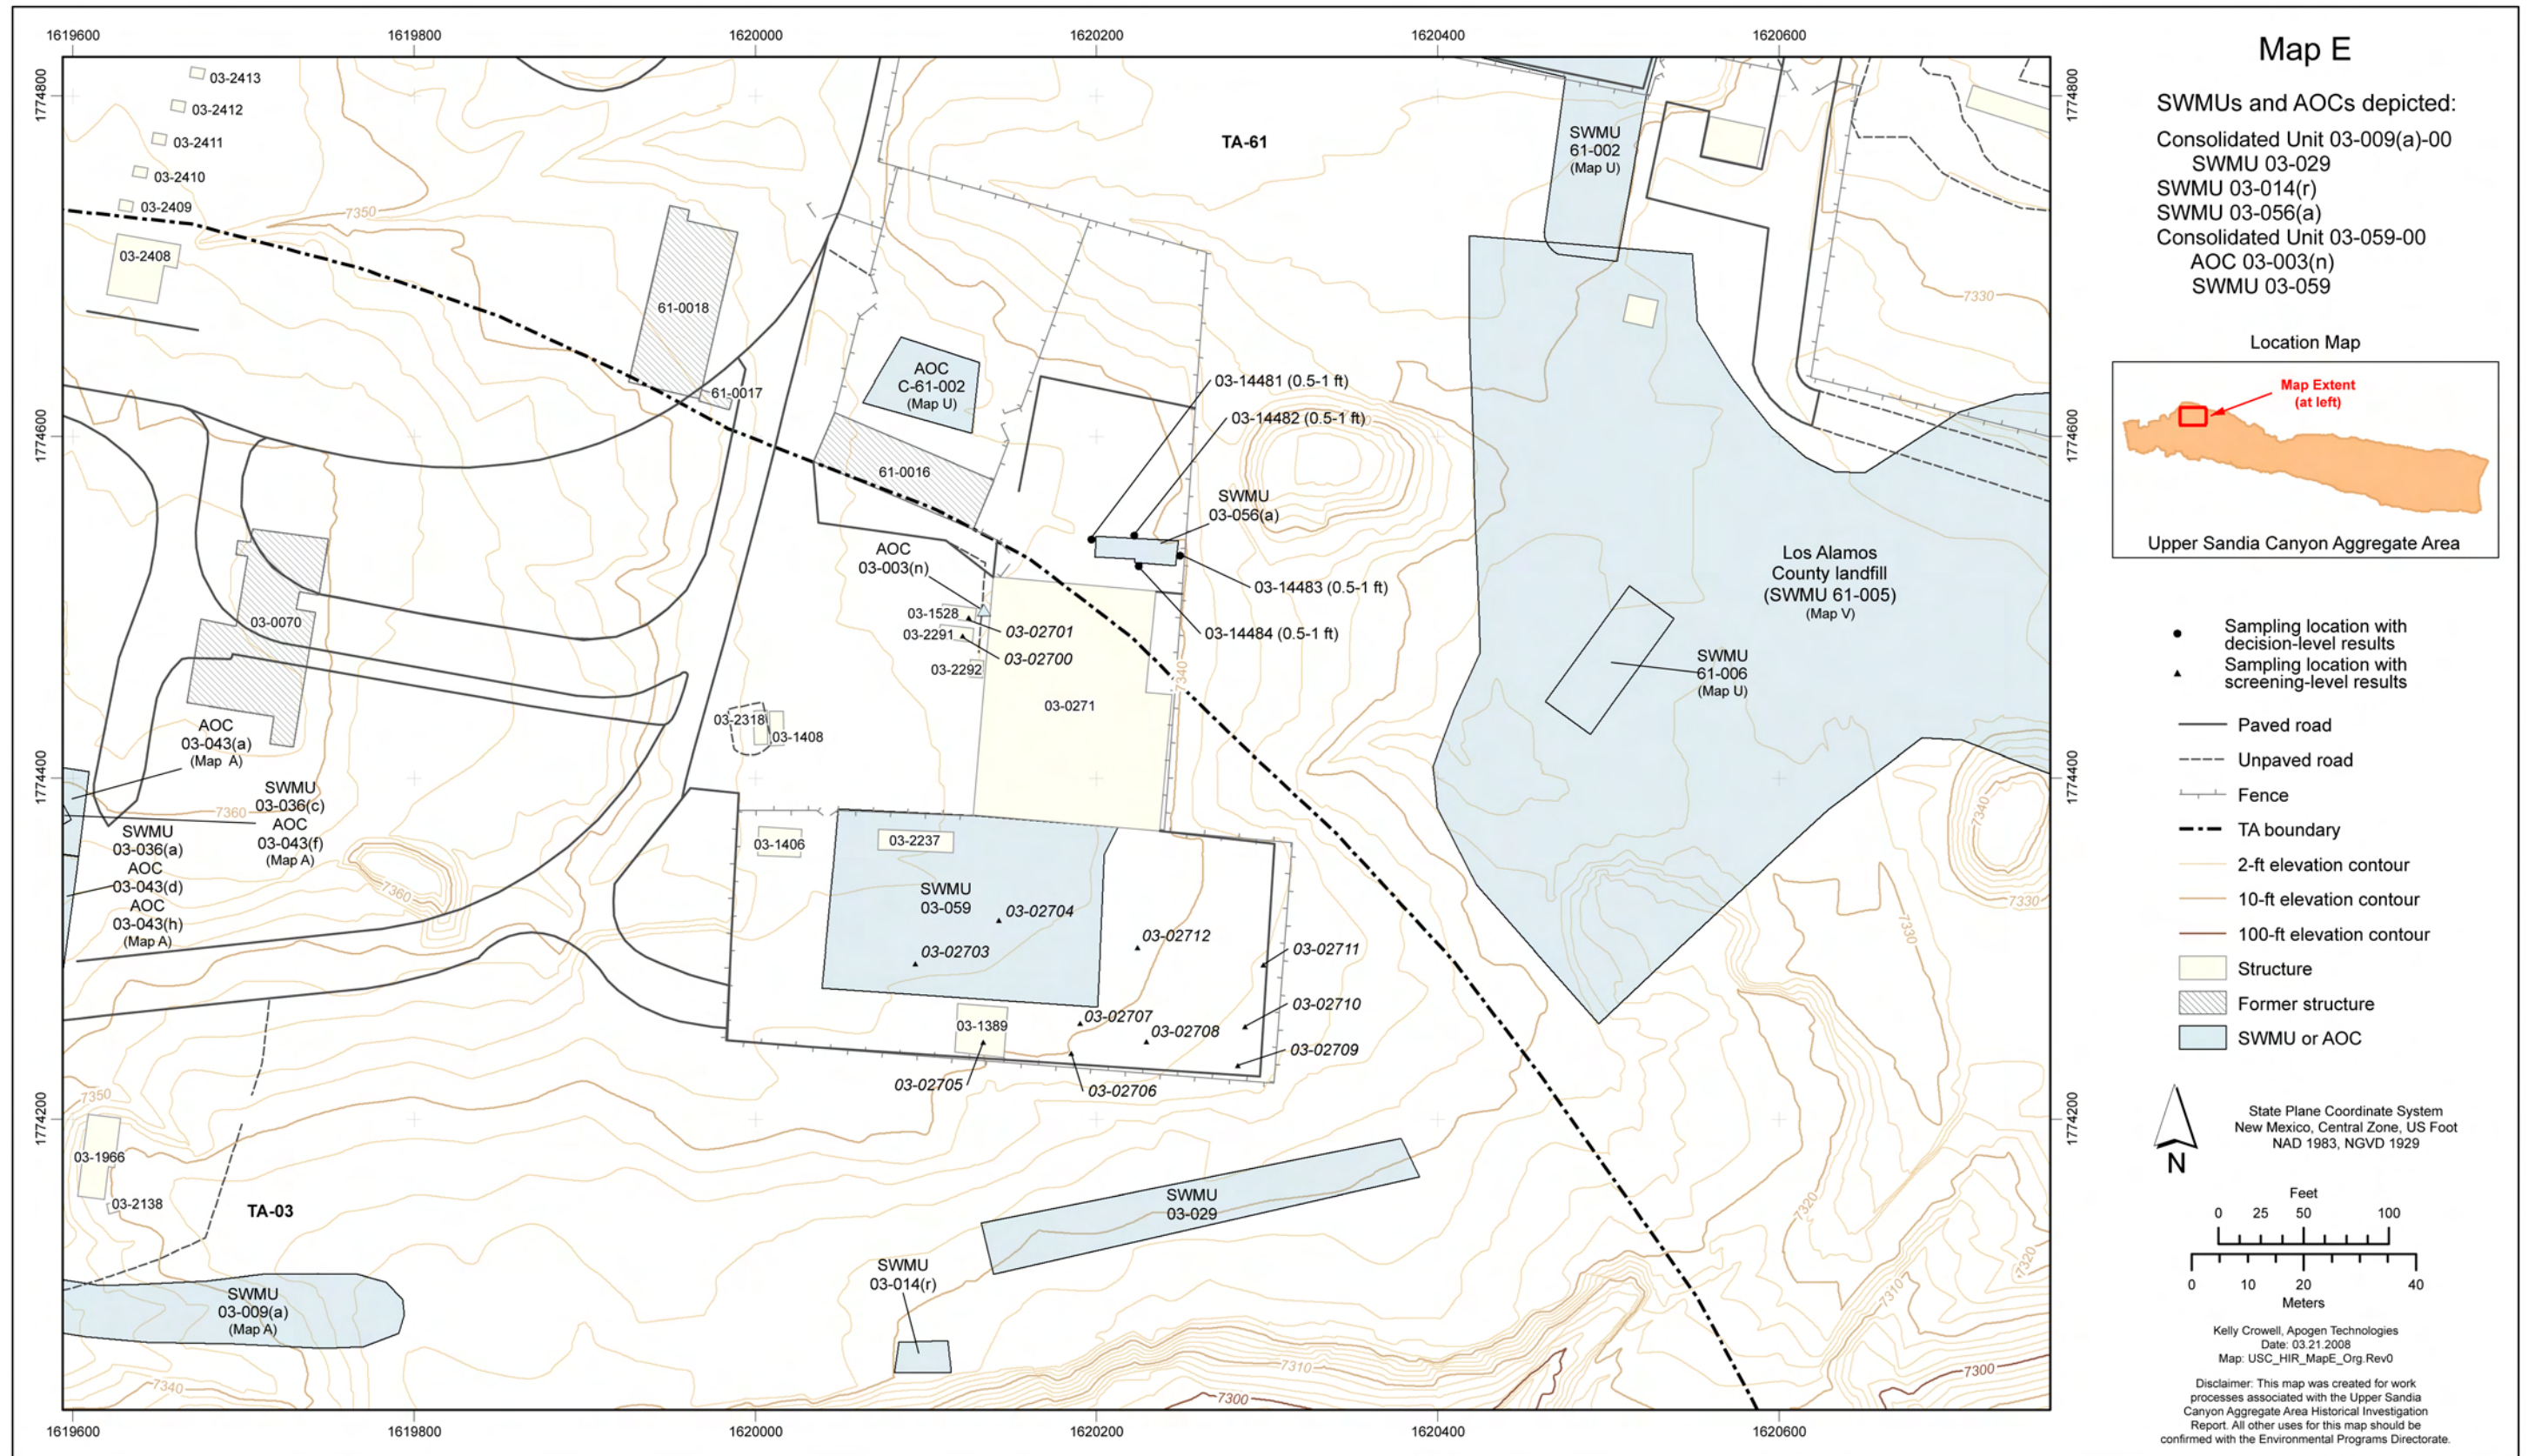


Figure 2.7-3 Map E organic chemical sampling locations







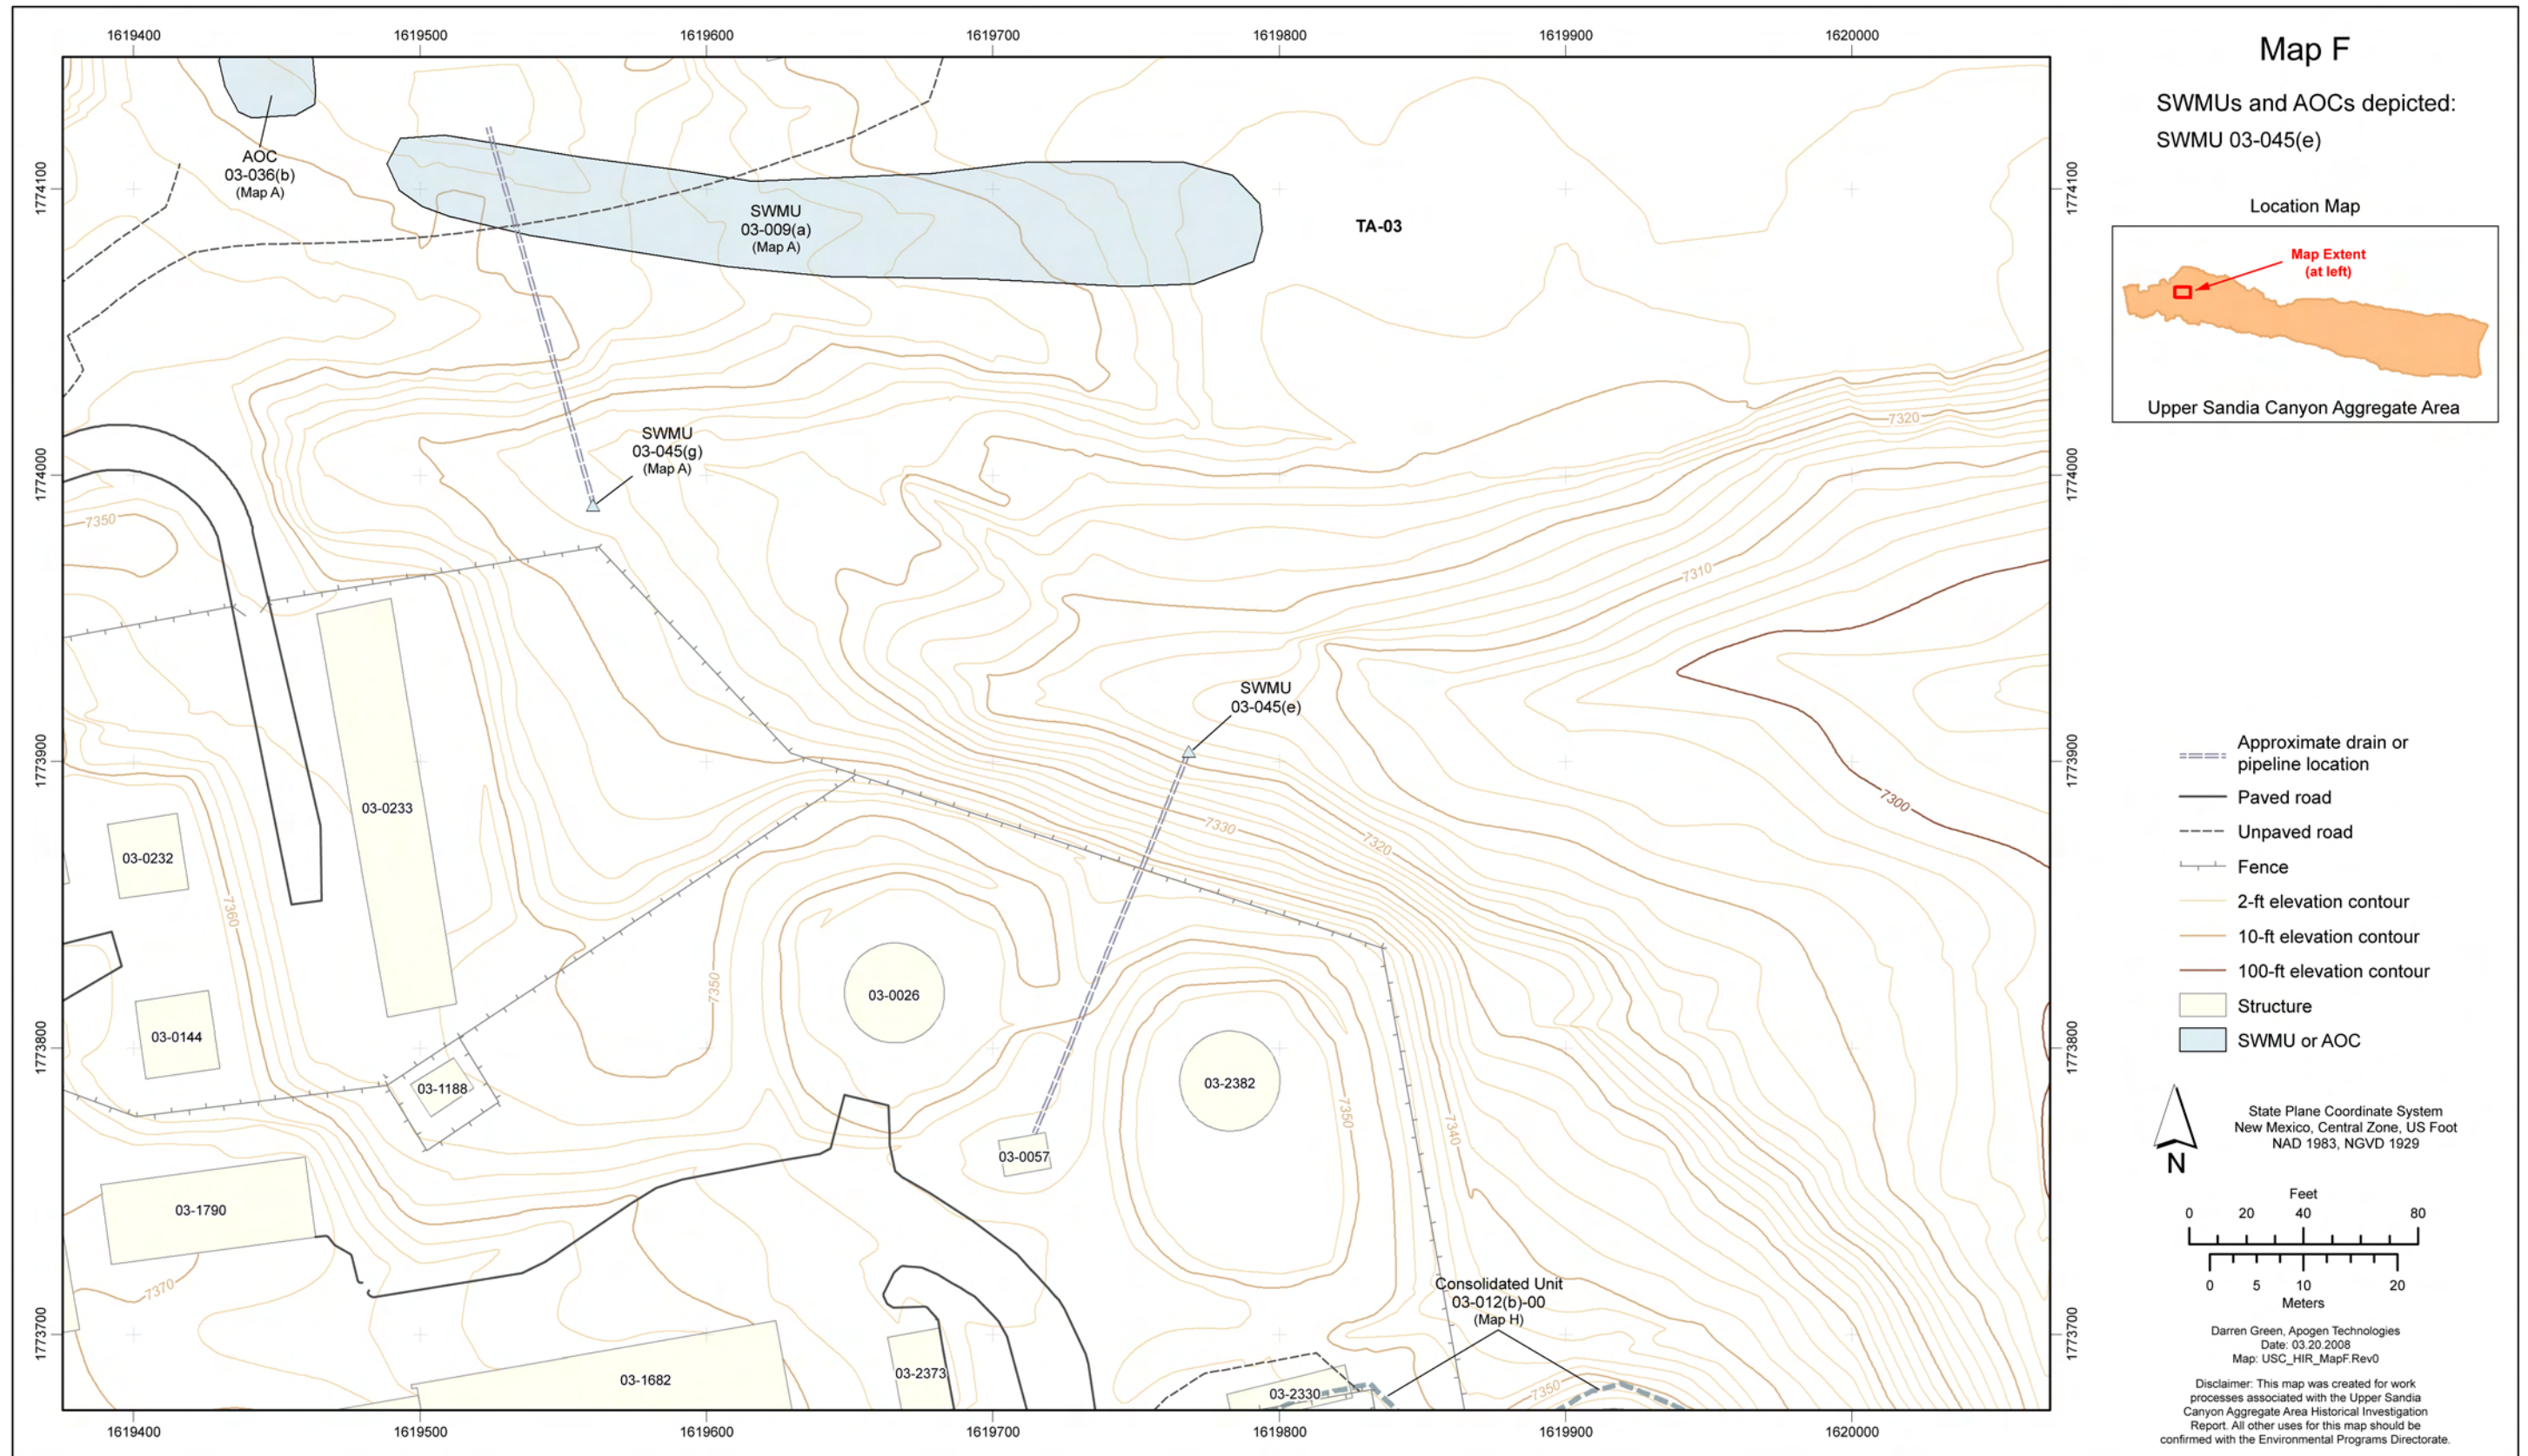


Figure 2.30-1 Map F site location



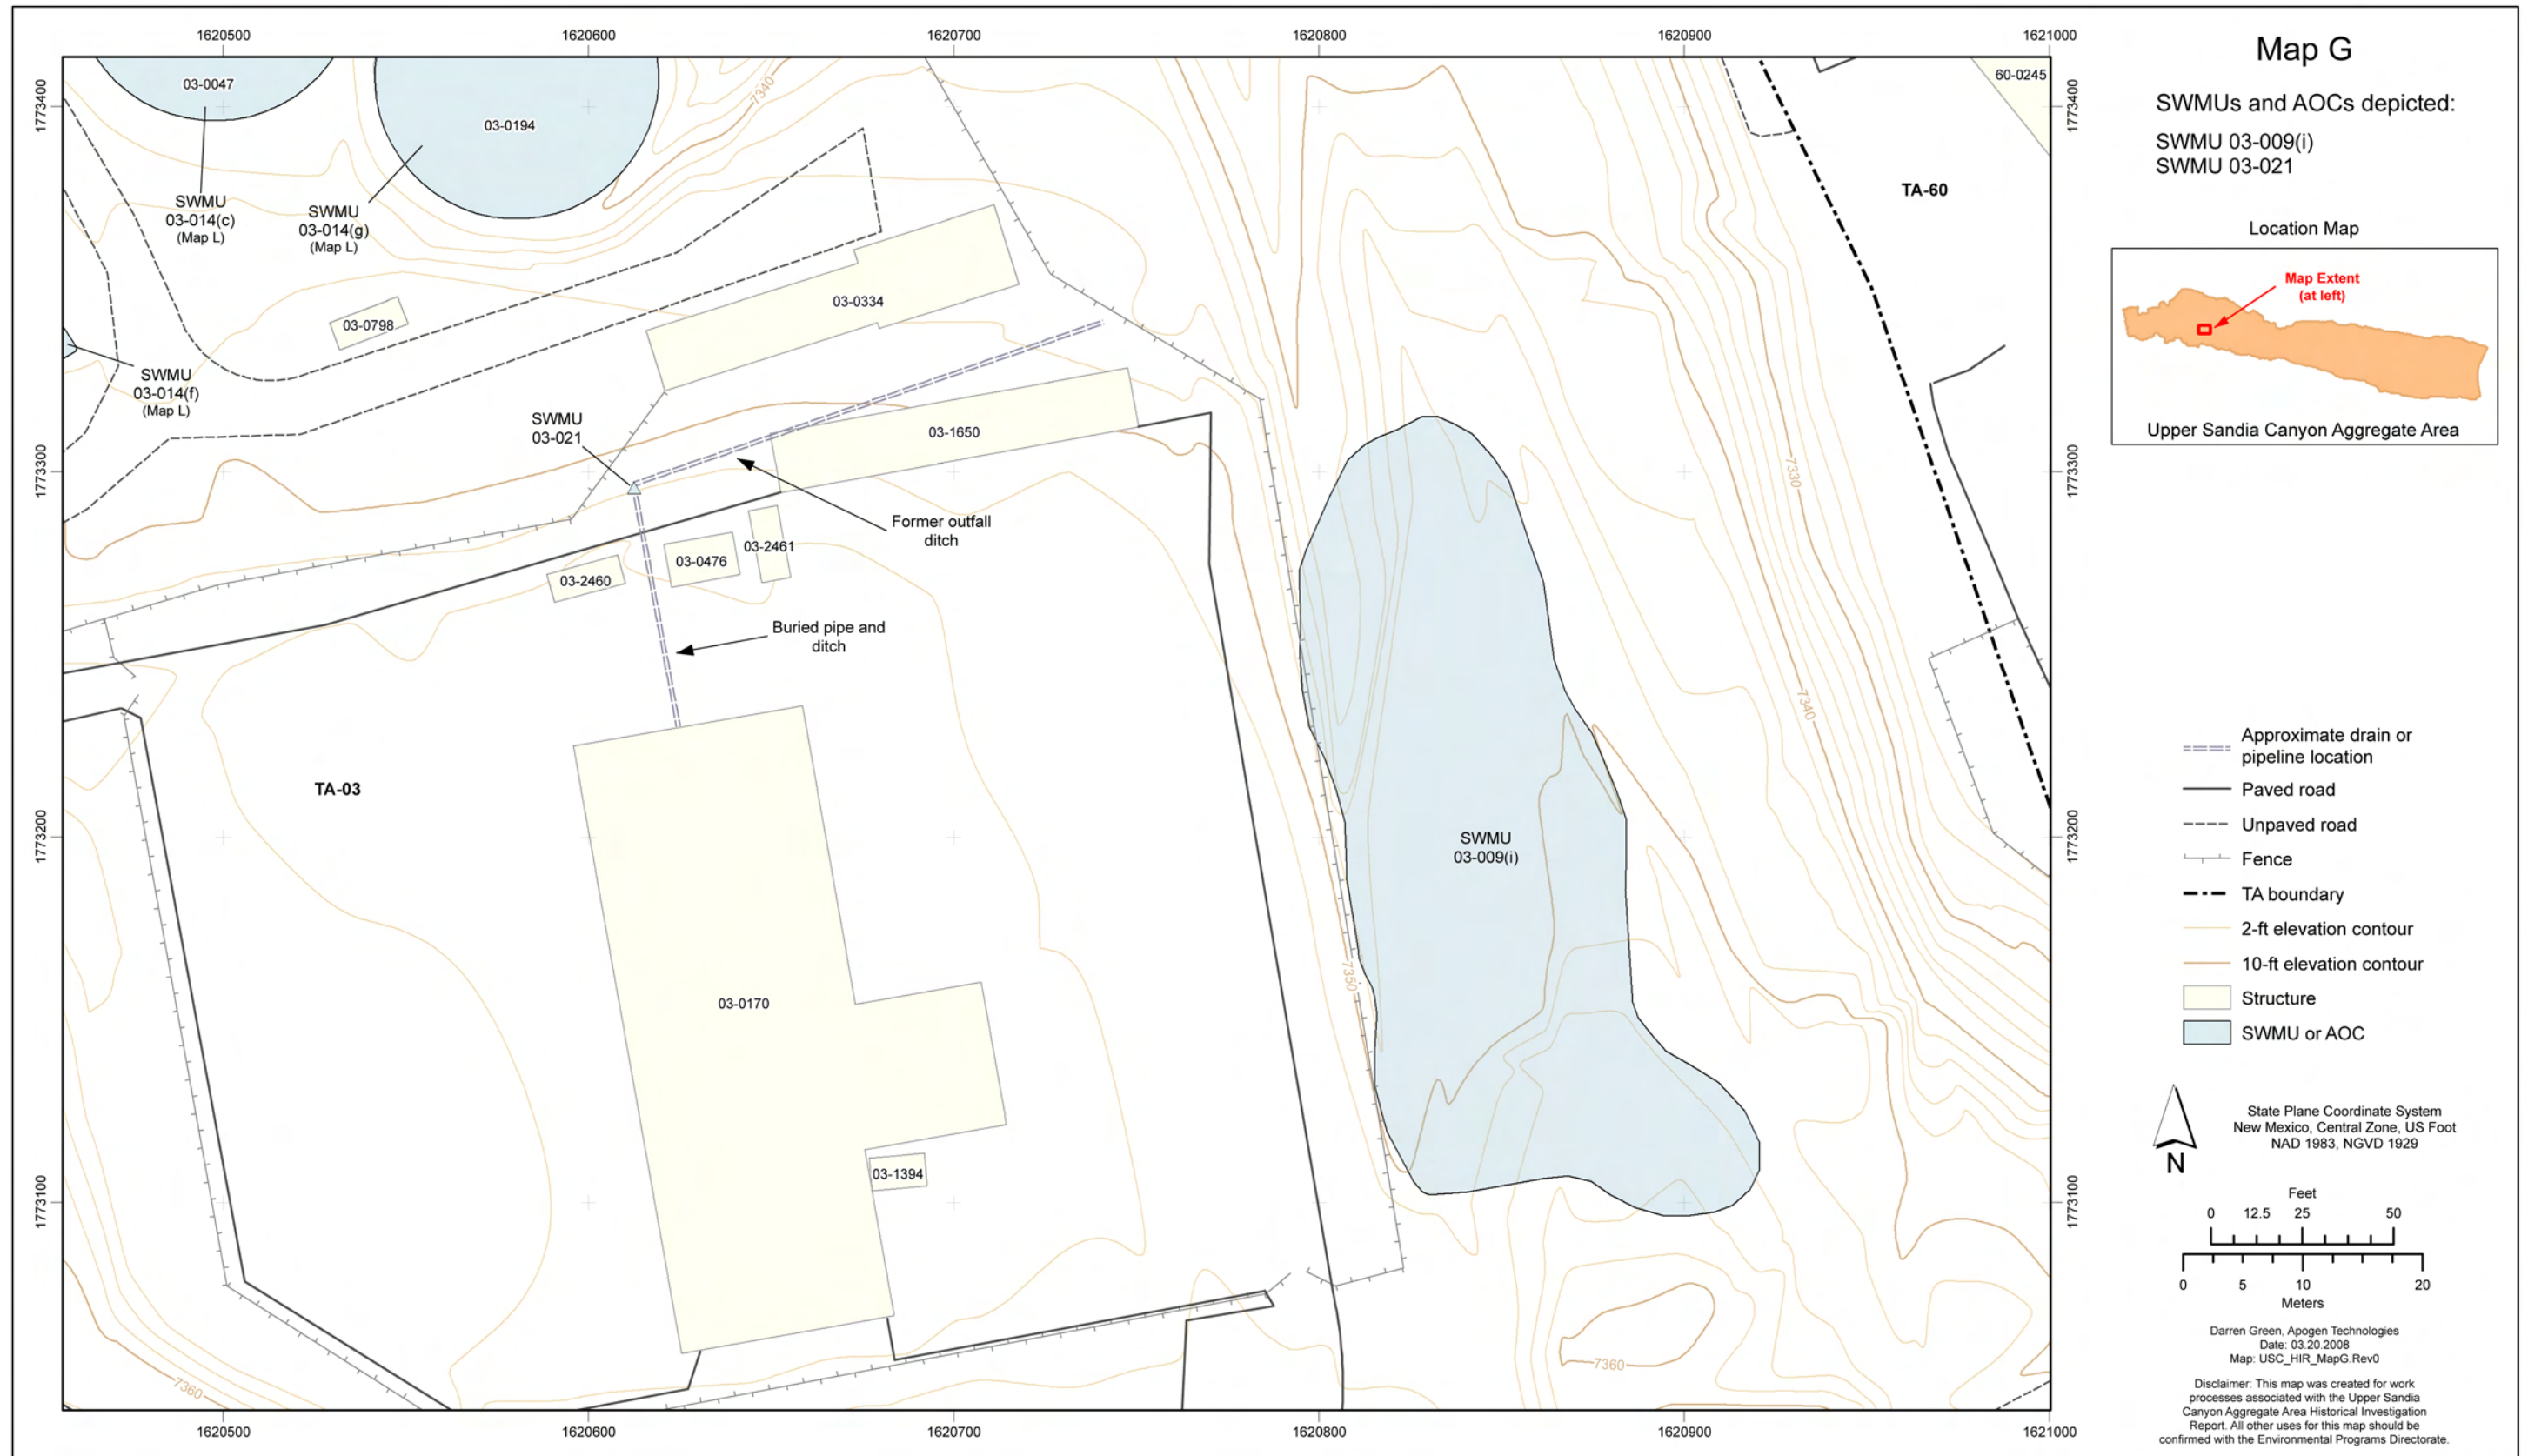


Figure 2.8-1 Map G site location



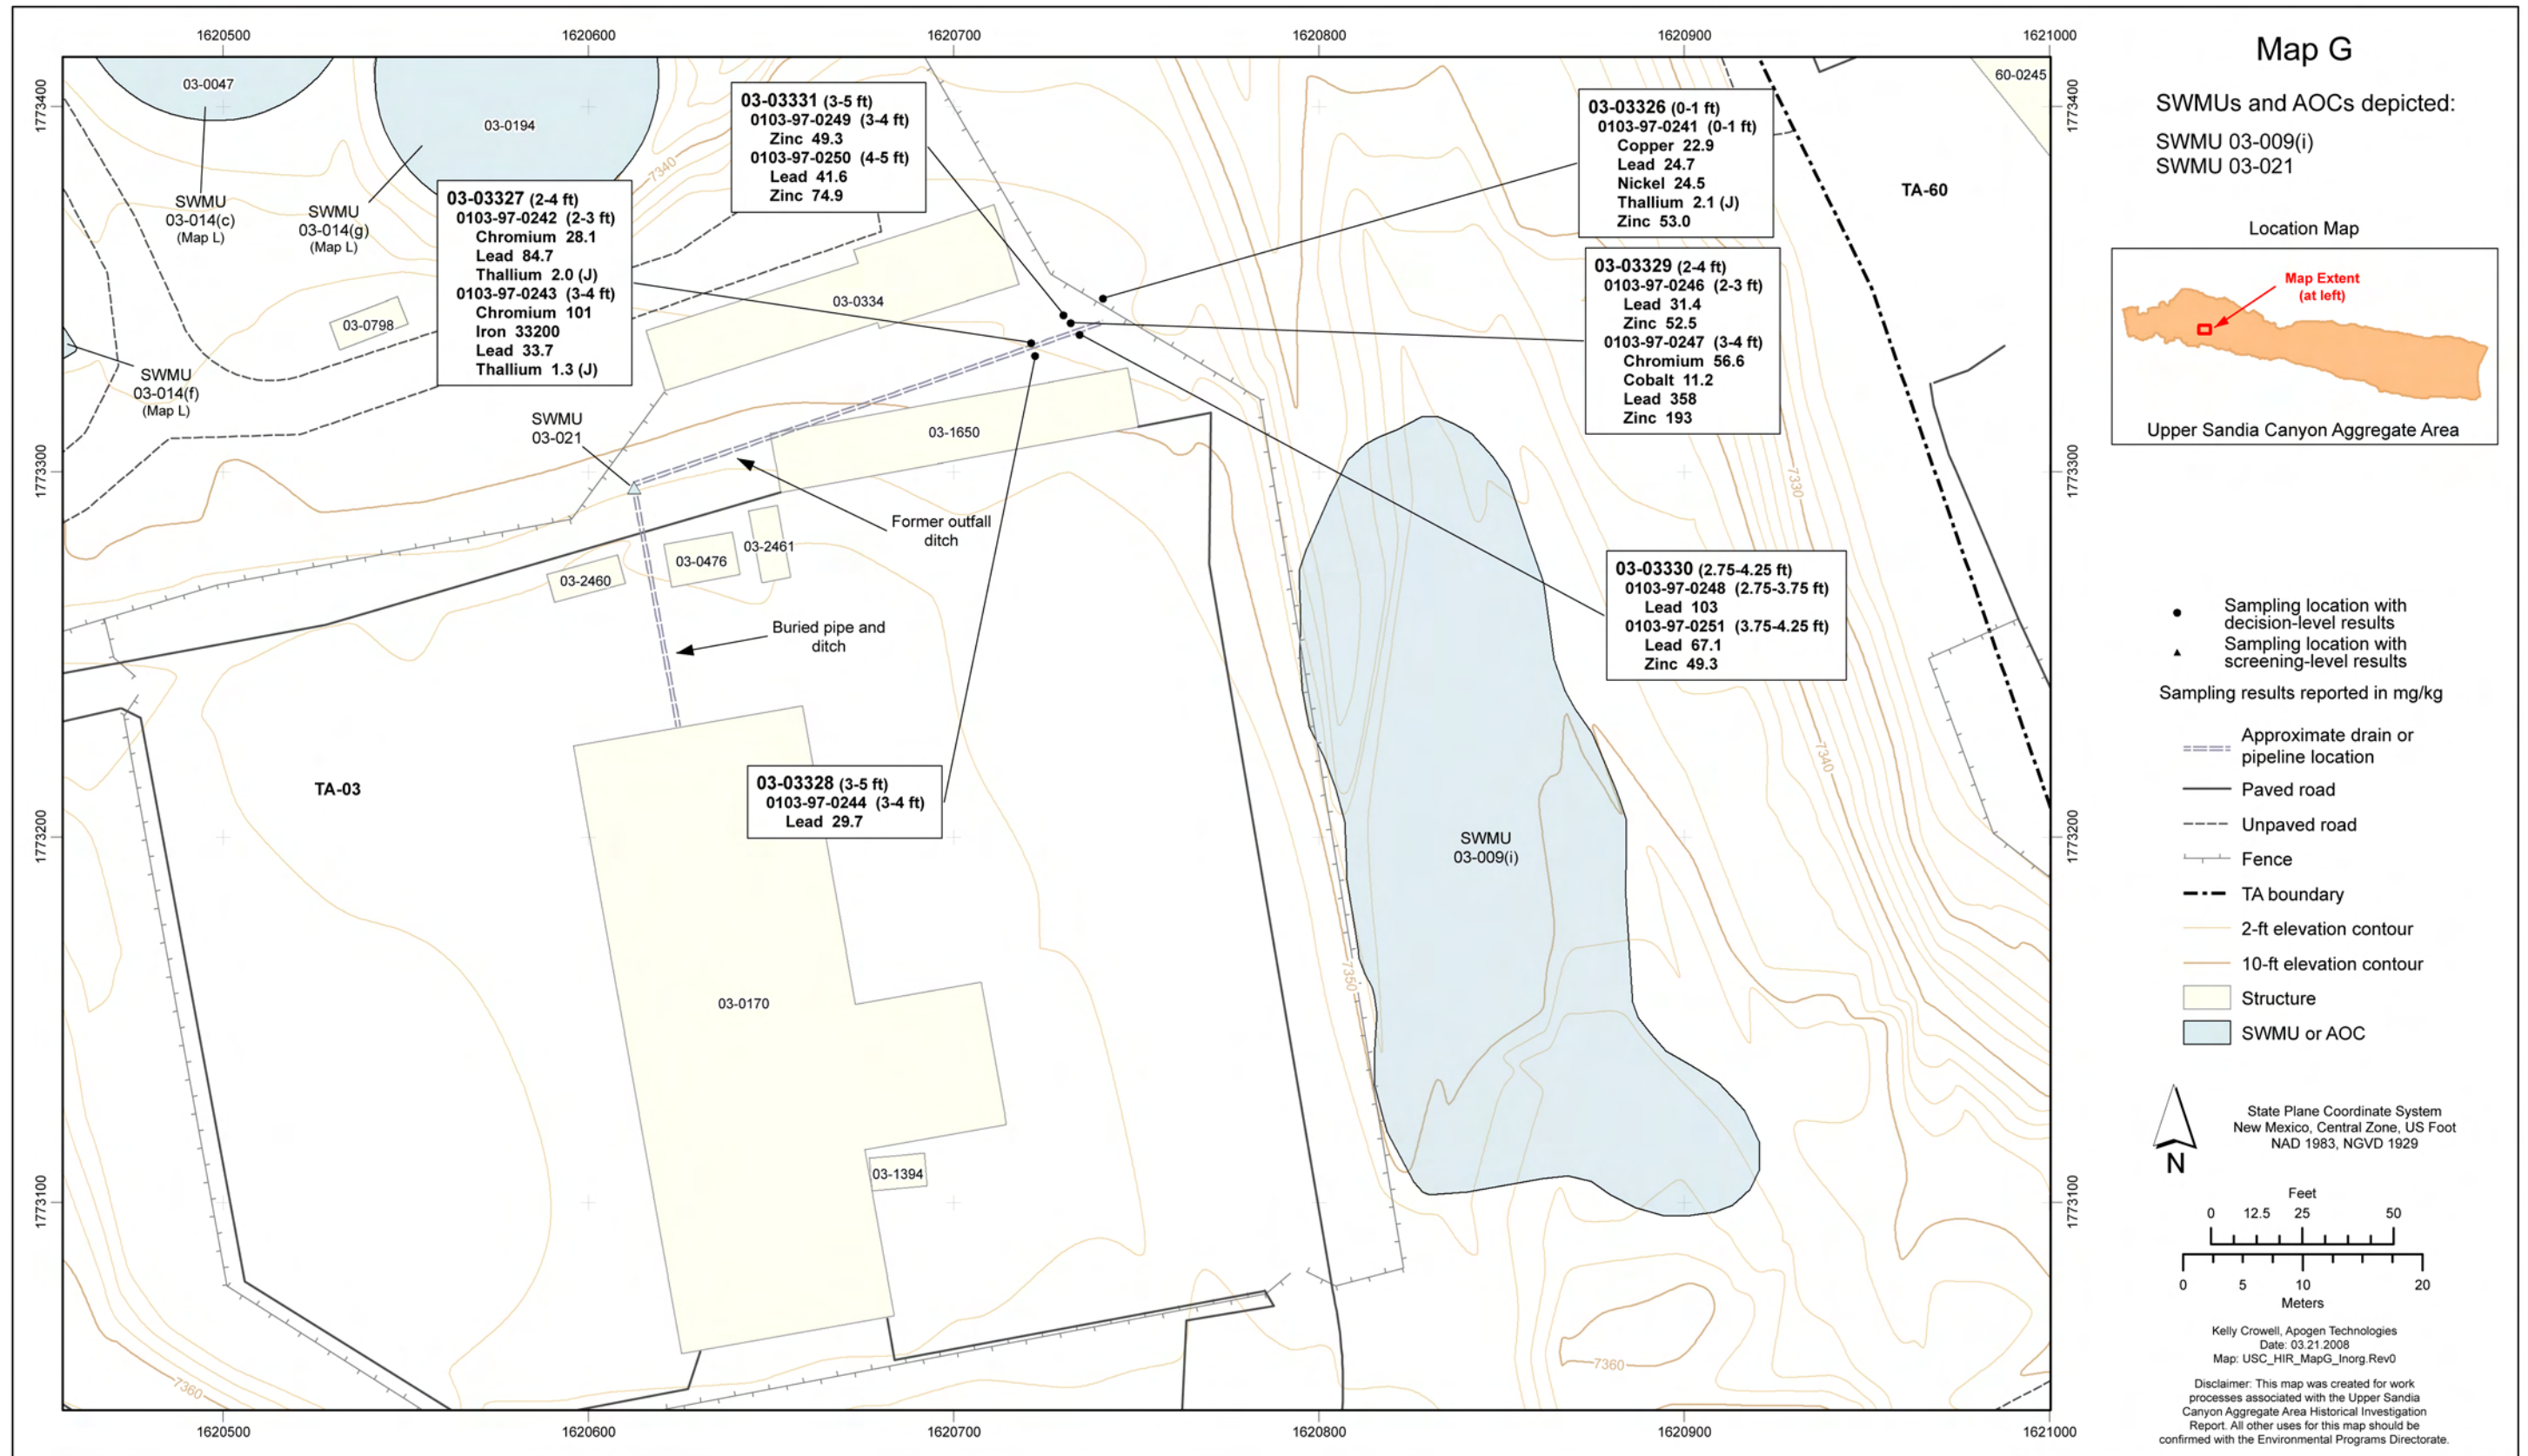


Figure 2.8-2 Map G inorganic chemical sampling locations and results detected above BVs



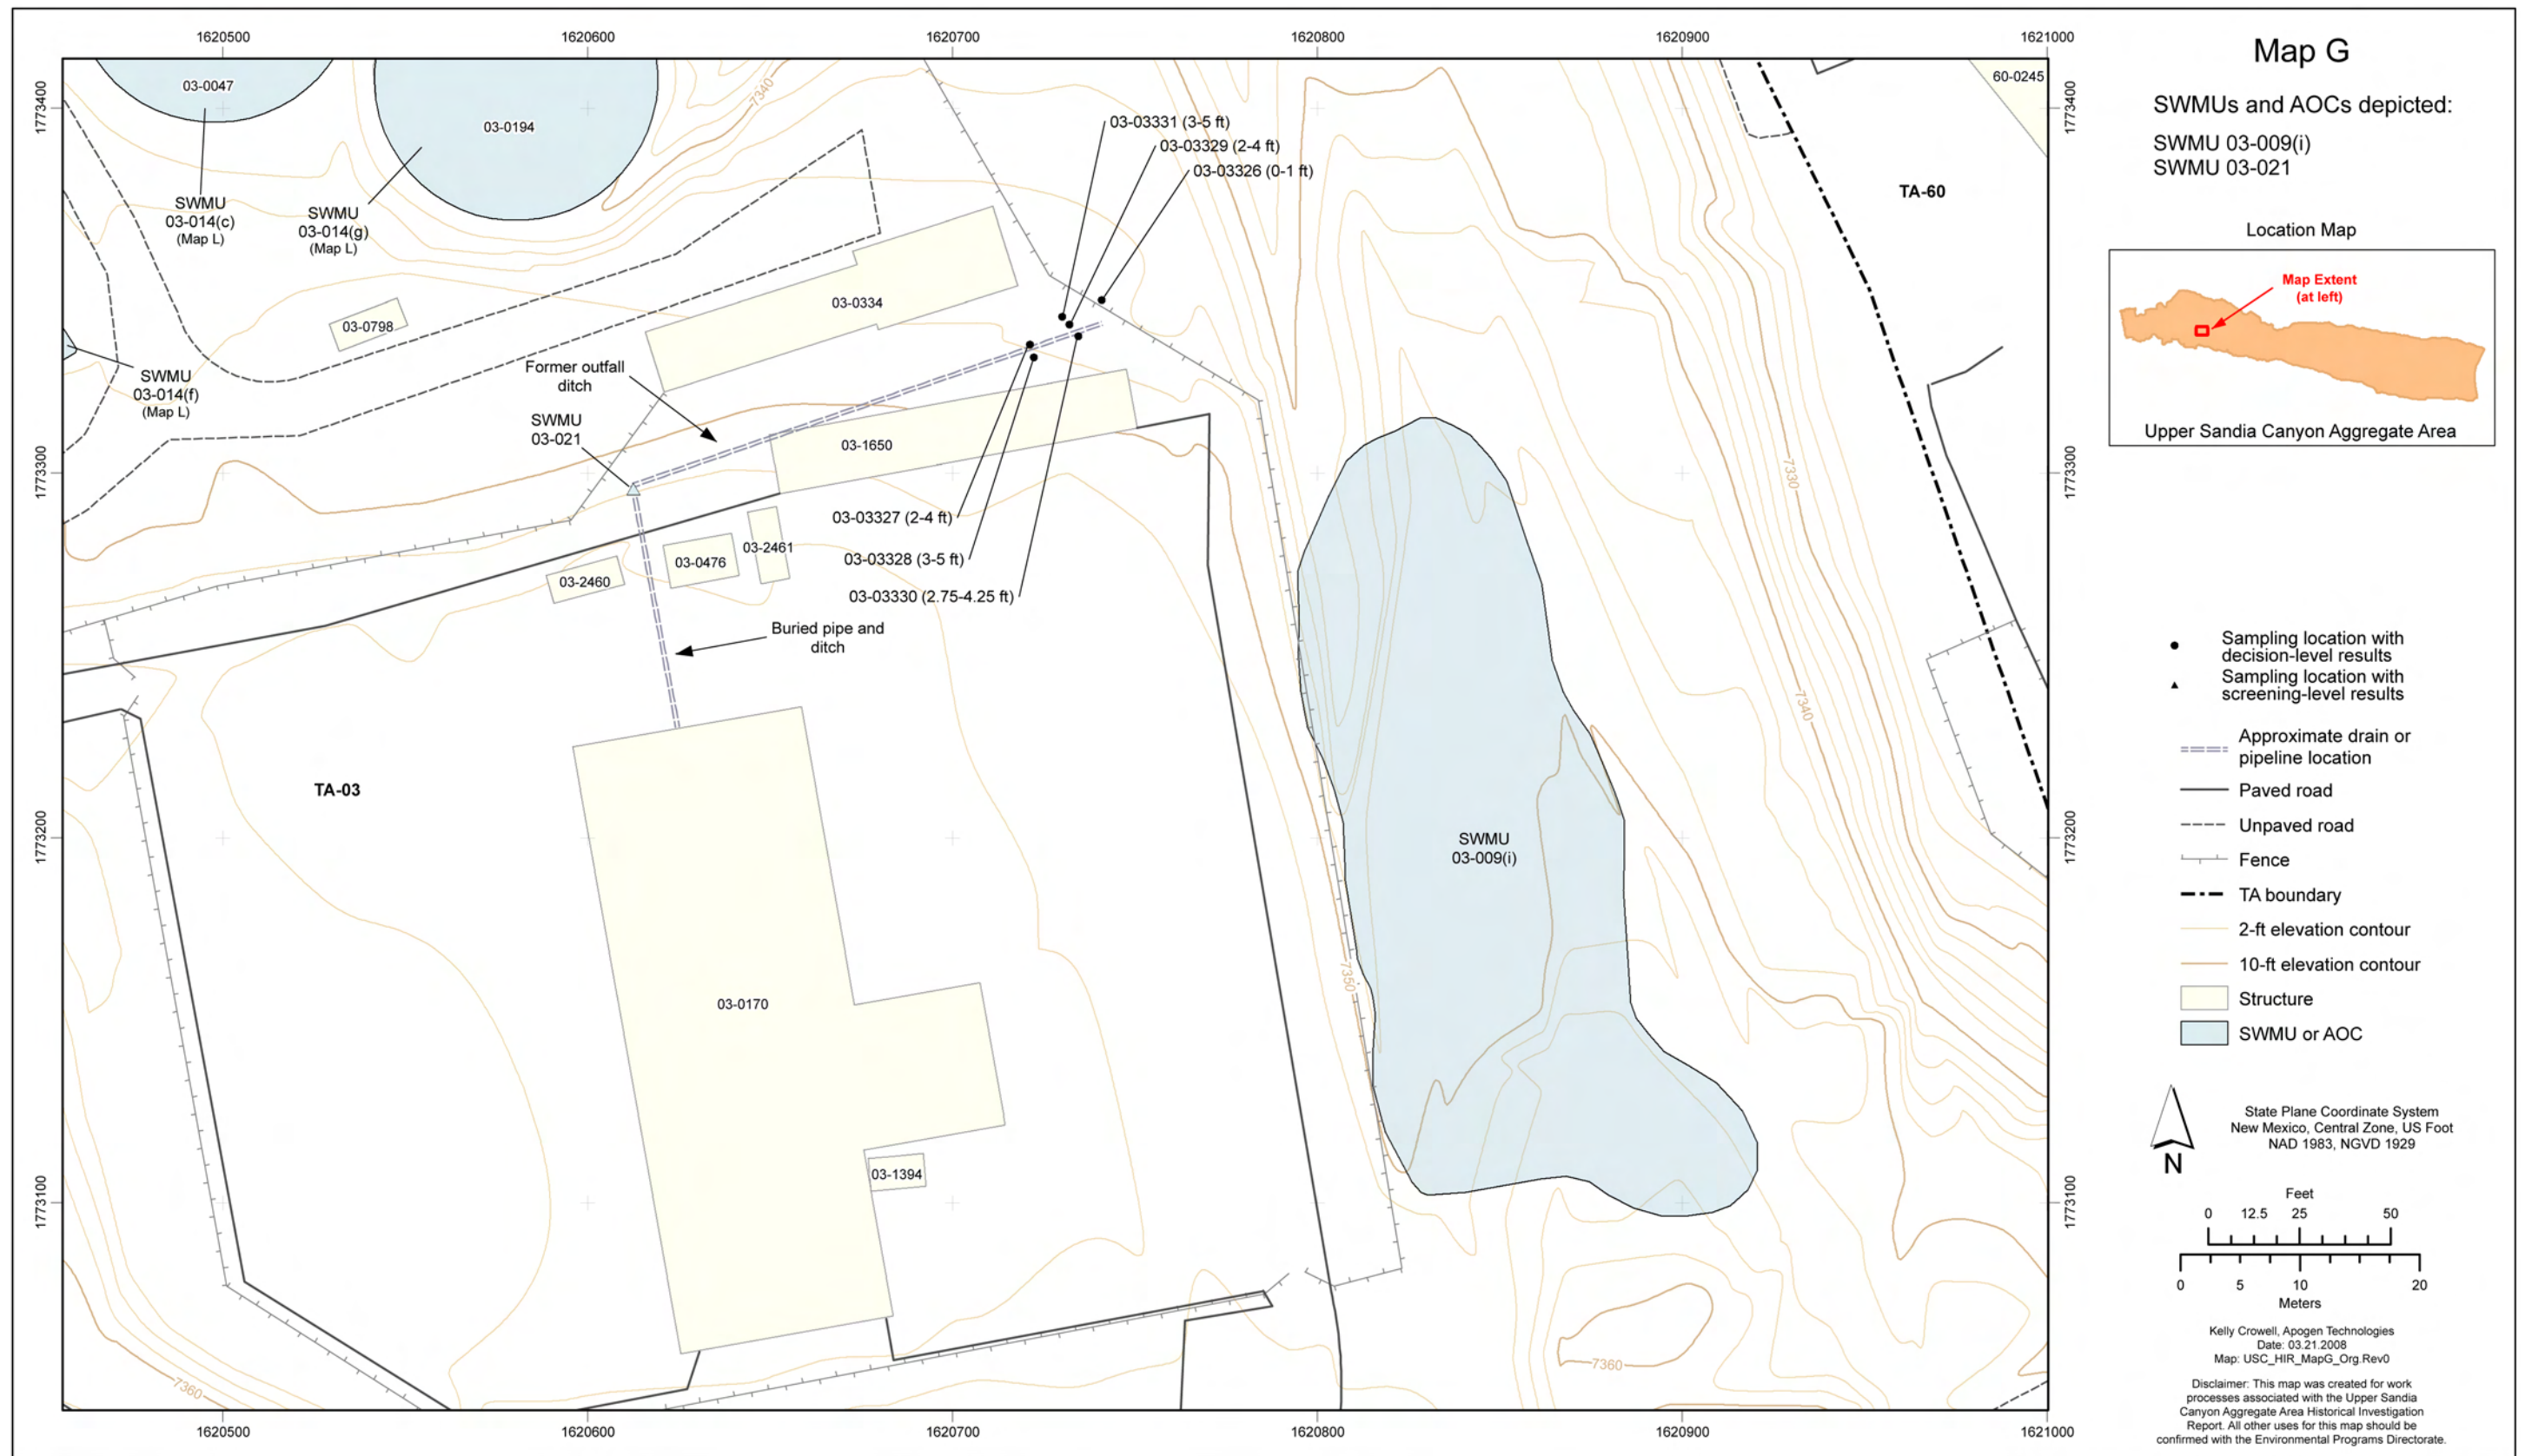


Figure 2.8-3 Map G organic chemical sampling locations



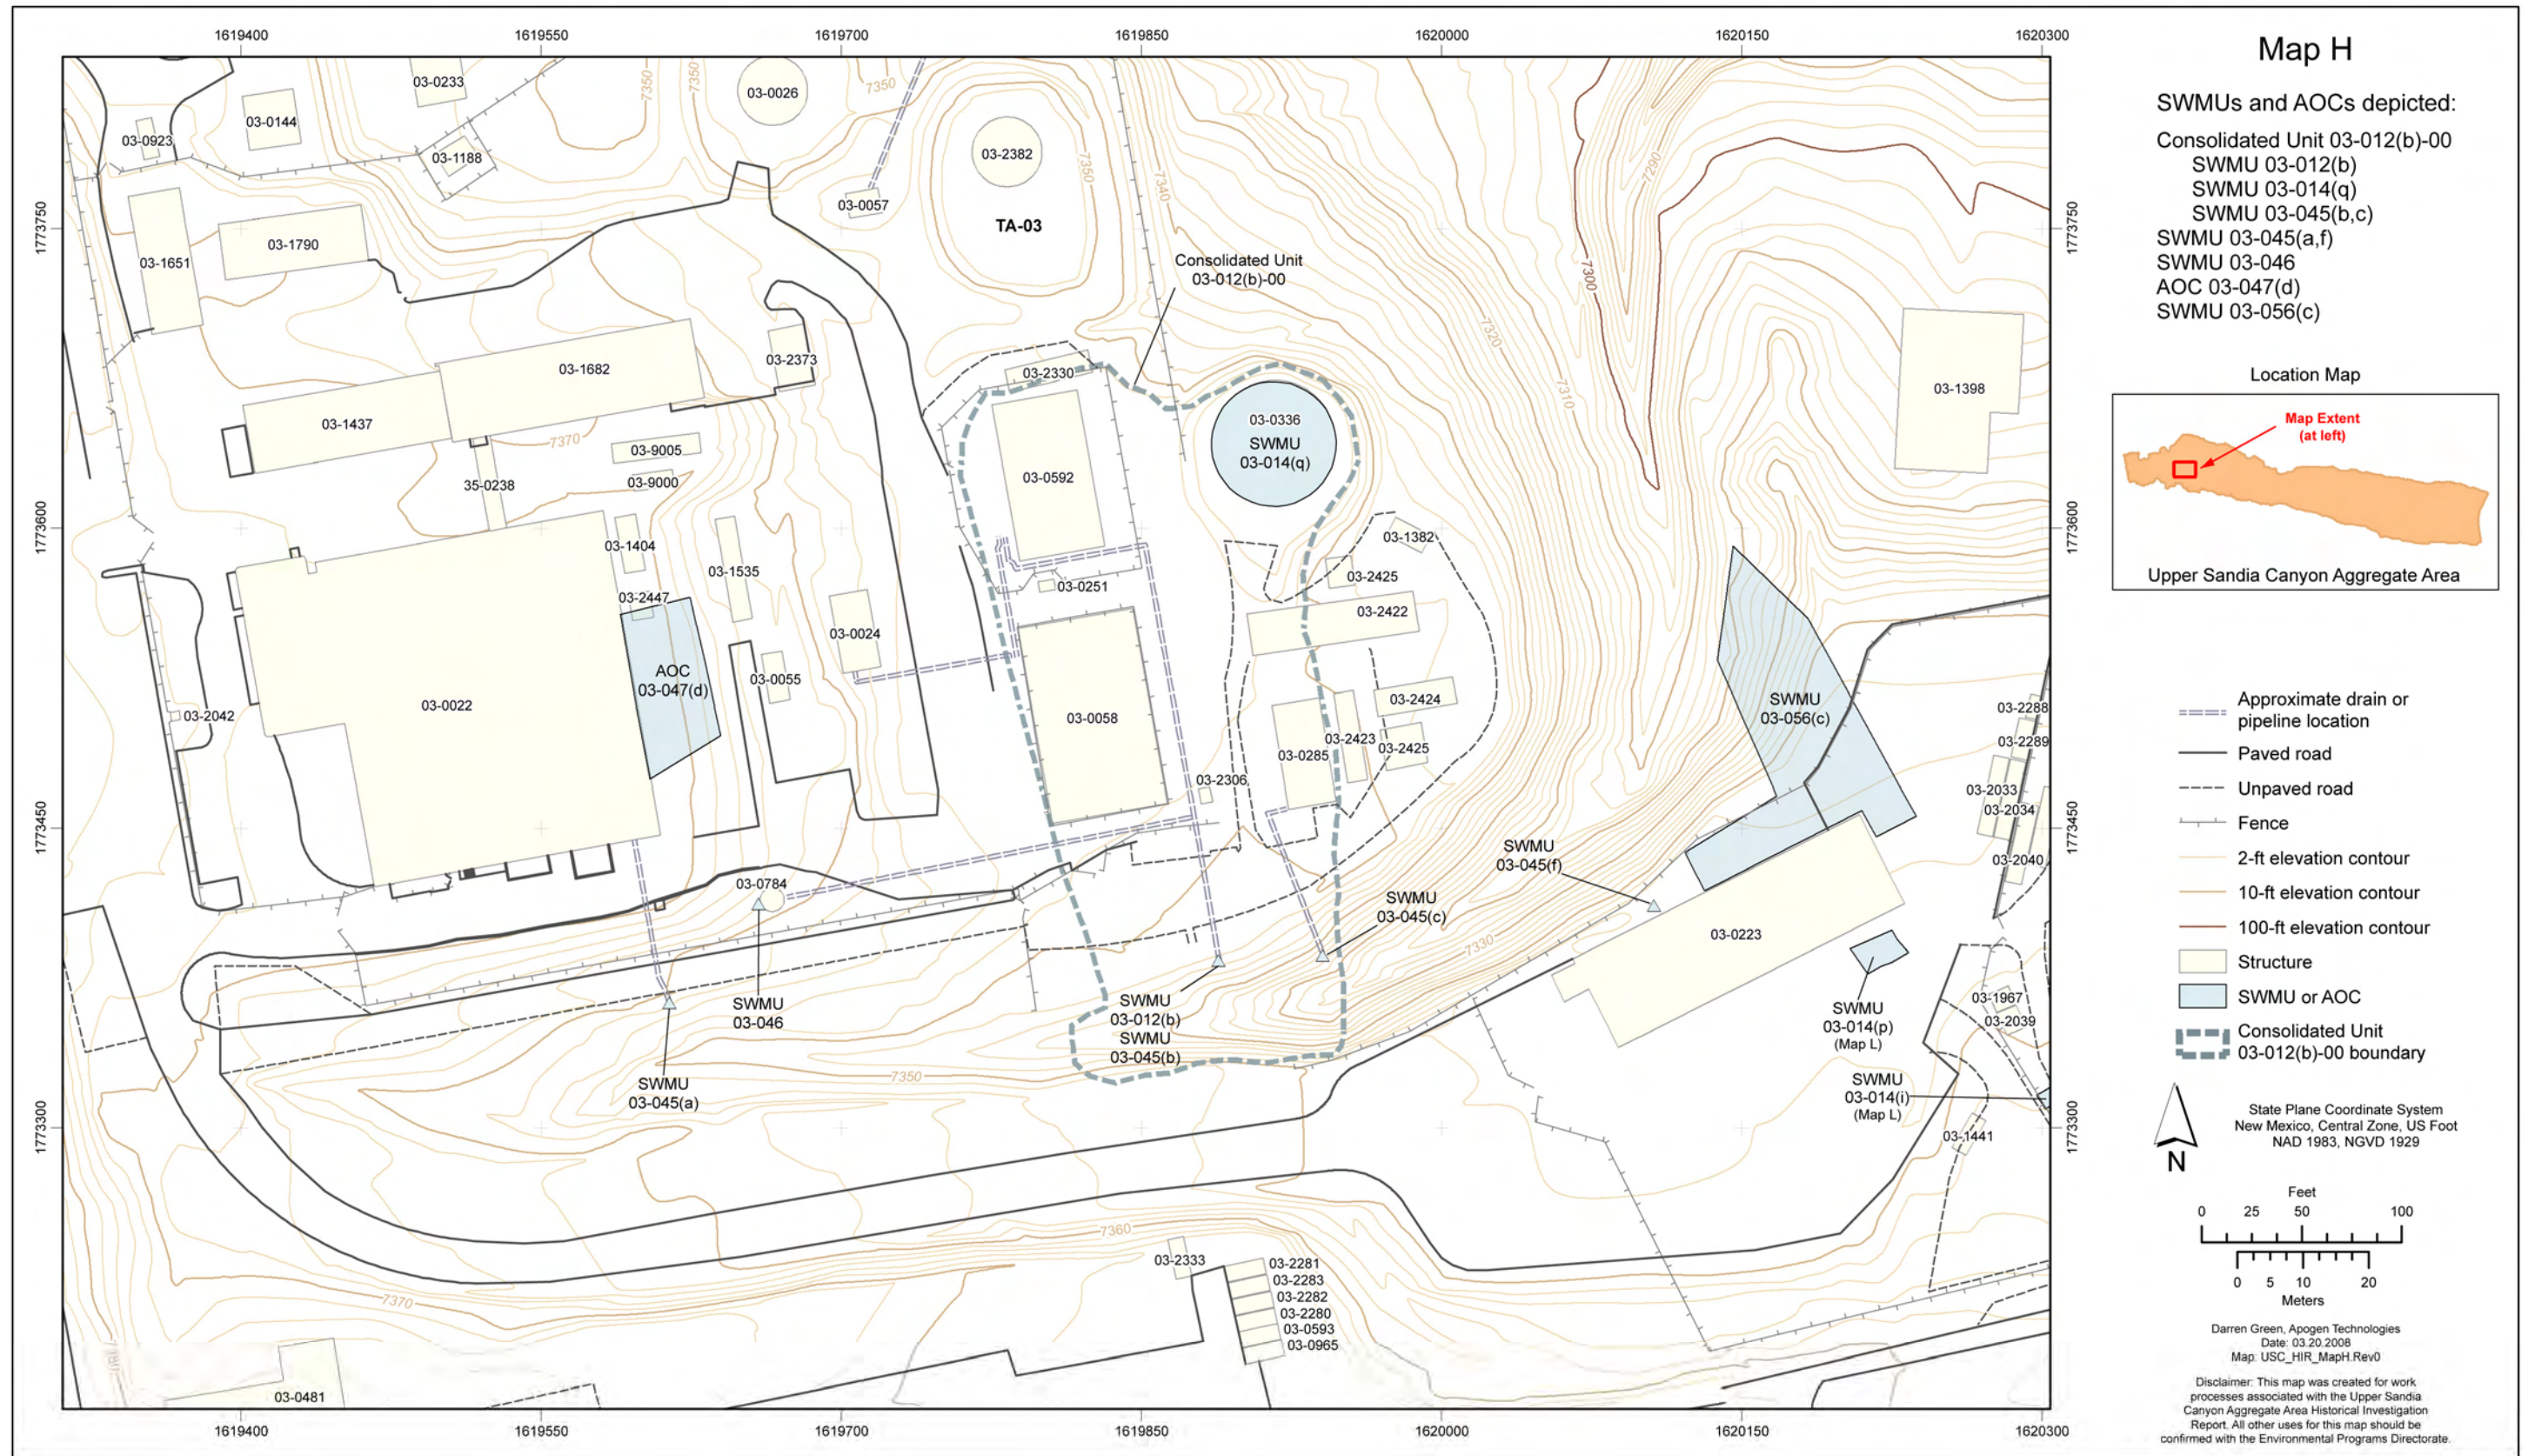


Figure 2.9-1 Map H site location



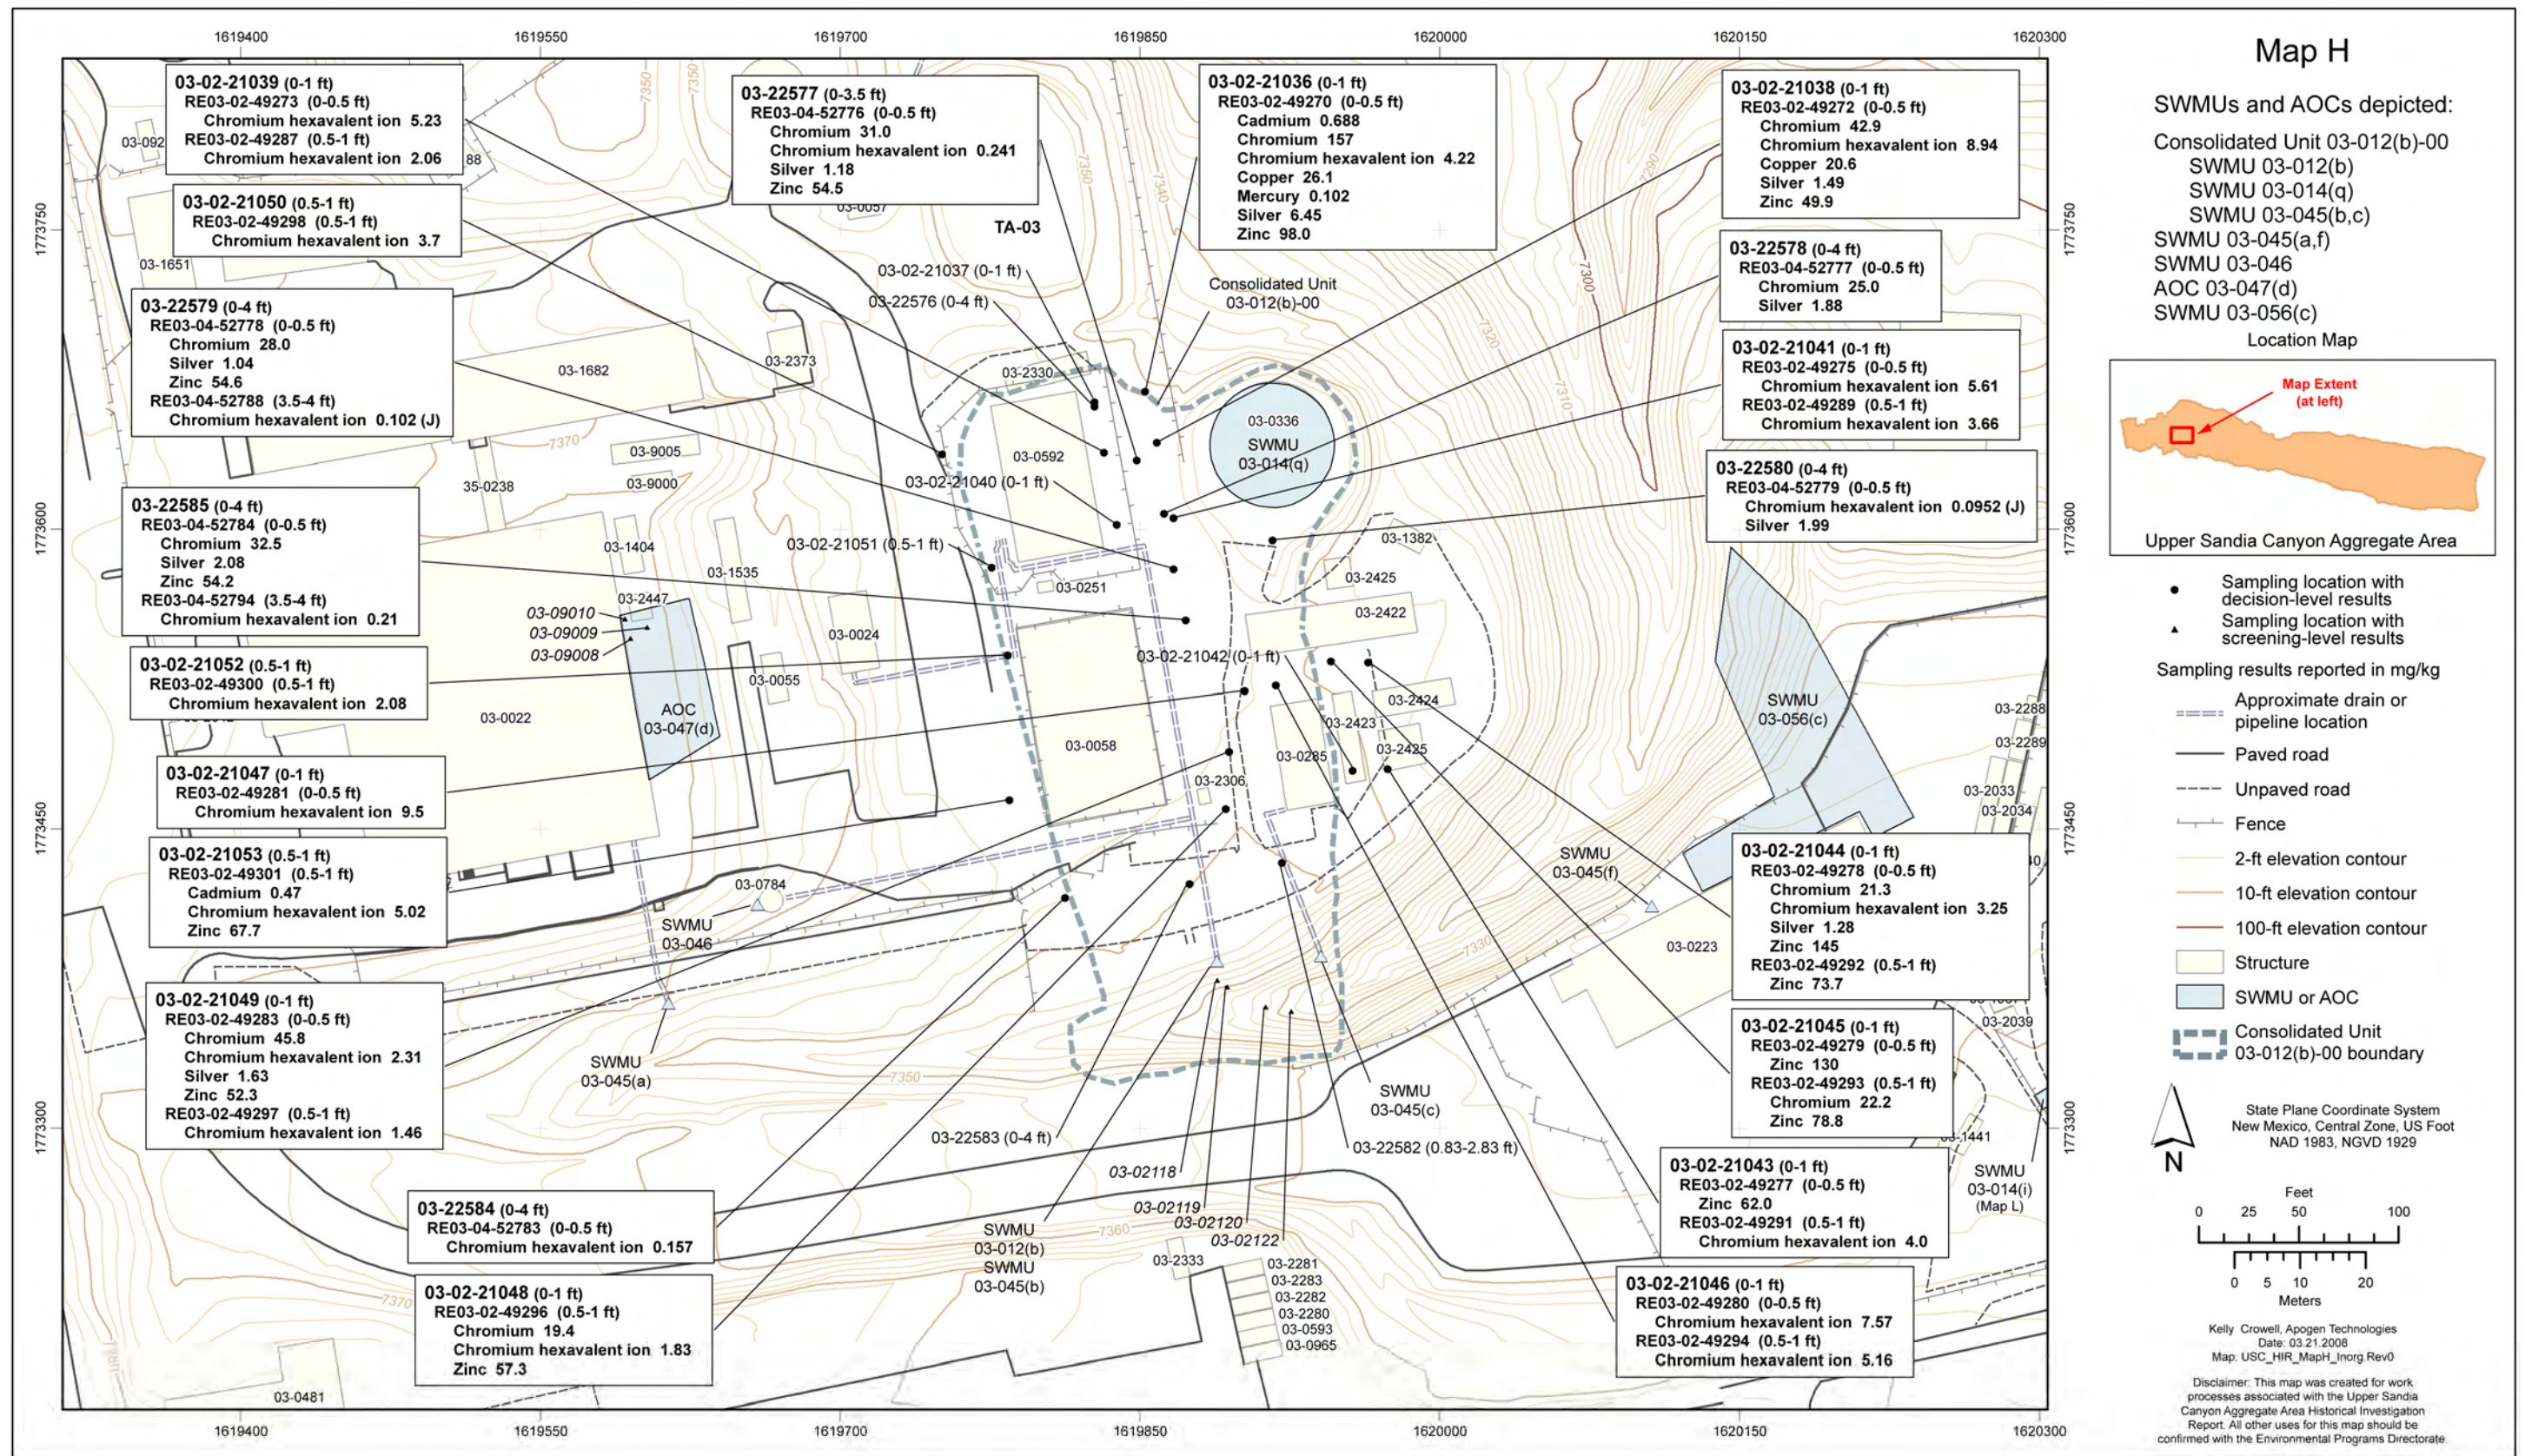


Figure 2.9-2 Map H inorganic chemical sampling locations and results detected above BVs



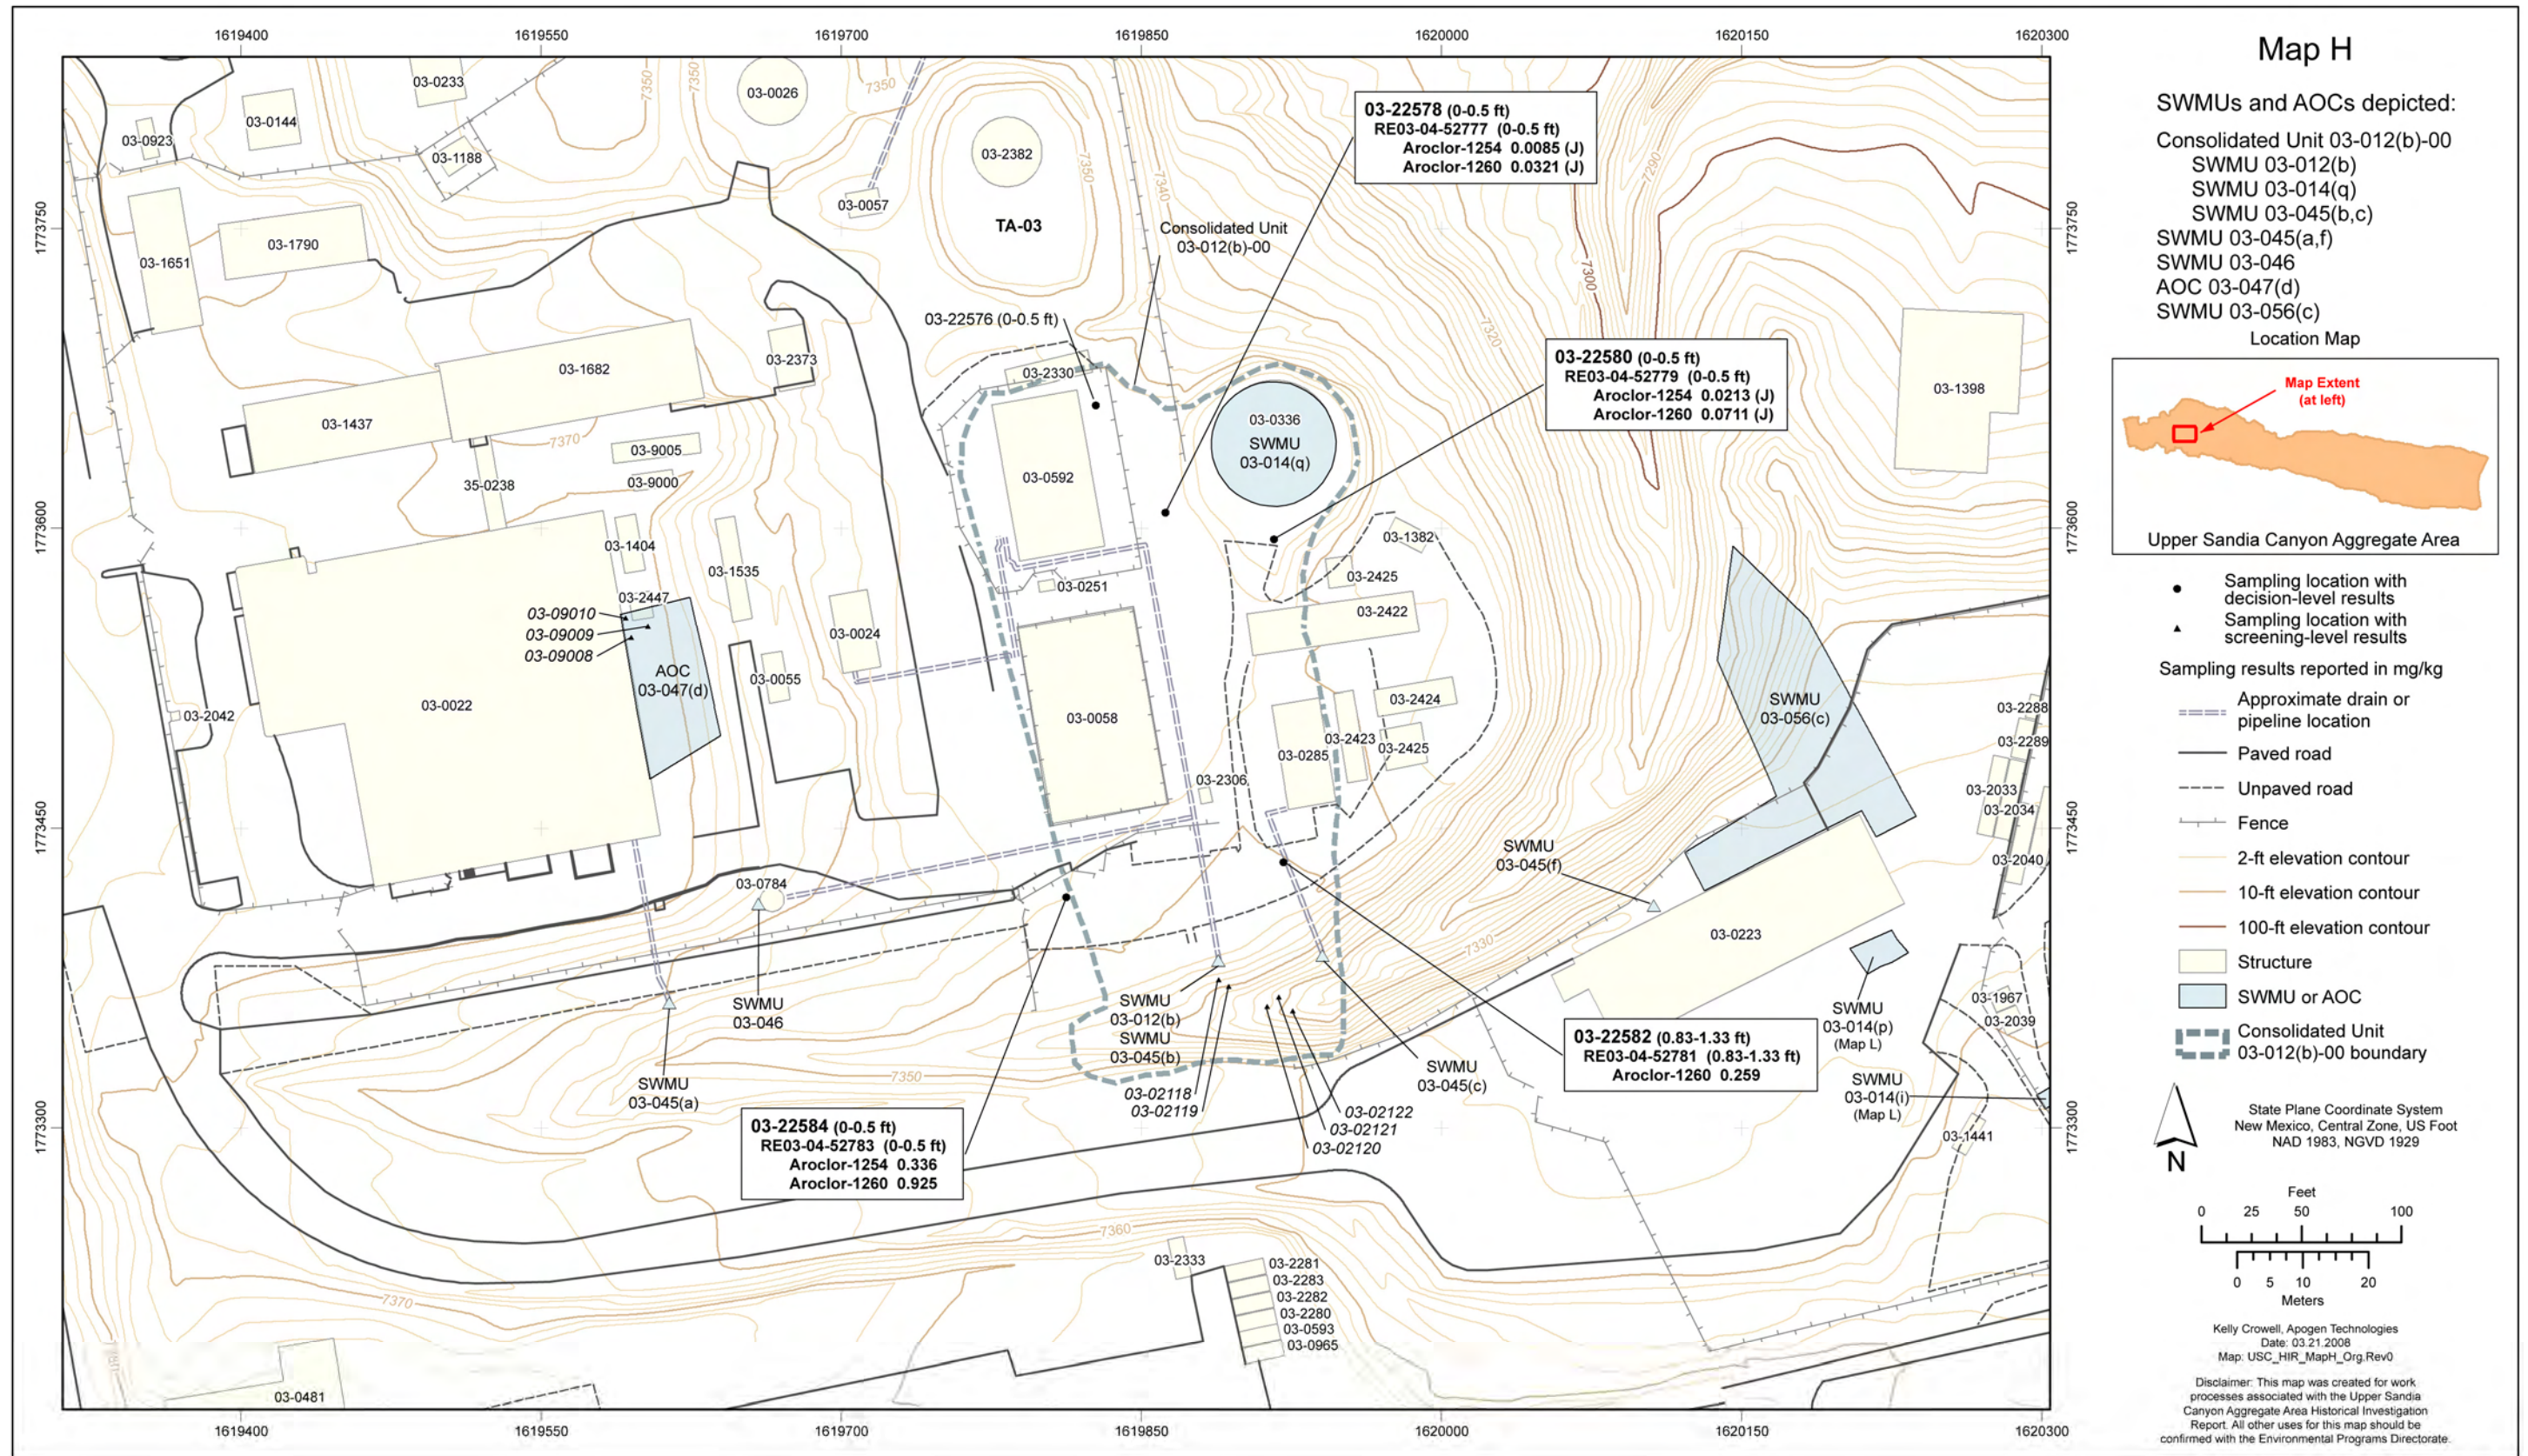


Figure 2.9-3 Map H organic chemical sampling locations and detected results



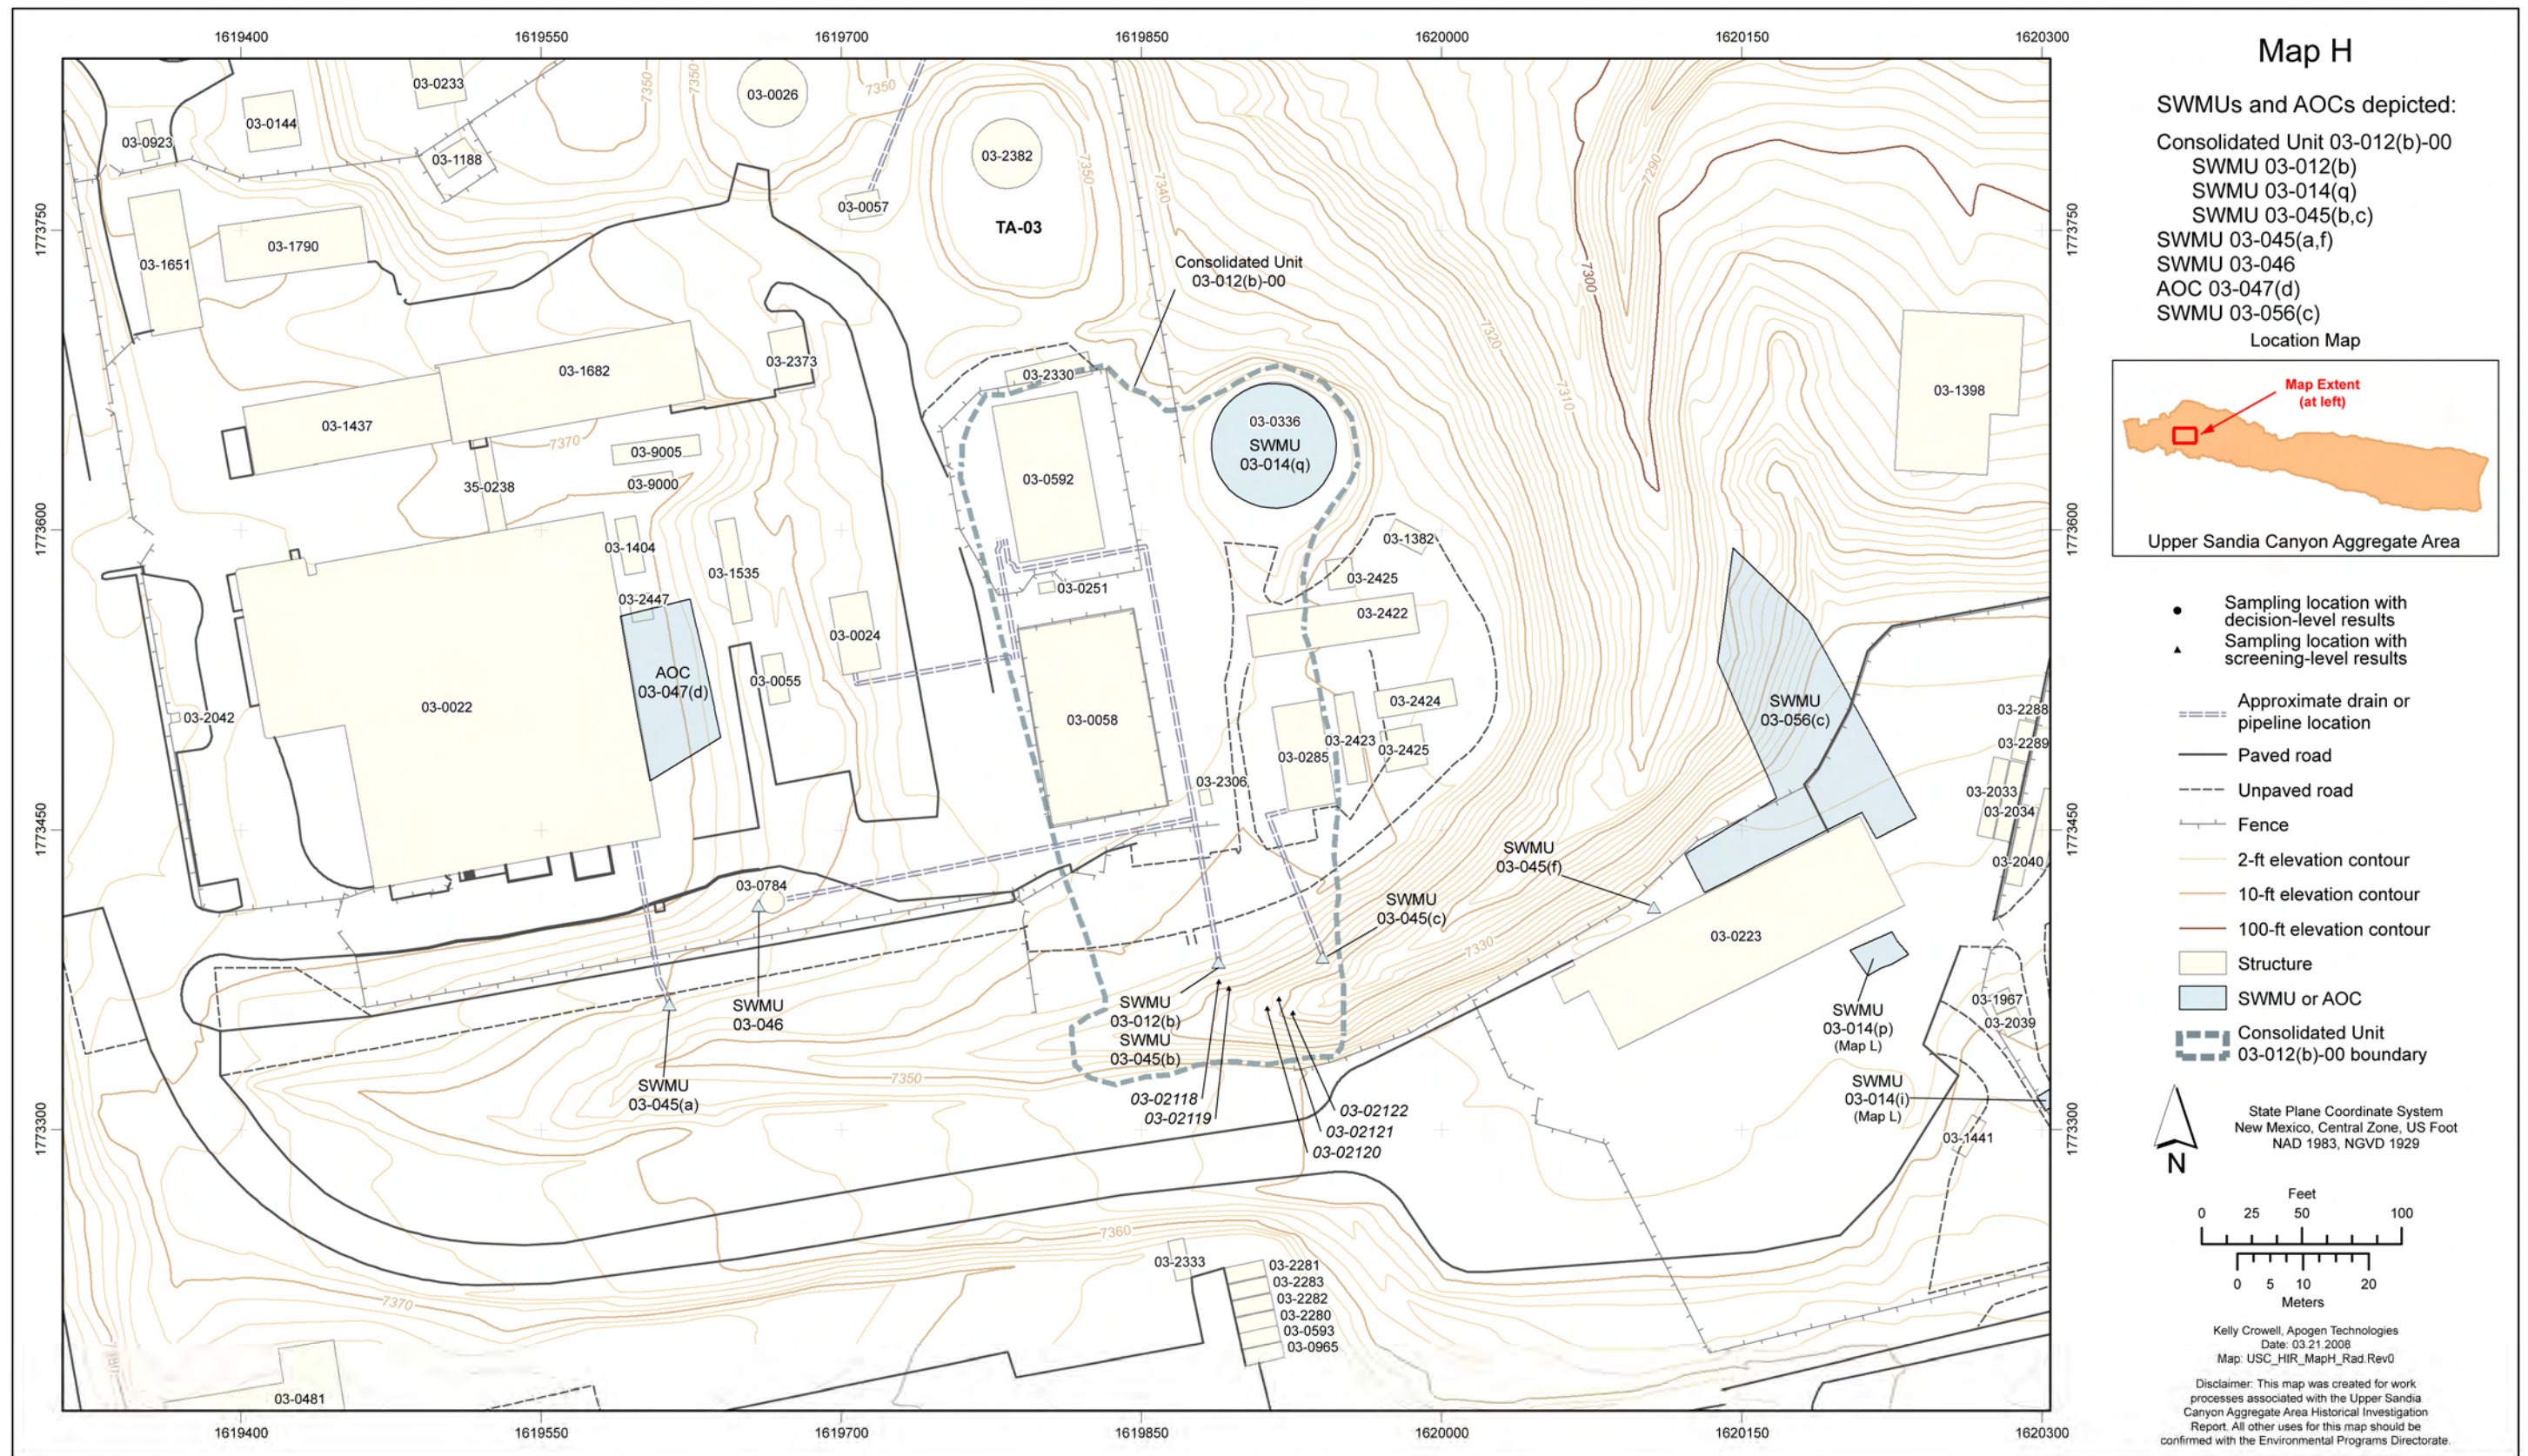


Figure 2.9-4 Map H radionuclide sampling locations



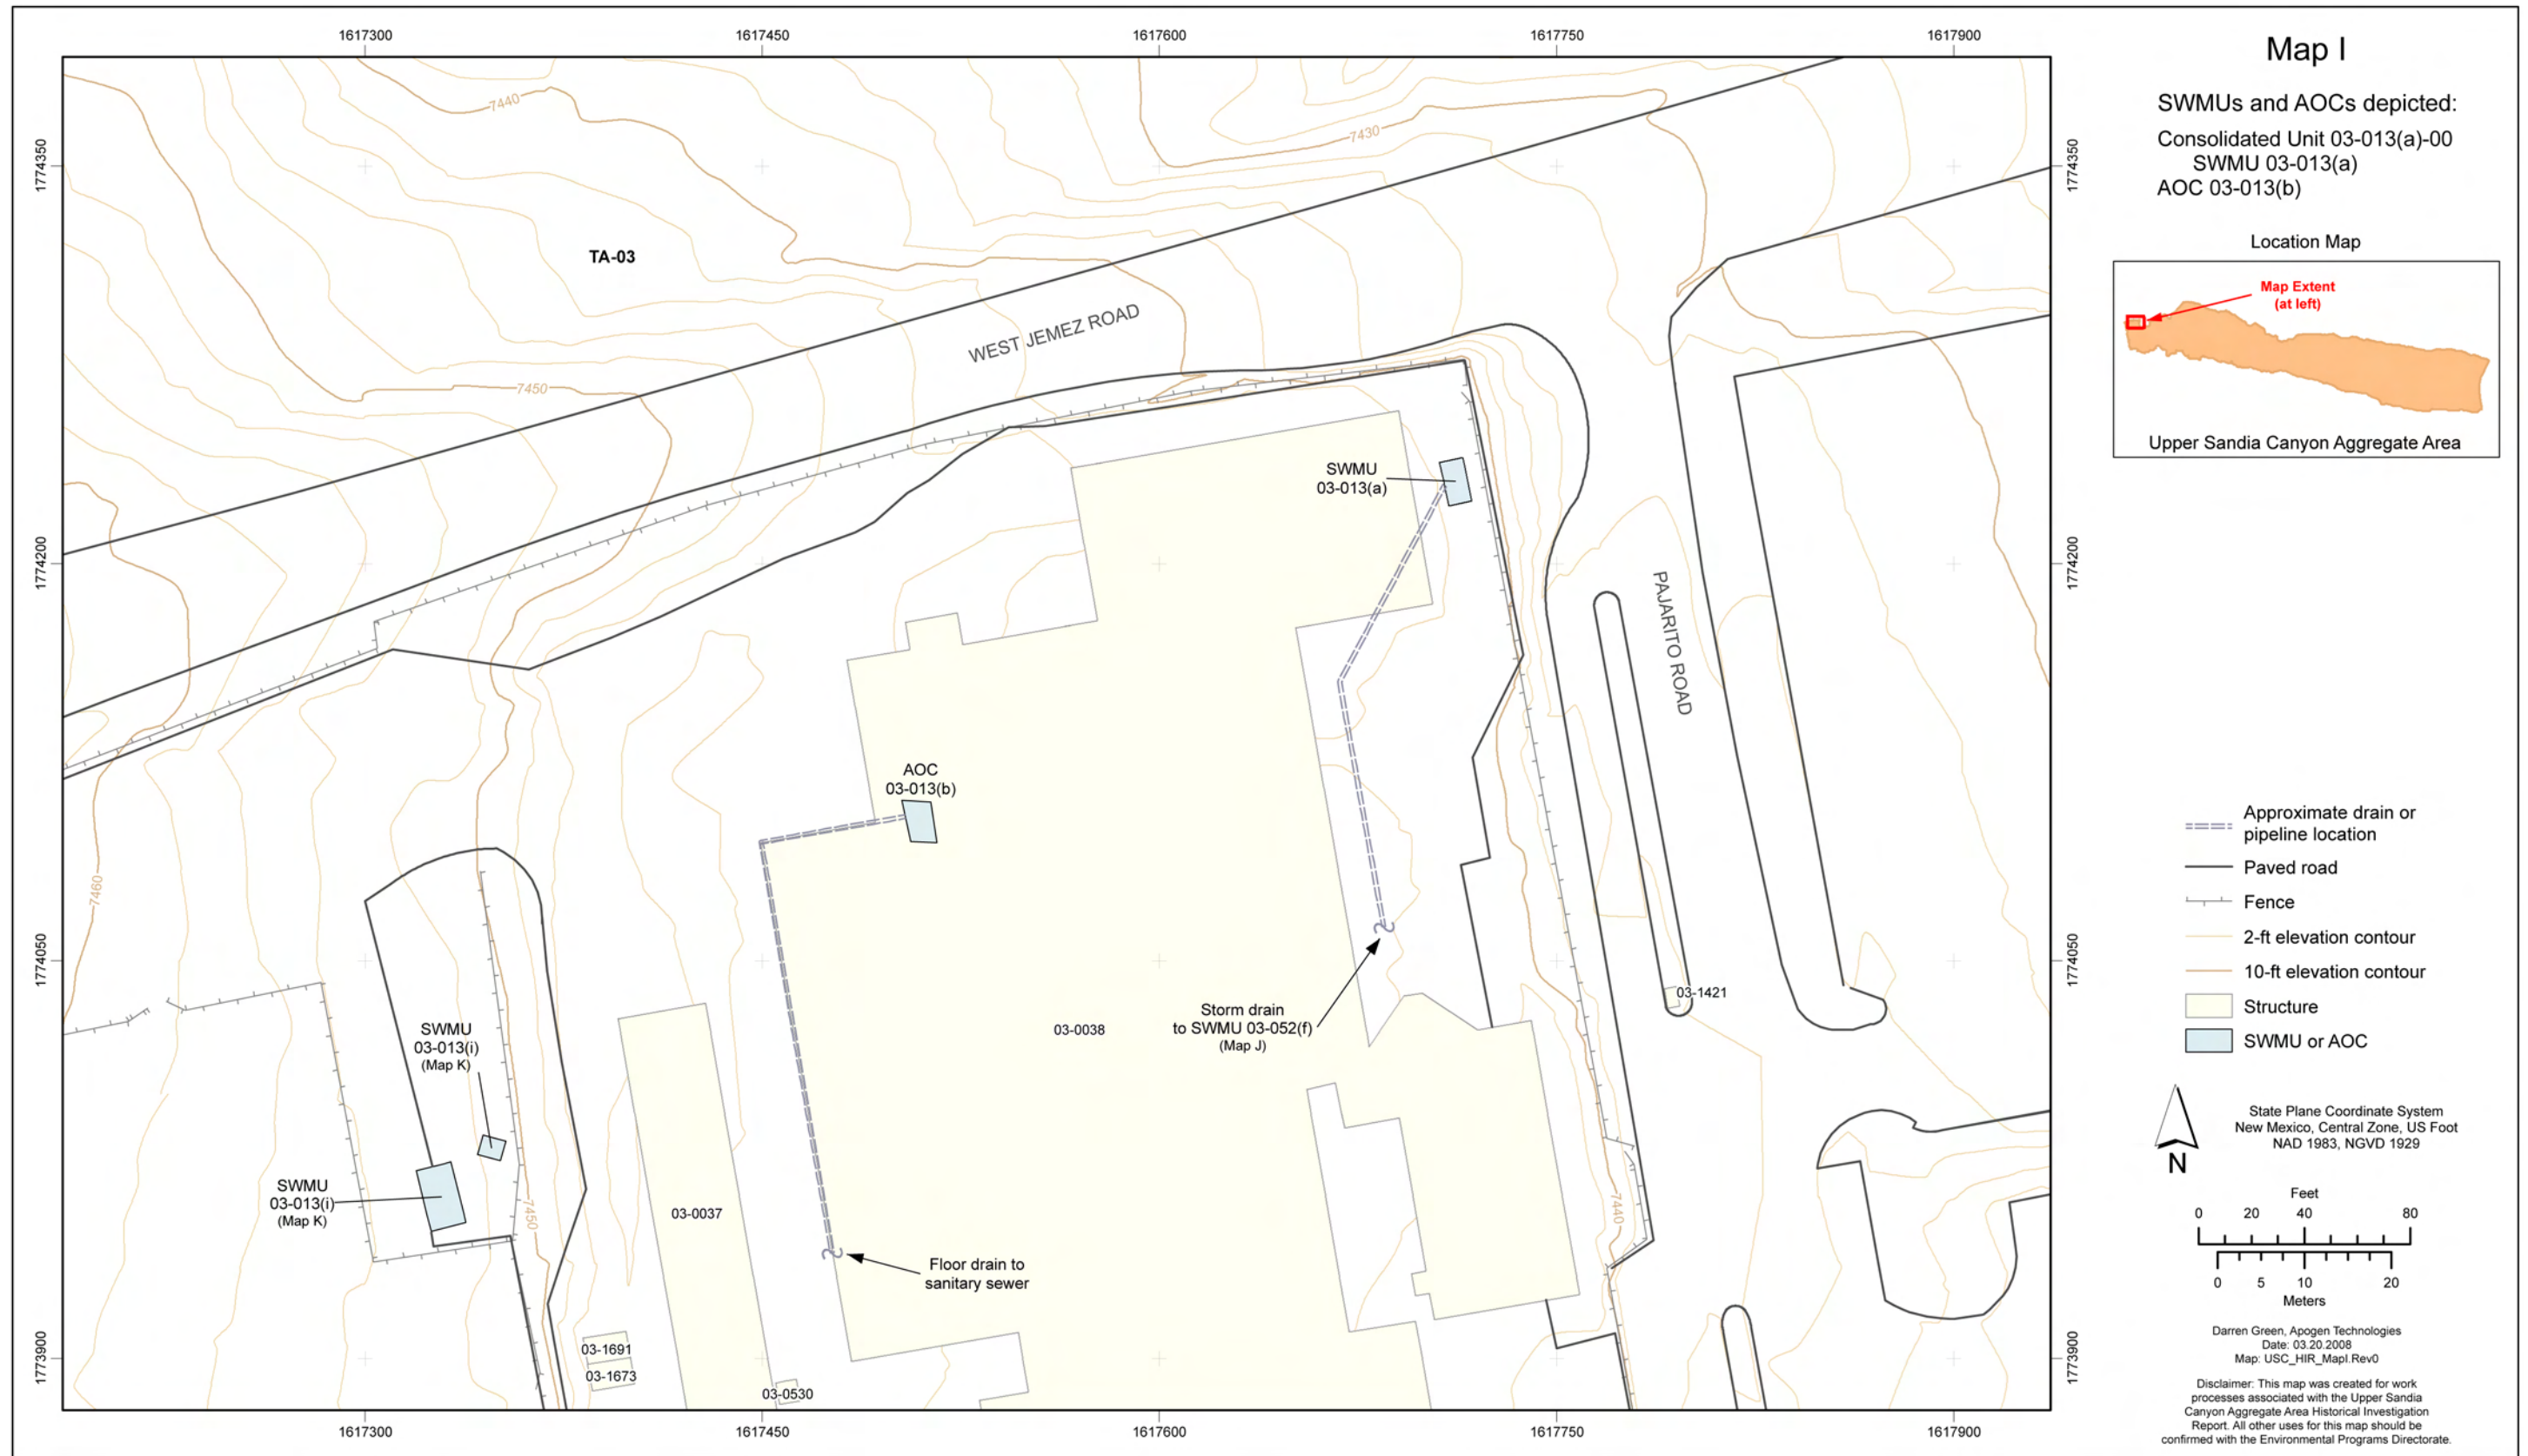


Figure 2.10-1 Map I site location

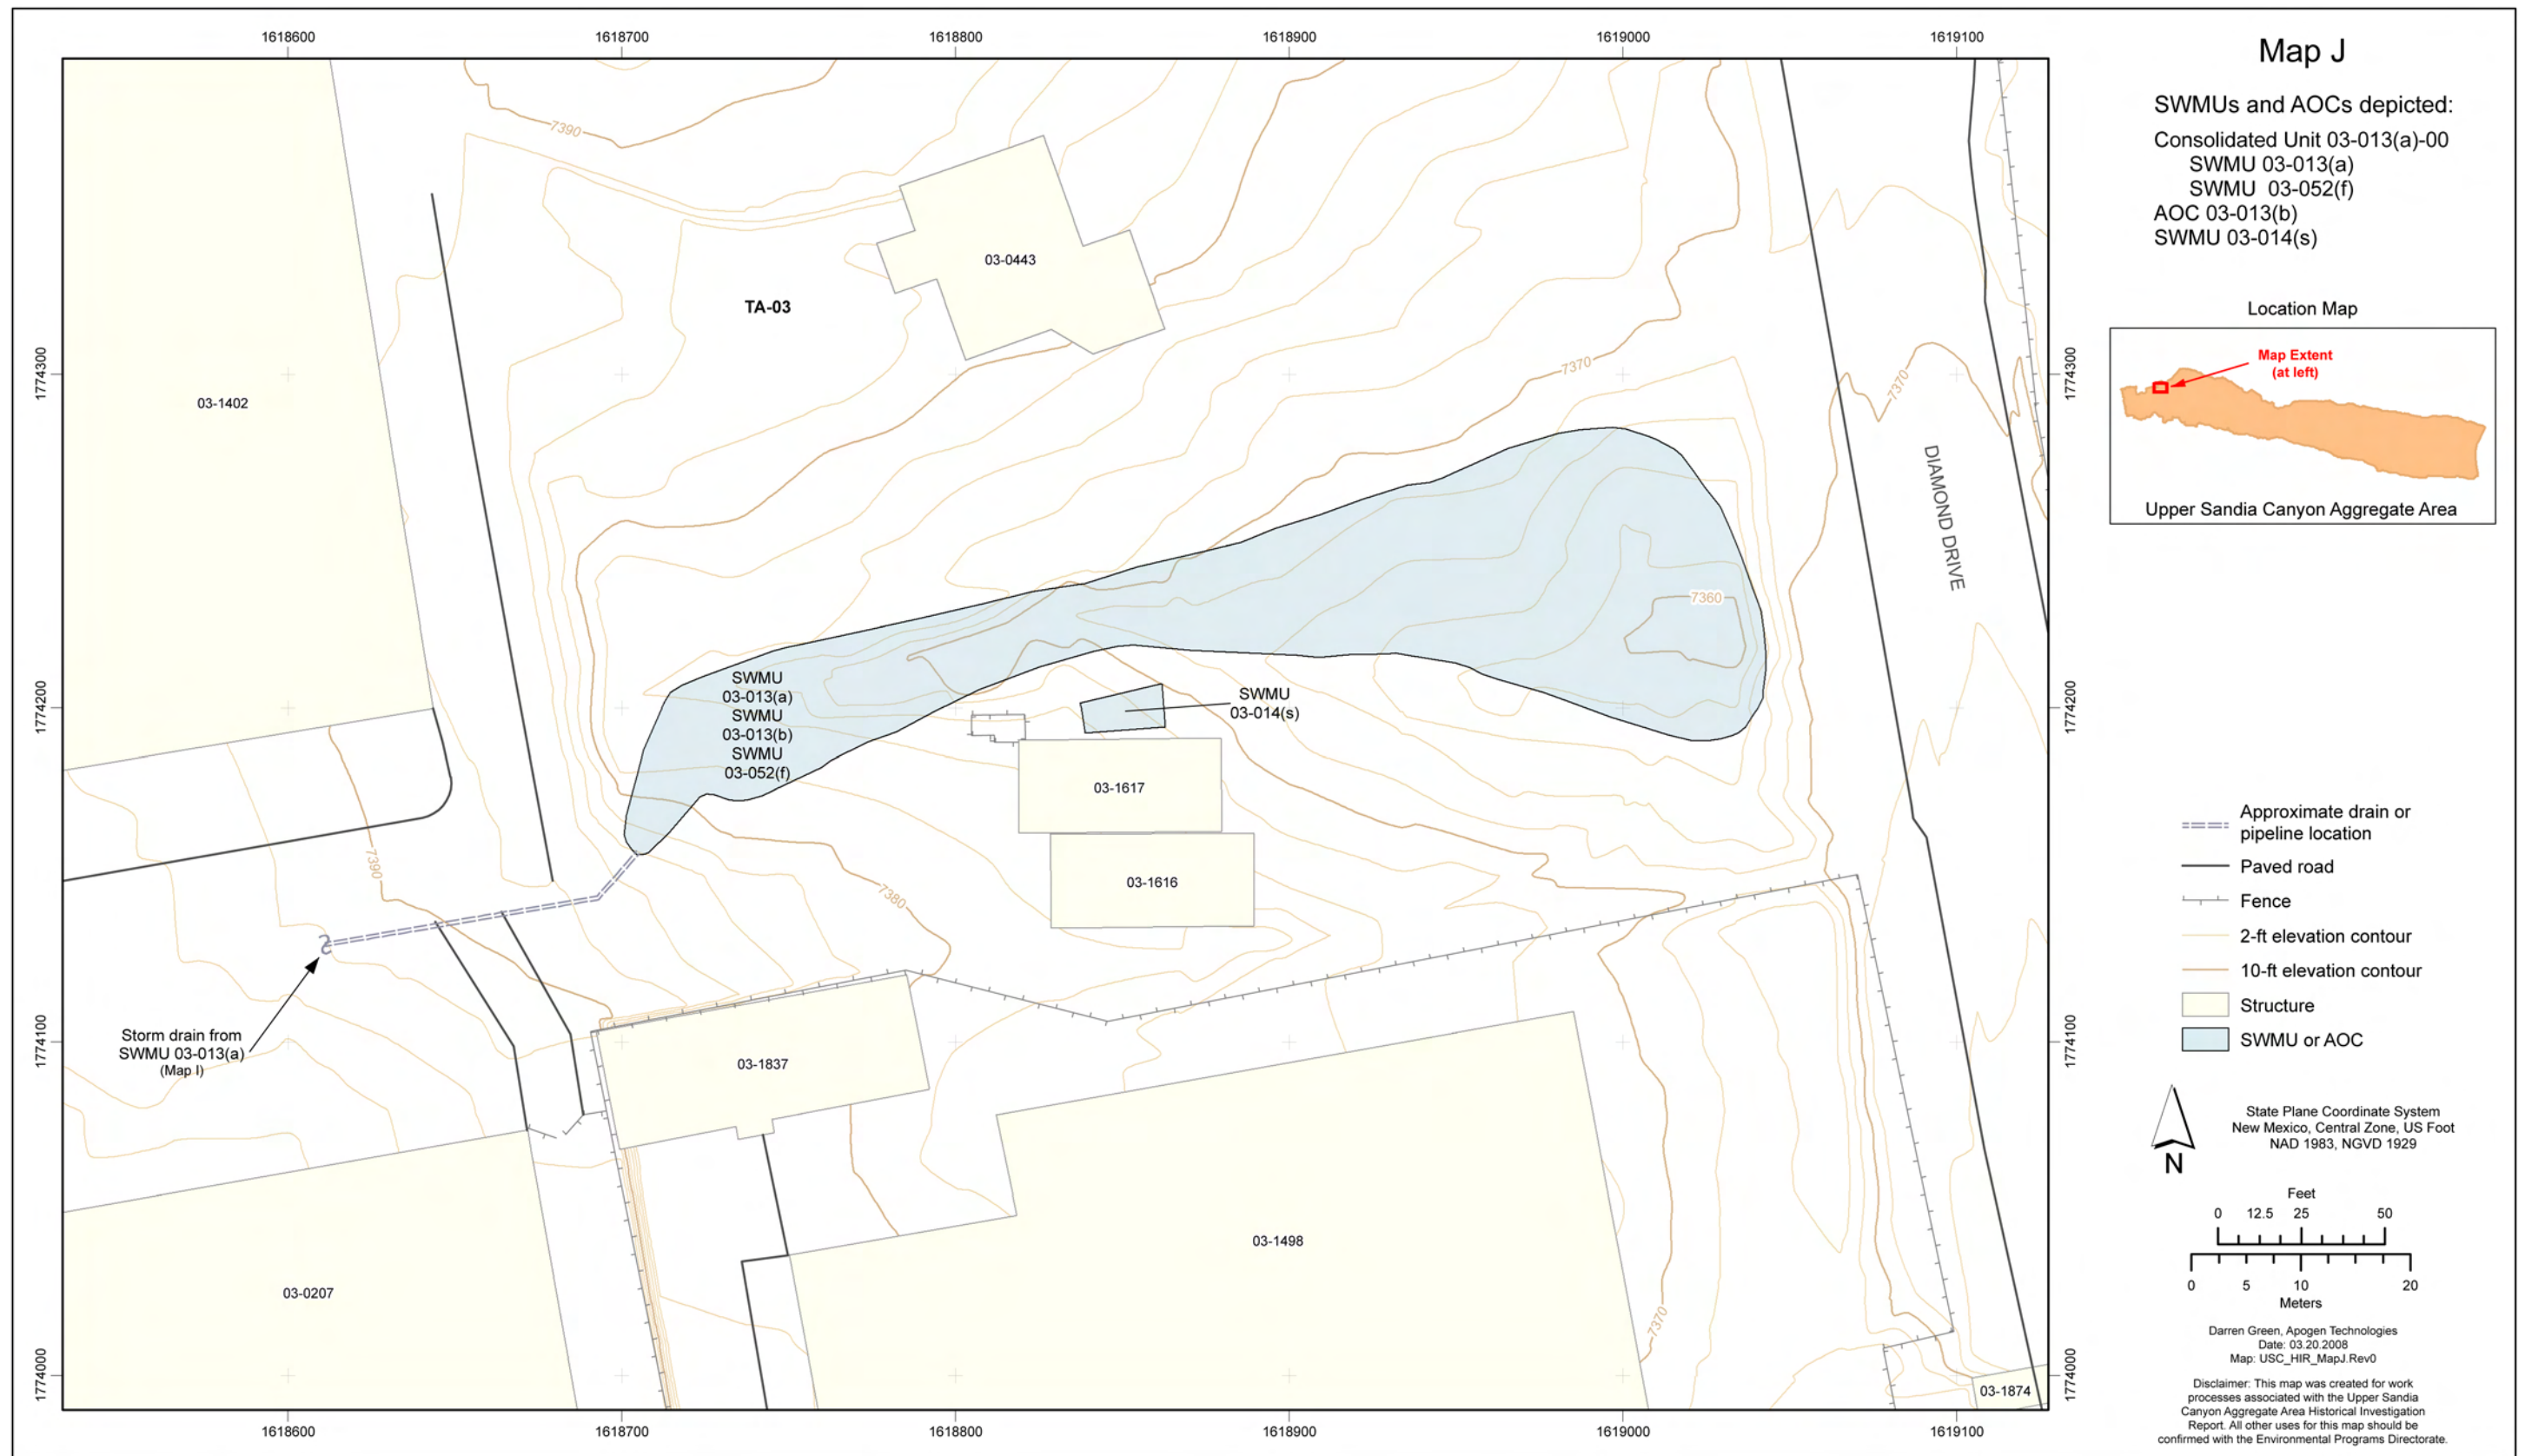


Figure 2.10-2 Map J site location



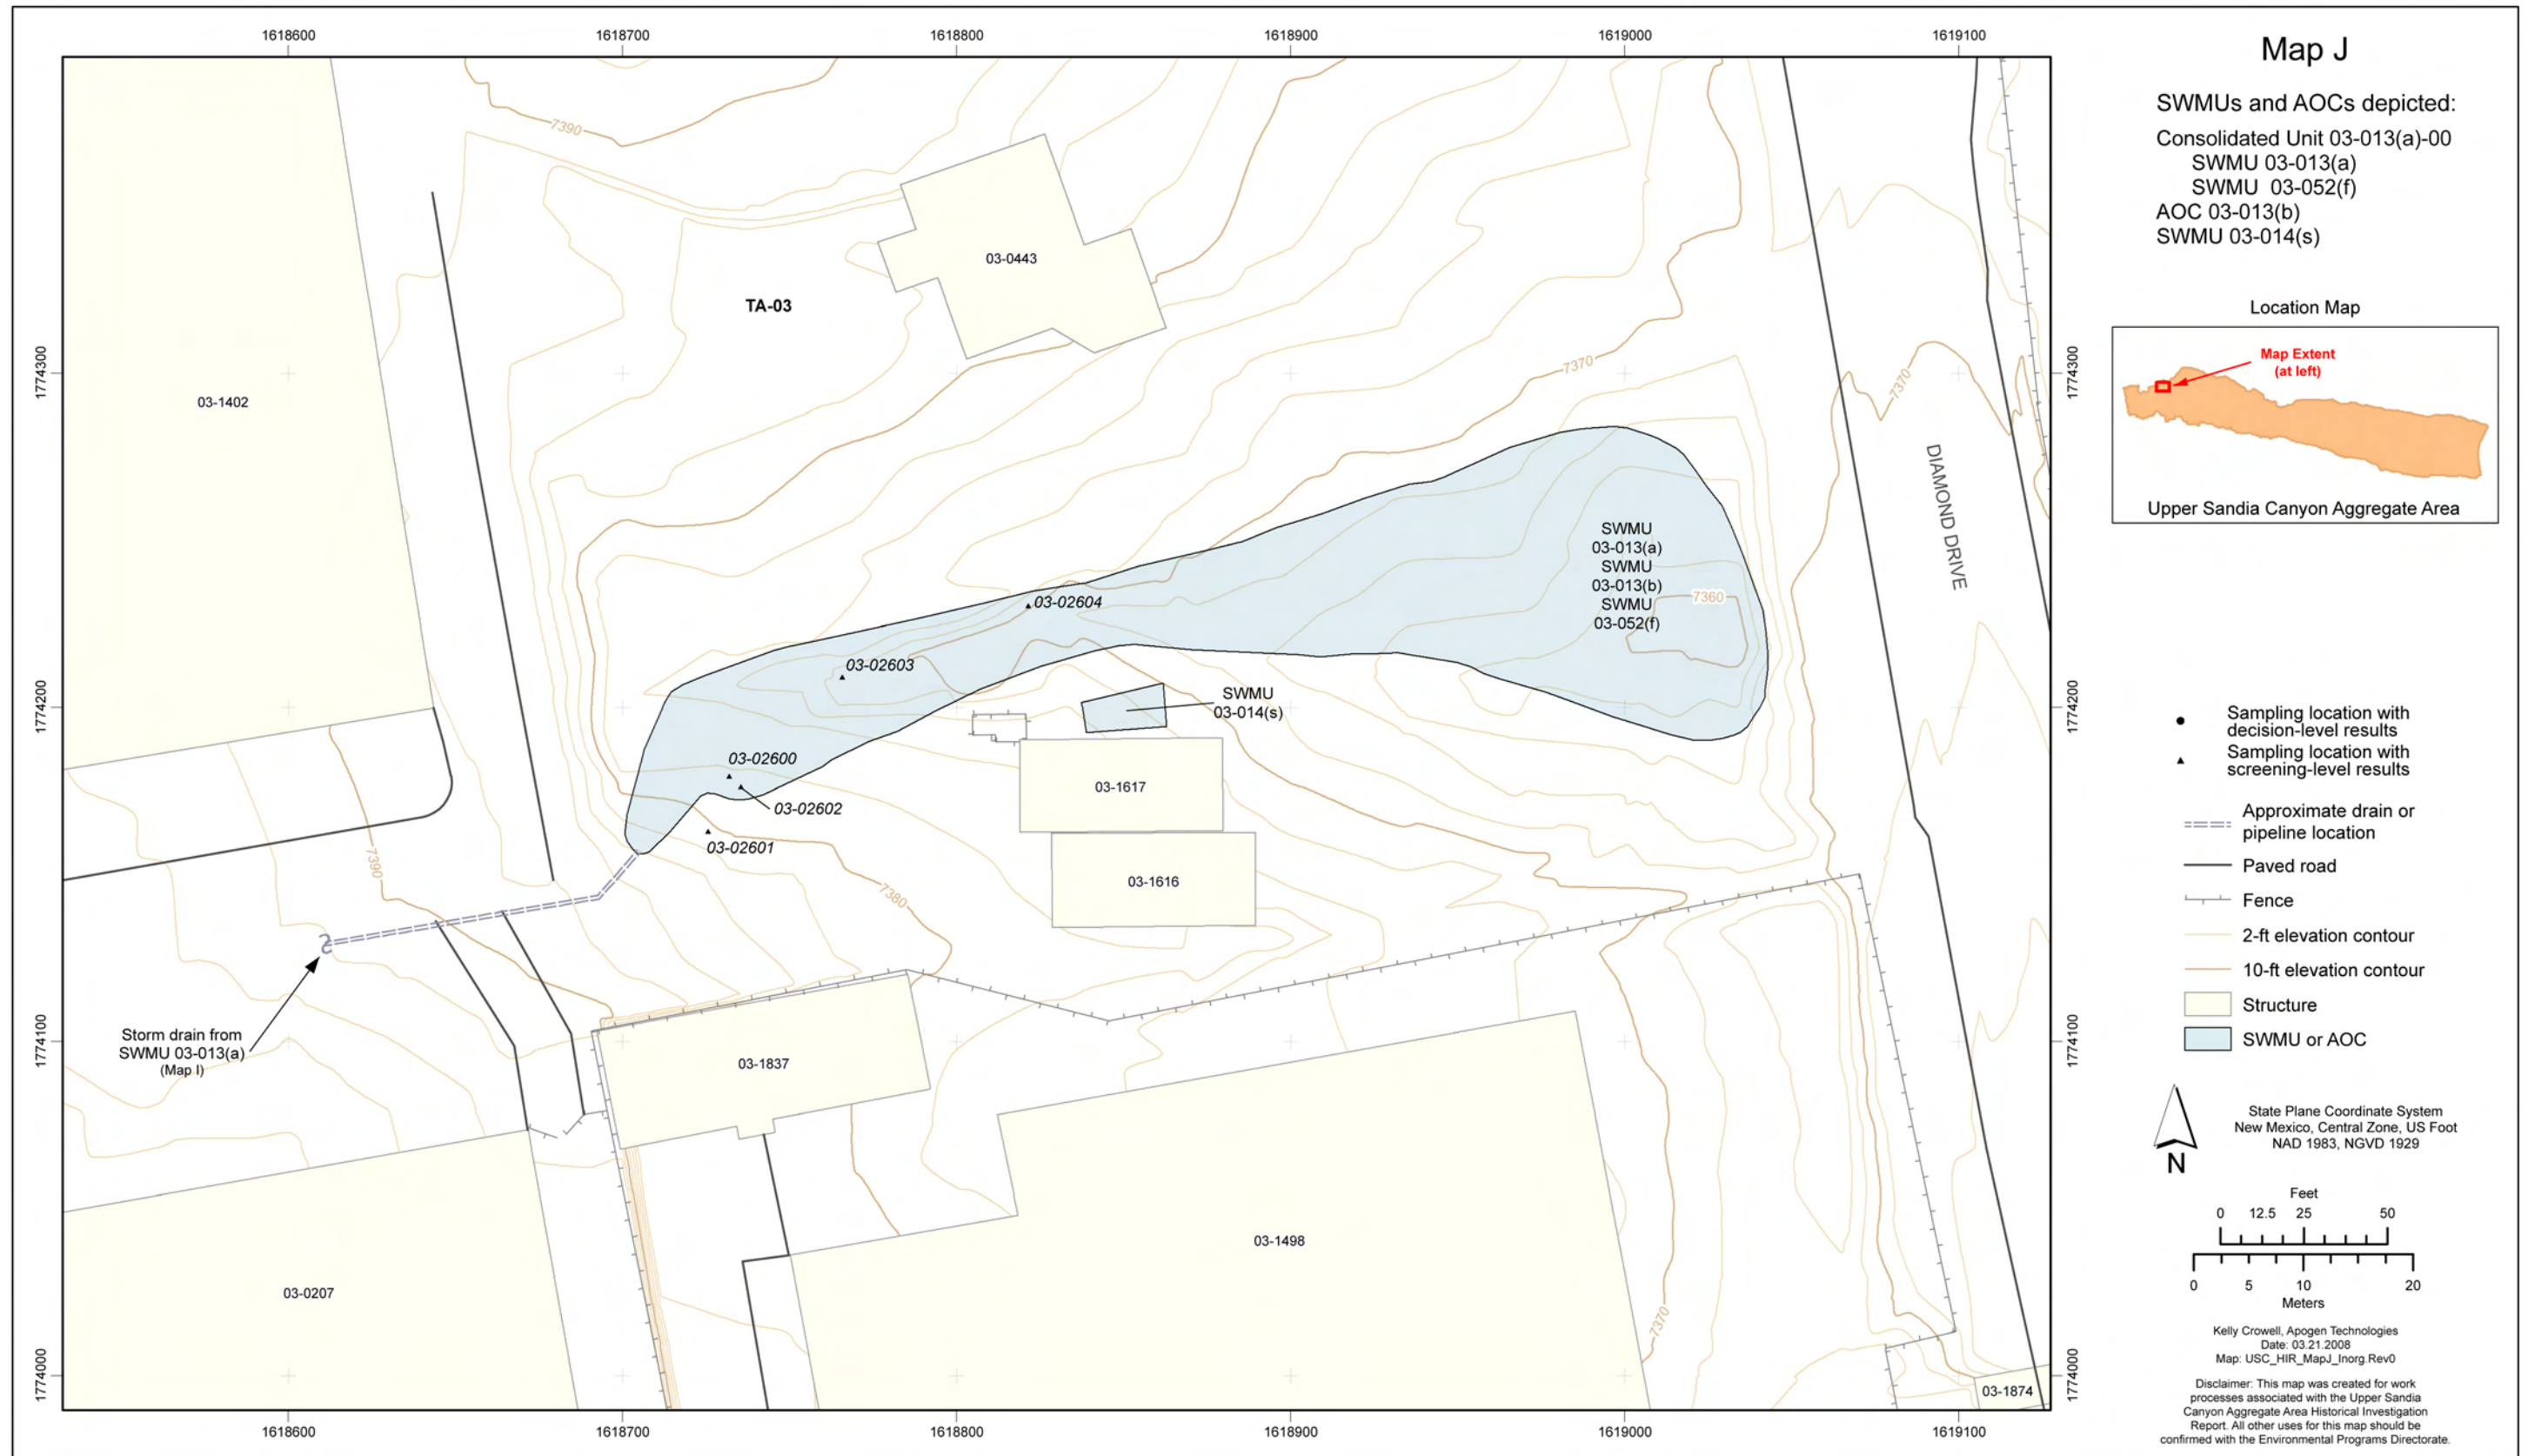


Figure 2.10-3 Map J inorganic chemical sampling locations

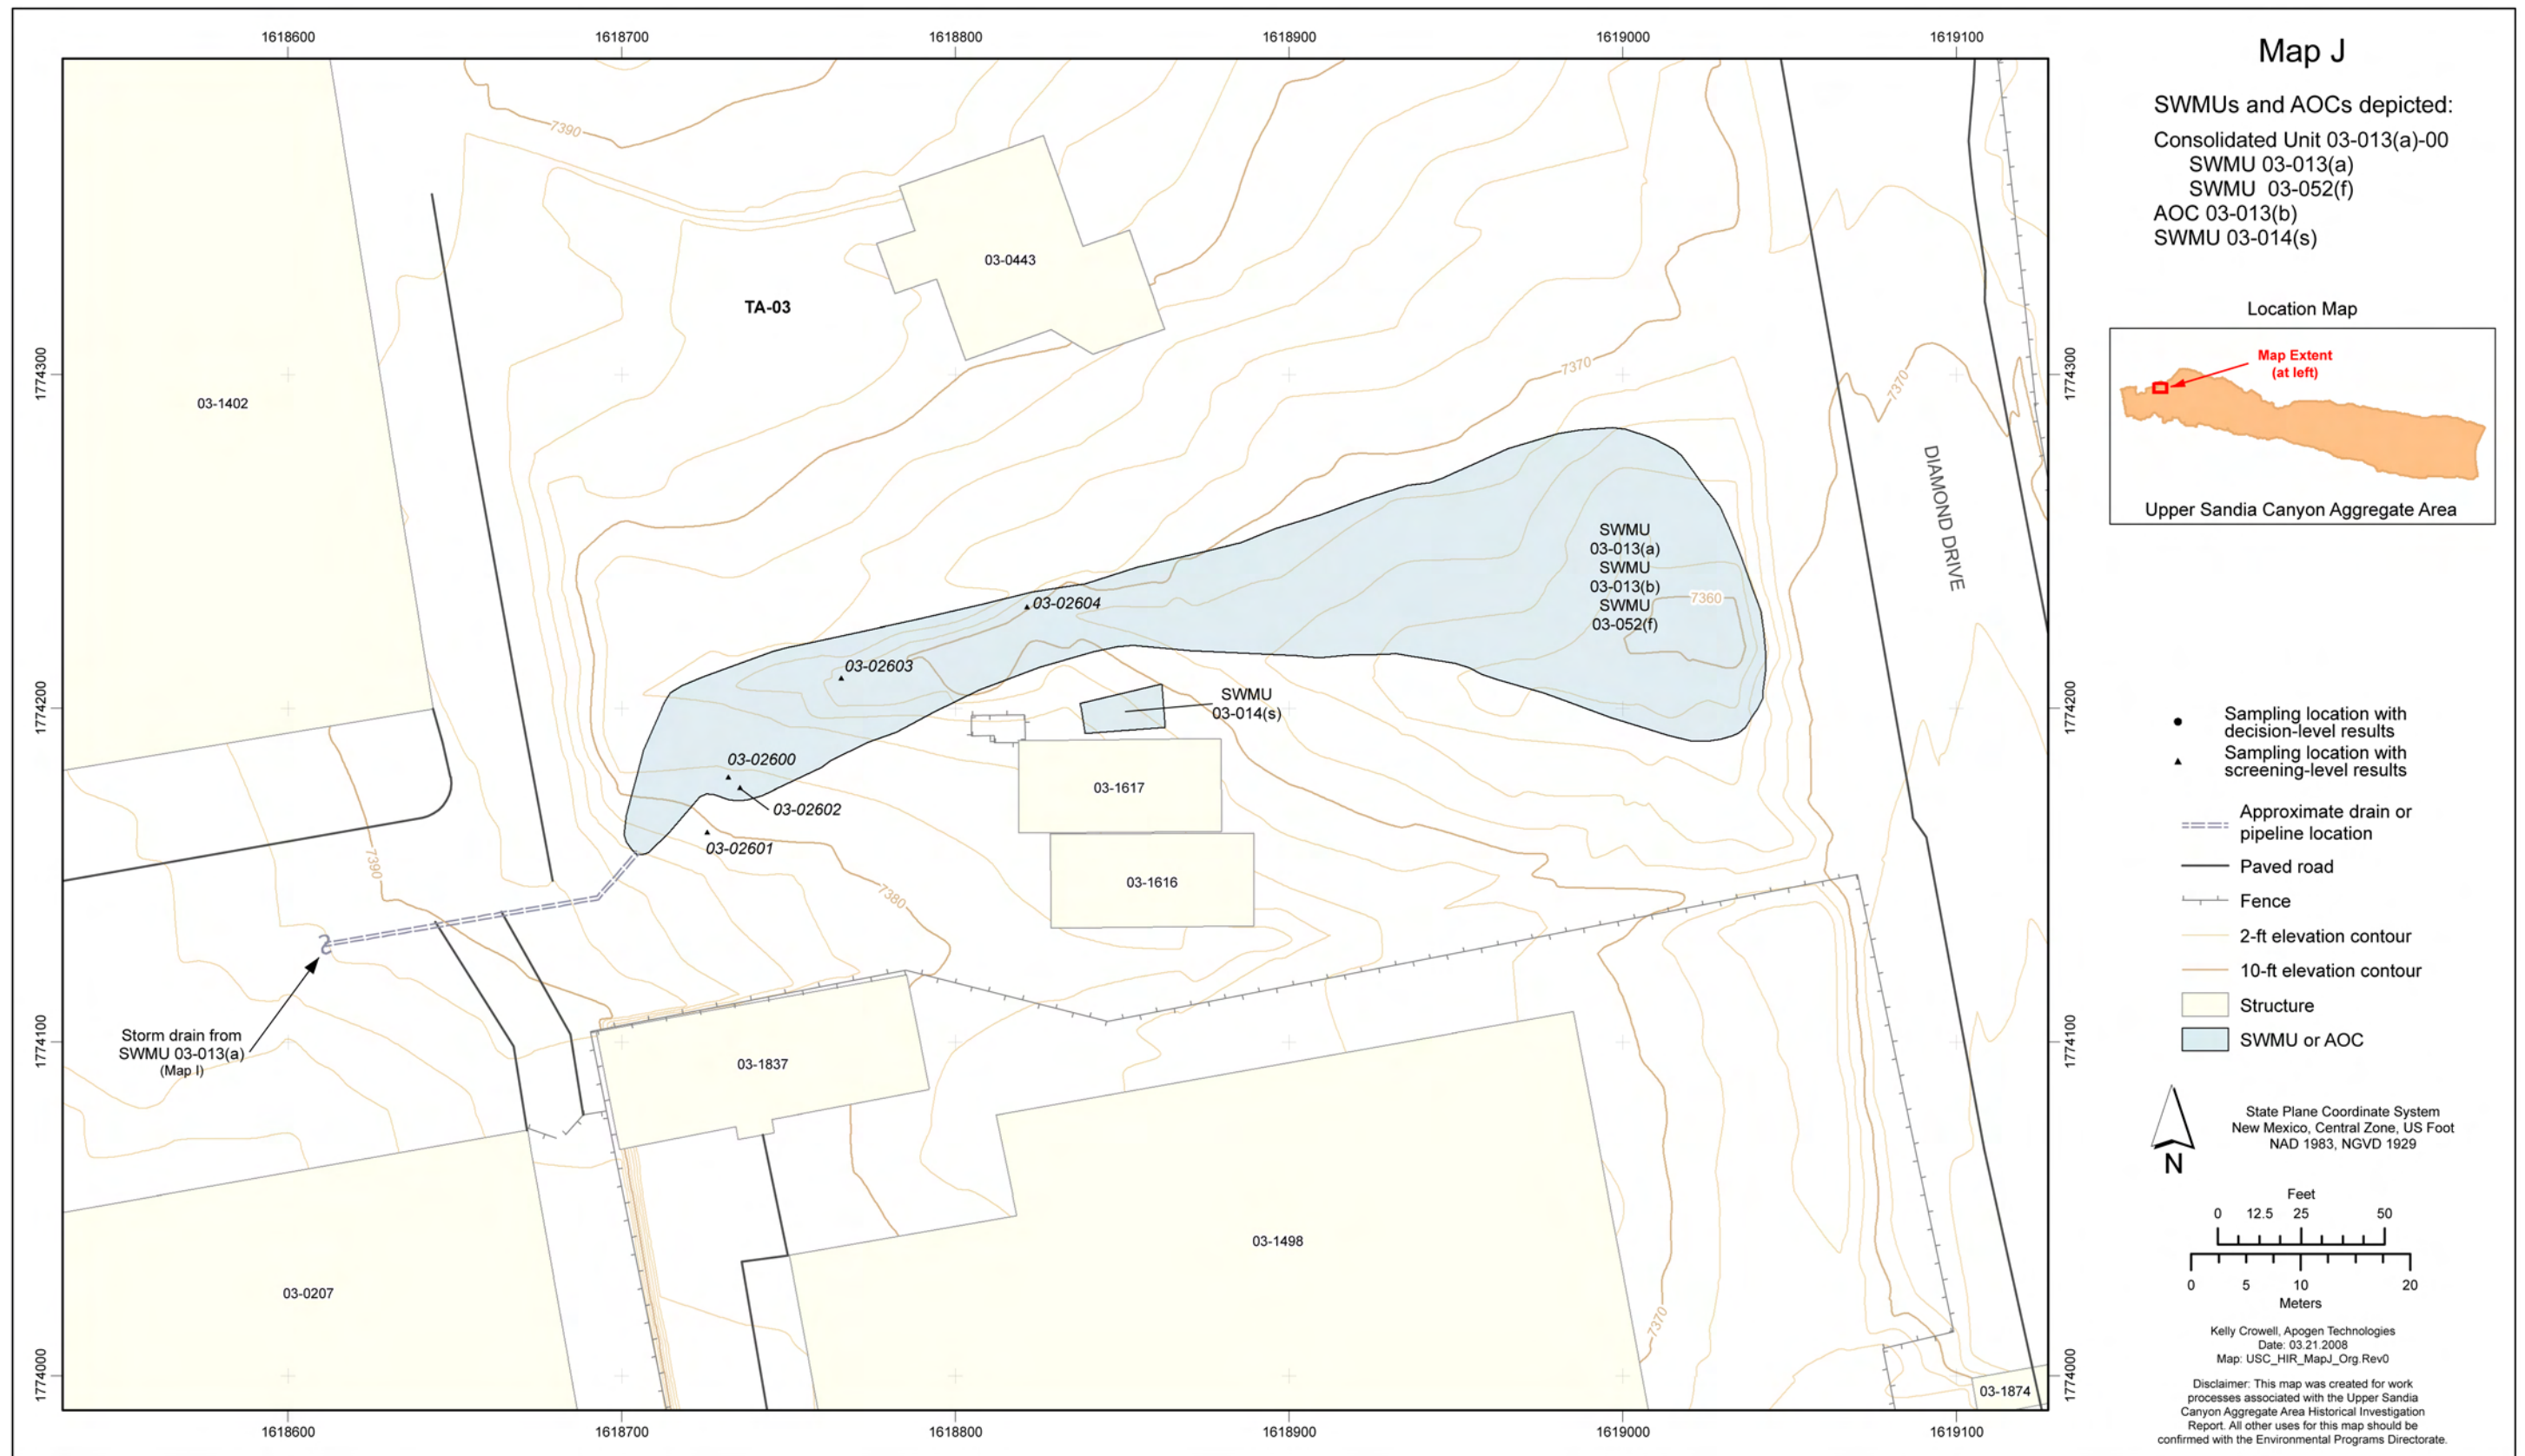


Figure 2.10-4 Map J organic chemical sampling locations



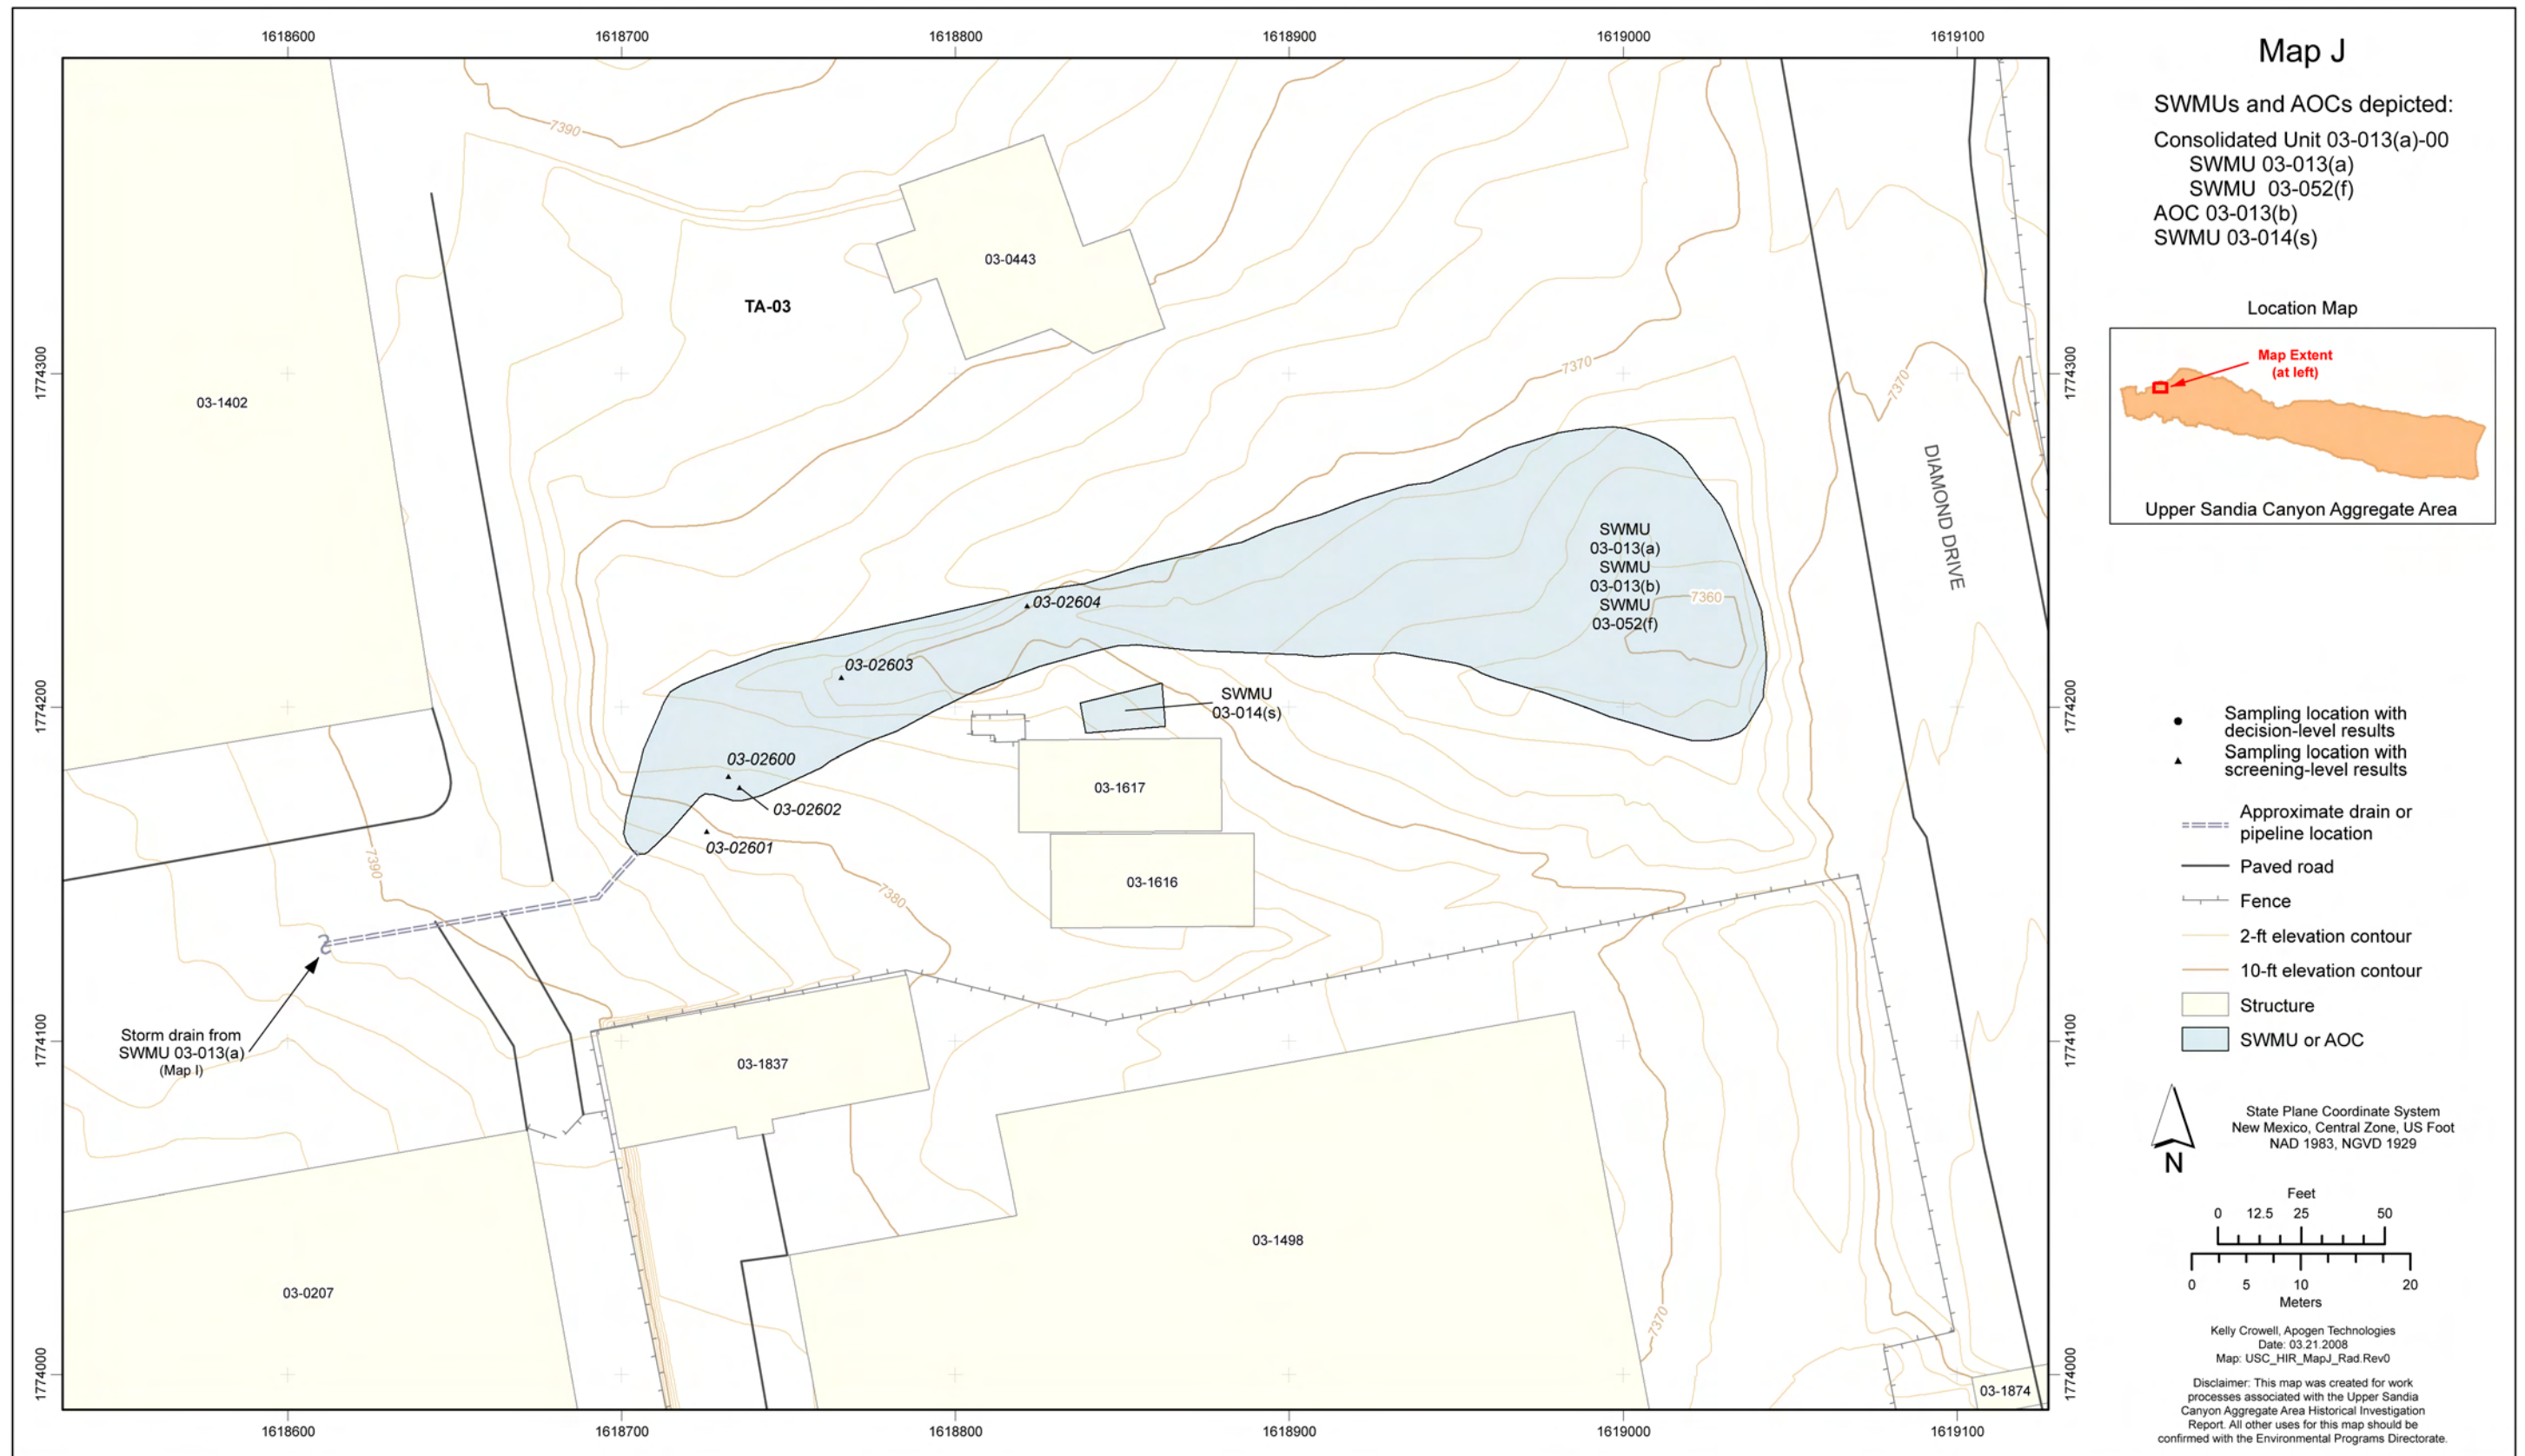


Figure 2.10-5 Map J radionuclide sampling locations

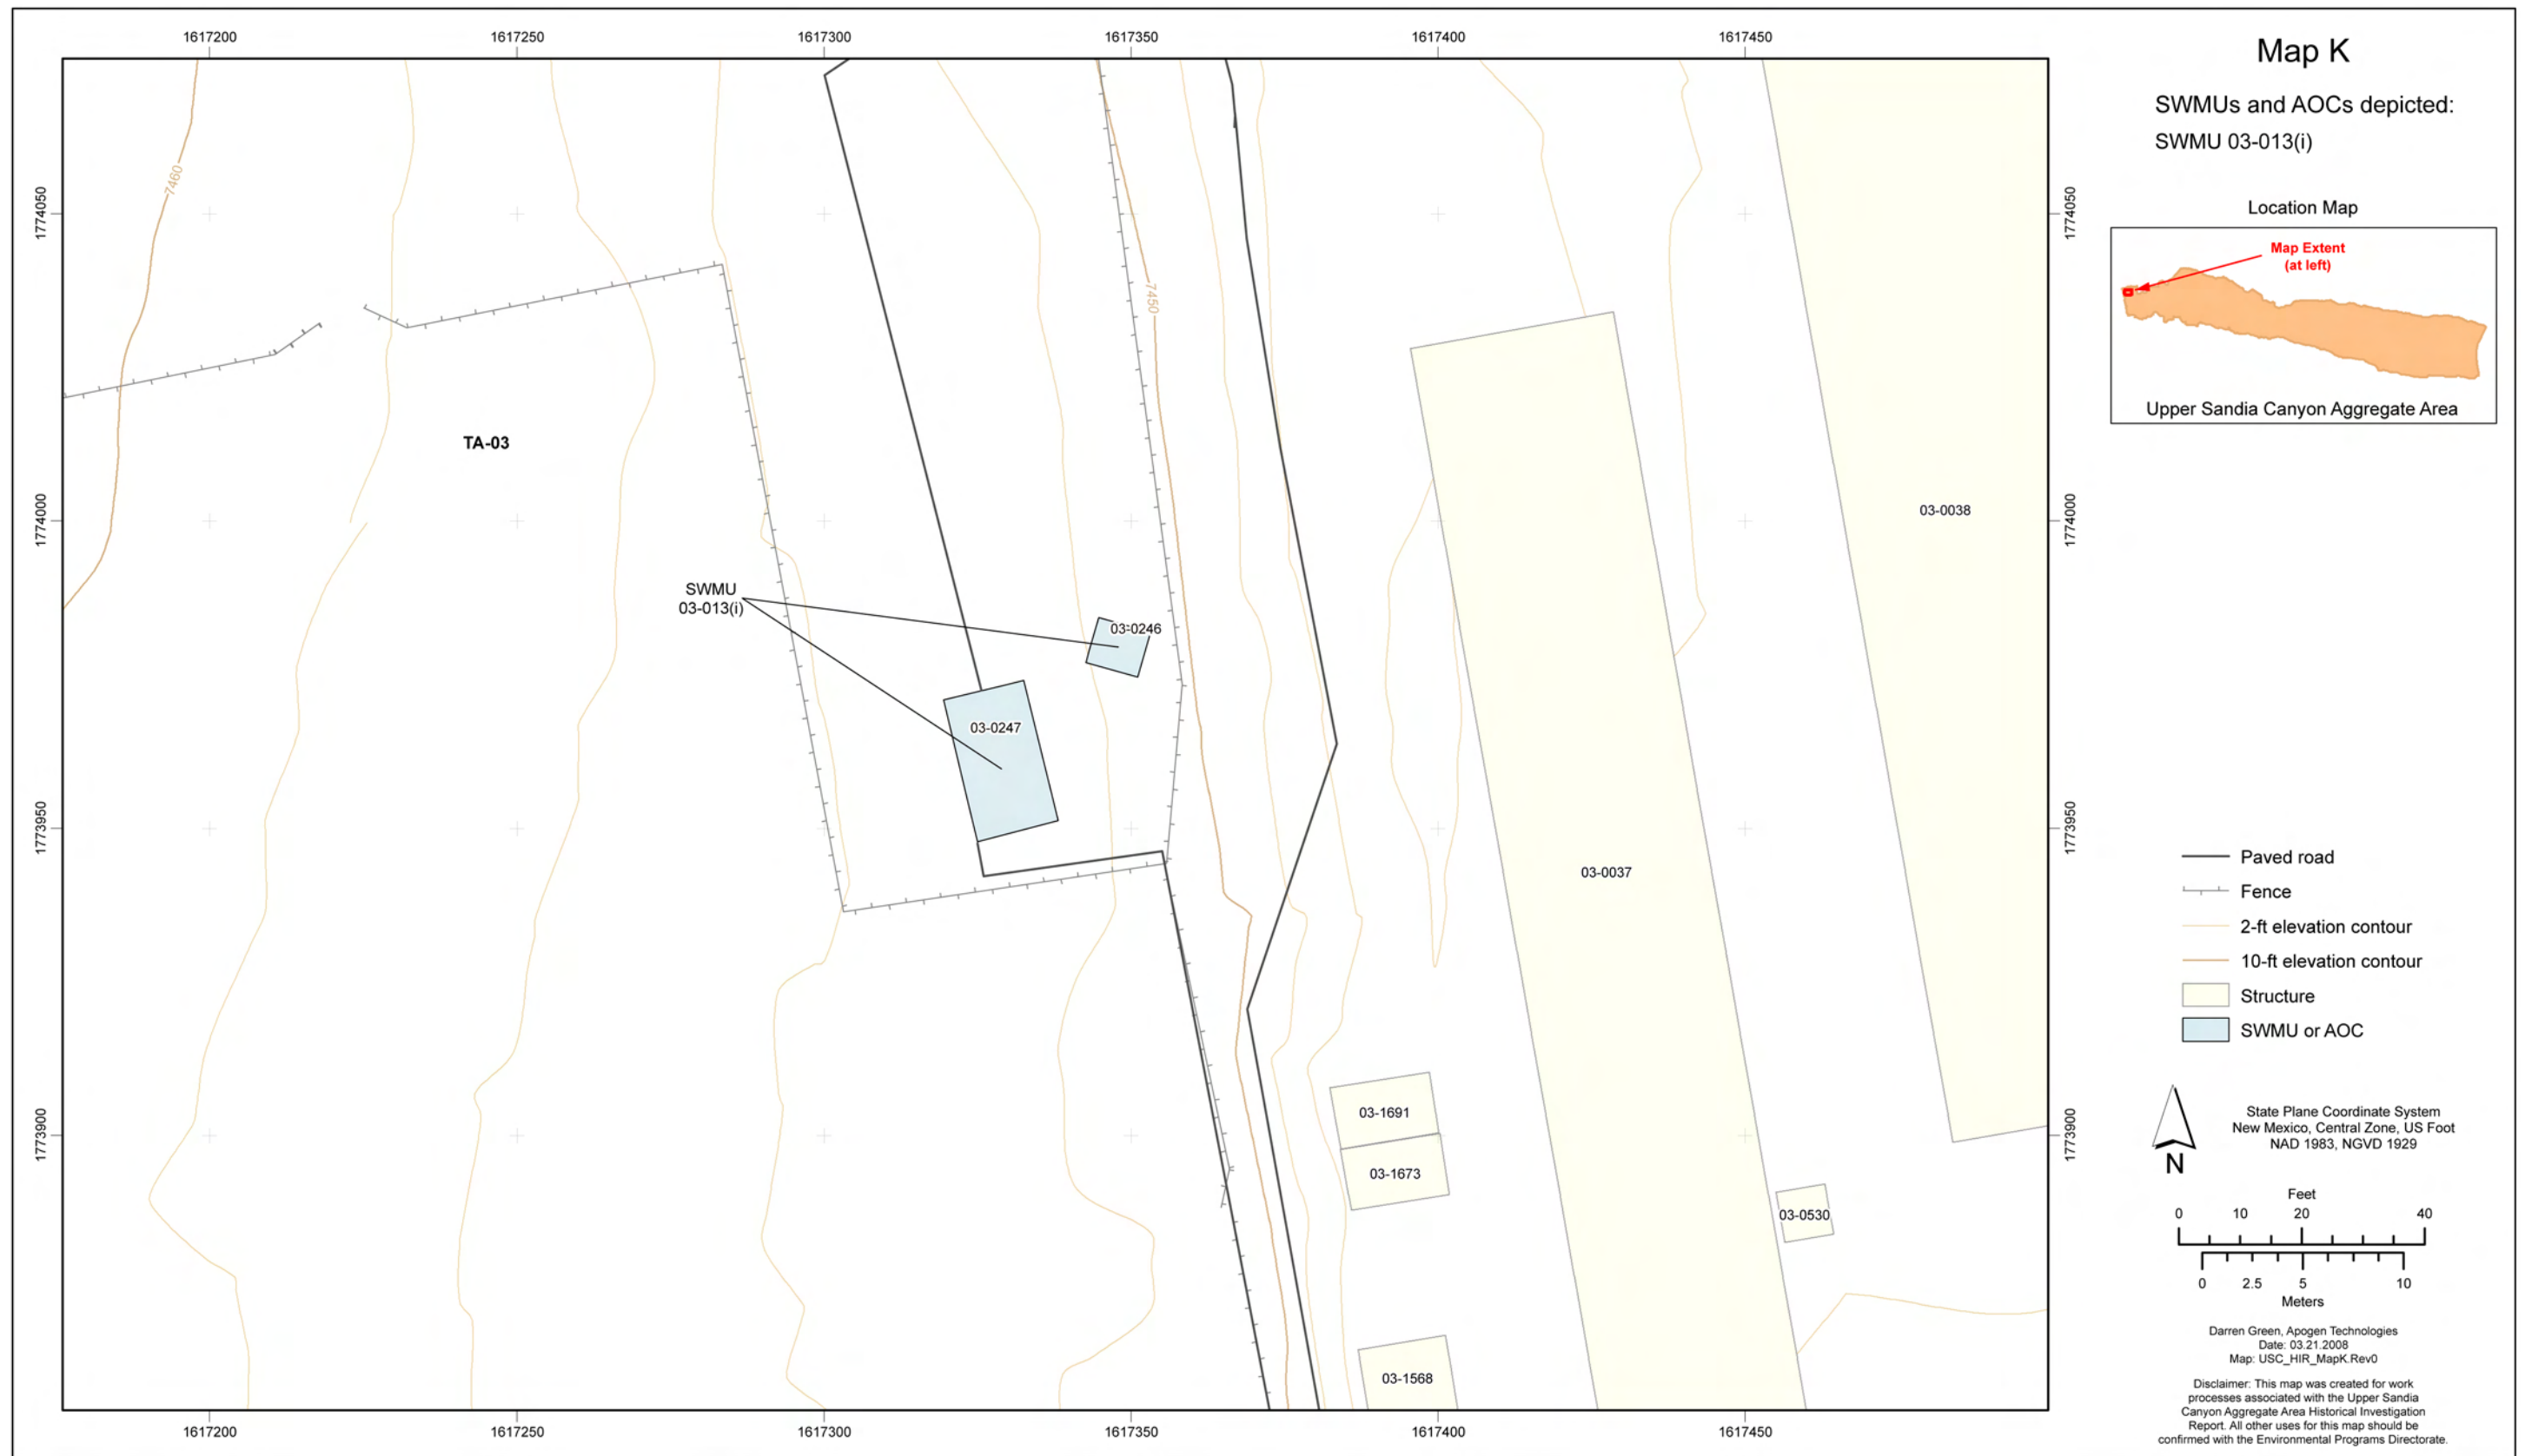


Figure 2.12-1 Map K site location



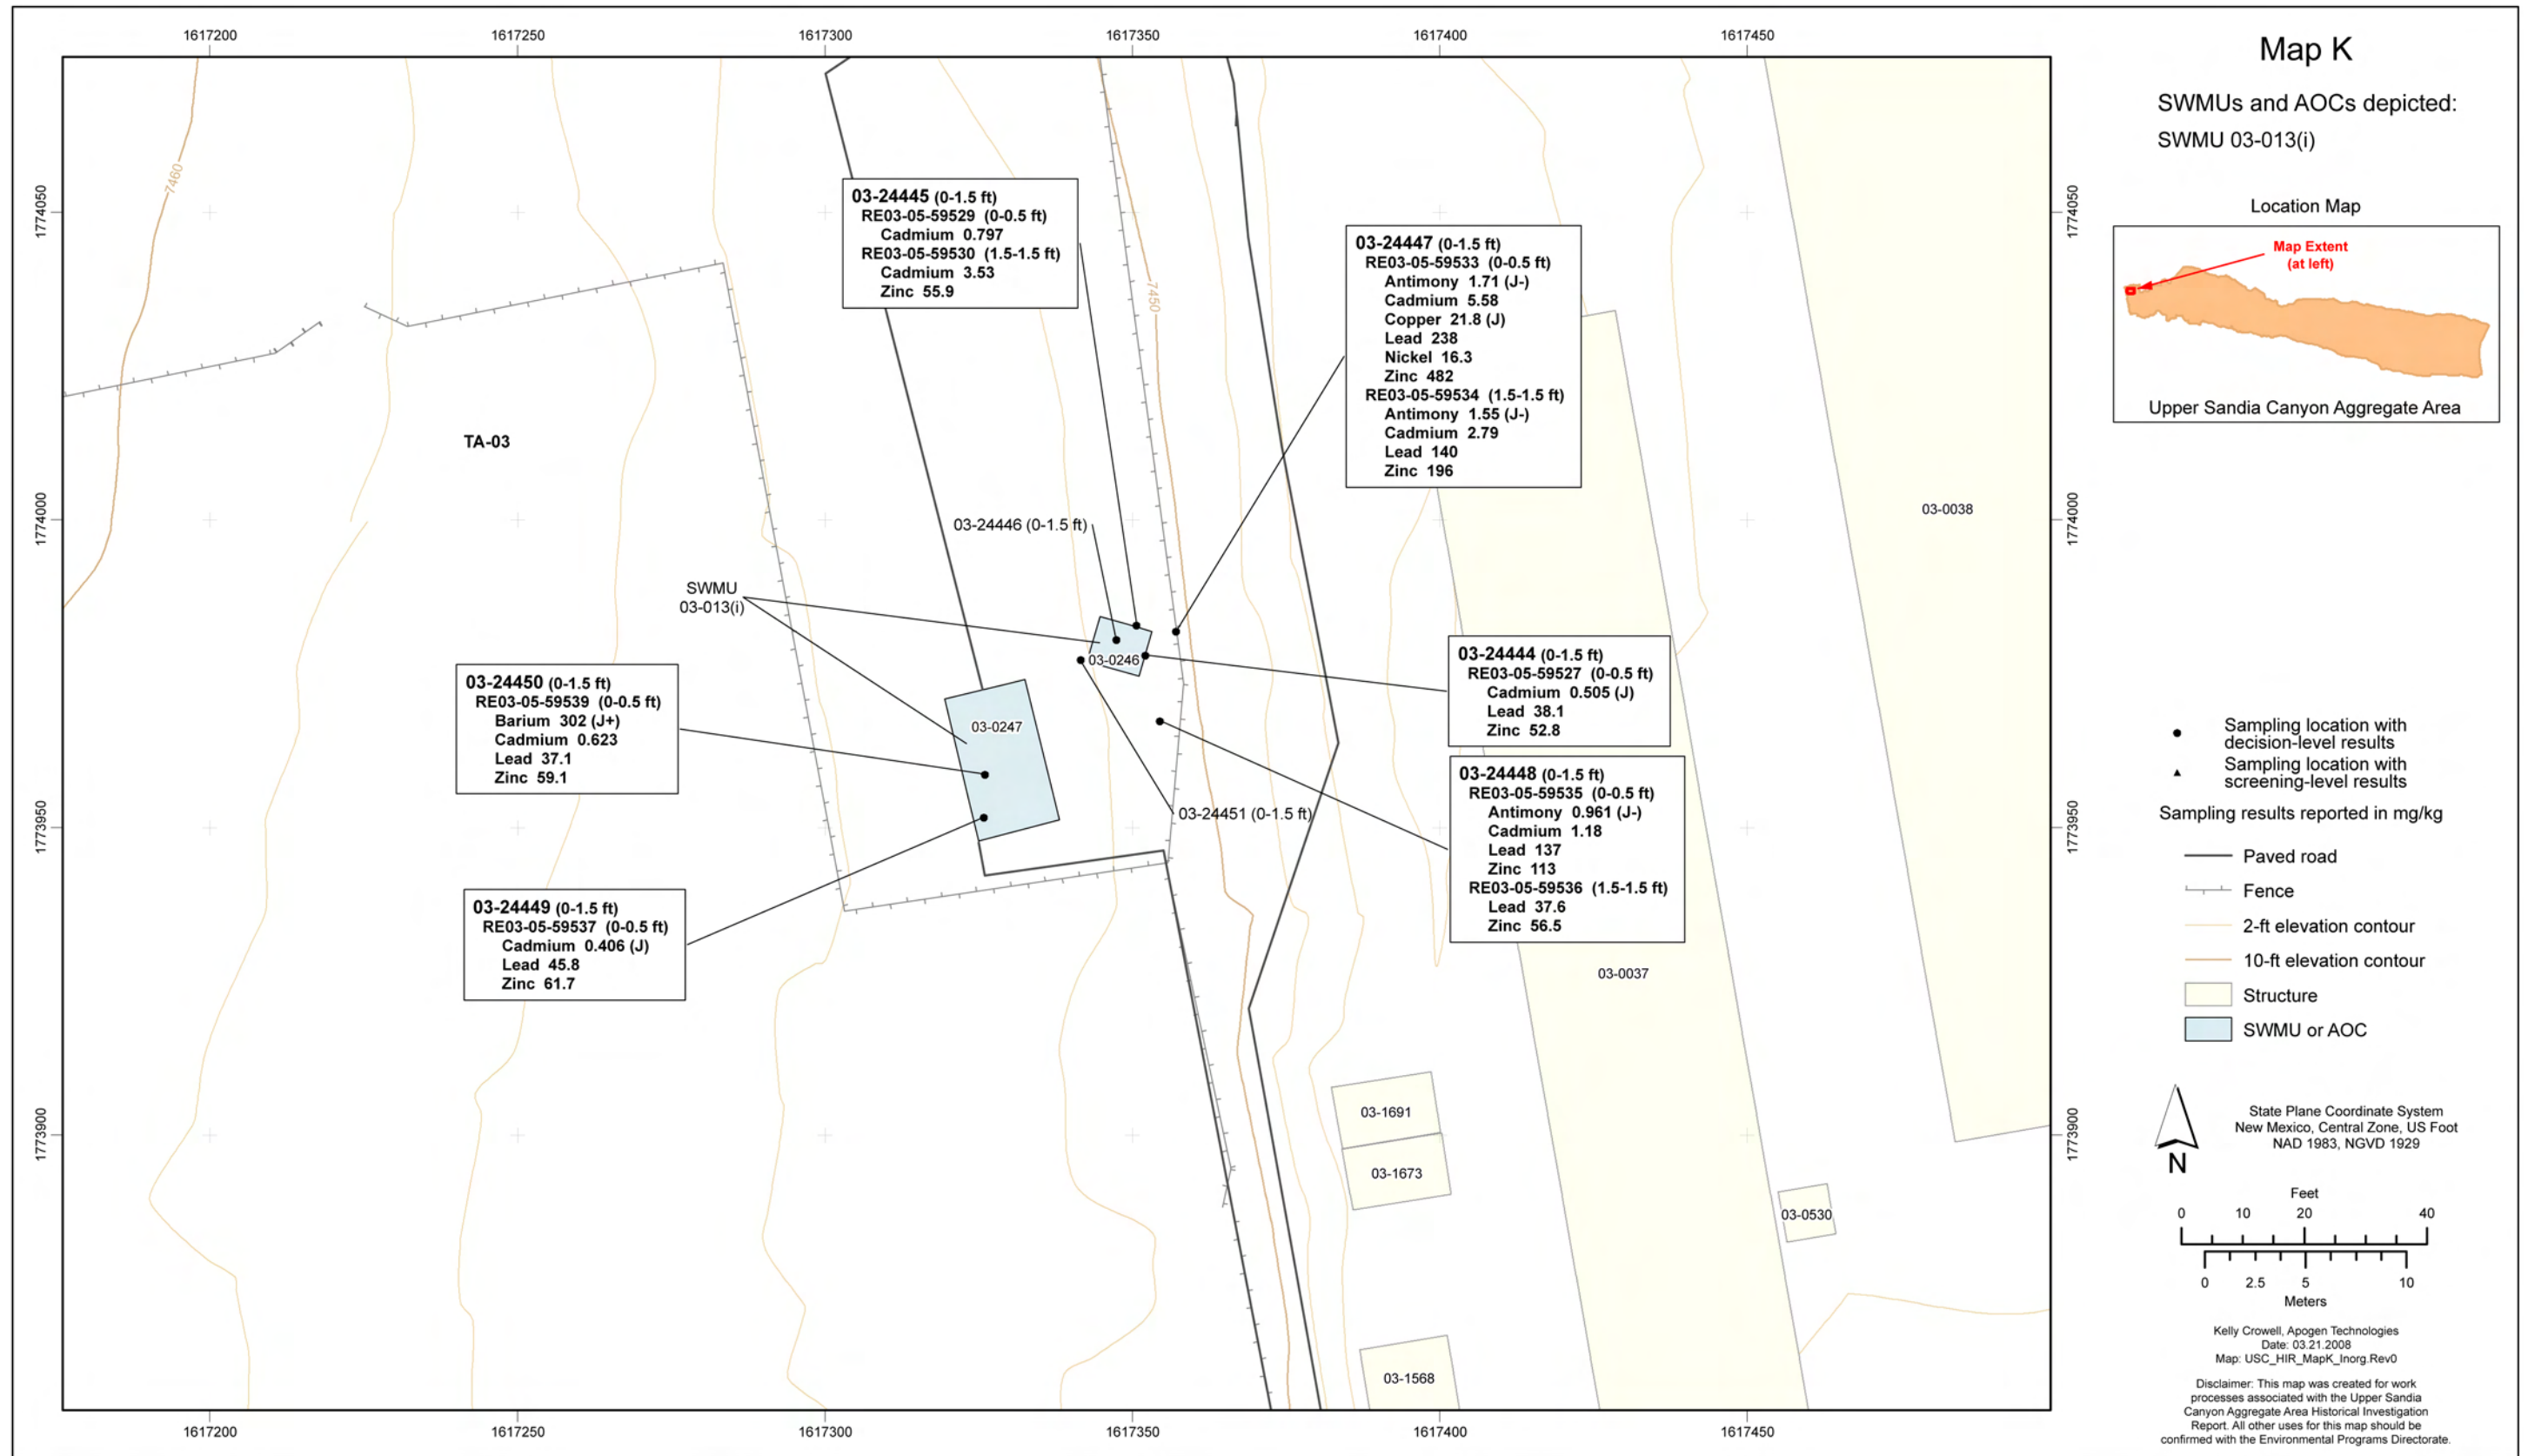


Figure 2.12-2 Map K inorganic chemical sampling locations and results detected above BVs



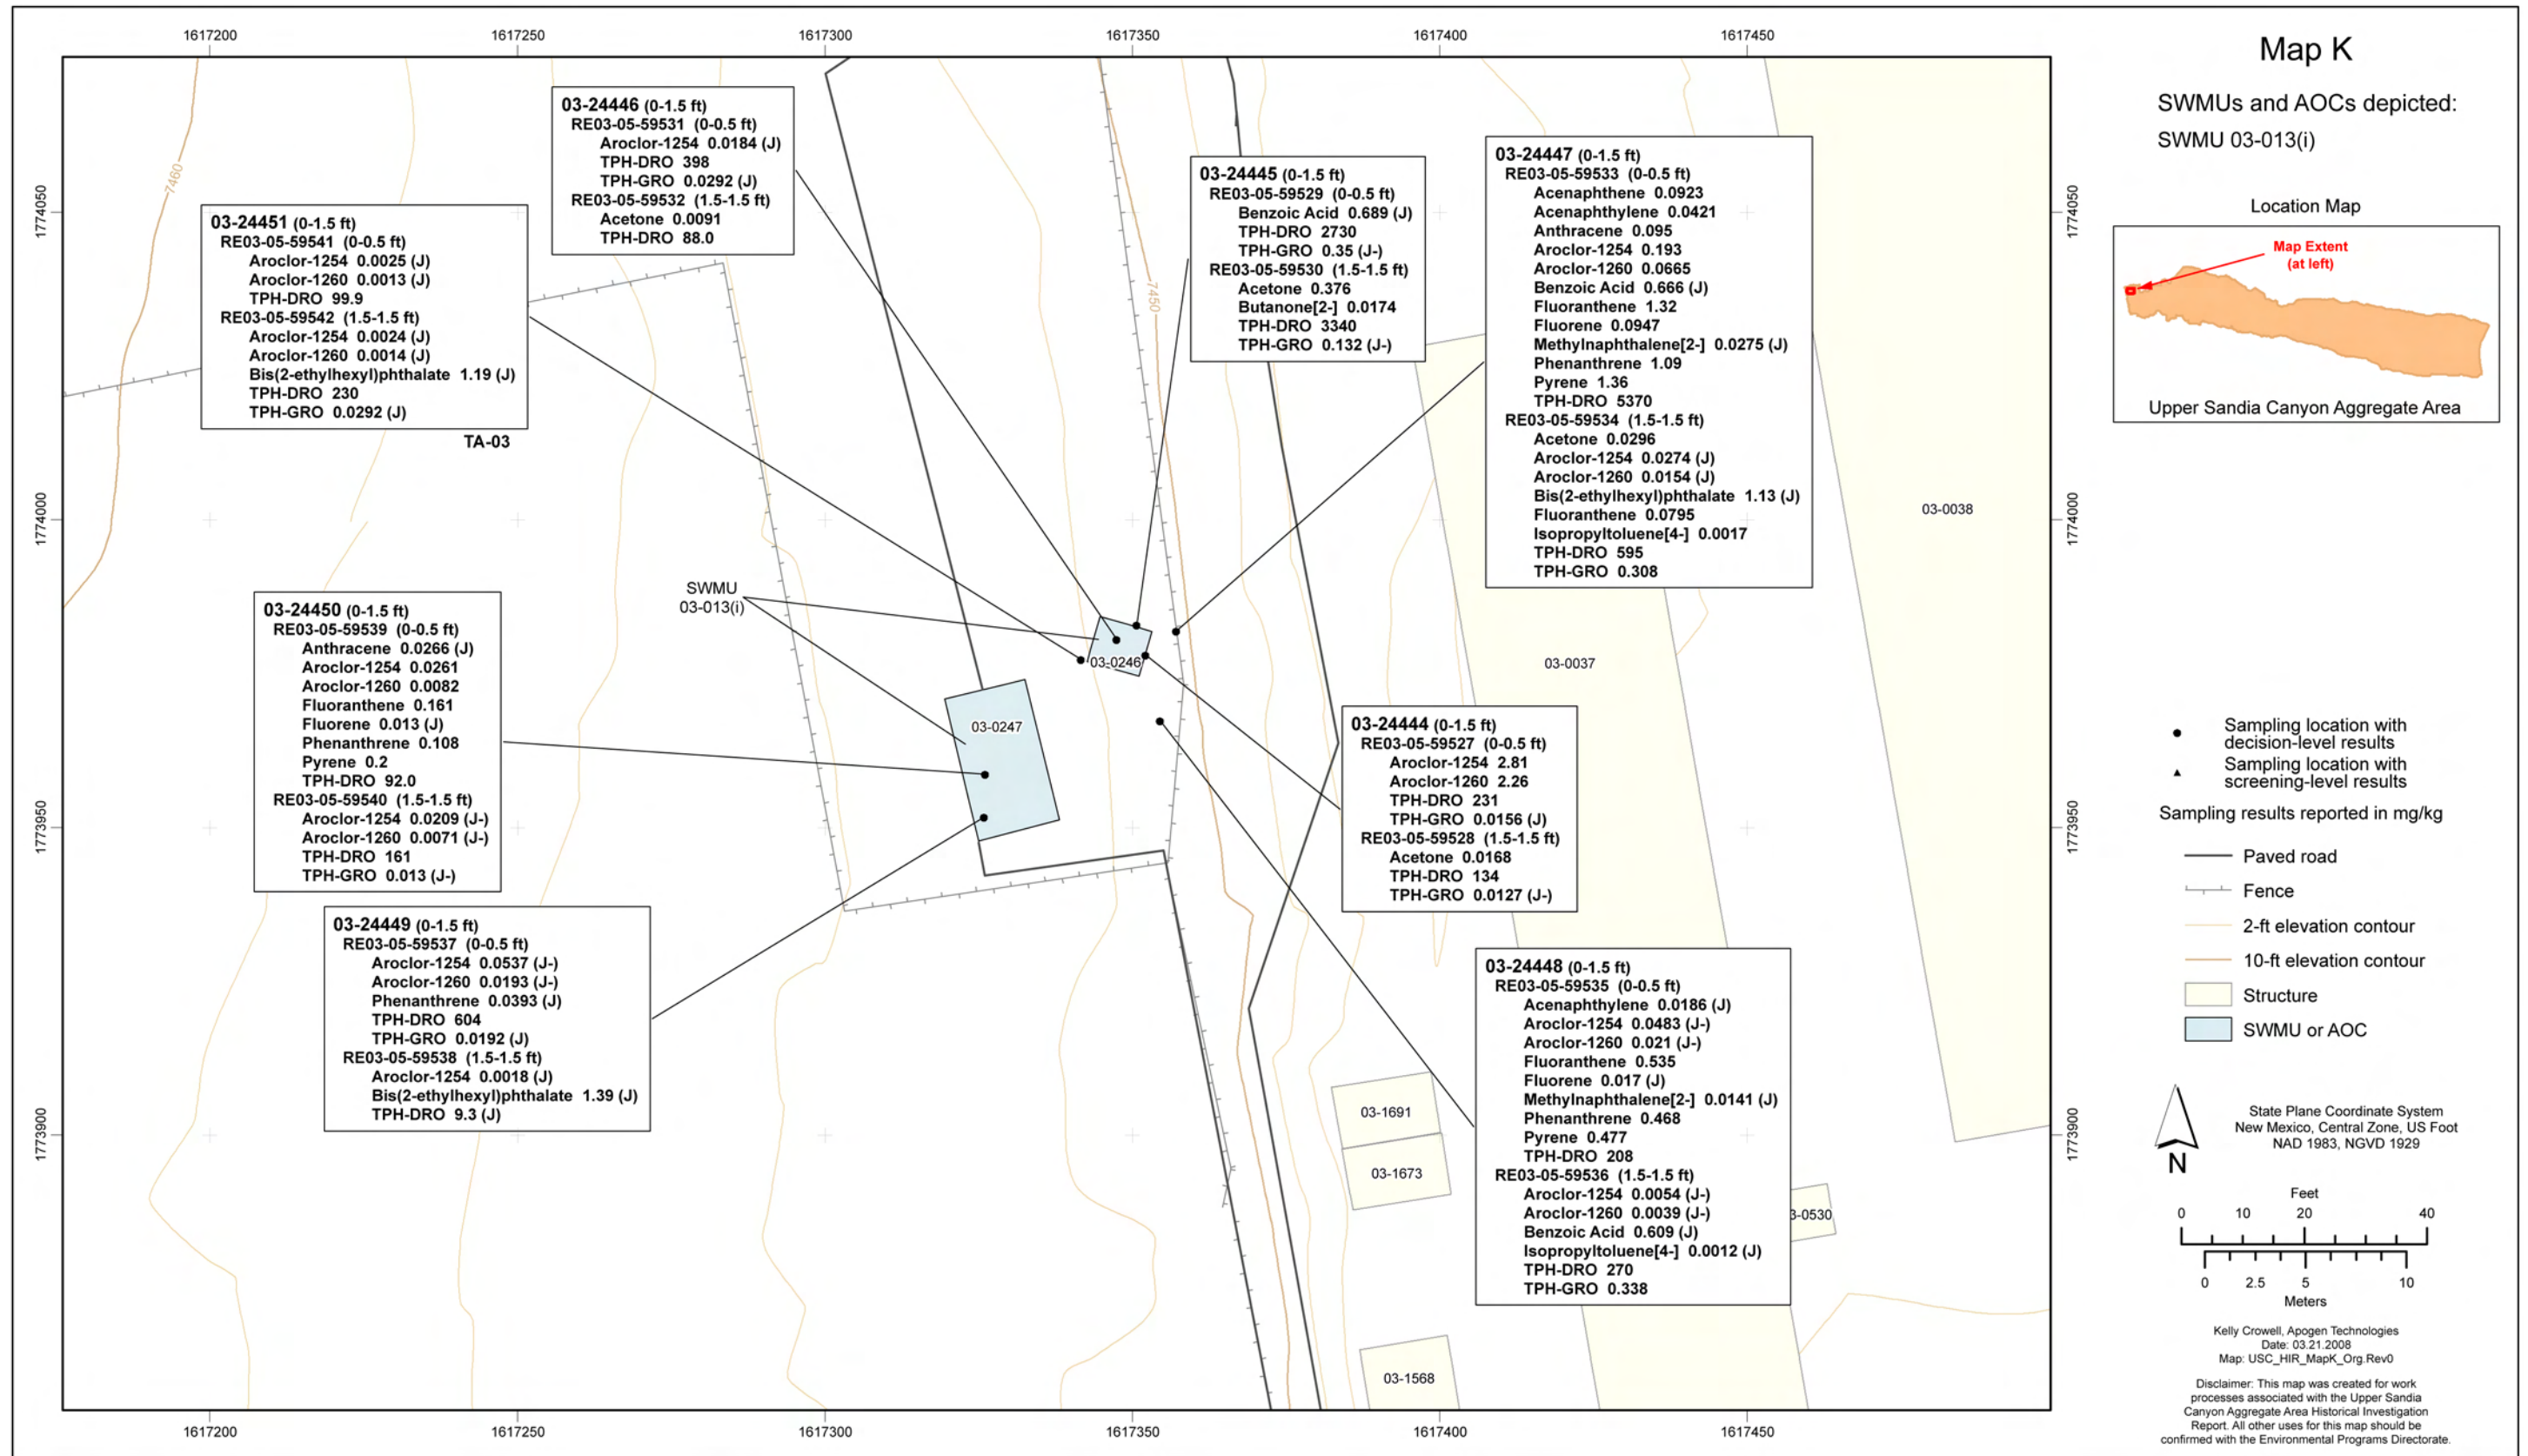


Figure 2.12-3 Map K organic chemical sampling locations and detected results



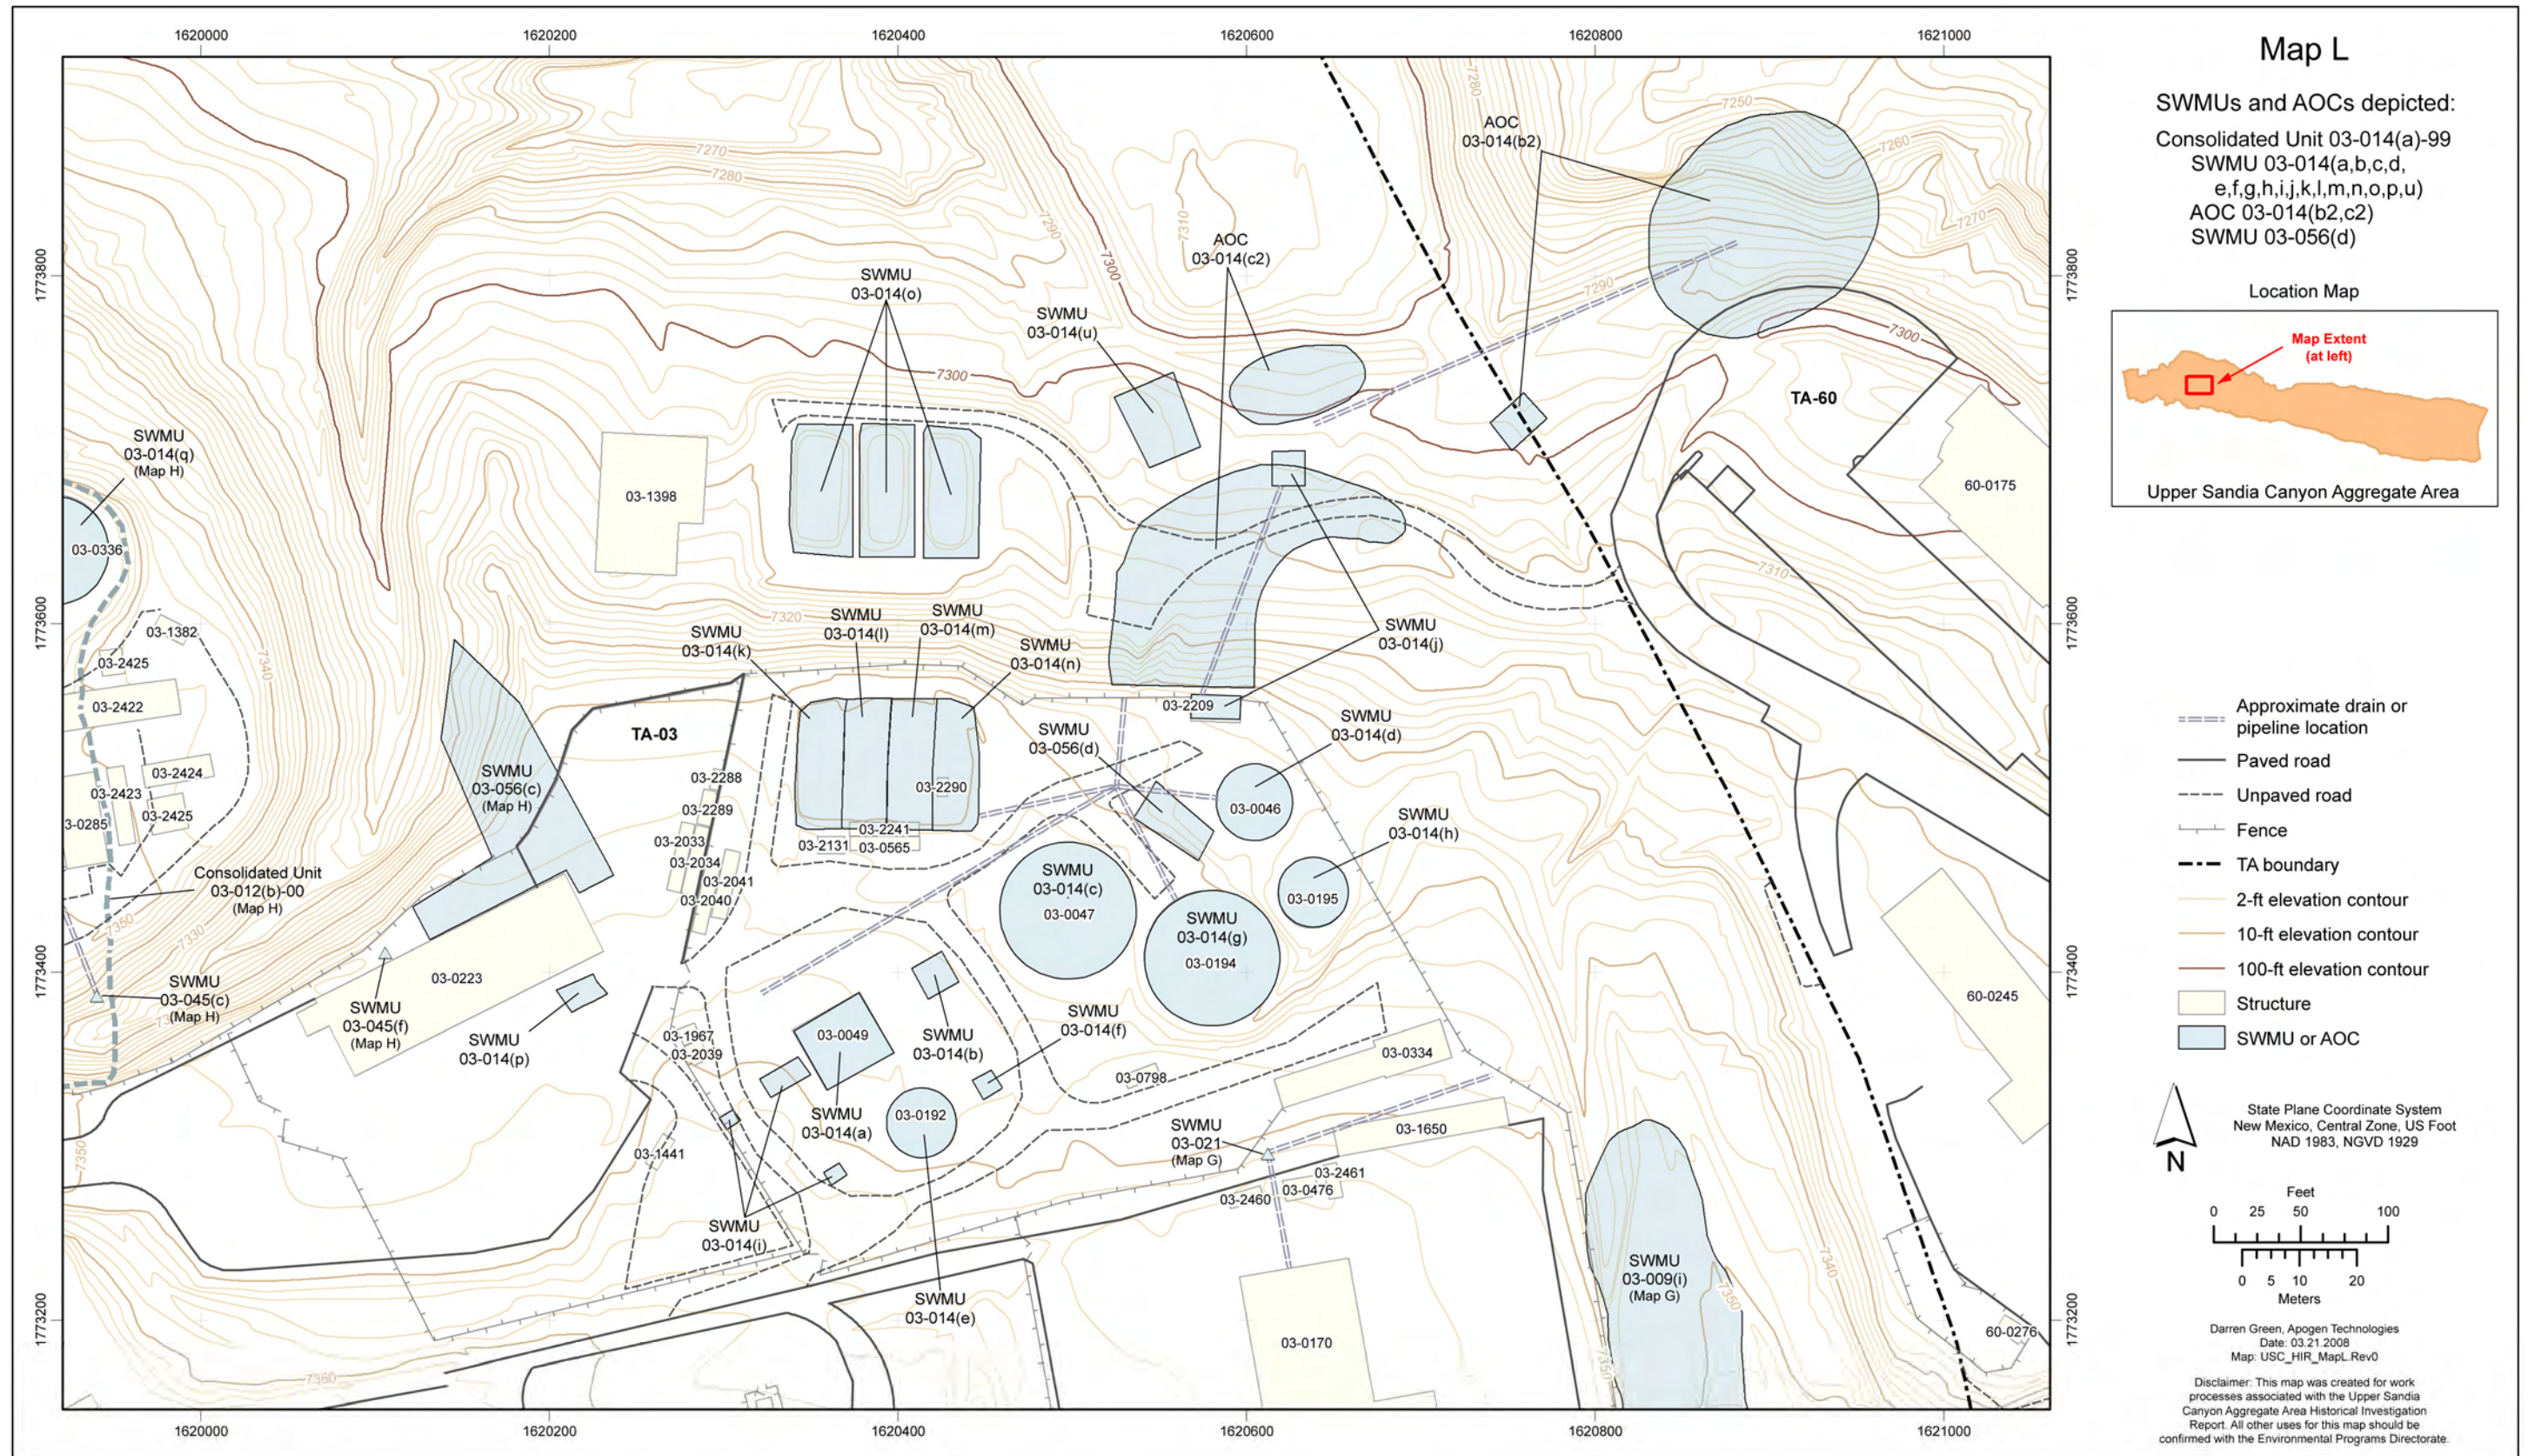


Figure 2.13-1 Map L site location



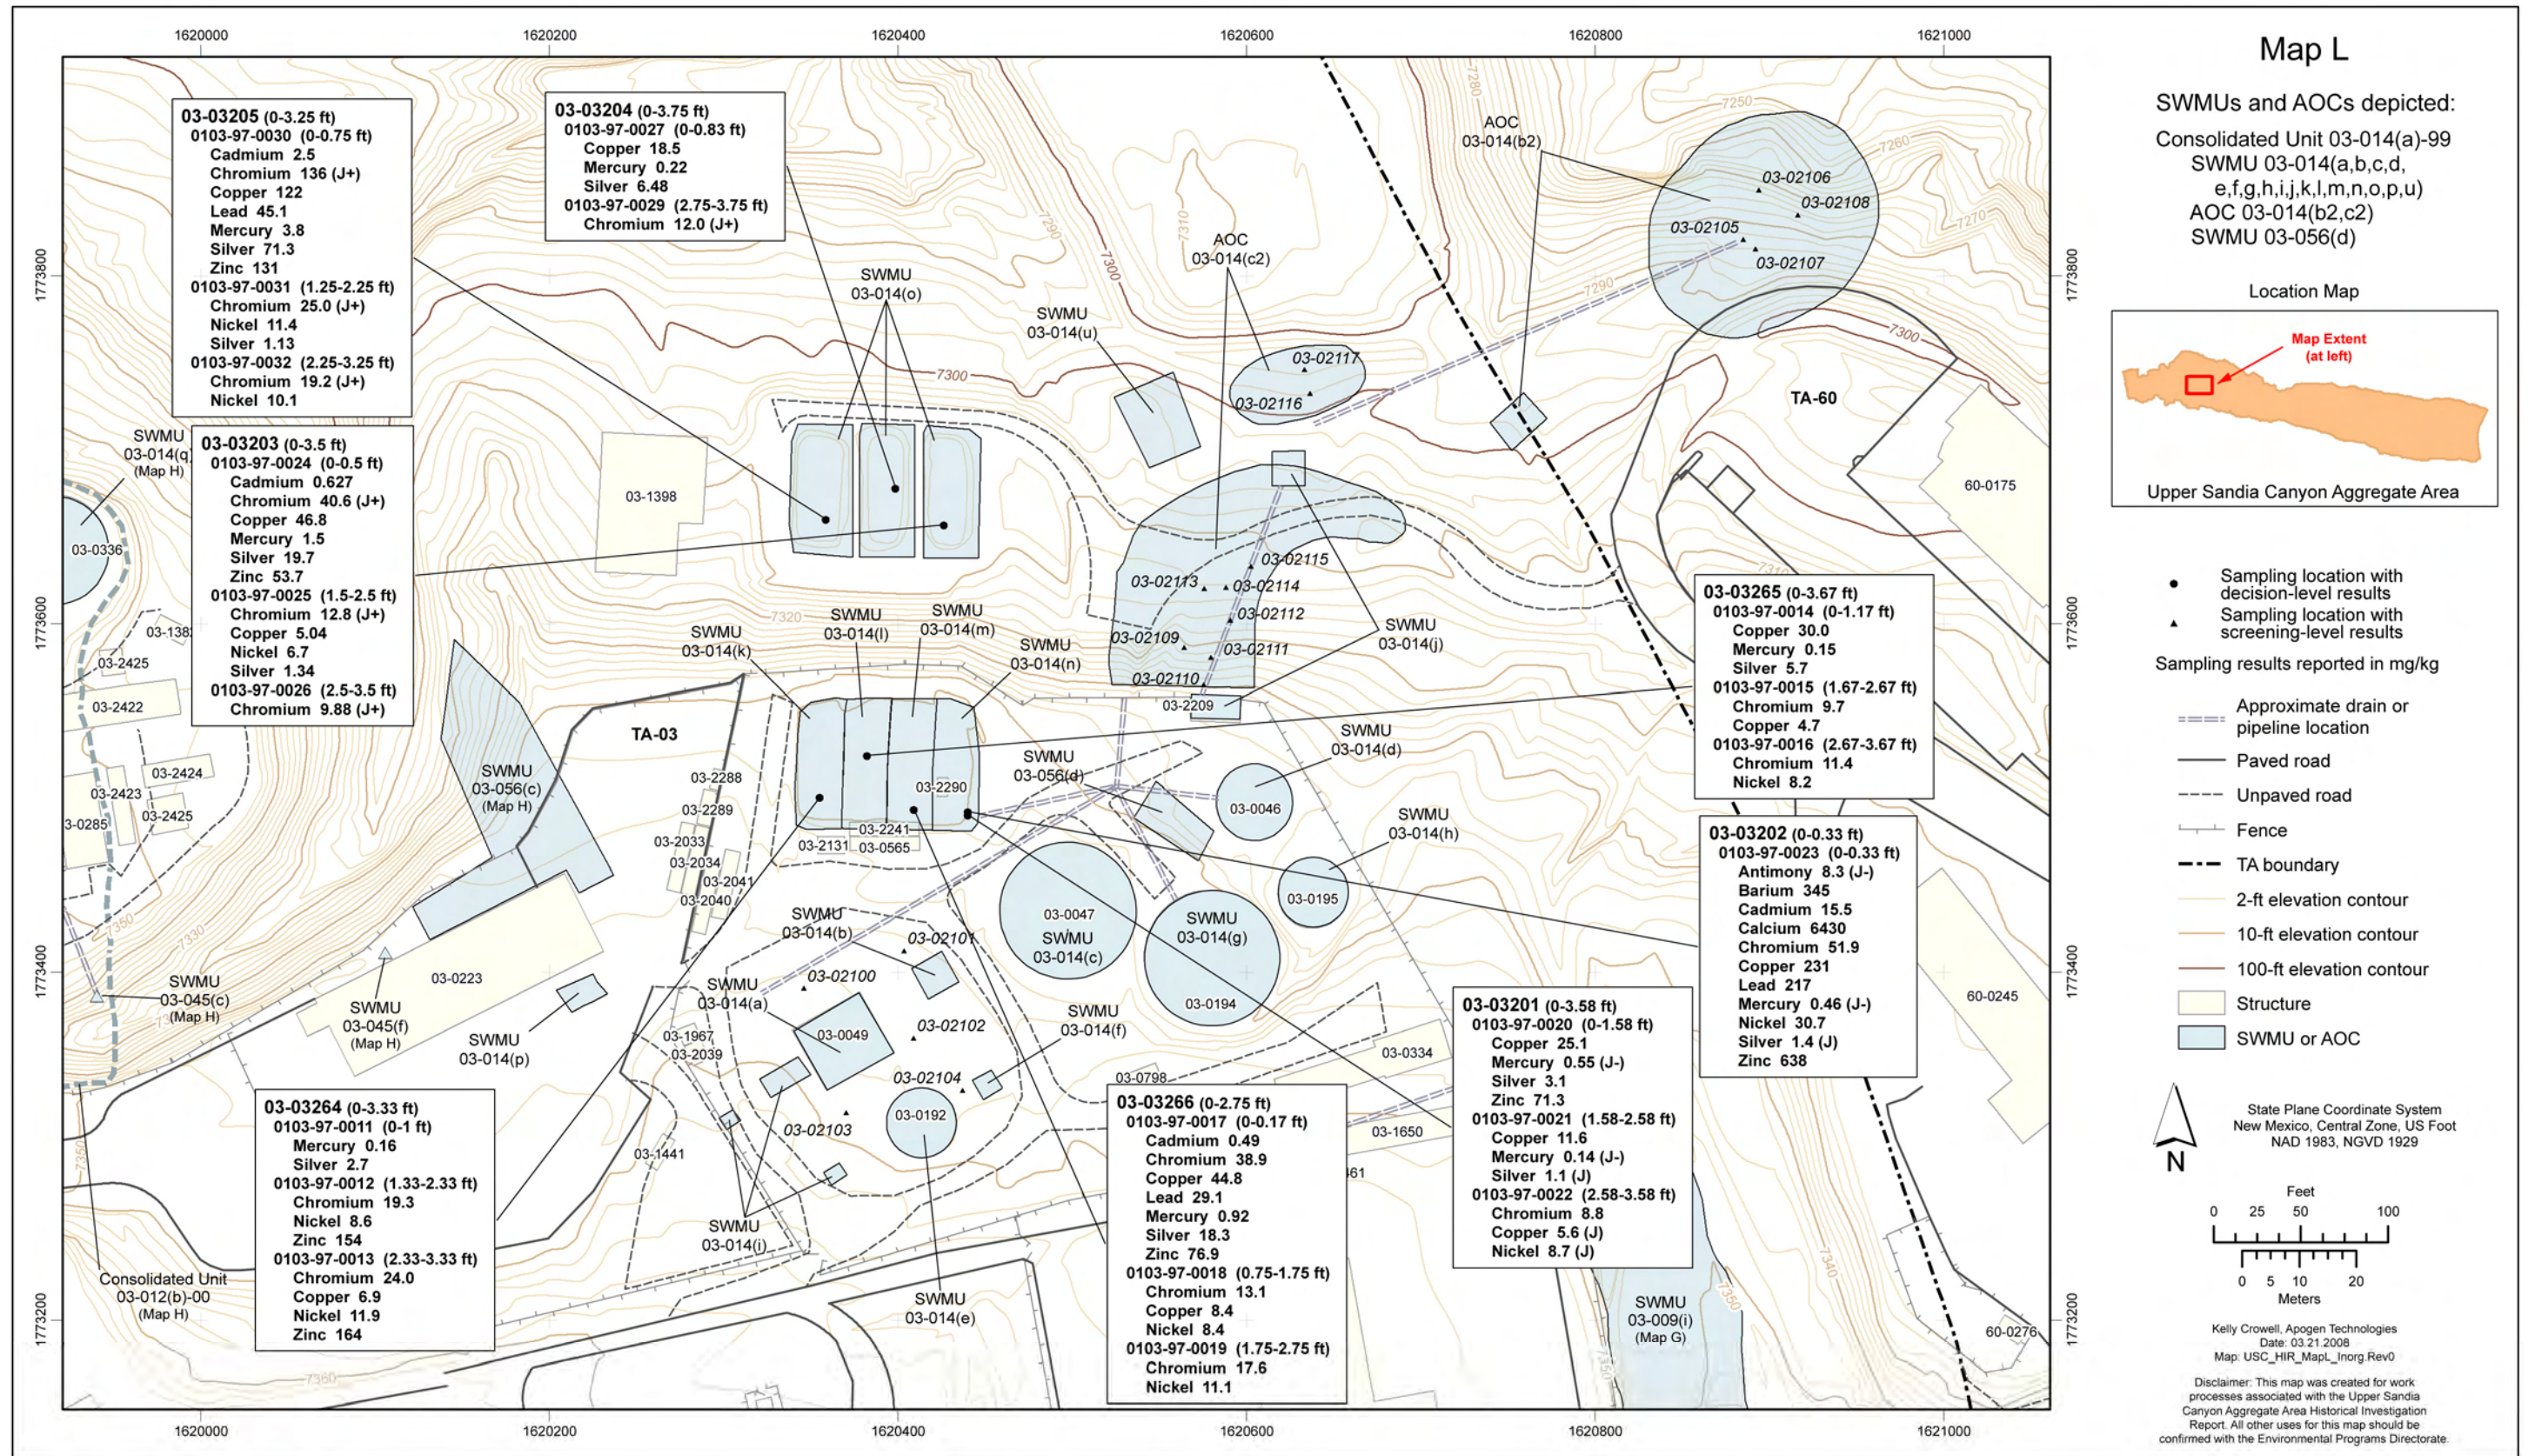


Figure 2.13-2 Map L inorganic chemical sampling locations and results detected above BVs



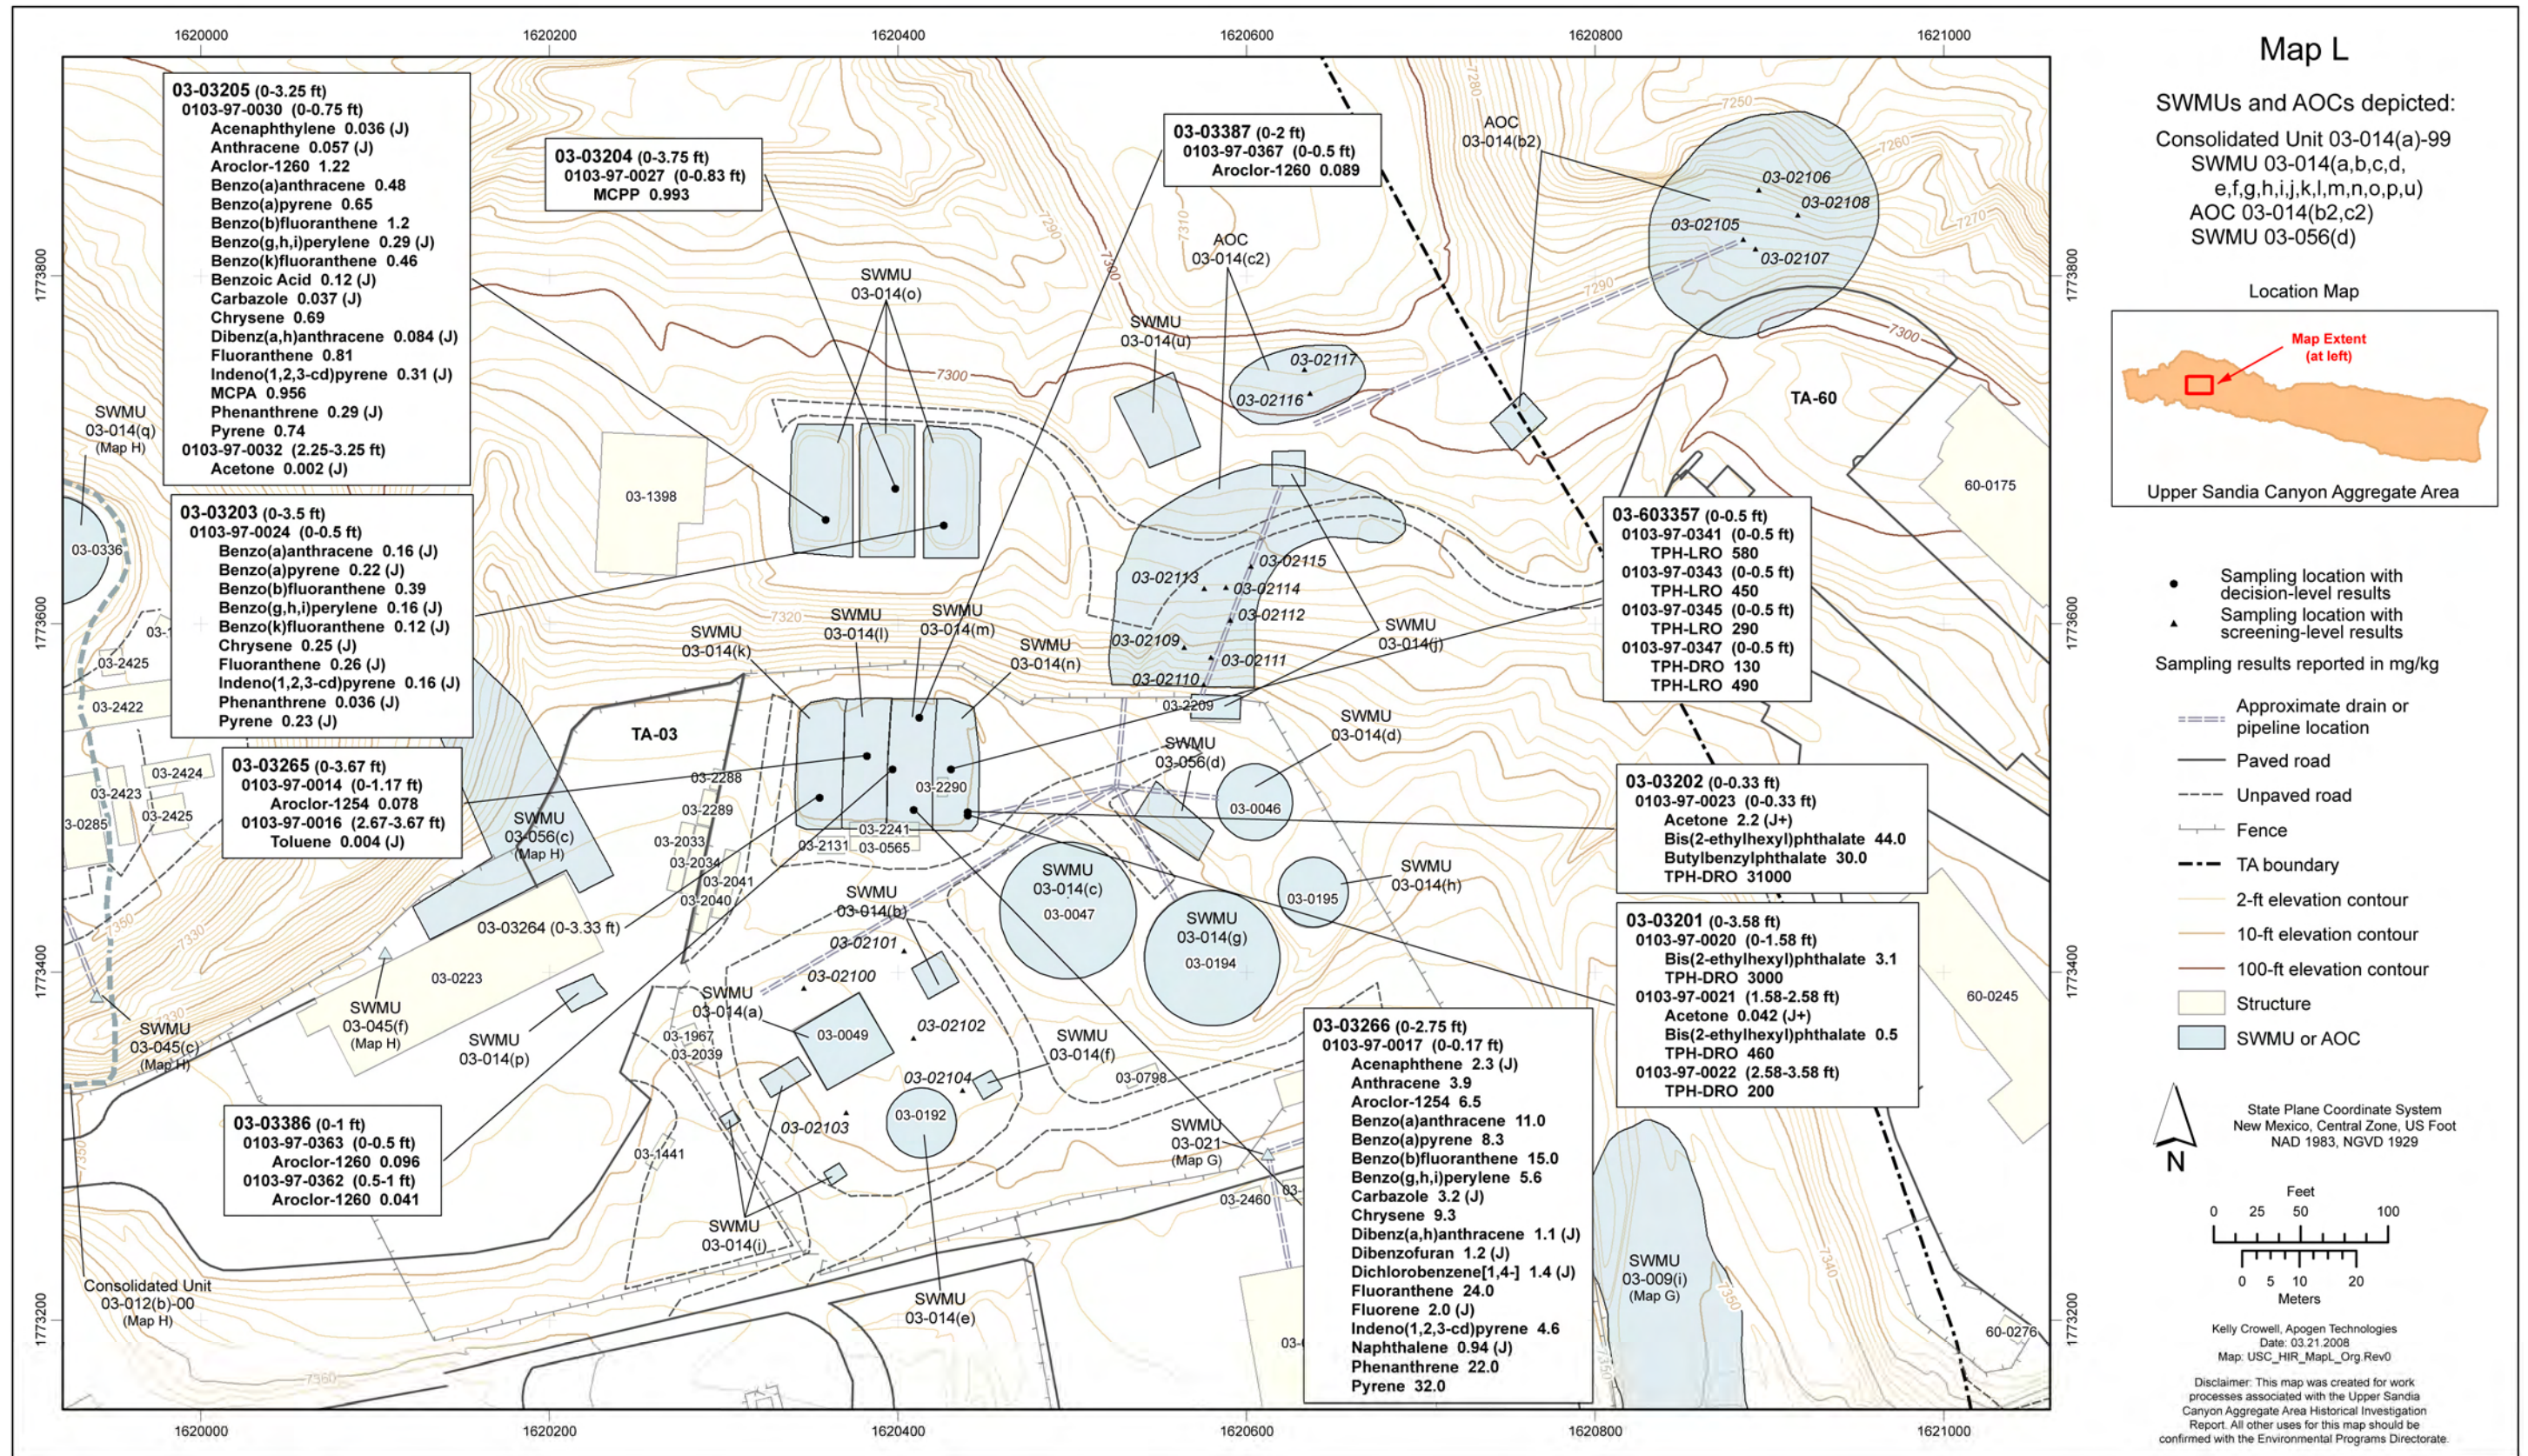


Figure 2.13-3 Map L organic chemical sampling locations and detected results



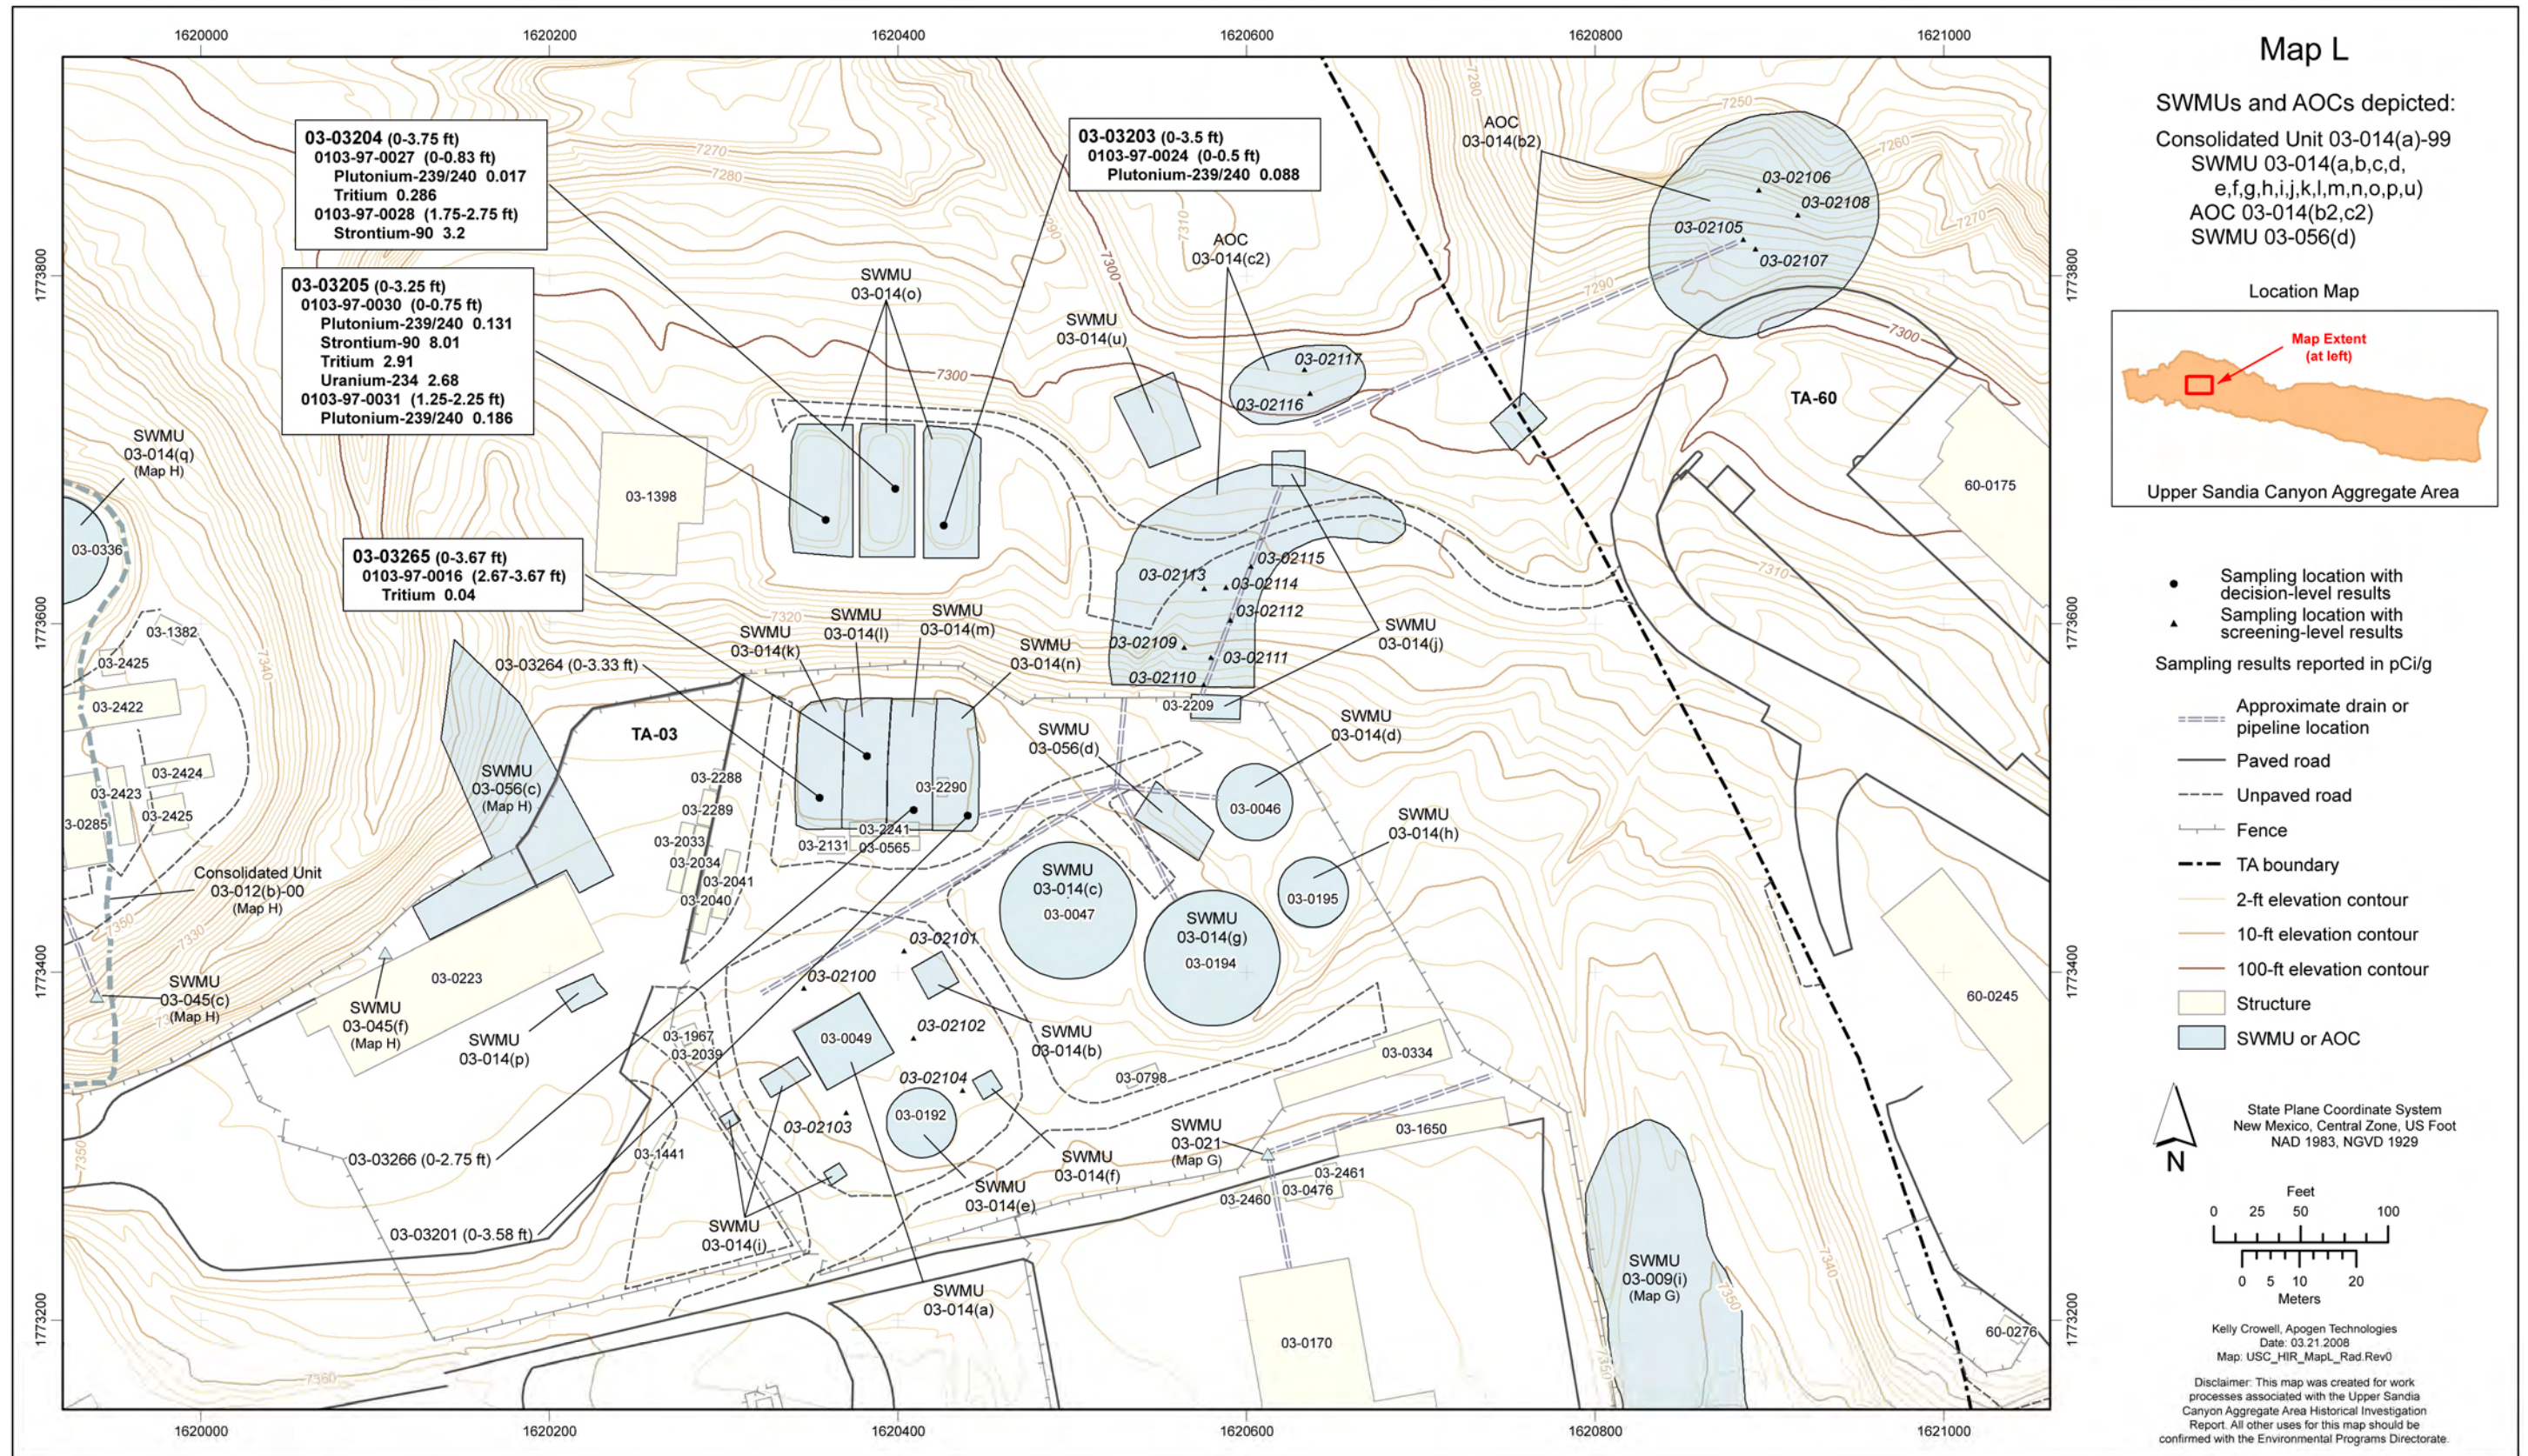


Figure 2.13-4 Map L radionuclide sampling locations and results detected above FVs/BVs



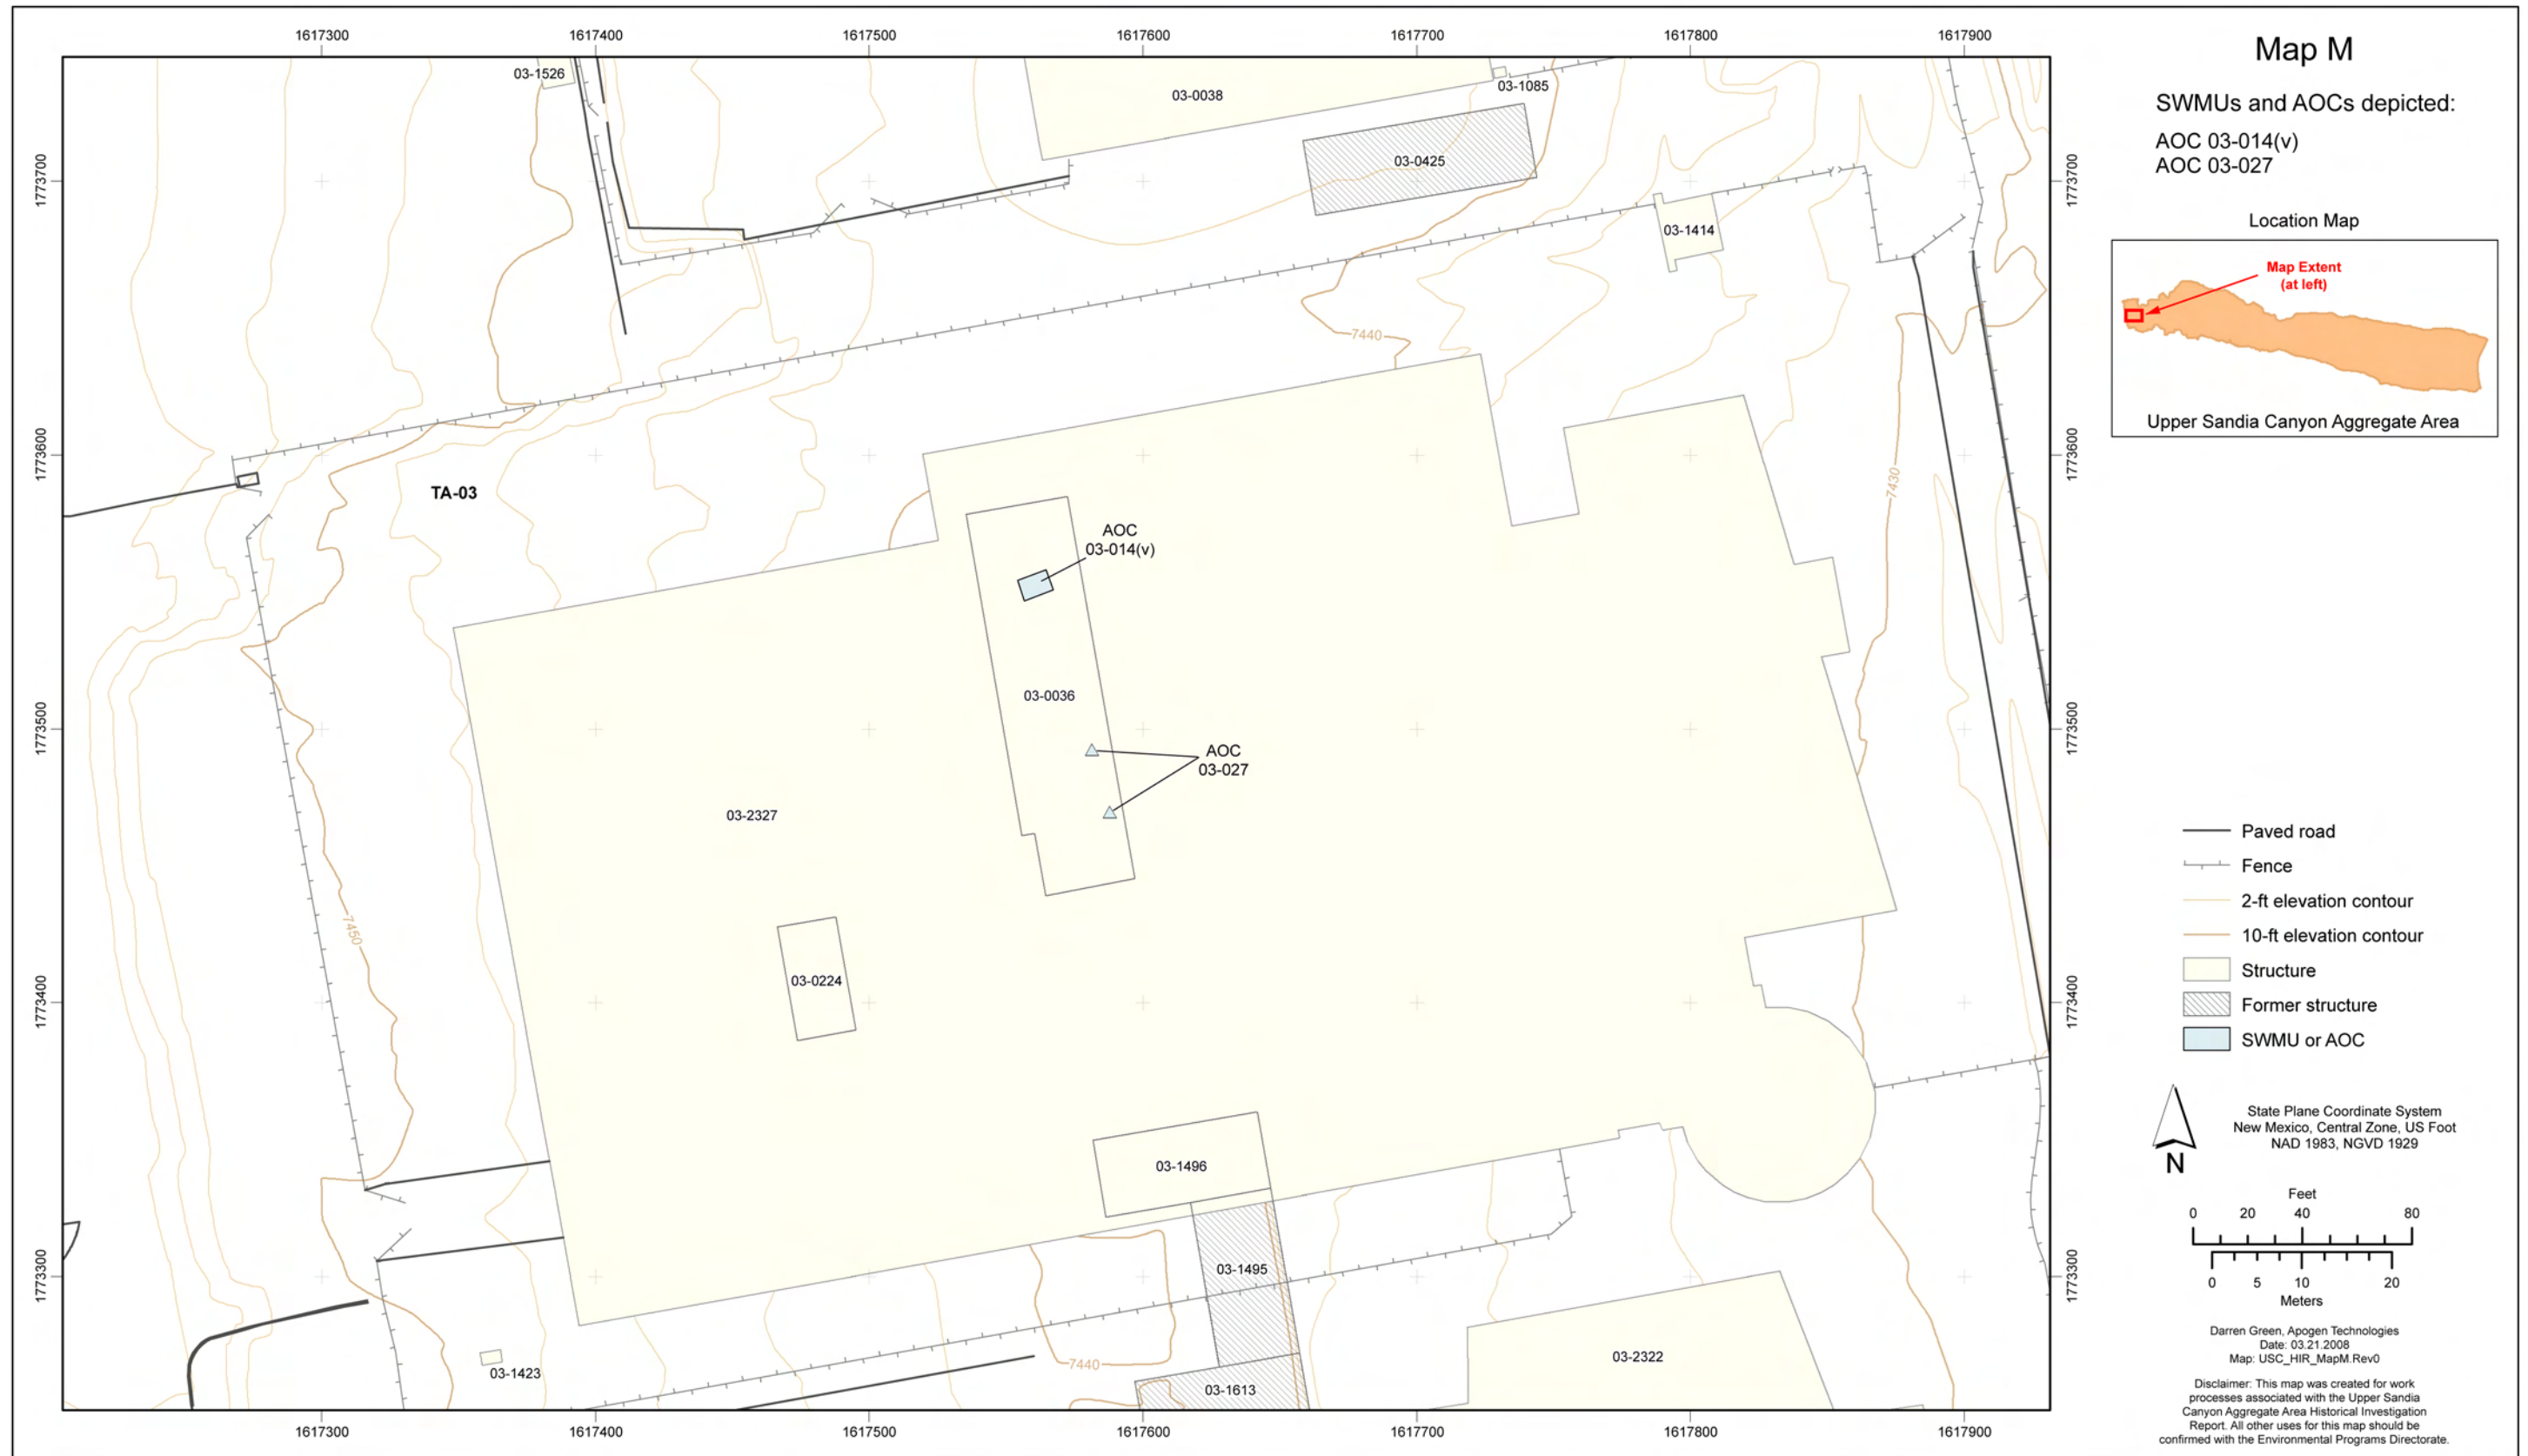


Figure 2.16-1 Map M site location



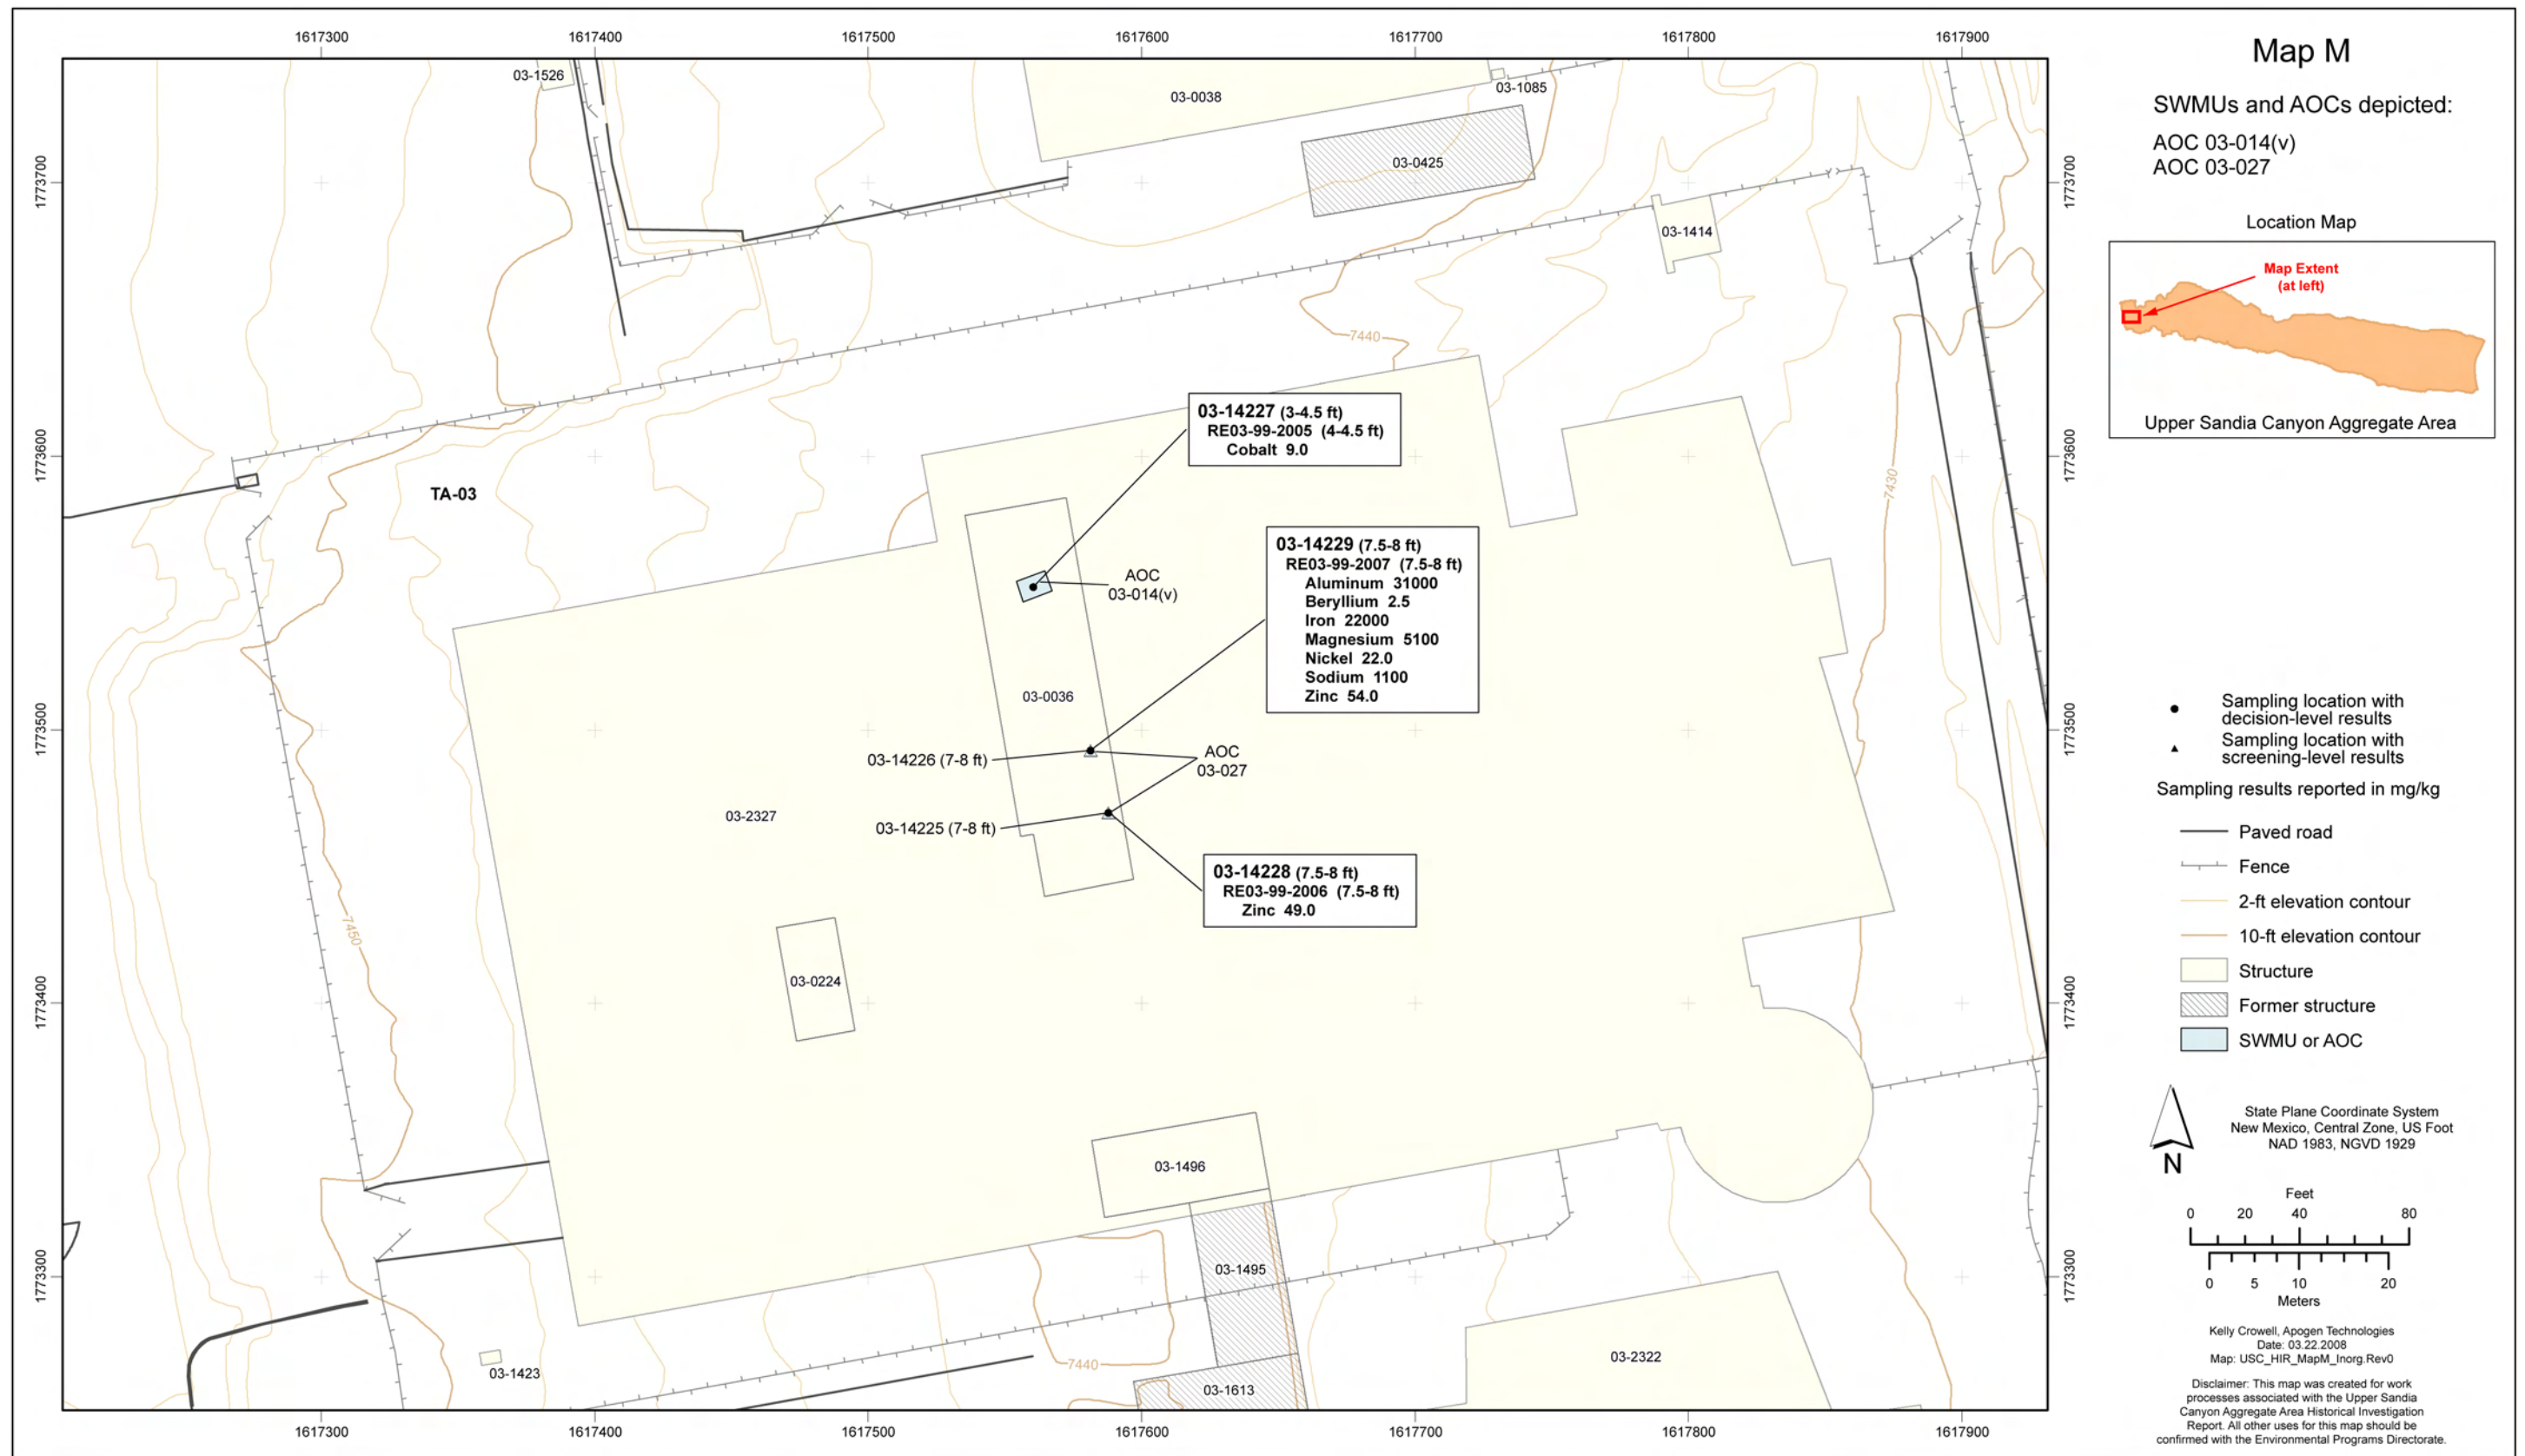


Figure 2.16-2 Map M inorganic chemical sampling locations and results detected above BVs

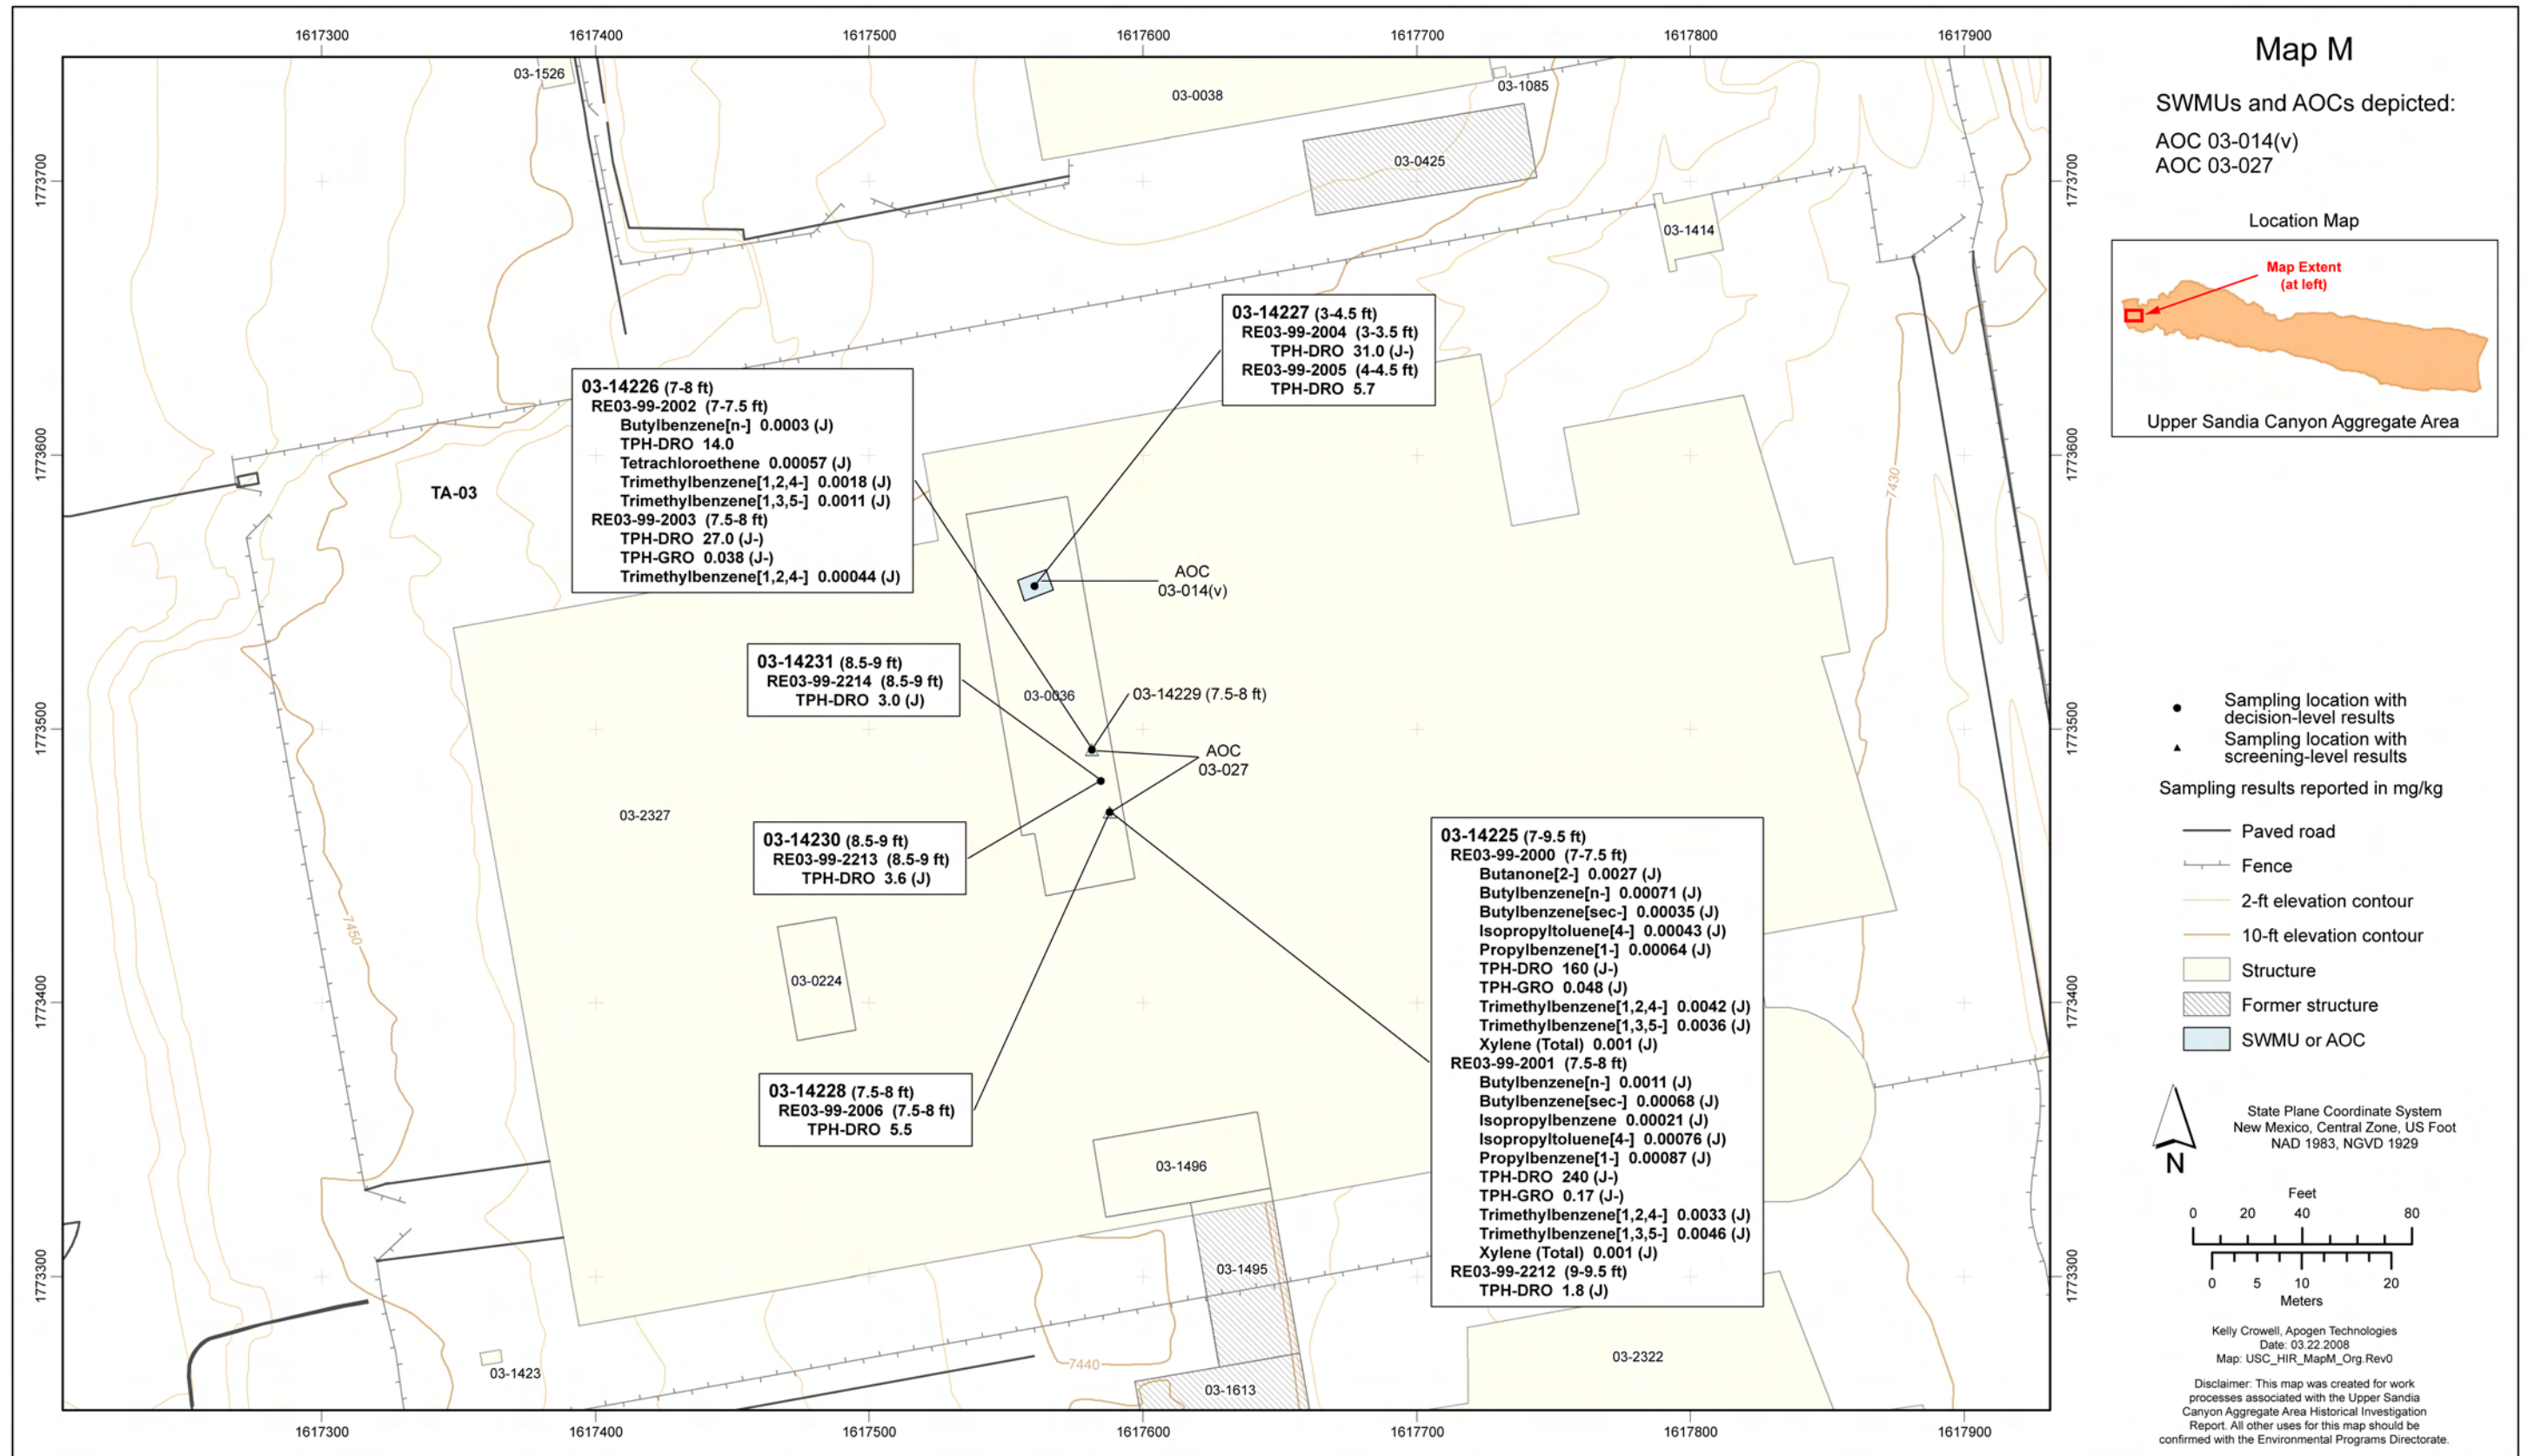


Figure 2.16-3 Map M organic chemical sampling locations and detected results



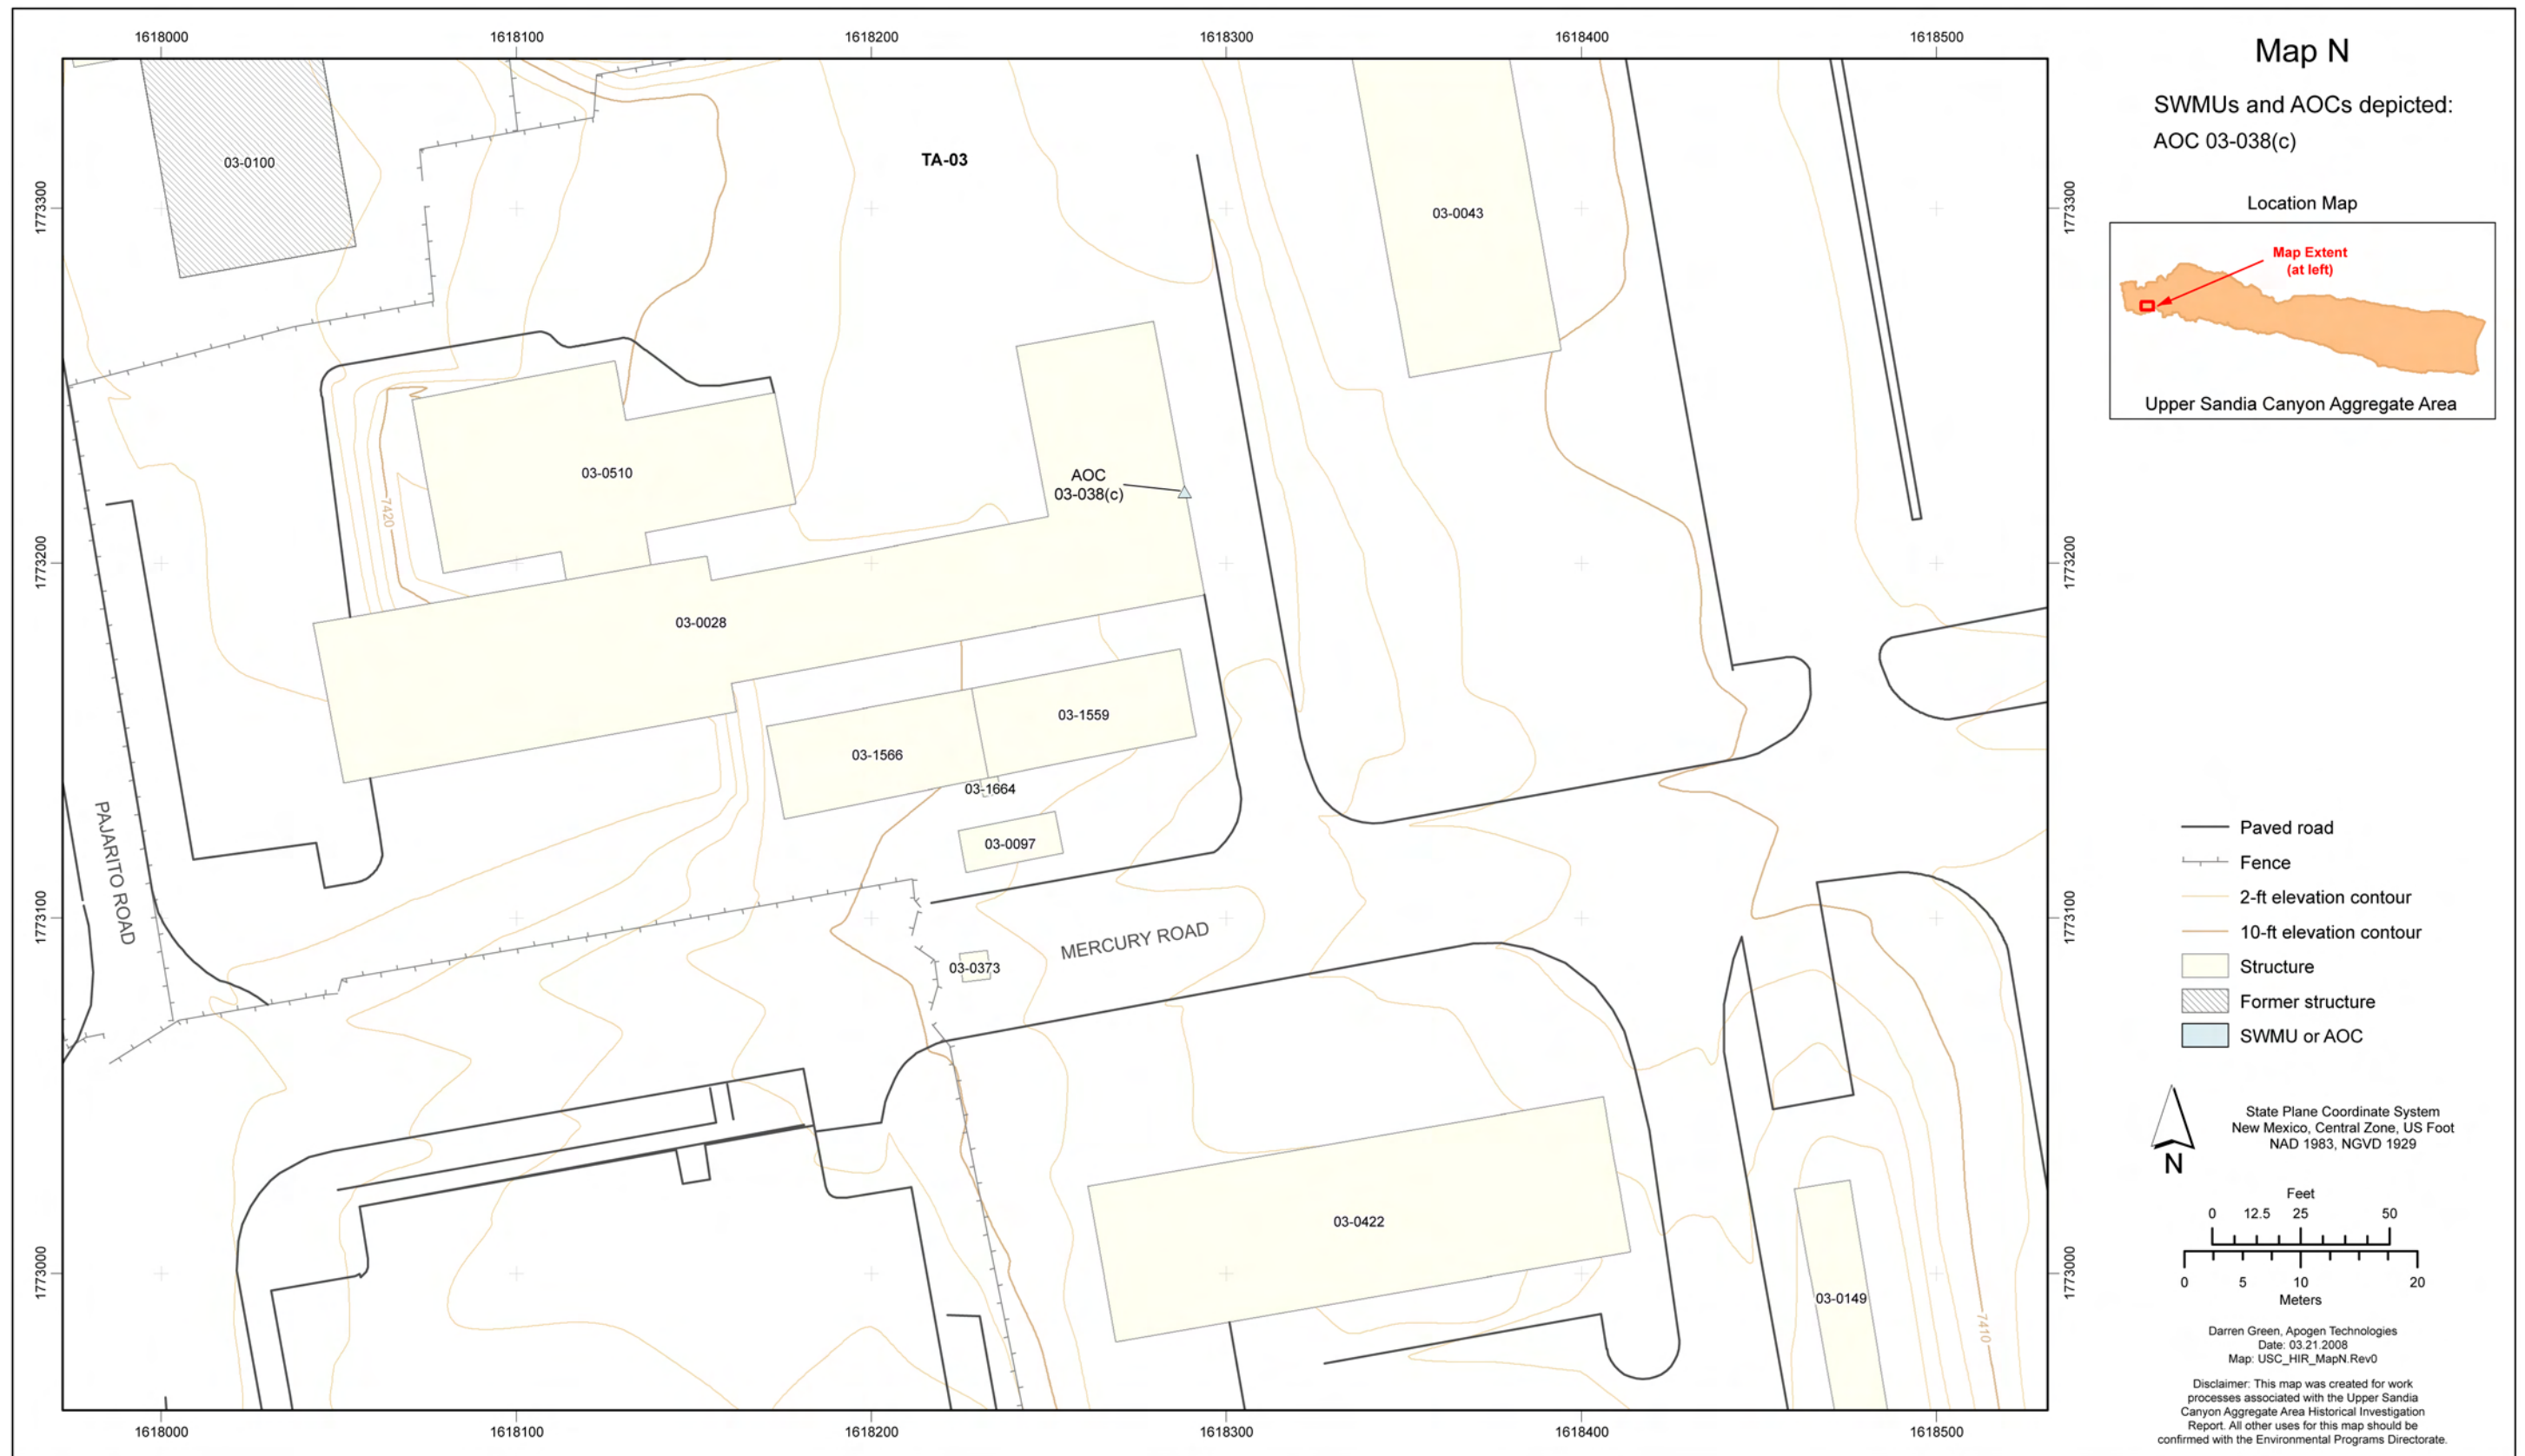


Figure 2.24-1 Map N site location



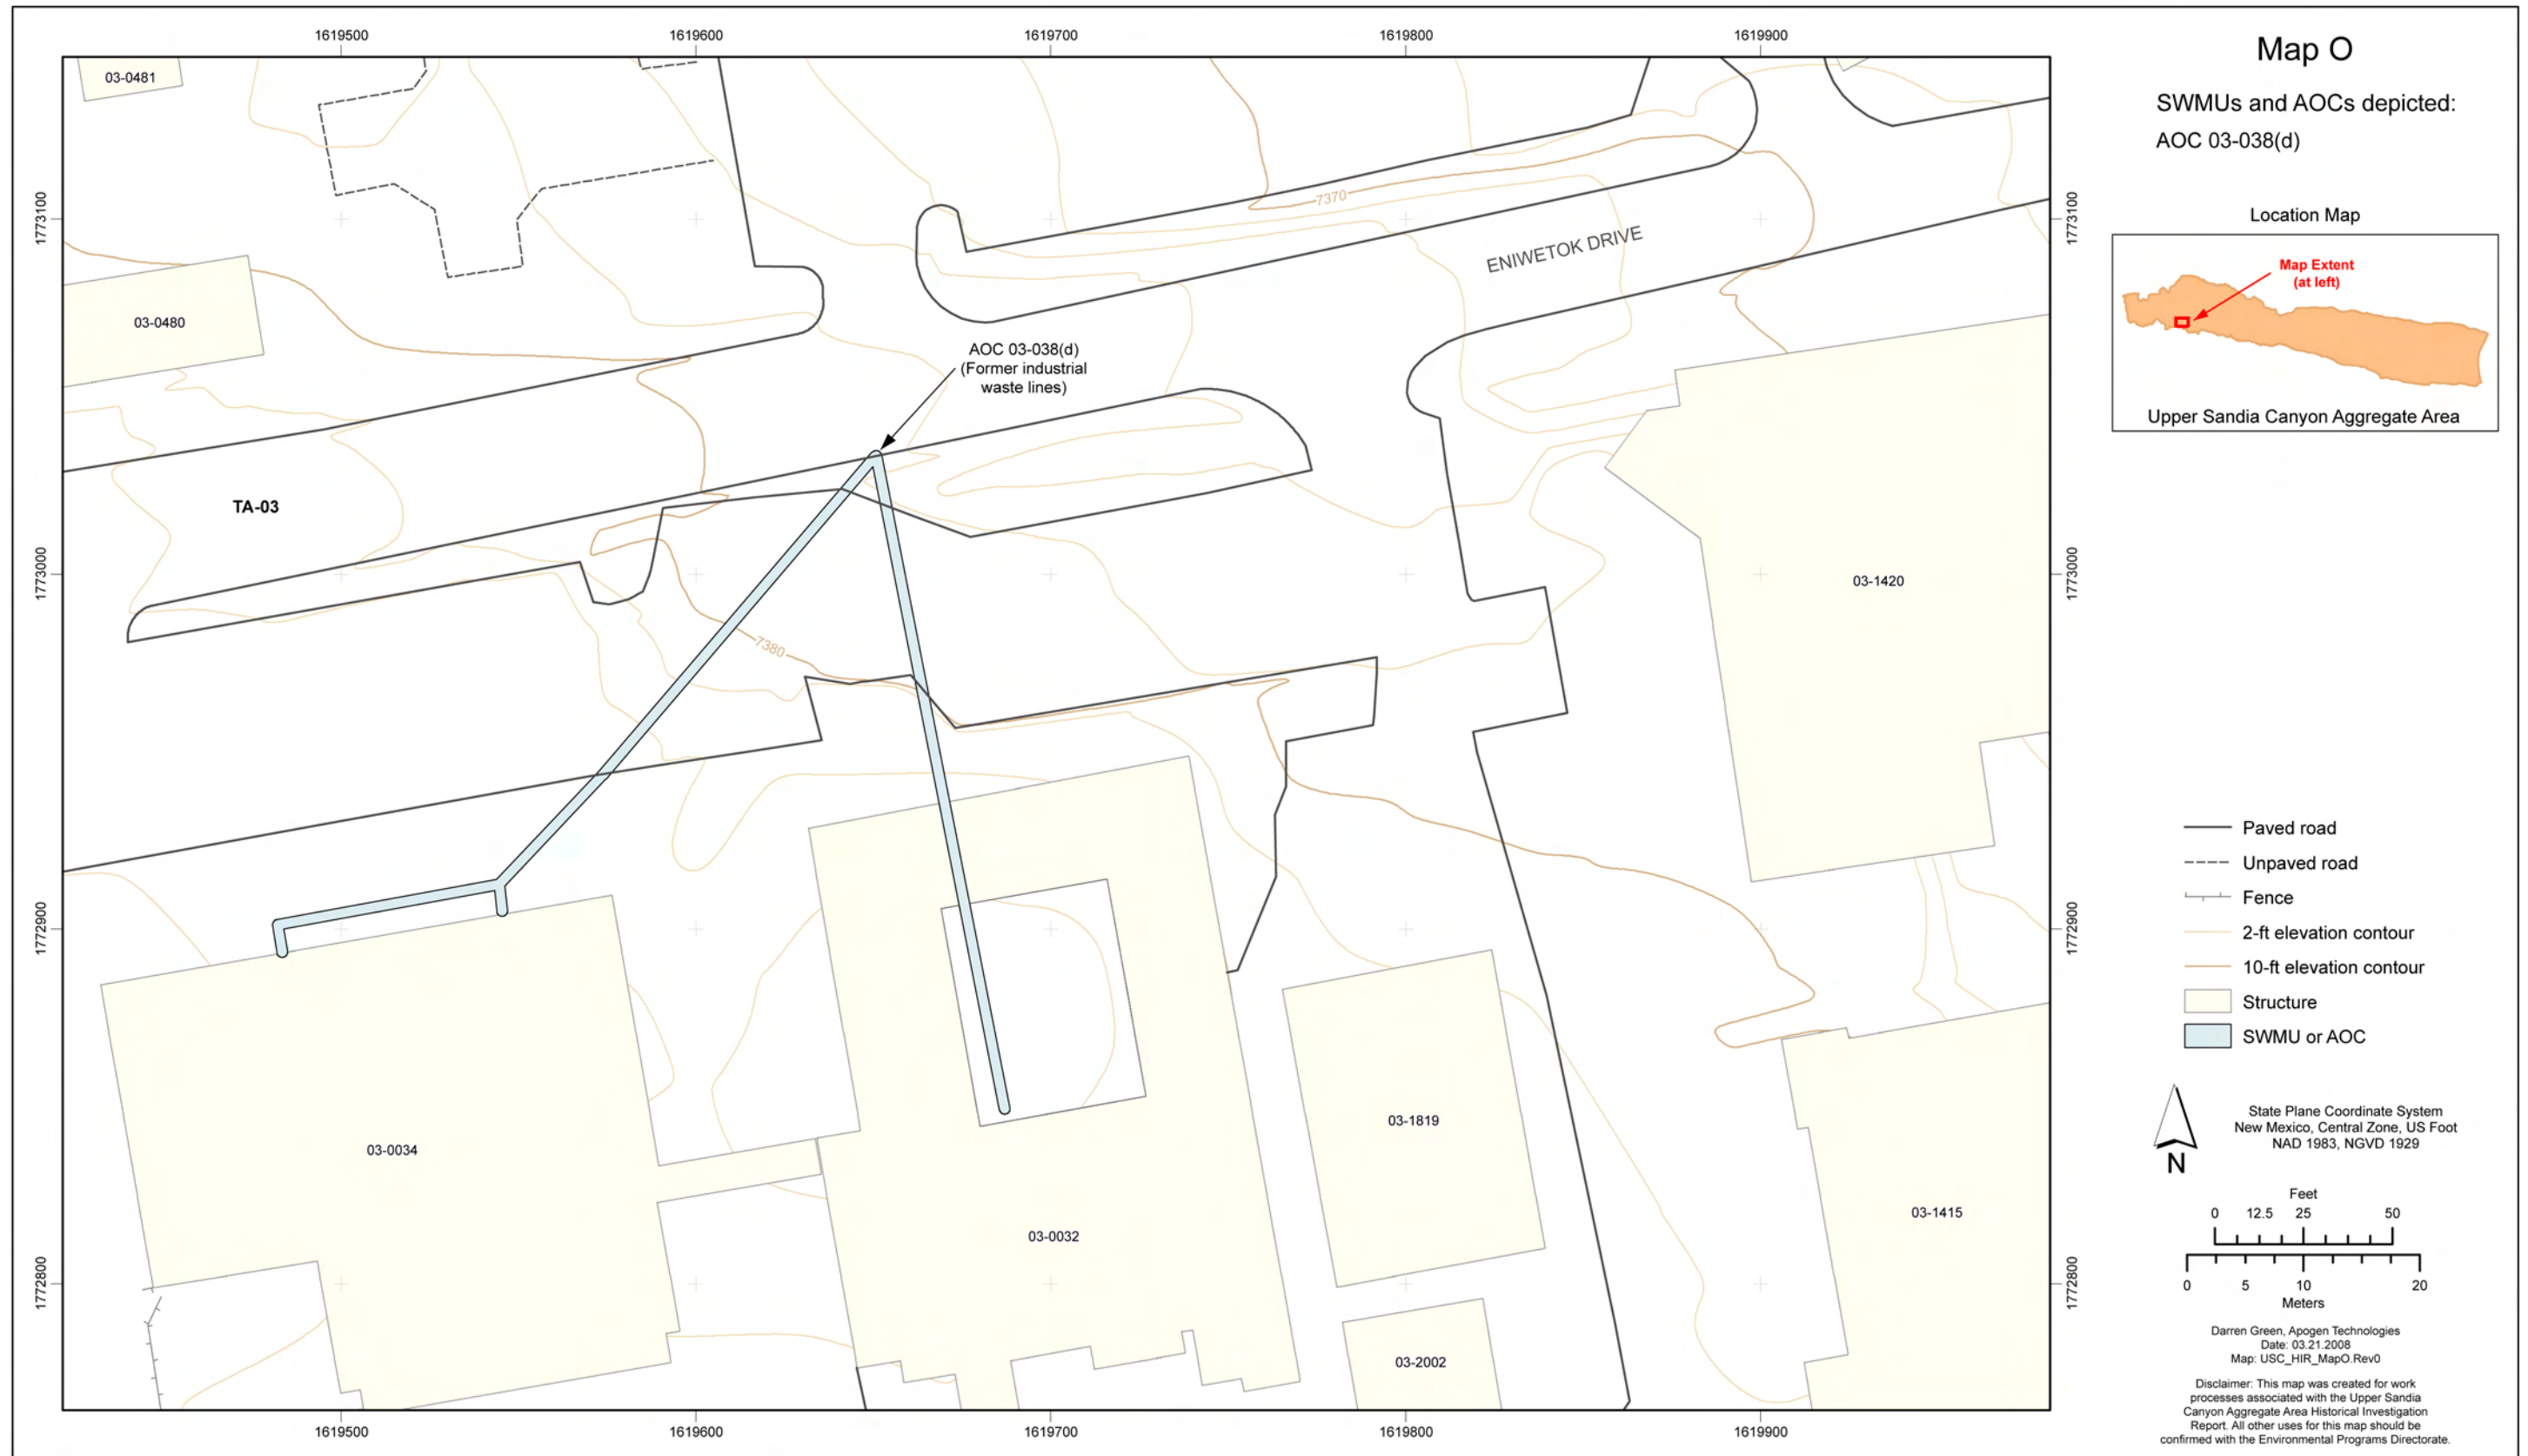


Figure 2.25-1 Map O site location

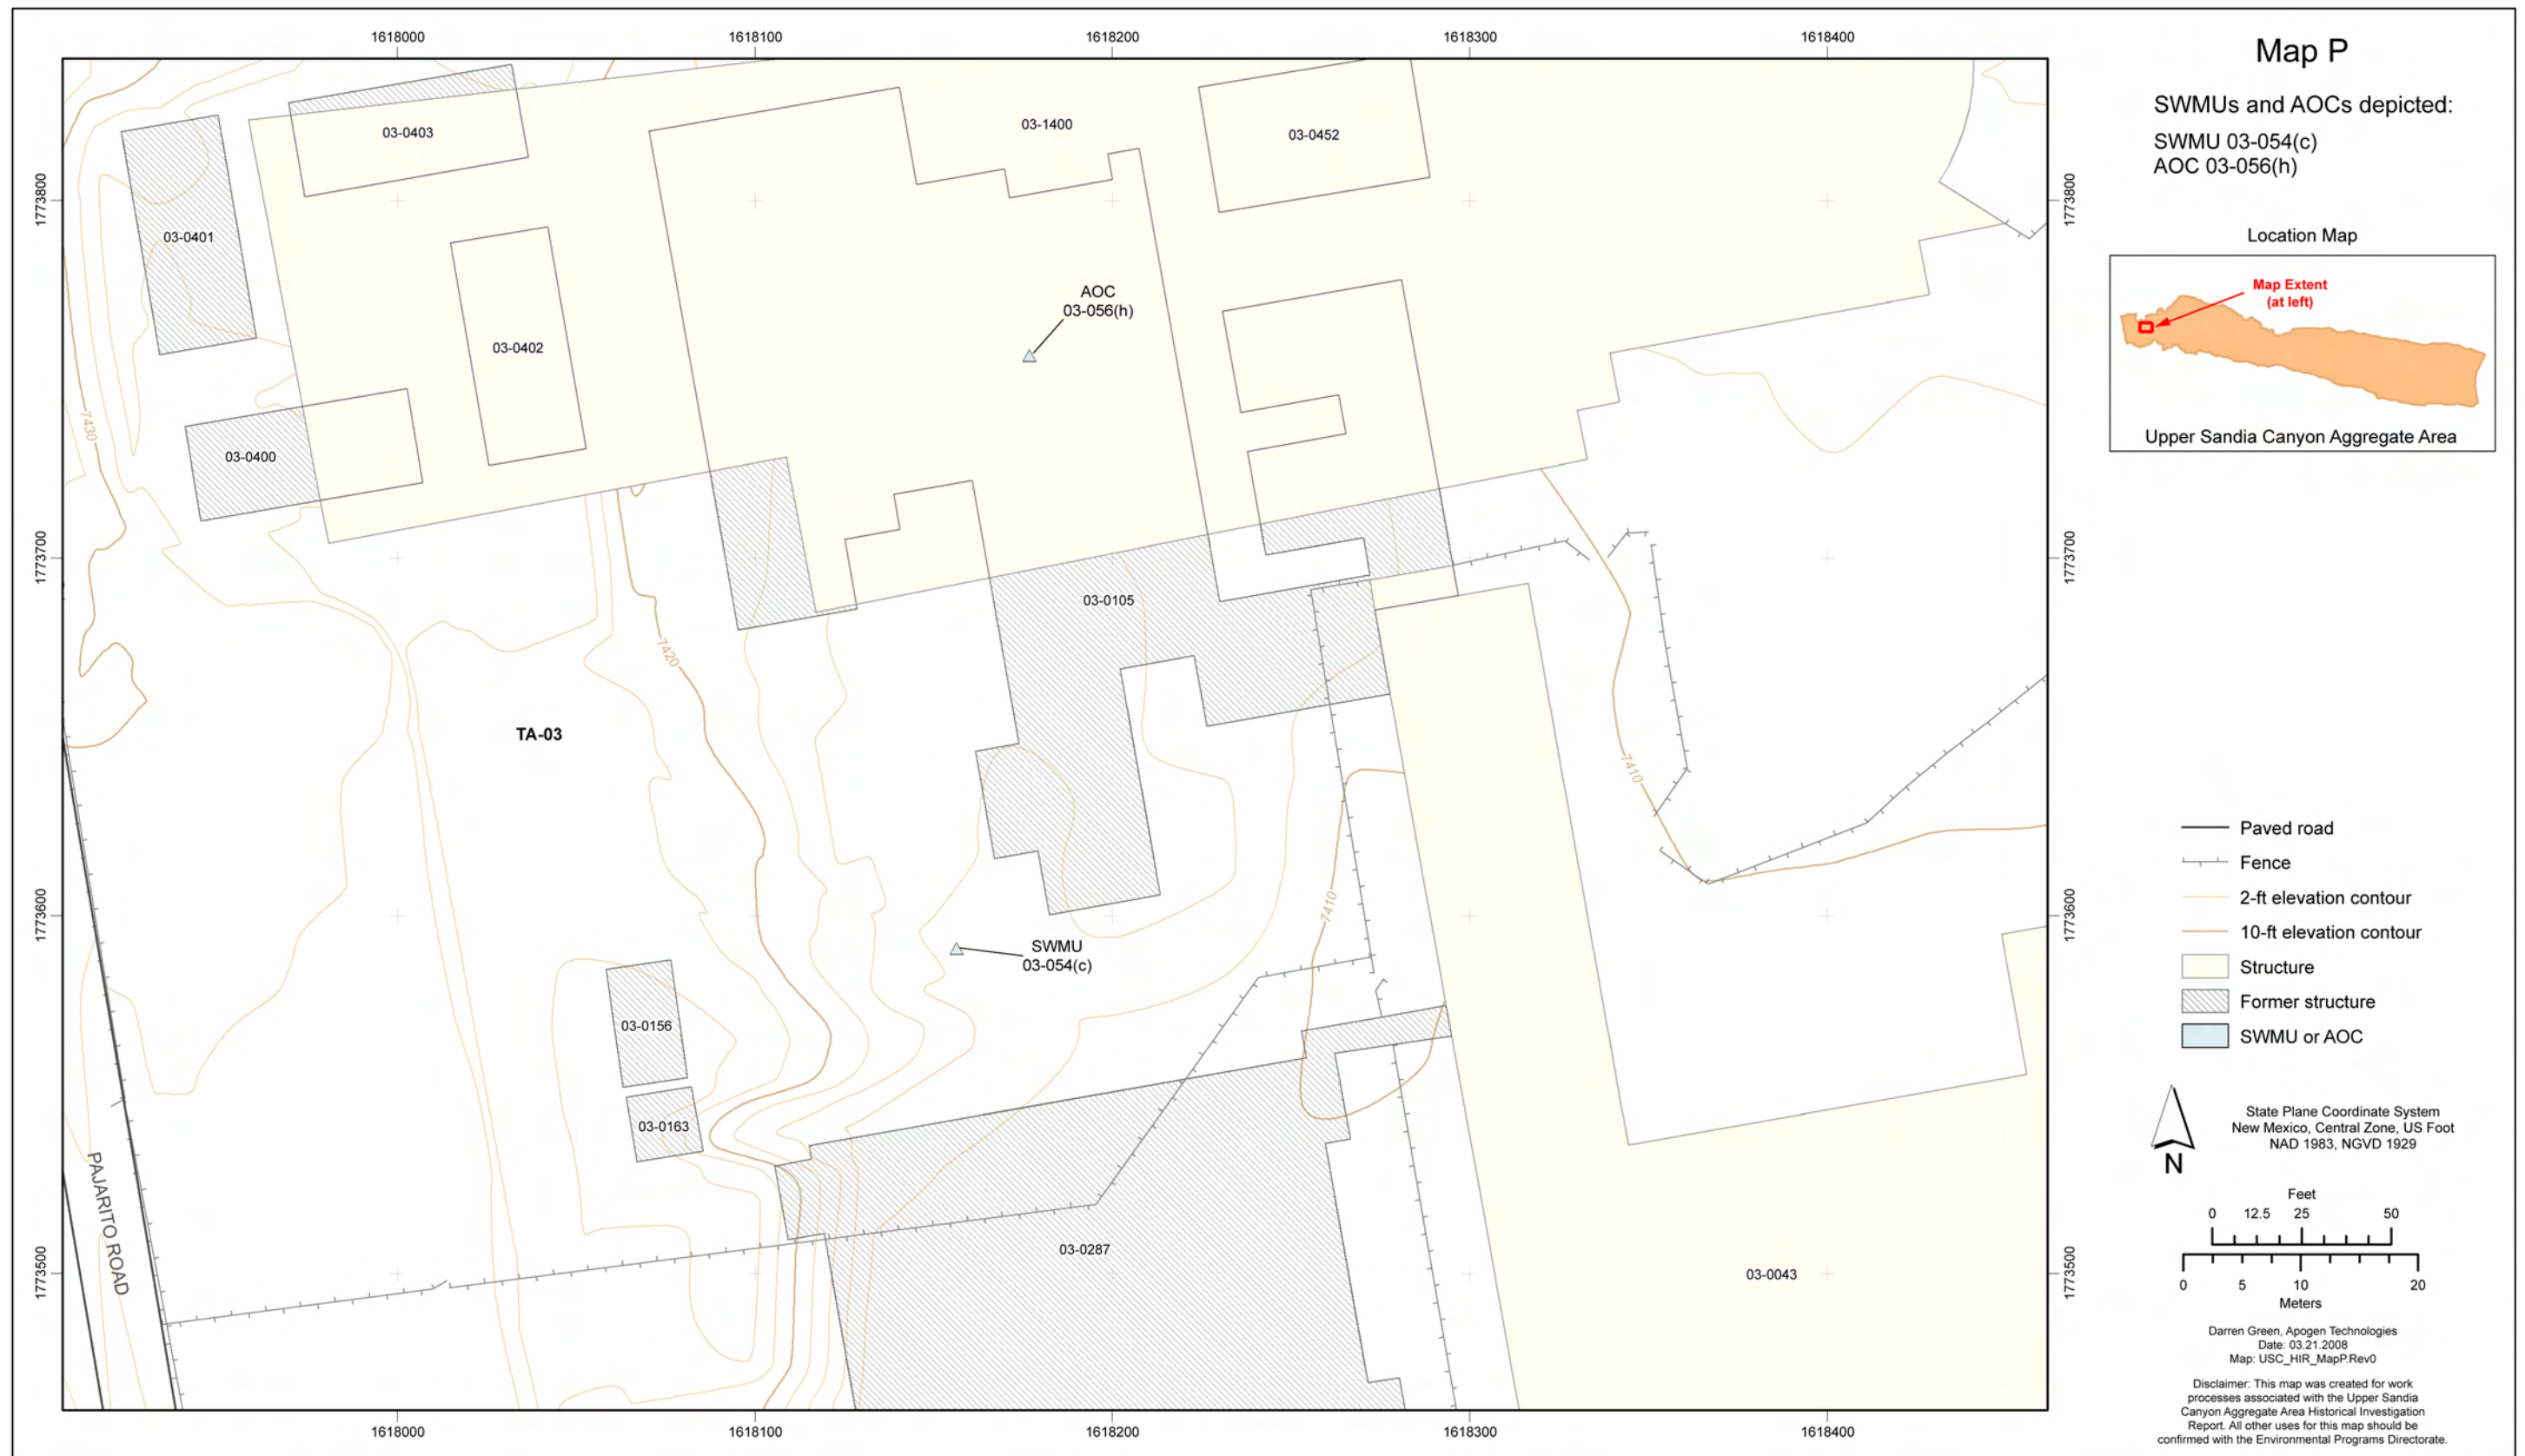


Figure 2.38-1 Map P site location



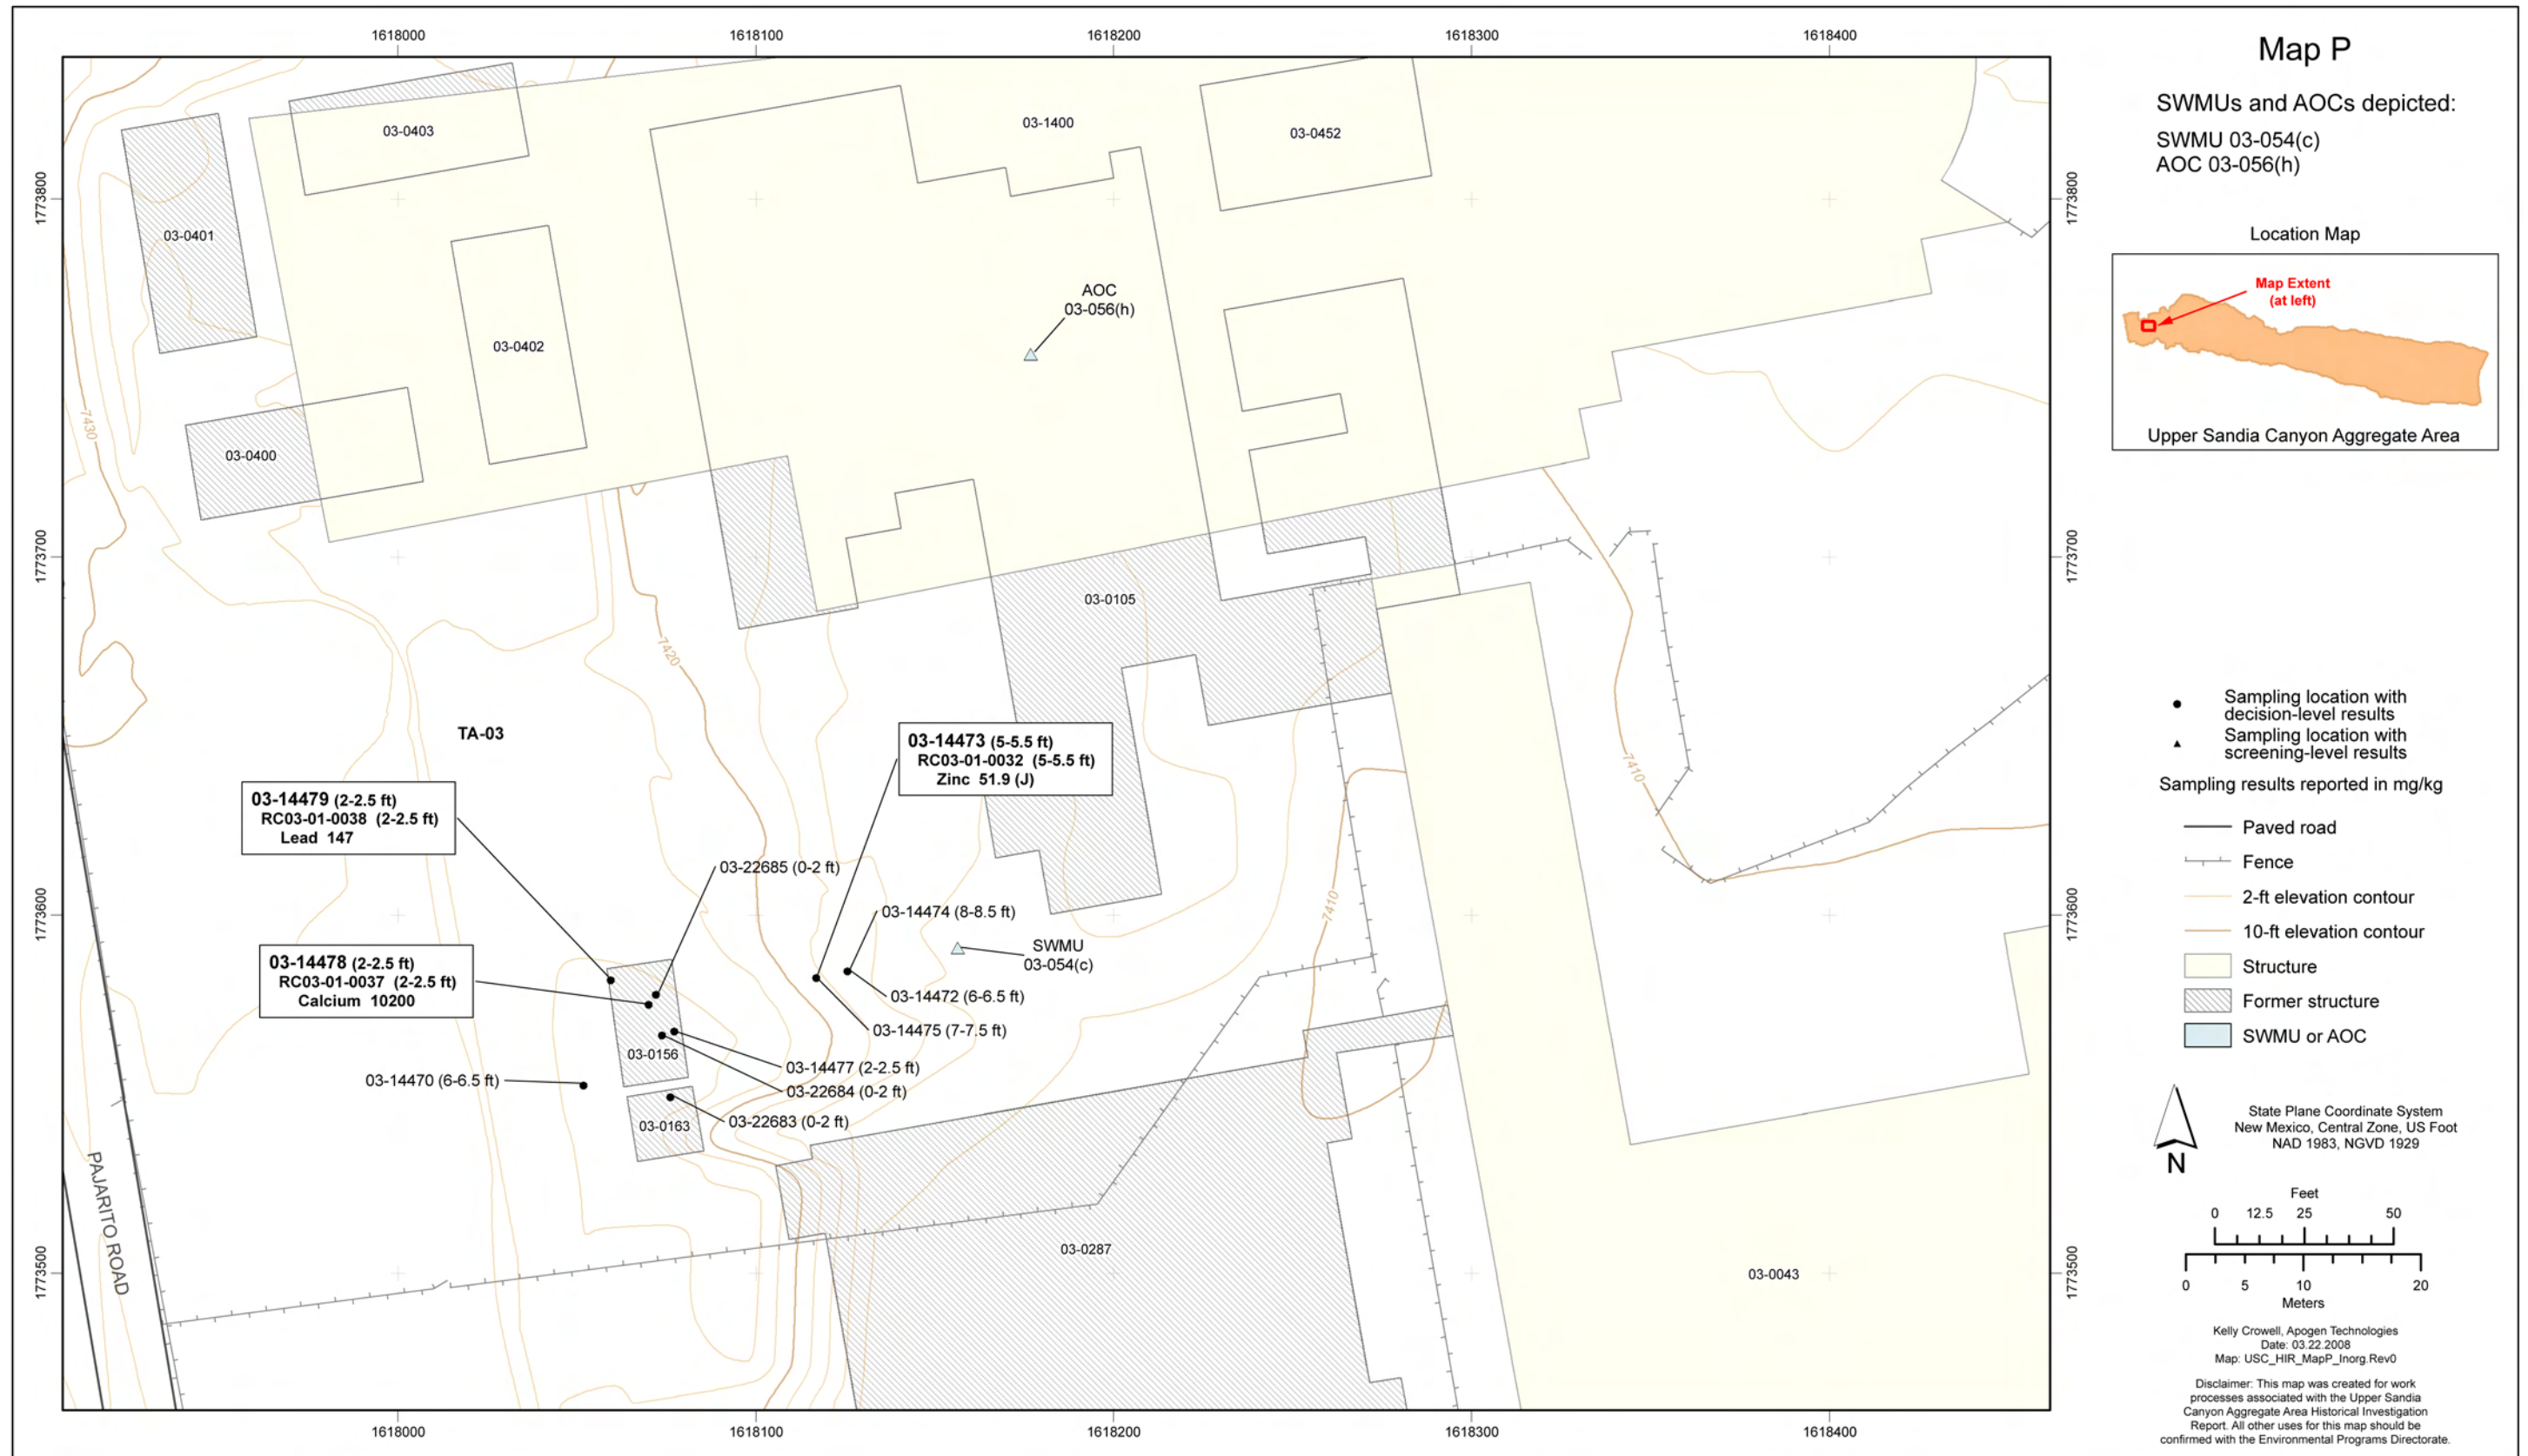


Figure 2.38-2 Map P inorganic chemical sampling locations and results detected above BVs



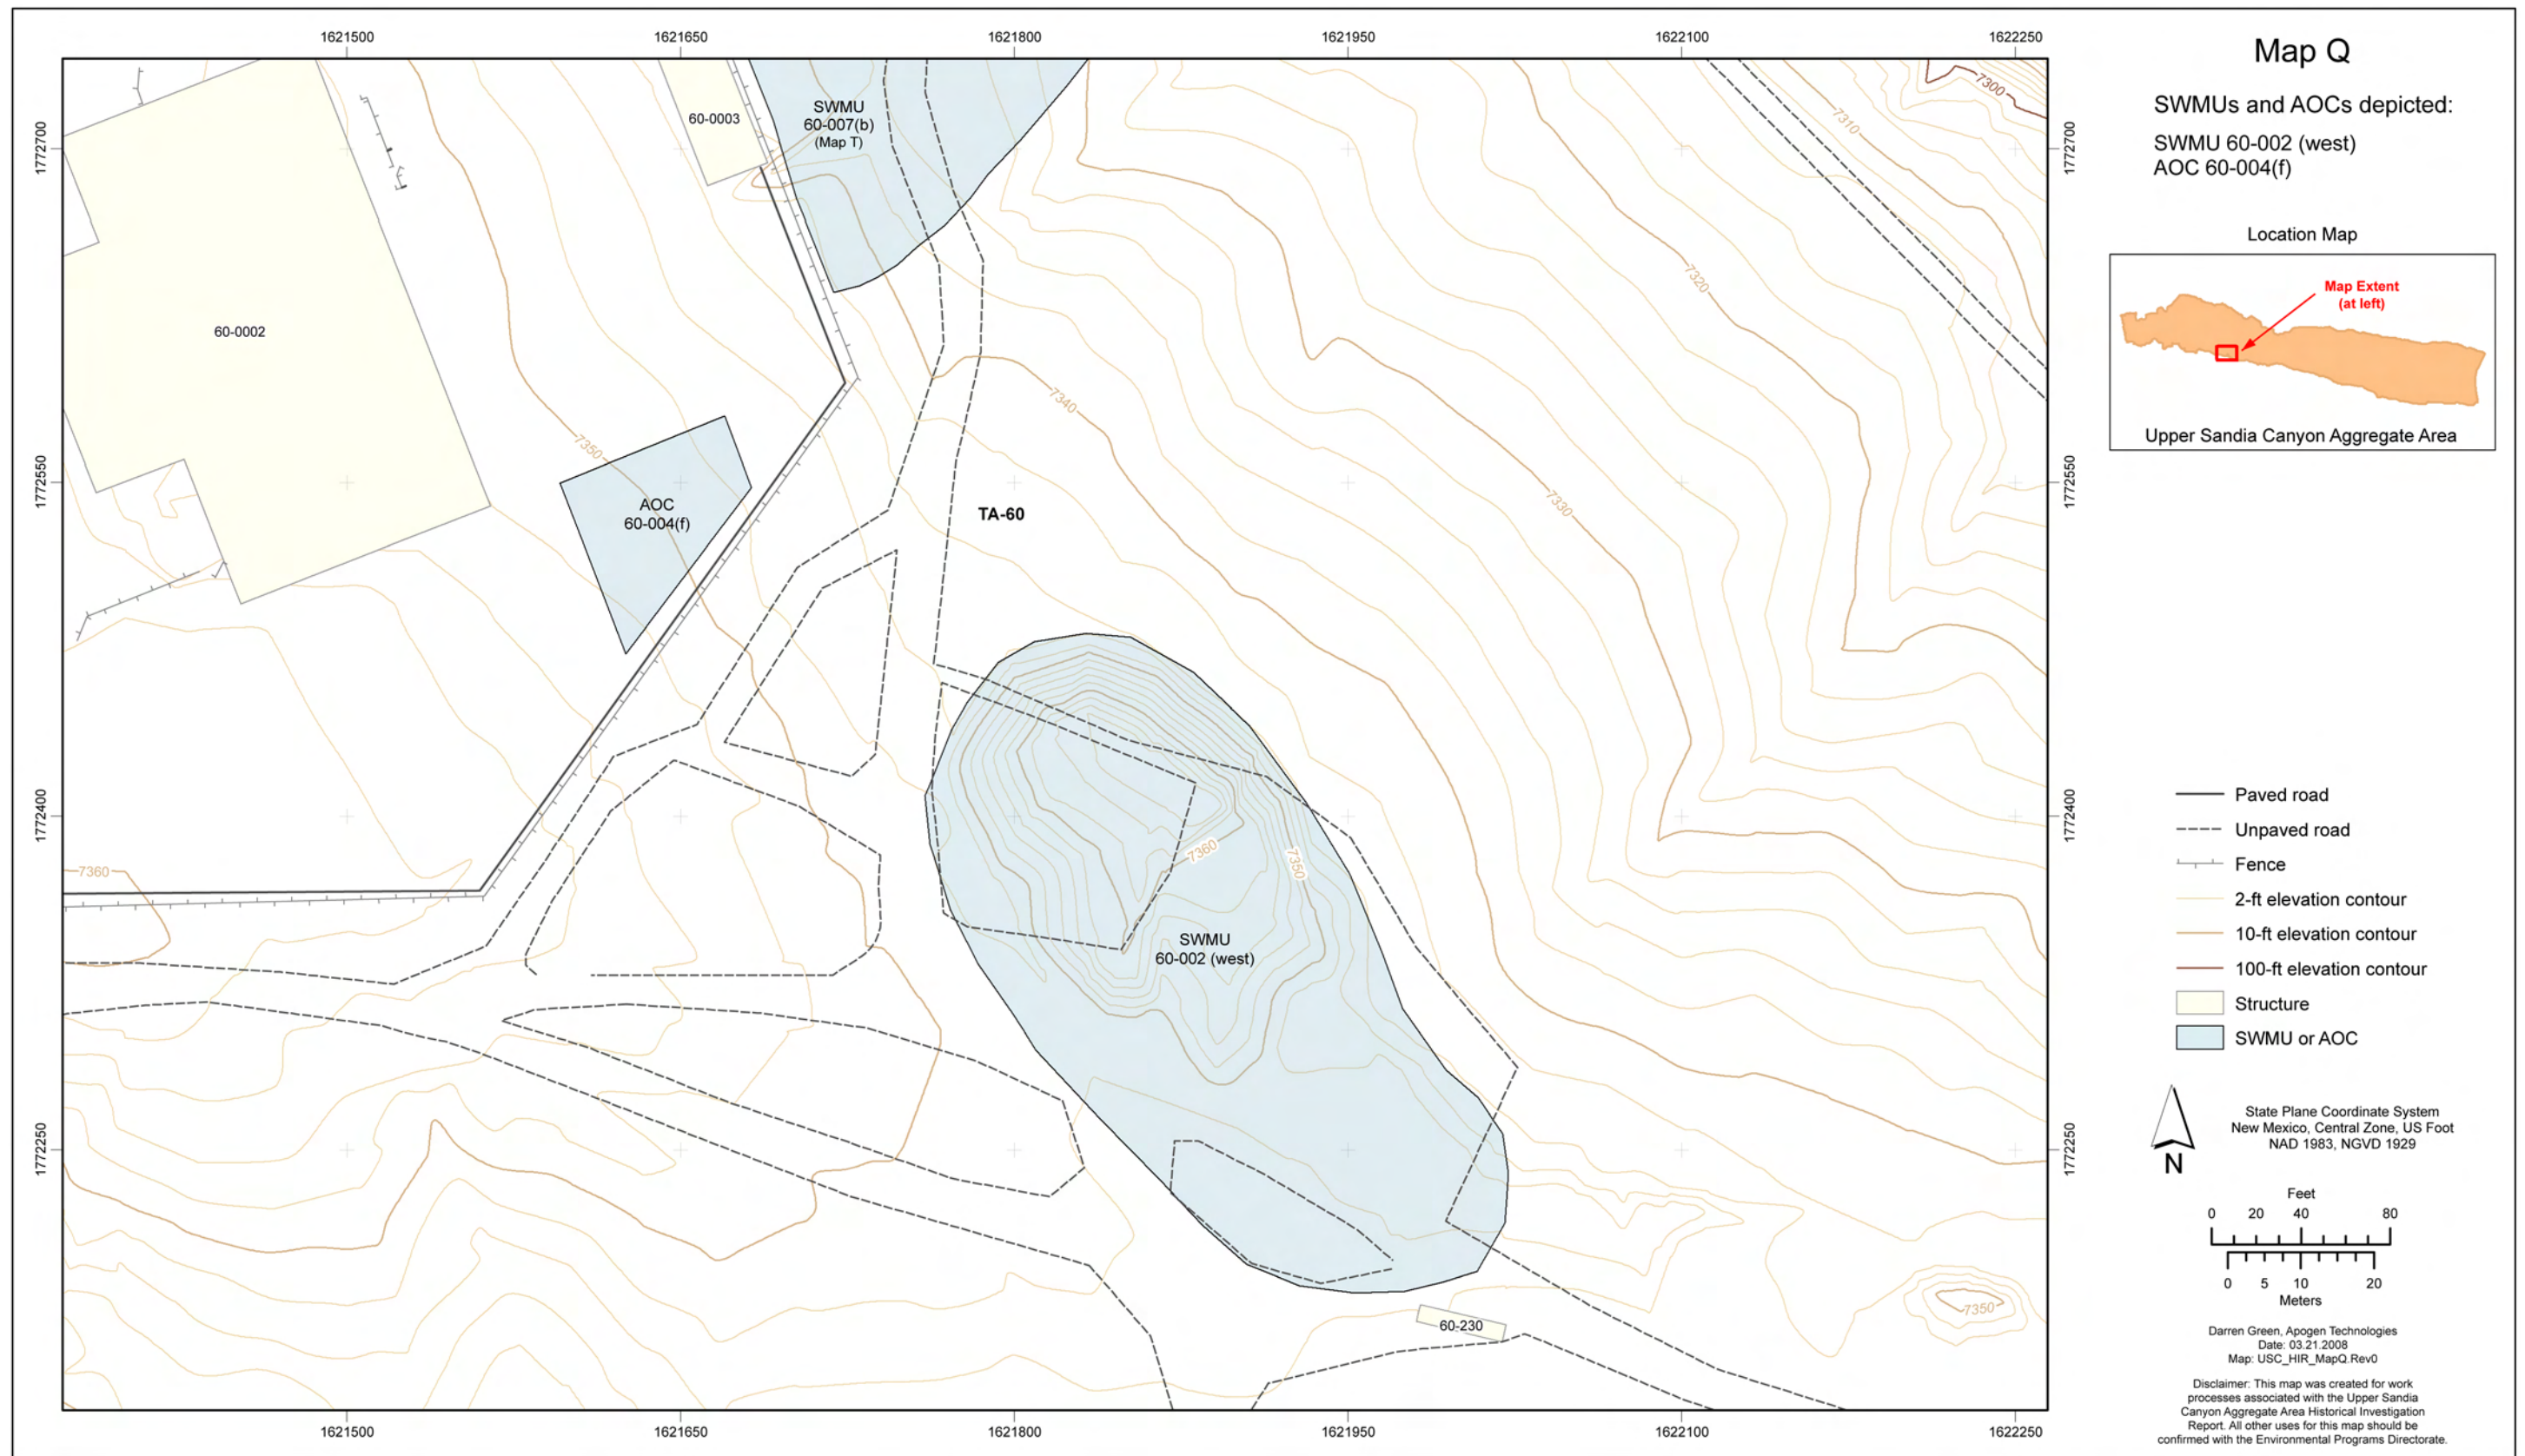


Figure 3.1-1 Map Q site location



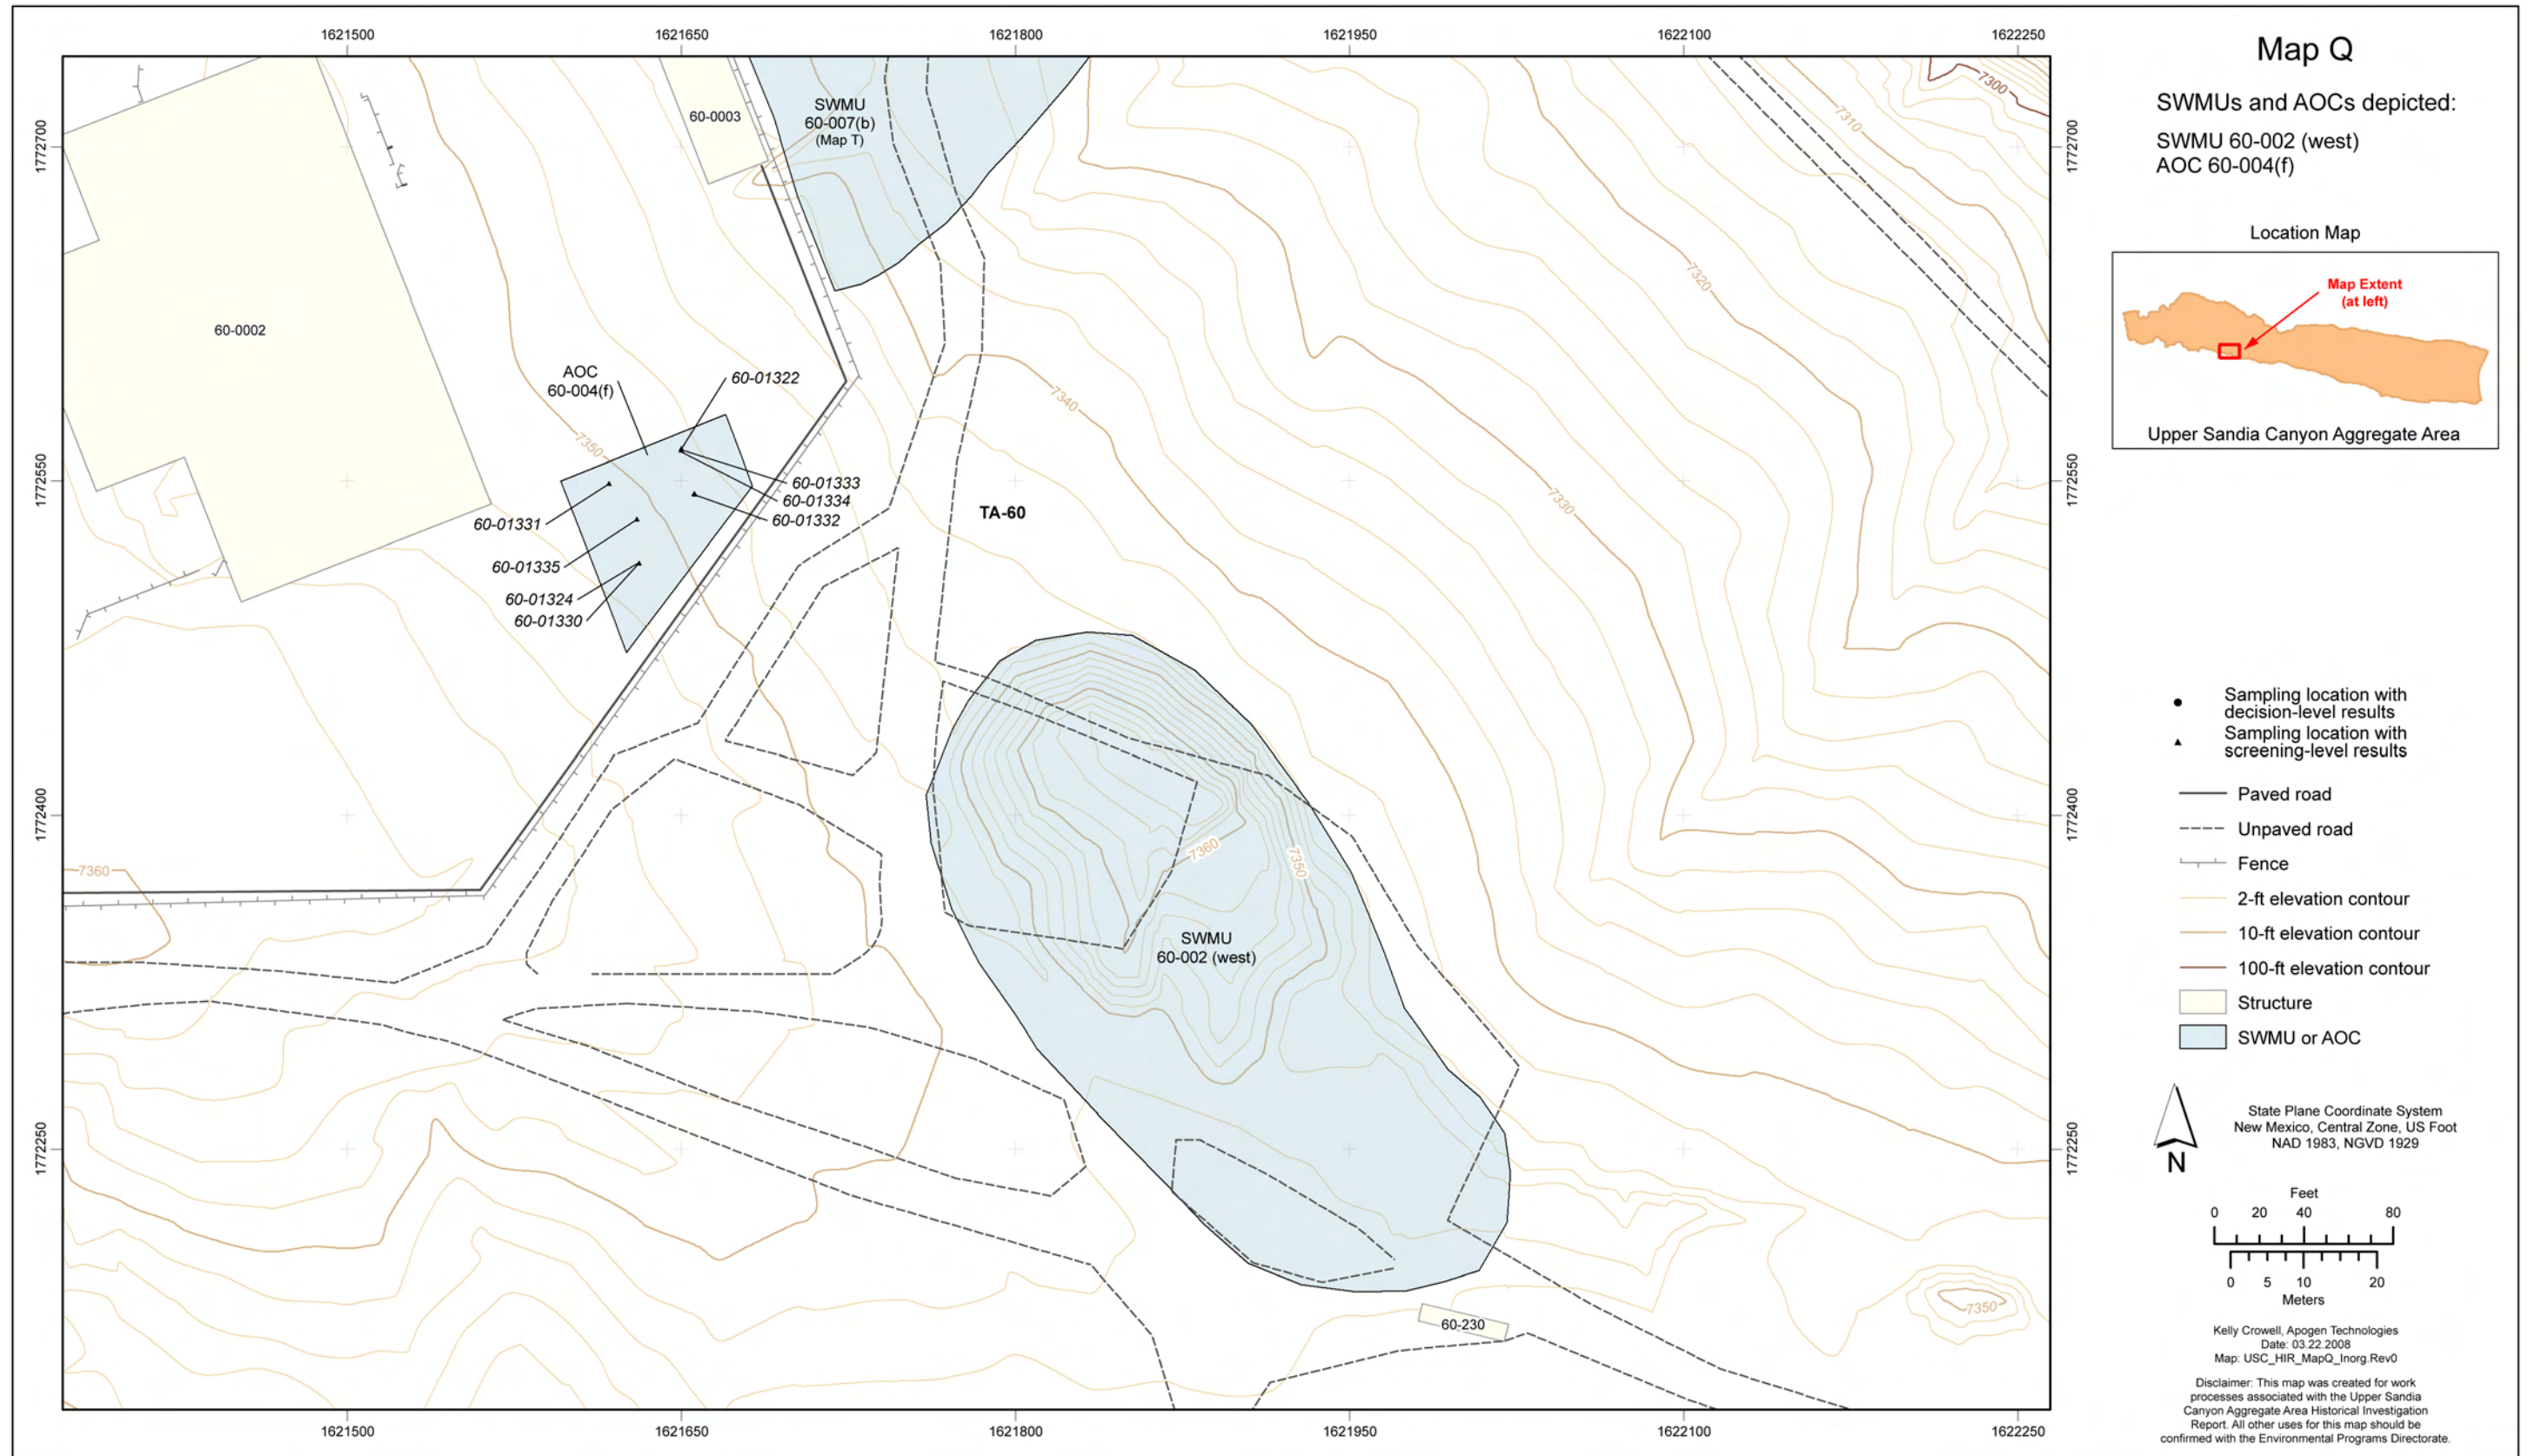


Figure 3.1-2 Map Q inorganic chemical sampling locations and results detected above BVs



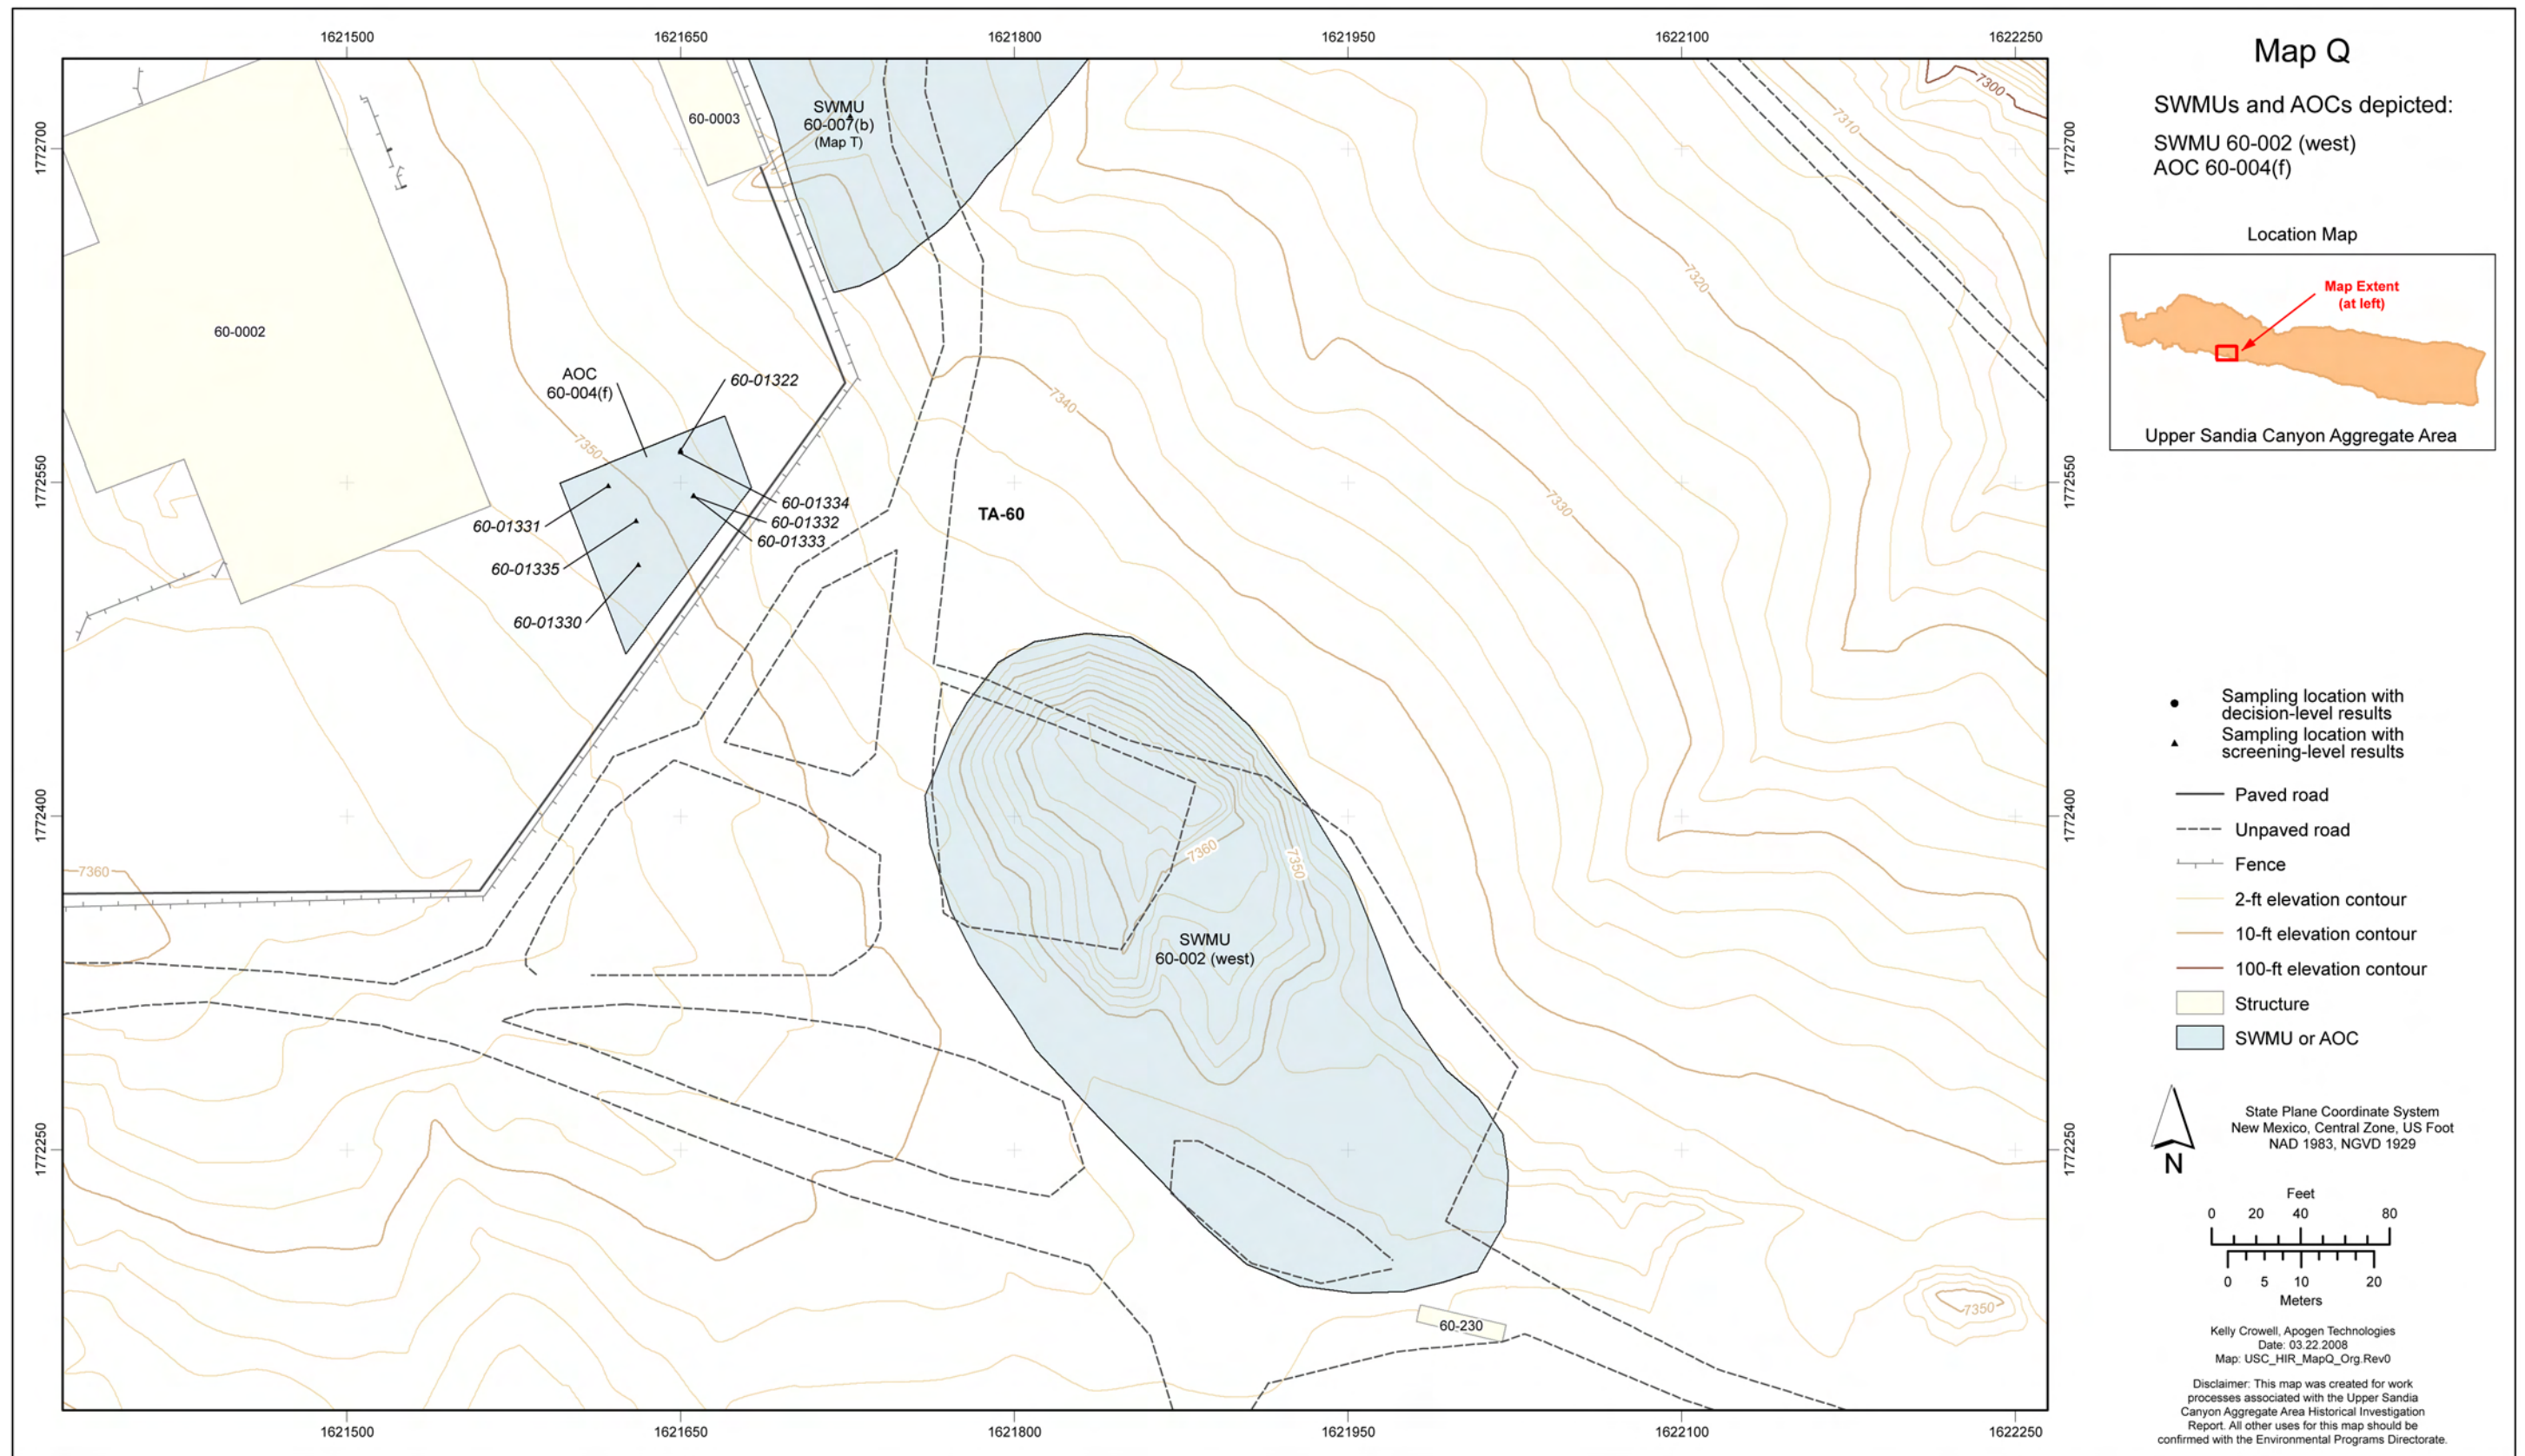


Figure 3.1-3 Map Q organic chemical sampling locations



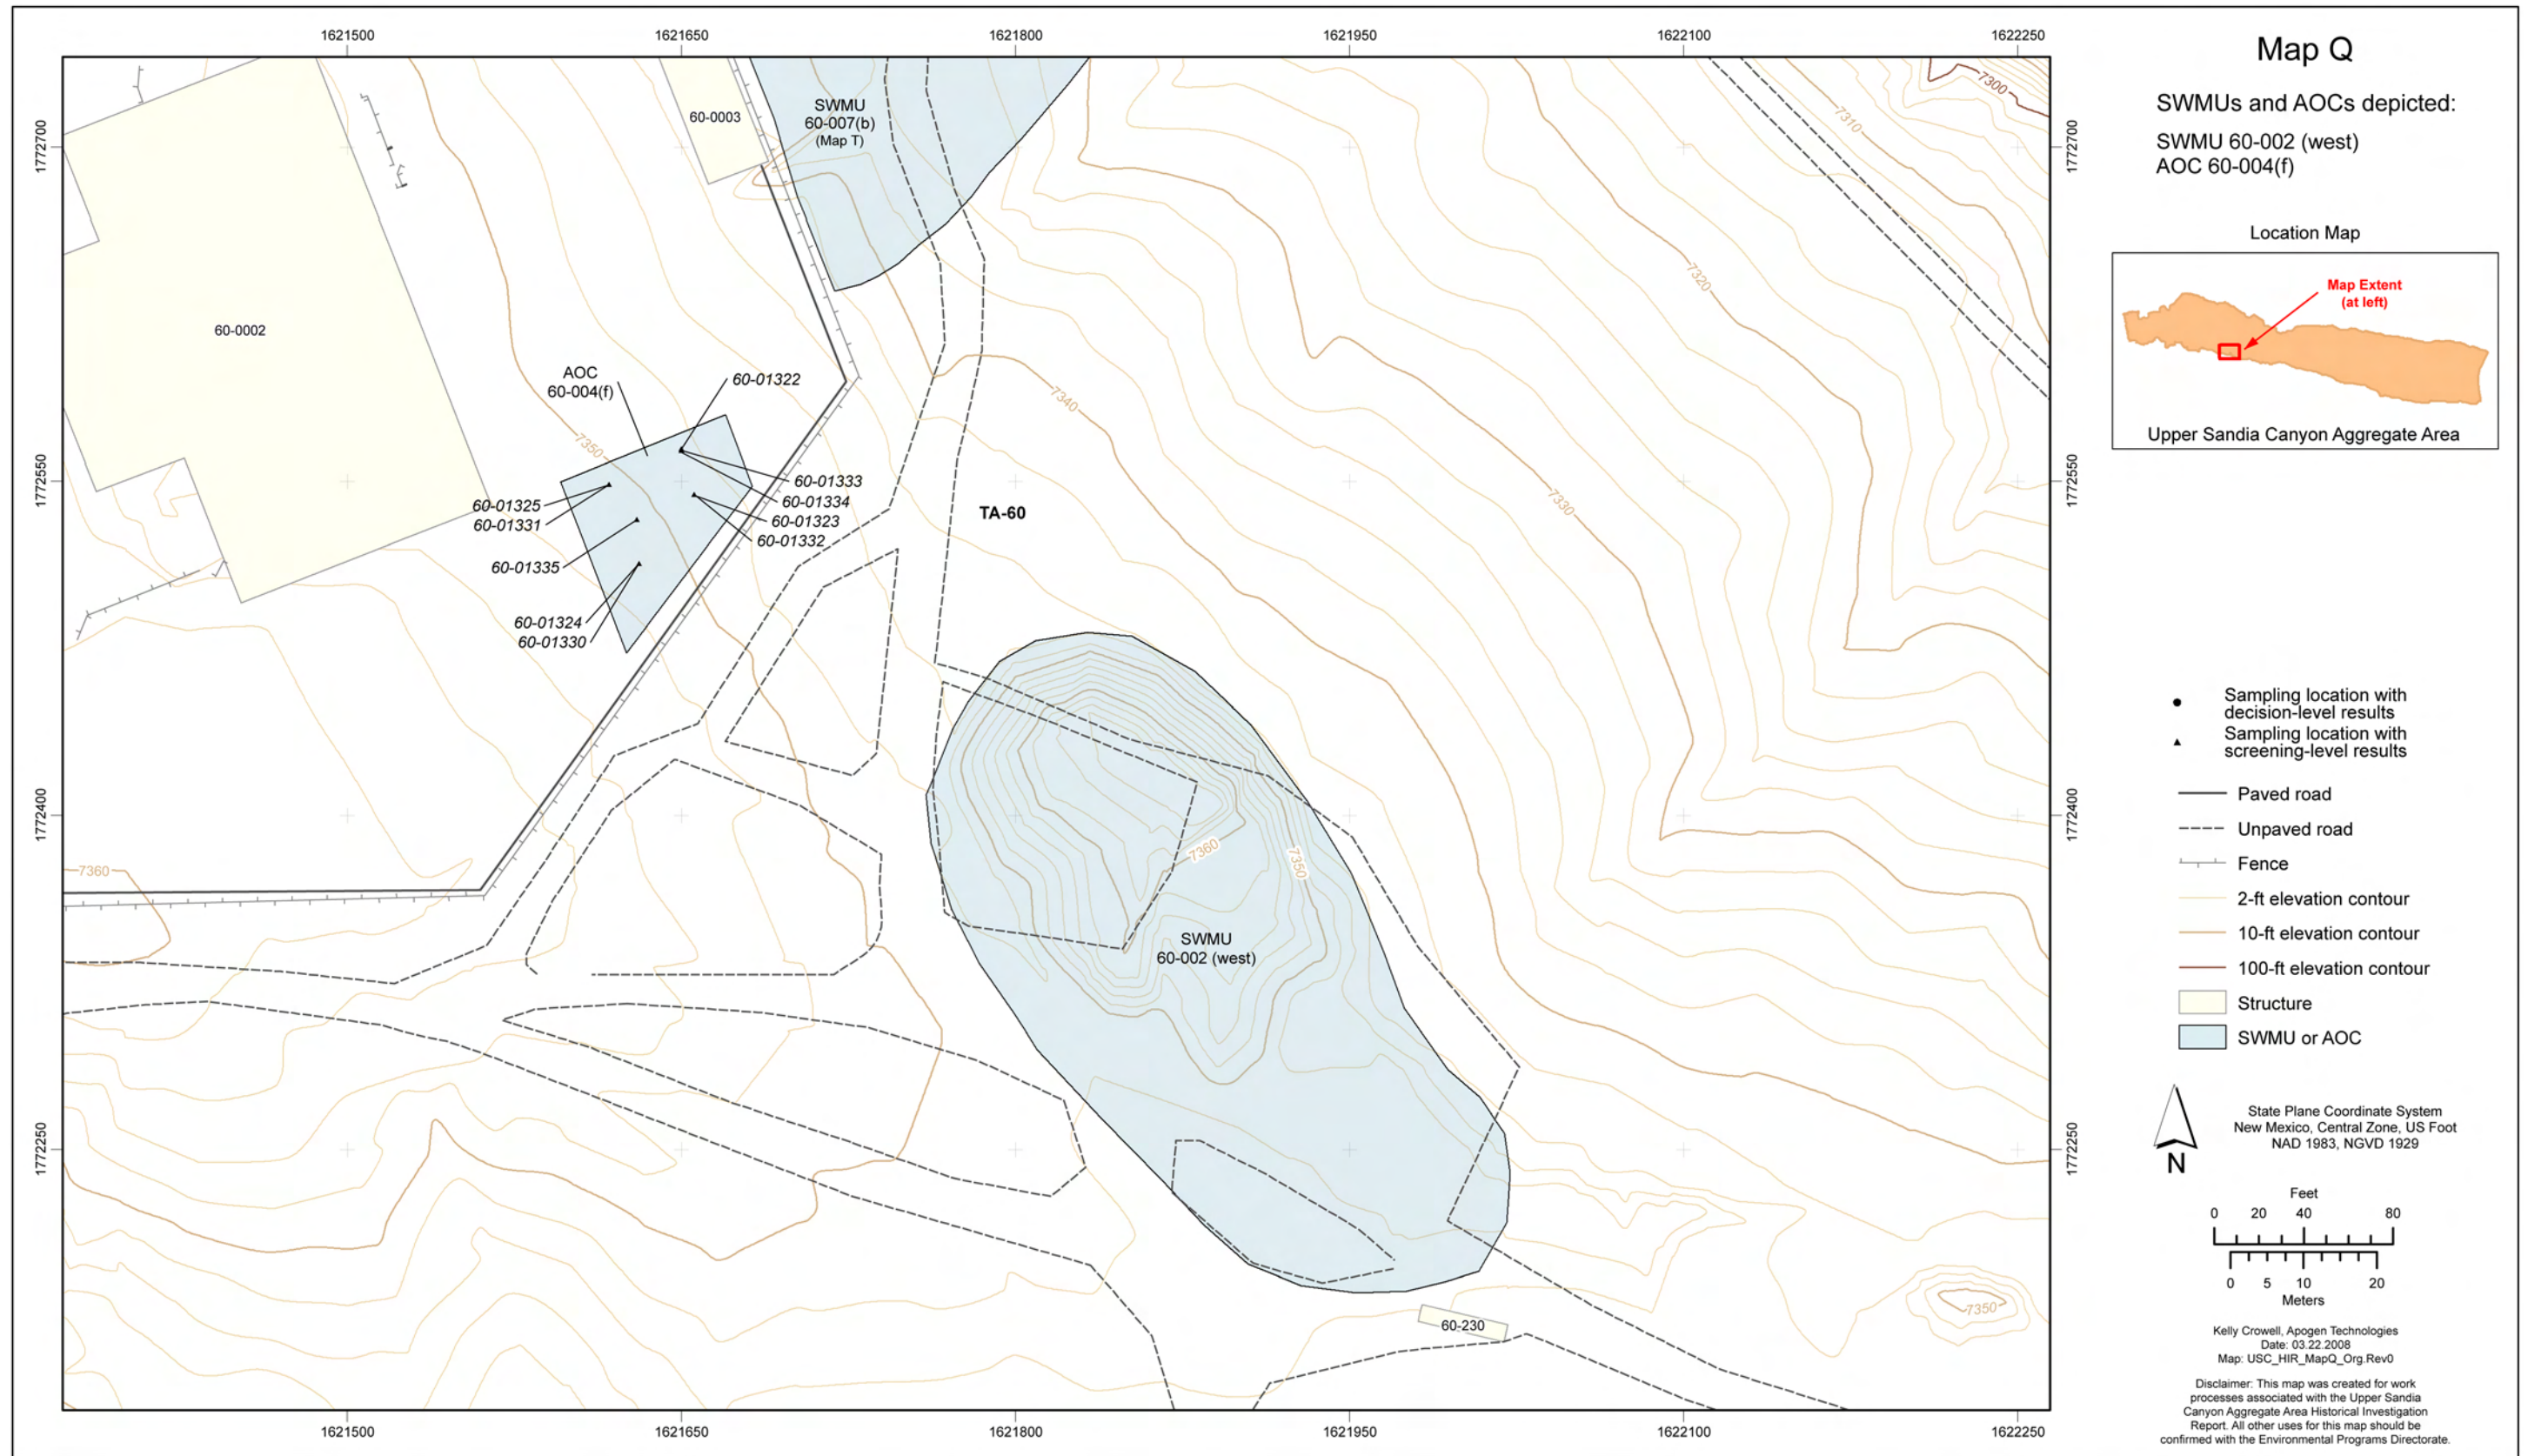


Figure 3.1-4 Map Q radionuclide sampling locations



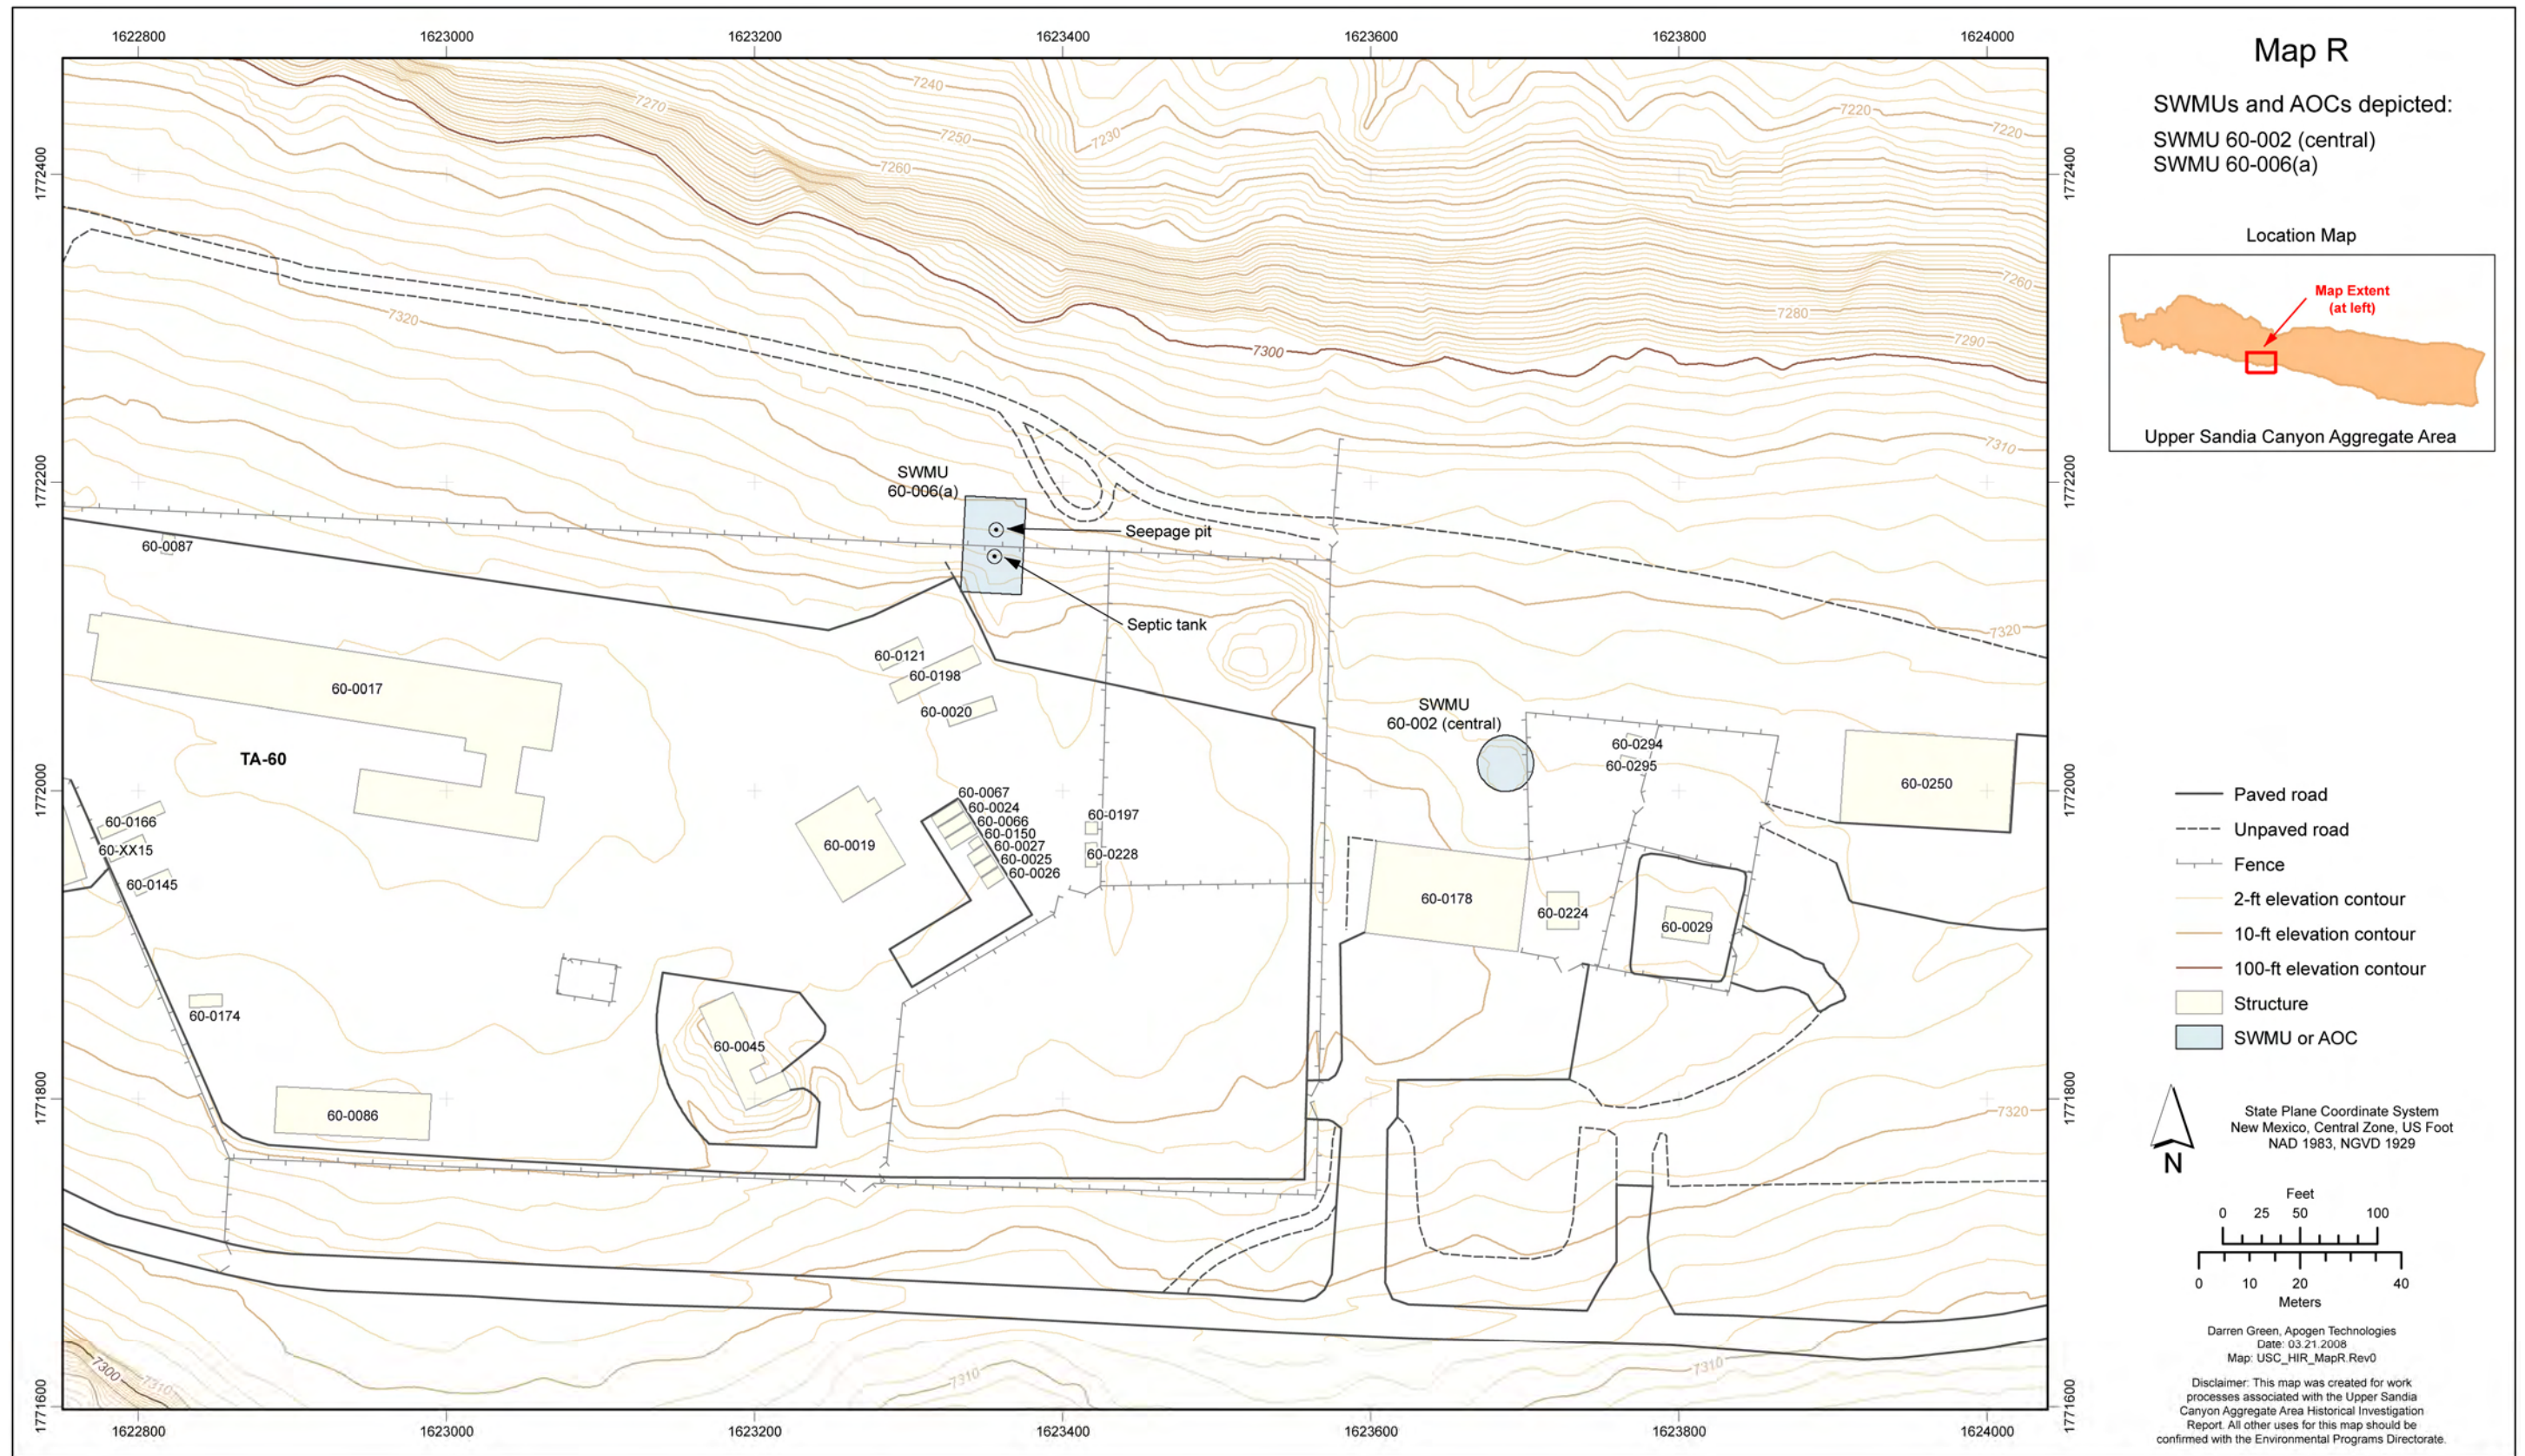


Figure 3.1-5 Map R site location



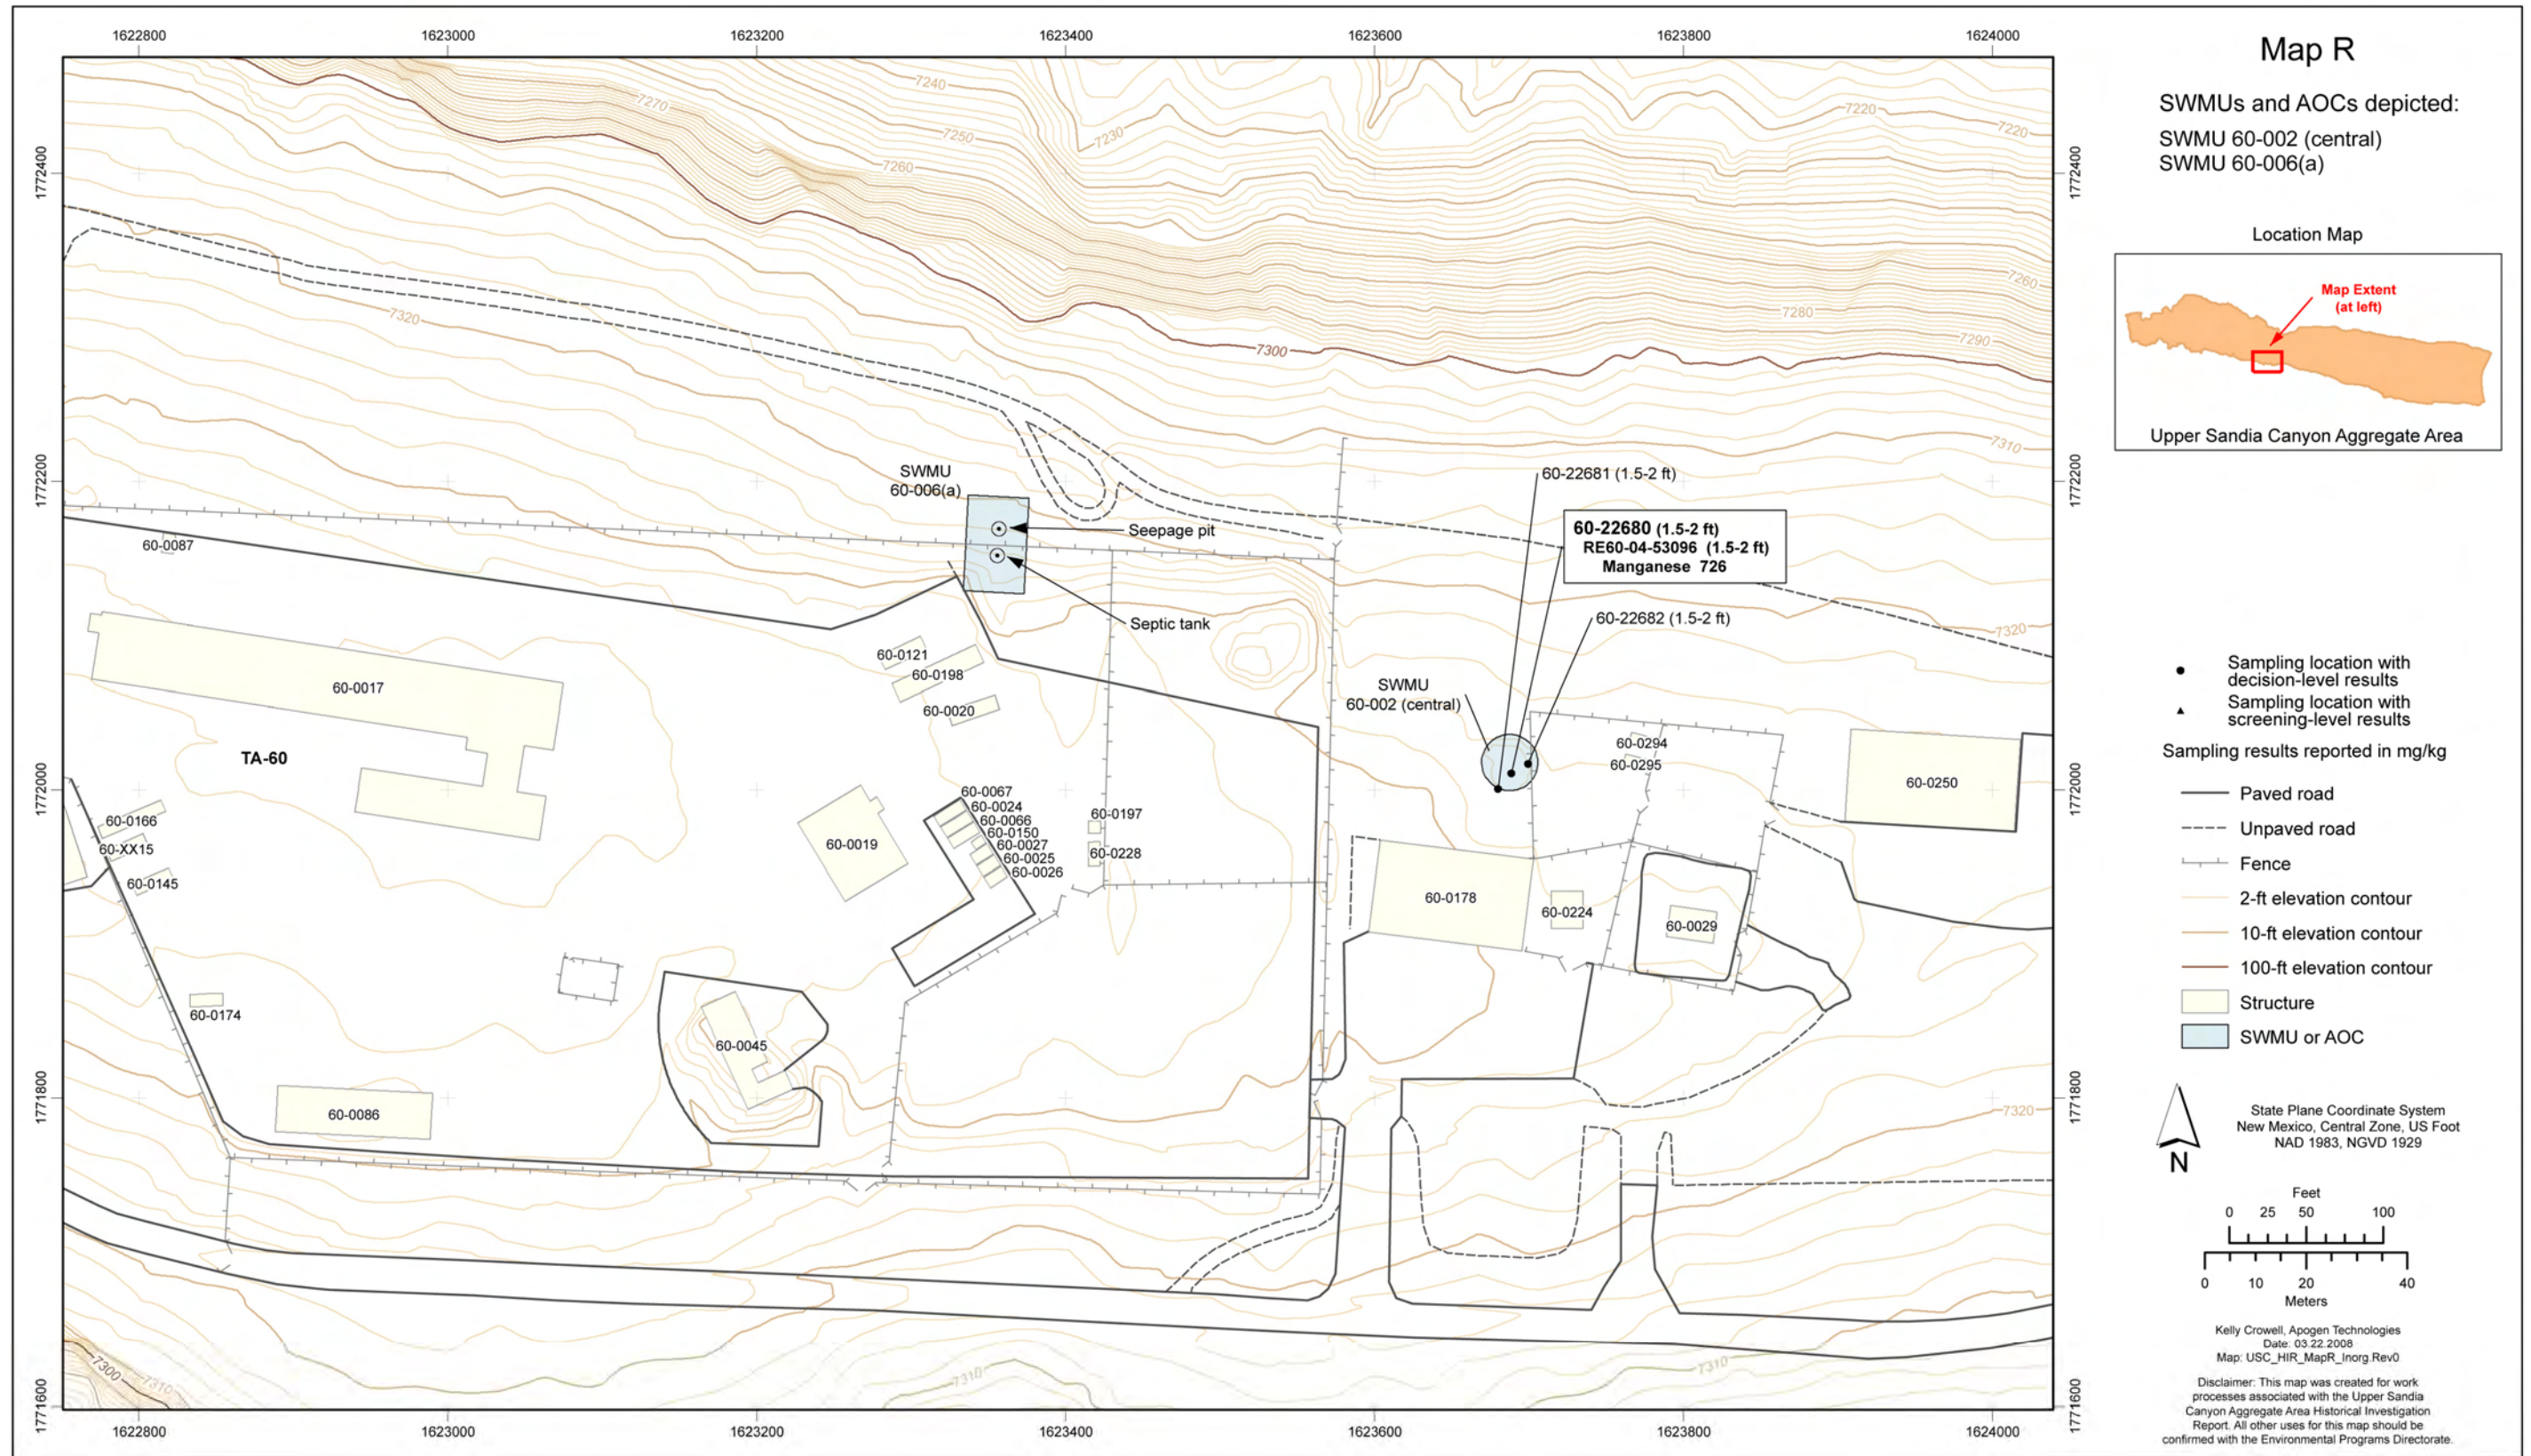


Figure 3.1-6 Map R inorganic chemical sampling locations and results detected above BVs



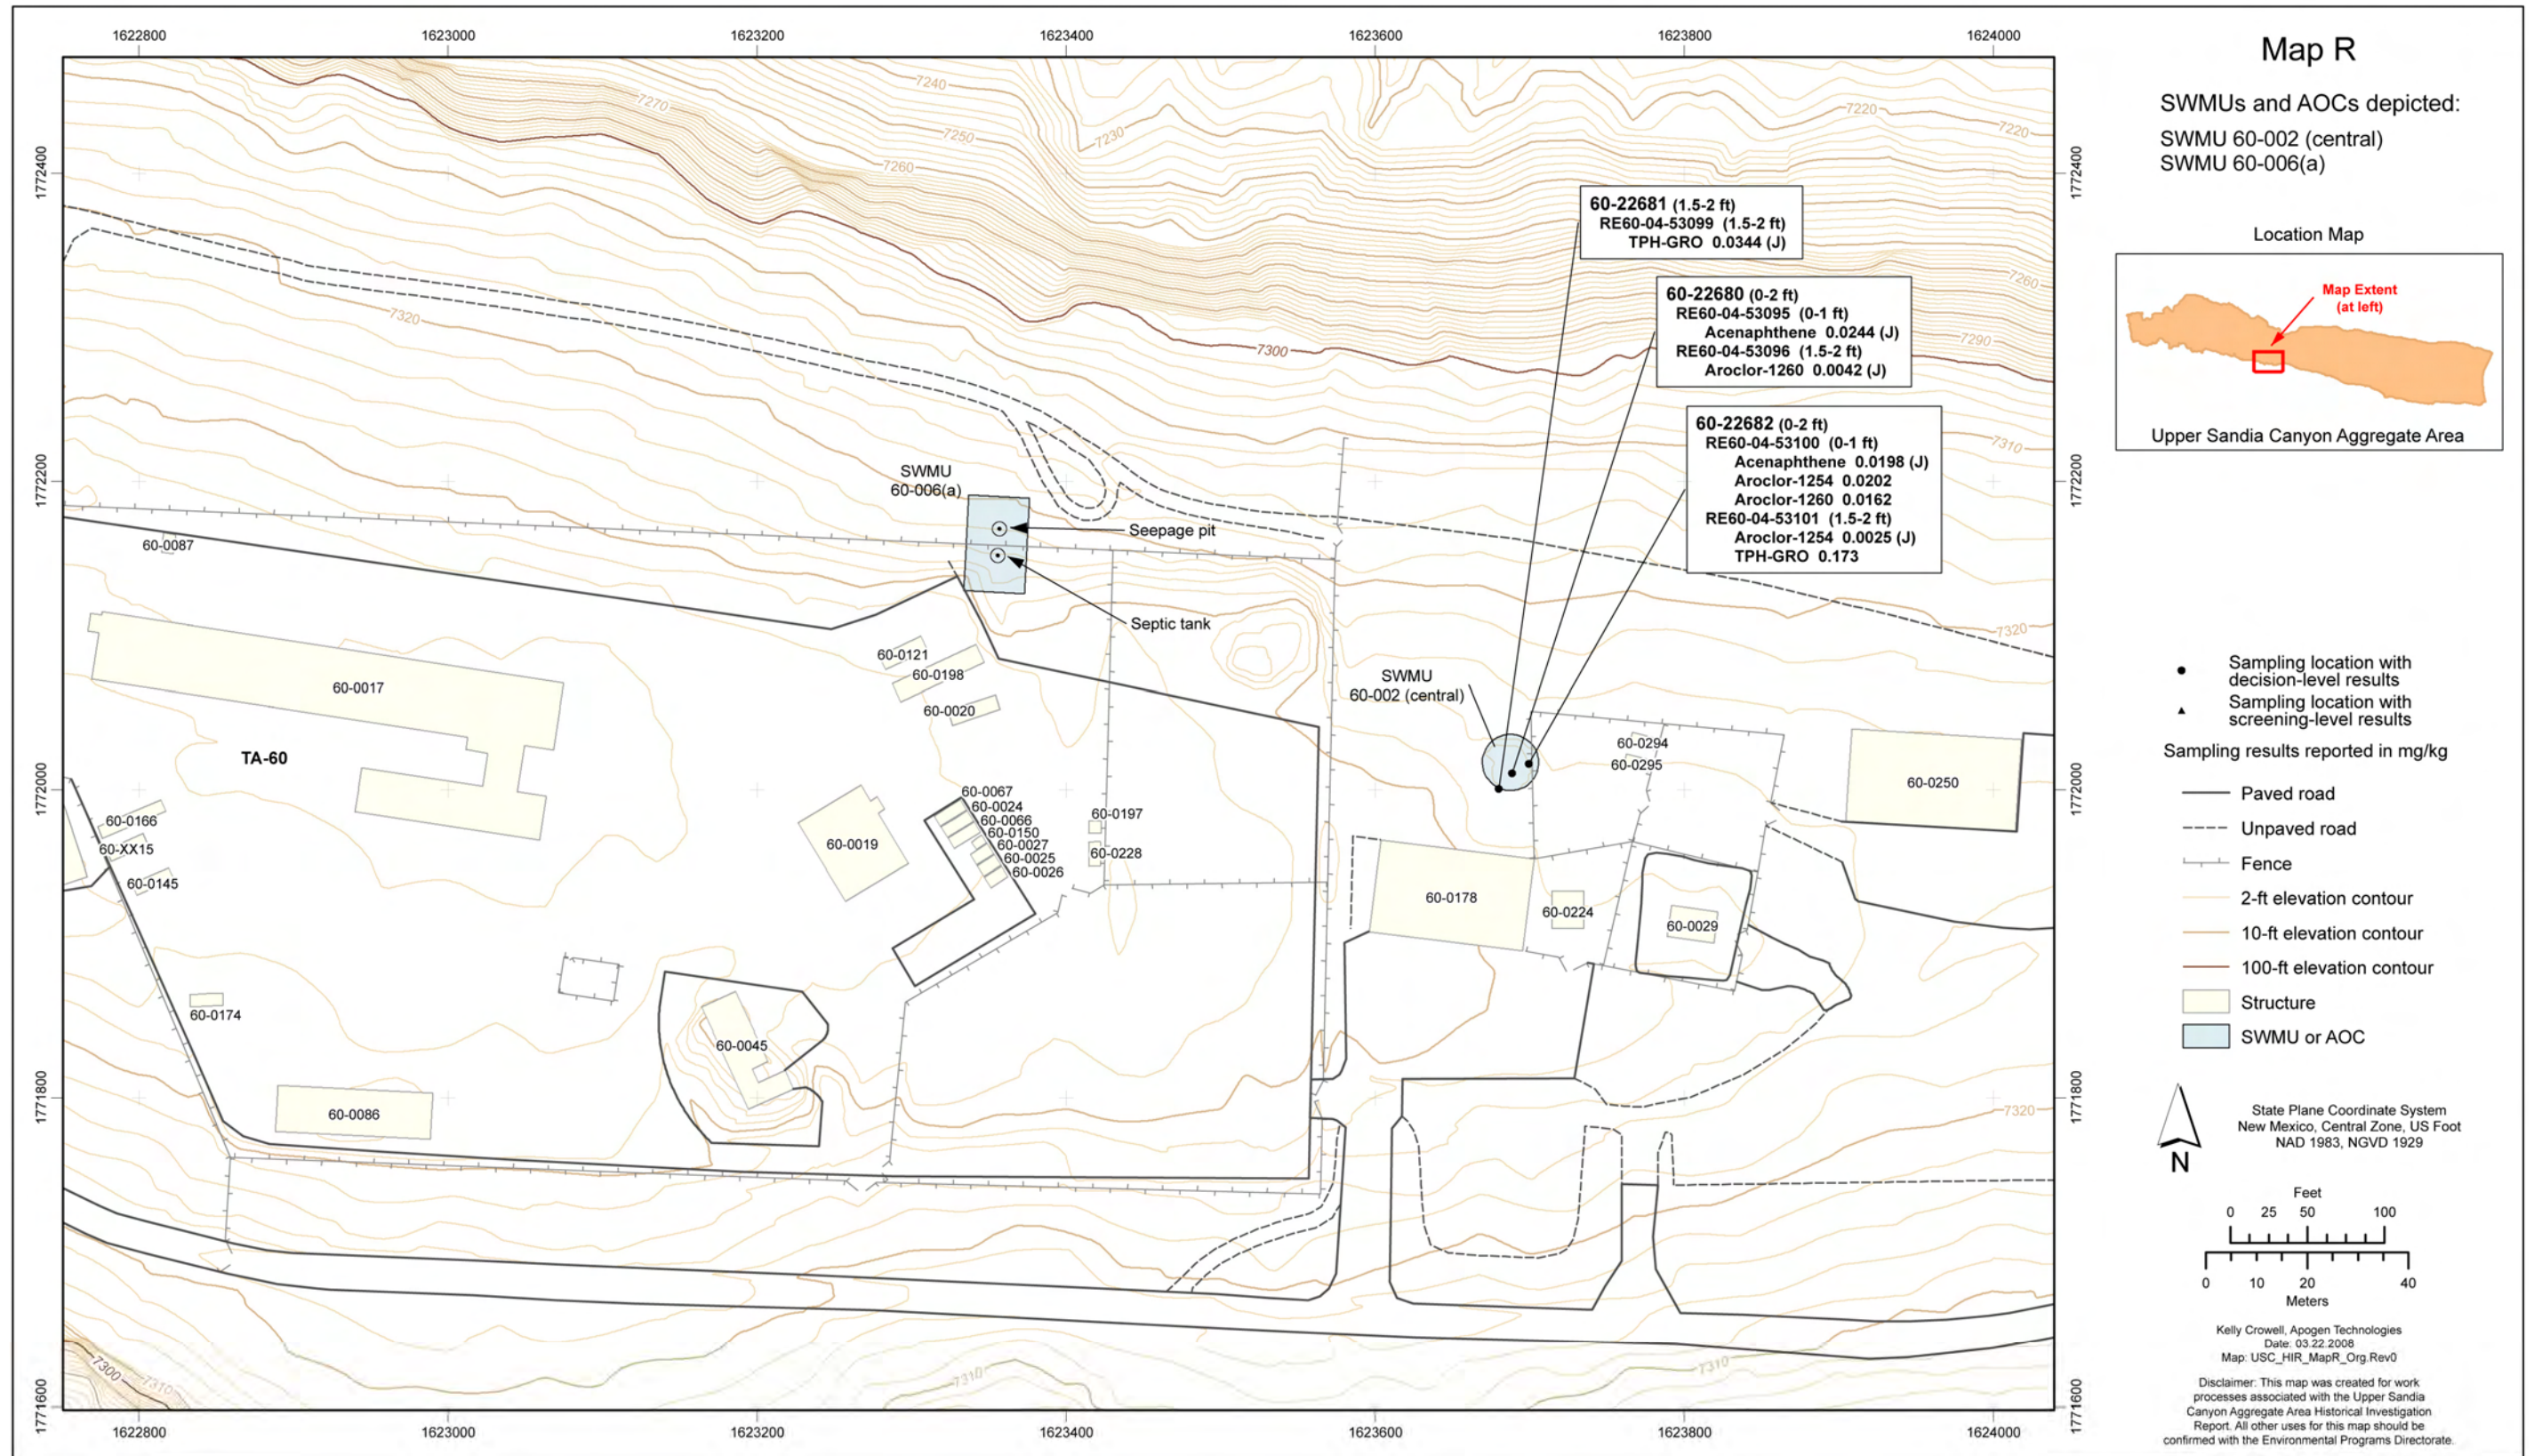


Figure 3.1-7 Map R organic chemical sampling locations and detected results



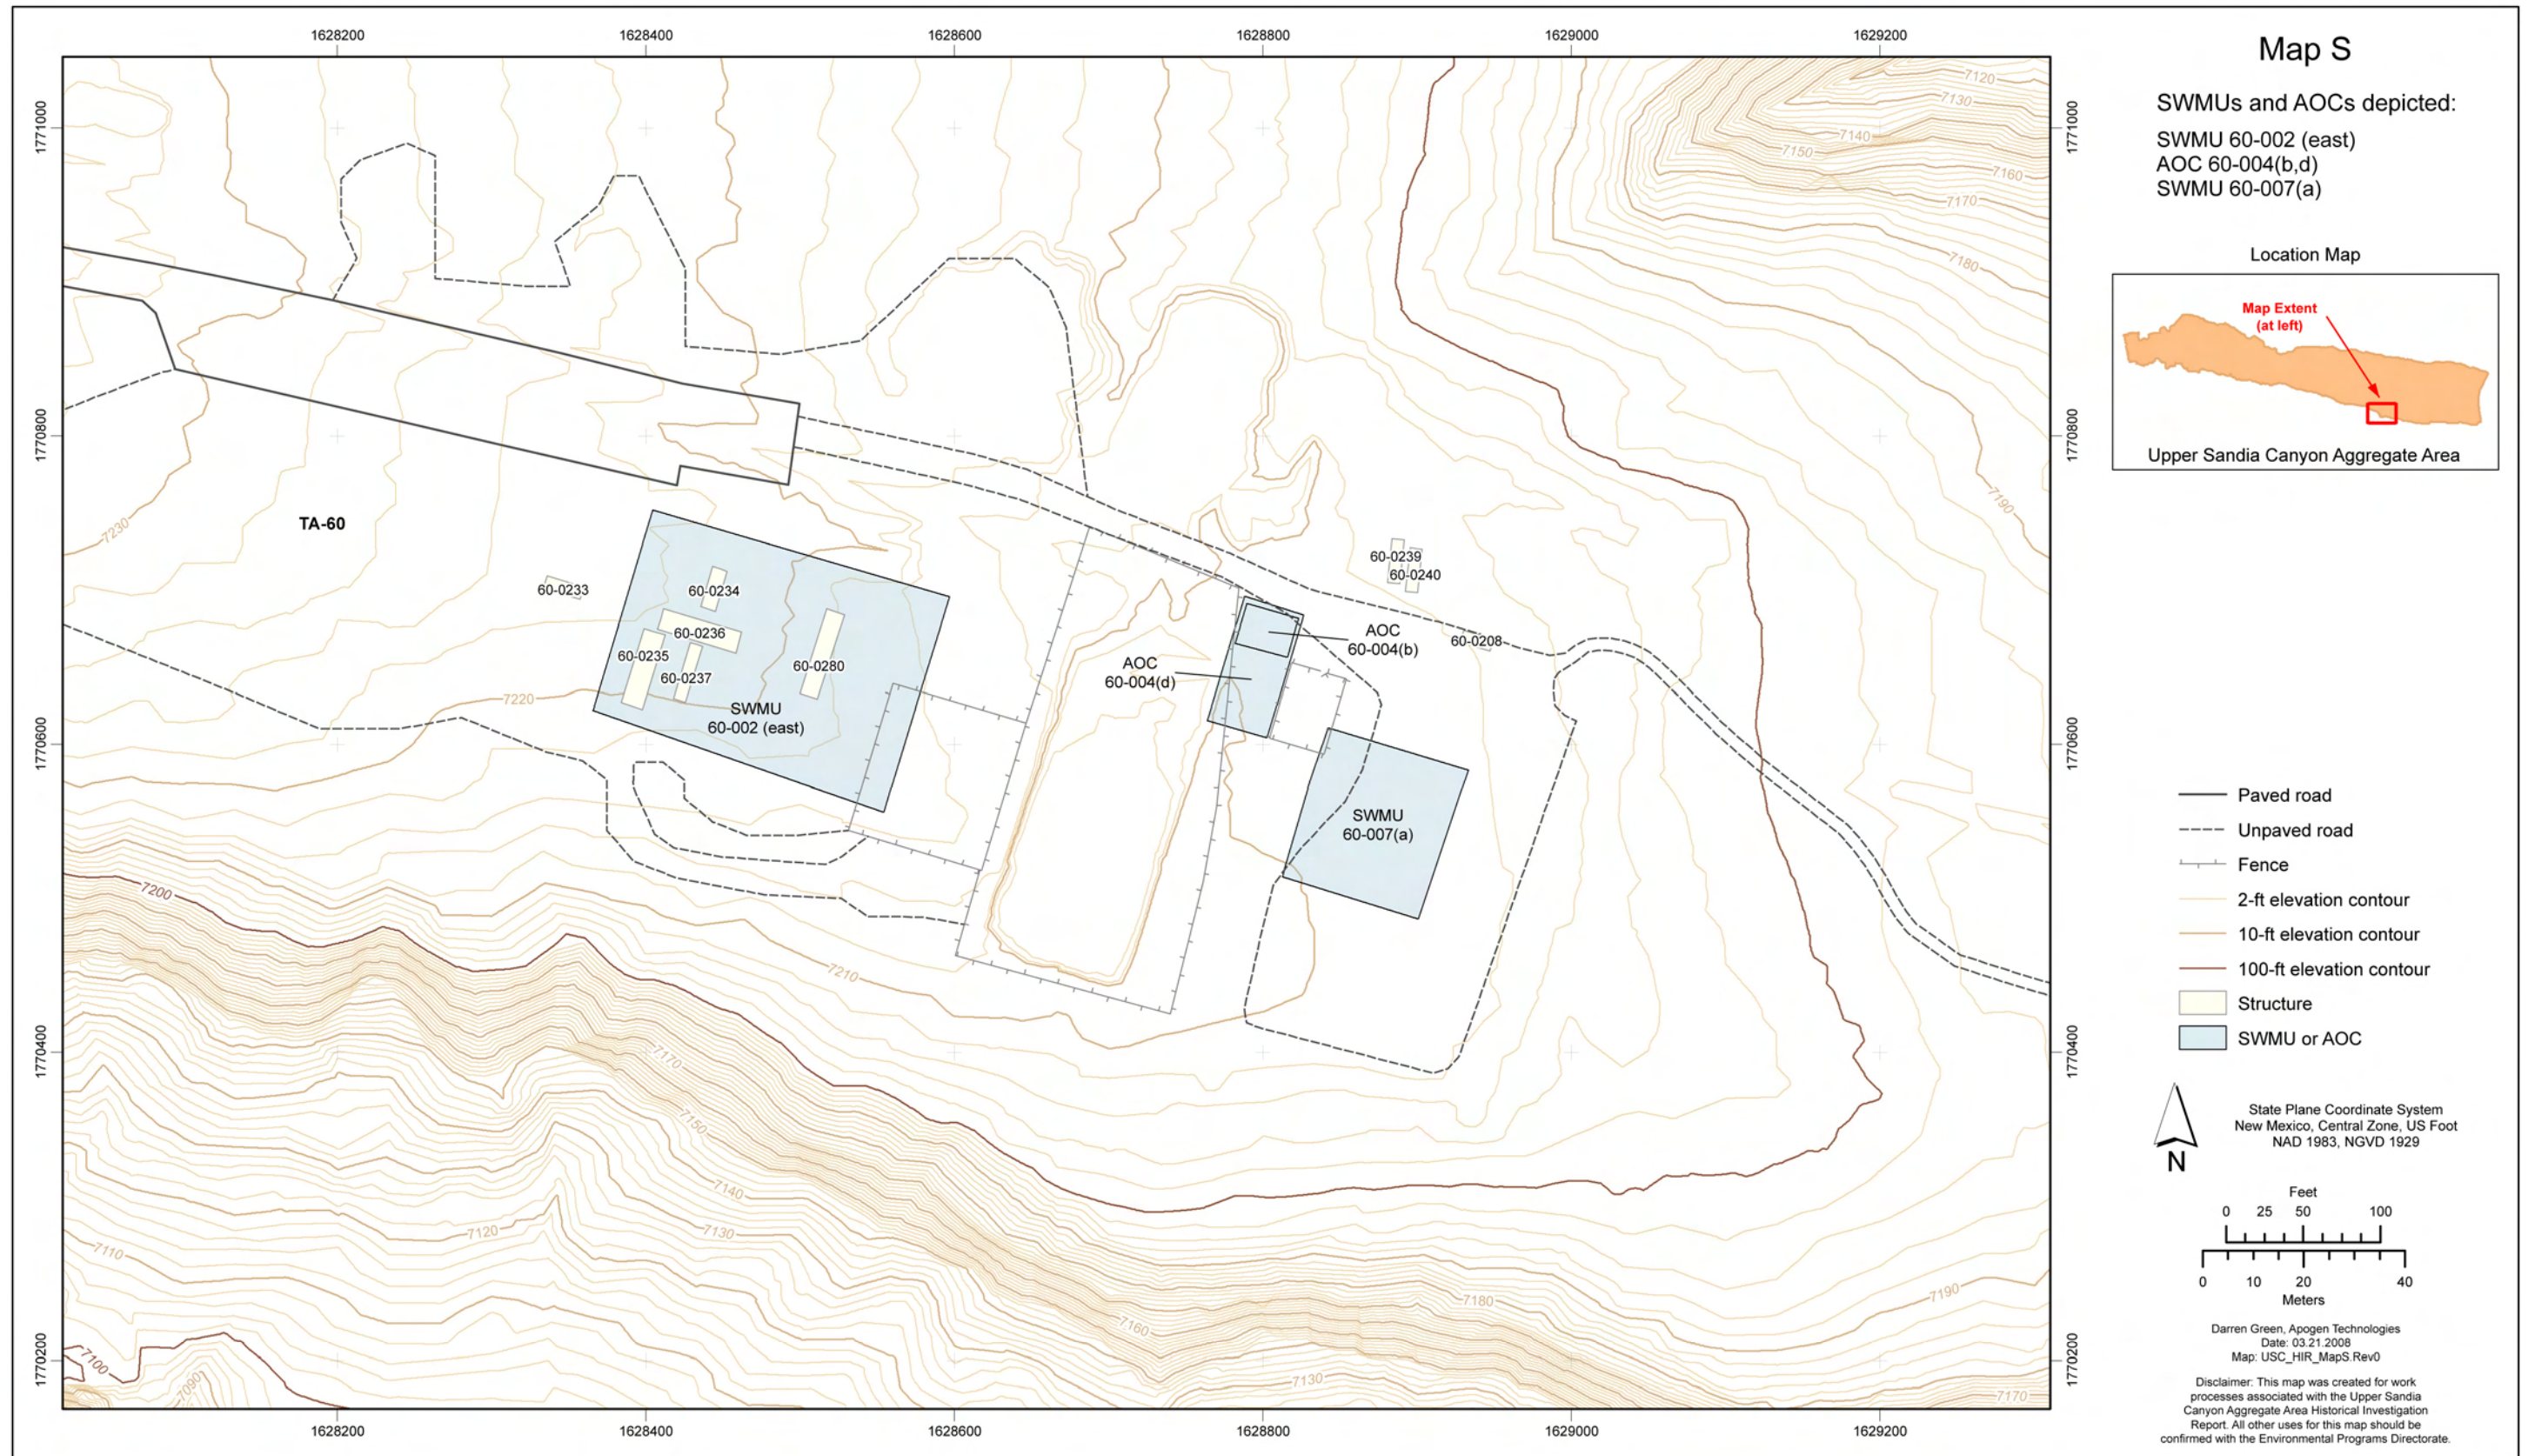


Figure 3.1-8 Map S site location



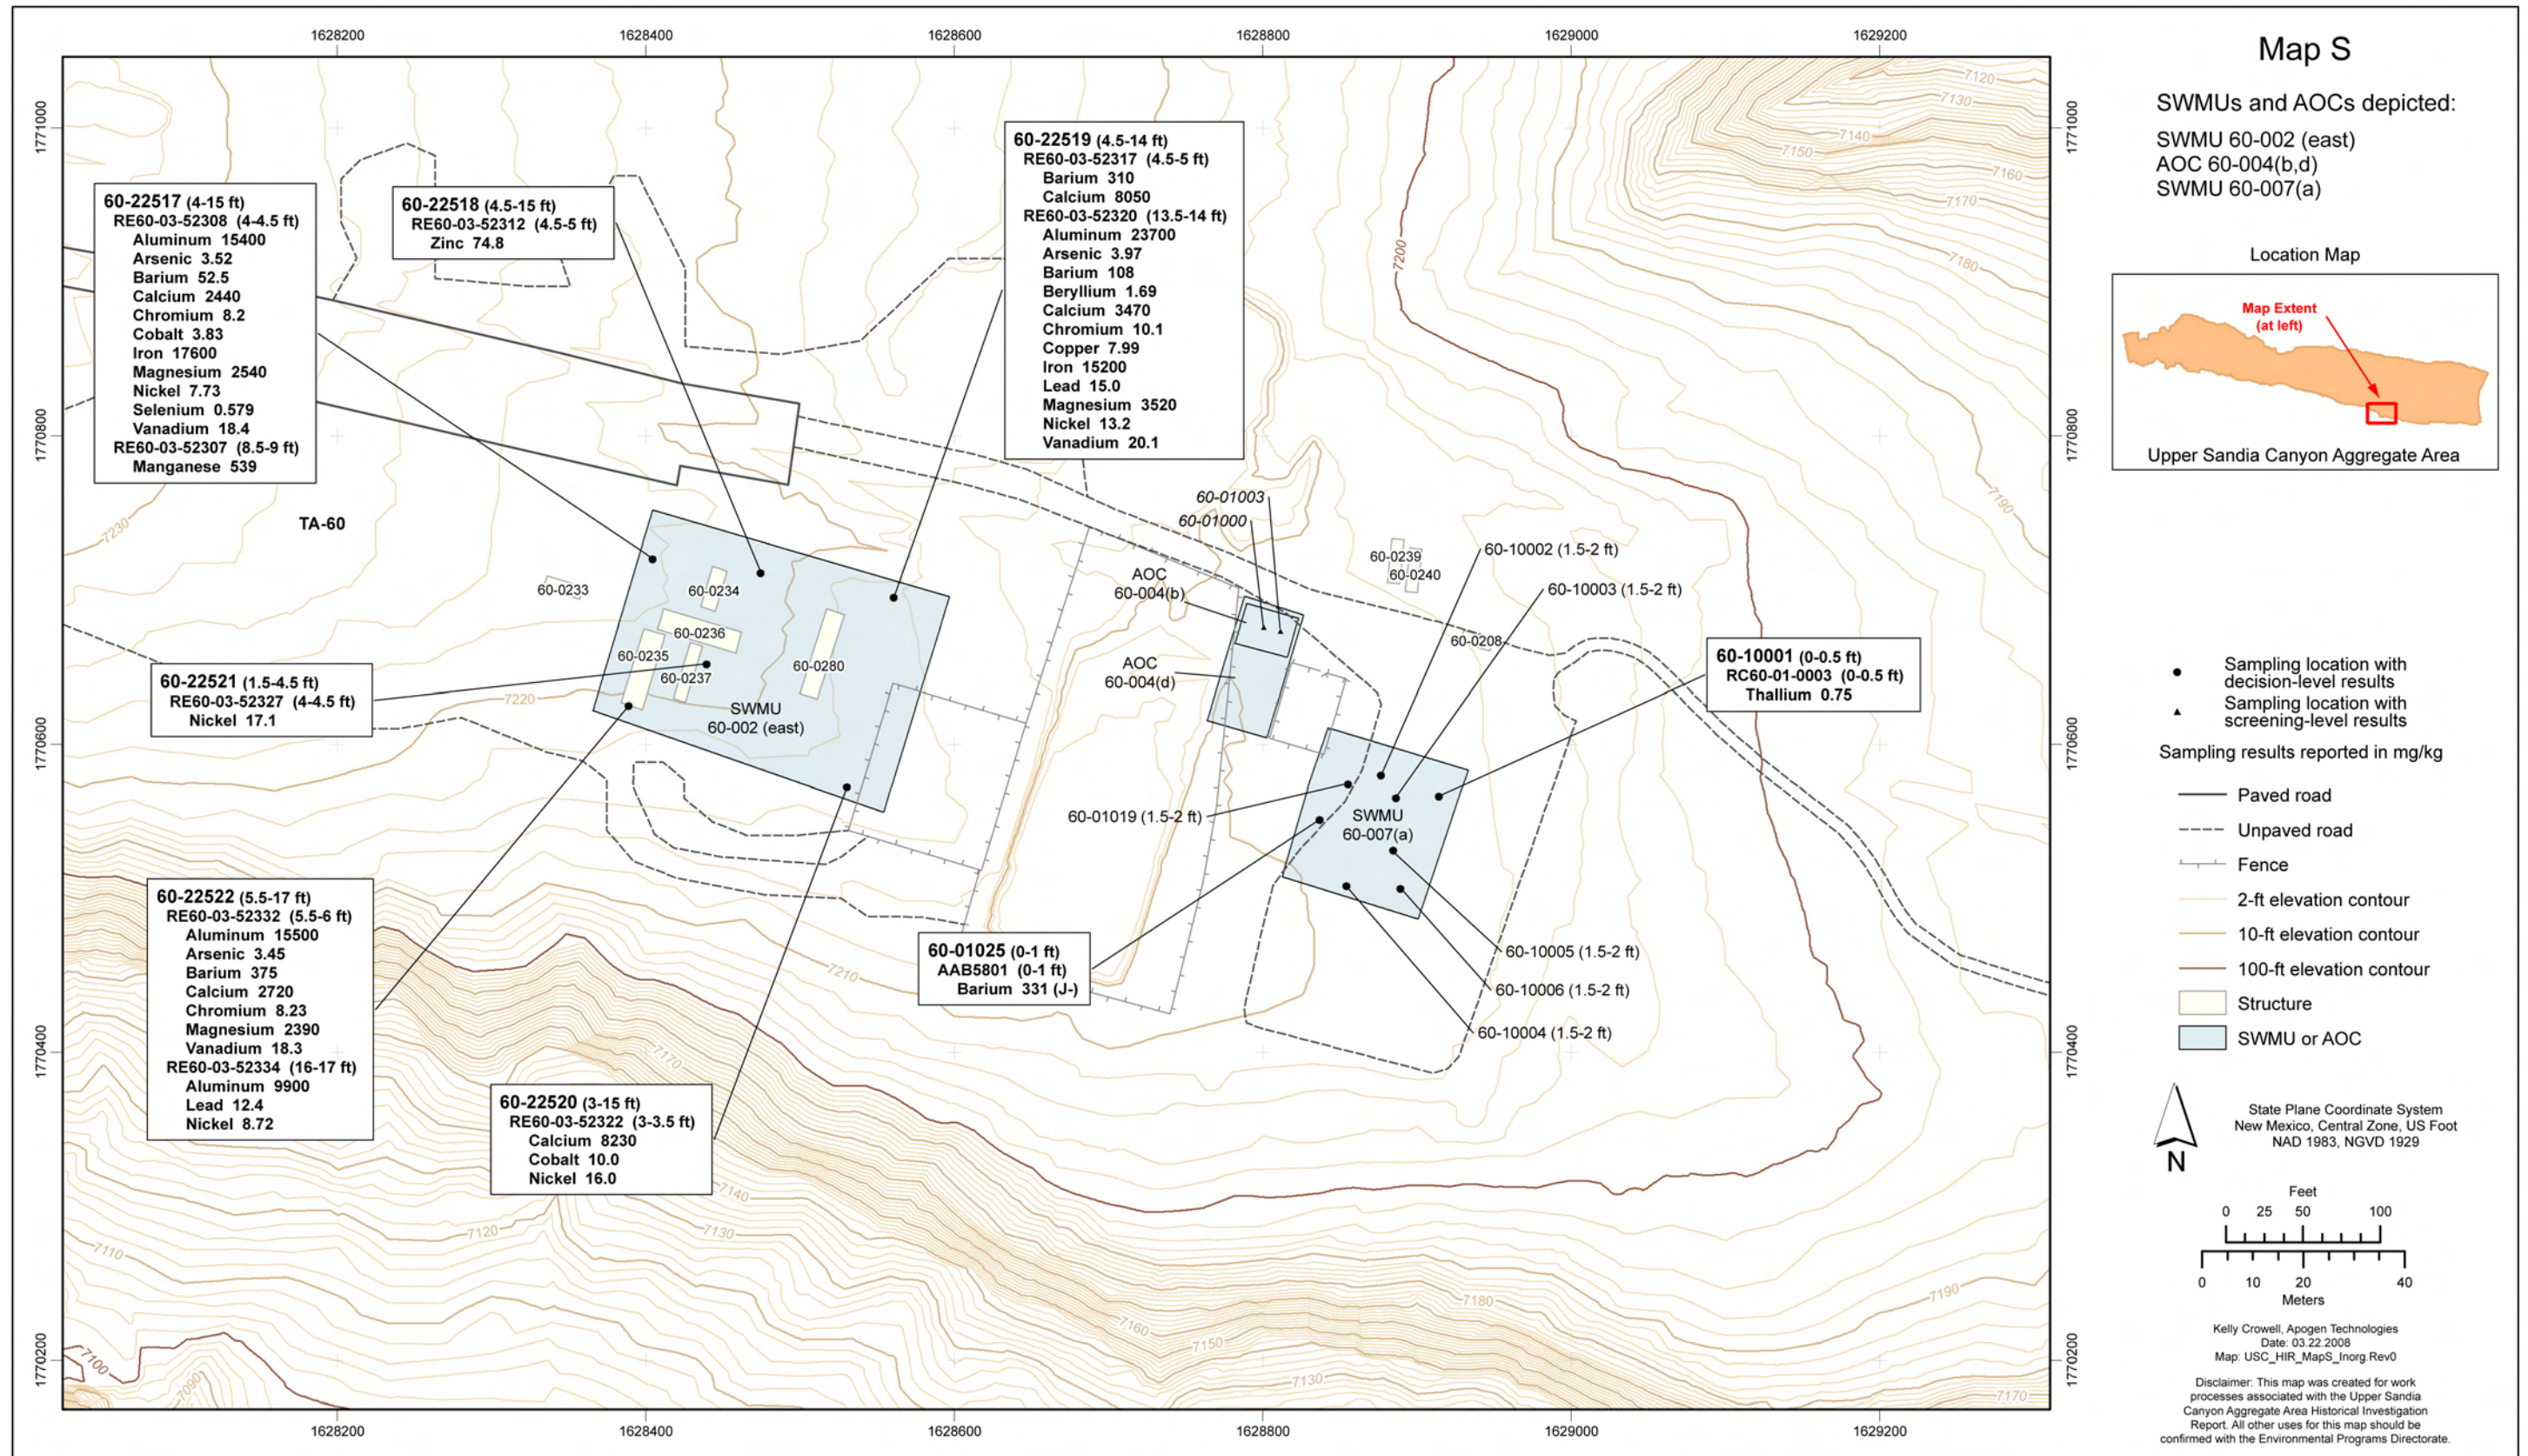


Figure 3.1-9 Map S inorganic chemical sampling locations and results detected above BVs



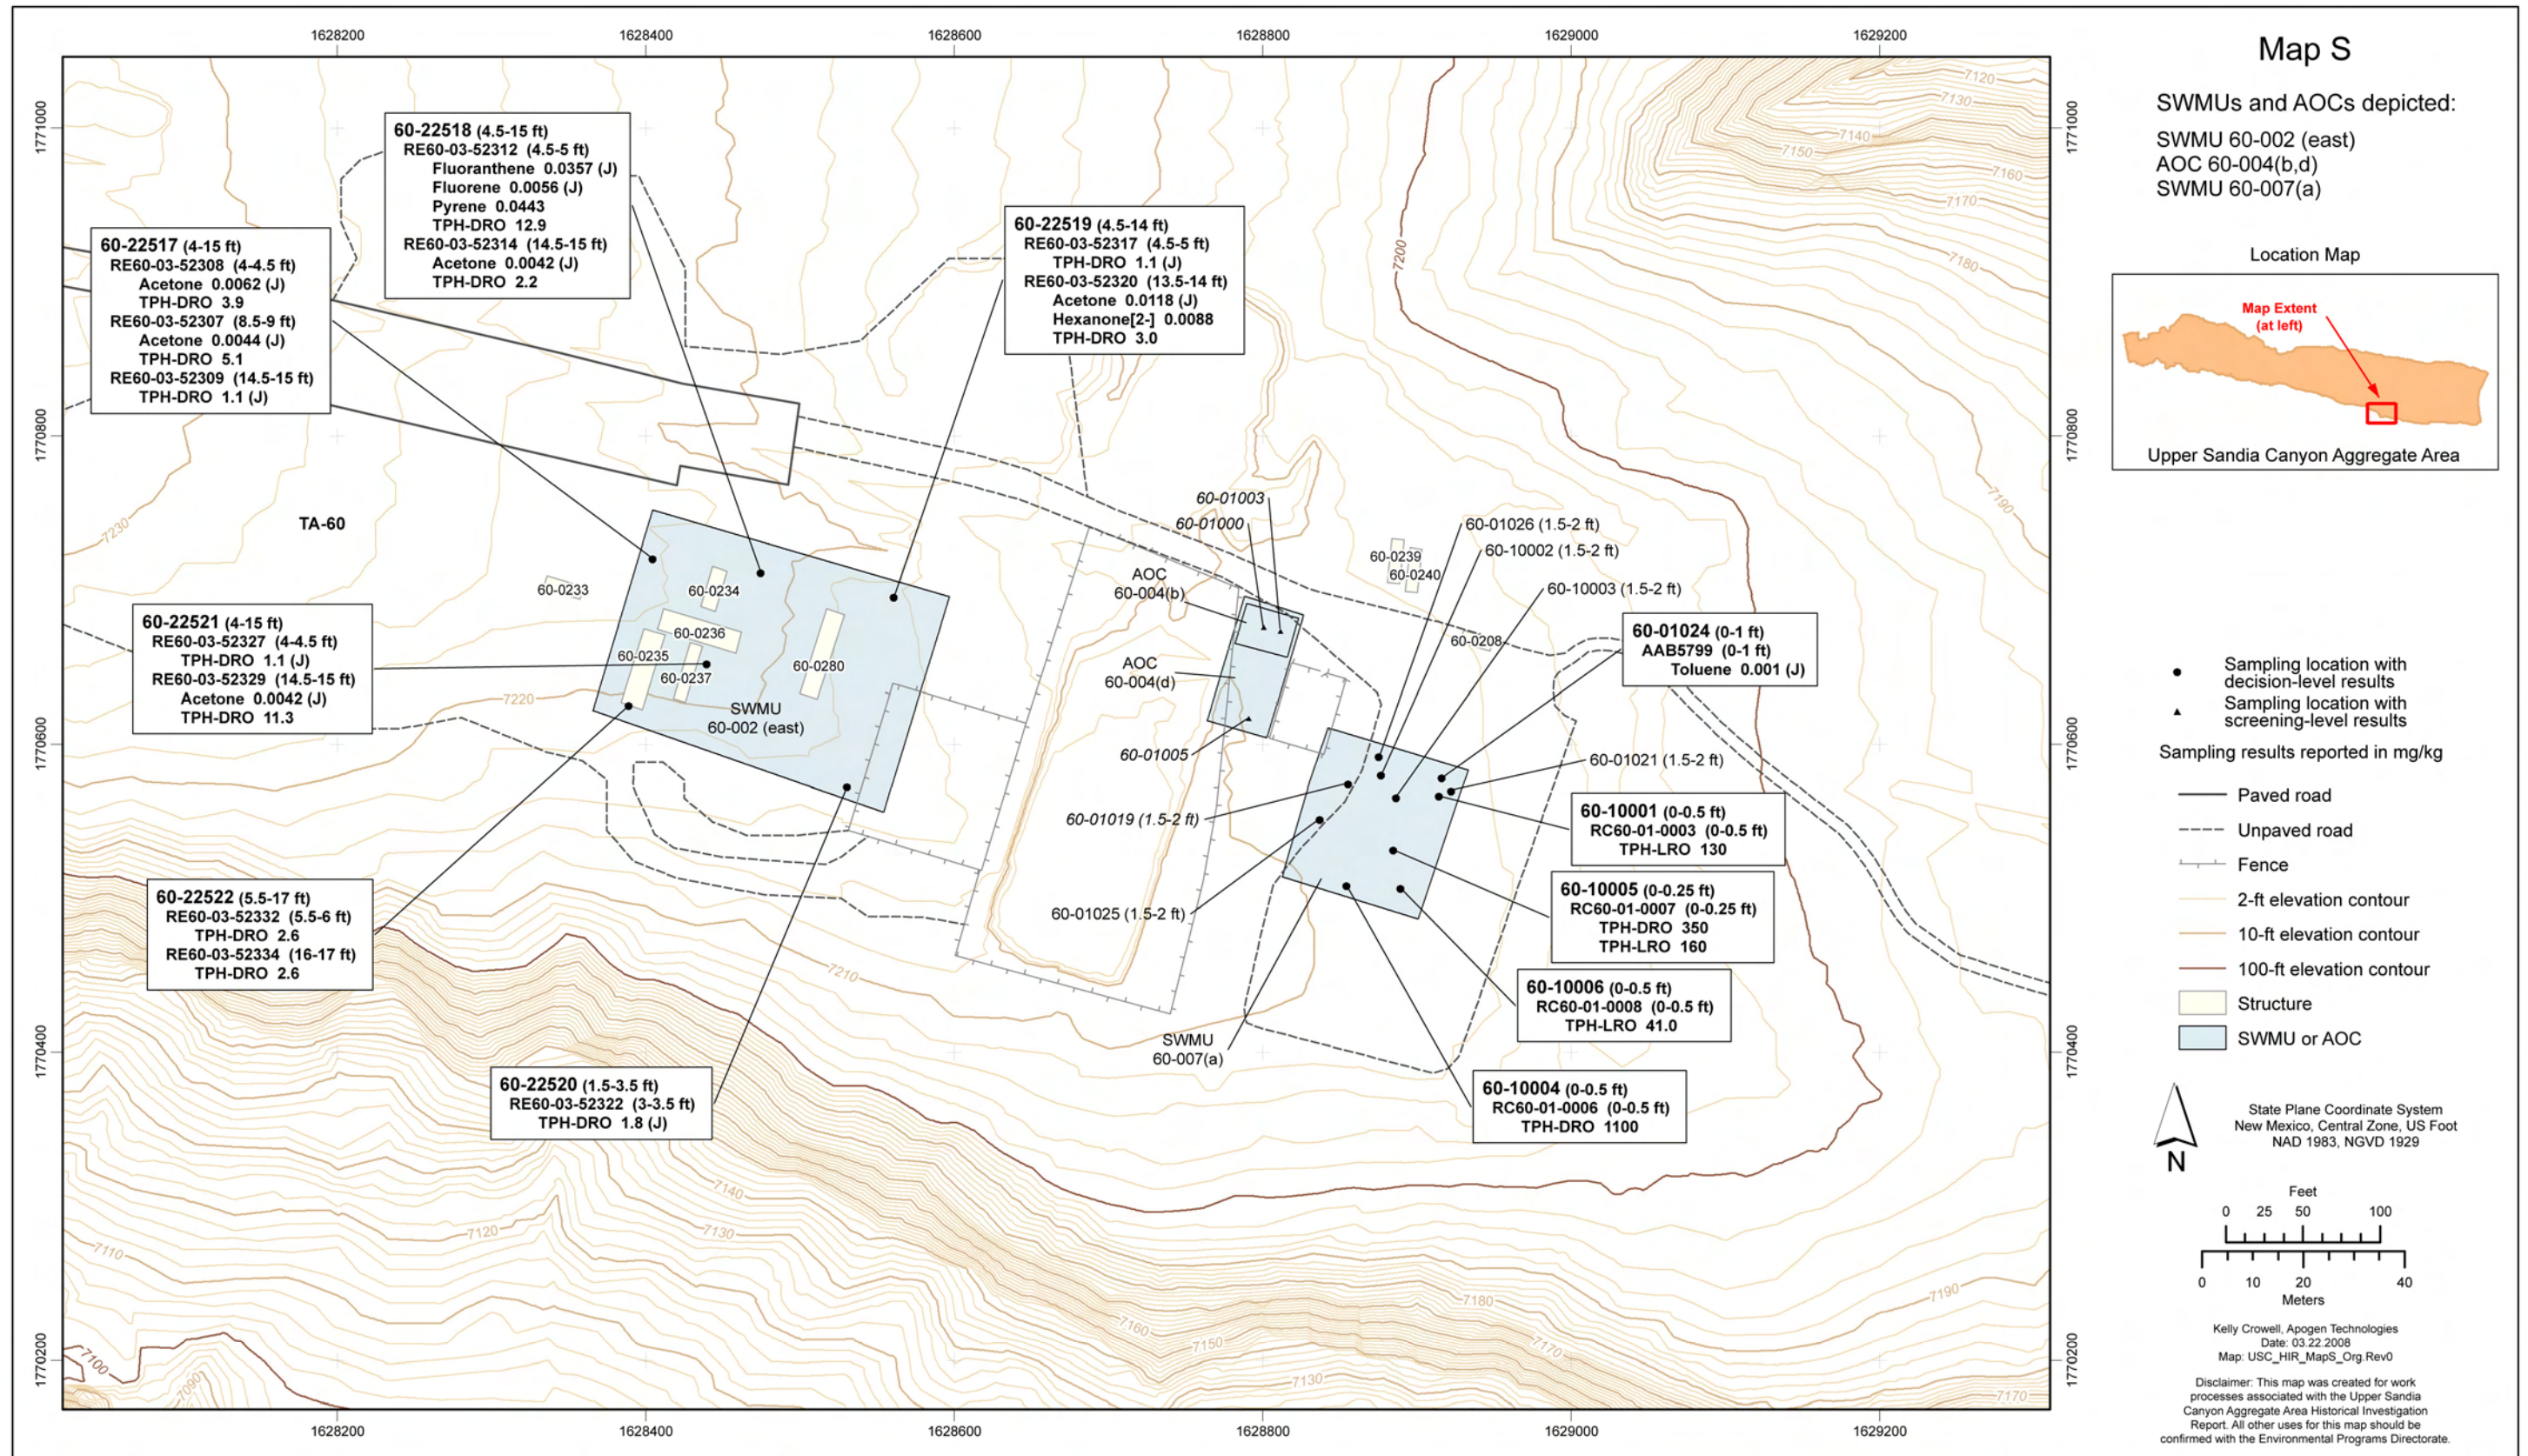


Figure 3.1-10 Map S organic chemical sampling locations and detected results



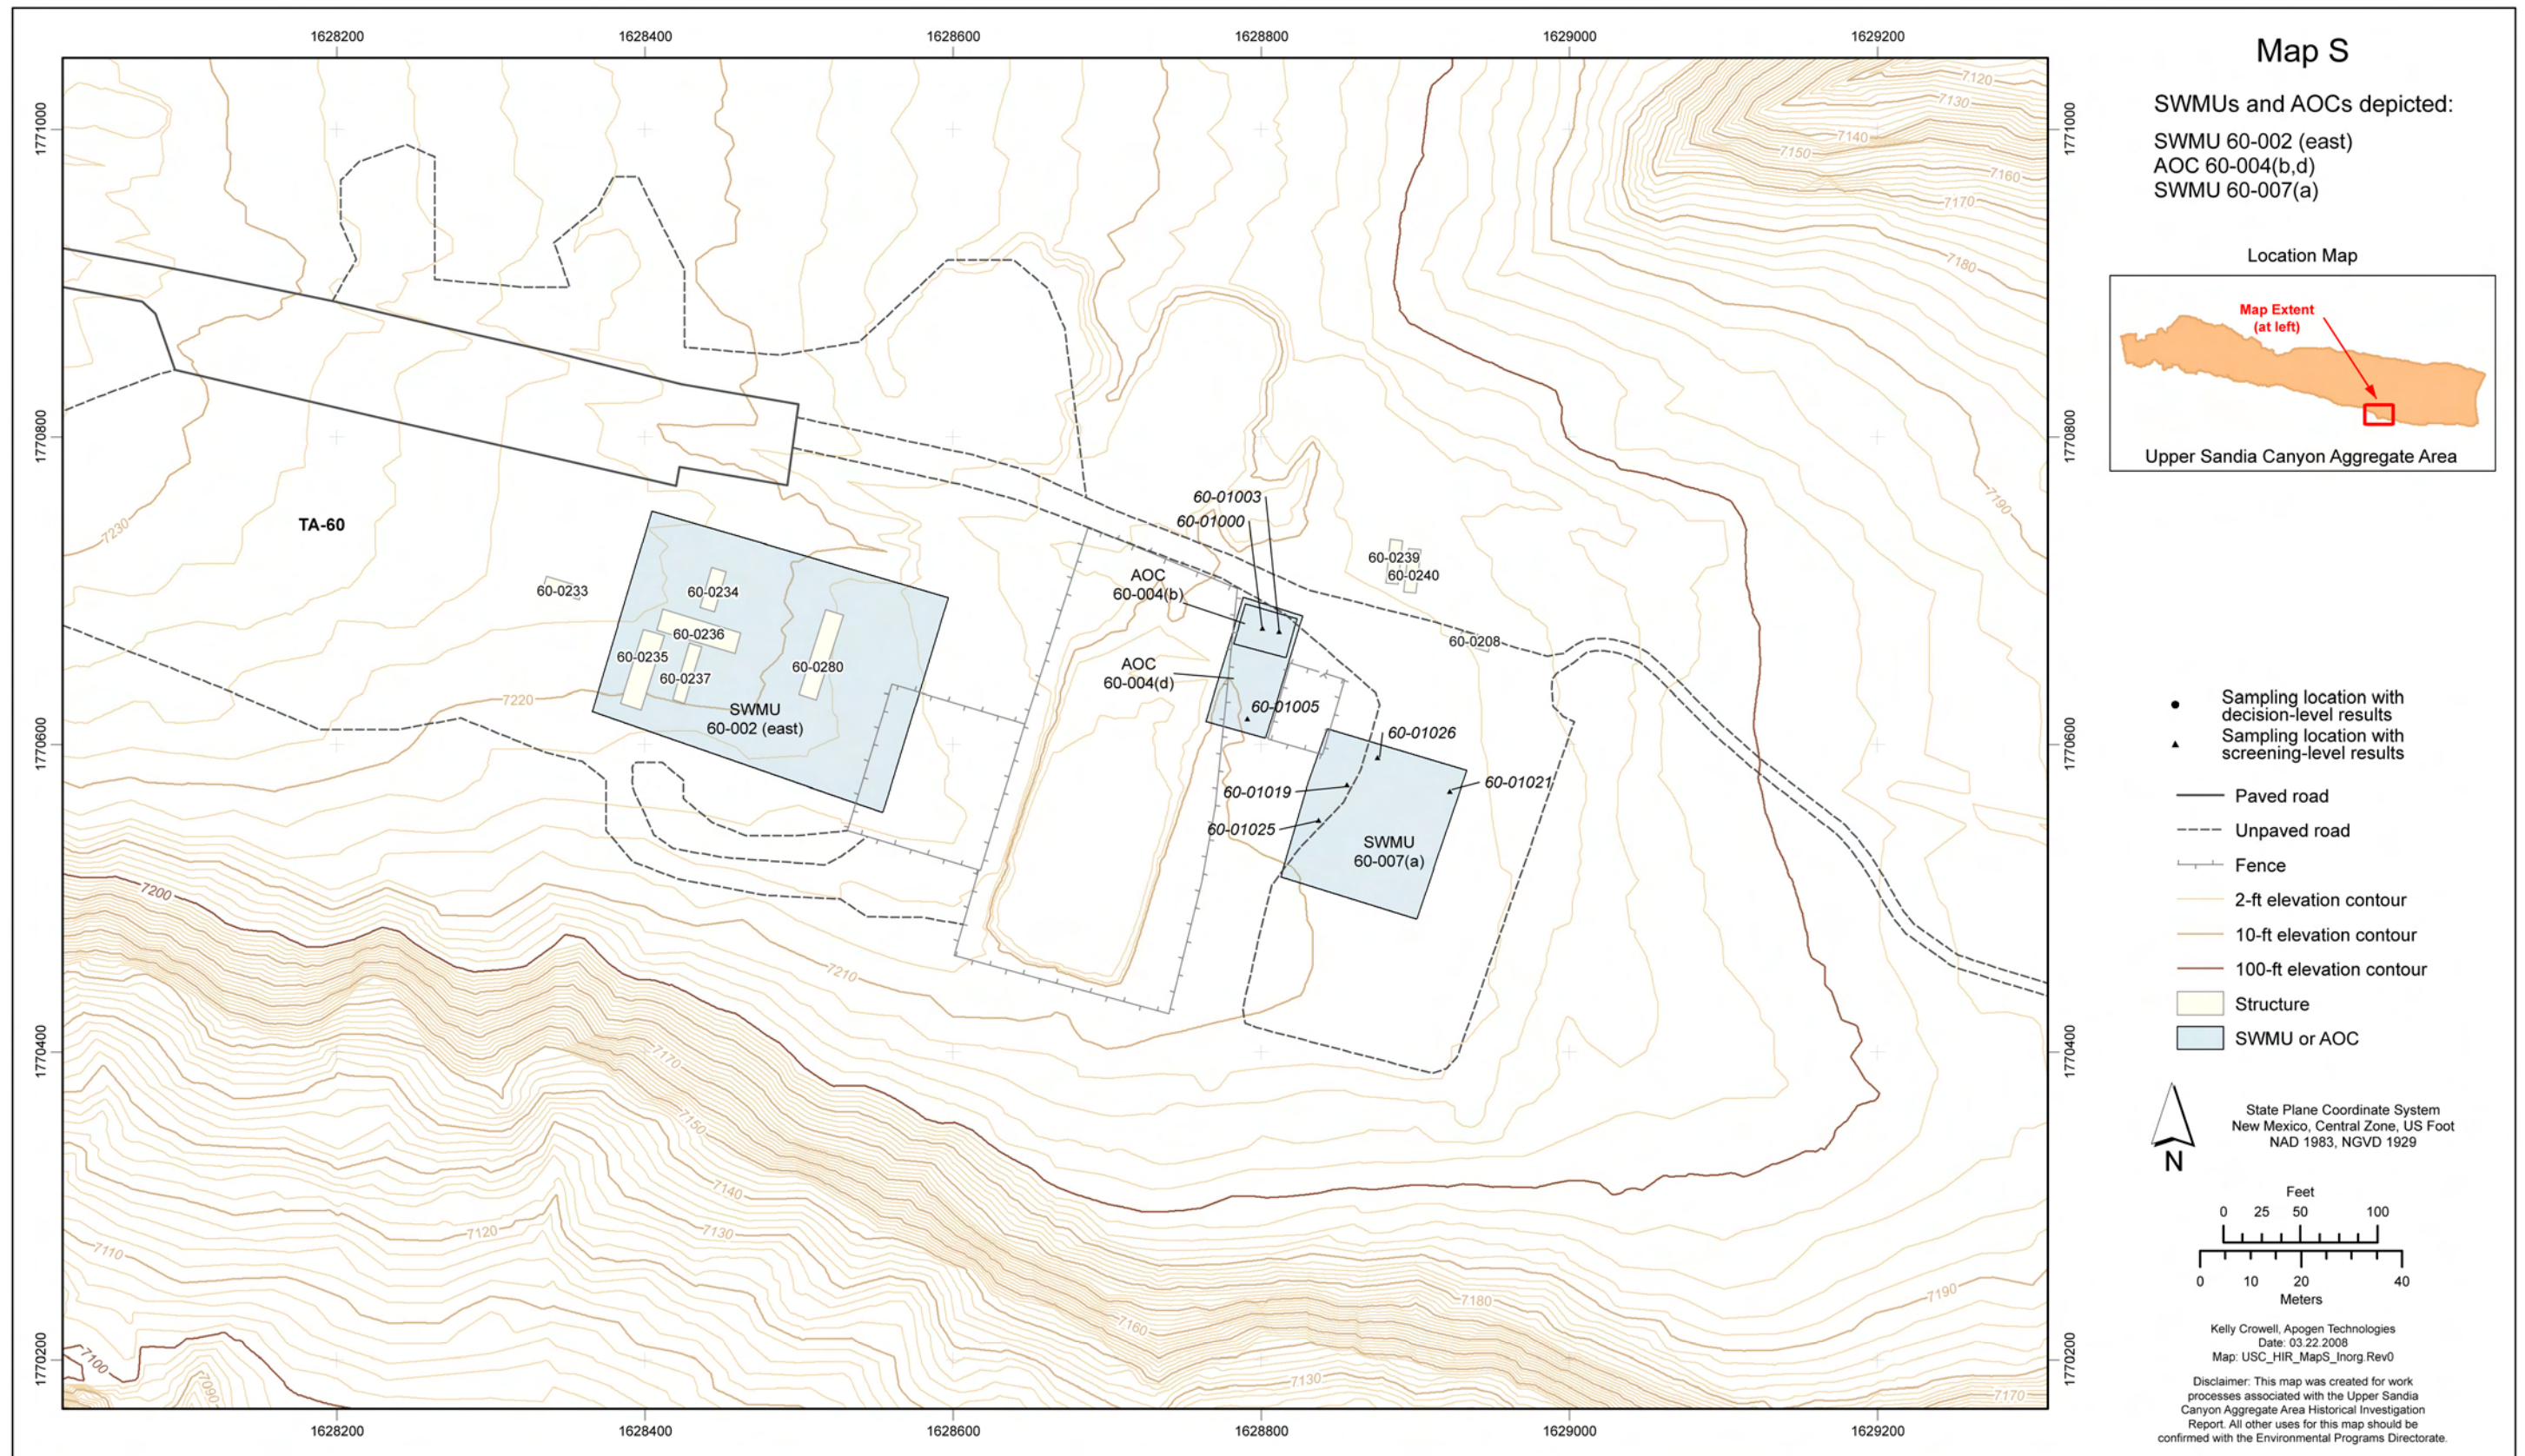


Figure 3.1-11 Map S radionuclide sampling locations



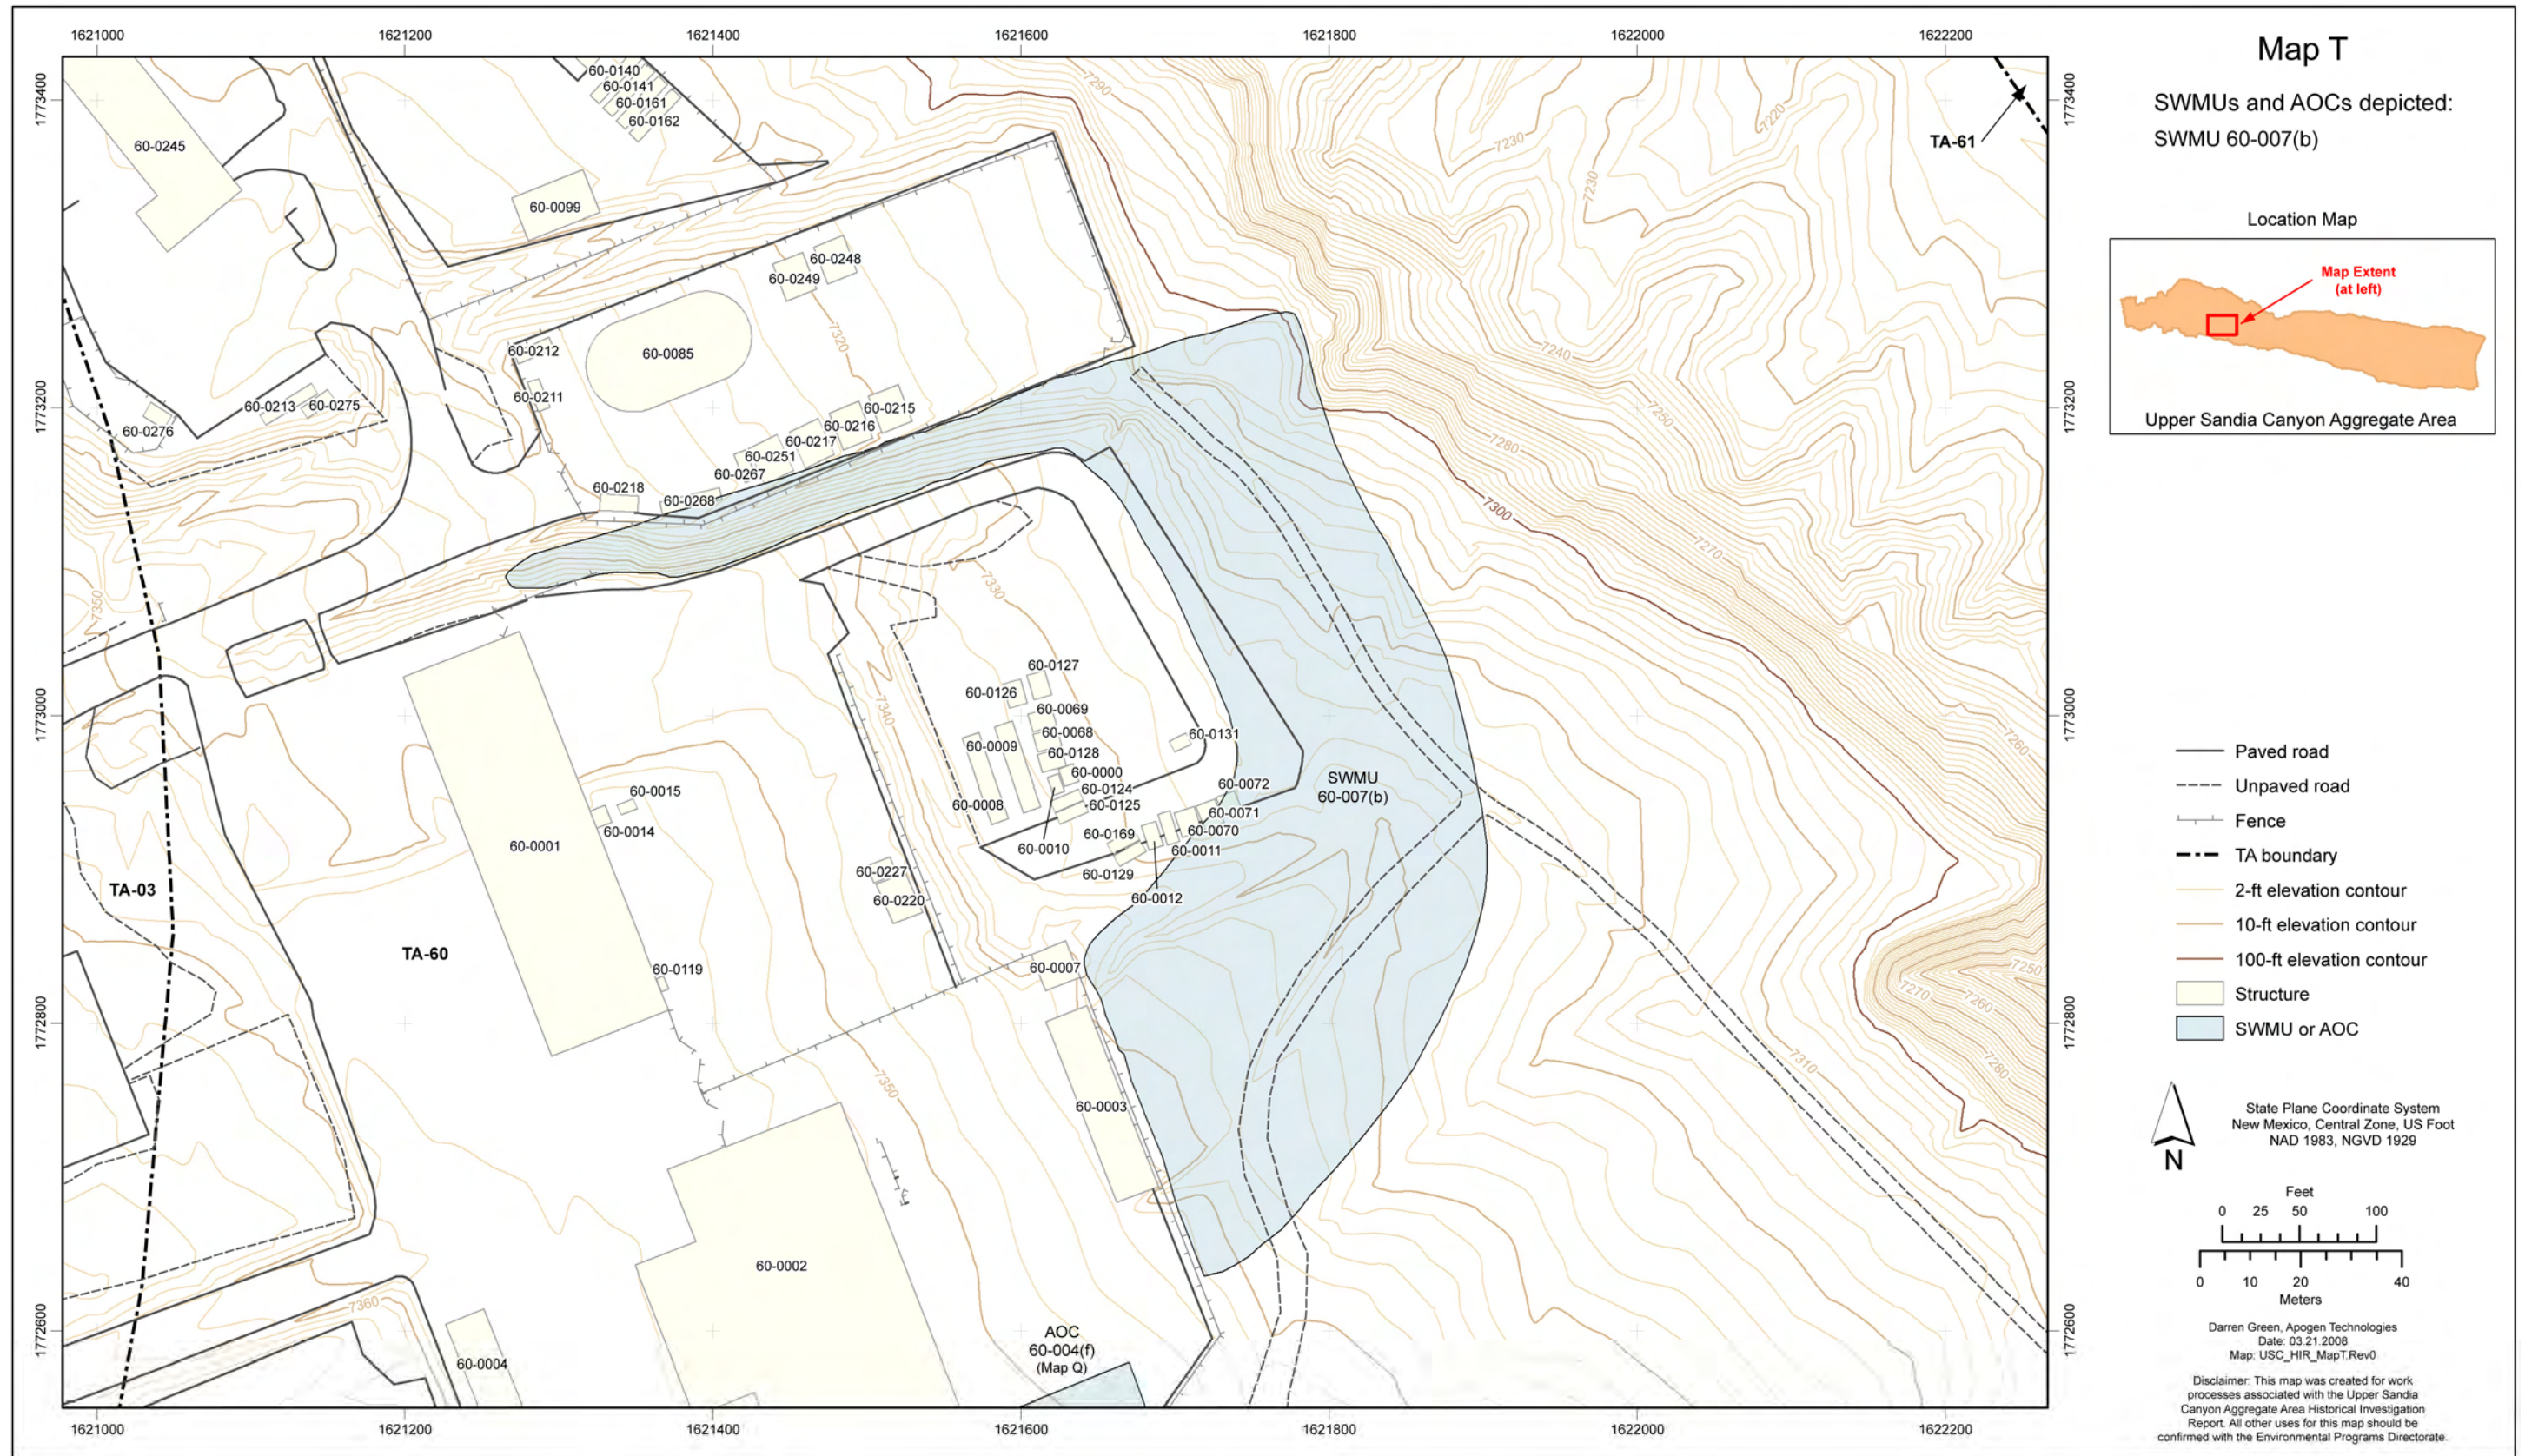


Figure 3.7-1 Map T site location



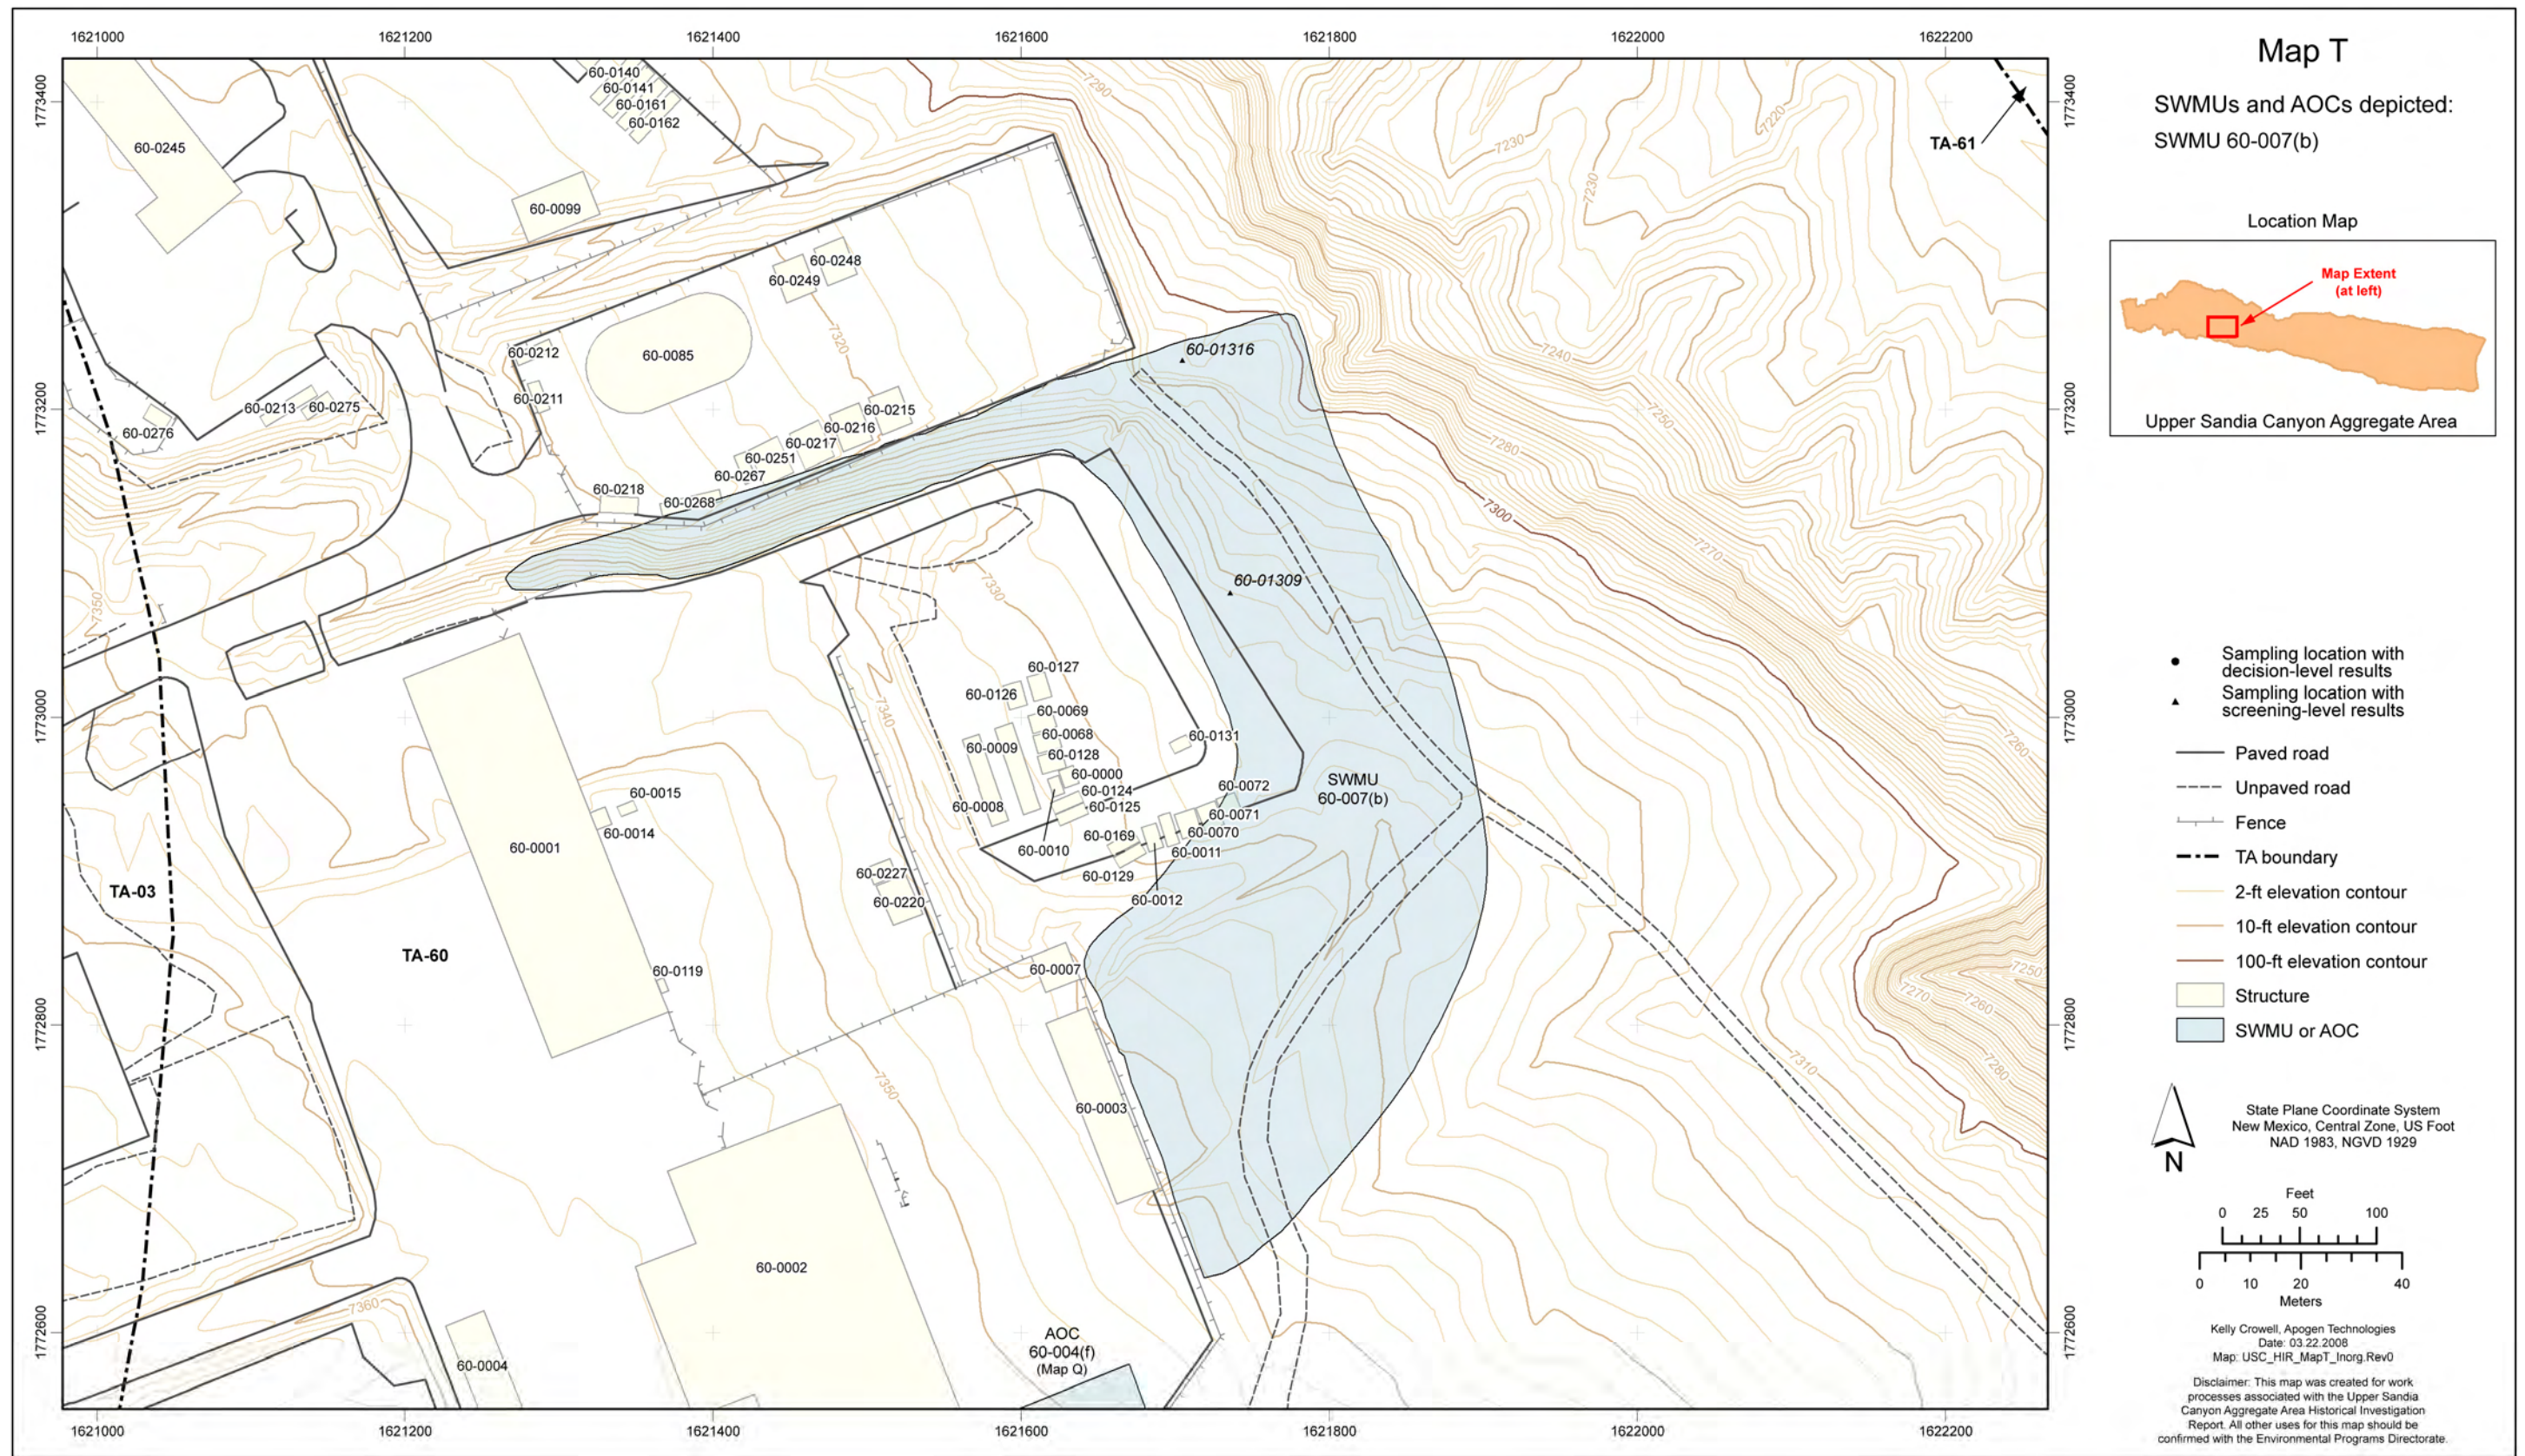


Figure 3.7-2 Map T inorganic chemical sampling locations



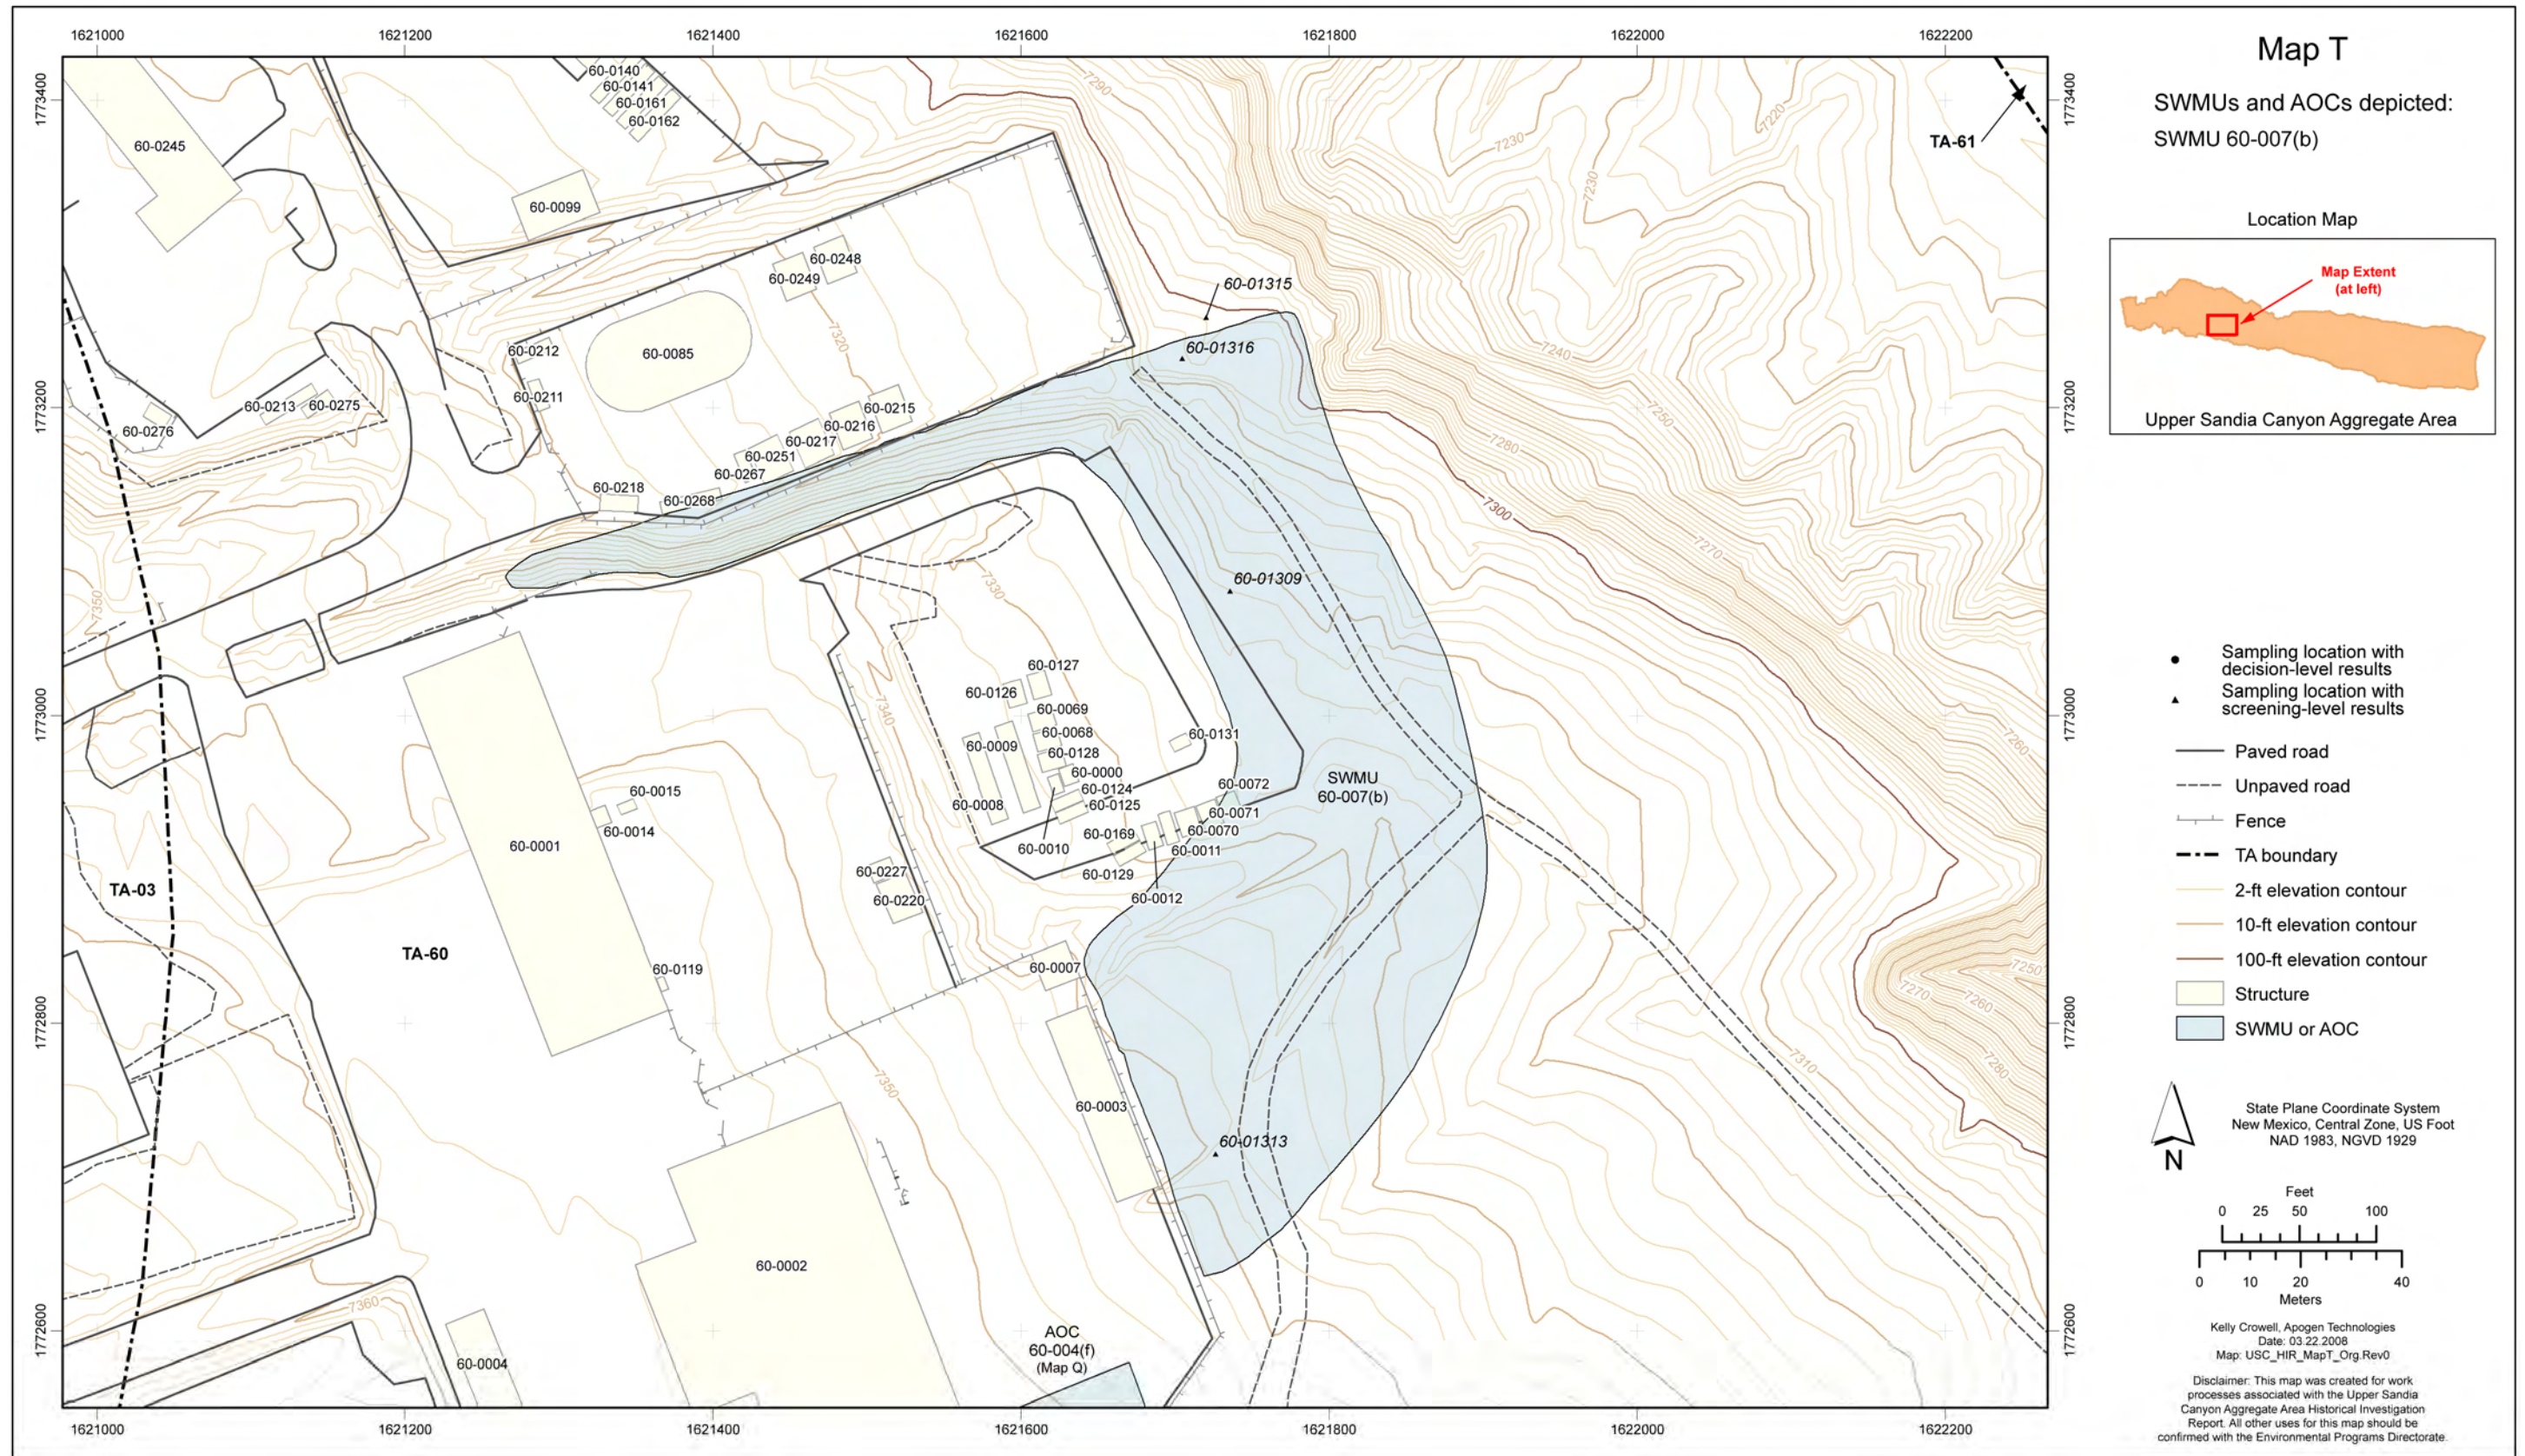


Figure 3.7-3 Map T organic chemical sampling locations



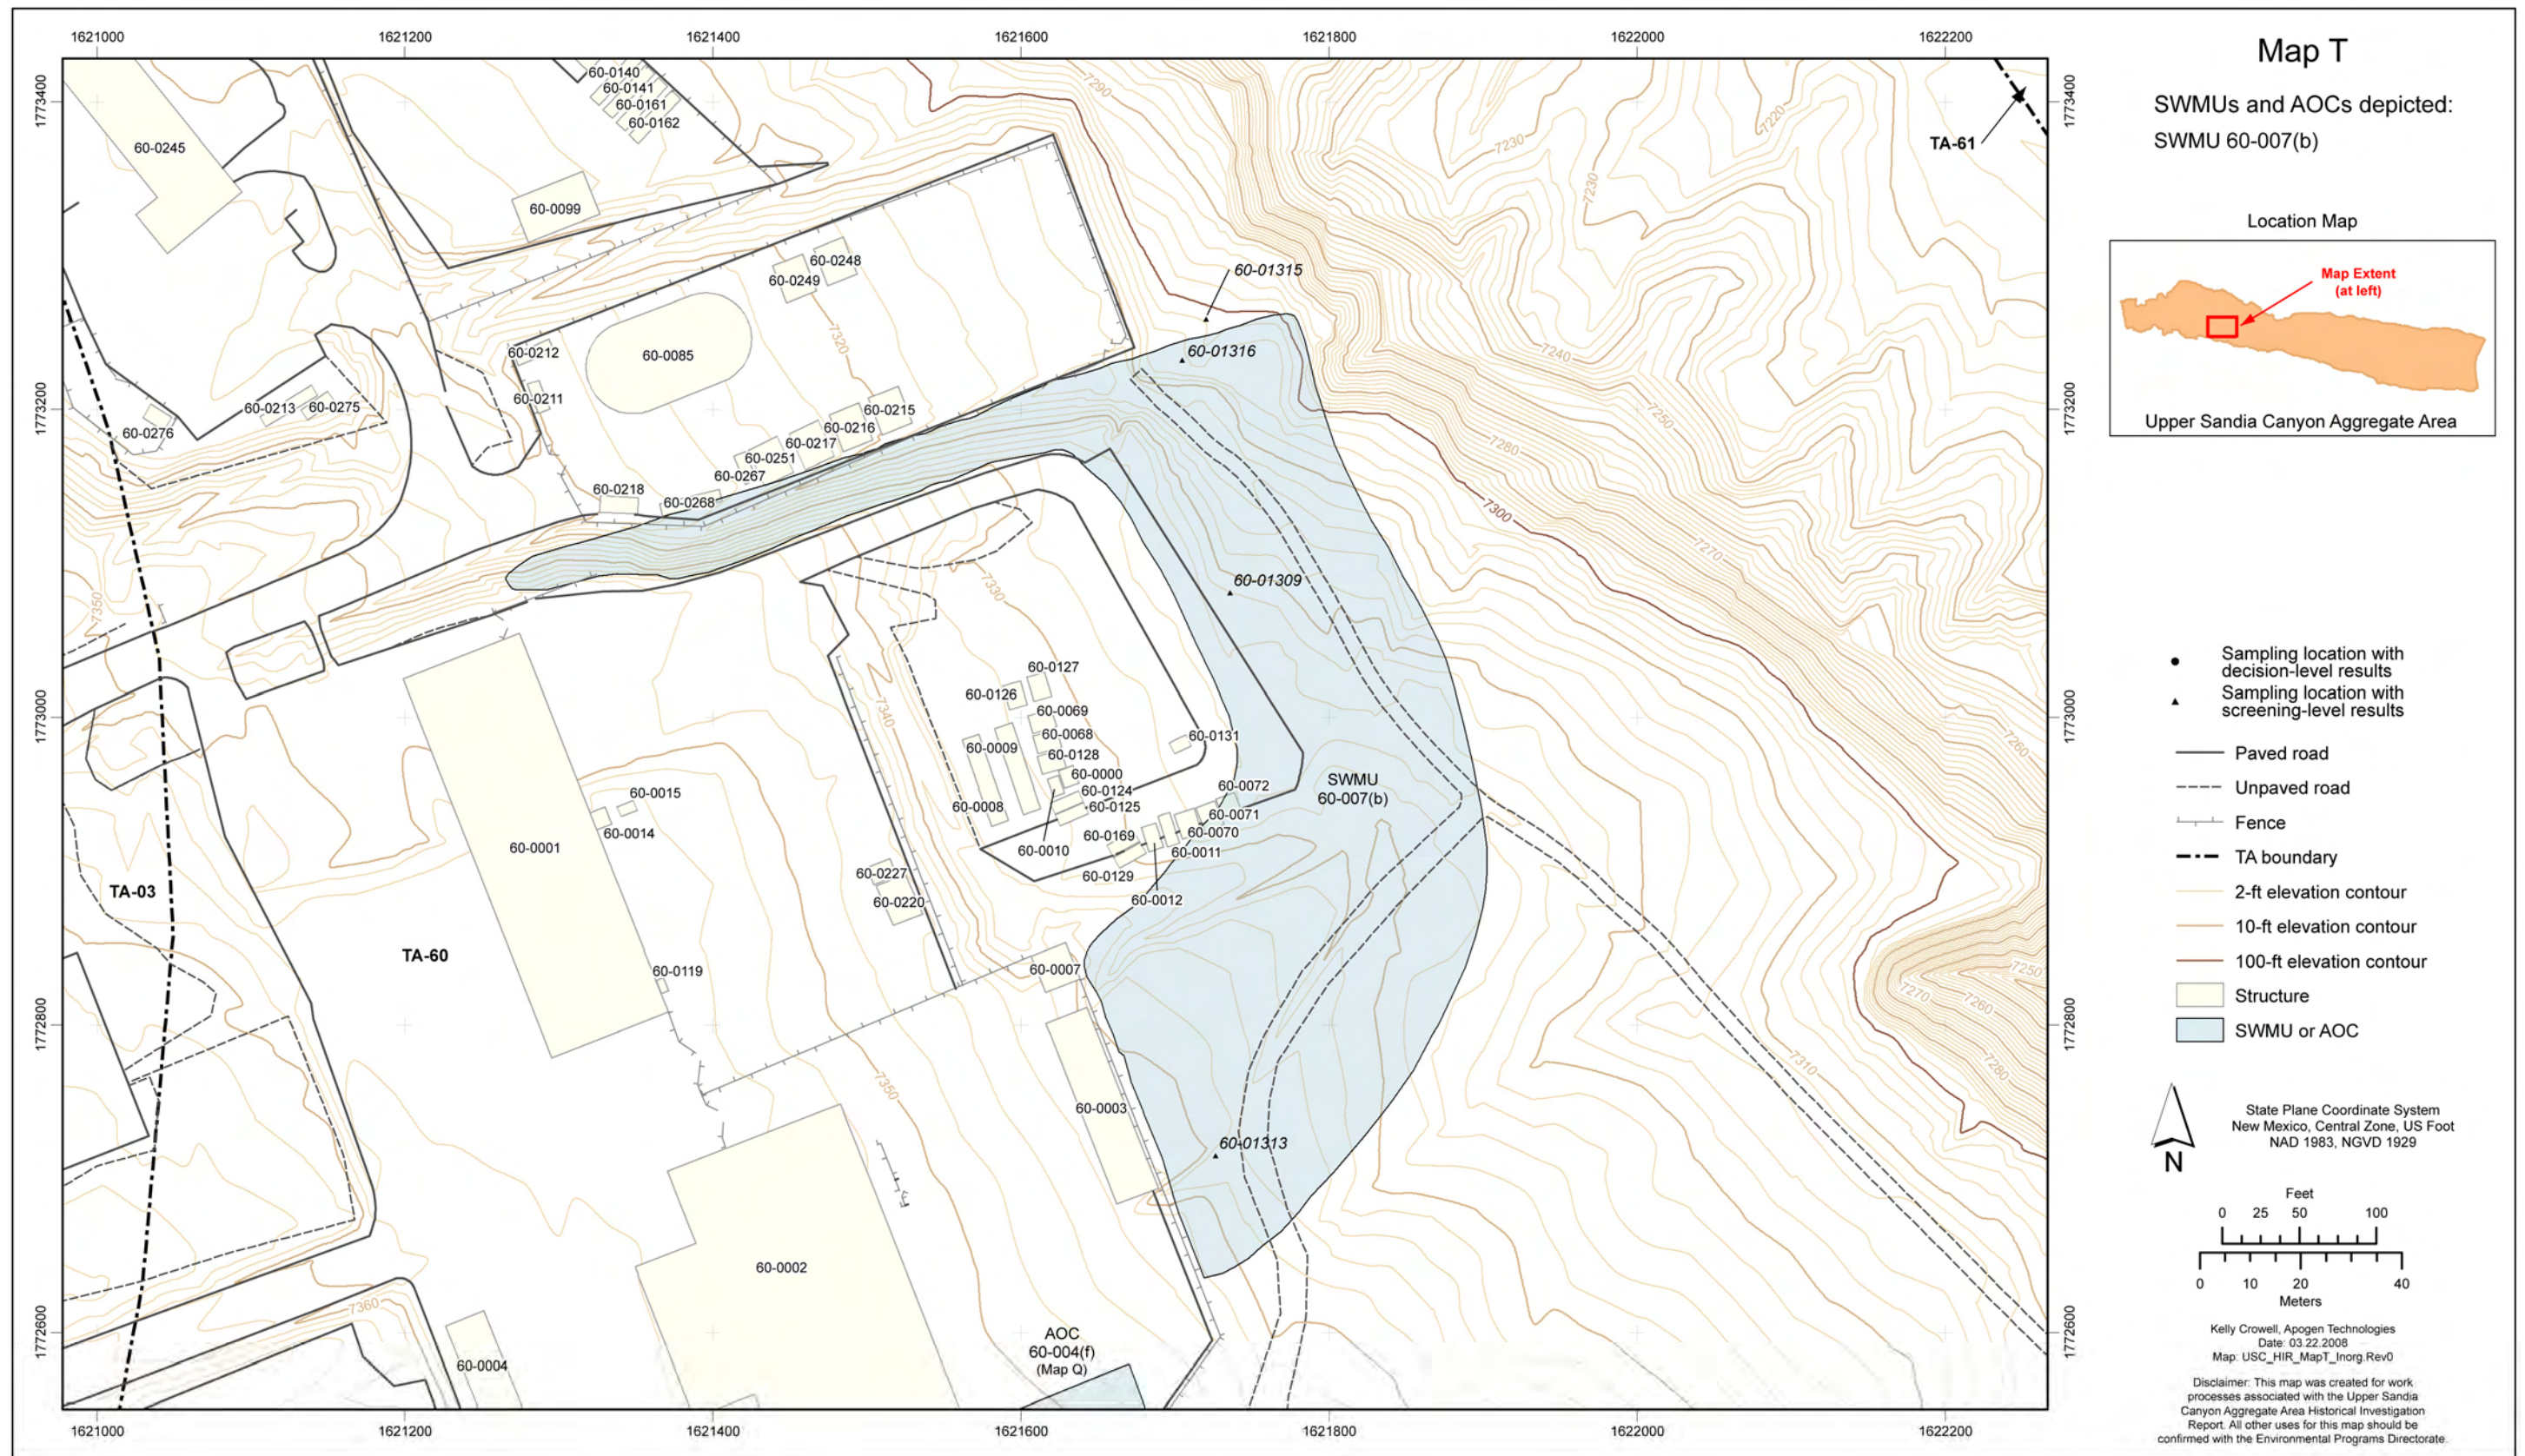


Figure 3.7-4 Map T radionuclide sampling locations



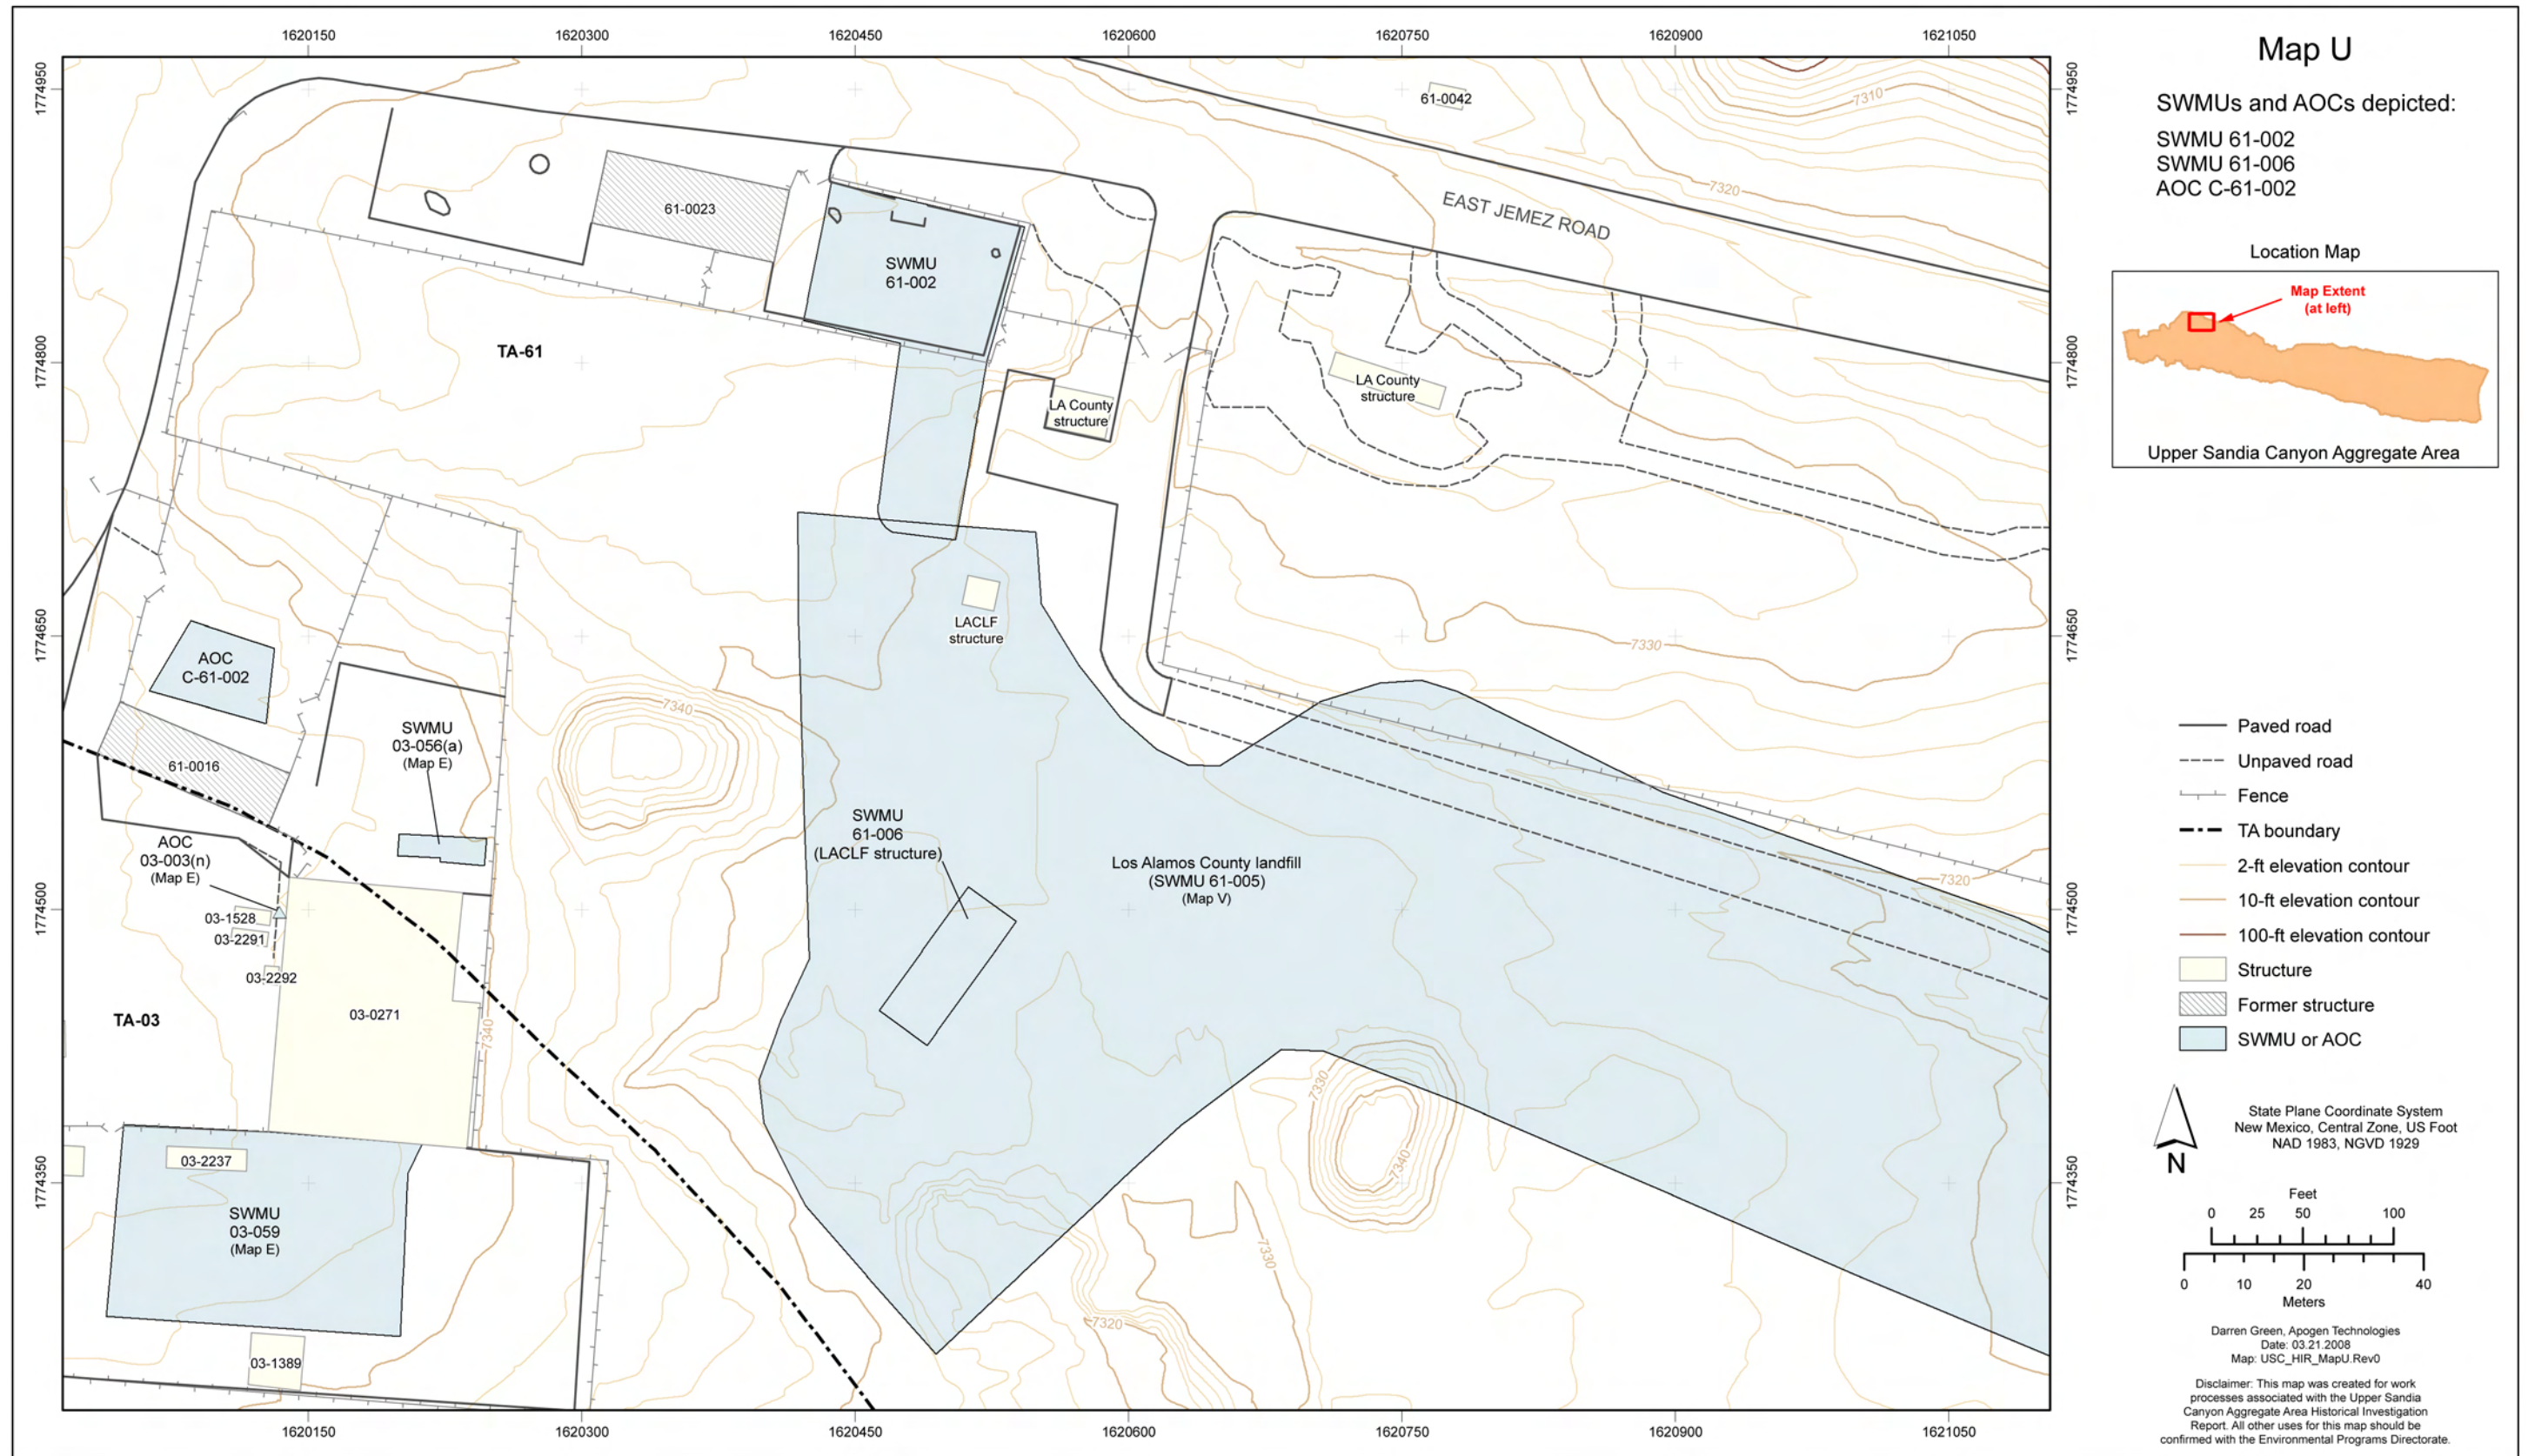


Figure 4.1-1 Map U site location



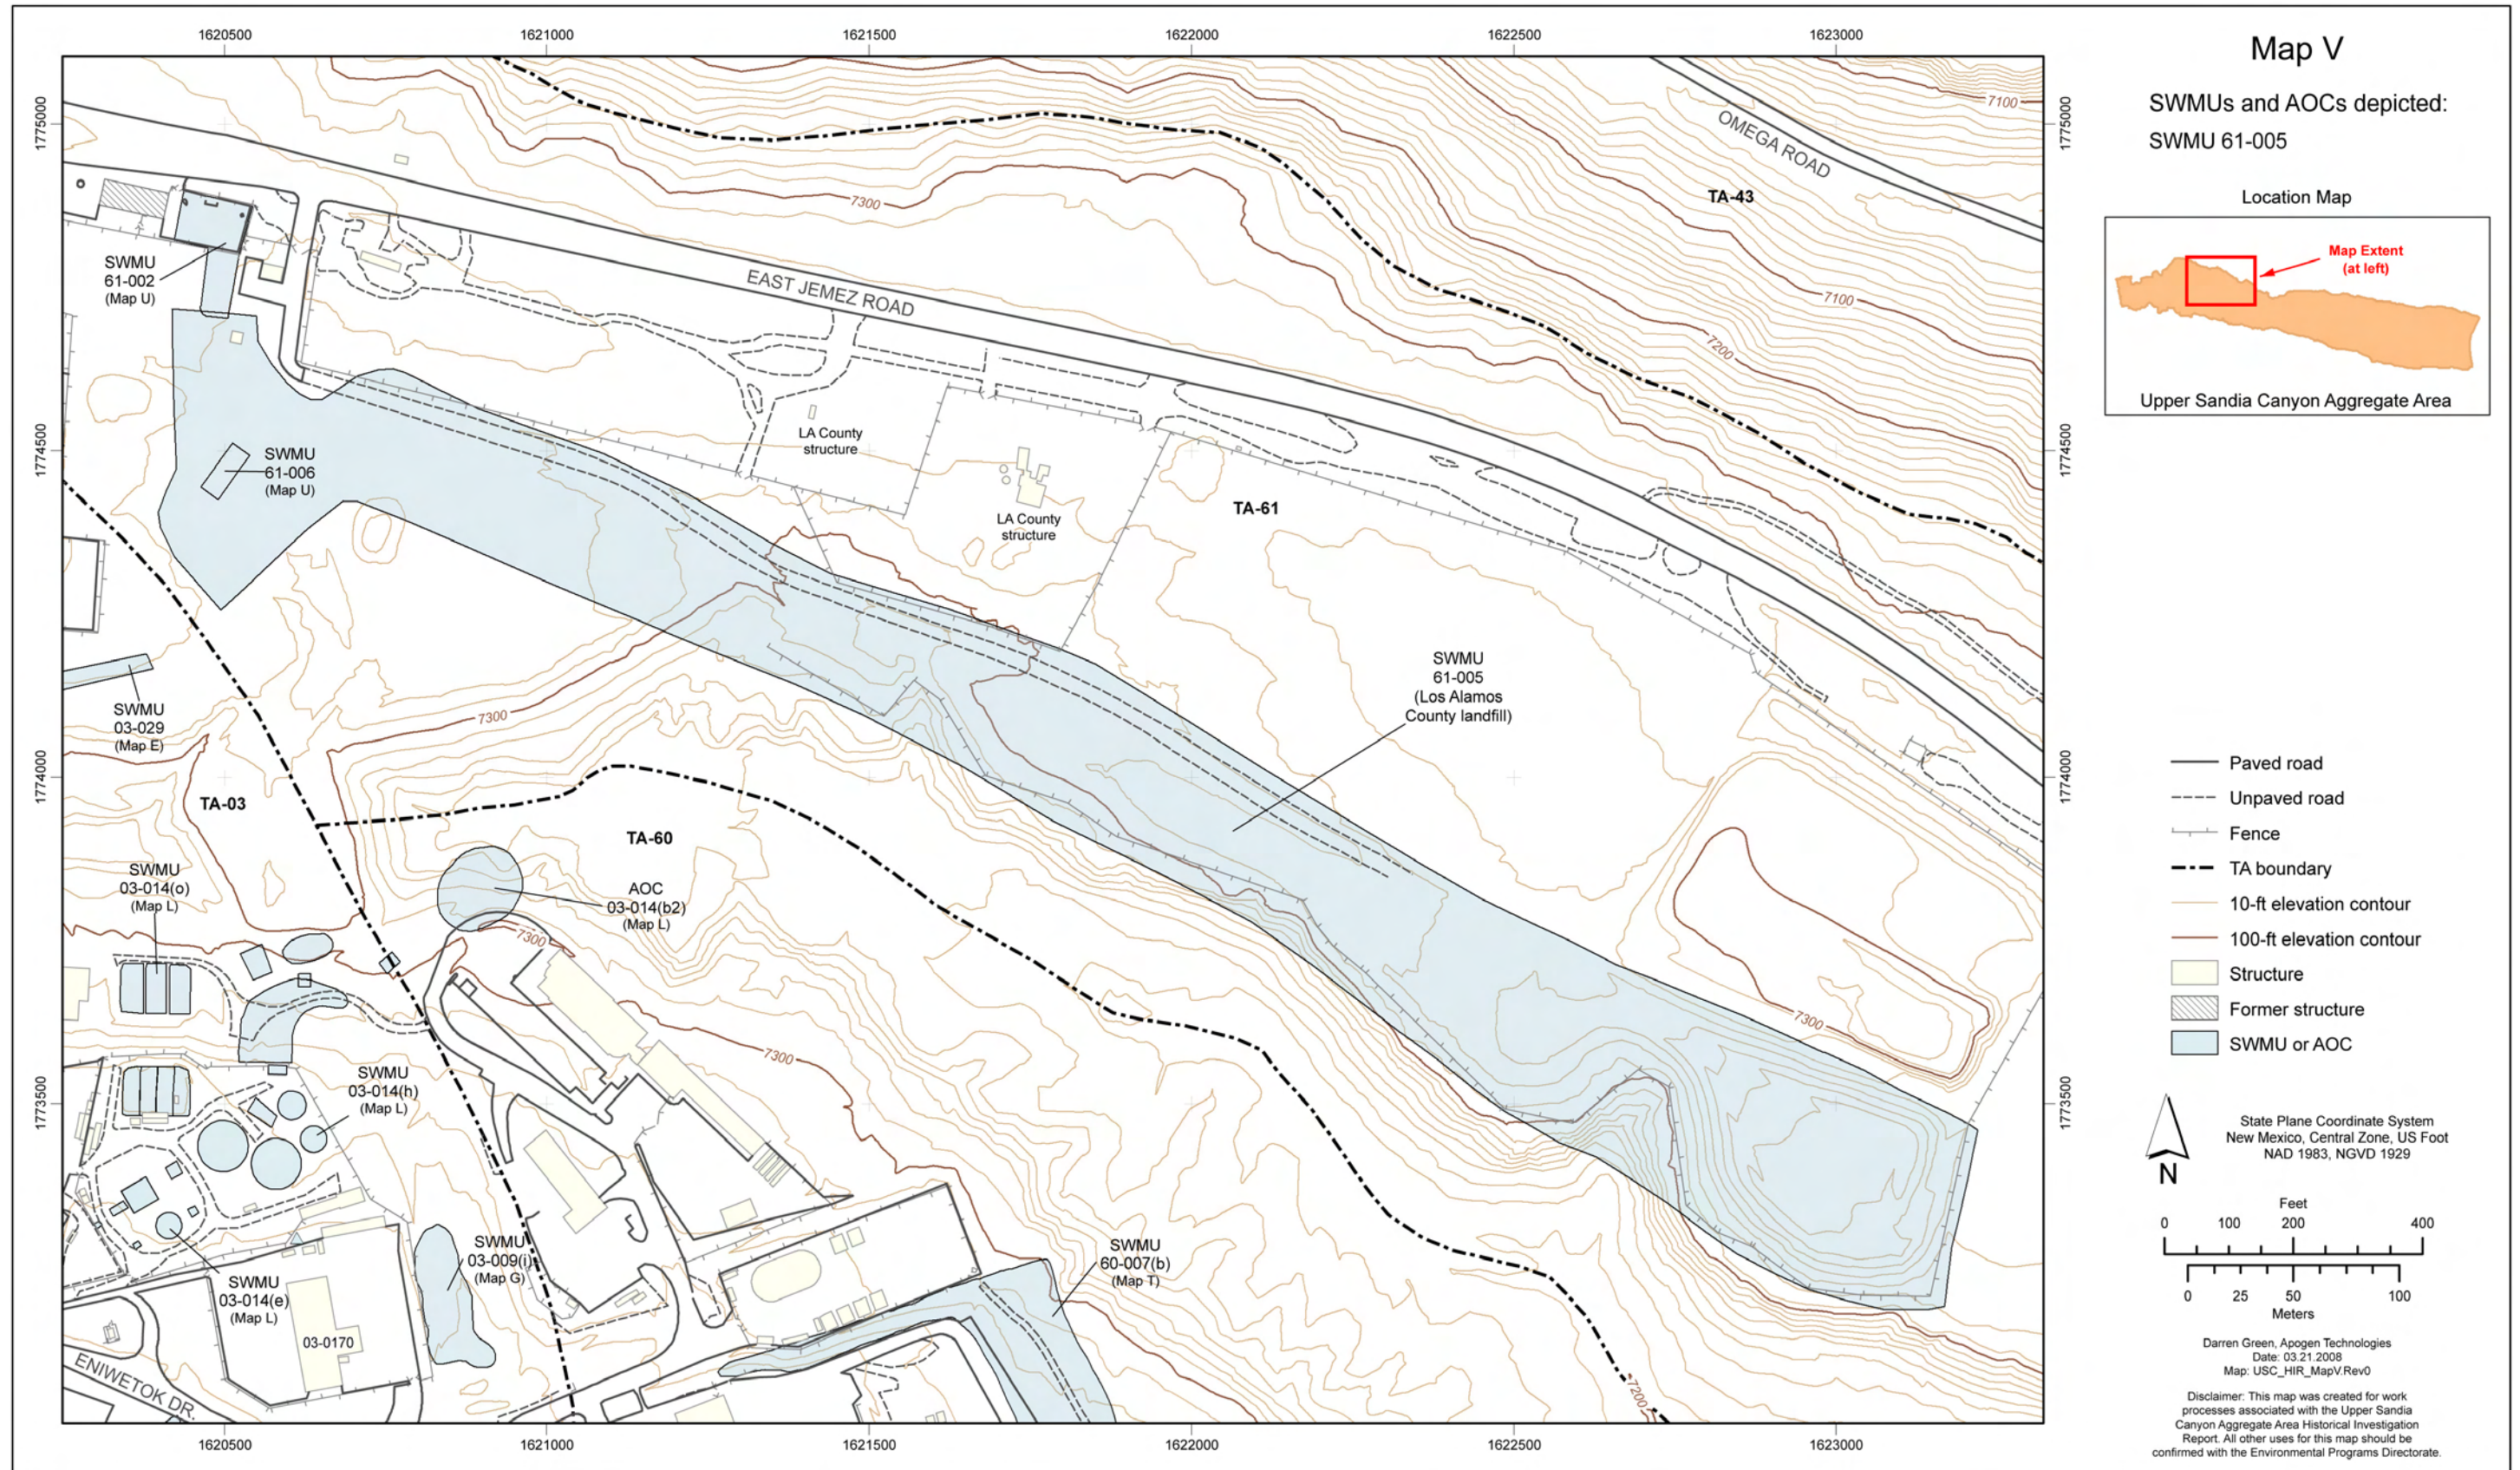


Figure 4.2-1 Map V site location





**Table 1.0-1  
SWMUs and AOCs within the Upper Sandia Canyon Aggregate Area**

Site ID	Subunit	Brief Description	Site Status	Reference
<b>TA-03</b>				
AOC 03-001(d)		Satellite accumulation area located on a paved area northwest of building 03-0170	NFA Approved	EPA 2005, 088464
AOC 03-001(f)		Satellite accumulation areas (rooms 122, 125, and 132) and a less-than-90-day hazardous waste accumulation area (room 103) within building 03-0038	NFA Approved	EPA 2005, 088464
AOC 03-001(i)		Two inactive material and equipment storage areas located near a parks and refuse office building (Building 03-0070)	NFA Approved	NMED 2006, 094384
AOC 03-001(n)		Satellite accumulation areas in room 104 and on the south loading dock of building 03-032	NFA Approved	EPA 2005, 088464
AOC 03-001(o)		A former Satellite accumulation area within room 100 of building 03-035	NFA Approved	EPA 2005, 088464
AOC 03-001(p)		Satellite accumulation area located within building 03-037 (a carpenter shed)	NFA Approved	EPA 2005, 088464
AOC 03-001(q)		Former satellite accumulation areas located in rooms 108A and A326 of building 03-043	NFA Approved	EPA 2005, 088464
AOC 03-001(r)		Former satellite accumulation area within room 101 of building 03-409	NFA Approved	EPA 2005, 088464
AOC 03-001(v)		Former satellite accumulation area within a pesticide storage shed (building 60-029, formerly designated building 03-1486)	NFA Approved	EPA 2005, 088464
AOC 03-001(x)		Satellite accumulation area within building 03-022	NFA Approved	EPA 2005, 088464
SWMU 03-002(a)		A former less-than-90-day hazardous waste accumulation area that has also been identified as a <90-day storage area that was established at the Laboratory within building 03-066 (outside of room P-100)	Removed from Module VIII, Hazardous Waste Facility Permit (HWFP)	NMED 2001, 070010
SWMU 03-002(b)		An inactive hazardous waste satellite accumulation area established at the Laboratory within building 03-1966	Removed from Module VIII, HWFP	NMED 1998, 063042

Table 1.0-1 (continued)

Site ID	Subunit	Brief Description	Site Status	Reference
SWMU 03-002(c)		Former Storage area used to store pesticides/herbicides	Under Investigation	HIR Section 2.1
SWMU 03-003(c)		Equipment storage area, PCB only site, used to temporarily store used dielectric oils/capacitors	Under Investigation	HIR Section 2.2
AOC 03-003(d)		Transformer area - PCB only site, is a concrete pad that formerly housed transformers	Under Investigation	HIR Section 2.3
AOC 03-003(f)		Transformer area - PCB only site, is an area of potential soil contamination	Under Investigation	HIR Section 2.4
AOC 03-003(g)		Transformer area - PCB only storage site	Under Investigation	HIR Section 2.5
AOC 03-003(m)		The location of two former capacitor banks at building 03-1188 in a limited access, fenced area	NFA Approved	EPA 2003, 087296
AOC 03-003(o)		Capacitor bank area - PCB only site for Scyllac experiment	Under Investigation	HIR Section 2.6
AOC 03-006		Burn site - duplicate of SWMU 61-003	NFA Approved	EPA 2005, 088464
AOC 03-008(b)		Firing site	NFA Approved	EPA 2005, 088464
<b>Consolidated Area 03-009(a)</b>	SWMU 03-009(a)	Surface disposal (soil fill) located at the canyon rim south of asphalt plant	Under Investigation	HIR Section 2.7.1
	SWMU 03-028	Surface impoundment holding pond near asphalt plant	Under Investigation	HIR Section 2.7.2
	SWMU 03-029	Landfill near rim of Sandia Canyon south of building 064617	Under Investigation	HIR Section 2.7.3
	SWMU 03-036(a)	Aboveground tanks-two former product tanks at asphalt plant	Under Investigation	HIR Section 2.7.4
	SWMU 03-036(c)	Aboveground tanks - duplicate of 03-043(f), former tank for cooled asphalt storage	Under Investigation	HIR Section 2.7.5
	SWMU 03-036(d)	Underground tanks - duplicate of 3-043(g), hot emulsion storage tank	Under Investigation	HIR Section 2.7.6
	AOC 03-043(b)	Aboveground tank, asphalt emulsion storage	Under Investigation	HIR Section 2.7.7
	AOC 03-043(d)	Aboveground tank, duplicate of 03-036(a)	Under Investigation	HIR Section 2.7.8
	AOC 03-043(h)	Aboveground tank, duplicate of 03-036(a)	Under Investigation	HIR Section 2.7.9



Table 1.0-1 (continued)

Site ID	Subunit	Brief Description	Site Status	Reference
<b>Consolidated Area 03-009(a) (continued)</b>	SWMU 03-045(g)	Storm drain, closed and locked formerly permitted outfall	Under Investigation	HIR Section 2.7.10
SWMU 03-009(i)		Surface disposal site for construction debris	Under Investigation	HIR Section 2.8
AOC 03-010(c)		Operational release	NFA Approved	EPA 2005, 088464
AOC 03-010(d)		Operational release	NFA Approved	EPA 2005, 088464
<b>Consolidated Area 03-012(b)-99</b>	SWMU 03-012(b)	Operational release and outfall associated with the power plant	Under Investigation	HIR Section 2.9.1
	SWMU 03-014(q)	Holding tank, former effluent tank	Under Investigation	HIR Section 2.9.2
	SWMU 03-045(b)	Operational Release, duplicate of 03-012(b)	Under Investigation	HIR Section 2.9.3
	SWMU 03-045(c)	Outfall currently NPDES permitted receives effluent from cooling tower	Under Investigation	HIR Section 2.9.4
<b>Consolidated Unit 03-013(a)-00</b>	SWMU 03-013(a)	Storm drain, metal pipe storm drain	Under Investigation	HIR Section 2.10.1
	SWMU 03-052(f)	Outfall received wastewater from building 03-0038	Under Investigation	HIR Section 2.10.2
AOC 03-013(b)		Floor drains in basement of building 03-0038	Under Investigation	HIR Section 2.11
AOC 03-013(c)		Operational release	NFA Approved	EPA 2005, 088464
AOC 03-013(d)		Operational release	NFA Approved	EPA 2005, 088464
AOC 03-013(e)		Operational release	NFA Approved	EPA 2005, 088464
AOC 03-013(f)		Operational release	NFA Approved	EPA 2005, 088464
SWMU 03-013(i)		Operational release, oil contaminated soil and gravel	Under Investigation	HIR Section 2.12
<b>Consolidated Unit 03-014(a)-99</b>	SWMU 03-014(a)	Structure Associated with Former WWTP, Imhoff tank	Under Investigation	HIR Section 2.13.1
	SWMU 03-014(b)	Structure Associated with Former WWTP, the dosing siphon	Under Investigation	HIR Section 2.13.2
	AOC 03-014(b2)	Outfall formerly permitted , received effluent from flow-measurement weir	Under Investigation	HIR Section 2.13.3
	SWMU 03-014(c)	Structure Associated with Former WWTP, trickling filter	Under Investigation	HIR Section 2.13.4
	AOC 03-014(c2)	Outfall, abandoned overflow, received effluent from WWTP	Under Investigation	HIR Section 2.13.5

Table 1.0-1 (continued)

Site ID	Subunit	Brief Description	Site Status	Reference
<b>Consolidated Unit 03-014(a)-99 (continued)</b>	SWMU 03-014(d)	Structure Associated with Former WWTP, secondary clarifier	Under Investigation	HIR Section 2.13.6
	SWMU 03-014(e)	Structure Associated with Former WWTP, Imhoff tank	Under Investigation	HIR Section 2.13.7
	SWMU 03-014(f)	Structure Associated with Former WWTP, dosing siphon	Under Investigation	HIR Section 2.13.8
	SWMU 03-014(g)	Structure Associated with Former WWTP, trickling filter	Under Investigation	HIR Section 2.13.9
	SWMU 03-014(h)	Structure Associated with Former WWTP, secondary clarifier	Under Investigation	HIR Section 2.13.10
	SWMU 03-014(i)	Structure Associated with Former WWTP, splitter box, a comminutor, and bar screen	Under Investigation	HIR Section 2.13.11
	SWMU 03-014(j)	Structure Associated with Former WWTP, chlorination system	Under Investigation	HIR Section 2.13.12
	SWMU 03-014(k)	Structure Associated with Former WWTP, unlined sludge drying bed	Under Investigation	HIR Section 2.13.13
	SWMU 03-014(l)	Structure Associated with Former WWTP, unlined sludge drying bed	Under Investigation	HIR Section 2.13.14
	SWMU 03-014(m)	Structure Associated with Former WWTP, unlined sludge drying bed	Under Investigation	HIR Section 2.13.15
	SWMU 03-014(n)	Structure Associated with Former WWTP, unlined sludge drying bed	Under Investigation	HIR Section 2.13.16
	SWMU 03-014(o)	Structure Associated with Former WWTP, three lined sludge drying bed	Under Investigation	HIR Section 2.13.17
	SWMU 03-014(p)	Structure Associated with Former WWTP, active lift station	Under Investigation	HIR Section 2.13.18
	SWMU 03-014(u)	Structure Associated with Former WWTP, former holding tank	Under Investigation	HIR Section 2.13.19
	SWMU 03-056(d)	Drum storage, active site on northeast side of Plant 1 trickling filter	Under Investigation	HIR Section 2.13.20
SWMU 03-014(r)		Lift Station Associated with Former WWTP, active lift station	Under Investigation	HIR Section 2.14
SWMU 03-014(s)		Lift Station Associated with Former WWTP, active lift station	Under Investigation	HIR Section 2.15



Table 1.0-1 (continued)

Site ID	Subunit	Brief Description	Site Status	Reference
AOC 03-014(v)		Drain Associated with Former WWTP in former garage (building 03-0036)	Under Investigation	HIR Section 2.16
AOC 03-014(y)		Drain Associated with Former WWTP in basement of press building (03-0035)	Under Investigation	HIR Section 2.17
<b>Consolidated Unit 03-015-00</b>	SWMU 03-015	Outfall located between Eniwetok Rd. and security fence ne of building 03-0141	Under Investigation	HIR Section 2.18.1
	AOC 03-053	Operational facility, basement area of building 03-0141	Under Investigation	HIR Section 2.18.2
AOC C-03-016		Oil metal bin, cleanout bin	Under Investigation	HIR Section 2.19
AOC 03-016(b)		Septic system	NFA Approved	EPA 2005, 088464
AOC 03-016(c)		Septic system	NFA Approved	EPA 2005, 088464
AOC 03-016(d)		Septic system	NFA Approved	EPA 2005, 088464
AOC 03-016(e)		Septic system - duplicate of SWMU 03-014(s)	NFA Approved	EPA 2005, 088464
AOC 03-016(f)		Septic system - duplicate of SWMU 03-014(s)	NFA Approved	EPA 2005, 088464
SWMU 03-020(a)		Disposal pit	Removed from Module VIII, HWFP	NMED 1998, 063042
AOC 03-020(b)		Surface disposal site	NFA Approved	EPA 2005, 088464
SWMU 03-021		Outfall located 60 ft north of building 03-0170	Under Investigation	HIR Section 2.20
AOC 03-023		Sump	NFA Approved	EPA 2005, 088464
SWMU 03-024		Tank and/or associated equipment	Removed from Module VIII, HWFP	NMED 1998, 063042
SWMU 03-026(b)		Sumps (active)	Removed from Module VIII, HWFP	NMED 2001, 070010
AOC 03-027		Lift wells, two concrete block lined lift wells	Under Investigation	HIR Section 2.21
SWMU 03-032		Tank and associated equipment	Removed from Module VIII, HWFP	NMED 2001, 070010
SWMU 03-035(a)		Underground storage tank	Removed from Module VIII, HWFP	NMED 1998, 063042
SWMU 03-035(b)		Underground storage tank	Removed from Module VIII, HWFP	NMED 1998, 063042
AOC 03-036(b)		Former Aboveground tanks that contained diesel fuel	Under Investigation	HIR Section 2.22
AOC 03-036(e)		Aboveground tank	NFA Approved	EPA 2005, 088464

Table 1.0-1 (continued)

Site ID	Subunit	Brief Description	Site Status	Reference
AOC 03-036(f)		Aboveground tank	NFA Approved	EPA 2005, 088464
AOC 03-036(g)		Aboveground tank	NFA Approved	EPA 2005, 088464
AOC 03-036(h)		Aboveground tanks	NFA Approved	EPA 2005, 088464
AOC 03-036(i)		Aboveground tank	NFA Approved	EPA 2005, 088464
AOC 03-036(j)		Aboveground tanks	NFA Approved	EPA 2005, 088464
SWMU 03-037		Underground tanks, active concrete tank in basement of Sigma building	Under Investigation	HIR Section 2.23
AOC 03-038(c)		Waste lines, cast iron piped rinse solution from copper electroplating	Under Investigation	HIR Section 2.24
AOC 03-038(d)		Waste lines, industrial line associated with liquid waste treatment system	Under Investigation	HIR Section 2.25
SWMU 03-039(a)		Silver recovery unit	Removed from Module VIII, HWFP	NMED 1998, 063042
AOC 03-039(b)		Silver recovery unit	NFA Approved	EPA 2005, 088464
AOC 03-039(d)		Silver recovery unit	NFA Approved	EPA 2005, 088464
AOC 03-039(e)		Silver recovery unit	NFA Approved	EPA 2005, 088464
AOC 03-040(b)		Storage area	NFA Approved	EPA 2005, 088464
AOC 03-043(a)		Aboveground tank stored asphalt emulsion	Under Investigation	HIR Section 2.26
SWMU 03-043(e)		Underground storage tank	Removed from Module VIII, HWFP	NMED 2001, 070010
AOC 03-043(f)		Aboveground tank, duplicate of 03-036(c)	Under Investigation	HIR Section 2.27
AOC 03-043(g)		Aboveground tank, duplicate of 03-036(d)	Under Investigation	HIR Section 2.28
SWMU 03-044(a)		Container storage area	Removed from Module VIII, HWFP	NMED 2001, 070010
SWMU 03-045(a)		Outfall, inactive, unpermitted from building 03-0022	Under Investigation	HIR Section 2.29
SWMU 03-045(d)		Storage tank (aboveground)	Removed from Module VIII, HWFP	NMED 1998, 063042
SWMU 03-045(e)		Outfall from drain in an oil pump house, 03-0057	Under Investigation	HIR Section 2.30
SWMU 03-045(f)		Outfall from sink in utilities control center building 03-0223	Under Investigation	HIR Section 2.31



Table 1.0-1 (continued)

Site ID	Subunit	Brief Description	Site Status	Reference
SWMU 03-045(h)		Outfall located at north perimeter of Sigma Complex	Under Investigation	HIR Section 2.32
SWMU 03-045(i)		Outfall	Removed from Module VIII, HWFP	NMED 2001, 070010
SWMU 03-046		Above ground wastewater treatment tank	Certificate of Completion	NMED 2008, 100116, HIR Section 2.33
AOC 03-047(a)		Storage area	NFA Approved	EPA 2005, 088464
AOC 03-047(b)		Storage area	NFA Approved	EPA 2005, 088464
AOC 03-047(c)		Drum storage	NFA Approved	EPA 2005, 088464
AOC 03-047(d)		Storage area for containers for Steam Plant	Under Investigation	HIR Section 2.34
AOC 03-047(e)		Storage area	NFA Approved	EPA 2005, 088464
AOC 03-047(f)		Storage area	NFA Approved	EPA 2005, 088464
AOC 03-047(g)		Drum storage for three drums	Under Investigation	HIR Section 2.35
AOC 03-047(h)		Storage area	NFA Approved	EPA 2005, 088464
AOC 03-047(i)		Satellite accumulation area	NFA Approved	EPA 2005, 088464
SWMU 03-049(c)		Outfall (active)	Removed from Module VIII, HWFP	NMED 2001, 070010
AOC 03-050(c)		Exhaust emissions, off-gas scrubber of HEPA filter system	NFA Approved	EPA 2005, 088464
AOC 03-051(c)		Soil contamination From Vacuum Pump Leaking	Under Investigation	HIR Section 2.36
AOC 03-052(b)		Storm drainage 20 ft north and west of Sigma building 03-0066	Under Investigation	HIR Section 2.37
SWMU 03-052(c)		One-time release	Removed from Module VIII, HWFP	NMED 2001, 070010
AOC 03-052(d)		Storm drainage (non-PCB transformers / capacitors)	NFA Approved	EPA 2003, 087296
SWMU 03-054(c)		Outfall, former cooling tower, and pump house	Under Investigation	HIR Section 2.38
SWMU 03-056(a)		Storage area, inactive, used oil accumulation	Under Investigation	HIR Section 2.39
AOC 03-056(b)		Container storage area	NFA Approved	EPA 2003, 087296
SWMU 03-056(c)		Transformer storage area - PCB only site, north of utilities shop, 03-0223	Under Investigation	HIR Section 2.4

Table 1.0-1 (continued)

Site ID	Subunit	Brief Description	Site Status	Reference
AOC 03-056(h)		Container Storage Area near 03-0105 and 03-0287	Under Investigation	HIR Section 2.41
AOC 03-056(i)		Drum storage	NFA Approved	EPA 2005, 088464
AOC 03-056(k)		Container storage area north side of loading dock at Sigma building 03-0066	Under Investigation	HIR Section 2.42
SWMU 03-056(l)		Storage area outside Beryllium Technology Facility 03-0141	Under Investigation	HIR Section 2.43
SWMU 03-056(n)		Container storage area	Removed from Module VIII, HWFP	NMED 2001, 070010
AOC 03-057		Sump/grease trap	NFA Approved	EPA 2005, 088464
<b>Consolidated Unit 03-059-00</b>	AOC 03-003(n)	One-time spill - PCB only site, one time spill	Under Investigation	HIR Section 2.44.1
	SWMU 03-059	Storage area - PCB only site, former salvage yard	Under Investigation	HIR Section 2.44.2
AOC C-03-001		Gas trap	NFA Approved	EPA 2005, 088464
AOC C-03-002		One-time spill, leak from asphalt machine	NFA Approved	EPA 2005, 088464
AOC C-03-004		Miscellaneous debris	NFA Approved	EPA 2005, 088464
AOC C-03-005		Oil Spill	NFA Approved	EPA 2005, 088464
AOC C-03-009		Storage area	NFA Approved	EPA 2005, 088464
AOC C-03-011		Waste oil tank	NFA Approved	EPA 2005, 088464
AOC C-03-015		Underground storage tank	NFA Approved	EPA 2005, 088464
AOC C-03-017		Underground storage tank	NFA Approved	EPA 2005, 088464
AOC C-03-018		Underground storage tank	NFA Approved	EPA 2005, 088464
AOC C-03-020		Storage tanks	NFA Approved	EPA 2005, 088464
AOC C-03-022		Kerosene tanker trailer used to store and distribute kerosene for asphalt plant	Under Investigation	HIR Section 2.45
<b>TA-60</b>				
AOC 60-001(a)		Storage area (active)	NFA Approved	EPA 2003, 087296
AOC 60-001(b)		Storage area (active)	NFA Approved	EPA 2005, 088464
AOC 60-001(c)		Storage area (active)	NFA Approved	EPA 2005, 088464



Table 1.0-1 (continued)

Site ID	Subunit	Brief Description	Site Status	Reference
AOC 60-001(d)		Storage area, pesticide shed	NFA Approved	EPA 2005, 088464
SWMU 60-002		Storage areas on Sigma Mesa (west, central, east)	Under Investigation	HIR Section 3.1
AOC 60-003		Oil-water separator	NFA Approved	EPA 2005, 088464
AOC 60-004(a)		Storage area	NFA Approved	EPA 2005, 088464
AOC 60-004(b)		Storage area for 12 containers of diesel sludge	Under Investigation	HIR Section 3.2
AOC 60-004(d)		Storage area for dismantled USTs and contents	Under Investigation	HIR Section 3.3
AOC 60-004(f)		Storage area bermed and used for new product storage	Under Investigation	HIR Section 3.4
AOC 60-005(b)		Drilling mud pit	NFA Approved	EPA 2005, 088464
SWMU 60-006(a)		Septic system on Sigma Mesa	Under Investigation	HIR Section 3.5
AOC 60-006(c)		Septic tank	NFA Approved	EPA 2005, 088464
SWMU 60-007(a)		Release, equipment stored leaked oil	Under Investigation	HIR Section 3.6
SWMU 60-007(b)		Release, storm drainage from motor pool building 03-0001	Under Investigation	HIR Section 3.7
AOC C-60-001		Underground tank	NFA Approved	EPA 2005, 088464
AOC C-60-003		One-time spill at pesticide shed	NFA Approved	EPA 2005, 088464
AOC C-60-004		Underground tank	NFA Approved	EPA 2005, 088464
<b>TA-61</b>				
AOC 61-001		Storage area	NFA Approved	EPA 2005, 088464
SWMU 61-002		Transformer storage area - PCB only site located east of Radio Repair Shop 61-0023	Under Investigation	HIR Section 4.1
AOC 61-003		Burn sites	NFA Approved	EPA 2005, 088464
SWMU 61-004(a)		Former septic tank	Removed from Module VIII, HWFP	NMED 2001, 070010
AOC 61-004(c)		Septic system	NFA Approved	EPA 2005, 088464
SWMU 61-005		Landfill, County Subtitle D	Under Investigation	HIR Section 4.2
SWMU 61-006		Waste oil tank, active, used oil recycling	Under Investigation	HIR Section 4.3

**Table 1.0-1 (continued)**

Site ID	Subunit	Brief Description	Site Status	Reference
AOC C-61-001		Leak from transformer storage area - PCB only site	NFA Approved	EPA 2005, 088464
AOC C-61-002		Subsurface contamination, potentially petroleum based	Under Investigation	HIR Section 4.4

Note: Shading denotes sites that have been approved for NFA.



**Table 2.0-1**  
**Decision-Level Data from TA-03 Site Samples Collected and Analyses Requested**

Sample Id	Location Id	Depth (ft)	Media	Chromium Hexavalent Ion	Gamma Spectroscopy	Gross Alpha/Beta Radiation	Herbicides	Isotopic Plutonium	Isotopic Uranium	Metals	PCBs	Pesticides	Strontium-90	SVOCs	TPH-DRO	TPH-GRO	Tritium	VOCs
<b>SWMU 03-003(c)</b>																		
RC03-01-0012	03-14454	0.0–0.25	Debris	—	—*	—	—	—	—	—	9441R	—	—	—	—	—	—	—
RC03-01-0013	03-14455	0.0–0.25	Debris	—	—	—	—	—	—	—	9441R	—	—	—	—	—	—	—
RC03-01-0014	03-14456	0.0–0.25	Debris	—	—	—	—	—	—	—	9441R	—	—	—	—	—	—	—
RC03-01-0015	03-14457	0.33–0.5	Fill	—	—	—	—	—	—	—	9441R	—	—	—	—	—	—	—
RC03-01-0016	03-14458	0.33–0.5	Fill	—	—	—	—	—	—	—	9441R	—	—	—	—	—	—	—
RC03-01-0017	03-14459	0.33–0.5	Fill	—	—	—	—	—	—	—	9441R	—	—	—	—	—	—	—
<b>Consolidated Unit 03-009(a)-00</b>																		
<b>SWMU 03-009(a)</b>																		
RE03-03-52417	03-22537	4.5–5.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52422	03-22538	14.5–15.0	Fill	—	—	—	—	—	—	1886S	—	—	—	1886S	1886S	1886S	—	1886S
RE03-03-52423	03-22538	19.5–20.0	Qbt 4	—	—	—	—	—	—	1892S	—	—	—	1892S	1892S	1892S	—	1892S
RE03-03-52427	03-22539	4.0–5.0	Qbt 4	—	—	—	—	—	—	1886S	—	—	—	1886S	1886S	1886S	—	1886S
RE03-03-52429	03-22539	19.5–20.0	Qbt 4	—	—	—	—	—	—	1886S	—	—	—	1886S	1886S	1886S	—	1886S
<b>SWMU 03-028</b>																		
RE03-03-52348	03-22523	5.0–5.5	Soil	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52351	03-22523	19.0–19.5	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52352	03-22524	7.5–8.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52354	03-22524	19.5–20.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
<b>SWMU 03-036(a)</b>																		
RE03-03-52357	03-22525	8.0–8.5	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52359	03-22525	19.5–20.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
<b>SWMU 03-036(c)</b>																		
RE03-03-52362	03-22526	3.0–4.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52365	03-22526	19.5–20.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
<b>SWMU 03-036(d)</b>																		
RE03-03-52368	03-22527	4.5–5.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
<b>AOC 03-043(b)</b>																		
RE03-03-52372	03-22528	9.5–10.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52374	03-22528	19.5–20.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52419	03-22537	19.5–20.0	Qbt 4	—	—	—	—	—	—	1892S	—	—	—	1892S	1892S	1892S	—	1892S

Table 2.0-1 (continued)

Sample Id	Location Id	Depth (ft)	Media	Chromium Hexavalent Ion	Gamma Spectroscopy	Gross Alpha/Beta Radiation	Herbicides	Isotopic Plutonium	Isotopic Uranium	Metals	PCBs	Pesticides	Strontium-90	SVOCs	TPH-DRO	TPH-GRO	Tritium	VOCs
<b>SWMU 03-045(g)</b>																		
RE03-03-52407	03-22535	0.0–0.5	Sediment	—	—	—	—	—	—	1886S	—	—	—	1886S	1886S	1886S	—	1886S
RE03-03-52408	03-22535	1.5–2.0	Sediment	—	—	—	—	—	—	1886S	—	—	—	1886S	1886S	1886S	—	1886S
RE03-03-52412	03-22536	0.0–0.5	Sediment	—	—	—	—	—	—	1886S	—	—	—	1886S	1886S	1886S	—	1886S
RE03-03-52413	03-22536	1.5–2.0	Sediment	—	—	—	—	—	—	1886S	—	—	—	1886S	1886S	1886S	—	1886S
<b>Consolidated Unit 03-012(b)-00</b>																		
<b>03-012(b)-00</b>																		
RE03-02-49270	03-02-21036	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49284	03-02-21036	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49271	03-02-21037	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49285	03-02-21037	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49272	03-02-21038	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49286	03-02-21038	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49273	03-02-21039	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49287	03-02-21039	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49274	03-02-21040	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49288	03-02-21040	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49275	03-02-21041	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49289	03-02-21041	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49276	03-02-21042	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49290	03-02-21042	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49277	03-02-21043	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49291	03-02-21043	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49278	03-02-21044	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49292	03-02-21044	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49279	03-02-21045	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49293	03-02-21045	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49280	03-02-21046	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49294	03-02-21046	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49281	03-02-21047	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49295	03-02-21047	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49282	03-02-21048	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49296	03-02-21048	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49283	03-02-21049	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49297	03-02-21049	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—



Table 2.0-1 (continued)

Sample Id	Location Id	Depth (ft)	Media	Chromium Hexavalent Ion	Gamma Spectroscopy	Gross Alpha/Beta Radiation	Herbicides	Isotopic Plutonium	Isotopic Uranium	Metals	PCBs	Pesticides	Strontium-90	SVOCs	TPH-DRO	TPH-GRO	Tritium	VOCs
RE03-02-49298	03-02-21050	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49299	03-02-21051	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49300	03-02-21052	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49301	03-02-21053	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-04-52775	03-22576	0.0–0.5	Soil	1954S	—	—	—	—	—	1954S	1953S	—	—	—	—	—	—	—
RE03-04-52785	03-22576	3.5–4.0	Soil	1954S	—	—	—	—	—	1954S	—	—	—	—	—	—	—	—
RE03-04-52776	03-22577	0.0–0.5	Soil	1954S	—	—	—	—	—	1954S	—	—	—	—	—	—	—	—
RE03-04-52786	03-22577	3.0–3.5	Soil	1954S	—	—	—	—	—	1954S	—	—	—	—	—	—	—	—
RE03-04-52777	03-22578	0.0–0.5	Soil	1954S	—	—	—	—	—	1954S	1953S	—	—	—	—	—	—	—
RE03-04-52787	03-22578	3.5–4.0	Soil	1954S	—	—	—	—	—	1954S	—	—	—	—	—	—	—	—
RE03-04-52778	03-22579	0.0–0.5	Soil	1954S	—	—	—	—	—	1954S	—	—	—	—	—	—	—	—
RE03-04-52788	03-22579	3.5–4.0	Soil	1954S	—	—	—	—	—	1954S	—	—	—	—	—	—	—	—
RE03-04-52779	03-22580	0.0–0.5	Soil	1961S	—	—	—	—	—	1961S	1960S	—	—	—	—	—	—	—
RE03-04-52789	03-22580	3.5–4.0	Soil	1961S	—	—	—	—	—	1961S	—	—	—	—	—	—	—	—
RE03-04-52781	03-22582	0.83–1.33	Soil	1959S	—	—	—	—	—	1959S	1958S	—	—	—	—	—	—	—
RE03-04-52791	03-22582	1.83–2.83	Soil	1959S	—	—	—	—	—	1959S	—	—	—	—	—	—	—	—
RE03-04-52782	03-22583	0.0–0.5	Soil	1959S	—	—	—	—	—	1959S	—	—	—	—	—	—	—	—
RE03-04-52792	03-22583	3.5–4.0	Soil	1959S	—	—	—	—	—	1959S	—	—	—	—	—	—	—	—
RE03-04-52783	03-22584	0.0–0.5	Soil	1959S	—	—	—	—	—	1959S	1958S	—	—	—	—	—	—	—
RE03-04-52793	03-22584	3.5–4.0	Soil	1959S	—	—	—	—	—	1959S	—	—	—	—	—	—	—	—
RE03-04-52784	03-22585	0.0–0.5	Soil	1959S	—	—	—	—	—	1959S	—	—	—	—	—	—	—	—
RE03-04-52794	03-22585	3.5–4.0	Soil	1959S	—	—	—	—	—	1959S	—	—	—	—	—	—	—	—
<b>SWMU 03-013(i)</b>																		
RE03-05-59527	03-24444	0.0–0.5	Fill	—	—	—	—	—	—	3193S	3192S	—	—	3192S	3192S	3192S	—	—
RE03-05-59528	03-24444	1.5–1.5	Fill	—	—	—	—	—	—	3193S	3192S	—	—	3192S	3192S	3192S	—	3192S
RE03-05-59529	03-24445	0.0–0.5	Fill	—	—	—	—	—	—	3193S	3192S	—	—	3192S	3192S	3192S	—	—
RE03-05-59530	03-24445	1.5–1.5	Fill	—	—	—	—	—	—	3193S	3192S	—	—	3192S	3192S	3192S	—	3192S
RE03-05-59531	03-24446	0.0–0.5	Fill	—	—	—	—	—	—	3195S	3194S	—	—	3194S	3194S	3194S	—	—
RE03-05-59532	03-24446	1.5–1.5	Fill	—	—	—	—	—	—	3195S	3194S	—	—	3194S	3194S	3194S	—	3194S
RE03-05-59533	03-24447	0.0–0.5	Fill	—	—	—	—	—	—	3193S	3192S	—	—	3192S	3192S	3192S	—	—
RE03-05-59534	03-24447	1.5–1.5	Fill	—	—	—	—	—	—	3193S	3192S	—	—	3192S	3192S	3192S	—	3192S
RE03-05-59535	03-24448	0.0–0.5	Fill	—	—	—	—	—	—	3193S	3192S	—	—	3192S	3192S	3192S	—	—
RE03-05-59536	03-24448	1.5–1.5	Fill	—	—	—	—	—	—	3193S	3192S	—	—	3192S	3192S	3192S	—	3192S
RE03-05-59537	03-24449	0.0–0.5	Fill	—	—	—	—	—	—	3193S	3192S	—	—	3192S	3192S	3192S	—	—
RE03-05-59538	03-24449	1.5–1.5	Fill	—	—	—	—	—	—	3193S	3192S	—	—	3192S	3192S	3192S	—	3192S

Table 2.0-1 (continued)

Sample Id	Location Id	Depth (ft)	Media	Chromium Hexavalent Ion	Gamma Spectroscopy	Gross Alpha/Beta Radiation	Herbicides	Isotopic Plutonium	Isotopic Uranium	Metals	PCBs	Pesticides	Strontium-90	SVOCs	TPH-DRO	TPH-GRO	Tritium	VOCs
RE03-05-59539	03-24450	0.0–0.5	Fill	—	—	—	—	—	—	3193S	3192S	—	—	3192S	3192S	3192S	—	—
RE03-05-59540	03-24450	1.5–1.5	Fill	—	—	—	—	—	—	3193S	3192S	—	—	3192S	3192S	3192S	—	3192S
RE03-05-59541	03-24451	0.0–0.5	Fill	—	—	—	—	—	—	3195S	3194S	—	—	3194S	3194S	3194S	—	—
RE03-05-59542	03-24451	1.5–1.5	Fill	—	—	—	—	—	—	3195S	3194S	—	—	3194S	3194S	3194S	—	3194S
<b>Consolidated Unit 03-014(a)-99</b>																		
<b>SWMU 03-014(k)</b>																		
0103-97-0011	03-03264	0.0–1.0	Fill	—	—	—	3375R	3377R	3377R	3376R	3375R	3375R	3377R	3375R	—	—	3377R	—
0103-97-0012	03-03264	1.33–2.33	Qbt 4	—	—	—	3375R	3377R	3377R	3376R	3375R	3375R	3377R	3375R	—	—	3377R	—
0103-97-0013	03-03264	2.33–3.33	Qbt 4	—	—	—	3375R	3377R	3377R	3376R	3375R	3375R	3377R	3375R	—	—	3377R	3375R
<b>SWMU 03-014(l)</b>																		
0103-97-0014	03-03265	0.0–1.17	Fill	—	—	—	3375R	3377R	3377R	3376R	3375R	3375R	3377R	3375R	—	—	3377R	—
0103-97-0015	03-03265	1.67–2.67	Qbt 4	—	—	—	3375R	3377R	3377R	3376R	3375R	3375R	3377R	3375R	—	—	3377R	—
0103-97-0016	03-03265	2.67–3.67	Qbt 4	—	—	—	3375R	3377R	3377R	3376R	3375R	3375R	3377R	3375R	—	—	3377R	3375R
<b>SWMU 03-014(m)</b>																		
0103-97-0017	03-03266	0.0–0.17	Fill	—	—	—	3375R	3377R	3377R	3376R	3375R	3375R	3377R	3375R	—	—	3377R	—
0103-97-0018	03-03266	0.75–1.75	Qbt 4	—	—	—	3375R	3377R	3377R	3376R	3375R	3375R	3377R	3375R	—	—	3377R	—
0103-97-0019	03-03266	1.75–2.75	Qbt 4	—	—	—	3375R	3377R	3377R	3376R	3375R	3375R	3377R	3375R	—	—	3377R	3375R
0103-97-0363	03-03386	0.0–0.5	Fill	—	—	—	—	—	—	—	4002R	—	—	4002R	—	—	—	—
0103-97-0362	03-03386	0.5–1.0	Fill	—	—	—	—	—	—	—	4002R	—	—	4002R	—	—	—	—
0103-97-0361	03-03386	0.67–1.0	Fill	—	—	—	—	—	—	—	4002R	—	—	4002R	—	—	—	—
0103-97-0367	03-03387	0.0–0.5	Fill	—	—	—	—	—	—	—	4002R	—	—	4002R	—	—	—	—
0103-97-0366	03-03387	0.5–1.0	Fill	—	—	—	—	—	—	—	4002R	—	—	4002R	—	—	—	—
0103-97-0365	03-03387	1.0–1.5	Fill	—	—	—	—	—	—	—	4002R	—	—	4002R	—	—	—	—
0103-97-0364	03-03387	1.5–2.0	Fill	—	—	—	—	—	—	—	4002R	—	—	4002R	—	—	—	—
<b>SWMU 03-014(n)</b>																		
0103-97-0020	03-03201	0.0–1.58	Fill	—	—	—	3433R	3435R	3435R	3434R	—	3433R	3435R	3433R	3433R	—	3435R	3433R
0103-97-0021	03-03201	1.58–2.58	Qbt 4	—	—	—	3433R	3435R	3435R	3434R	—	3433R	3435R	3433R	3433R	—	3435R	3433R
0103-97-0022	03-03201	2.58–3.58	Qbt 4	—	—	—	3433R	3435R	3435R	3434R	—	3433R	3435R	3433R	3433R	—	3435R	3433R
0103-97-0023	03-03202	0.0–0.33	Fill	—	—	—	3433R	—	—	3434R	—	3433R	—	3433R	3433R	—	—	3433R
0103-97-0341	03-603357	0.0–0.5	Sludge	—	—	—	—	—	—	—	—	—	—	—	3721R	—	—	—
0103-97-0343	03-603357	0.0–0.5	Soil	—	—	—	—	—	—	—	—	—	—	—	3721R	—	—	—
0103-97-0345	03-603357	0.0–0.5	Fill	—	—	—	—	—	—	—	—	—	—	—	3721R	—	—	—
0103-97-0347	03-603357	0.0–0.5	Fill	—	—	—	—	—	—	—	—	—	—	—	3721R	—	—	—
<b>SWMU 03-014(o)</b>																		
0103-97-0024	03-03203	0.0–0.5	Fill	—	—	—	3444R	3446R	3446R	3445R	3444R	3444R	3446R	3444R	—	—	—	—



Table 2.0-1 (continued)

Sample Id	Location Id	Depth (ft)	Media	Chromium Hexavalent Ion	Gamma Spectroscopy	Gross Alpha/Beta Radiation	Herbicides	Isotopic Plutonium	Isotopic Uranium	Metals	PCBs	Pesticides	Strontium-90	SVOCs	TPH-DRO	TPH-GRO	Tritium	VOCs
0103-97-0025	03-03203	1.5–2.5	Qbt 4	—	—	—	3444R	3446R	3446R	3445R	3444R	3444R	3446R	3444R	—	—	3446R	—
0103-97-0026	03-03203	2.5000–3.5	Qbt 4	—	—	—	3444R	3446R	3446R	3445R	3444R	3444R	3446R	3444R	—	—	3446R	3444R
0103-97-0027	03-03204	0.0–0.83	Fill	—	—	—	3444R	3446R	3446R	3445R	3444R	3444R	3446R	3444R	—	—	3446R	—
0103-97-0028	03-03204	1.75–2.75	Qbt 4	—	—	—	3444R	3446R	3446R	3445R	3444R	3444R	3446R	3444R	—	—	3446R	—
0103-97-0029	03-03204	2.75–3.75	Qbt 4	—	—	—	3444R	3446R	3446R	3445R	3444R	3444R	3446R	3444R	—	—	3446R	3444R
0103-97-0030	03-03205	0.0–0.75	Fill	—	—	—	3444R	3446R	3446R	3445R	3444R	3444R	3446R	3444R	—	—	3446R	—
0103-97-0031	03-03205	1.25–2.25	Qbt 4	—	—	—	3444R	3446R	3446R	3445R	3444R	3444R	3446R	3444R	—	—	3446R	—
0103-97-0032	03-03205	2.25–3.25	Qbt 4	—	—	—	3444R	3446R	3446R	3445R	3444R	3444R	3446R	3444R	—	—	3446R	3444R
<b>AOC 03-014(v)</b>																		
RE03-99-2004	03-14227	3.0–3.5	Fill	—	—	—	—	—	—	5825R	5824R	—	—	—	5824R	5824R	—	5824R
RE03-99-2005	03-14227	4.0–4.5	Fill	—	—	—	—	—	—	5825R	5824R	—	—	—	5824R	5824R	—	5824R
<b>Consolidated Unit 03-015-00</b>																		
<b>SWMU 03-015</b>																		
AAB5813	03-02004	0.0–1.5	Sediment	—	20229	20229, 20957	—	—	—	20215	—	—	—	—	—	—	20229, 20957	—
<b>AOC C-03-016</b>																		
RE03-03-52397	03-22533	1.0–1.5	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52398	03-22533	16.0–16.5	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52402	03-22534	4.0–5.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52403	03-22534	9.5–10.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52405	03-22534	19.5–20.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
<b>SWMU 03-021</b>																		
0103-97-0241	03-03326	0.0–1.0	Soil	—	—	—	—	—	—	3429R	—	—	—	3428R	—	—	—	—
0103-97-0242	03-03327	2.0–3.0	Soil	—	—	—	—	—	—	3429R	—	—	—	3428R	—	—	—	—
0103-97-0243	03-03327	3.0–4.0	Soil	—	—	—	—	—	—	3429R	—	—	—	3428R	—	—	—	—
0103-97-0244	03-03328	3.0–4.0	Soil	—	—	—	—	—	—	3429R	—	—	—	3428R	—	—	—	3427R
0103-97-0245	03-03328	4.0–5.0	Soil	—	—	—	—	—	—	3429R	—	—	—	3428R	—	—	—	—
0103-97-0246	03-03329	2.0–3.0	Soil	—	—	—	—	—	—	3429R	—	—	—	3428R	—	—	—	—
0103-97-0247	03-03329	3.0–4.0	Soil	—	—	—	—	—	—	3429R	—	—	—	3428R	—	—	—	—
0103-97-0248	03-03330	2.75–3.75	Soil	—	—	—	—	—	—	3429R	—	—	—	3428R	—	—	—	—
0103-97-0251	03-03330	3.75–4.25	Soil	—	—	—	—	—	—	3429R	—	—	—	3428R	—	—	—	—
0103-97-0249	03-03331	3.0–4.0	Soil	—	—	—	—	—	—	3429R	—	—	—	3428R	—	—	—	—
0103-97-0250	03-03331	4.0–5.0	Soil	—	—	—	—	—	—	3429R	—	—	—	3428R	—	—	—	—

Table 2.0-1 (continued)

Sample Id	Location Id	Depth (ft)	Media	Chromium Hexavalent Ion	Gamma Spectroscopy	Gross Alpha/Beta Radiation	Herbicides	Isotopic Plutonium	Isotopic Uranium	Metals	PCBs	Pesticides	Strontium-90	SVOCs	TPH-DRO	TPH-GRO	Tritium	VOCs
<b>AOC 03-027</b>																		
RE03-99-2000	03-14225	7.0–7.5	Fill	—	—	—	—	—	—	5825R	5824R	—	—	—	5824R	5824R	—	5824R
RE03-99-2001	03-14225	7.5–8.0	Fill	—	—	—	—	—	—	5825R	5824R	—	—	—	5824R	5824R	—	5824R
RE03-99-2212	03-14225	9.0–9.5	Qbt 3	—	—	—	—	—	—	—	—	—	—	—	6108R	—	—	—
RE03-99-2002	03-14226	7.0–7.5	Fill	—	—	—	—	—	—	5825R	5824R	—	—	—	5824R	5824R	—	5824R
RE03-99-2003	03-14226	7.5–8.0	Fill	—	—	—	—	—	—	5825R	5824R	—	—	—	5824R	5824R	—	5824R
RE03-99-2006	03-14228	7.5–8.0	Fill	—	—	—	—	—	—	5825R	5824R	—	—	—	5824R	5824R	—	5824R
RE03-99-2007	03-14229	7.5–8.0	Fill	—	—	—	—	—	—	5825R	5824R	—	—	—	5824R	5824R	—	5824R
RE03-99-2213	03-14230	8.5–9.0	Qbt 3	—	—	—	—	—	—	—	—	—	—	—	6108R	—	—	—
RE03-99-2214	03-14231	8.5–9.0	Qbt 3	—	—	—	—	—	—	—	—	—	—	—	6108R	—	—	—
<b>AOC 03-036(b)</b>																		
RE03-03-52377	03-22529	11.0–11.5	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52378	03-22529	14.5–15.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52379	03-22529	19.5–20.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52382	03-22530	10.0–11.0	Soil	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52383	03-22530	14.5–15.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52384	03-22530	19.5–20.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
<b>AOC 03-052(b)</b>																		
0103-97-0163	03-03285	0.0–1.0	Soil	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0164	03-03285	2.0–3.0	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	3408R
0103-97-0165	03-03286	0.0–1.0	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0166	03-03286	1.0–2.0	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0167	03-03287	0.0–1.0	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0168	03-03287	1.0–2.0	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0169	03-03288	0.0–1.0	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0170	03-03288	1.0–2.0	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0175	03-03291	0.0–1.0	Soil	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0176	03-03291	4.0–5.0	Soil	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0177	03-03292	0.0–0.67	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
<b>SWMU 03-054(c)</b>																		
RC03-01-0029	03-14470	6.0–6.5	Fill	9516R	—	—	—	—	—	9516R	—	—	—	—	—	—	—	—
RC03-01-0031	03-14472	6.0–6.5	Fill	9516R	—	—	—	—	—	9516R	—	—	—	—	—	—	—	—
RC03-01-0032	03-14473	5.0–5.5	Fill	9516R	—	—	—	—	—	9516R	—	—	—	—	—	—	—	—
RC03-01-0033	03-14474	8.0–8.5	Fill	9516R	—	—	—	—	—	9516R	—	—	—	—	—	—	—	—
RC03-01-0034	03-14475	7.0–7.5	Soil	9516R	—	—	—	—	—	9516R	—	—	—	—	—	—	—	—

Table 2.0-1 (continued)

Sample Id	Location Id	Depth (ft)	Media	Chromium Hexavalent Ion	Gamma Spectroscopy	Gross Alpha/Beta Radiation	Herbicides	Isotopic Plutonium	Isotopic Uranium	Metals	PCBs	Pesticides	Strontium-90	SVOCs	TPH-DRO	TPH-GRO	Tritium	VOCs
RC03-01-0036	03-14477	2.0–2.5	Soil	9516R	—	—	—	—	—	9516R	—	—	—	—	—	—	—	—
RC03-01-0037	03-14478	2.0–2.5	Soil	9516R	—	—	—	—	—	9516R	—	—	—	—	—	—	—	—
RC03-01-0038	03-14479	2.0–2.5	Soil	9516R	—	—	—	—	—	9516R	—	—	—	—	—	—	—	—
RE03-04-53103	03-22683	0.0–0.5	Fill	—	—	—	—	—	—	2039S	—	—	—	—	—	—	—	—
RE03-04-53104	03-22683	1.5–2.0	Fill	—	—	—	—	—	—	2039S	—	—	—	—	—	—	—	—
RE03-04-53108	03-22684	0.0–0.5	Fill	—	—	—	—	—	—	2039S	—	—	—	—	—	—	—	—
RE03-04-53109	03-22684	1.5–2.0	Fill	—	—	—	—	—	—	2039S	—	—	—	—	—	—	—	—
RE03-04-53110	03-22685	0.0–0.5	Fill	—	—	—	—	—	—	2039S	—	—	—	—	—	—	—	—
RE03-04-53111	03-22685	1.5–2.0	Fill	—	—	—	—	—	—	2039S	—	—	—	—	—	—	—	—
<b>SWMU 03-056(a)</b>																		
RC03-01-0041	03-14481	0.5–1.0	Fill	—	—	—	—	—	—	9433R	—	—	—	—	9432R	—	—	—
RC03-01-0042	03-14482	0.5–1.0	Fill	—	—	—	—	—	—	9433R	—	—	—	—	9432R	—	—	—
RC03-01-0043	03-14483	0.5–1.0	Fill	—	—	—	—	—	—	9433R	—	—	—	—	9432R	—	—	—
RC03-01-0044	03-14484	0.5–1.0	Fill	—	—	—	—	—	—	9433R	—	—	—	—	9432R	—	—	—
RC03-01-0046	03-14485	0.0–0.5	Debris	—	—	—	—	—	—	9433R	—	—	—	—	—	—	—	—
RC03-01-0047	03-14486	0.0–0.5	Debris	—	—	—	—	—	—	9433R	—	—	—	—	—	—	—	—
RC03-01-0048	03-14487	0.0–0.5	Debris	—	—	—	—	—	—	9433R	—	—	—	—	—	—	—	—
RC03-01-0049	03-14488	0.0–0.25	Debris	—	—	—	—	—	—	9433R	—	—	—	—	—	—	—	—
<b>AOC 03-056(k)</b>																		
0103-97-0151	03-03281	0.0–0.17	Engineered Material	—	—	—	—	—	3411R	—	—	—	—	—	—	—	—	—
0103-97-0152	03-03281	0.5–1.0	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0153	03-03281	1.83–2.83	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	3408R
0103-97-0154	03-03282	0.0–0.5	Engineered Material	—	3411R	3411R	—	—	3411R	—	—	—	—	—	—	—	—	—
0103-97-0155	03-03282	0.5–1.5	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0156	03-03282	1.5–2.17	Soil	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0157	03-03283	0.0–0.25	Engineered Material	—	—	—	—	—	3411R	—	—	—	—	—	—	—	—	—
0103-97-0158	03-03283	0.33–1.25	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0160	03-03284	0.0–0.17	Engineered Material	—	—	—	—	—	3411R	—	—	—	—	—	—	—	—	—
0103-97-0161	03-03284	0.5–1.25	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0171	03-03289	0.0–1.0	Fill	—	3411R	3411R	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0172	03-03289	3.5–4.5	Soil	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0173	03-03290	0.0–1.0	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0174	03-03290	1.0–1.5	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—



Table 2.0-1 (continued)

Sample Id	Location Id	Depth (ft)	Media	Chromium Hexavalent Ion	Gamma Spectroscopy	Gross Alpha/Beta Radiation	Herbicides	Isotopic Plutonium	Isotopic Uranium	Metals	PCBs	Pesticides	Strontium-90	SVOCs	TPH-DRO	TPH-GRO	Tritium	VOCs
<b>SWMU 03-056(I)</b>																		
RE03-03-51685	03-22331	0.0–0.4921	Engineered Material	—	—	—	—	—	—	1803S	—	—	—	—	—	—	—	—
RE03-03-51686	03-22331	0.4921–2.2966	Soil	—	—	—	—	—	—	1803S	—	—	—	—	—	—	—	—
RE03-03-51687	03-22332	0.0–0.4921	Engineered Material	—	—	—	—	—	—	1803S	—	—	—	—	—	—	—	—
RE03-03-51688	03-22332	0.4921–2.2966	Soil	—	—	—	—	—	—	1803S	—	—	—	—	—	—	—	—
RE03-03-51689	03-22333	0.0–0.6562	Engineered Material	—	—	—	—	—	—	1803S	—	—	—	—	—	—	—	—
RE03-03-51690	03-22333	0.6562–1.6404	Soil	—	—	—	—	—	—	1803S	—	—	—	—	—	—	—	—
RE03-03-51692	03-22334	0.0–1.6404	Soil	—	—	—	—	—	—	1803S	—	—	—	—	—	—	—	—

\*— = Analyses not requested.

**Table 2.0-2**  
**Screening-Level Data from TA-03 Site Samples Collected and Analyses Requested**

Sample ID	Location ID	Depth (ft)	Media	Gamma Spectroscopy	Gross Alpha/Beta Radiation	Gross Gamma Radiation	Herbicides	Isotopic Plutonium	Isotopic Uranium	Metals	PCBs	Pesticides	Pesticides/PCBs	Strontium-90	Tritium	SVOCs	VOCs
<b>SWMU 03-002(c)</b>																	
AAB6034	03-02300	0.0-0.5	Fill	—*	19231	19231	18269	—	—	18460	18269	18269	—	—	19231	18269	—
AAB6037	03-02301	0.0-0.5	Fill	—	19231	19231	18269	—	—	18460	18269	18269	—	—	19231	18269	—
AAB6038	03-02302	0.0-0.5	Fill	—	19231	19231	18269	—	—	18460	18269	18269	—	—	19231	18269	18269
AAB6039	03-02303	0.0-0.5	Fill	—	19231	19231	18269	—	—	18460	18269	18269	—	—	19231	18269	—
AAB6035	03-02304	0.0-0.25	Fill	—	19231	19231	18269	—	—	18460	18269	18269	—	—	19231	18269	—
<b>Consolidated Unit 03-012(b)-00</b>																	
<b>SWMU 03-012(b)</b>																	
AAB5881	03-02118	0.0-0.5	Soil	19954	19954	21698	—	—	—	20225	18186	18186	—	—	19954	18186	18186
AAB7668	03-02118	0.0-0.5	Soil	—	20714	20714	18550	—	—	—	18550	—	—	—	20714	—	—
AAB7703	03-02118	0.0-0.5	Soil	—	20520	20520	19136	—	—	—	19136	—	—	—	20520	—	—
AAB5882	03-02119	0.0-0.5	Soil	19954	19954	21698	18186	19954	19954	20225	18186	18186	—	19954	19954	18186	18186
AAB5883	03-02120	0.0-0.5	Sediment	19954	19954	21698	18186	—	—	20225	18186	18186	—	—	19954	18186	18186
AAB5884	03-02121	0.0-0.5	Engineered Material	19954	19954	21698	—	—	—	20225	18186	18186	—	—	19954	18186	18186
AAB7669	03-02121	0.0-0.5	Sediment	—	20714	20714	18550	—	—	—	18550	—	—	—	20714	—	—
AAB7704	03-02121	0.0-0.5	Sediment	—	20520	20520	19136	—	—	—	19136	—	—	—	20520	—	—
AAB5885	03-02122	0.0-0.5	Sediment	19954	19954	21698	—	—	—	20225	18186	18186	—	—	19954	18186	18186
AAB7667	03-02122	0.0-0.5	Sediment	—	20714	20714	18550	—	—	—	18550	—	—	—	20714	—	—
AAB7702	03-02122	0.0-0.5	Sediment	—	20520	20520	19136	—	—	—	19136	—	—	—	20520	—	—
<b>Consolidated Unit 03-013(a)-00</b>																	
AAB6023	03-02600	0.0-0.33	Sediment	—	19230	19230	—	—	—	18459	18315	—	—	—	19230	18315	18315
AAB6026	03-02601	0.0-0.25	Sediment	—	19230	19230	—	—	—	18459	18315	—	—	—	19230	18315	18315
AAB6029	03-02601	0.0-0.25	Sediment	—	19230	19230	—	—	—	18459	18315	—	—	—	19230	18315	—
AAB6027	03-02602	0.0-0.5	Sediment	—	19230	19230	—	—	—	18459	18315	—	—	—	19230	18315	18315
AAB6028	03-02603	0.0-0.5	Sediment	—	19230	19230	—	—	—	18459	18315	—	—	—	19230	18315	18315
AAB6030	03-02604	0.0-0.67	Sediment	—	19230	19230	—	—	—	18459	18315	—	—	—	19230	18315	18315
<b>Consolidated Unit 03-014(a)-99</b>																	
<b>SWMU 03-014(a)</b>																	
AAB5944	03-02100	0.0-1.0	Soil	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	—	18891	18246	—
AAB5952	03-02100	1.0-1.5	Soil	—	18891	18891	—	—	—	18298	—	—	—	—	18891	—	18246

Table 2.0-2 (continued)

Sample ID	Location ID	Depth (ft)	Media	Gamma Spectroscopy	Gross Alpha/Beta Radiation	Gross Gamma Radiation	Herbicides	Isotopic Plutonium	Isotopic Uranium	Metals	PCBs	Pesticides	Pesticides/PCBs	Strontium-90	SVOCs	Tritium	VOCs
AAB5945	03-02101	0.0–1.0	Soil	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	—	18246	18891	—
AAB5953	03-02101	1.0–1.5	Soil	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
AAB5947	03-02102	0.0–1.0	Soil	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	—	18246	18891	—
AAB5954	03-02102	1.0–1.5	Soil	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
AAB5948	03-02103	0.0–1.0	Soil	19329	18891	18891	—	19329	19329	18298	—	—	—	—	—	18891	—
AAB5955	03-02103	1.0–1.5	Soil	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
AAB5949	03-02104	0.0–1.0	Soil	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	—	18246	18891	—
AAB5956	03-02104	1.0–1.5	Soil	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
<b>AOC 03-014(b2)</b>																	
AAB5930	03-02105	0.0–1.0	Soil	19954	19954	21698	18186	—	—	20225	18186	18186	—	—	18186	19954	18186
AAB5932	03-02105	0.0–1.0	Soil	—	—	—	—	—	—	20225	—	—	—	—	—	—	—
AAB5931	03-02106	0.0–1.0	Soil	19954	19954	21698	18186	—	—	20225	18186	18186	—	—	18186	19954	18186
AAB5933	03-02106	1.0–1.5	Soil	—	—	—	—	—	—	20225	—	—	—	—	—	—	—
AAB5934	03-02107	0.0–1.0	Soil	19954	19954	21698	18186	—	—	20225	18186	18186	—	—	18186	19954	—
AAB5936	03-02107	1.0–1.5	Soil	—	—	—	—	—	—	—	—	—	—	—	—	—	18186
AAB5935	03-02108	0.0–0.5	Soil	19954	19954	21698	18186	—	—	20225	18186	18186	—	—	18186	19954	—
AAB5937	03-02108	0.0–0.5	Soil	—	—	—	—	—	—	—	—	—	—	—	—	—	18186
AAB7670	03-02108	0.0–0.5	Soil	—	20714	20714	18550	—	—	—	18550	—	—	—	—	20714	—
AAB7701	03-02108	0.0–0.17	Soil	—	20520	20520	19136	—	—	—	19136	—	—	—	—	20520	—
<b>AOC 03-014(c2)</b>																	
AAB5907	03-02109	0.0–1.0	Sediment	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	19329	18246	18891	—
AAB5908	03-02110	0.0–1.0	Sediment	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	19329	18246	18891	—
AAB5909	03-02110	0.67–1	Sediment	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
AAB5910	03-02110	1.0–1.5	Sediment	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
AAB5911	03-02111	0.0–1.0	Sediment	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	19329	18246	18891	—
AAB5913	03-02111	1.0–1.5	Sediment	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
AAB5912	03-02112	0.0–1.0	Sediment	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	19329	18246	18891	—
AAB5914	03-02112	0.67–1	Sediment	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
AAB5915	03-02113	0.0–1.0	Sediment	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	19329	18246	18891	—
AAB5916	03-02113	1.0–1.5	Sediment	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
AAB5917	03-02114	0.0–1.0	Sediment	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	19329	18246	18891	—
AAB5919	03-02114	1.0–1.5	Sediment	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
AAB5918	03-02115	0.0–0.5	Sediment	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	19329	18246	18891	—



Table 2.0-2 (continued)

Sample ID	Location ID	Depth (ft)	Media	Gamma Spectroscopy	Gross Alpha/Beta Radiation	Gross Gamma Radiation	Herbicides	Isotopic Plutonium	Isotopic Uranium	Metals	PCBs	Pesticides	Pesticides/PCBs	Strontium-90	SVOCs	Tritium	VOCs
AAB5921	03-02115	0.33–0.5	Sediment	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
AAB5929	03-02115	0.33–0.5	Sediment	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
AAB5922	03-02116	0.0–0.67	Sediment	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	19329	18246	18891	—
AAB5924	03-02116	0.0–0.67	Sediment	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
AAB5923	03-02117	0.0–0.5	Sediment	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	19329	18246	18891	—
AAB5925	03-02117	0.0–0.5	Sediment	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
<b>SWMU 03-014(0)</b>																	
0103-97-0024	03-03203	0.0–0.5	Fill	—	—	—	—	—	—	3446R	—	—	—	—	—	—	—
<b>Consolidated Unit 03-015-00</b>																	
<b>SWMU 03-015</b>																	
AAB5809	03-02000	0.0–1.5	Soil	20251	20251	20864	—	20251	20251	20221	—	—	—	—	18212	20251	—
AAB5810	03-02001	0.0–1.5	Soil	20251	20251	20864	—	20251	20251	20221	—	—	—	—	18212	20251	—
AAB5811	03-02002	0.0–1.5	Soil	20251	20251	20864	—	20251	20251	20221	—	—	—	—	18212	20251	—
AAB5812	03-02003	0.0–1.5	Soil	20251	20251	20864	—	—	—	20221	—	—	—	—	18212	20251	—
AAB5813	03-02004	0.0–1.5	Sediment	—	20957	20957	—	—	—	—	—	—	—	—	18213	20957	—
<b>AOC 03-047(d)</b>																	
VCXX-95-0082	03-09008	0.0–0.5	Soil	—	—	—	—	—	—	72632	—	—	72619	—	72618	—	72580
VCXX-95-0083	03-09009	0.0–0.5	Soil	—	—	—	—	—	—	72632	—	—	72619	—	72618	—	72580
VCXX-95-0084	03-09010	0.0–0.5	Soil	—	—	—	—	—	—	72632	—	—	72619	—	72618	—	72580
<b>AOC 03-051(c)</b>																	
VCXX-95-0091	03-09012	0.0–0.5	Soil	—	—	—	—	—	—	72520	—	—	72541	—	72542	—	—
VCXX-95-0092	03-09013	0.0–0.5	Soil	—	—	—	—	—	—	72520	—	—	72541	—	72542	—	—
VCXX-95-0093	03-09014	0.0–0.5	Soil	—	—	—	—	—	—	72520	—	—	72541	—	72542	—	—
VCXX-95-0094	03-09015	0.0–0.5	Soil	—	—	—	—	—	—	72520	—	—	72541	—	72542	—	—
<b>Consolidated Unit 03-059-00</b>																	
<b>SWMU 03-059</b>																	
AAB7765	03-02700	0.0–0.83	Soil	—	20758	20758	—	—	—	—	20492	—	—	—	—	20758	—
AAB7766	03-02701	0.0–0.83	Soil	—	20758	20758	—	—	—	—	20492	—	—	—	—	20758	—
AAB7768	03-02703	0.0–0.5	Engineered Material	—	20758	20758	—	—	—	—	20492	—	—	—	—	20758	—
AAB7769	03-02704	0.0–0.5	Engineered Material	—	20758	20758	—	—	—	—	20492	—	—	—	—	20758	—
AAB7770	03-02705	0.0–0.5	Engineered Material	—	20758	20758	—	—	—	—	20492	—	—	—	—	20758	—
AAB7771	03-02706	0.0–0.5	Engineered Material	—	20758	20758	—	—	—	—	20492	—	—	—	—	20758	—
AAB7772	03-02707	0.0–0.5	Engineered Material	—	20758	20758	—	—	—	—	20492	—	—	—	—	20758	—

Table 2.0-2 (continued)

Sample ID	Location ID	Depth (ft)	Media	Gamma Spectroscopy	Gross Alpha/Beta Radiation	Gross Gamma Radiation	Herbicides	Isotopic Plutonium	Isotopic Uranium	Metals	PCBs	Pesticides	Pesticides/PCBs	Strontium-90	SVOCs	Tritium	VOCs
AAB7773	03-02708	0.0-0.5	Engineered Material	—	20758	20758	—	—	—	—	20492	—	—	—	—	20758	—
AAB7774	03-02709	0.0-0.5	Engineered Material	—	20758	20758	—	—	—	—	20492	—	—	—	—	20758	—
AAB7775	03-02710	0.0-0.5	Engineered Material	—	20758	20758	—	—	—	—	20492	—	—	—	—	20758	—
AAB7776	03-02711	0.0-0.5	Engineered Material	—	20758	20758	—	—	—	—	20492	—	—	—	—	20758	—
AAB7777	03-02712	0.0-0.5	Engineered Material	—	20758	20758	—	—	—	—	20492	—	—	—	—	20758	—

\*— = Analyses not requested.

**Table 2.0-3**  
**Summary of Inorganic Chemicals Above BVs for TA-03 Sites**

Sample ID	Location ID	Depth (ft)	Media	Aluminum	Antimony	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium	Chromium hexavalent ion	Cobalt	Copper	Iron	Lead	Magnesium	Manganese	Mercury	Nickel	Potassium	Selenium	Silver	Sodium	Thallium	Vanadium	Zinc
<b>Soil/Fill BV</b>				<b>29200</b>	<b>0.83</b>	<b>8.17</b>	<b>295</b>	<b>1.83</b>	<b>0.4</b>	<b>6120</b>	<b>19.3</b>	<b>na<sup>a</sup></b>	<b>8.64</b>	<b>14.7</b>	<b>21500</b>	<b>22.3</b>	<b>4610</b>	<b>671</b>	<b>0.1</b>	<b>15.4</b>	<b>3460</b>	<b>1.52</b>	<b>1</b>	<b>915</b>	<b>0.73</b>	<b>39.6</b>	<b>48.8</b>
<b>Sediment BV</b>				<b>15400</b>	<b>0.83</b>	<b>3.98</b>	<b>127</b>	<b>1.31</b>	<b>0.4</b>	<b>4420</b>	<b>10.5</b>	<b>na</b>	<b>4.73</b>	<b>11.2</b>	<b>13800</b>	<b>19.7</b>	<b>2370</b>	<b>543</b>	<b>0.1</b>	<b>9.38</b>	<b>2690</b>	<b>0.3</b>	<b>1</b>	<b>1470</b>	<b>0.73</b>	<b>19.7</b>	<b>60.2</b>
<b>Qbt 3/Qbt 4 BV</b>				<b>7340</b>	<b>0.5</b>	<b>2.79</b>	<b>46</b>	<b>1.21</b>	<b>1.63</b>	<b>2200</b>	<b>7.14</b>	<b>na</b>	<b>3.14</b>	<b>4.66</b>	<b>14500</b>	<b>11.2</b>	<b>1690</b>	<b>482</b>	<b>0.1</b>	<b>6.58</b>	<b>3500</b>	<b>0.3</b>	<b>1</b>	<b>2770</b>	<b>1.1</b>	<b>17</b>	<b>63.5</b>
<b>Consolidated Unit 03-009(a)-00</b>																											
<b>SWMU 03-009(a)</b>																											
RE03-03-52423	03-22538	19.5–20.0	Qbt 4	— <sup>b</sup>	—	—	—	—	—	—	—	NA <sup>c</sup>	—	—	—	—	—	—	—	—	—	0.48(J+)	—	—	—	—	—
RE03-03-52427	03-22539	4.0–5.0	Qbt 4	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	0.43(J+)	—	—	—	—	—
<b>SWMU 03-028</b>																											
RE03-03-52351	03-22523	19.0–19.5	Qbt 4	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	0.43(J-)	—	—	—	—	—
RE03-03-52352	03-22524	7.5–8.0	Qbt 4	10500	—	3.2	148	—	—	5020	—	NA	—	5.4	—	13	2460	—	—	7.7	—	0.68(J-)	—	—	—	—	—
RE03-03-52354	03-22524	19.5–20.0	Qbt 4	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	0.54(J-)	—	—	—	—	—
<b>SWMU 03-036(a)</b>																											
RE03-03-52357	03-22525	8.0–8.5	Qbt 4	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	0.67(J-)	—	—	—	—	—
<b>SWMU 03-036(c)</b>																											
RE03-03-52362	03-22526	3.0–4.0	Qbt 4	—	—	5.7	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	0.43(J-)	—	—	—	—	—
<b>SWMU 03-036(d)</b>																											
RE03-03-52368	03-22527	4.5–5.0	Qbt 4	—	—	—	—	—	—	—	—	NA	—	—	—	13.8	—	—	—	—	—	0.51(J-)	—	—	—	—	—
<b>AOC 03-043(b)</b>																											
RE03-03-52372	03-22528	9.5–10.0	Qbt 4	7480	—	4.3	67.5	—	—	—	10(J-)	NA	—	—	18400	31.7	2190	—	—	6.6	—	0.66(J-)	—	—	—	—	115
RE03-03-52374	03-22528	19.5–20.0	Qbt 4	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	0.4(J-)	—	—	—	—	—
<b>SWMU 03-045(g)</b>																											
RE03-03-52407	03-22535	0.0–0.5	Sediment	—	—	4.2	262	—	—	23400	27.5(J-)	NA	7.9	29.4	19700	—	6310	582(J)	—	17.5	2850	—	—	2190	—	32	61.1
RE03-03-52408	03-22535	1.5–2.0	Sediment	—	—	—	128	—	0.63	13700	14.4(J-)	NA	—	24.5	—	—	2700	—	—	11	—	—	—	—	—	21.6	65.1
RE03-03-52412	03-22536	0.0–0.5	Sediment	—	—	—	241	—	0.93	22100	27.7(J-)	NA	7.7	39.2	19900	27.3	5200	—	—	19.3	2870	—	—	1510	—	31.3	141
RE03-03-52413	03-22536	1.5–2.0	Sediment	—	—	—	—	—	—	66000	10.9(J-)	NA	—	—	—	—	3340	654(J)	—	11.9	—	—	—	—	—	—	—
<b>Consolidated Unit 03-012(b)-00</b>																											
RE03-02-49270	03-02-21036	0.0–0.5	Fill	—	—	—	—	—	0.688	—	157	4.22	—	26.1	—	—	—	—	0.102	—	—	—	6.45	—	—	—	98.0
RE03-02-49272	03-02-21038	0.0–0.5	Fill	—	—	—	—	—	—	—	42.9	8.94	—	20.6	—	—	—	—	—	—	—	—	1.49	—	—	—	49.9
RE03-02-49273	03-02-21039	0.0–0.5	Fill	—	—	—	—	—	—	—	—	5.23	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
RE03-02-49287	03-02-21039	0.5–1.0	Fill	—	5.57(U)	—	—	—	2.79(U)	—	—	2.06	—	—	—	—	—	—	—	—	—	—	2.79(U)	—	2.79(U)	—	—
RE03-02-49275	03-02-21041	0.0–0.5	Fill	—	—	—	—	—	—	—	—	5.61	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—



Table 2.0-3 (continued)

Sample ID	Location ID	Depth (ft)	Media	Aluminum	Antimony	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium	Chromium hexavalent ion	Cobalt	Copper	Iron	Lead	Magnesium	Manganese	Mercury	Nickel	Potassium	Selenium	Silver	Sodium	Thallium	Vanadium	Zinc	
<b>Soil/Fill BV</b>				<b>29200</b>	<b>0.83</b>	<b>8.17</b>	<b>295</b>	<b>1.83</b>	<b>0.4</b>	<b>6120</b>	<b>19.3</b>	na <sup>a</sup>	<b>8.64</b>	<b>14.7</b>	<b>21500</b>	<b>22.3</b>	<b>4610</b>	<b>671</b>	<b>0.1</b>	<b>15.4</b>	<b>3460</b>	<b>1.52</b>	<b>1</b>	<b>915</b>	<b>0.73</b>	<b>39.6</b>	<b>48.8</b>	
<b>Sediment BV</b>				<b>15400</b>	<b>0.83</b>	<b>3.98</b>	<b>127</b>	<b>1.31</b>	<b>0.4</b>	<b>4420</b>	<b>10.5</b>	na	<b>4.73</b>	<b>11.2</b>	<b>13800</b>	<b>19.7</b>	<b>2370</b>	<b>543</b>	<b>0.1</b>	<b>9.38</b>	<b>2690</b>	<b>0.3</b>	<b>1</b>	<b>1470</b>	<b>0.73</b>	<b>19.7</b>	<b>60.2</b>	
<b>Qbt 3/Qbt 4 BV</b>				<b>7340</b>	<b>0.5</b>	<b>2.79</b>	<b>46</b>	<b>1.21</b>	<b>1.63</b>	<b>2200</b>	<b>7.14</b>	na	<b>3.14</b>	<b>4.66</b>	<b>14500</b>	<b>11.2</b>	<b>1690</b>	<b>482</b>	<b>0.1</b>	<b>6.58</b>	<b>3500</b>	<b>0.3</b>	<b>1</b>	<b>2770</b>	<b>1.1</b>	<b>17</b>	<b>63.5</b>	
RE03-02-49289	03-02-21041	0.5–1.0	Fill	—	—	—	—	—	—	—	—	3.66	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
RE03-02-49277	03-02-21043	0.0–0.5	Fill	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	62
RE03-02-49291	03-02-21043	0.5–1.0	Fill	—	—	—	—	—	—	—	—	4.00	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
RE03-02-49278	03-02-21044	0.0–0.5	Fill	—	—	—	—	—	—	—	21.3	3.25	—	—	—	—	—	—	—	—	—	—	1.28	—	—	—	145	
RE03-02-49292	03-02-21044	0.5–1.0	Fill	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	73.7	
RE03-02-49279	03-02-21045	0.0–0.5	Fill	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	130	
RE03-02-49293	03-02-21045	0.5–1.0	Fill	—	—	—	—	—	—	—	22.2	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	78.8	
RE03-02-49280	03-02-21046	0.0–0.5	Fill	—	—	—	—	—	—	—	—	7.57	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-02-49294	03-02-21046	0.5–1.0	Fill	—	—	—	—	—	—	—	—	5.16	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-02-49281	03-02-21047	0.0–0.5	Fill	—	—	—	—	—	—	—	—	9.5	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-02-49296	03-02-21048	0.5–1.0	Fill	—	—	—	—	—	—	—	19.4	1.83	—	—	—	—	—	—	—	—	—	—	—	—	—	—	57.3	
RE03-02-49283	03-02-21049	0.0–0.5	Fill	—	—	—	—	—	—	—	45.8	2.31	—	—	—	—	—	—	—	—	—	—	1.63	—	—	—	52.3	
RE03-02-49297	03-02-21049	0.5–1.0	Fill	—	—	—	—	—	—	—	—	1.46	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-02-49298	03-02-21050	0.5–1.0	Fill	—	—	—	—	—	—	—	—	3.70	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-02-49300	03-02-21052	0.5–1.0	Fill	—	—	—	—	—	—	—	—	2.08	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-02-49301	03-02-21053	0.5–1.0	Fill	—	—	—	—	—	0.470	—	—	5.02	—	—	—	—	—	—	—	—	—	—	—	—	—	—	67.7	
RE03-04-52775	03-22576	0.0–0.5	Soil	—	—	—	—	—	0.524(U)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-04-52785	03-22576	3.5–4.0	Soil	—	—	—	—	—	0.547(U)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-04-52776	03-22577	0.0–0.5	Soil	—	—	—	—	—	—	—	31	0.241	—	—	—	—	—	—	—	—	—	—	1.18	—	—	—	54.5	
RE03-04-52786	03-22577	3.0–3.5	Soil	—	—	—	—	—	0.539(U)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-04-52777	03-22578	0.0–0.5	Soil	—	—	—	—	—	0.56(U)	—	25	—	—	—	—	—	—	—	—	—	—	—	1.88	—	—	—	—	
RE03-04-52778	03-22579	0.0–0.5	Soil	—	—	—	—	—	—	—	28	—	—	—	—	—	—	—	—	—	—	—	1.04	—	—	—	54.6	
RE03-04-52788	03-22579	3.5–4.0	Soil	—	—	—	—	—	0.501(U)	—	—	0.102(J)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-04-52779	03-22580	0.0–0.5	Soil	—	—	—	—	—	—	—	—	0.0952(J)	—	—	—	—	—	—	—	—	—	—	1.99	—	—	—	—	
RE03-04-52791	03-22582	1.83–2.83	Soil	—	—	—	—	—	0.545(U)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-04-52782	03-22583	0.0–0.5	Soil	—	—	—	—	—	0.514(U)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-04-52792	03-22583	3.5–4.0	Soil	—	—	—	—	—	0.532(U)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-04-52783	03-22584	0.0–0.5	Soil	—	—	—	—	—	—	—	—	0.157	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-04-52793	03-22584	3.5–4.0	Soil	—	—	—	—	—	0.491(U)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-04-52784	03-22585	0.0–0.5	Soil	—	—	—	—	—	—	—	32.5	—	—	—	—	—	—	—	—	—	—	—	2.08	—	—	—	54.2	
RE03-04-52794	03-22585	3.5–4.0	Soil	—	—	—	—	—	—	—	—	0.21	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	

Table 2.0-3 (continued)

Sample ID	Location ID	Depth (ft)	Media	Aluminum	Antimony	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium	Chromium hexavalent ion	Cobalt	Copper	Iron	Lead	Magnesium	Manganese	Mercury	Nickel	Potassium	Selenium	Silver	Sodium	Thallium	Vanadium	Zinc	
<b>Soil/Fill BV</b>				29200	0.83	8.17	295	1.83	0.4	6120	19.3	na <sup>a</sup>	8.64	14.7	21500	22.3	4610	671	0.1	15.4	3460	1.52	1	915	0.73	39.6	48.8	
<b>Sediment BV</b>				15400	0.83	3.98	127	1.31	0.4	4420	10.5	na	4.73	11.2	13800	19.7	2370	543	0.1	9.38	2690	0.3	1	1470	0.73	19.7	60.2	
<b>Qbt 3/Qbt 4 BV</b>				7340	0.5	2.79	46	1.21	1.63	2200	7.14	na	3.14	4.66	14500	11.2	1690	482	0.1	6.58	3500	0.3	1	2770	1.1	17	63.5	
<b>SWMU 03-013(i)</b>																												
RE03-05-59527	03-24444	0.0–0.5	Fill	—	—	—	—	—	0.505(J)	—	—	NA	—	—	—	38.1	—	—	—	—	—	1.7(U)	—	—	—	—	—	52.8
RE03-05-59528	03-24444	1.5–1.5	Fill	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	1.75(U)	—	—	—	—	—	—
RE03-05-59529	03-24445	0.0–0.5	Fill	—	—	—	—	—	0.797	—	—	NA	—	—	—	—	—	—	—	—	—	1.68(U)	—	—	—	—	—	
RE03-05-59530	03-24445	1.5–1.5	Fill	—	—	—	—	—	3.53	—	—	NA	—	—	—	—	—	—	—	—	—	1.81(U)	—	—	—	—	55.9	
RE03-05-59531	03-24446	0.0–0.5	Fill	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	1.76(U)	—	—	—	—	—	
RE03-05-59532	03-24446	1.5–1.5	Fill	—	—	—	—	—	0.57(U)	—	—	NA	—	—	—	—	—	—	—	—	—	1.71(U)	—	—	—	—	—	
RE03-05-59533	03-24447	0.0–0.5	Fill	—	1.71(J-)	—	—	—	5.58	—	—	NA	—	21.8(J)	—	238	—	—	—	16.3	—	1.76(U)	—	—	—	—	482	
RE03-05-59534	03-24447	1.5–1.5	Fill	—	1.55(J-)	—	—	—	2.79	—	—	NA	—	—	—	140	—	—	—	—	—	1.68(U)	—	—	—	—	196	
RE03-05-59535	03-24448	0.0–0.5	Fill	—	0.961(J-)	—	—	—	1.18	—	—	NA	—	—	—	137	—	—	—	—	—	1.66(U)	—	—	—	—	113	
RE03-05-59536	03-24448	1.5–1.5	Fill	—	—	—	—	—	—	—	—	NA	—	—	—	37.6	—	—	—	—	—	1.72(U)	—	—	—	—	56.5	
RE03-05-59537	03-24449	0.0–0.5	Fill	—	—	—	—	—	0.406(J)	—	—	NA	—	—	—	45.8	—	—	—	—	—	1.79(U)	—	—	—	—	61.7	
RE03-05-59538	03-24449	1.5–1.5	Fill	—	—	—	—	—	0.656(U)	—	—	NA	—	—	—	—	—	—	—	—	—	1.97(U)	—	—	—	—	—	
RE03-05-59539	03-24450	0.0–0.5	Fill	—	—	—	302(J+)	—	0.623	—	—	NA	—	—	—	37.1	—	—	—	—	—	—	—	—	—	—	59.1	
RE03-05-59540	03-24450	1.5–1.5	Fill	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	1.89(U)	—	—	—	—	—	
RE03-05-59541	03-24451	0.0–0.5	Fill	—	—	—	—	—	0.568(U)	—	—	NA	—	—	—	—	—	—	—	—	—	1.7(U)	—	—	—	—	—	
RE03-05-59542	03-24451	1.5–1.5	Fill	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	1.7(U)	—	—	—	—	—	
<b>Consolidated Unit 03-014(a)-99</b>																												
<b>SWMU 03-014(k)</b>																												
0103-97-0011	03-03264	0.0–1.0	Fill	—	4.7(U)	—	—	—	0.47(U)	—	—	NA	—	—	—	—	—	—	0.16	—	—	—	2.7	—	—	—	—	
0103-97-0012	03-03264	1.33–2.33	Qbt 4	—	5.4(U)	—	—	—	—	—	19.3	NA	—	—	—	—	—	—	—	8.6	—	—	—	—	—	—	154	
0103-97-0013	03-03264	2.33–3.33	Qbt 4	—	5(U)	—	—	—	—	—	24	NA	—	6.9	—	—	—	—	—	11.9	—	—	—	—	—	—	164	
<b>SWMU 03-014(l)</b>																												
0103-97-0014	03-03265	0.0–1.17	Fill	—	5(U)	—	—	—	0.5(U)	—	—	NA	—	30	—	—	—	—	0.15	—	—	—	5.7	—	—	—	—	
0103-97-0015	03-03265	1.67–2.67	Qbt 4	—	5.2(U)	—	—	—	—	—	9.7	NA	—	4.7	—	—	—	—	—	—	—	—	—	—	—	—	—	
0103-97-0016	03-03265	2.67–3.67	Qbt 4	—	5(U)	—	—	—	—	—	11.4	NA	—	—	—	—	—	—	—	8.2	—	—	—	—	—	—	—	
<b>SWMU 03-014(m)</b>																												
0103-97-0017	03-03266	0.0–0.17	Fill	—	4.6(U)	—	—	—	0.49	—	38.9	NA	—	44.8	—	29.1	—	—	0.92	—	—	—	18.3	—	—	—	76.9	
0103-97-0018	03-03266	0.75–1.75	Qbt 4	—	5.3(U)	—	—	—	—	—	13.1	NA	—	8.4	—	—	—	—	—	8.4	—	—	—	—	—	—	—	
0103-97-0019	03-03266	1.75–2.75	Qbt 4	—	5.8(U)	—	—	—	—	—	17.6	NA	—	—	—	—	—	—	—	11.1	—	—	—	—	—	—	—	

Table 2.0-3 (continued)

Sample ID	Location ID	Depth (ft)	Media	Aluminum	Antimony	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium	Chromium hexavalent ion	Cobalt	Copper	Iron	Lead	Magnesium	Manganese	Mercury	Nickel	Potassium	Selenium	Silver	Sodium	Thallium	Vanadium	Zinc	
<b>Soil/Fill BV</b>				29200	0.83	8.17	295	1.83	0.4	6120	19.3	na <sup>a</sup>	8.64	14.7	21500	22.3	4610	671	0.1	15.4	3460	1.52	1	915	0.73	39.6	48.8	
<b>Sediment BV</b>				15400	0.83	3.98	127	1.31	0.4	4420	10.5	na	4.73	11.2	13800	19.7	2370	543	0.1	9.38	2690	0.3	1	1470	0.73	19.7	60.2	
<b>Qbt 3/Qbt 4 BV</b>				7340	0.5	2.79	46	1.21	1.63	2200	7.14	na	3.14	4.66	14500	11.2	1690	482	0.1	6.58	3500	0.3	1	2770	1.1	17	63.5	
<b>SWMU 03-014(n)</b>																												
0103-97-0020	03-03201	0.0–1.58	Fill	—	—	—	—	—	—	—	—	NA	—	25.1	—	—	—	—	0.55(J-)	—	—	—	3.1	—	—	—	71.3	
0103-97-0021	03-03201	1.58–2.58	Qbt 4	—	0.75(UJ)	—	—	—	—	—	—	NA	—	11.6	—	—	—	—	0.14(J-)	—	—	0.6(U)	1.1(J)	—	—	—	—	
0103-97-0022	03-03201	2.58–3.58	Qbt 4	—	0.76(UJ)	—	—	—	—	—	8.8	NA	—	5.6(J)	—	—	—	—	—	8.7(J)	—	0.61(U)	—	—	—	—	—	
0103-97-0023	03-03202	0.0–0.33	Fill	—	8.3(J-)	—	345	—	15.5	6430	51.9	NA	—	231	—	217	—	—	0.46(J-)	30.7	—	—	1.4(J)	—	—	—	638	
<b>SWMU 03-014(o)</b>																												
0103-97-0024	03-03203	0.0–0.5	Fill	—	4.31(U)	—	—	—	0.627	—	40.6(J+)	NA	—	46.8	—	—	—	—	1.5	—	—	—	19.7	—	—	—	53.7	
0103-97-0025	03-03203	1.5–2.5	Qbt 4	—	3.82(U)	—	—	—	—	—	12.8(J+)	NA	—	5.04	—	—	—	—	—	6.7	—	—	1.34	—	—	—	—	
0103-97-0026	03-03203	2.5–3.5	Qbt 4	—	4.79(U)	—	—	—	—	—	9.88(J+)	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
0103-97-0027	03-03204	0.0–0.83	Fill	—	5.38(U)	—	—	—	0.538(U)	—	—	NA	—	18.5	—	—	—	—	0.22	—	—	—	6.48	—	—	—	—	
0103-97-0028	03-03204	1.75–2.75	Qbt 4	—	4.86(U)	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
0103-97-0029	03-03204	2.75–3.75	Qbt 4	—	5.09(U)	—	—	—	—	—	12(J+)	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
0103-97-0030	03-03205	0.0–0.75	Fill	—	4.96(U)	—	—	—	2.5	—	136(J+)	NA	—	122	—	45.1	—	—	3.8	—	—	—	71.3	—	—	—	131	
0103-97-0031	03-03205	1.25–2.25	Qbt 4	—	4.94(U)	—	—	—	—	—	25(J+)	NA	—	—	—	—	—	—	—	11.4	—	—	1.13	—	—	—	—	
0103-97-0032	03-03205	2.25–3.25	Qbt 4	—	4.62(U)	—	—	—	—	—	19.2(J+)	NA	—	—	—	—	—	—	—	10.1	—	—	—	—	—	—	—	
<b>SWMU 03-014(v)</b>																												
RE03-99-2005	03-14227	4.0–4.5	Fill	—	—	—	—	—	—	—	—	NA	9	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>Consolidated Unit 03-015-00</b>																												
<b>SWMU 03-015</b>																												
AAB5813	03-02004	0.0–1.5	Sediment	NA	—	—	181(J-)	—	—	NA	—	NA	NA	NA	NA	29.3(J-)	NA	NA	—	—	NA	0.61(UJ)	—	NA	—	NA	NA	
<b>AOC C-03-016</b>																												
RE03-03-52397	03-22533	1.0–1.5	Qbt 4	—	—	—	48	—	—	—	—	NA	—	9.5	—	31.5	—	1490	—	—	—	0.37(J-)	—	—	—	—	—	
RE03-03-52398	03-22533	16.0–16.5	Qbt 4	24800	—	3.6	156	4.2	—	9830(J)	12(J-)	NA	—	10.8	16400	26	4980	—	—	10	—	0.69(J-)	—	—	—	19.4	—	
RE03-03-52402	03-22534	4.0–5.0	Qbt 4	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	0.39(J-)	—	—	—	—	—	
RE03-03-52403	03-22534	9.5–10.0	Qbt 4	—	—	—	—	—	—	—	—	NA	—	—	—	12.6	—	—	—	—	—	0.48(J-)	—	—	—	—	—	
RE03-03-52405	03-22534	19.5–20.0	Qbt 4	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	0.38(J-)	—	—	—	—	—	
<b>SWMU 03-021</b>																												
0103-97-0241	03-03326	0.0–1.0	Soil	—	—	—	—	—	—	—	—	NA	—	22.9	—	24.7	—	—	—	24.5	—	—	—	—	2.1(J)	—	53	
0103-97-0242	03-03327	2.0–3.0	Soil	—	—	—	—	—	—	—	28.1	NA	—	—	—	84.7	—	—	—	—	—	—	—	—	2(J)	—	—	
0103-97-0243	03-03327	3.0–4.0	Soil	—	0.95(U)	—	—	—	—	—	101	NA	—	—	33200	33.7	—	—	—	—	—	—	—	—	1.3(J)	—	—	
0103-97-0244	03-03328	3.0–4.0	Soil	—	—	—	—	—	—	—	—	NA	—	—	—	29.7	—	—	—	—	—	—	—	—	—	—	—	
0103-97-0245	03-03328	4.0–5.0	Soil	—	0.86(U)	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	



Table 2.0-3 (continued)

Sample ID	Location ID	Depth (ft)	Media	Aluminum	Antimony	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium	Chromium hexavalent ion	Cobalt	Copper	Iron	Lead	Magnesium	Manganese	Mercury	Nickel	Potassium	Selenium	Silver	Sodium	Thallium	Vanadium	Zinc
<b>Soil/Fill BV</b>				29200	0.83	8.17	295	1.83	0.4	6120	19.3	na <sup>a</sup>	8.64	14.7	21500	22.3	4610	671	0.1	15.4	3460	1.52	1	915	0.73	39.6	48.8
<b>Sediment BV</b>				15400	0.83	3.98	127	1.31	0.4	4420	10.5	na	4.73	11.2	13800	19.7	2370	543	0.1	9.38	2690	0.3	1	1470	0.73	19.7	60.2
<b>Qbt 3/Qbt 4 BV</b>				7340	0.5	2.79	46	1.21	1.63	2200	7.14	na	3.14	4.66	14500	11.2	1690	482	0.1	6.58	3500	0.3	1	2770	1.1	17	63.5
0103-97-0246	03-03329	2.0–3.0	Soil	—	—	—	—	—	—	—	—	NA	—	—	—	31.4	—	—	—	—	—	—	—	—	—	—	52.5
0103-97-0247	03-03329	3.0–4.0	Soil	—	—	—	—	—	—	—	56.6	NA	11.2	—	—	358	—	—	—	—	—	—	—	—	—	—	193
0103-97-0248	03-03330	2.75–3.75	Soil	—	—	—	—	—	—	—	—	NA	—	—	—	103	—	—	—	—	—	—	—	—	—	—	—
0103-97-0251	03-03330	3.75–4.25	Soil	—	—	—	—	—	—	—	—	NA	—	—	—	67.1	—	—	—	—	—	—	—	—	—	—	49.3
0103-97-0249	03-03331	3.0–4.0	Soil	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	49.3
0103-97-0250	03-03331	4.0–5.0	Soil	—	—	—	—	—	—	—	—	NA	—	—	—	41.6	—	—	—	—	—	—	—	—	—	—	74.9
<b>AOC 03-027</b>																											
RE03-99-2001	03-14225	7.5–8.0	Fill	—	2.8(U)	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
RE03-99-2003	03-14226	7.5–8.0	Fill	—	3(U)	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
RE03-99-2006	03-14228	7.5–8.0	Fill	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	49
RE03-99-2007	03-14229	7.5–8.0	Fill	31000	3.1(U)	—	—	2.5	—	—	—	NA	—	—	22000	—	5100	—	22	—	—	—	—	1100	—	—	54
<b>AOC 03-036(b)</b>																											
RE03-03-52377	03-22529	11.0–11.5	Qbt 4	—	—	—	66.4	—	—	4500	—	NA	—	5.9	—	27.3	—	—	—	—	—	0.59(J-)	—	—	—	—	—
RE03-03-52378	03-22529	14.5–15.0	Qbt 4	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	0.35(J-)	—	—	—	—	64.5
RE03-03-52379	03-22529	19.5–20.0	Qbt 4	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	0.39(J-)	—	—	—	—	—
RE03-03-52383	03-22530	14.5–15.0	Qbt 4	—	—	—	—	—	—	—	—	NA	—	—	—	21	—	—	—	—	—	1.2(J-)	—	—	—	—	—
RE03-03-52384	03-22530	19.5–20.0	Qbt 4	—	—	—	—	1.3	—	—	—	NA	—	—	—	11.3	—	—	—	—	—	0.54(J-)	—	—	—	—	—
<b>AOC 03-052(b)</b>																											
0103-97-0163	03-03285	0.0–1.0	Soil	—	7.7(UJ)	—	—	—	0.64(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	2.2(U)	—	—	—	—
0103-97-0164	03-03285	2.0–3.0	Fill	—	7.6(UJ)	—	—	—	0.63(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	2.2(U)	—	—	—	—
0103-97-0165	03-03286	0.0–1.0	Fill	—	6.7(UJ)	—	—	—	0.55(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	1.9(U)	—	—	—	—
0103-97-0166	03-03286	1.0–2.0	Fill	—	7.2(UJ)	—	—	—	0.6(U)	—	—	NA	—	—	—	64(J-)	—	—	—	—	—	—	2.1(U)	—	—	—	—
0103-97-0167	03-03287	0.0–1.0	Fill	—	7.4(UJ)	—	—	—	0.62(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	2.2(U)	—	—	—	49.8
0103-97-0168	03-03287	1.0–2.0	Fill	—	7.1(UJ)	—	—	—	0.59(U)	—	—	NA	—	—	—	45(J-)	—	—	—	—	—	—	2.1(U)	—	—	—	—
0103-97-0169	03-03288	0.0–1.0	Fill	—	7.3(UJ)	—	—	—	0.6(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	2.1(U)	—	—	—	—
0103-97-0170	03-03288	1.0–2.0	Fill	—	7.5(UJ)	—	—	—	0.62(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	2.2(U)	—	—	—	—
0103-97-0175	03-03291	0.0–1.0	Soil	—	6.7(UJ)	—	—	—	0.55(U)	—	—	NA	21.5	—	—	—	—	—	—	—	—	—	1.9(U)	—	—	—	—
0103-97-0176	03-03291	4.0–5.0	Soil	—	7.1(UJ)	—	—	—	0.59(U)	—	—	NA	13.7	—	—	—	—	1000(J+)	—	20	—	—	2.1(U)	—	—	—	—
0103-97-0177	03-03292	0.0–0.67	Fill	—	5.9(UJ)	—	—	—	0.61(J-)	—	—	NA	—	—	—	—	—	—	—	—	—	—	1.7(U)	—	—	—	152
<b>SWMU 03-054(c)</b>																											
RC03-01-0029	03-14470	6.0–6.5	Fill	—	0.92(UJ)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
RC03-01-0031	03-14472	6.0–6.5	Fill	—	0.86(UJ)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—

Table 2.0-3 (continued)

Sample ID	Location ID	Depth (ft)	Media	Aluminum	Antimony	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium	Chromium hexavalent ion	Cobalt	Copper	Iron	Lead	Magnesium	Manganese	Mercury	Nickel	Potassium	Selenium	Silver	Sodium	Thallium	Vanadium	Zinc
<b>Soil/Fill BV</b>				29200	0.83	8.17	295	1.83	0.4	6120	19.3	na <sup>a</sup>	8.64	14.7	21500	22.3	4610	671	0.1	15.4	3460	1.52	1	915	0.73	39.6	48.8
<b>Sediment BV</b>				15400	0.83	3.98	127	1.31	0.4	4420	10.5	na	4.73	11.2	13800	19.7	2370	543	0.1	9.38	2690	0.3	1	1470	0.73	19.7	60.2
<b>Qbt 3/Qbt 4 BV</b>				7340	0.5	2.79	46	1.21	1.63	2200	7.14	na	3.14	4.66	14500	11.2	1690	482	0.1	6.58	3500	0.3	1	2770	1.1	17	63.5
RC03-01-0032	03-14473	5.0–5.5	Fill	—	0.87(UJ)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	51.9(J)
RC03-01-0033	03-14474	8.0–8.5	Fill	—	0.86(UJ)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
RC03-01-0034	03-14475	7.0–7.5	Soil	—	0.87(UJ)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
RC03-01-0036	03-14477	2.0–2.5	Soil	—	0.9(UJ)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
RC03-01-0037	03-14478	2.0–2.5	Soil	—	0.85(UJ)	—	—	—	—	10200	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
RC03-01-0038	03-14479	2.0–2.5	Soil	—	0.92(UJ)	—	—	—	—	—	—	—	—	—	—	147	—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 03-056(a)</b>																											
RC03-01-0041	03-14481	0.5–1.0	Fill	—	—	—	—	—	—	7850(J)	—	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
RC03-01-0042	03-14482	0.5–1.0	Fill	—	—	—	—	—	—	6750(J)	—	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
RC03-01-0043	03-14483	0.5–1.0	Fill	—	—	—	—	—	—	11500(J)	—	NA	—	—	—	—	—	—	—	—	—	—	1.6	—	—	—	89.8
RC03-01-0044	03-14484	0.5–1.0	Fill	—	—	—	—	—	—	10400(J)	—	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>AOC 03-056(k)</b>																											
0103-97-0152	03-03281	0.5–1.0	Fill	—	7.6(UJ)	—	—	—	0.63(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	2.2(U)	—	—	—	—
0103-97-0153	03-03281	1.83–2.83	Fill	—	7.2(UJ)	—	—	—	0.6(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	2.1(U)	—	—	—	—
0103-97-0155	03-03282	0.5–1.5	Fill	—	6.4(UJ)	—	—	—	0.53(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	1.9(U)	—	—	—	—
0103-97-0156	03-03282	1.5–2.17	Soil	—	7.5(UJ)	—	—	—	0.62(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	2.2(U)	—	—	—	—
0103-97-0158	03-03283	0.33–1.25	Fill	—	7.4(UJ)	—	—	—	0.61(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	2.2(U)	—	—	—	—
0103-97-0161	03-03284	0.5–1.25	Fill	—	7(UJ)	—	—	—	0.58(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	2(U)	—	—	—	—
0103-97-0171	03-03289	0.0–1.0	Fill	—	6.6(UJ)	—	—	—	0.55(U)	—	—	NA	—	20.1	—	24.9(J-)	—	—	—	—	—	—	1.9(U)	—	—	—	—
0103-97-0172	03-03289	3.5–4.5	Soil	—	7.4(UJ)	—	—	—	0.61(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	2.1(U)	—	—	—	—
0103-97-0173	03-03290	0.0–1.0	Fill	—	6.3(UJ)	—	—	—	0.52(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	1.8(U)	—	—	—	—
0103-97-0174	03-03290	1.0–1.5	Fill	—	6.9(UJ)	—	—	—	0.57(U)	—	—	NA	—	28.2	—	—	—	—	—	—	—	—	2(U)	—	—	—	—
<b>SWMU 03-056(l)</b>																											
RE03-03-51690	03-22333	0.65–1.64	Soil	—	—	—	—	—	—	9050	—	NA	—	29.4	—	—	—	1530	—	—	—	—	—	—	—	—	—
RE03-03-51692	03-22334	0.0–1.64	Soil	—	—	—	—	—	—	6800	—	NA	—	19.5	—	—	—	—	—	—	—	—	—	—	—	—	60.9

Note: All values in mg/kg. BVs are provided in LANL 1998, 059730.

<sup>a</sup> na = Not available.

<sup>b</sup> — = Not detected or not detected above BV.

<sup>c</sup> NA = Not analyzed.

**Table 2.0-4  
Summary of Detected VOCs for TA-03 Sites**

Sample ID	Location ID	Depth (ft)	Media	Acetone	Benzene	Butanone[2-]	Butylbenzene[n-]	Butylbenzene[sec-]	Carbon Disulfide	Isopropylbenzene	Isopropyltoluene[4-]	Methylene Chloride	Propylbenzene[1-]	Tetrachloroethene	Toluene	Trichloroethane[1,1,1-]	Trichloroethene	Trimethylbenzene[1,2,4-]	Trimethylbenzene[1,3,5-]	Xylene (Total)
<b>Consolidated Unit 03-009(a)-00</b>																				
<b>SWMU 03-009(a)</b>																				
RE03-03-52422	03-22538	14.5–15.0	Fill	— <sup>a</sup>	—	—	—	—	—	—	—	0.031	—	0.00057(J)	—	—	—	—	—	—
RE03-03-52427	03-22539	4.0–5.0	Qbt 4	—	—	—	—	—	—	—	—	0.023	—	—	—	—	—	—	—	—
RE03-03-52429	03-22539	19.5–20.0	Qbt 4	—	—	—	—	—	—	—	—	0.024	—	—	—	—	—	—	—	—
<b>SWMU 03-028</b>																				
RE03-03-52352	03-22524	7.5–8.0	Qbt 4	—	—	—	—	—	—	—	—	0.0036(J)	—	—	—	—	—	—	—	—
RE03-03-52354	03-22524	19.5–20.0	Qbt 4	0.0057(J)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 03-036(a)</b>																				
RE03-03-52357	03-22525	8.0–8.5	Qbt 4	0.0062(J)	—	—	—	—	—	—	—	—	—	0.00053(J)	—	—	—	—	—	—
<b>SWMU 03-036(c)</b>																				
RE03-03-52365	03-22526	19.5–20.0	Qbt 4	0.0051(J)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 03-036(d)</b>																				
RE03-03-52368	03-22527	4.5–5.0	Qbt 4	—	—	—	—	—	—	—	—	—	—	0.00025(J)	—	—	—	—	—	—
<b>AOC 03-043(b)</b>																				
RE03-03-52374	03-22528	19.5–20.0	Qbt 4	0.003(J)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 03-045(g)</b>																				
RE03-03-52407	03-22535	0.0–0.5	Sediment	—	—	—	—	—	—	—	—	0.013	—	—	—	—	—	—	—	—
RE03-03-52408	03-22535	1.5–2.0	Sediment	—	—	—	—	—	—	—	—	0.011	—	—	—	—	—	—	—	—
RE03-03-52412	03-22536	0.0–0.5	Sediment	—	—	—	—	—	—	—	—	0.018	—	—	—	—	—	—	—	—
RE03-03-52413	03-22536	1.5–2.0	Sediment	—	—	—	0.0018(J)	—	—	—	0.014	0.013	—	—	—	—	0.0019(J)	0.0029(J)	0.0011(J)	—
<b>SWMU 03-013(i)</b>																				
RE03-05-59528	03-24444	1.5–1.5	Fill	0.0168	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	NA <sup>b</sup>
RE03-05-59530	03-24445	1.5–1.5	Fill	0.376	—	0.0174	—	—	—	—	—	—	—	—	—	—	—	—	—	NA
RE03-05-59532	03-24446	1.5–1.5	Fill	0.0091	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	NA
RE03-05-59534	03-24447	1.5–1.5	Fill	0.0296	—	—	—	—	—	—	0.0017	—	—	—	—	—	—	—	—	NA
RE03-05-59536	03-24448	1.5–1.5	Fill	—	—	—	—	—	—	—	0.0012(J)	—	—	—	—	—	—	—	—	NA



Table 2.0-4 (continued)

Sample ID	Location ID	Depth (ft)	Media	Acetone	Benzene	Butanone[2-]	Butylbenzene[n-]	Butylbenzene[sec-]	Carbon Disulfide	Isopropylbenzene	Isopropyltoluene[4-]	Methylene Chloride	Propylbenzene[1-]	Tetrachloroethene	Toluene	Trichloroethane[1,1,1-]	Trichloroethene	Trimethylbenzene[1,2,4-]	Trimethylbenzene[1,3,5-]	Xylene (Total)
<b>Consolidated Unit 03-014(a)-99</b>																				
<b>SWMU 03-014(l)</b>																				
0103-97-0016	03-03265	2.67–3.67	Qbt 4	—	—	—	—	—	—	—	—	—	—	—	0.004(J)	—	—	—	—	—
<b>SWMU 03-014(n)</b>																				
0103-97-0021	03-03201	1.58–2.58	Qbt 4	0.042(J)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
0103-97-0023	03-03202	0.0–0.33	Fill	2.2(J)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 03-014(o)</b>																				
0103-97-0032	03-03205	2.25–3.25	Qbt 4	0.002(J)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>AOC 03-027</b>																				
RE03-99-2000	03-14225	7.0–7.5	Fill	—	—	0.0027(J)	0.00071(J)	0.00035(J)	—	—	0.00043(J)	—	0.00064(J)	—	—	—	—	0.0042(J)	0.0036(J)	0.001(J)
RE03-99-2001	03-14225	7.5–8.0	Fill	—	—	—	0.0011(J)	0.00068(J)	—	0.00021(J)	0.00076(J)	—	0.00087(J)	—	—	—	—	0.0033(J)	0.0046(J)	0.001(J)
RE03-99-2002	03-14226	7.0–7.5	Fill	—	—	—	0.0003(J)	—	—	—	—	—	—	0.00057(J)	—	—	—	0.0018(J)	0.0011(J)	—
RE03-99-2003	03-14226	7.5–8.0	Fill	—	—	—	—	—	—	—	—	—	—	—	—	—	—	0.00044(J)	—	—
<b>AOC 03-036(b)</b>																				
RE03-03-52382	03-22530	10.0–11.0	Soil	—	—	—	—	—	—	—	—	—	—	0.00075(J)	—	—	—	0.0013(J)	—	—
RE03-03-52384	03-22530	19.5–20.0	Qbt 4	0.0026(J)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>AOC 03-056(k)</b>																				
0103-97-0153	03-03281	1.83–2.83	Fill	—	—	0.006(J)	—	—	0.004(J)	—	—	—	—	—	—	—	—	—	—	—

Note: All values in mg/kg.

<sup>a</sup> — = Not detected.<sup>b</sup> NA = Not analyzed.

**Table 2.0-5  
Summary of Detected SVOCs for TA-03 Sites**

Sample ID	Location ID	Depth (ft)	Media	Acenaphthene	Acenaphthylene	Anthracene	Benzo(a)anthracene	Benzo(a)pyrene	Benzo(b)fluoranthene	Benzo(g,h,i)perylene	Benzo(k)fluoranthene	Benzoic Acid	Bis(2-ethylhexyl)phthalate	Butylbenzylphthalate	Carbazole	Chrysene	Dibenz(a,h)anthracene	Dibenzofuran	Dichlorobenzene[1,4-]	Fluoranthene	Fluorene	Indeno(1,2,3-cd)pyrene	Methylnaphthalene[2-]	Naphthalene	Phenanthrene	Pyrene	
<b>Consolidated Unit 03-009(a)-00</b>																											
<b>SWMU 03-028</b>																											
RE03-03-52348	03-22523	5.0–5.5	Soil	— <sup>a</sup>	—	—	—	—	—	—	—	0.28(J)	0.079(J)	—	NA <sup>b</sup>	—	—	—	—	—	—	—	—	—	—	—	—
RE03-03-52351	03-22523	19.0–19.5	Qbt 4	—	—	—	—	—	—	—	—	0.14(J)	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 03-036(a)</b>																											
RE03-03-52359	03-22525	19.5–20.0	Qbt 4	—	—	—	—	—	—	—	—	0.25(J)	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 03-045(g)</b>																											
RE03-03-52407	03-22535	0.0–0.5	Sediment	—	—	—	0.16(J)	0.22(J)	0.19(J)	0.2(J)	0.2(J)	—	0.73	—	NA	0.21(J)	—	—	—	0.37(J)	—	0.18(J)	—	—	0.14(J)	0.38(J)	
RE03-03-52408	03-22535	1.5–2.0	Sediment	—	—	—	—	—	—	—	—	—	0.28(J)	—	NA	—	—	—	—	0.12(J)	—	—	—	—	—	0.11(J)	
RE03-03-52412	03-22536	0.0–0.5	Sediment	—	—	—	0.12(J)	0.14(J)	0.15(J)	—	0.12(J)	—	0.77	—	NA	0.15(J)	—	—	—	0.33(J)	—	0.12(J)	—	—	0.12(J)	0.28(J)	
RE03-03-52413	03-22536	1.5–2.0	Sediment	—	—	—	0.16(J)	0.16(J)	0.15(J)	0.11(J)	0.14(J)	—	0.32(J)	—	NA	0.18(J)	—	—	—	0.42	—	0.12(J)	—	—	0.2(J)	0.34(J)	
<b>SWMU 03-013(i)</b>																											
RE03-05-59529	03-24445	0.0–0.5	Fill	—	—	—	—	—	—	—	—	0.689(J)	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	
RE03-05-59533	03-24447	0.0–0.5	Fill	0.0923	0.0421	0.095	—	—	—	—	—	0.666(J)	—	—	NA	—	—	—	—	1.32	0.0947	—	0.0275(J)	—	1.09	1.36	
RE03-05-59534	03-24447	1.5–1.5	Fill	—	—	—	—	—	—	—	—	—	1.13(J)	—	NA	—	—	—	—	0.0795	—	—	—	—	—	—	
RE03-05-59535	03-24448	0.0–0.5	Fill	—	0.0186(J)	—	—	—	—	—	—	—	—	—	NA	—	—	—	—	0.535	0.017(J)	—	0.0141(J)	—	0.468	0.477	
RE03-05-59536	03-24448	1.5–1.5	Fill	—	—	—	—	—	—	—	—	0.609(J)	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	
RE03-05-59537	03-24449	0.0–0.5	Fill	—	—	—	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	0.0393(J)	—	
RE03-05-59538	03-24449	1.5–1.5	Fill	—	—	—	—	—	—	—	—	—	1.39(J)	—	NA	—	—	—	—	—	—	—	—	—	—	—	
RE03-05-59539	03-24450	0.0–0.5	Fill	—	—	0.0266(J)	—	—	—	—	—	—	—	—	NA	—	—	—	—	0.161	0.013(J)	—	—	—	0.108	0.2	
RE03-05-59542	03-24451	1.5–1.5	Fill	—	—	—	—	—	—	—	—	—	1.19(J)	—	NA	—	—	—	—	—	—	—	—	—	—	—	
<b>Consolidated Unit 03-014(a)-99</b>																											
<b>SWMU 03-014(m)</b>																											
0103-97-0017	03-03266	0.0–0.17	Fill	2.3(J)	—	3.9	11	8.3	15	5.6	NA	—	—	—	3.2(J)	9.3	1.1(J)	1.2(J)	1.4(J)	24	2(J)	4.6	—	0.94(J)	22	32	
<b>SWMU 03-014(n)</b>																											
0103-97-0020	03-03201	0.0–1.58	Fill	—	—	—	—	—	—	—	—	—	3.1	—	NA	—	—	—	—	—	—	—	—	—	—	—	
0103-97-0021	03-03201	1.58–2.58	Qbt 4	—	—	—	—	—	—	—	—	—	0.5	—	NA	—	—	—	—	—	—	—	—	—	—	—	
0103-97-0023	03-03202	0.0–0.33	Fill	—	—	—	—	—	—	—	—	—	44	30	NA	—	—	—	—	—	—	—	—	—	—	—	

Table 2.0-5 (continued)

Sample ID	Location ID	Depth (ft)	Media	Acenaphthene	Acenaphthylene	Anthracene	Benzo(a)anthracene	Benzo(a)pyrene	Benzo(b)fluoranthene	Benzo(g,h,i)perylene	Benzo(k)fluoranthene	Benzoic Acid	Bis(2-ethylhexyl)phthalate	Butylbenzylphthalate	Carbazole	Chrysene	Dibenz(a,h)anthracene	Dibenzofuran	Dichlorobenzene[1,4-]	Fluoranthene	Fluorene	Indeno(1,2,3-cd)pyrene	Methylnaphthalene[2-]	Naphthalene	Phenanthrene	Pyrene	
<b>SWMU 03-014(o)</b>																											
0103-97-0024	03-03203	0.0-0.5	Fill	—	—	—	0.16(J)	0.22(J)	0.39	0.16(J)	0.12(J)	—	—	—	—	0.25(J)	—	—	—	0.26(J)	—	0.16(J)	—	—	0.036(J)	0.23(J)	
0103-97-0030	03-03205	0.0-0.75	Fill	—	0.036(J)	0.057(J)	0.48	0.65	1.2	0.29(J)	0.46	0.12(J)	—	—	0.037(J)	0.69	0.084(J)	—	—	0.81	—	0.31(J)	—	—	0.29(J)	0.74	
<b>AOC C-03-016</b>																											
RE03-03-52402	03-22534	4.0-5.0	Qbt 4	—	—	—	—	—	—	—	—	—	0.15(J)	—	NA	—	—	—	—	—	—	—	—	—	—	—	
RE03-03-52403	03-22534	9.5-10.0	Qbt 4	—	—	—	—	—	—	—	—	—	0.13(J)	—	NA	—	—	—	—	—	—	—	—	—	—	—	
<b>AOC 03-036(b)</b>																											
RE03-03-52377	03-22529	11.0-11.5	Qbt 4	—	—	—	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	0.61	—	0.092(J)	—	
RE03-03-52383	03-22530	14.5-15.0	Qbt 4	—	—	—	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	0.092(J)	—	—	—	

Note: All values in mg/kg.

<sup>a</sup> — = Not detected or not detected above BV.

<sup>b</sup> NA = Not analyzed.



**Table 2.0-6  
Summary of Detected PCBs, Herbicides, and TPH for TA-03 Sites**

Sample ID	Location ID	Depth (ft)	Media	PCBs		Herbicides		TPH		
				Aroclor-1254	Aroclor-1260	MCPA	MCPP	DRO	GRO	LRO
<b>SWMU 03-003(c)</b>										
RC03-01-0015	03-14457	0.33–0.5	Fill	0.054	— <sup>a</sup>	NA <sup>b</sup>	NA	NA	NA	NA
RC03-01-0016	03-14458	0.33–0.5	Fill	0.043	—	NA	NA	NA	NA	NA
<b>Consolidated Unit 03-009(a)-00</b>										
<b>SWMU 03-036(d)</b>										
RE03-03-52368	03-22527	4.5–5.0	Qbt 4	NA	NA	NA	NA	—	0.86	NA
<b>SWMU 03-045(g)</b>										
RE03-03-52413	03-22536	1.5–2.0	Sediment	NA	NA	NA	NA	—	0.95	NA
<b>Consolidated Unit 03-012(b)-00</b>										
RE03-04-52777	03-22578	0.0–0.5	Soil	0.0085(J)	0.0321(J)	NA	NA	NA	NA	NA
RE03-04-52779	03-22580	0.0–0.5	Soil	0.0213(J)	0.0711(J)	NA	NA	NA	NA	NA
RE03-04-52781	03-22582	0.83–1.33	Soil	—	0.259	NA	NA	NA	NA	NA
RE03-04-52783	03-22584	0.0–0.5	Soil	0.336	0.925	NA	NA	NA	NA	NA
<b>SWMU 03-013(i)</b>										
RE03-05-59527	03-24444	0.0–0.5	Fill	2.81	2.26	NA	NA	231	0.0156(J)	NA
RE03-05-59528	03-24444	1.5–1.5	Fill	—	—	NA	NA	134	0.0127(J-)	NA
RE03-05-59529	03-24445	0.0–0.5	Fill	—	—	NA	NA	2730	0.35(J-)	NA
RE03-05-59530	03-24445	1.5–1.5	Fill	—	—	NA	NA	3340	0.132(J-)	NA
RE03-05-59531	03-24446	0.0–0.5	Fill	0.0184(J)	—	NA	NA	398	0.0292(J)	NA
RE03-05-59532	03-24446	1.5–1.5	Fill	—	—	NA	NA	88	—	NA
RE03-05-59533	03-24447	0.0–0.5	Fill	0.193	0.0665	NA	NA	5370	—	NA
RE03-05-59534	03-24447	1.5–1.5	Fill	0.0274(J)	0.0154(J)	NA	NA	595	0.308	NA
RE03-05-59535	03-24448	0.0–0.5	Fill	0.0483(J-)	0.021(J-)	NA	NA	208	—	NA
RE03-05-59536	03-24448	1.5–1.5	Fill	0.0054(J-)	0.0039(J-)	NA	NA	270	0.338	NA
RE03-05-59537	03-24449	0.0–0.5	Fill	0.0537(J-)	0.0193(J-)	NA	NA	604	0.0192(J)	NA
RE03-05-59538	03-24449	1.5–1.5	Fill	0.0018(J)	—	NA	NA	9.3(J)	—	NA
RE03-05-59539	03-24450	0.0–0.5	Fill	0.0261	0.0082	NA	NA	92	—	NA
RE03-05-59540	03-24450	1.5–1.5	Fill	0.0209(J-)	0.0071(J-)	NA	NA	161	0.013(J-)	NA
RE03-05-59541	03-24451	0.0–0.5	Fill	0.0025(J)	0.0013(J)	NA	NA	99.9	—	NA
RE03-05-59542	03-24451	1.5–1.5	Fill	0.0024(J)	0.0014(J)	NA	NA	230	0.0292(J)	NA

Table 2.0-6 (continued)

Sample ID	Location ID	Depth (ft)	Media	PCBs		Herbicides		TPH		
				Aroclor-1254	Aroclor-1260	MCPA	MCPP	DRO	GRO	LRO
<b>Consolidated Unit 03-014(a)-99</b>										
<b>SWMU 03-014(l)</b>										
0103-97-0014	03-03265	0.0–1.17	Fill	0.078	—	—	—	NA	NA	NA
<b>SWMU 03-014(m)</b>										
0103-97-0017	03-03266	0.0–0.17	Fill	6.5	—	—	—	NA	NA	NA
0103-97-0363	03-03386	0.0–0.5	Fill	—	0.096	NA	NA	NA	NA	NA
0103-97-0362	03-03386	0.5–1.0	Fill	—	0.041	NA	NA	NA	NA	NA
0103-97-0367	03-03387	0.0–0.5	Fill	—	0.089	NA	NA	NA	NA	NA
<b>SWMU 03-014(n)</b>										
0103-97-0020	03-03201	0.0–1.58	Fill	—	—	—	—	3000	NA	NA
0103-97-0021	03-03201	1.58–2.58	Qbt 4	—	—	—	—	460	NA	NA
0103-97-0022	03-03201	2.58–3.58	Qbt 4	—	—	—	—	200	NA	NA
0103-97-0023	03-03202	0.0–0.33	Fill	—	—	—	—	31000	NA	NA
0103-97-0343	03-603357	0.0–0.5	Soil	NA	NA	NA	NA	—	NA	450
0103-97-0345	03-603357	0.0–0.5	Fill	NA	NA	NA	NA	—	NA	290
0103-97-0347	03-603357	0.0–0.5	Fill	NA	NA	NA	NA	130	NA	490
<b>SWMU 03-014(o)</b>										
0103-97-0027	03-03204	0.0–0.83	Fill	—	—	—	0.993	NA	NA	NA
0103-97-0030	03-03205	0.0–0.75	Fill	—	1.22	0.956	—	NA	NA	NA
<b>AOC 03-014(v)</b>										
RE03-99-2004	03-14227	3.0–3.5	Fill	—	—	NA	NA	31(J-)	—	NA
RE03-99-2005	03-14227	4.0–4.5	Fill	—	—	NA	NA	5.7	—	NA
<b>AOC C-03-016</b>										
RE03-03-52402	03-22534	4.0–5.0	Qbt 4	NA	NA	NA	NA	5900	390	NA
RE03-03-52403	03-22534	9.5–10.0	Qbt 4	NA	NA	NA	NA	7100	770	NA
<b>AOC 03-027</b>										
RE03-99-2000	03-14225	7.0–7.5	Fill	—	—	NA	NA	160(J-)	0.048(J)	NA
RE03-99-2001	03-14225	7.5–8.0	Fill	—	—	NA	NA	240(J-)	0.17(J-)	NA
RE03-99-2212	03-14225	9.0–9.5	Qbt 3	NA	NA	NA	NA	1.8(J)	NA	NA
RE03-99-2002	03-14226	7.0–7.5	Fill	—	—	NA	NA	14	—	NA
RE03-99-2003	03-14226	7.5–8.0	Fill	—	—	NA	NA	27(J-)	0.038(J-)	NA
RE03-99-2006	03-14228	7.5–8.0	Fill	—	—	NA	NA	5.5	—	NA
RE03-99-2213	03-14230	8.5–9.0	Qbt 3	NA	NA	NA	NA	3.6(J)	NA	NA
RE03-99-2214	03-14231	8.5–9.0	Qbt 3	NA	NA	NA	NA	3(J)	NA	NA

Table 2.0-6 (continued)

Sample ID	Location ID	Depth (ft)	Media	PCBs		Herbicides		TPH		
				Aroclor-1254	Aroclor-1260	MCPA	MCPP	DRO	GRO	LRO
<b>AOC 03-036(b)</b>										
RE03-03-52377	03-22529	11.0–11.5	Qbt 4	NA	NA	NA	NA	46	0.38	NA
RE03-03-52378	03-22529	14.5–15.0	Qbt 4	NA	NA	NA	NA	—	0.23	NA
RE03-03-52379	03-22529	19.5–20.0	Qbt 4	NA	NA	NA	NA	—	0.64	NA
RE03-03-52382	03-22530	10.0–11.0	Soil	NA	NA	NA	NA	—	0.18	NA
RE03-03-52383	03-22530	14.5–15.0	Qbt 4	NA	NA	NA	NA	51	0.47	NA
RE03-03-52384	03-22530	19.5–20.0	Qbt 4	NA	NA	NA	NA	—	0.18	NA

Note: All values in mg/kg.

<sup>a</sup> — = Not detected or not detected above BV.

<sup>b</sup> NA = Not analyzed.



**Table 2.0-7**  
**Summary of Radionuclides Detected or Detected Above BVs/FVs for TA-03 Sites**

Sample ID	Location ID	Depth (ft)	Media	Gross Alpha	Gross Beta	Plutonium-239/240	Strontium-90	Tritium	Uranium-234	Uranium-235	Uranium-238
<b>Soil/Fill BV/FV</b>				na <sup>a</sup>	na	0.054	1.31	na	2.59	0.2	2.29
<b>Qbt 4 BV/FV</b>				na	na	na	na	na	1.98	0.09	1.93
<b>Consolidated Unit 03-014(a)-99</b>											
<b>SWMU 03-014(l)</b>											
0103-97-0016	03-03265	2.67–3.67	Qbt 4	NA <sup>b</sup>	NA	— <sup>c</sup>	—	0.04	—	—	—
<b>SWMU 03-014(o)</b>											
0103-97-0024	03-03203	0.0–0.5	Fill	NA	NA	0.088	—	NA	—	—	—
0103-97-0027	03-03204	0.00–0.83	Fill	NA	NA	0.017	—	0.286	—	—	—
0103-97-0028	03-03204	1.75–2.75	Qbt 4	NA	NA	—	3.2	—	—	—	—
0103-97-0030	03-03205	0.00–0.75	Fill	NA	NA	0.131	8.01	2.906	2.68	—	—
0103-97-0031	03-03205	1.25–2.25	Qbt 4	NA	NA	0.186	—	—	—	—	—
<b>SWMU 03-056(k)</b>											
0103-97-0171	03-03289	0.0–1.0	Fill	6.1	5.9	NA	NA	NA	—	—	4.44
0103-97-0173	03-03290	0.0–1.0	Fill	NA	NA	NA	NA	NA	—	—	10.07
0103-97-0174	03-03290	1.0–1.5	Fill	NA	NA	NA	NA	NA	—	0.203	7.13

Note: All values in pCi/g. BV/FV are provided in LANL 1998, 059730.

<sup>a</sup> na = Not available.

<sup>b</sup> NA = Not analyzed.

<sup>c</sup> — = Not detected or not detected above BV/FV.

**Table 2.0-8**  
**Summary of Inorganic Chemicals Detected in Debris and Engineered Material for TA-03 Sites**

Sample ID	Location ID	Depth (ft)	Media	Aluminum	Antimony	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium	Cobalt	Copper	Iron	Lead	Magnesium	Manganese	Nickel	Potassium	Selenium	Silver	Sodium	Thallium	Vanadium	Zinc	
<b>SWMU 03-056(a)</b>																										
RC03-01-0046	03-14485	0.0–0.5	Debris	3340	—*	2.7	67.5	0.23	—	5830(J)	7.1	2.6	7.5(J)	7550	7.3	1740	139	9.8(J)	759	—	—	259	—	16.4	21.7(J)	
RC03-01-0047	03-14486	0.0–0.5	Debris	3200	—	1.7	51	0.23	—	5370(J)	7.4	2.5	8(J)	7160	5.5	1780	133	7.8	663	—	—	306	—	15.4	18.4(J)	
RC03-01-0048	03-14487	0.0–0.5	Debris	2420	0.24	1.2	43.1	0.25	0.1	6660(J)	3.8	2	4.7	6170	7	1250	126	5	839	—	0.36	121	—	12.1	56.7(J)	
RC03-01-0049	03-14488	0.0–0.25	Debris	6090	—	2	77.7	0.41	—	10900(J)	8.9	3.1	6.9(J)	10600	5.1	2760	182	6.8	1790	—	—	187	—	20.7	42.2	
<b>SWMU 03-056(l)</b>																										
RE03-03-51685	03-22331	0.0–0.4921	Engineered Material	3810	—	3.49	33.2	0.313	0.262	802	2.74	1.13	6.83	4970(J+)	8.98	441	154	4.36	470	2.92	—	911	2.82	6.26	34.4	
RE03-03-51687	03-22332	0.0–0.4921	Engineered Material	1780	—	0.911	93.5	—	0.05	9920	2.49	0.906	6.32	2870(J+)	2.08	747	135	5.38	340	0.116	—	876	—	8.31	10.4	
RE03-03-51689	03-22333	0.0–0.6562	Engineered Material	2150	—	1.62	29.8	0.263	0.08	3780	5.61	1.85	9.32	4600(J+)	4.43	1290	150	6.76	452	0.478	—	746	—	9.27	16.5	

Note: All values in mg/kg.

\* — = Not detected.

**Table 2.0-9**  
**Summary of Organic Chemicals Detected in Debris and Sludge for TA-03 Sites**

Sample ID	Location ID	Depth (ft)	Media	Aroclor-1254	LRO
<b>SWMU 03-003(c)</b>					
RC03-01-0013	03-14455	0.0–0.25	Debris	14	NA*
RC03-01-0014	03-14456	0.0–0.25	Debris	0.64	NA
<b>Consolidated Unit 03-014(a)-99</b>					
<b>SWMU 03-014(n)</b>					
0103-97-0341	03-603357	0.0–0.5	Sludge	NA	580

Note: All values in mg/kg.

\* NA = Not analyzed.

**Table 2.0-10**  
**Summary of Radionuclides Detected in Engineered Material for TA-03 Sites**

Sample ID	Location ID	Depth (ft)	Media	Cesium-134	Cesium-137	Gross alpha	Gross beta	Uranium-234	Uranium-235	Uranium-238
<b>AOC 03-056(k)</b>										
0103-97-0151	03-03281	0.0–0.17	Engineered Material	NA*	NA	NA	NA	0.801	0.076	2.91
0103-97-0154	03-03282	0.0–0.5	Engineered Material	0.101	0.22	6.1	10.8	1.39	0.144	4.71
0103-97-0157	03-03283	0.0–0.25	Engineered Material	NA	NA	NA	NA	0.607	0.071	1.59
0103-97-0160	03-03284	0.0–0.17	Engineered Material	NA	NA	NA	NA	1.07	0.092	2.01

Note: All values in pCi/g.

\* NA = Not analyzed.

**Table 2.0-11  
Summary of Inorganic Chemical Screening-Level Results for TA-03 Sites**

Sample ID	Location	Depth (ft)	Media	Aluminum	Antimony	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium	Cobalt	Copper	Cyanide (Total)	Iron	Lead	Magnesium	Manganese	Mercury	Nickel	Potassium	Selenium	Silver	Sodium	Thallium	Vanadium	Zinc	
<b>Soil/Fill BV</b>				<b>29200</b>	<b>0.83</b>	<b>8.17</b>	<b>295</b>	<b>1.83</b>	<b>0.4</b>	<b>6120</b>	<b>19.3</b>	<b>8.64</b>	<b>14.7</b>	<b>0.5</b>	<b>21500</b>	<b>22.3</b>	<b>4610</b>	<b>671</b>	<b>0.1</b>	<b>15.4</b>	<b>3460</b>	<b>1.52</b>	<b>1</b>	<b>915</b>	<b>0.73</b>	<b>39.6</b>	<b>48.8</b>	
<b>Sediment BV</b>				<b>15400</b>	<b>0.83</b>	<b>3.98</b>	<b>127</b>	<b>1.31</b>	<b>0.4</b>	<b>4420</b>	<b>10.5</b>	<b>4.73</b>	<b>11.2</b>	<b>0.82</b>	<b>13800</b>	<b>19.7</b>	<b>2370</b>	<b>543</b>	<b>0.1</b>	<b>9.38</b>	<b>2690</b>	<b>0.3</b>	<b>1</b>	<b>1470</b>	<b>0.73</b>	<b>19.7</b>	<b>60.2</b>	
<b>SWMU 03-002(c)</b>																												
AAB6034	03-02300	0.0–0.5	Fill	8440	<5.6 <sup>a</sup>	<1.4	341	<1.2	<1.1	6220	5.8	<11.7	<5.1	NA <sup>b</sup>	10100	11.2	1330	1410	<0.08	<7.9	<1130	<0.53	<0.98	<235	<0.53	21.5	25.5	
AAB6037	03-02301	0.0–0.5	Fill	7190	<5.1	<0.95	59	<0.89	<1	3750	7.4	<3.5	<5.2	NA	7890	10.4	<1150	106	<0.03	<6.3	<959	<0.49	<0.9	<189	<0.49	28.6	23.9	
AAB6038	03-02302	0.0–0.5	Fill	7090	<5.2	<1.1	96.8	<0.9	1.5	9360	6.9	<5	<6.1	NA	8060	12.5	<1060	311	0.14	<6.8	<1010	<0.49	<0.91	<509	<0.49	13.4	41.3	
AAB6039	03-02303	0.0–0.5	Fill	7740	<5.1	<0.91	72.7	<0.85	<1	5540	6.1	<7.2	10.6	NA	10900	18.4	1230	204	<0.04	<8.4	<1070	<0.49	12.5	<343	<0.49	15.3	88.8	
AAB6035	03-02304	0.0–0.25	Fill	3480	<4.5	<1.2	57.9	<0.47	<0.86	8480	13.1	<3.8	10.7	NA	8470	21.5	1750	182	<0.03	10.8	<825	<0.43	<0.8	<464	<0.43	14.4	61.6	
<b>Consolidated Unit 03-012(b)-00</b>																												
<b>SWMU 03-012(b)</b>																												
AAB5881	03-02118	0.0–0.5	Soil	NA	<0.45	<2.3	<46.9	<0.38	<0.96	NA	130	NA	NA	NA	NA	21.4	NA	NA	NA	<6.5	NA	<0.72	25.8	NA	<0.69	NA	NA	
AAB5882	03-02119	0.0–0.5	Soil	NA	<0.44	10.1	211	<0.18	5.2	NA	2080	NA	NA	NA	NA	224	NA	NA	NA	19.8	NA	<0.71	108	NA	<0.68	NA	NA	
AAB5883	03-02120	0.0–0.5	Sediment	NA	<0.45	<0.97	<28	<0.13	<0.05	NA	8.3	NA	NA	NA	NA	8.1	NA	NA	NA	<3.6	NA	<0.73	<0.08	NA	<0.7	NA	NA	
AAB5884	03-02121	0.0–0.5	Engineered Material	NA	<0.44	<1.1	<20.9	<0.1	<0.07	NA	4.4	NA	NA	NA	NA	8.3	NA	NA	NA	<2.3	NA	<0.72	<0.07	NA	<0.69	NA	NA	
AAB5885	03-02122	0.0–0.5	Sediment	NA	<0.43	<0.83	<16	<0.08	<0.24	NA	2.7	NA	NA	NA	NA	6.2	NA	NA	NA	<1.6	NA	<0.69	<0.12	NA	<0.67	NA	NA	
<b>Consolidated Unit 03-013(a)-00</b>																												
AAB6023	03-02600	0.0–0.33	Sediment	2160	<4.5	<0.43	<35.9	<0.28	<0.51	3690	9.9	<2	114	NA	3900	60.6	<776	142	<0.03	<6.8	<389	<0.57	<1.7	<106	<0.43	<5.4	94.6	
AAB6026	03-02601	0.0–0.25	Sediment	1340	<4.7	<0.45	<27.2	<0.33	<0.52	1720	2.3	<2.6	5.9	NA	4380	42.4	<759	77.5	<0.03	<3.2	<376	<0.45	<0.83	<121	<0.45	<5.2	107	
AAB6029	03-02601	0.0–0.25	Sediment	1480	<5.5	<0.53	<31.3	<0.39	<0.45	<1160	3	<2	6.7	NA	5730	13.9	<735	86.7	<0.03	<4.3	<412	<0.53	<0.97	<85.9	<0.53	<9.1	80.9	
AAB6027	03-02602	0.0–0.5	Sediment	1980	<5.5	<0.52	<40.2	<0.43	<0.58	2230	16.5	<2.1	10.1	NA	4310	14.1	<725	67.2	0.14	<4.9	<446	<0.52	<0.96	<118	<0.52	<6.1	111	
AAB6028	03-02603	0.0–0.5	Sediment	1550	<5.7	<0.54	<31.5	<0.31	<0.46	3260	3.6	<1.6	<5.2	NA	3480	15	<711	75.2	<0.03	<4.3	<438	<0.54	<1	<114	<0.54	<4.8	72.7	
AAB6030	03-02604	0.0–0.67	Sediment	2260	<4.4	<0.48	<31	<0.44	<0.58	2120	5.4	<2.5	6.7	NA	3320	49.4	<780	117	<0.03	<3.7	<472	<0.42	<0.78	<203	<0.42	<5.7	83.9	
<b>Consolidated Unit 03-014(a)-99</b>																												
<b>SWMU 03-014(a)</b>																												
AAB5944	03-02100	0.0–1.0	Soil	7310	<4.8	<1.4	70.5	<0.69	2.4	<991	30.6	<2.2	68.6	NA	9830	45.8	1170	258	0.14	<6.6	<1060	<0.45	20.2	<225	<0.45	12	94.7	
AAB5952	03-02100	1.0–1.5	Soil	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	2.2	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	
AAB5945	03-02101	0.0–1.0	Soil	7360	<4.4	3.1	136	<0.69	2.3	2480	164	<3.8	159	NA	11100	115	1170	341	0.67	<8.3	<1020	<0.42	81.2	<143	<0.42	20.1	111	
AAB5953	03-02101	1.0–1.5	Soil	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	4.9	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	
AAB5947	03-02102	0.0–1.0	Soil	11700	<4.7	3.6	169	1.3	4	2620	239	<8.4	210	NA	17400	102	1950	472	0.14	10.6	1240	<0.45	110	<425	<0.45	30.6	125	
AAB5954	03-02102	1.0–1.5	Soil	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	<0.48	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	
AAB5948	03-02103	0.0–1.0	Soil	5950	<4.6	<1.9	116	<0.76	3.4	1730	200	<2.6	220	NA	7420	76.4	1350	193	2.6	10.6	<950	<0.44	106	<180	<0.44	13.9	113	
AAB5955	03-02103	1.0–1.5	Soil	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	0.62	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	
AAB5949	03-02104	0.0–1.0	Soil	7730	<4.6	<1.8	132	<0.7	3	1590	209	<2.7	203	NA	8410	93	1170	272	0.21	<8.5	<910	<0.44	106	<259	<0.44	17.2	104	
AAB5956	03-02104	1.0–1.5	Soil	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	<0.53	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	



Table 2.0-11 (continued)

Sample ID	Location	Depth (ft)	Media	Aluminum	Antimony	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium	Cobalt	Copper	Cyanide (Total)	Iron	Lead	Magnesium	Manganese	Mercury	Nickel	Potassium	Selenium	Silver	Sodium	Thallium	Vanadium	Zinc
<b>AOO 03-014(b2)</b>																											
AAB5930	03-02105	0.0–1.0	Soil	NA	<0.43	<1.1	<22.1	<0.45	<0.05	NA	2.6	NA	NA	NA	NA	8.4	NA	NA	NA	<1.5	NA	<0.69	<0.61	NA	<0.66	NA	NA
AAB5931	03-02106	0.0–1.0	Soil	NA	<0.58	<1.6	<57.4	<0.33	<0.29	NA	86	NA	NA	NA	NA	30.5	NA	NA	NA	<4.4	NA	<0.94	42.4	NA	<0.91	NA	NA
AAB5934	03-02107	0.0–1.0	Soil	NA	<0.53	<2	<53.6	<0.51	<0.1	NA	10.8	NA	NA	NA	NA	17.7	NA	NA	NA	<2.6	NA	<0.85	5.5	NA	<0.82	NA	NA
AAB5935	03-02108	0.0–0.5	Soil	NA	<0.49	2.9	60.8	<0.41	<0.32	NA	4.1	NA	NA	NA	NA	30.2	NA	NA	NA	<2.9	NA	<0.79	<0.62	NA	<0.77	NA	NA
<b>AOO 03-014(c2)</b>																											
AAB5907	03-02109	0.0–1.0	Sediment	3330	<4.5	<0.67	<37.3	<0.52	<1.1	1860	4.2	<0.8	<5.1	NA	6440	1550	<948	242	<0.03	<1.3	<513	<0.43	<1.9	<115	<0.43	<6.8	28.2
AAB5908	03-02110	0.0–1.0	Sediment	6500	<4.5	<1.3	68.8	<0.65	<1.1	1850	5.8	<1.4	11.1	NA	8710	27	1150	191	<0.09	<2.3	1080	<0.42	<1.8	<106	<0.42	<9.7	42.7
AAB5909	03-02110	0.67–1.0	Sediment	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	<0.4	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
AAB5910	03-02110	1.0–1.5	Sediment	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	<0.4	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
AAB5911	03-02111	0.0–1.0	Sediment	5240	<4.4	<0.66	45.7	<0.78	1.4	1160	2.8	<2	<2.9	NA	9740	13.3	<1050	235	<0.03	<3.6	<860	<0.42	<0.78	<96.9	<0.42	<9	39.4
AAB5913	03-02111	1.0–1.5	Sediment	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	<0.39	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
AAB5912	03-02112	0.0–1.0	Sediment	3720	<4.5	2.3	47.4	<0.4	7.3	2600	118	<1.2	105	NA	11800	39.7	<865	179	1.3	26.5	<717	<0.43	60.2	<120	<0.43	<7.3	106
AAB5914	03-02112	0.67–1.0	Sediment	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	8.5	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
AAB5915	03-02113	0.0–1.0	Sediment	4160	<4.5	<0.66	84.2	<0.4	1.7	1940	61.4	<1.4	36.9	NA	5960	17.8	1090	194	0.26	<6.8	<779	<0.43	29.2	<194	<0.43	<8.6	52.2
AAB5916	03-02113	1.0–1.5	Sediment	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	32.1	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
AAB5917	03-02114	0.0–1.0	Sediment	5120	<4.5	<1.7	46.4	<0.62	2	1610	11.5	<1.1	16.7	NA	8570	9.7	1140	243	0.23	11.3	<923	<0.43	3	<136	<0.43	<9.7	40.2
AAB5919	03-02114	1.0–1.5	Sediment	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	<0.42	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
AAB5918	03-02115	0.0–0.5	Sediment	3680	<4.4	<0.78	89.4	<0.38	1.4	6970	67.8	<1.7	30.2	NA	6190	18.4	1120	184	0.25	<4.3	<749	<0.42	32	<124	<0.42	<8	49.2
AAB5921	03-02115	0.33–0.5	Sediment	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	14.4	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
AAB5929	03-02115	0.33–0.5	Sediment	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	13.6	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
AAB5922	03-02116	0.0–0.67	Sediment	2880	<4.3	<0.64	45.8	<0.39	<0.82	2180	30.9	<0.79	26.3	NA	4680	10.5	<702	126	0.14	<2.1	<645	<0.41	15.3	<185	<0.41	<5.2	30.7
AAB5924	03-02116	0.0–0.67	Sediment	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	7.8	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
AAB5923	03-02117	0.0–0.5	Sediment	3370	<4.6	<1.4	<38.3	<0.4	1.3	1280	74.9	<0.77	52.9	NA	5560	15.5	<588	61.6	0.5	12.6	<727	<0.44	32.6	<180	<0.44	<8.8	39.9
AAB5925	03-02117	0.0–0.5	Sediment	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	17.4	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
<b>Consolidated Unit 03-015-00</b>																											
<b>SWMU 03-015</b>																											
AAB5809	03-02000	0.0–1.5	Soil	NA	<0.83	3.7	134	<0.96	<0.75	NA	16.1	NA	NA	NA	NA	71.5	NA	NA	2.4	16.5	NA	1.2	2.7	NA	<0.64	NA	NA
AAB5810	03-02001	0.0–1.5	Soil	NA	<0.39	4.4	105	<0.74	<0.23	NA	13	NA	NA	NA	NA	22.1	NA	NA	NA	<8.4	NA	<1	<0.07	NA	<0.61	NA	NA
AAB5811	03-02002	0.0–1.5	Soil	NA	<0.4	4.2	150	<0.8	<0.07	NA	11.7	NA	NA	NA	NA	15.1	NA	NA	NA	<7.7	NA	<0.65	<0.07	NA	<0.62	NA	NA
AAB5812	03-02003	0.0–1.5	Soil	NA	<0.47	5.1	129	<0.9	<0.11	NA	10.8	NA	NA	NA	NA	20.8	NA	NA	NA	<7.6	NA	<0.64	<0.07	NA	<0.62	NA	NA
<b>AOO 03-047(d)</b>																											
VCXX-95-0082	03-09008	0.0–0.5	Soil	4690	<0.992	2.19	52.2	0.417	0.562	3240	13	2.14	18.3	NA	8430	21.7	1120	175	0.637	6.16	790	0.372	<0.992	132	<0.992	10.5	71.6
VCXX-95-0083	03-09009	0.0–0.5	Soil	4870	<0.992	2.13	38.7	0.545	<0.496	1120	4.73	1.29	5.28	NA	8660	13	915	197	0.0561	3.41	732	0.346	<0.992	231	<0.992	7.91	43.3
VCXX-95-0084	03-09010	0.0–0.5	Soil	4450	0.246	2.56	217	0.354	0.346	6040	13.2	2.87	16.9	NA	10100	391	1050	198	0.15	7.63	723	0.518	<0.995	81.4	<0.995	12.4	125

Table 2.0-11 (continued)

Sample ID	Location	Depth (ft)	Media	Aluminum	Antimony	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium	Cobalt	Copper	Cyanide (Total)	Iron	Lead	Magnesium	Manganese	Mercury	Nickel	Potassium	Selenium	Silver	Sodium	Thallium	Vanadium	Zinc
<b>AOC 03-051(c)</b>																											
VCXX-95-0091	03-09012	0.0–0.5	Soil	8810	<0.941	2.7	64.7	0.566	0.862	1070	6.27	2.52	3.73	NA	10800	18.3	1270	210	<0.0305	4.25	1020	<0.47	<0.941	115	<0.941	15.1	34.4
VCXX-95-0092	03-09013	0.0–0.5	Soil	15300	<0.953	3.71	94.8	0.874	1.34	2830	14.1	3.9	7.63	NA	16200	199	2730	444	<0.0328	7.48	1980	<0.477	<0.953	126	<0.953	26.6	305
VCXX-95-0093	03-09014	0.0–0.5	Soil	6520	<0.936	2.34	52.8	0.471	0.808	1110	4.43	2.35	3.2	NA	10100	17.9	1130	247	<0.0319	4.88	760	<0.468	<0.936	102	<2.34	10.2	42.1
VCXX-95-0094	03-09015	0.0–0.5	Soil	11800	0.319	4.04	115	0.796	1.07	1950	9.23	6.03	6.19	NA	13800	18.4	1790	442	<0.0261	6.74	1180	<0.47	<0.94	98.2	<2.35	26.2	27.5

Note: All values in mg/kg. Shaded values denote results detected above BV.

<sup>a</sup>< = Result is not detected.

<sup>b</sup>NA = Not analyzed.

Table 2.0-12  
Summary of VOC Screening-Level Results for TA-03 Sites

Sample ID	Location ID	Depth (ft)	Media	Acetone	Isopropyltoluene 4-	Methylene Chloride	Toluene
<b>Consolidated Unit 03-014(a)-99</b>							
<b>AOC 03-014(b2)</b>							
AAB5930	03-02105	0.0–1.0	Soil	<0.074 <sup>a</sup>	0.28	<0.007	0.008
<b>AOC 03-047(d)</b>							
VCXX-95-0082	03-09008	0.0–0.5	Soil	0.0134	NA <sup>b</sup>	0.00267	<0.002
VCXX-95-0083	03-09009	0.0–0.5	Soil	0.0487	NA	0.00508	<0.002
VCXX-95-0084	03-09010	0.0–0.5	Soil	0.00994	NA	0.0028	<0.002

Note: All values in mg/kg. Shaded values denote detected results.

<sup>a</sup>< = Result is not detected.

<sup>b</sup>NA = Not analyzed.

**Table 2.0-13  
Summary of SVOC Screening-Level Results for TA-03 Sites**

Sample ID	Location ID	Depth (ft)	Media Code	Acenaphthene	Anthracene	Benzo(a)anthracene	Benzo(a)pyrene	Benzo(b)fluoranthene	Benzo(g,h,i)perylene	Benzo(k)fluoranthene	Bis(2-ethylhexyl)phthalate	Chrysene	Dibenz(a,h)anthracene	Dibenzofuran	Fluoranthene	Fluorene	Indeno(1,2,3-cd)pyrene	Naphthalene	Phenanthrene	Pyrene
<b>Consolidated Unit 03-012(b)-00</b>																				
<b>SWMU 03-012(b)</b>																				
AAB5881	03-02118	0-0.5	Soil	<0.41*	<0.41	<0.41	<0.41	<0.41	<0.41	<0.41	<0.41	<0.41	<0.41	<0.41	0.41	<0.41	<0.41	<0.41	<0.41	<0.41
AAB5882	03-02119	0-0.5	Soil	<0.44	1.5	5.9	4.1	4.9	1.2	1.2	<0.44	3.5	0.5	<0.44	11	<0.44	1.6	<0.44	6.3	7.8
<b>Consolidated Unit 03-014(a)-99</b>																				
<b>AOC 03-014(b2)</b>																				
AAB5931	03-02106	0-1	Soil	<0.58	<0.58	<0.58	<0.58	<0.58	<0.58	<0.58	0.6	<0.58	<0.58	<0.58	<0.58	<0.58	<0.58	<0.58	<0.58	<0.58
<b>AOC 03-014(c2)</b>																				
AAB5912	03-02112	0-1	Sediment	<0.35	<0.35	<0.35	1.8	1.7	0.43	2	<0.35	1.8	<0.35	<0.35	3.2	<0.35	0.66	<0.35	1.3	3.2
<b>Consolidated Unit 03-015-00</b>																				
<b>SWMU 03-015</b>																				
AAB5809	03-02000	0-1.5	Soil	12	22	63	57	54	40	38	<3.8	60	14	5.6	120	10	45	7.2	88	120
AAB5810	03-02001	0-1.5	Soil	<0.36	<0.36	<0.36	<0.36	<0.36	<0.36	<0.36	<0.36	<0.36	<0.36	<0.36	0.52	<0.36	<0.36	<0.36	<0.36	0.44
<b>AOC 03-047(d)</b>																				
VCXX-95-0082	03-09008	0-0.5	Soil	<13.2	<13.2	<13.2	21.9	31.3	<13.2	<13.2	<13.2	<13.2	<13.2	<13.2	60.1	<13.2	11.6	<13.2	49.6	43
VCXX-95-0084	03-09010	0-0.5	Soil	<12.9	<12.9	<12.9	10.1	13.4	<12.9	<12.9	<12.9	9.57	<12.9	<12.9	29.1	<12.9	<12.9	<12.9	23.5	20.7

Note: All values in mg/kg. Shaded values denote detected results.

\* < = Result is not detected.



**Table 2.0-14**  
**Summary of PCB Screening-Level Results for TA-03 Sites**

Sample ID	Location ID	Depth (ft)	Media Code	Aroclor-1254	Aroclor-1260	Total PCB
<b>Consolidated Unit 03-012(b)-00</b>						
<b>SWMU 03-012(b)</b>						
AAB5881	03-02118	0-0.5	Soil	<0.21 <sup>a</sup>	6.2	NA <sup>b</sup>
AAB7668	03-02118	0-0.5	Soil	<2.2	4.5	<8.3
AAB7703	03-02118	0-0.5	Soil	<0.064	7.6	7.6
AAB5882	03-02119	0-0.5	Soil	<0.88	0.83	NA
<b>Consolidated Unit 03-013(a)-00</b>						
AAB6029	03-02601	0-0.25	Sediment	0.021	<0.0156	0.021
<b>Consolidated Unit 03-014(a)-99</b>						
<b>SWMU 03-014(a)</b>						
AAB5944	03-02100	0-1	Soil	<0.037	0.18	NA
AAB5945	03-02101	0-1	Soil	<0.035	0.73	NA
AAB5947	03-02102	0-1	Soil	<0.037	0.42	NA
AAB5949	03-02104	0-1	Soil	<0.037	0.36	NA
<b>AOC 03-014(c2)</b>						
AAB5907	03-02109	0-1	Sediment	<0.035	0.16	NA
AAB5908	03-02110	0-1	Sediment	<0.035	0.3	NA
AAB5911	03-02111	0-1	Sediment	<0.035	0.34	NA
AAB5912	03-02112	0-1	Sediment	<1.1	0.63	NA
AAB5915	03-02113	0-1	Sediment	<0.035	0.25	NA
AAB5917	03-02114	0-1	Sediment	<0.035	0.38	NA
AAB5922	03-02116	0-0.67	Sediment	<0.034	0.15	NA
AAB5923	03-02117	0-0.5	Sediment	<0.108	0.19	NA
<b>AOC 03-047(d)</b>						
VCXX-95-0083	03-09009	0-0.5	Soil	<0.0333	0.0866	NA
VCXX-95-0084	03-09010	0-0.5	Soil	<0.331	1.19	NA

Note: All values in mg/kg. Shaded values denote detected results.

<sup>a</sup> < = Result is not detected.

<sup>b</sup> NA = Not analyzed.

**Table 2.0-15**  
**Summary of Radionuclide Screening-Level Results for TA-03 Sites**

Sample ID	Location ID	Depth (ft)	Media	Americium-241	Cesium-137	Cobalt-60	Europium-152	Gross alpha	Gross beta	Plutonium-238	Plutonium-239/240	Strontium-90	Tritium	Uranium-234	Uranium-235	Uranium-238
<b>Soil BV/FV</b>				<b>0.013</b>	<b>1.65</b>	<b>na<sup>a</sup></b>	<b>na</b>	<b>na</b>	<b>na</b>	<b>0.023</b>	<b>0.054</b>	<b>1.31</b>	<b>na</b>	<b>2.59</b>	<b>0.2</b>	<b>2.29</b>
<b>Sediment BV/FV</b>				<b>0.04</b>	<b>0.9</b>	<b>na</b>	<b>na</b>	<b>na</b>	<b>na</b>	<b>0.006</b>	<b>0.068</b>	<b>1.04</b>	<b>na</b>	<b>2.59</b>	<b>0.2</b>	<b>2.29</b>
<b>Consolidated Unit 03-012(b)-00</b>																
<b>SWMU 03-012(b)</b>																
AAB5881	03-02118	0.0–0.5	Soil	<0.002 <sup>b</sup>	0.232	<0	<-0.017	4.21	2.54	NA	NA	NA	<0.0891	NA	NA	NA
AAB5882	03-02119	0.0–0.5	Soil	<0.054	0.307	<-0.037	<0.014	8	5.03	0.1	0.81	<-0.05	0.420	5.68	0.22	3.81
AAB7669	03-02121	0.0–0.5	Sediment	NA <sup>c</sup>	NA	NA	NA	<-14.67	<-34.65	NA	NA	NA	1.5	NA	NA	NA
AAB7702	03-02122	0.0–0.5	Sediment	NA	NA	NA	NA	<-7.34	<-15.07	NA	NA	NA	6.66	NA	NA	NA
<b>Consolidated Unit 03-014(a)-99</b>																
<b>SWMU 03-014(a)</b>																
AAB5944	03-02100	0.0–1.0	Soil	<0.022	<0.053	<-0.006	<0.086	<-44.02	<-42.94	0.07	0.047	<0.5	<0	1.482	0.056	1.059
AAB5945	03-02101	0.0–1.0	Soil	<0.177	<0.091	<-0.006	<0.135	<-14.67	<-24.86	0.097	0.57	<0.06	<0	2.734	0.131	1.284
AAB5947	03-02102	0.0–1.0	Soil	<0.025	0.301	<0.016	<0.075	<-44.02	<-45.95	0.178	0.113	<-0.12	<0	10.011	0.543	2.581
AAB5954	03-02102	1.0–1.5	Soil	NA	NA	NA	NA	<-44.02	<-59.51	NA	NA	NA	0.94	NA	NA	NA
AAB5948	03-02103	0.0–1.0	Soil	<0.14	0.145	<-0.022	<0.021	<29.35	<-18.83	0.135	0.164	<-0.04	<0.6	2.644	0.113	1.633
AAB5949	03-02104	0.0–1.0	Soil	0.068	0.271	<0.013	<0.147	<-29.35	<-30.88	0.144	0.074	<-0.17	<0	2.757	0.092	2.16
<b>SWMU 03-014(b2)</b>																
AAB5930	03-02105	0.0–1.0	Soil	<0.078	<0.037	<0.019	<0.111	2.7	1.73	NA	NA	NA	<0.0319	NA	NA	NA
AAB5931	03-02106	0.0–1.0	Soil	<0.025	0.904	0.07	<0.151	3.59	3.92	NA	NA	NA	<0.304	NA	NA	NA
AAB5934	03-02107	0.0–1.0	Soil	<0.028	0.797	<-0.041	<0.169	6.3	4.62	NA	NA	NA	<0.0339	NA	NA	NA
AAB5935	03-02108	0.0–0.5	Soil	<0.076	2.44	<0.005	<-0.042	7.42	9.7	NA	NA	0.66	<0.185	NA	NA	NA
<b>SWMU 03-014(c2)</b>																
AAB5907	03-02109	0.0–1.0	Sediment	<0	0.173	<0.012	<0.073	<-29.35	<-32.39	0.009	<-0.002	<0.03	<0.03	0.617	0.029	0.628
AAB5908	03-02110	0.0–1.0	Sediment	<0.104	0.101	<-0.042	<0.159	<14.67	<-18.83	0.02	<0.002	<0.37	<0	0.689	0.011	0.68
AAB5911	03-02111	0.0–1.0	Sediment	<0.023	<0.034	<0.015	0.44	<-44.02	<-35.4	<-0.002	NA	<0.07	<0	0.554	0.034	0.507
AAB5912	03-02112	0.0–1.0	Sediment	<0.045	0.235	<0.039	<0.141	<-44.02	<-26.36	0.007	0.257	<0.01	<0.44	2.41	0.104	1.117
AAB5915	03-02113	0.0–1.0	Sediment	<0.005	0.067	<-0.042	<0.07	<-44.02	<-56.49	0.002	0.065	<-0.22	1.03	1.248	0.056	0.863
AAB5917	03-02114	0.0–1.0	Sediment	<0.04	<0.041	<-0.008	<0.171	<-29.35	<-29.38	<-0.009	0.011	<-0.14	<0.87	0.899	0.032	0.689
AAB5918	03-02115	0.0–0.5	Sediment	<0.031	<0.079	<-0.002	<0.004	<-44.02	<-44.44	0.014	0.011	<-1.31	<0.54	1.095	0.059	0.869
AAB5922	03-02116	0–0.67	Sediment	<0.052	<0.038	<-0.003	0.214	<-29.35	<-44.44	0.007	0.005	<0.27	<0.47	0.759	0.032	0.768
AAB5923	03-02117	0.0–0.5	Sediment	<0.028	0.206	<-0.021	<0.146	<-44.02	<-54.99	0.016	0.029	<0	3.14	1.815	0.101	1.468

Table 2.0-15 (continued)

Sample ID	Location ID	Depth (ft)	Media	Americium-241	Cesium-137	Cobalt-60	Europium-152	Gross alpha	Gross beta	Plutonium-238	Plutonium-239/240	Strontium-90	Tritium	Uranium-234	Uranium-235	Uranium-238
<b>Soil BV/FV</b>				<b>0.013</b>	<b>1.65</b>	na <sup>a</sup>	na	na	na	<b>0.023</b>	<b>0.054</b>	<b>1.31</b>	na	<b>2.59</b>	<b>0.2</b>	<b>2.29</b>
<b>Sediment BV/FV</b>				<b>0.04</b>	<b>0.9</b>	na	na	na	na	<b>0.006</b>	<b>0.068</b>	<b>1.04</b>	na	<b>2.59</b>	<b>0.2</b>	<b>2.29</b>
<b>Consolidated Unit 03-015-00</b>																
<b>SWMU 03-015</b>																
AAB5809	03-02000	0.0–1.5	Soil	<0.042	0.191	<0.022	<0.061	23.2	15.2	<0.01	0.03	<-0.06	<0	6.31	0.31	6.29
AAB5810	03-02001	0.0–1.5	Soil	<0.072	0.068	<0.001	<0.12	<-29.35	<12.81	<0	<0.01	NA	<0	1.91	0.12	1.89
AAB5811	03-02002	0.0–1.5	Soil	<0.181	<0.026	<0.018	0.195	<-29.35	3.52	<-0.01	<0.01	NA	<0	0.95	0.07	0.99
<b>Consolidated Unit 03-059-00</b>																
<b>SWMU 03-059</b>																
AAB7771	03-02706	0.0–0.5	Engineered Material	NA	NA	NA	NA	<-7.38	<-16.01	NA	NA	NA	2.55	NA	NA	NA
AAB7774	03-02709	0.0–0.5	Engineered Material	NA	NA	NA	NA	<-7.38	<-22.42	NA	NA	NA	5.69	NA	NA	NA
AAB7777	03-02712	0.0–0.5	Engineered Material	NA	NA	NA	NA	<7.38	<30.96	NA	NA	NA	1.48	NA	NA	NA

Note: All values in pCi/g. Shaded values denote results detected above BV/FV. BV/FV are provided in LANL 1998, 059730.

<sup>a</sup> na = Not available.

<sup>b</sup> < = Result is not detected.

<sup>c</sup> NA = Not analyzed.



**Table 3.0-1**  
**Decision-Level Data from TA-60 Site Samples Collected and Analyses Requested**

Sample ID	Location ID	Depth (ft)	Media	Metals	PCBs	SVOCs	TPH	VOCs
<b>SWMU 60-002 (east and central)</b>								
RE60-03-52308	60-22517	4-4.5	Qbt 4	1884S	—	1884S	1884S	1884S
RE60-03-52307	60-22517	8.5-9	Qbt 4	1884S	—	1884S	1884S	1884S
RE60-03-52309	60-22517	14.5-15	Qbt 4	1884S	—	1884S	1884S	1884S
RE60-03-52312	60-22518	4.5-5	Soil	1884S	—	1884S	1884S	1884S
RE60-03-52314	60-22518	14.5-15	Qbt 4	1884S	—	1884S	1884S	1884S
RE60-03-52317	60-22519	4.5-5	Soil	1884S	—	1884S	1884S	1884S
RE60-03-52320	60-22519	13.5-14	Qbt 4	1884S	—	1884S	1884S	1884S
RE60-03-52322	60-22520	3-3.5	Soil	1884S	—	1884S	1884S	1884S
RE60-03-52324	60-22520	14.5-15	Qbt 4	1884S	—	1884S	1884S	1884S
RE60-03-52327	60-22521	4-4.5	Soil	1884S	—	1884S	1884S	1884S
RE60-03-52329	60-22521	14.5-15	Qbt 4	1884S	—	1884S	1884S	1884S
RE60-03-52332	60-22522	5.5-6	Qbt 4	1884S	—	1884S	1884S	1884S
RE60-03-52334	60-22522	16-17	Qbt 4	1884S	—	1884S	1884S	1884S
RE60-04-53095	60-22680	0-1	Soil	2042S	2042S	2042S	2042S	2042S
RE60-04-53096	60-22680	1.5-2	Soil	2042S	2042S	2042S	2042S	2042S
RE60-04-53098	60-22681	0-1	Soil	2042S	2042S	2042S	2042S	2042S
RE60-04-53099	60-22681	1.5-2	Soil	2042S	2042S	2042S	2042S	2042S
RE60-04-53100	60-22682	0-1	Soil	2042S	2042S	2042S	2042S	2042S
RE60-04-53101	60-22682	1.5-2	Soil	—	2042S	—	2042S	2042S
<b>SWMU 60-007(a)</b>								
AAB5794	60-01019	0-1	Fill	—	—	—	—	18086
AAB5804	60-01019	0-1	Soil	20203	18086	18086	—	—
AAB5796	60-01021	0-1	Soil	—	—	—	—	18086
AAB5799	60-01024	0-1	Soil	—	—	—	—	18086
AAB5801	60-01025	0-1	Soil	20203	18086	18086	—	18086
AAB5806	60-01026	0-1	Soil	—	18086	—	—	18086
RC60-01-0003	60-10001	0-0.5	Fill	9408R	9407R	—	9407R	—
RC60-01-0004	60-10002	0-0.5	Fill	9408R	9407R	—	9407R	—
RC60-01-0005	60-10003	0-0.5	Fill	9408R	9407R	—	9407R	—
RC60-01-0006	60-10004	0-0.5	Fill	9408R	9407R	—	9407R	—
RC60-01-0007	60-10005	0-0.25	Fill	9408R	9407R	—	9407R	—
RC60-01-0008	60-10006	0-0.5	Fill	9408R	9407R	—	9407R	—

\*— = Analyses not requested.

**Table 3.0-2  
Screening-Level Data from TA-60 Site Samples Collected and Analyses Requested**

Sample ID	Location ID	Depth (ft)	Media	Gross Alpha/Beta Radiation	Gross Gamma Radiation	Tritium	Metals	PCBs	Pesticides	SVOCs	VOCs
<b>AOC 60-004(b)</b>											
AAB5769	60-01000	0.0–1.0	Soil	18896	18896	—	18958	18084	18084	18084	—
AAB5875	60-01003	0.0–1.0	Soil	18896	18896	—	18958	18084	18084	18084	—
AAB5774	60-01005	0.0–1.0	Soil	18896	18896	—	—	—	—	—	18084
<b>AOC 60-004(f)</b>											
AAB7646	60-01322	0.0–0.5	Sediment	20713	20713	20713	19168	—	—	—	—
AAC0418	60-01322	2.0–2.5	Soil	20639	20639	20639	—	—	—	—	19731
AAC0419	60-01322	6.0–6.5	Qbt 4	20639	20639	20639	—	—	—	—	19731
AAC0417	60-01322	6.5–7.0	Qbt 4	20639	20639	20639	19990	19731	19731	19731	—
AAB7641	60-01323	0.0–1.5	Sediment	20713	20713	20713	—	—	—	—	—
AAB7635	60-01324	0.0–1.5	Sediment	20713	20713	20713	19168	—	—	—	—
AAB7647	60-01325	1.0–1.5	Soil	20713	20713	20713	—	—	—	—	—
AAB7726	60-01330	1.0–2.0	Soil	20527	20527	20527	19866	19137	—	19137	—
AAC0406	60-01330	2.0–2.5	Soil	20639	20639	20639	—	—	—	—	19731
AAC0407	60-01330	5.5–6.0	Qbt 4	20639	20639	20639	—	—	—	—	19731
AAC0405	60-01330	6.0–6.5	Qbt 4	20639	20639	20639	19990	19731	19731	19731	—
AAB7727	60-01331	1.0–2.0	Soil	20527	20527	20527	19866	19137	—	19137	—
AAC0412	60-01331	2.0–2.5	Soil	20639	20639	20639	—	—	—	—	19731
AAC0413	60-01331	5.0–5.5	Qbt 4	20639	20639	20639	—	—	—	—	19731
AAC0411	60-01331	5.5–6.0	Qbt 4	20639	20639	20639	19990	19731	19731	19731	—
AAB7728	60-01332	1.0–2.0	Soil	20527	20527	20527	19866	19137	—	19137	—
AAC0415	60-01332	2.0–2.5	Soil	20639	20639	20639	—	—	—	—	19731
AAC0416	60-01332	5.0–5.5	Qbt 4	20639	20639	20639	—	—	—	—	19731
AAC0414	60-01332	5.5–6.0	Qbt 4	20639	20639	20639	19990	19731	19731	19731	—
AAB7729	60-01333	1.0–2.0	Soil	20527	20527	20527	19866	19137	—	19137	—
AAB7730	60-01334	1.0–2.0	Soil	20527	20527	20527	19866	19137	—	19137	—
AAC0409	60-01335	2.0–2.5	Soil	20639	20639	20639	—	—	—	—	19731
AAC0410	60-01335	5.0–5.5	Qbt 4	20639	20639	20639	—	—	—	—	19731
AAC0408	60-01335	5.5–6.0	Qbt 4	20639	20639	20639	19990	19731	19731	19731	—
<b>SWMU 60-006(a)</b>											
AAB5817	60-01100	1.0–2.0	Sludge	18896	18896	18896	18958	—	—	18084	—
AAB5818	60-01100	1.0–2.0	Sludge	18896	18896	18896	18958	—	—	18084	—

Table 3.0-2 (continued)

Sample ID	Location ID	Depth (ft)	Media	Gross Alpha/Beta	Gross Gamma	Tritium	Metals	PCBs	Pesticides	SVOCs	VOCs
<b>SWMU 60-007(a)</b>											
AAB5794	60-01019	0.0-1.0	Fill	20952	20952	—	—	—	—	—	—
AAB5804	60-01019	0.0-1.0	Soil	20952	20952	—	—	—	—	—	—
AAB5796	60-01021	0.0-1.0	Soil	20952	20952	—	—	—	—	—	—
AAB5801	60-01025	0.0-1.0	Soil	20952	20952	—	—	—	—	—	—
AAB5806	60-01026	0.0-1.0	Soil	20952	20952	—	—	—	—	—	—
<b>SWMU 60-007(b)</b>											
AAB7639	60-01309	0.0-1.0	Sediment	20713	20713	20713	19168	—	—	—	—
AAB7708	60-01309	0.0-1.0	Sediment	20520	20520	20520	—	19136	—	19136	—
AAB7636	60-01313	0.0-1.5	Soil	20713	20713	20713	—	—	—	—	—
AAB7705	60-01313	0.0-1.5	Soil	20520	20520	20520	—	—	—	—	19136
AAB7643	60-01315	0.0-0.5	Sediment	21950	21950	21950	—	—	—	—	—
AAB7706	60-01315	0.0-0.5	Sediment	20520	20520	20520	—	—	—	—	19136
AAB7648	60-01316	0.0-0.5	Sediment	20713	20713	20713	19168	—	—	—	—
AAB7707	60-01316	0.0-1.0	Sediment	20520	20520	20520	—	19136	—	19136	—

\*— = Analyses not requested.



**Table 3.0-3**  
**Summary of Inorganic Chemicals Detected Above BVs for TA-60 Sites**

Sample ID	Location ID	Depth (ft)	Media	Aluminum	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium	Cobalt	Copper	Iron	Lead	Magnesium	Manganese	Nickel	Selenium	Thallium	Vanadium	Zinc
<b>Soil/Fill BV</b>				<b>29200</b>	<b>8.17</b>	<b>295</b>	<b>1.83</b>	<b>0.4</b>	<b>6120</b>	<b>19.3</b>	<b>8.64</b>	<b>14.7</b>	<b>21500</b>	<b>22.3</b>	<b>4610</b>	<b>671</b>	<b>15.4</b>	<b>1.52</b>	<b>0.73</b>	<b>39.6</b>	<b>48.8</b>
<b>Sediment BV</b>				<b>15400</b>	<b>3.98</b>	<b>127</b>	<b>1.31</b>	<b>0.4</b>	<b>4420</b>	<b>10.5</b>	<b>4.73</b>	<b>11.2</b>	<b>13800</b>	<b>19.7</b>	<b>2370</b>	<b>543</b>	<b>9.38</b>	<b>0.3</b>	<b>0.73</b>	<b>19.7</b>	<b>60.2</b>
<b>Qbt 4 BV</b>				<b>7340</b>	<b>2.79</b>	<b>46</b>	<b>1.21</b>	<b>1.63</b>	<b>2200</b>	<b>7.14</b>	<b>3.14</b>	<b>4.66</b>	<b>14500</b>	<b>11.2</b>	<b>1690</b>	<b>482</b>	<b>6.58</b>	<b>0.3</b>	<b>1.1</b>	<b>17</b>	<b>63.5</b>
<b>SWMU 60-002 (east)</b>																					
RE60-03-52308	60-22517	4.0–4.5	Qbt 4	15350	3.52	52.5	— <sup>a</sup>	—	2440	8.2	3.83	—	17600	—	2540	—	7.73	0.579	—	18.4	—
RE60-03-52307	60-22517	8.5–9.0	Qbt 4	—	—	—	—	—	—	—	—	—	—	—	—	539	—	0.54(U)	—	—	—
RE60-03-52309	60-22517	14.5–15.0	Qbt 4	—	—	—	—	—	—	—	—	—	—	—	—	—	—	0.516(U)	—	—	—
RE60-03-52312	60-22518	4.5–5.0	Soil	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	74.8
RE60-03-52314	60-22518	14.5–15.0	Qbt 4	—	—	—	—	—	—	—	—	—	—	—	—	—	—	0.48(U)	—	—	—
RE60-03-52317	60-22519	4.50–5.00	Soil	—	—	310	—	0.539(U)	8050	—	—	—	—	—	—	—	—	—	—	—	—
RE60-03-52320	60-22519	13.5–14.0	Qbt 4	23720	3.97	108	1.69	—	3470	10.1	—	7.99	15200	15	3520	—	13.2	0.583(U)	—	20.1	—
RE60-03-52322	60-22520	3.0-3.5	Soil	—	—	—	—	0.55(U)	8230	—	10	—	—	—	—	—	16	—	—	—	—
RE60-03-52324	60-22520	14.5–15.0	Qbt 4	—	—	—	—	—	—	—	—	—	—	—	—	—	—	0.489(U)	—	—	—
RE60-03-52327	60-22521	4.0–4.5	Soil	—	—	—	—	0.533(U)	—	—	—	—	—	—	—	—	17.1	—	—	—	—
RE60-03-52332	60-22522	5.5–6.0	Qbt 4	15520	3.45	375	—	—	2720	8.23	—	—	—	—	2390	—	—	0.542(U)	—	18.3	—
RE60-03-52334	60-22522	16.0–17.0	Qbt 4	9900	—	—	—	—	—	—	—	—	—	12.4	—	—	8.72	0.565(U)	—	—	—
<b>SWMU 60-002 (central)</b>																					
RE60-04-53096	60-22680	1.5–2.0	Soil	—	—	—	—	—	—	—	—	—	—	—	—	726	—	—	—	—	—
<b>SWMU 60-007(a)</b>																					
AAB5801	60-01025	0.0–1.0	Soil	NA <sup>b</sup>	—	331(J-)	—	—	NA	—	NA	NA	NA	—	NA	NA	—	—	—	NA	NA
RC60-01-0003	60-10001	0.0–0.5	Fill	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	0.75	—	—

Note: All values in mg/kg. BVs are provided in LANL 1998, 059730.

<sup>a</sup> — = Not detected or not detected above BV.

<sup>b</sup> NA = Not analyzed.

**Table 3.0-4  
Summary of Detected Organic Chemicals for TA-60 Sites**

Sample ID	Location ID	Depth (ft)	Media	VOCs			SVOCs				PCBs		TPH		
				Acetone	Hexanone[2-]	Toluene	Acenaphthene	Fluoranthene	Fluorene	Pyrene	Aroclor-1254	Aroclor-1260	DRO	GRO	LRO
<b>SWMU 60-002 (ast)</b>															
RE60-03-52308	60-22517	4.0–4.5	Qbt 4	0.0062(J)	—	—	—	—	—	—	NA	NA	3.9	—	NA
RE60-03-52307	60-22517	8.5–9.0	Qbt 4	0.0044(J)	—	—	—	—	—	—	NA	NA	5.1	—	NA
RE60-03-52309	60-22517	14.5–15.0	Qbt 4	—	—	—	—	—	—	—	NA	NA	1.1(J)	—	NA
RE60-03-52312	60-22518	4.5–5.0	Soil	—	—	—	—	0.0357(J)	0.0056(J)	0.0443	NA	NA	12.9	—	NA
RE60-03-52314	60-22518	14.5–15.0	Qbt 4	0.0042(J)	—	—	—	—	—	—	NA	NA	2.2	—	NA
RE60-03-52317	60-22519	4.50–5.00	Soil	—	—	—	—	—	—	—	NA	NA	1.1(J)	—	NA
RE60-03-52320	60-22519	13.5–14.0	Qbt 4	0.0118(J)	0.0088	—	—	—	—	—	NA	NA	3	—	NA
RE60-03-52322	60-22520	3.0–3.5	Soil	—	—	—	—	—	—	—	NA	NA	1.8(J)	—	NA
RE60-03-52327	60-22521	4.0–4.5	Soil	—	—	—	—	—	—	—	NA	NA	1.1(J)	—	NA
RE60-03-52329	60-22521	14.5–15.0	Qbt 4	0.0042(J)	—	—	—	—	—	—	NA	NA	11.3	—	NA
RE60-03-52332	60-22522	5.5–6.0	Qbt 4	—	—	—	—	—	—	—	NA	NA	2.6	—	NA
RE60-03-52334	60-22522	16.0–17.0	Qbt 4	—	—	—	—	—	—	—	NA	NA	2.6	—	NA
<b>SWMU 60-002 (central)</b>															
RE60-04-53095	60-22680	0.0–1.0	Soil	—	—	—	0.0244(J)	—	—	—	—	—	—	—	NA
RE60-04-53096	60-22680	1.5–2.0	Soil	—	—	—	—	—	—	—	—	0.0042(J)	—	—	NA
RE60-04-53099	60-22681	1.5–2.0	Soil	—	—	—	—	—	—	—	—	—	—	0.0344(J)	NA
RE60-04-53100	60-22682	0.0–1.0	Soil	—	—	—	0.0198(J)	—	—	—	0.0202	0.0162	—	—	NA
RE60-04-53101	60-22682	1.5–2.0	Soil	—	—	—	NA	NA	NA	NA	0.0025(J)	—	NA	0.173	NA
<b>SWMU 60-007(a)</b>															
AAB5799	60-01024	0.0–1.0	Soil	—	—	0.001(J)	NA	NA	NA	NA	NA	NA	NA	NA	NA
RC60-01-0003	60-10001	0.0–0.5	Fill	NA	NA	NA	NA	NA	NA	NA	—	—	—	NA	130
RC60-01-0006	60-10004	0.0–0.5	Fill	NA	NA	NA	NA	NA	NA	NA	—	—	1100	NA	—
RC60-01-0007	60-10005	0.0–0.25	Fill	NA	NA	NA	NA	NA	NA	NA	—	—	350	NA	160
RC60-01-0008	60-10006	0.0–0.5	Fill	NA	NA	NA	NA	NA	NA	NA	—	—	—	NA	41

Note: All values in mg/kg.

<sup>a</sup> — = Not detected.<sup>b</sup> NA = Not analyzed.

**Table 3.0-5  
Summary of Inorganic Chemical Screening-Level Results for TA-60 Sites**

Sample ID	Location ID	Depth (ft)	Media Code	Aluminum	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium	Cobalt	Copper	Iron	Lead	Magnesium	Manganese	Mercury	Nickel	Potassium	Selenium	Silver	Sodium	Vanadium	Zinc
<b>Soil BV</b>				<b>29200</b>	<b>8.17</b>	<b>295</b>	<b>1.83</b>	<b>0.4</b>	<b>6120</b>	<b>19.3</b>	<b>8.64</b>	<b>14.7</b>	<b>21500</b>	<b>22.3</b>	<b>4610</b>	<b>671</b>	<b>0.1</b>	<b>15.4</b>	<b>3460</b>	<b>1.52</b>	<b>1</b>	<b>915</b>	<b>39.6</b>	<b>48.8</b>
<b>Sediment BV</b>				<b>15400</b>	<b>3.98</b>	<b>127</b>	<b>1.31</b>	<b>0.4</b>	<b>4420</b>	<b>10.5</b>	<b>4.73</b>	<b>11.2</b>	<b>13800</b>	<b>19.7</b>	<b>2370</b>	<b>543</b>	<b>0.1</b>	<b>9.38</b>	<b>2690</b>	<b>0.3</b>	<b>1</b>	<b>1470</b>	<b>19.7</b>	<b>60.2</b>
<b>Qbt 4 BV</b>				<b>7340</b>	<b>2.79</b>	<b>46</b>	<b>1.21</b>	<b>1.63</b>	<b>2200</b>	<b>7.14</b>	<b>3.14</b>	<b>4.66</b>	<b>14500</b>	<b>11.2</b>	<b>1690</b>	<b>482</b>	<b>0.1</b>	<b>6.58</b>	<b>3500</b>	<b>0.3</b>	<b>1</b>	<b>2770</b>	<b>17</b>	<b>63.5</b>
<b>AOC 60-004(b)</b>																								
AAB5769	60-01000	0.0–1.0	Soil	3270	<1.1 <sup>a</sup>	95.4	<0.43	<0.56	1880	5.3	<3.2	6.6	8180	7.9	1120	225	0.17	<6.4	<607	<0.34	<0.43	<192	12.6	27.7
AAB5875	60-01003	0.0–1.0	Soil	2700	<0.45	66	<0.36	<0.56	1180	4.5	<2.1	<4.3	7450	19.4	<885	243	<0.06	<4.7	<563	<0.34	<0.43	<154	<8.3	43.5
<b>AOC 60-004(f)</b>																								
AAB7646	60-01322	0.0–0.5	Sediment	7250	3.4	149	<0.7	<0.5	2460	8.9	<4.1	16.6	9870	13	1700	252	<0.06	<5.3	1220	<0.54	<0.8	<205	16.9	85.7
AAC0417	60-01322	6.5–7.0	Qbt 4	11200	<2.1	64.2	<0.78	<0.07	2050	7.4	<3.9	<3.4	12700	18.6	2180	NA <sup>b</sup>	<0.11	<8.7	1510	<1	<0.61	<76	12.8	50.2
AAB7635	60-01324	0.0–1.5	Sediment	6600	5.9	147	<0.53	<0.37	2280	8.3	<3.2	7.5	7460	9.7	1650	223	<0.02	<5	1100	<0.54	<0.8	<187	15.5	36.4
AAB7726	60-01330	1.0–2.0	Soil	6770	5.8	230	<0.57	<0.07	2700	7.7	<4.6	7.5	9850	8	2090	305	NA	<6.8	1270	<0.94	<0.47	NA	23.2	32.8
AAC0405	60-01330	6.0–6.5	Qbt 4	13000	<2.2	74	<0.91	<0.08	2400	7.9	<2.5	<3.8	13400	4.1	2410	NA	0.28	<9.5	1710	<1.1	<0.73	<80.8	<12.7	57.2
AAB7727	60-01331	1.0–2.0	Soil	7940	5.2	180	<0.63	<0.07	1890	9.6	<4.6	8.7	9080	15.4	1700	347	NA	<6.6	1500	<0.95	<0.56	NA	19.1	47.1
AAC0411	60-01331	5.5–6.0	Qbt 4	9330	<1.7	61.9	<0.62	<0.08	1610	7.9	<2	<2.6	10500	10.9	1870	NA	0.27	<7	<1280	<1.1	<0.63	<92.6	<9.8	38.6
AAB7728	60-01332	1.0–2.0	Soil	8960	3.1	163	<0.65	<0.06	2180	7.4	<4.6	13.6	9900	12	1820	247	NA	<6.6	1570	<0.86	<0.39	NA	22	98.2
AAC0414	60-01332	5.5–6.0	Qbt 4	13800	3.7	200	<1.1	<0.08	13400	8.7	<4.1	<3.7	13900	10.5	2770	NA	0.28	10.9	1890	<1.1	<1	<155	<16.9	53.6
AAB7729	60-01333	1.0–2.0	Soil	7490	2.5	225	<0.5	<0.07	5850	7.7	<5.1	<1.7	11000	8.2	2380	956	NA	<6.4	1260	<0.94	<0.49	NA	24.5	160
AAB7730	60-01334	1.0–2.0	Soil	11600	5	193	<0.72	<0.07	2530	11.7	<5	28.7	12000	18.4	2080	245	NA	<8	1930	<0.96	<0.51	NA	26.5	77.7
AAC0408	60-01335	5.5–6.0	Qbt 4	5500	<1.5	57.5	<0.4	<0.08	1530	4.3	<1.7	<0.78	9990	5.7	1280	NA	0.31	<4.3	<975	<1.1	<0.66	<80.3	<8.1	45.5
<b>SWMU 60-006(a)</b>																								
AAB5817	60-01100	1.0–2.0	Sludge	116000	115	5060	9.7	174	327000	1230	106	4240	237000	3600	33100	2450	65.6	737	67100	71.28	215	72400	819	42600
AAB5818	60-01100	1.0–2.0	Sludge	9820	<7.5	334	<1.7	10.6	170000	96.7	<13.6	285	21900	369	16900	287	3.76	82.4	52300	<6.2	<7.6	66200	56.5	2950
<b>SWMU 60-007(b)</b>																								
AAB7639	60-01309	0.0–1.0	Sediment	2900	<0.68	48.5	<0.39	<0.37	1770	2.7	<3.7	<2.6	3960	6.7	<714	331	<0.02	<4.1	<448	<0.55	<0.81	<89.7	<6.2	35.8
AAB7648	60-01316	0.0–0.5	Sediment	1750	<0.56	<31	<0.3	<0.35	5890	2.3	<1	<3.5	3340	3.4	<597	102	<0.02	<1.6	<335	<0.52	<0.77	<102	<5.1	20.7

Note: All values in mg/kg. Shaded values denote results detected above BV.

<sup>a</sup> < = Result is not detected.

<sup>b</sup> NA = Not analyzed.



**Table 3.0-6**  
**Summary of Organic Chemical Screening-Level Results for TA-60 Sites**

Sample ID	Location ID	Depth (ft)	Media Code	PCBs		SVOCs			
				Aroclor-1254	Aroclor-1260	Benzoic Acid	Benzyl Alcohol	Bis(2-ethylhexyl)phthalate	Phenol
<b>SWMU 60-004(b)</b>									
AAB5769	60-01000	0-1	Soil	0.0563	<0.0359*	<1.7	<0.36	<0.36	<0.36
AAB5875	60-01003	0-1	Soil	<0.0359	<0.0359	<1.7	<0.36	0.36	1.9
<b>SWMU 60-004(f)</b>									
AAC0411	60-01331	5.5-6	Qbt 4	0.0556	0.0439	<2	<0.41	<0.41	<0.41
<b>SWMU 60-007(b)</b>									
AAB7707	60-01316	0-1	Sediment	<0.46	<0.46	<3.5	<1.7	5.3	<0.35

Note: All values in mg/kg. Shaded values denote detected results.

\* < = Result is not detected.

**Table 3.0-7**  
**Summary of Radionuclide Screening-Level Results for TA-60 Sites**

Sample ID	Location ID	Depth (ft)	Media	Tritium
<b>AOC 60-004(f)</b>				
AAC0418	60-01322	2.0-2.5	Soil	1.21
AAC0419	60-01322	6.0-6.5	Qbt 4	0.98
AAC0417	60-01322	6.5-7.0	Qbt 4	1.37
AAB7641	60-01323	0.0-1.5	Sediment	0.95
AAC0407	60-01330	5.5-6.0	Qbt 4	1.52
AAC0405	60-01330	6.0-6.5	Qbt 4	1.93
AAC0411	60-01331	5.5-6.0	Qbt 4	1.97
AAC0416	60-01332	5.0-5.5	Qbt 4	1.48
AAC0414	60-01332	5.5-6.0	Qbt 4	1.08
AAC0408	60-01335	5.5-6.0	Qbt 4	0.93
<b>SWMU 60-006(a)</b>				
AAB5817	60-01100	1.0-2.0	Sludge	910
AAB5818	60-01100	1.0-2.0	Sludge	1090
<b>SWMU 60-007(b)</b>				
AAB7639	60-01309	0.0-1.0	Sediment	0.99
AAB7636	60-01313	0.0-1.5	Soil	2.97
AAB7648	60-01316	0.0-0.5	Sediment	0.99

Note: All values in pCi/g.



# **Appendix A**

---

*Acronyms and Abbreviations, Glossary,  
Metric Conversion Table, and Data Qualifier Definitions*





## **A-1.0 ACRONYMS AND ABBREVIATIONS**

ACA	accelerated corrective action
AK	acceptable knowledge
amsl	above mean sea level
AOC	area of concern
bgs	below ground surface
BV	background value
CFR	Code of Federal Regulations
CSM	conceptual site model
D&D	decontamination and decommissioning
DOE	Department of Energy
DOT	Department of Transportation
dpm	disintegrations per minute
DRO	diesel range organic
DU	depleted uranium
EP	Environmental Programs (Directorate)
EPA	Environmental Protection Agency
ER	Environmental Restoration (Project)
FFCA	Federal Facility Compliance Act
FV	fallout value
GPS	global positioning system
GRO	gasoline range organic
HE	high explosives
HIR	historical investigation report
IDW	investigation-derived waste
IFWGMP	Interim Facility-Wide Groundwater Monitoring Plan
kV	kilovolt
LANL	Los Alamos National Laboratory
LRO	lubrication-range organic
MCL	maximum contaminant level
NFA	no further action
NMED	New Mexico Environment Department
NPDES	National Pollutant Discharge Elimination System
NSSB	National Security Science Building

NTS	Nevada Test Site
OU	operable unit
PAH	polycyclic aromatic hydrocarbon
PCB	polychlorinated biphenyl
PCE	perchloroethylene [also tetrachloroethane]
pH	potential of hydrogen
PID	photoionization detector
PPE	personal protective equipment
ppm	parts per million
QA/QC	quality assurance/quality control
RCRA	Resource Conservation and Recovery Act
RLW	radioactive liquid waste
RFI	RCRA facility investigation
RPF	Records Processing Facility
SOP	standard operating procedure
SVOC	semivolatile organic compound
SWMU	solid waste management unit
SWSC	Sanitary Wastewater Systems Consolidation
TA	technical area
TLD	thermoluminescent dosimeter
TPH	total petroleum hydrocarbons
TSCA	Toxic Substances Control Act
VCA	voluntary corrective action
VOC	volatile organic compound
WAC	waste acceptance criteria
WCSF	waste characterization strategy form
WWTP	wastewater treatment plant
XRF	x-ray fluorescence

## A-2.0 GLOSSARY

**abandonment**—The plugging of a well or borehole in a manner that precludes the migration of surface runoff or groundwater along the length of the well or borehole.

**accelerated corrective action**—A cleanup process used to implement presumptive remedies at small-scale and relatively simple sites where groundwater contamination is not a component of the accelerated cleanup, where the remedy is considered to be the final remedy for the site, and where



the fieldwork will be accomplished within 180 days of the start of field activities. Accelerated corrective actions may be implemented before the approval of the accelerated corrective action work plan by the New Mexico Environment Department.

**accelerated corrective measure**—A cleanup process meeting the same criteria as an accelerated corrective action, except that an accelerated corrective measure cannot be implemented before New Mexico Environment Department approval of the accelerated corrective measure work plan.

**accuracy**—A measure of the closeness of measurements to the true value of the parameter being measured.

**action level**—(1) A numerical value that has been established by statistical analysis or has been set according to regulatory limits and is used as a criterion for action. Contamination found in a particular medium below an appropriate action level is not generally subject to remediation or further study. (2) A health- and environment-based concentration derived using chemical-specific toxicity information and standardized exposure assumptions. An action level can be developed on a facility-specific basis or can be taken from standardized lists.

**administrative authority**—For Los Alamos National Laboratory, one or more regulatory agencies, such as the New Mexico Environment Department, the U.S. Environmental Protection Agency, or the U.S. Department of Energy, as appropriate.

**administrative controls**—Nonphysical or nonengineered mechanisms for managing risks to human health and the environment.

**administrative order on consent**—A legal agreement signed by the U.S. Environmental Protection Agency and an individual, business, or other entity through which a violator agrees to pay for the correction of violations, take the required corrective or cleanup actions, or refrain from an activity. It describes the actions to be taken, may be subject to a comment period, applies to civil actions, and can be enforced in court.

**administrative record**—All documents that the administrative authority considered, or relied on, when selecting the response action at a site, culminating in the record of decision for remedial action or an action memorandum for removal actions.

**aggregate**—At the Los Alamos National Laboratory, an area within a *watershed* containing solid waste management units (SWMUs) and/or areas of concern (AOCs), and the media affected or potentially affected by releases from those SWMUs and/or AOCs. Aggregates are designated to promote efficient and effective corrective action activities.

**alluvial**—Pertaining to geologic deposits or features formed by running water.

**alluvial fan**—A fan-shaped piedmont accumulation of alluvium.

**alluvium**—Soil deposited by a river or other running water.

**alpha radiation**—A form of particle radiation that is highly ionizing and has low penetration. Alpha radiation consists of two protons and two neutrons bound together into a particle that is identical to a helium nucleus and can be written as  $\text{He}^{2+}$ .

**analysis**—A critical evaluation, usually made by breaking a subject (either material or intellectual) down into its constituent parts, then describing the parts and their relationship to the whole. Analyses may include physical analysis, chemical analysis, toxicological analysis, and knowledge-of-process determinations.

**analyte**—The element, nuclide, or ion a chemical analysis seeks to identify and/or quantify; the chemical constituent of interest.

**analytical method**—A procedure or technique for systematically performing an activity.

**annular space (annulus)**—The space between a borehole wall and a well casing, or the space between a casing pipe and a liner pipe.

**Appendix F, performance measures**—The measures that define Los Alamos National Laboratory's contractual requirements as established with the U.S. Department of Energy and the University of California (specifically in Section B, Performance Objectives, Criteria, and Measures for Operations and Administration, Parts II-1 and II-2).

**applicable or relevant and appropriate requirements (ARARs)**—(1) Those cleanup standards, standards of control, and other substantive requirements, criteria, or limitations promulgated under federal environmental, state environmental, or facility siting laws that specifically address a hazardous substance, pollutant, contamination, remedial action, location, or other circumstance found at a site. Only those state standards that are identified by a state in a timely manner and that are more stringent than federal requirements may be applicable (see National Contingency Plan, section 300.5). (2) Requirements promulgated under federal or state law that specifically address the circumstances at a site. (3) Requirements and environmental laws that may be either "applicable" or "relevant and appropriate," but not both. The identification of ARARs must take place on a site-specific basis.

**aquifer**—An underground geological formation (or group of formations) containing water that is the source of groundwater for wells and springs.

**area of concern**—(1) A release that may warrant investigation or remediation and is not a solid waste management unit (SWMU). (2) An area at Los Alamos National Laboratory that may have had a release of a hazardous waste or a hazardous constituent but is not a SWMU.

**area of contamination**—As defined by the U.S. Environmental Protection Agency, certain areas of generally dispersed contamination that could be equated to a Resource Conservation and Recovery Act (RCRA) landfill. The movement of hazardous wastes within those areas would not be considered land disposal and would not trigger RCRA land-disposal restrictions. An area of contamination may be designated by the Environmental Remediation and Surveillance Program as part of a corrective action for waste management purposes, subject to approval by the administrative authority.

**assessment**—(1) The act of reviewing, inspecting, testing, checking, conducting surveillance, auditing, or otherwise determining and documenting whether items, processes, or services meet specified requirements. (2) An evaluation process used to measure the performance or effectiveness of a system and its elements. In this glossary, assessment is an all-inclusive term used to denote any one of the following: audit, performance evaluation, management system review, peer review, inspection, or surveillance.

**background concentration**—Naturally occurring concentrations of an inorganic chemical or radionuclide in soil, sediment, or tuff.

**background data**—Data that represent naturally occurring concentrations of inorganic and radionuclide constituents in a geologic medium. Los Alamos National Laboratory's (the Laboratory's) background data are derived from samples collected at locations that are either within, or adjacent to, the Laboratory. These locations (1) are representative of geological media found within Laboratory boundaries, and (2) have not been affected by Laboratory operations.

**background level**—(1) The concentration of a substance in an environmental medium (air, water, or soil) that occurs naturally or is not the result of human activities. (2) In exposure assessment, the concentration of a substance in a defined control area over a fixed period of time before, during, or after a data-gathering operation.

**background radiation**—The amount of radioactivity naturally present in the environment, including cosmic rays from space and natural radiation from soils and rock.

**background sample**—A sample collected from an area or site that is similar to the one being studied but known, or thought, to be free from constituents of concern.

**background value (BV)**—A statistically derived concentration (i.e., the upper tolerance limit [UTL]) of a chemical used to represent the background data set. If a UTL cannot be derived, either the detection limit or maximum reported value in the background data set is used.

**baseline contaminant level**—Anthropogenic soil concentrations of a given chemical associated with Los Alamos National Laboratory and/or with commercial activities or processes that may not be related to source material(s) or release(s) from within a solid waste management unit or area of concern.

**baseline data**—Data that result from samples not directly associated with, or attributed to, a site. Baseline data must be identified during planning as originating from baseline samples. They are not equivalent to Los Alamos National Laboratory background data, usually are specific to an industrial area (such as a technical area), and are not applicable to another site without approval by the administrative authority.

**baseline risk assessment**—A site-specific analysis of the potential adverse effects of hazardous constituents that have been released from a site in the absence of any controls or mitigating actions. A baseline risk assessment consists of the following four steps: data collection and analysis, exposure assessment, toxicity assessment, and risk characterization.

**bentonite**—An absorbent aluminum silicate clay formed from volcanic ash and used in various adhesives, cements, and ceramic fillers. Because bentonite can absorb large quantities of water and expand to several times its normal volume, it is a common drilling mud additive.

**beta radiation**—High-energy electrons emitted by certain types of radioactive nuclei, such as potassium-40. The beta particles emitted are a form of ionizing radiation also known as beta rays.

**blank**—A sample that is expected to have a negligible or unmeasurable amount of an analyte. Results of blank sample analyses indicate whether field samples might have been contaminated during the sample collection, transport, storage, preparation, or analysis processes.

**blind sample**—See single blind sample and double blind sample.

**borehole**—(1) A hole drilled or bored into the ground, usually for exploratory or economic purposes.  
(2) A hole into which casing, screen, and other materials may be installed to construct a well.

**borehole logging**—The process of making remote measurements of physical, chemical, or other parameters at multiple depths in a borehole.

**calibration**—A process used to identify the relationship between the true analyte concentration or other variable and the response of a measurement instrument, chemical analysis method, or other measurement system.

**calibration standard**—A sample prepared to contain known amounts of analytes of interest and other constituents required for an analysis.

**canyon**—A stream-cut chasm or gorge, the sides of which are composed of cliffs or a series of cliffs rising from the chasm's bed. Canyons are characteristic of arid or semiarid regions where downcutting by streams greatly exceeds weathering.



- cap**—A modern engineered landfill cover that is designed and constructed to minimize or eliminate the release of constituents into the environment.
- certificate of completion**—A document to be issued by the New Mexico Environment Department (NMED) under the March 1, 2005, Compliance Order on Consent (Consent Order) once NMED determines that the requirements of the Consent Order have been satisfied for a particular solid waste management unit or area of concern.
- certification**—A signed statement required by permits, or certain enforcement documents (e.g., a compliance order), that is submitted with reports and other information requested by the administrative authority. Certification ensures that a document and all of its attachments were prepared under the direction or supervision of an authorized person in accordance with a system designed to ensure that qualified personnel properly gather and evaluate the information submitted. Known violations of certification carry significant penalties.
- chain of custody**—An unbroken, documented trail of accountability that is designed to ensure the uncompromised physical integrity of samples, data, and records.
- chemical**—Any naturally occurring or human-made substance characterized by a definite molecular composition.
- chemical analysis**—A process used to measure one or more attributes of a sample in a clearly defined, controlled, and systematic manner. Chemical analysis often requires treating a sample chemically or physically before measurement.
- chemical interference**—A chemical or physical entity whose influence results in a decrease or increase in the response of an analytical method or other measurement system relative to the response obtained in the absence of the entity.
- chemical of concern**—A chemical identified in human-health or ecological risk assessments as posing a risk.
- chemical of potential concern (COPC)**—A detected chemical compound or element that has the potential to adversely affect human receptors as a result of its concentration, distribution, and toxicity.
- chemical of potential ecological concern**—A detected chemical compound or element that has the potential to adversely affect ecological receptors as a result of its concentration, distribution, and toxicity.
- cleanup**—A series of actions taken to deal with the release, or threat of a release, of a hazardous substance that could affect humans and/or the environment. The term cleanup is sometimes used interchangeably with the terms remedial action, removal action, or corrective action.
- cleanup levels**—Media-specific contaminant concentration levels that must be met by a selected corrective action. Cleanup levels are established by using criteria such as the protection of human health and the environment; compliance with regulatory requirements; reduction of toxicity, mobility, or volume through treatment; long- and short-term effectiveness; implementability; and cost.
- Code of Federal Regulations (CFR)**—A document that codifies all rules of the executive departments and agencies of the federal government. The code is divided into 50 volumes, known as titles. Title 40 of the CFR (referenced as 40 CFR) covers environmental regulations.
- collocated sample**—One of two or more samples collected within close proximity of each other and meant to represent the same immediate area.

**comment period**—The time provided for the public to review and comment on a regulation action or rule-making after it has been published.

**comparability**—A qualitative measure of the degree to which one item or data set can be compared with another.

**Compliance Order on Consent (Consent Order)**—For the Environmental Remediation and Surveillance Program, an enforcement document signed by the New Mexico Environment Department, the U.S. Department of Energy, and the Regents of the University of California on March 1, 2005, which prescribes the requirements for corrective action at Los Alamos National Laboratory. The purposes of the Consent Order are (1) to define the nature and extent of releases of contaminants at, or from, the facility; (2) to identify and evaluate, where needed, alternatives for corrective measures to clean up contaminants in the environment and prevent or mitigate the migration of contaminants at, or from, the facility; and (3) to implement such corrective measures. The Consent Order supersedes the corrective action requirements previously specified in Module VIII of the Laboratory's Hazardous Waste Facility Permit.

**composite sample**—A sample collected over a temporal or spatial range that typically consists of a series of discrete equal samples that have been combined.

**Consent Order**—See Compliance Order on Consent.

**consolidated unit**—A group of solid waste management units (SWMUs), or SWMUs and areas of concern, which generally are geographically proximate and have been combined for the purposes of investigation, reporting, or remediation.

**contaminant**—(1) Chemicals and radionuclides present in environmental media or on debris above background levels. (2) According to the March 1, 2005, Compliance Order on Consent (Consent Order), any hazardous waste listed or identified as characteristic in 40 Code of Federal Regulations (CFR) 261 (incorporated by 20.4.1.200 New Mexico Administrative Code [NMAC]); any hazardous constituent listed in 40 CFR 261 Appendix VIII (incorporated by 20.4.1.200 NMAC) or 40 CFR 264 Appendix IX (incorporated by 20.4.1.500 NMAC); any groundwater contaminant listed in the Water Quality Control Commission (WQCC) Regulations at 20.6.3.3103 NMAC; any toxic pollutant listed in the WQCC Regulations at 20.6.2.7 NMAC; explosive compounds; nitrate; and perchlorate. (Note: Under the Consent Order, the term "contaminant" does not include radionuclides or the radioactive portion of mixed waste.)

**continuing calibration**—A combination of calibration blank and check standards used to determine if an instrument's response to an analyte concentration is within acceptable bounds relative to its initial calibration. A continuing calibration is performed every 12 h of operation or every 10 injections, depending on the analytical test method, thus verifying the satisfactory performance of an instrument on a day-to-day basis. The continuing-calibration 12-h period assumes that the instrument has not been shut down since the initial calibration.

**corrective action**—(1) In the Resource Conservation and Recovery Act, an action taken to rectify conditions potentially adverse to human health or the environment. (2) In the quality assurance field, the process of rectifying and preventing nonconformances.

**corrective measure**—An action taken at a solid waste management unit or area of concern to protect human health or the environment in the event of a release of contaminants into the environment, or to prevent a release of contaminants into the environment.

**corrective measure evaluation**—An evaluation of potential remedial alternatives undertaken to identify a preferred remedy that will be protective of human health and the environment and that will attain appropriate cleanup goals.

**corrective measures implementation plan**—A detailed plan and specifications to implement an approved remedy at a facility. The corrective measures implementation plan is the third step in the corrective action process and includes the design, construction, maintenance, and monitoring of the chosen remedy.

**corrective measures study**—A formal process for identifying and evaluating alternative remedies for releases at a facility.

**cumulative risk**—The evaluation of a simultaneous exposure of a receptor to multiple media, pathways, and contaminants in order to estimate the resulting health and environmental effects.

**Curie**—A unit of radioactivity defined as the quantity of any radioactive nuclide that has an activity of  $3.7 \times 10^{10}$  disintegrations per second (dps).

**daily calibration**—The combination of a calibration blank and calibration standard used to determine if the instrument response to an analyte concentration is within acceptable bounds relative to the initial calibration. A daily calibration establishes the instrument response factors on which quantitations are based, thus verifying the satisfactory performance of an instrument on a day-to-day basis.

**data package**—The hard copy deliverable for each sample delivery group produced by a contract analytical laboratory in accordance with the statement of work for analytical services.

**data-quality assessment**—The statistical and/or scientific evaluation of a data set that establishes whether the data set is adequate for its intended use.

**data-quality objectives**—Qualitative and quantitative statements of the overall level of uncertainty that a decision maker will accept regarding results or decisions based on environmental data. The objectives provide the statistical framework for planning and managing environmental data operations that will meet user needs.

**data validation**—A systematic process that applies a defined set of performance-based criteria to a body of data and that may result in the qualification of the data. The data-validation process is performed independently of the analytical laboratory that generates the data set and occurs before conclusions are drawn from the data. The process may include a standardized data review (routine data validation) and/or a problem-specific data review (focused data validation).

**data verification**—The process of evaluating the completeness, correctness, consistency, and compliance of a laboratory data package against a specified standard or contract.

- **Completeness:** All required information is present—in both hard copy and electronic forms.
- **Correctness:** The reported results are based on properly documented and correctly applied algorithms.
- **Consistency:** The values are the same when they appear in different reports or are transcribed from one report to another.
- **Compliance:** The data pass numerical quality-control tests based on parameters or limits specified in a contract or in an auxiliary document.

**decision-level concentration**—The concentration at which a 5% probability exists of reporting a false positive for a sample that contains no analytes.

**decision peer review**—A technical (subject-matter-expert) review that occurs before document writing has begun. The focus of the decision peer review is on the appropriateness of the stated objectives for the identified problem, on the adequacy of the proposed approach to address the objectives, and on the identification of concerns and necessary contingencies. Any decision that is expected to lead



to the writing of a peer-reviewed document is subject to a decision peer review and falls under Quality Procedure 3.5, Peer Review Process.

**decommissioning**—The permanent removal of facilities and their components from service after the discontinued use of structures or buildings that are deemed no longer useful. Decommissioning must take place in accordance with regulatory requirements and applicable environmental policies.

**decontamination**—The removal of unwanted material from the surface of, or from within, another material.

**deferred action**—The postponement of the selection and implementation of a corrective measure.

**detect (detection)**—An analytical result, as reported by an analytical laboratory, that denotes a chemical or radionuclide to be present in a sample at a given concentration.

**detection limit**—The minimum concentration that can be determined by a single measurement of an instrument. A detection limit implies a specified statistical confidence that the analytical concentration is greater than zero.

**detector background**—The ambient signal response recorded by radioactivity-measuring instruments that is independent of radioactivity contributed by the radionuclides being measured in the sample.

**discharge**—The accidental or intentional spilling, leaking, pumping, pouring, emitting, emptying, or dumping of hazardous waste into, or on, any land or water.

**disposal**—The discharge, deposit, injection, dumping, spilling, leaking, or placing of any solid waste or hazardous waste into, or on, any land or water so that such solid waste or hazardous waste or any constituent thereof may enter the environment or be emitted into the air or discharged into any waters, including groundwaters.

**document catalog number**—A unique document identifier designed to track every document generated by the Environmental Remediation and Surveillance Program. (This number is automatically assigned when an online document signature form is obtained.)

**document peer review**—A technical, regulatory, and legal review of a final, professionally edited document. Before the peer review, the document should receive a Level 3 (full) edit as defined by Los Alamos National Laboratory's Communication Arts and Services (IM-1) Group. Because this review follows the decision peer review, the approach should already have been agreed upon. Thus, the primary focus of a document peer review is on content (and to a lesser extent on approach; the clarity of presentation; and a consistent, appropriate format). The document peer review may be either a panel review or a read review. Quality Procedure 4.9 (Document Development and Approval Process) lists the types of Environmental Remediation and Surveillance Program documents that require a formal peer review.

**drilling package**—A document package that includes a detailed drilling plan, curation plan, sampling and analysis plan (SAP), and geophysical logging plan, as necessary, to meet the sampling requirements defined in the site-specific SAP for a given operable unit.

**drill rod (drill pipe)**—Special pipe used to transmit rotation and energy from the drill rig to the bit. This conduit conveys circulation fluids such as air, water, or other mixtures to cool the bit and evacuate the borehole cuttings.

**duplicate analysis**—An analysis performed on one member of a pair of identically prepared subsamples taken from the same sample.

**duplicate measurement**—An additional measurement performed on a prepared sample under identical conditions to evaluate any variance in measurement.

**ecological screening levels**—Soil, sediment, or water concentrations that are used to screen for potential ecological effects. The concentrations are based on a chemical's no-observed-adverse-effect level for a receptor, below which no risk is indicated.

**Environmental Restoration (ER) Project**—A Los Alamos National Laboratory project established in 1989 as part of a U.S. Department of Energy nationwide program, and precursor of today's Environmental Remediation and Surveillance (ERS) Program. This program is designed (1) to investigate hazardous and/or radioactive materials that may be present in the environment as a result of past Laboratory operations, (2) to determine if the materials currently pose an unacceptable risk to human health or the environment, and (3) to remediate (clean up, stabilize, or restore) those sites where unacceptable risk is still present.

**environmental samples**—Air, soil, water, or other media samples that have been collected from streams, wells, and soils, or other locations, and that are not expected to exhibit properties classified as hazardous by the U.S. Department of Transportation.

**ER data**—Data derived from samples that have been collected and paid for through Environmental Remediation and Surveillance Program funding.

**ER database (ERDB)**—A database housing analytical and other programmatic information for the Environmental Remediation and Surveillance Program. The ERDB currently contains about 3 million analyses in 300 tables.

**ER identification (ER ID) number**—A unique identifier assigned by the Environmental Remediation and Surveillance Program's Records Processing Facility to each document when it is submitted as a final record.

**error**—The quantifiable difference between an observed value and the true value of a parameter being measured.

**estimated detection limit**—A reporting limit required by a Los Alamos National Laboratory statement of work for analytical services.

**estimated quantitation limit (EQL)**—The lowest concentration that can be reliably achieved within specified limits of precision and accuracy during routine analytical-laboratory operating conditions. The low point on a calibration curve should reflect this quantitation limit. The EQL is not used to establish detection status. Sample EQLs are highly matrix dependent, and the specified EQLs might not always be achievable.

**evapotranspiration**—(1) The discharge of water from the earth's surface to the atmosphere by evaporation from lakes, streams, and soil surfaces and by transpiration from plants. (2) The loss of water from the soil by evaporation and/or by transpiration from the plants growing in the soil.

**exposure pathway**—Any path from the sources of contaminants to humans and other species or settings through air, soil, water, or food.

**exposure unit**—The bounded area or volume within which a person or other receptor could be exposed to contaminants that have been released into the environment.

**external standard calibration**—A comparison of instrument responses from a sample to the responses from target compounds in the calibration standards. The sample's peak areas (or peak heights) are compared to the standards' peak areas (or peak heights).

**facility**—All contiguous land (and structures, other appurtenances, and improvements on the land) used for treating, storing, or disposing of hazardous waste. A facility may consist of several treatment, storage, or disposal operational units. For the purpose of implementing a corrective action, a facility

is all the contiguous property that is under the control of the owner or operator seeking a permit under Subtitle C of the Resource Conservation and Recovery Act.

**field blank (field reagent blank)**—A blank sample prepared in the field or carried to the sampling site, exposed to sampling conditions (e.g., by removing bottle caps), and returned to a laboratory to be analyzed in the same manner in which environmental samples are being analyzed. Field blanks are used to identify the presence of any contamination that may have been added during the sampling and analysis process.

**field duplicate (replicate) samples**—Two separate, independent samples taken from the same source, which are collected as collocated samples (i.e., equally representative of a sample matrix at a given location and time).

**field matrix spike**—A known amount of a field sample to which a known amount of a target analyte has been added and used to compute the proportion of the added analyte that is recovered upon analysis.

field reagent blank—See field blank.

**field sample**—See sample.

**field split sample**—A field sample that has been homogenized and divided, in the field, into equally representative portions that are submitted for analysis.

**focused data validation**—A technically based analyte-, sample-, and data-use-specific process that extends the qualification of data beyond the method or contractual compliance and provides a higher level of confidence that an analyte is present or absent. If an analyte is present, the quality of the quantitation may be obtained through focused validation.

**formal training**—Training that is conducted by a qualified individual in settings such as a classroom or the field.

**gamma radiation**—A form of electromagnetic, high-energy ionizing radiation emitted from a nucleus. Gamma rays are essentially the same as x-rays (though at higher energy) and require heavy shielding, such as concrete or steel, to be blocked.

**graded approach**—A management tool used to evaluate the importance and relative risk of an item, activity, or service in the working process.

gravimetric moisture content—See water content.

**ground cover**—Natural or human-made materials (e.g., grasses, pine needles, asphalt, or concrete) which overlay soils.

**groundwater**—Interstitial water that occurs in saturated earth material and is capable of entering a well in sufficient amounts to be used as a water supply.

**hazard index**—The sum of hazard quotients for multiple contaminants to which a receptor may have been exposed.

**Hazardous and Solid Waste Amendments (HSWA)**—Public Law No. 98-616, 98 Stat. 3221, enacted in 1984, which amended the Resource Conservation and Recovery Act of 1976 (42 United States Code § 6901 et seq).

**hazardous constituent (hazardous waste constituent)**—According to the March 1, 2005, Compliance Order of Consent (Consent Order), any constituent identified in Appendix VIII of Part 261, Title 40 Code of Federal Regulations (CFR) (incorporated by 20.4.1.200 New Mexico Administrative



Code [NMAC]) or any constituent identified in 40 CFR 264, Appendix IX (incorporated by 20.4.1.500 NMAC).

**hazardous samples**—Samples of on-site air particulates, soil, or water and materials collected at waste sites that are known, or thought, to meet the definition of a hazard class per 49 Code of Federal Regulations 171.8. The term “hazardous samples” does not refer to Resource Conservation and Recovery Act hazardous wastes unless so stated.

**hazardous waste**—(1) Solid waste that is listed as a hazardous waste, or exhibits any of the characteristics of hazardous waste (i.e., ignitability, corrosivity, reactivity, or toxicity, as provided in 40 CFR, Subpart C). (2) According to the March 1, 2005, Compliance Order of Consent (Consent Order), any solid waste or combination of solid wastes that, because of its quantity, concentration, or physical, chemical, or infectious characteristics, meets the description set forth in New Mexico Statutes Annotated 1978, § 74-4-3(K) and is listed as a hazardous waste or exhibits a hazardous waste characteristic under 40 CFR 261 (incorporated by 20.4.1.200 New Mexico Administrative Code).

**Hazardous Waste Bureau**—The New Mexico Environment Department bureau charged with providing regulatory oversight and technical guidance to New Mexico hazardous waste generators and to treatment, storage, and disposal facilities, as required by the New Mexico Hazardous Waste Act.

**Hazardous Waste Facility Permit**—The authorization issued to Los Alamos National Laboratory (the Laboratory) by the New Mexico Environment Department that allows the Laboratory to operate as a hazardous waste treatment, storage, and disposal facility.

**hazard quotient (HQ)**—The ratio of the estimated site-specific exposure concentration of a single chemical from a site to the estimated daily exposure level at which no adverse health effects are likely to occur.

**high-explosive wastes**—Any waste-containing material having an amount of stored chemical energy that could start a violent reaction when initiated by impact, spark, or heat. This violent reaction would be accompanied by a strong shock wave and the potential for high-velocity particles to be propelled.

**HSWA module**—See Module VIII.

**independent quality assessment**—A planned and documented activity performed by individuals outside the Environmental Remediation and Surveillance (ERS) Program to determine—by investigation, examination, or evaluation of objective evidence—the extent to which the ERS quality program is being implemented.

**infiltration**—(1) The penetration of water through the ground surface into subsurface soil. (2) The technique of applying large volumes of wastewater to land to penetrate the surface and percolate through the underlying soil.

**initial calibration**—The process used to establish the relationship between instrument response and analyte concentration at several analyte concentration values in order to demonstrate that an instrument is capable of acceptable analytical performance.

**injection well**—A well into which fluids are injected for purposes such as waste disposal, improving the recovery of crude oil, or solution mining.

**inspection**—The critical examination or measurement of an item or activity to determine its conformance to applicable quality standards or specifications.

**institutional controls**—Controls that prohibit or limit access to contaminated media. Institutional controls may include use restrictions, permitting requirements, standard operating procedures, laboratory

implementation requirements, laboratory implementation guidance, and laboratory performance requirements.

**instrument detection limit (IDL)**—A measure of instrument sensitivity without any consideration for contributions to the signal from reagents. The IDL is calculated as follows: Three times the average of the standard deviations obtained on three nonconsecutive days from the analysis of a standard solution, with seven consecutive measurements of that solution per day. The standard solution must be prepared at a concentration of three to five times the instrument manufacturer's estimated IDL.

**instrument drift**—A systematic change in a given logging system's output as a result of causes inherent in the logging system, such as changing tool temperature or the deterioration of an electronic component.

**instrument performance check**—The analysis of a chemical of known relative mass abundances to indicate how well a mass spectrometer is performing over a specified mass range.

**interim measure**—An action that can be implemented to minimize or prevent the migration of contaminants and to minimize or prevent actual or potential human or ecological exposure to contaminants, while long-term final corrective action remedies are evaluated and, if necessary, implemented.

**internal standards**—Compounds added to a sample after the sample has been prepared for qualitative and quantitative instrument analysis. The compounds serve as a standard of retention time and response that is invariant from run to run.

**investigation-derived waste**—Solid waste or hazardous waste that was generated as a result of corrective action investigation or remediation field activities. Investigation-derived waste may include drilling muds, cuttings, and purge water from the installation of test pits or wells; purge water, soil, and other materials from the collection of samples; residues from the testing of treatment technologies and pump-and-treat systems; contaminated personal protective equipment; and solutions (aqueous or otherwise) used to decontaminate nondisposable protective clothing and equipment.

**laboratory control sample (LCS)**—A known matrix that has been spiked with compound(s) representative of target analytes. LCSs are used to document laboratory performance, and the acceptance criteria for LCSs are method-specific.

**laboratory qualifier (laboratory flag)**—Codes applied to data by a contract analytical laboratory to indicate, on a gross scale, a verifiable or potential data deficiency. These flags are applied according to the U.S. Environmental Protection Agency contract-laboratory program guidelines.

**land disposal**—Placement in or on the land, except in a corrective-action management unit or staging pile; this includes, but is not limited to, placement in a landfill, surface impoundment, waste pile, injection well, or land treatment facility.

**land-disposal restrictions**—Requirements in Title 40 Code of Federal Regulations, Section 268 that specify treatment standards that protect human health and the environment when hazardous waste is land disposed. All hazardous waste, except under certain limited circumstances, must meet a specific treatment standard before it can be land disposed.

**LANL (Los Alamos National Laboratory) data validation qualifiers**—The Los Alamos National Laboratory data qualifiers which are defined by, and used, in the Environmental Remediation and Surveillance (ERS) Program validation process. The qualifiers describe the general usability (or quality) of data. For a complete list of data qualifiers applicable to any particular analytical suite, consult the appropriate ERS standard operating procedure.

**LANL (Los Alamos National Laboratory) data validation reason codes**—The Los Alamos National Laboratory designations applied to sample data by data validators who are independent of the contract laboratory that performed a given sample analysis. Reason codes provide an analysis-specific explanation for applying a qualifier, with some description of the qualifier's potential impact on data use. For a complete list of data qualifiers applicable to any particular analytical suite, consult the appropriate Environmental Remediation and Surveillance Program standard operating procedure.

**Los Alamos unlimited release (LA-UR) number**—A unique identification number required for all documents or presentations prepared for distribution outside Los Alamos National Laboratory (the Laboratory). LA-UR numbers are obtained by filling out a technical information release form (<http://enterprise.lanl.gov/alpha.htm>) and submitting the form together with 2 copies of the document to the Laboratory's Classification Group (S-7) for review.

**maximum contaminant level (MCL)**—Under the Safe Drinking Water Act, the maximum permissible level of a contaminant in water that is delivered to any user of a public water system serving 15 or more connections and 25 or more people. MCLs are enforceable standards and take into account the feasibility and cost of attaining the standards.

**measuring and test equipment**—Devices or systems used to calibrate, measure, gauge, test, or inspect entities to control or acquire data and verify conformance to specified requirements.

**medium (environmental)**—Any material capable of absorbing or transporting constituents. Examples of media include tuffs, soils and sediments derived from these tuffs, surface water, soil water, groundwater, air, structural surfaces, and debris.

**method blank**—An analyte-free matrix to which all reagents are added in the same volumes or proportions as those used in the environmental sample processing, and which is prepared and analyzed in the same manner as the corresponding environmental samples. The method blank is used to assess the potential for sample contamination during preparation and analysis.

**method detection limit (MDL)**—The minimum concentration of a substance that can be measured and reported with a known statistical confidence that the analyte concentration is greater than zero. After subjecting samples to the usual preparation, the MDL is determined by analyzing those samples of a given matrix type that contain the analyte. The MDL is used to establish detection status.

**migration**—The movement of inorganic and organic chemical species through unsaturated or saturated materials.

**migration pathway**—A route (e.g., a stream or subsurface flow path) for the potential movement of contaminants to environmental receptors (plants, humans, or other animals).

**mixed waste**—Waste containing both hazardous and source, special nuclear, or byproduct materials subject to the Atomic Energy Act of 1954.

**model**—A schematic description of a physical, biological, or social system, theory, or phenomenon that accounts for its known or inferred properties and may be used for the further study of its characteristics.

**Module VIII**—Module VIII of the Los Alamos National Laboratory (the Laboratory) Hazardous Waste Facility Permit. This permit allows the Laboratory to operate as a hazardous-waste treatment, storage, and disposal facility. From 1990 to 2005, Module VIII included requirements from the Hazardous and Solid Waste Amendments. These requirements have been superseded by the March 1, 2005, Compliance Order on Consent (Consent Order).



**monitoring well**—(1) A well used to obtain water-quality samples or to measure groundwater levels, (2) A well drilled at a hazardous waste management facility or Superfund site to collect groundwater samples for the purpose of physical, chemical, or biological analysis and to determine the amounts, types, and distribution of contaminants in the groundwater beneath the site.

**National Pollutant Discharge Elimination System**—The national program for issuing, modifying, revoking and reissuing, terminating, monitoring, and enforcing permits to discharge wastewater or storm water, and for imposing and enforcing pretreatment requirements under the Clean Water Act.

**no further action**—Under the Resource Conservation and Recovery Act, a corrective-action determination whereby, based on evidence or risk, no further investigation or remediation is warranted.

**nondetect**—A result that is less than the method detection limit.

**non-ER data**—Data derived from samples collected by, and paid for by, sources other than the Environmental Remediation and Surveillance Program.

**operable units (OUs)**—At Los Alamos National Laboratory, 24 areas originally established for administering the Environmental Remediation and Surveillance Program. Set up as groups of potential release sites, the OUs were aggregated according to geographic proximity for the purposes of planning and conducting Resource Conservation and Recovery Act (RCRA) facility assessments and RCRA facility investigations. As the project matured, it became apparent that there were too many areas to allow efficient communication and to ensure consistency in approach. In 1994, the 24 OUs were reduced to 6 administrative field units.

**peer review**—See decision peer review and document peer review.

**performance criteria**—Measurable criteria used to assess all or part of a process.

**performance evaluation**—A type of audit in which quantitative data generated by a measurement system are obtained independently and then compared with routinely obtained data to evaluate the proficiency of an analyst or laboratory.

**performance-evaluation sample**—A sample of known composition with respect to selected analytes, which, upon analysis, is expected to yield results that fall within a prescribed range. Performance-evaluation samples are selected to mimic, as closely as possible, matrices that are representative of environmental samples from a particular location.

**permit**—An authorization, license, or equivalent control document issued by the U.S. Environmental Protection Agency or an approved state agency to implement the requirements of an environmental regulation.

**permit modification**—A change to a condition in a facility's permit, initiated by either a request from the permittee or by the administrative authority's action.

**polychlorinated biphenyls (PCBs)**—Any chemical substance limited to the biphenyl molecule that has been chlorinated to varying degrees, or any combination that contains such substances. PCBs are colorless, odorless compounds that are chemically, electrically, and thermally stable and have proven to be toxic to both humans and other animals.

**preliminary remediation goals**—Acceptable exposure levels (protective of human health and the environment) that are used as a risk-based tool for evaluating remedial alternatives.

**preliminary risk assessment**—A risk assessment that is conducted using conservative assumptions and scenarios and that assumes no mitigating or corrective measures beyond those already in place.

**prepared sample**—A sample that has been treated to render it amenable to analysis. The sample preparation may include additives or treatments such as digestate, distillate, electroplate, extract, filter retentate, filtrate, homogenate, precipitate, pulverized/sieved portion of sample, or residue.

**qualifications**—The requisites (e.g., education, training, skills, or experience) that equip an individual for a professional position, such as assessor or lead assessor.

**quality assessment**—A system of activities whose purpose is to provide assurance that overall quality control is being executed effectively. Quality assessment involves a continuing evaluation of a production system's products and performance.

**quality-assessment sample**—A sample submitted for analysis, the data from which are used to assess the performance quality of a sampling or analysis process. May include performance-evaluation samples, field duplicates, or field blanks.

**quality assurance/quality control**—A system of procedures, checks, audits, and corrective actions set up to ensure that all U.S. Environmental Protection Agency research design and performance, environmental monitoring and sampling, and other technical and reporting activities are of the highest achievable quality.

**quality control**—See quality assurance/quality control.

**quality-control sample**—A specimen that, upon analysis, is intended to provide information that is useful for adjusting, controlling, or verifying the continuing acceptability of sampling and/or analysis activities in progress.

**Quaternary**—The second period of the Cenozoic Era, following the Tertiary, and including the last two to three million years of earth history.

**radiation**—A stream of particles or electromagnetic waves emitted by atoms and molecules of a radioactive substance as a result of nuclear decay. The particles or waves emitted can consist of neutrons, positrons, alpha particles, beta particles, or gamma radiation.

**radioactive material**—For purposes of complying with U.S. Department of Transportation regulations, any material having a specific activity (activity per unit mass of the material) greater than 2 nanocuries per gram (nCi/g) and in which the radioactivity is evenly distributed.

**radioactive waste**—Waste that, by either monitoring and analysis, or acceptable knowledge, or both, has been determined to contain added (or concentrated and naturally occurring) radioactive material or activation products, or that does not meet radiological release criteria.

**radionuclide**—Radioactive particle (human-made or natural) with a distinct atomic weight number.

**RCRA facility assessment (RFA)**—Usually the first step in the Resource Conservation and Recovery Act (RCRA) corrective action process. The RFA includes the identification of potential and actual releases from solid waste management units and preliminary determinations about releases and the need for corrective action and stabilization measures.

**RCRA facility investigation (RFI)**—A Resource Conservation and Recovery Act (RCRA) investigation that determines if a release has occurred and characterizes the nature and extent of contamination at a hazardous waste facility. The RFI is generally equivalent to the remedial investigation portion of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA) process.

**record**—Any book, paper, map, photograph, machine-readable material, or other documentary material, regardless of physical form or characteristics.

- reference set**—A hard-copy compilation of reference items cited in Environmental Remediation and Surveillance Program documents.
- regulatory standard**—Media-specific contaminant concentration levels of potential concern that are mandated by federal or state legislation or regulation (e.g., the Safe Drinking Water Act, New Mexico Water Quality Control Commission regulations).
- release**—Any spilling, leaking, pumping, pouring, emitting, emptying, discharging, injecting, escaping, leaching, dumping, or disposing of hazardous waste or hazardous constituents into the environment.
- remediation**—(1) The process of reducing the concentration of a contaminant (or contaminants) in air, water, or soil media to a level that poses an acceptable risk to human health and the environment.  
(2) The act of restoring a contaminated area to a usable condition based on specified standards.
- remediation waste**—All solid wastes and hazardous wastes, and all media (including groundwater, surface water, soils, and sediments) and debris, that are managed for implementing cleanup.
- reporting limit (RL)**—The numerical value that an analytical laboratory (in conjunction with its client) selects for determining if a target analyte has been detected. Results below the RL are considered to be undetected, but results above the RL are considered to be detected. The RLs are not necessarily based on instrument sensitivity. RLs can be established at the instrument detection limit, method detection limit, estimated quantitation limit, or contract-required detection limit.
- request number**—An identifying number assigned by the Environmental Remediation and Surveillance Program to a group of samples submitted for analysis.
- Resource Conservation and Recovery Act**—The Solid Waste Disposal Act as amended by the Resource Conservation and Recovery Act of 1976 (Public Law [PL] 94-580, as amended by PL 95-609 and PL 96-482, United States Code 6901 et seq.).
- risk**—A measure of the probability that damage to life, health, property, and/or the environment will occur as a result of a given hazard.
- risk analysis**—In the quality assurance field, a qualitative evaluation of the probability and the potential consequences associated with noncompliant documents or work activities.
- risk assessment**—See baseline risk assessment.
- risk-based end state**—The post-remediation vision for the planned future land use of a specific U.S. Department of Energy property.
- risk characterization**—The last phase in the risk assessment process which estimates the potential for adverse health or ecological effects to occur as a result of exposure to a stressor, and which evaluates the uncertainty involved.
- risk management**—The process of evaluating and selecting alternative regulatory and nonregulatory responses to risk. The selection process necessarily requires the consideration of legal, economic, and behavioral factors.
- routine analysis**—The analysis categories of inorganic compounds, organic compounds, metals, radiochemistry, and high explosives, as defined in a contract laboratory's statement of work.
- routine data**—Data generated using analytical methods that are identified as routine methods in the current Environmental Remediation and Surveillance Program statement of work for analytical services.



**routine data validation**—The process of reviewing analytical data relative to quantitative routine acceptance criteria. The objective of routine data validation is two-fold—

- to estimate the technical quality of the data relative to minimum national standards adopted by the Environmental Remediation and Surveillance Program, and
- to indicate to data users the technical data quality at a gross level by assigning laboratory qualifiers to environmental data whose quality indicators do not meet acceptance criteria.

**runoff**—The portion of the precipitation on a drainage area that is discharged from the area.

**run-on**—Surface water that flows onto an area as a result of runoff occurring higher up on a slope.

**sample**—A portion of a material (e.g., rock, soil, water, or air), which, alone or in combination with other portions, is expected to be representative of the material or area from which it is taken. Samples are typically either sent to a laboratory for analysis or inspection or are analyzed in the field. When referring to samples of environmental media, the term field sample may be used.

**sample matrix**—In chemical analysis, that portion of a sample that is exclusive of the analytes of interest. Together, the matrix and the analytes of interest form the sample.

**screening action level (SAL)**—A radionuclide's medium-specific concentration level; it is calculated by using conservative criteria below which it is generally assumed that no potential exists for a dose that is unacceptable to human health. The derivation of a SAL is based on conservative exposure and on land-use assumptions. However, if an applicable regulatory standard exists that is less than the value derived, it is used in place of the SAL.

**screening risk assessment**—A risk assessment that is performed with few data and many assumptions in order to identify exposures that should be evaluated more carefully for potential risk.

**sediment**—(1) A mass of fragmented inorganic solid that comes from the weathering of rock and is carried or dropped by air, water, gravity, or ice. (2) A mass that is accumulated by any other natural agent and that forms in layers on the earth's surface (e.g., sand, gravel, silt, mud, fill, or loess). (3) A solid material that is not in solution and is either distributed through the liquid or has settled out of the liquid.

**sensitivity**—An indication of the lowest analyte concentration that can be measured with a specified degree of confidence.

**simple random sample**—A sampling design in which every possible sample (sample unit) has an equal probability of being selected.

**single blind sample**—A performance-evaluation sample submitted for analysis whose sample identity is known to the analyst, but whose composition is known to the submitter and not to the analyst.

**site characterization**—Defining the pathways and methods of migration of hazardous waste or constituents, including the media affected; the extent, direction and speed of the contaminants; complicating factors influencing movement; or concentration profiles.

**site conceptual model**—A qualitative or quantitative description of sources of contamination, environmental transport pathways for contamination, and receptors that may be impacted by contamination and whose relationships describe qualitatively or quantitatively the release of contamination from the sources, the movement of contamination along the pathways to the exposure points, and the uptake of contaminants by the receptors.

**site-specific health and safety plan (SSHASP)**—A health and safety plan that has been tailored to a site or to an Environmental Remediation and Surveillance (ERS) Program field activity and that has been approved by an ERS health and safety representative. A SSHASP contains information

specific to the project, including the scope of work, relevant history, descriptions of hazards from activity associated with the project site(s), and techniques for exposure mitigation (e.g., personal protective equipment and hazard mitigation).

**soil**—(1) A material that overlies bedrock and has been subject to soil-forming processes. (2) A sample media group that includes naturally occurring and artificial fill materials.

**soil moisture**—The water contained in the pore space of the unsaturated zone.

**soil water**—Water in the unsaturated zone, regardless of whether it occurs in soil or rock.

**solid waste**—Any garbage, refuse, or sludge from a waste treatment plant, water-supply treatment plant, or air-pollution control facility, and other discarded material, including solid, liquid, semisolid, or contained gaseous material resulting from industrial, commercial, mining, and agricultural operations and from community activities. Solid waste does not include solid or dissolved materials in domestic sewage; solid or dissolved materials in irrigation return flows; industrial discharges that are point sources subject to permits under section 402 of the Federal Water Pollution Control Act, as amended; or source, special nuclear, or byproduct material as defined by the Atomic Energy Act of 1954, as amended.

**solid waste management unit (SWMU)**—(1) Any discernible site at which solid wastes have been placed at any time, whether or not the site use was intended to be the management of solid or hazardous waste. SWMUs include any site at a facility at which solid wastes have been routinely and systematically released. This definition includes regulated sites (i.e., landfills, surface impoundments, waste piles, and land treatment sites), but does not include passive leakage or one-time spills from production areas and sites in which wastes have not been managed (e.g., product storage areas). (2) According to the March 1, 2005, Compliance Order on Consent (Consent Order), any discernible site at which solid waste has been placed at any time, and from which the New Mexico Environment Department determines there may be a risk of a release of hazardous waste or hazardous waste constituents (hazardous constituents), whether or not the site use was intended to be the management of solid or hazardous waste. Such sites include any area in Los Alamos National Laboratory at which solid wastes have been routinely and systematically released; they do not include one-time spills.

**split sample**—A sample that has been divided into two or more portions that are expected to be of the same composition; used to characterize within-sample heterogeneity, sample handling, and measurement variability.

**standard operating procedure**—A document that details the officially approved method(s) for an operation, analysis, or action, with thoroughly prescribed techniques and steps.

**surface sample**—A sample taken at a collection depth that is (or was) representative of the medium's surface during the period of investigative interest. A typical depth interval for a surface sample is 0 to 6 in. for mesa-top locations, but may be up to several feet in sediment-deposition areas within canyons.

**target analyte**—A chemical or parameter, the concentration, mass, or magnitude of which is designed to be quantified by a particular test method.

**technical area (TA)**—At Los Alamos National Laboratory, an administrative unit of operational organization (e.g., TA-21).

**topography**—The physical or natural features of an object or entity and their structural relationships.

**toxic pollutant**—A water contaminant or combination of water contaminants in concentration(s) that, upon exposure, ingestion, or assimilation, either directly from the environment or indirectly by

ingestion through food chains, will unreasonably threaten to injure the health of humans, or the health of other animals or plants that are commonly hatched, bred, cultivated, or protected for use by humans for food or economic benefit.

**transmissivity**—The ability of an aquifer to transmit water.

**transport (transportation)**—(1) The movement of a hazardous waste by air, rail, highway, or water.  
(2) The movement of a contaminant from a source through a medium to a receptor.

**treatment**—Any method, technique, or process, including elementary neutralization, designed to change the physical, chemical, or biological character or composition of any hazardous waste so as to neutralize such waste, recover energy or material resources from the waste, or to render such waste nonhazardous or less hazardous; safer to transport, store, or dispose of; or amenable for recovery or storage; or reduced in volume.

**treatment, storage, and disposal facility**—An interim-status or permitted facility in which hazardous waste is treated, stored, or disposed.

**trend analysis**—An analytical or graphical representation used to identify the changes in a variable as it is measured over a period of time.

**tuff**—Consolidated volcanic ash, composed largely of fragments produced by volcanic eruptions.

**underground storage tank**—A tank located at least partially underground and designed to hold gasoline or other petroleum products or chemicals.

**unique identifier**—A word or code that aids in the ability to trace the history, application, or location of an activity, item, datum, or sample using recorded documentation. For Environmental Remediation and Surveillance Program records, a unique identifier is an alphanumeric identifier assigned to a primary record.

**unrestricted area**—Any area, whose access is not controlled by a licensee for purposes of protecting individuals from exposure to radiation and radioactive materials, and any area used for residential quarters.

**U.S. Department of Energy**—The federal agency that sponsors energy research and regulates nuclear materials for weapons production.

**U.S. Environmental Protection Agency (EPA)**—The federal agency responsible for enforcing environmental laws. Although state regulatory agencies may be authorized to administer some of this responsibility, EPA retains oversight authority to ensure the protection of human health and the environment.

**vadose zone**—The zone between the land surface and the water table within which the moisture content is less than saturation (except in the capillary fringe) and pressure is less than atmospheric. Soil pore space also typically contains air or other gases. The capillary fringe is included in the vadose zone.

**verification**—A test or tests, generally performed before and after logging in lieu of a calibration, to ascertain whether the logging system is operating properly. Verification differs from calibration in that it does not provide updated system-calibration values.

**welded tuff**—A volcanic deposit hardened by the action of heat, pressures from overlying material, and hot gases.



**well casing**—A solid piece of pipe, typically steel or polyvinyl chloride (PVC) plastic, used to keep a well open in either unconsolidated materials or unstable rock and as a means to contain zone-isolation materials such as cement grout or bentonite.

**well screen**—A perforated wire-wrapped casing that allows fluids, but not solid material, to enter a well.

**work plan**—A document that specifies the activities to be performed when implementing an investigation or remedy. At a minimum, the work plan should identify the scope of the work to be performed, specify the procedures to be used to perform the work, and present a schedule for performing the work. The work plan may also present the technical basis for performing the work.

### A-3.0 METRIC CONVERSION TABLE

Multiply SI (Metric) Unit	by	To Obtain US Customary Unit
kilometers (km)	0.622	miles (mi)
kilometers (km)	3281	feet (ft)
meters (m)	3.281	feet (ft)
meters (m)	39.37	inches (in.)
centimeters (cm)	0.03281	feet (ft)
centimeters (cm)	0.394	inches (in.)
millimeters (mm)	0.0394	inches (in.)
micrometers or microns ( $\mu\text{m}$ )	0.000394	inches (in.)
square kilometers ( $\text{km}^2$ )	0.3861	square miles ( $\text{mi}^2$ )
hectares (ha)	2.5	acres
square meters ( $\text{m}^2$ )	10.764	square feet ( $\text{ft}^2$ )
cubic meters ( $\text{m}^3$ )	35.31	cubic feet ( $\text{ft}^3$ )
kilograms (kg)	2.2046	pounds (lb)
grams (g)	0.0353	ounces (oz)
grams per cubic centimeter ( $\text{g}/\text{cm}^3$ )	62.422	pounds per cubic foot ( $\text{lb}/\text{ft}^3$ )
milligrams per kilogram (mg/kg)	1	parts per million (ppm)
micrograms per gram ( $\mu\text{g}/\text{g}$ )	1	parts per million (ppm)
liters (L)	0.26	gallons (gal.)
milligrams per liter (mg/L)	1	parts per million (ppm)
degrees Celsius ( $^{\circ}\text{C}$ )	$9/5 + 32$	degrees Fahrenheit ( $^{\circ}\text{F}$ )

#### A-4.0 DATA QUALIFIER DEFINITIONS

Data Qualifier	Definition
U	The analyte was analyzed for but not detected.
J	The analyte was positively identified, and the associated numerical value is estimated to be more uncertain than would normally be expected for that analysis.
J+	The analyte was positively identified, and the result is likely to be biased high.
J-	The analyte was positively identified, and the result is likely to be biased low.
UJ	The analyte was not positively identified in the sample, and the associated value is an estimate of the sample-specific detection or quantitation limit.
R	The data are rejected as a result of major problems with quality assurance/quality control (QA/QC) parameters.

## **Appendix B**

---

*Analytical Suites and Results  
(on CD included with this document)*





LA-UR-08-1850  
March 2008  
EP2008-0139

# Investigation Work Plan for Upper Sandia Canyon Aggregate Area


Prepared by the Environmental Programs Directorate

Los Alamos National Laboratory, operated by Los Alamos National Security, LLC, for the U.S. Department of Energy under Contract No. DE-AC52-06NA25396, has prepared this document pursuant to the Compliance Order on Consent, signed March 1, 2005. The Compliance Order on Consent contains requirements for the investigation and cleanup, including corrective action, of contamination at Los Alamos National Laboratory. The U.S. government has rights to use, reproduce, and distribute this document. The public may copy and use this document without charge, provided that this notice and any statement of authorship are reproduced on all copies.


# Investigation Work Plan for Upper Sandia Canyon Aggregate Area

March 2008


Responsible project leader:

Kent Rich		Project Leader	Environmental Programs	3/24/08
Printed Name	Signature	Title	Organization	Date

Responsible LANS representative:

Susan G. Stiger		Associate Director	Environmental Programs	3-31-08
Printed Name	Signature	Title	Organization	Date

Responsible DOE representative:

David R. Gregory		Project Director	DOE-LASO	3/31/08
Printed Name	Signature	Title	Organization	Date





## EXECUTIVE SUMMARY

The Upper Sandia Canyon Aggregate Area is located in Technical Area 03 (TA-03), TA-60, and TA-61 at Los Alamos National Laboratory. The Upper Sandia Canyon Aggregate Area consists of 180 solid waste management units (SWMUs) and areas of concern (AOCs). TA-03 contains 153 SWMUs and AOCs; 75 sites have been approved for no further action (NFA) or have received a certificate of completion, and 78 sites will be investigated as part of this work plan. TA-60 contains 18 SWMUs and AOCs; 11 sites have been approved for NFA, and 7 sites will be investigated as part of this work plan. TA-61 contains 9 SWMUs and AOCs; 5 sites have been approved for NFA, and 4 sites will be investigated as part of this work plan. This investigation work plan identifies and describes the activities needed to complete the investigation of the remaining 89 SWMUs and AOCs. Details of previous investigations and analytical results for the 89 sites included in this work plan are provided in the historical investigation report for Upper Sandia Canyon Aggregate Area.

The sampling strategy proposed in this work plan will be integrated with the data results of the Sandia Canyons investigations to assess potential contaminant migration from sites within the Upper Sandia Canyon Aggregate Area. Additional data collected in Sandia Canyon under the Federal Facility Compliance Agreement/Administrative Order, Multi-Sector General Permit, and the Interim Facility-Wide Groundwater Monitoring Plan also will be used in assessing potential contaminant migration from the Upper Sandia Canyon Aggregate Area sites. All integrated results relevant to Upper Sandia Canyon Aggregate Area sites will be included in the report to be submitted following execution of this work plan.

The objective of this work plan is to evaluate the historical data and, based on that evaluation, to propose additional sampling as necessary to define the nature and extent of contamination associated with the SWMUs and AOCs within the Upper Sandia Canyon Aggregate Area.



## CONTENTS

<b>1.0</b>	<b>INTRODUCTION .....</b>	<b>1</b>
1.1	Work Plan Overview .....	1
1.2	Work Plan Objectives .....	2
<b>2.0</b>	<b>BACKGROUND .....</b>	<b>2</b>
2.1	General Site Information.....	2
2.2	Operational History .....	3
2.3	Conceptual Site Model .....	3
2.3.1	Potential Contaminant Sources.....	3
2.3.2	Potential Contaminant Transport Mechanisms .....	3
2.3.3	Potential Receptors and Pathways .....	4
2.3.4	Cleanup Standards.....	4
2.4	Data Overview .....	4
<b>3.0</b>	<b>SITE CONDITIONS.....</b>	<b>5</b>
3.1	Surface Conditions .....	5
3.1.1	Soil.....	5
3.1.2	Surface Water .....	5
3.1.3	Land Use .....	5
3.2	Subsurface Conditions .....	6
3.2.1	Anticipated Stratigraphic Units .....	6
3.2.2	Hydrogeology .....	8
<b>4.0</b>	<b>SITE DESCRIPTIONS AND PROPOSED INVESTIGATION ACTIVITIES.....</b>	<b>10</b>
4.1	TA-03.....	10
4.1.1	SWMU 03-002(c), Former Storage Area.....	10
4.1.2	SWMU 03-003(c), Equipment Storage Area—PCB Site.....	11
4.1.3	AOC 03-003(d), Transformer Pad—PCB Only Site .....	12
4.1.4	AOC 03-003(f), Transformer Area—PCB Only Site.....	13
4.1.5	AOC 03-003(g), Transformer Area—PCB Only Site.....	14
4.1.6	AOC 03-003(o), Former Non-PCB Capacitor Bank .....	14
4.1.7	Consolidated Unit 03-009(a)-00 .....	15
4.1.8	SWMU 03-009(i), Surface Disposal Site .....	22
4.1.9	Consolidated Unit 03-012(b)-00, Power Plant .....	22
4.1.10	Consolidated Unit 03-013(a)-00 .....	26
4.1.11	AOC 03-013(b), Floor Drains .....	28
4.1.12	SWMU 03-013(i), Operational Release.....	29
4.1.13	Consolidated Unit 03-014(a)-99 .....	30
4.1.14	SWMU 03-014(r), Lift Station Associated with Former WWTP.....	45
4.1.15	SWMU 03-014(s), Lift Station Associated with Former WWTP .....	45
4.1.16	AOC 03-014(v), Drain Associated with Former WWTP .....	46
4.1.17	AOC 03-014(y), Drain Associated with Former WWTP .....	46
4.1.18	Consolidated Unit 03-015-00 .....	47
4.1.19	AOC C-03-016, Oil Metal Bin .....	48
4.1.20	SWMU 03-021, Outfall .....	49
4.1.21	AOC 03-027, Lift Wells.....	50
4.1.22	AOC 03-036(b), Former Aboveground Storage Tanks .....	51
4.1.23	SWMU 03-037, Underground Storage Tanks .....	52



4.1.24	AOC 03-038(c), Waste Lines .....	53
4.1.25	AOC 03-038(d), Waste Lines .....	53
4.1.26	AOC 03-043(a), Aboveground Storage Tank.....	54
4.1.27	AOC 03-043(f), Aboveground Storage Tank.....	54
4.1.28	AOC 03-043(g), Aboveground Storage Tank.....	54
4.1.29	SWMU 03-045(a), Outfall .....	54
4.1.30	SWMU 03-045(e), Outfall .....	55
4.1.31	SWMU 03-045(f), Outfall .....	56
4.1.32	SWMU 03-045(h), Outfall .....	57
4.1.33	SWMU 03-046, Aboveground Wastewater Treatment Tank.....	57
4.1.34	AOC 03-047(d), Storage Area.....	57
4.1.35	AOC 03-047(g), Drum Storage .....	58
4.1.36	AOC 03-051(c), Soil Contamination—Vacuum Pump Leak.....	59
4.1.37	AOC 03-052(b), Storm Drainage.....	59
4.1.38	SWMU 03-054(c), Outfall .....	60
4.1.39	SWMU 03-056(a), Storage Area .....	61
4.1.40	SWMU 03-056(c), Transformer Storage Area—PCB Site .....	62
4.1.41	AOC 03-056(h), Container Storage Area .....	63
4.1.42	AOC 03-056(k), Container Storage Area .....	64
4.1.43	SWMU 03-056(l), Storage Area .....	65
4.1.44	Consolidated Unit 03-059-00 .....	66
4.1.45	AOC C-03-022, Kerosene Tanker Trailer.....	67
4.2	TA-60 .....	68
4.2.1	SWMU 60-002, Storage Area .....	68
4.2.2	AOC 60-004(b), Storage Area.....	70
4.2.3	AOC 60-004(d), Storage Area.....	70
4.2.4	AOC 60-004(f), Storage Area.....	71
4.2.5	SWMU 60-006(a), Septic System .....	72
4.2.6	SWMU 60-007(a), Release .....	73
4.2.7	SWMU 60-007(b), Release .....	73
4.3	TA-61 .....	74
4.3.1	SWMU 61-002, Transformer Storage Area—PCB Site .....	75
4.3.2	SWMU 61-005, Landfill .....	76
4.3.3	SWMU 61-006, Waste-Oil Tank.....	76
4.3.4	AOC C-61-002, Subsurface Contamination.....	77
<b>5.0</b>	<b>INVESTIGATION METHODS .....</b>	<b>77</b>
5.1	Field Surveys .....	77
5.1.1	Geodetic Surveys .....	77
5.1.2	Geophysical Surveys.....	78
5.2	Subsurface Characterization .....	78
5.2.1	Drilling Methods for Boreholes .....	78
5.3	Sample Collection.....	79
5.3.1	Surface Samples .....	79
5.3.2	Subsurface Samples .....	79
5.3.3	Excavation.....	80
5.4	Laboratory Analytical Methods .....	80
5.5	Health and Safety .....	80

5.6	Equipment Decontamination .....	80
5.7	Investigation-Derived Waste.....	81
5.8	Cleanup Activities .....	81
5.8.1	Description of Proposed Actions .....	81
<b>6.0</b>	<b>MONITORING PROGRAMS.....</b>	<b>83</b>
6.1	Groundwater .....	83
6.2	Air.....	83
6.3	Sediment and Surface Water .....	83
<b>7.0</b>	<b>SCHEDULE.....</b>	<b>84</b>
<b>8.0</b>	<b>REFERENCES AND MAP DATA SOURCES.....</b>	<b>84</b>
8.1	References .....	84
8.2	Map Data Sources .....	93

**Figures**

Figure 1.1-1	Upper Sandia Canyon Aggregate Area Map Key .....	95
Figure 3.1-1	Typical profiles of common soils at OU 1114 Operable Unit. ....	96
Figure 3.2-1	Generalized stratigraphy of bedrock geologic units of the Pajarito Plateau. ....	96
Figure 4.1-1	Map A site location.....	97
Figure 4.1-2	Map A inorganic chemical sampling locations and results detected above BVs.....	98
Figure 4.1-3	Map A organic chemical sampling locations and detected results .....	99
Figure 4.1-4	Map A radionuclide sampling locations.....	100
Figure 4.1-5	Map A proposed sampling locations.....	101
Figure 4.1-6	Map B site location.....	102
Figure 4.1-7	Map B organic chemical sampling locations and detected results .....	103
Figure 4.1-8	Map C site location.....	104
Figure 4.1-9	Map C inorganic chemical sampling locations and results detected above BVs.....	105
Figure 4.1-10	Map C organic chemical sampling locations.....	106
Figure 4.1-11	Map C radionuclide sampling locations .....	107
Figure 4.1-12	Map C proposed sampling locations.....	108
Figure 4.1-13	Map D site location.....	109
Figure 4.1-14	Map D inorganic chemical sampling locations and results detected above BVs.....	110
Figure 4.1-15	Map D organic chemical sampling locations and detected results .....	111
Figure 4.1-16	Map D radionuclide sampling locations and results detected above FVs/BVs.....	112
Figure 4.1-17	Map D proposed sampling locations.....	113
Figure 4.1-18	Map E site location.....	114
Figure 4.1-19	Map E inorganic chemical sampling locations and results detected above BVs.....	115
Figure 4.1-20	Map E organic chemical sampling locations .....	116
Figure 4.1-21	Map E radionuclide sampling locations.....	117
Figure 4.1-22	Map E proposed sampling locations .....	118
Figure 4.1-23	Map F site location .....	119

Figure 4.1-24	Map F proposed sampling locations .....	120
Figure 4.1-25	Map G site location .....	121
Figure 4.1-26	Map G inorganic chemical sampling locations and results detected above BVs .....	122
Figure 4.1-27	Map G organic chemical sampling locations .....	123
Figure 4.1-28	Map G proposed sampling locations.....	124
Figure 4.1-29	Map H site location.....	125
Figure 4.1-30	Map H inorganic chemical sampling locations and results detected above BVs.....	126
Figure 4.1-31	Map H organic chemical sampling locations and detected results .....	127
Figure 4.1-32	Map H radionuclide sampling locations .....	128
Figure 4.1-33	Map H proposed sampling locations.....	129
Figure 4.1-34	Map I site location .....	130
Figure 4.1-35	Map J site location .....	131
Figure 4.1-36	Map J inorganic chemical sampling locations.....	132
Figure 4.1-37	Map J organic chemical sampling locations .....	133
Figure 4.1-38	Map J radionuclide sampling locations .....	134
Figure 4.1-39	Map J proposed sampling locations.....	135
Figure 4.1-40	Map K site location.....	136
Figure 4.1-41	Map K inorganic chemical sampling locations and results detected above BVs .....	137
Figure 4.1-42	Map K organic chemical sampling locations and detected results .....	138
Figure 4.1-43	Map K proposed sampling locations.....	139
Figure 4.1-44	Map L site location .....	140
Figure 4.1-45	Map L inorganic chemical sampling locations and results detected above BVs .....	141
Figure 4.1-46	Map L organic chemical sampling locations and detected results.....	142
Figure 4.1-47	Map L radionuclide sampling locations and results detected above FVs/BVs .....	143
Figure 4.1-48	Map L proposed sampling locations .....	144
Figure 4.1-49	Map M site location .....	145
Figure 4.1-50	Map M inorganic chemical sampling locations and results detected above BVs .....	146
Figure 4.1-51	Map M organic chemical sampling locations and detected results.....	147
Figure 4.1-52	Map N site location.....	148
Figure 4.1-53	Map N proposed sampling locations.....	149
Figure 4.1-54	Map O site location .....	150
Figure 4.1-55	Map O proposed sampling locations.....	151
Figure 4.1-56	Map P site location.....	152
Figure 4.1-57	Map P inorganic chemical sampling locations and results detected above BVs.....	153
Figure 4.2-1	Map Q site location .....	154
Figure 4.2-2	Map Q inorganic chemical sampling locations and results detected above BVs .....	155
Figure 4.2-3	Map Q organic chemical sampling locations .....	156
Figure 4.2-4	Map Q radionuclide sampling locations .....	157
Figure 4.2-5	Map Q proposed sampling locations.....	158
Figure 4.2-6	Map R site location.....	159

Figure 4.2-7	Map R inorganic chemical sampling locations and results detected above BVs.....	160
Figure 4.2-8	Map R organic chemical sampling locations and detected results .....	161
Figure 4.2-9	Map R proposed sampling locations.....	162
Figure 4.2-10	Map S site location.....	163
Figure 4.2-11	Map S inorganic chemical sampling locations and results detected above BVs.....	164
Figure 4.2-12	Map S organic chemical sampling locations and detected results .....	165
Figure 4.2-13	Map S radionuclide sampling locations.....	166
Figure 4.2-14	Map S proposed sampling locations.....	167
Figure 4.2-15	Map T site location.....	168
Figure 4.2-16	Map T inorganic chemical sampling locations .....	169
Figure 4.2-17	Map T organic chemical sampling locations .....	170
Figure 4.2-18	Map T radionuclide sampling locations.....	171
Figure 4.2-19	Map T proposed sampling locations .....	172
Figure 4.3-1	Map U site location.....	173
Figure 4.3-2	Map U proposed sampling locations.....	174
Figure 4.3-3	Map V site location.....	175

## Tables

Table 1.1-1	SWMUs and AOCs within the Upper Sandia Canyon Aggregate Area .....	177
Table 2.3-1	Industrial SSLs .....	190
Table 4.0-1	Proposed Sampling Description and Analyses.....	192
Table 4.0-2	Analytical Methods for Surface and Subsurface Characterization .....	207
Table 4.1-1	Decision-Level Data from TA-03 Site Samples Collected and Analyses Requested .....	209
Table 4.1-2	Screening-Level Data from TA-03 Site Samples Collected and Analyses Requested...	217
Table 4.1-3	Summary of Inorganic Chemicals Detected Above BVs for TA-60 Sites .....	221
Table 4.1-4	Summary of Detected VOCs for TA-03 Sites .....	227
Table 4.1-5	Summary of Detected SVOCs for TA-03 Sites .....	229
Table 4.1-6	Summary of Detected PCBs, Herbicides, and TPH for TA-03 Sites .....	231
Table 4.1-7	Summary of Radionuclides Detected or Detected Above BVs/FVs for TA-03 Sites .....	234
Table 4.1-8	Summary of Inorganic Chemicals Detected in Debris and Engineered Material for TA-03 Sites .....	234
Table 4.1-9	Summary of Organic Chemicals Detected in Debris and Sludge for TA-03 Sites.....	235
Table 4.1-10	Summary of Radionuclides Detected in Engineered Material for TA-03 Sites .....	235
Table 4.1-11	Summary of Inorganic Chemical Screening-Level Results for TA-03 Sites .....	236
Table 4.1-12	Summary of VOC Screening-Level Results for TA-03 Sites .....	238
Table 4.1-13	Summary of SVOC Screening-Level Results for TA-03 Sites .....	239
Table 4.1-14	Summary of PCB Screening-Level Results for TA-03 Sites.....	240
Table 4.1-15	Summary of Radionuclide Screening-Level Results for TA-03 Sites .....	241
Table 4.2-1	Decision-Level Data from TA-60 Site Samples Collected and Analyses Requested .....	243
Table 4.2-2	Screening-Level Data from TA-60 Site Samples Collected and Analyses Requested...	244



Table 4.2-3	Summary of Inorganic Chemicals Above BVs for TA-60 Sites .....	246
Table 4.2-4	Summary of Detected Organic Chemicals for TA-60 Sites.....	247
Table 4.2-5	Summary of Inorganic Chemical Screening-Level Results for TA-60 Sites .....	248
Table 4.2-6	Summary of Organic Chemical Screening-Level Results for TA-60 Sites.....	249
Table 4.2-7	Summary of Radionuclide Screening-Level Results for TA-60 Sites .....	249
Table 5.0-1	Summary of Investigation Methods.....	251

**Appendixes**

Appendix A	Acronyms and Abbreviations, Glossary, Metric Conversion Table, and Data Qualifier Definitions
Appendix B	Investigation-Derived Waste Management Plan

**Plate**

Plate 1	Upper Sandia Canyon Aggregate Area
---------	------------------------------------

## 1.0 INTRODUCTION

Los Alamos National Laboratory (LANL or the Laboratory) is a multidisciplinary research facility owned by the U.S. Department of Energy (DOE) and managed by Los Alamos National Security, LLC. The Laboratory is located in north-central New Mexico approximately 60 mi northeast of Albuquerque and 20 mi northwest of Santa Fe. The Laboratory site covers 40 mi<sup>2</sup> of the Pajarito Plateau, which consists of a series of fingerlike mesas separated by deep canyons containing perennial and intermittent streams running from west to east. Mesa tops range in elevation from approximately 6200 and 7800 ft above mean sea level. The Upper Sandia Canyon Aggregate Area is shown in Plate 1.

The solid waste management units (SWMUs), areas of concern (AOCs), and consolidated units addressed in this investigation work plan are potentially contaminated with both hazardous and radioactive components. The New Mexico Environment Department (NMED), pursuant to the New Mexico Hazardous Waste Act, regulates cleanup of hazardous wastes and hazardous constituents. DOE regulates cleanup of radioactive contamination, pursuant to DOE Order 5400.5, "Radiation Protection of the Public and the Environment," and DOE Order 435.1, "Radioactive Waste Management." Information on radioactive materials and radionuclides, including the results of sampling and analysis of radioactive constituents, is voluntarily provided to NMED in accordance with DOE policy.

Corrective actions at the Laboratory are subject to the March 1, 2005, Compliance Order on Consent (the Consent Order). This work plan describes work activities that will be executed and completed in accordance with the Consent Order.

### 1.1 Work Plan Overview

The Upper Sandia Canyon Aggregate Area SWMUs and AOCs are located in Technical Area 03 (TA-03), TA-60 and TA-61 of the Laboratory with a total of 180 sites (Plate 1). Historical details of previous investigations and data for these sites are provided in the historical investigation report (HIR) for Upper Sandia Canyon Aggregate Area (LANL 2008, 100693). TA-03 contains 153 SWMUs and AOCs; 75 sites have been approved for no further action (NFA) or have received a certificate of completion, and 78 sites will be investigated as part of this work plan. TA-60 contains 18 SWMUs and AOCs; 11 sites have been approved for NFA, and 7 sites will be investigated as part of this work plan. TA-61 contains 9 SWMUs and AOCs; 5 sites have been approved for NFA, and 4 sites will be investigated as part of this work plan (Table 1.1-1). Of the 180 sites, 91 have been investigated and/or remediated and approved for NFA status (NFA-approval documents are referenced in Table 1.1-1); these 91 sites are described in the HIR and are not discussed further in this work plan. This work plan addresses the remaining 89 sites using the information from previous field investigations or removal actions to evaluate current conditions at each site.

Section 2 presents the general site information, operational history, and the preliminary conceptual site model of the Upper Sandia Canyon Aggregate Area. General site conditions are presented in section 3. Section 4 provides summaries of previous investigations and data collected and presents the scope of proposed activities for each site. The sites within the Upper Sandia Canyon Aggregate Area are widespread; therefore, they are organized by TA. Each TA subsection includes background information on operational history; summary of releases; and current site use, and status of the sites in the TAs. Section 5 provides investigation methods for proposed field activities. Ongoing monitoring and sampling programs in the Upper Sandia Canyon Aggregate Area are presented in section 6. Section 7 is an overview of the anticipated schedule of the investigation and reporting activities. The references cited in this report and the map data sources are provided in section 8. Appendix A of this work plan includes a

list of acronyms and abbreviations, a glossary, and metric conversion and data qualifier definitions tables. Appendix B describes the management of investigation-derived waste (IDW).

To simplify the discussion of this complex site, the Upper Sandia Canyon Aggregate Area figures were divided into smaller areas. Figure 1.1-1 presents an overview of the Upper Sandia Canyon Aggregate Area and provides a key for the specific areas covered by each of the figures.

## **1.2 Work Plan Objectives**

The objective of this work plan is to determine the nature and extent of releases from the 89 sites.

To accomplish this objective, this work plan

- presents historical and background information on the sites;
- describes the rationale for proposed data collection activities; and
- identifies and proposes appropriate methods and protocols for collecting, analyzing, and evaluating data to characterize these sites.

## **2.0 BACKGROUND**

### **2.1 General Site Information**

TA-03 occupies a large area located near the western end of South Mesa between Los Alamos Canyon to the north and Twomile Canyon to the south. Sandia and Mortandad Canyons originate within TA-03 and divide the eastern two-thirds of the area into finger-like projections. The middle mesa where most of TA-03 is located is called Sigma Mesa (LANL 1999, 064617, p. 2-11). TA-03 contains most of the Laboratory's administrative buildings and public and corporate access facilities. In addition, TA-03 houses several Laboratory activities such as experimental sciences, special nuclear materials, theoretical/computations, and physical support operations.

TA-60, also known as Sigma Mesa Site, was created from the eastern portion of TA-03 and lies on the finger-like mesa, Sigma Mesa, between Sandia and Mortandad Canyons. All buildings at TA-60 are located on the western end of the mesa and contain Laboratory support and maintenance operations and subcontractor-service facilities. The Nevada Test Site (NTS) Test Fabrication Facility; the NTS test tower (buildings 60-0017 and 60-0018); several small abandoned experimental areas including a solar pond and a test drill hole, and storage sites for pesticides, topsoil, and recyclable asphalt are also located at TA-60 (LANL 1999, 064617, p. 2-25).

TA-61 was also created from a portion of TA-03 and is bounded on the north by Los Alamos Canyon and on the south by Sandia Canyon (LANL 1999, 064617, p. 2-27). TA-61 contains physical support and infrastructure facilities, including the Los Alamos County landfill, sewer pump stations, a radio shop, general storage sheds, a blower house, a private batch concrete batch plant, a Laboratory-operated asphalt batch plant, and general warehouse storage for maintenance activities. A small parcel of private property, the Royal Crest Manufactured Home Community, is surrounded by TA-61. The Los Alamos County landfill occupies most of TA-61. The landfill was created in 1974 when large trenches and disposal areas were excavated from the north wall of Sandia Canyon.

## **2.2 Operational History**

In the early 1950s, operational facilities from TA-01 (located in the Los Alamos townsite) were relocated to TA-03. Early TA-03 facilities included the Van de Graaff accelerator building, a laboratory and support structures; the communications building; the Chemistry and Metallurgy Research Building; the general and chemical warehouses; the cryogenics laboratory; the administration building; the Sigma Building, a fire house, and the physics building. Additional new building construction continued through the 1960s and 1970s, when storage areas, shops, office buildings, a wastewater treatment plant (WWTP), a cement batch plant, and other transportable structures were added.

A solar pond was built in the 1970s on the eastern end of Sigma Mesa to test the feasibility of reducing the volume of low-level radioactive wastewater from TA-50. The experiment was unsuccessful, and the pond was abandoned. A mobile equipment repair shop and warehouse were built at TA-03 in 1972. Support structures for these facilities included automotive repair, a gas station, and a steam-cleaning facility surrounding the repair shop and warehouse. The Oppenheimer Study Center was constructed in 1977, and an annex was added to the administration building in 1981. In 1979, a geothermal test well was drilled at the eastern end of Sigma Mesa. The site was not suitable for geothermal development, and the experiment was terminated. A small pesticide storage shed was assembled in 1984 just east of the test rack assembly enclosure, and other areas on the mesa were historically designated as storage sites (LANL 1999, 064617, p. 2-25). A test rack facility was built in 1985 to assemble racks for use in underground testing of nuclear devices at NTS. A computer laboratory and several centers for various scientific activities were built during the 1990s (LANL 1999, 064617, p. 2-11), and very recently the National Security Sciences Building and the Strategic Computing Complex were built at TA-03.

TA-60 and TA-61 were created in 1989 when the Laboratory redefined its technical areas. As part of this effort, a portion of TA-03 was redesignated to TA-60, and a portion of TA-00 was redesignated to TA-61. TA-60 and TA-61 are relatively small sites that house physical support and maintenance operations structures. In addition, TA-61 contains the Los Alamos County landfill, which accepts nonhazardous waste from County residents and the Laboratory. This landfill is currently being closed under Resource Conservation and Recovery Act (RCRA) Subtitle D but some active cells continue to accept waste.

## **2.3 Conceptual Site Model**

The sampling proposed in this plan uses a conceptual site model to predict areas of potential contamination and allow for adequate characterization of these areas. A conceptual site model describes potential contaminant sources, transport mechanisms, and receptors.

### **2.3.1 Potential Contaminant Sources**

Releases at sites within Upper Sandia Canyon Aggregate Area may have occurred as a result of air emissions or effluent discharges. Previous sampling results indicate contamination from inorganic chemicals, organic chemicals, and radionuclides (LANL 2007, 098955). Additional sampling is needed to determine the nature and extent of contamination.

### **2.3.2 Potential Contaminant Transport Mechanisms**

Current potential transport mechanisms that may lead to exposure include

- dissolution and/or particulate transport of surface contaminants during precipitation and runoff events,



- airborne transport of contaminated surface soil,
- continued dissolution and advective/dispersive transport of chemical contaminants contained in subsurface soil and tuff as a result of past operations,
- disturbance of contaminants in shallow soil and subsurface tuff by Laboratory operations, and
- disturbance and uptake of contaminants in shallow soil by plants and animals.

### **2.3.3 Potential Receptors and Pathways**

Potential receptors and pathways may include

- Laboratory workers and
- plants and animals both on-site and in areas immediately surrounding the sites.

### **2.3.4 Cleanup Standards**

As specified in Section VII.B.1 of the Consent Order, screening levels will be used as soil cleanup levels unless they are determined to be impracticable or unless values do not exist for the current and reasonably foreseeable future land use. Soil screening levels for an industrial worker scenario are presented in Table 2.3-1 for previously detected inorganic and organic chemicals. The screening action levels for industrial worker scenario are also provided in Table 2.3-1 for previously detected radionuclides.

## **2.4 Data Overview**

Samples from previous investigations were analyzed for inorganic chemicals, organic chemicals, and/or radionuclides either by the Chemical Sciences and Technology (CST) Division at the Laboratory, by off-site fixed laboratories, or by both. Data obtained at CST Division laboratories are screening-level-quality data and are used only to select sampling locations and analytical suites. Data obtained from off-site fixed laboratories (i.e., decision-level data) are discussed for each site where data are available.

Concentrations of inorganic chemicals are compared with background values (BVs) and ranges of background concentrations (LANL 1998, 059730). Concentrations of detected organic chemicals are presented. Activities of detected radionuclides are compared with BVs or fallout values (FVs) and the ranges of the background/fallout activities for radionuclides (LANL 1998, 059730). These data are summarized in the HIR (LANL 2007, 098955).

This work plan summarizes the available data to determine whether the nature and extent of contamination are defined for each site. In addition, this work plan proposes sampling activities and analytical suites for those sites at which the nature and extent of contamination have not been defined. Sampling intervals are described for all proposed samples, but the volume of sample material collected is not defined because it depends on the type of material being sampled, recovery, and amount of material required for the analyses requested.

### **3.0 SITE CONDITIONS**

#### **3.1 Surface Conditions**

##### **3.1.1 Soil**

Soil on the Pajarito Plateau was initially mapped and described by Nyhan et al. (1978, 005702). The soil on the slopes between the mesa tops and canyon floors was mapped as mostly steep rock outcrops consisting of approximately 90% bedrock outcrop and patches of shallow, weakly developed colluvial soil. South-facing canyon walls generally are steep and usually have shallow soil in limited, isolated patches between rock outcrops. In contrast, the north-facing canyon walls generally have more extensive areas of shallow, dark-colored soil under thicker forest vegetation. The canyon floors generally contain poorly developed, deep, well-drained soil on floodplain terraces or small alluvial fans (Nyhan et al. 1978, 005702).

The soil on the mesa top in the Upper Sandia Canyon Aggregate Area belongs generally to the Hackroy series and the Carjo series (Nyhan et al. 1978, 005702). Hackroy soil consists of very shallow to shallow, well-drained, and moderately developed soil with an A-B horizon sequence. Soil textures can range from sandy loams to clay loams. The Carjo series consists of moderately deep, well-drained, and moderately developed soil with an A-B-C horizon sequence. The soil textures of the Carjo series can be very fine sandy loams. The parent material of the soil may range from Bandelier Tuff to sequences of alluvium/colluvium interstratified with moderately developed to well-developed buried soil. Typical profiles of the soil found at the Upper Sandia Canyon Aggregate Area are shown in Figure 3.1-1.

A majority of the natural mesa-top surface soil has been altered by anthropogenic activities. Excavation and fill, paved roads, parking lots, landscaped areas, and buildings have changed the natural soil landscape considerably.

##### **3.1.2 Surface Water**

Most surface water in the Los Alamos area occurs as ephemeral, intermittent, or interrupted streams in canyons cut into the Pajarito Plateau. Springs on the flanks of the Jemez Mountains, west of the Laboratory's western boundary, supply flow to the upper reaches of Cañon de Valle and to Guaje, Los Alamos, Pajarito, and Water Canyons (Purtymun 1975, 011787; Stoker 1993, 056021). These springs discharge water perched in the Bandelier Tuff and Tschicoma Formation at rates from 2 to 135 gal./min (Abeelee et al. 1981, 006273). The volume of flow from the springs maintains natural perennial reaches of varying lengths in each of the canyons.

The mesa-top portion of the Upper Sandia Canyon Aggregate Area is currently an industrially developed area. Perennial stream flow and saturated alluvial aquifer conditions occur in the upper and middle portions of the canyon system. A wetland of approximately 7 acres has developed as a result of effluent discharge. The only known perennial spring in the watershed, Sandia Spring, is located in lower Sandia Canyon near the Rio Grande (LANL 2007, 096665).

##### **3.1.3 Land Use**

Currently, land use of the Upper Sandia Canyon Aggregate Area is industrial. The TAs comprise the core operational and administrative complex of the Laboratory. The area is highly developed with numerous office and Laboratory buildings, utilities, parking facilities, roads, and other paved areas. Most of TA-03 is located on the mesa top west of Sandia Canyon and most of TA-60 and TA-61 are located on the mesa top east of Sandia Canyon (Plate 1).

## 3.2 Subsurface Conditions

### 3.2.1 Anticipated Stratigraphic Units

The stratigraphy of the Upper Sandia Canyon Aggregate Area is summarized in this section. Additional information on the geologic setting of the area and information on the Pajarito Plateau can be found in the Laboratory's Hydrogeologic Workplan (LANL 1998, 059599).

The bedrock at or near the surface of the mesa top is the Bandelier Tuff. There are approximately 1250 ft of volcanic and sedimentary materials between any potential contaminant-bearing units at the mesa surface and the regional aquifer. The stratigraphic units that may be encountered during investigation of the Upper Sandia Canyon Aggregate Area are described briefly in the following sections. The descriptions begin with the oldest (deepest) and proceed to the youngest (topmost).

#### The Bandelier Tuff

The Bandelier Tuff consists of the Otowi and Tshirege Members, which are stratigraphically separated in many places by the tephra and volcanoclastic sediment of the Cerro Toledo interval. The Bandelier Tuff was emplaced during cataclysmic eruptions of the Valles Caldera between 1.61 and 1.22 million yr ago. The tuff is composed of pumice, minor rock fragments, and crystals supported in an ashy matrix. It is a prominent cliff-forming unit because of its generally strong consolidation (Broxton and Reneau 1995, 049726).

*Otowi Member.* Griggs and Hem (1964, 092516), Smith and Bailey (1966, 021584), Bailey et al. (1969, 021498), and Smith et al. (1970, 009752) describe the Otowi Member. It consists of moderately consolidated (indurated), porous, and nonwelded vitric tuff (ignimbrite) that forms gentle colluvium-covered slopes along the base of canyon walls. The Otowi ignimbrites contain light gray to orange pumice that is supported in a white to tan ash matrix (Broxton et al. 1995, 050121; Broxton et al. 1995, 050119; Goff 1995, 049682). The ash matrix consists of glass shards, broken pumice, and crystal fragments, and fragments of perlite.

*The Guaje Pumice Bed.* The Guaje Pumice Bed occurs at the base of the Otowi Member, making a significant and extensive marker horizon. The Guaje Pumice Bed (Bailey et al. 1969, 021498; Self et al. 1986, 021579) contains well-sorted pumice fragments whose mean size varies between 0.8 and 1.6 in. Its thickness averages approximately 28 ft below most of the plateau, with local areas of thickening and thinning. Its distinctive white color and texture make it easily identifiable in borehole cuttings and core, and it is an important marker bed for the base of the Bandelier Tuff.

*Tephra and Volcanoclastic Sediment of the Cerro Toledo Interval.* The Cerro Toledo interval is an informal name given to a sequence of volcanoclastic sediment and tephra of mixed provenance that separates the Otowi and Tshirege Members of the Bandelier Tuff (Broxton et al. 1995, 050121; Goff 1995, 049682; Broxton and Reneau 1995, 049726). Although it is located between the two members of the Bandelier Tuff, it is not considered part of that formation (Bailey et al. 1969, 021498). Outcrops of the Cerro Toledo interval generally occur wherever the top of the Otowi Member appears in Sandia Canyon and in canyons to the north. The unit contains primary volcanic deposits described by Smith et al. (1970, 009752) as well as reworked volcanoclastic sediment. The occurrence of the Cerro Toledo interval is widespread; however, its thickness is variable, ranging between several feet and more than 100 ft.

The predominant rock types in the Cerro Toledo interval are rhyolitic tuffaceous sediment and tephra (Heiken et al. 1986, 048638; Stix et al. 1988, 049680; Broxton et al. 1995, 050121; Goff 1995, 049682).

The tuffaceous sediment is the reworked equivalents of Cerro Toledo rhyolite tephra. Oxidation and clay-rich horizons indicate that at least two periods of soil development occurred within the Cerro Toledo deposits. Because the soil is rich in clay, it may act as a barrier to the movement of vadose zone moisture. Some of the deposits contain both crystal-poor and crystal-rich varieties of pumice. The pumice deposits tend to form porous and permeable horizons within the Cerro Toledo interval, and locally, may provide important pathways for moisture transport in the vadose zone. A subordinate lithology within the Cerro Toledo interval includes clast-supported gravel, cobble, and boulder deposits derived from the Tschicoma Formation (Broxton et al. 1995, 050121; Goff 1995, 049682; Broxton and Reneau 1996, 055429).

*Tshirege Member.* The Tshirege Member is the upper member of the Bandelier Tuff and is the most widely exposed bedrock unit of the Pajarito Plateau (Griggs and Hem 1964, 092516; Smith and Bailey 1966, 021584; Bailey et al. 1969, 021498; Smith et al. 1970, 009752). Emplacement of this unit occurred during eruptions of the Valles Caldera approximately 1.2 million yr ago (Izett and Obradovich 1994, 048817; Spell et al. 1996, 055542). The Tshirege Member is a multiple-flow, ash-and-pumice sheet that forms the prominent cliffs in most of the canyons on the Pajarito Plateau. It is a chemical cooling unit whose physical properties vary vertically and laterally. The consolidation in this member is largely from compaction and welding at high temperatures after the tuff was emplaced. Its light brown, orange-brown, purplish, and white cliffs have numerous, mostly vertical fractures that may extend from several feet up to several tens of feet. The Tshirege Member includes thin but distinctive layers of bedded, sand-sized particles called surge deposits that demarcate separate flow units within the tuff. The Tshirege Member is generally over 200 ft thick.

The Tshirege Member differs from the Otowi Member most notably in its generally greater degree of welding and compaction. Time breaks between the successive emplacement of flow units caused the tuff to cool as several distinct cooling units. For this reason, the Tshirege Member consists of at least four cooling subunits that display variable physical properties vertically and horizontally (Smith and Bailey 1966, 021584; Crowe et al. 1978, 005720; Broxton et al. 1995, 050121). The welding and crystallization variability in the Tshirege Member produce recognizable vertical variations in its properties, such as density, porosity, hardness, composition, color, and surface-weathering patterns. The subunits are mappable based on a combination of hydrologic properties and lithologic characteristics.

Broxton et al. (1995, 050121) provide extensive descriptions of the Tshirege Member cooling units. The following paragraphs describe, in ascending order, subunits of the Tshirege Member.

The Tsankawi Pumice Bed forms the base of the Tshirege Member. Where exposed, it is commonly 20 to 30 in. thick. This pumice-fall deposit contains moderately well-sorted pumice lapilli (diameters reaching about 2.5 in.) in a crystal-rich matrix. Several thin ash beds are interbedded with the pumice-fall deposits.

Subunit Qbt 1g is the lowermost tuff subunit of the Tshirege Member. It consists of porous, nonwelded, and poorly sorted ash-flow tuff. This unit is poorly indurated but nonetheless forms steep cliffs because of a resistant bench near the top of the unit; the bench forms a harder, protective cap over the softer underlying tuff. A thin (4 to 10 in.), pumice-poor surge deposit commonly occurs at the base of this unit.

Subunit Qbt 1v forms alternating cliff-like and sloping outcrops composed of porous, nonwelded, crystallized tuff. The base of this unit is a thin, horizontal zone of preferential weathering that marks the abrupt transition from glassy tuff below (in Unit Qbt 1g) to the crystallized tuff above. This feature forms a widespread marker horizon (locally termed the vapor-phase notch) throughout the Pajarito Plateau that is readily visible in canyon walls in parts of Sandia Canyon. The lower part of Qbt 1v is orange-brown, resistant to weathering, and has distinctive columnar (vertical) joints; hence, the term "colonnade tuff" is appropriate for its description. A distinctive white band of alternating cliff- and slope-forming tuffs overlies



the colonnade tuff. The tuff of Qbt 1v is commonly nonwelded (pumices and shards retain their initial equant shapes) and have an open, porous structure.

Subunit Qbt 2 forms a distinctive, medium-brown, vertical cliff that stands out in marked contrast to the slope-forming, lighter-colored tuff above and below. It displays the greatest degree of welding in the Tshirege Member. A series of surge beds commonly mark its base. It typically has low porosity and permeability relative to the other units of the Tshirege Member.

Subunit Qbt 3 is a nonwelded to partially welded, vapor-phase altered tuff that forms the upper cliffs in Sandia Canyon. Its base consists of a purple-gray, unconsolidated, porous, and crystal-rich nonwelded tuff that forms a broad, gently sloping bench developed on top of Qbt 2. Abundant fractures extend through the upper units of the Bandelier Tuff, including the ignimbrite of the unit 3 of the Tshirege. The origin of the fractures has not been fully determined, but the most probable cause is brittle failure of the tuff caused by cooling contraction soon after initial emplacement (Vaniman 1991, 009995.1; Wohletz 1995, 054404).

### **3.2.2 Hydrogeology**

The hydrogeology of the Pajarito Plateau is generally separable in terms of mesas and canyons forming the plateau. Mesas are generally devoid of water, both on the surface and within the rock forming the mesa. Canyons range from wet to relatively dry; the wettest canyons contain continuous streams and contain perennial groundwater in the canyon-bottom alluvium. Dry canyons have only occasional streamflow and may lack alluvial groundwater. Intermediate perched groundwater has been found at certain locations on the plateau at depths ranging between 100 and 400 ft. The regional aquifer is found at depths of about 600 to 1200 ft.

The hydrogeologic conceptual site model for the Laboratory (LANL 1998, 059599) shows that, under natural conditions, relatively small volumes of water move beneath mesa tops because of low rainfall, high evaporation, and efficient water use by vegetation. Atmospheric evaporation may extend into mesas, further inhibiting downward flow.

#### **3.2.2.1 Groundwater**

In the Los Alamos area, groundwater occurs as (1) water in shallow alluvium in some of the larger canyons, (2) intermediate perched groundwater (a perched groundwater body lies above a less permeable layer and is separated from the underlying aquifer by an unsaturated zone), and (3) the regional aquifer. Numerous wells have been installed at the Laboratory and in the surrounding area to investigate the presence of groundwater in these zones and to monitor groundwater quality. The locations of the existing wells within the vicinity of the Upper Sandia Canyon Aggregate Area are shown in Plate 1.

The Laboratory formulated a comprehensive groundwater protection plan (LANL 1995, 050124) for an enhanced set of characterization and monitoring activities. The approved Hydrogeologic Workplan (LANL 1998, 059599) details the implementation of extensive groundwater characterization across the Pajarito Plateau within an area potentially affected by past and present Laboratory operations.

#### **Alluvial Groundwater**

Intermittent and ephemeral streamflow in the canyons of the Pajarito Plateau have deposited alluvium that can be as thick as 100 ft. The alluvium in canyons of the Jemez Mountains is generally composed of sand, gravel, pebbles, cobbles, and boulders derived from the Tschicoma Formation and Bandelier Tuff.

The alluvium in canyons is finer grained, consisting of clay, silt, sand, and gravel derived from the Bandelier Tuff.

In contrast to the underlying volcanic tuff and sediment, alluvium is relatively permeable. Ephemeral runoff in some canyons infiltrates the alluvium until downward movement is impeded by the less permeable tuff and sediment, which results in the buildup of a shallow alluvial groundwater body. Depletion by evapotranspiration and movement into the underlying rock limit the horizontal and vertical extent of the alluvial water (Purtymun et al. 1977, 011846). The limited saturated thickness and extent of the alluvial groundwater preclude its use as a viable source of water for municipal and industrial needs. Lateral flow of the alluvial perched groundwater is in an easterly, downcanyon direction (Purtymun et al. 1977, 011846).

### **Regional Aquifer**

The regional aquifer is the only aquifer capable of large-scale municipal water supply in the Los Alamos area (Purtymun 1984, 006513). The surface of the regional aquifer rises westward from the Rio Grande within the Santa Fe Group into the lower part of the Puye Formation beneath the central and western part of the Pajarito Plateau. The depths to groundwater below the mesa tops range between about 1200 ft along the western margin of the plateau and about 600 ft at the eastern margin. The location of wells and generalized water-level contours on top of the regional aquifer are described in the 2007 General Facility Information report (LANL 2007, 095364). The regional aquifer is typically separated from the alluvial groundwater and intermediate perched zone groundwater by 350 to 620 ft of tuff, basalt, and sediments (LANL 1993, 023249).

Groundwater in the regional aquifer flows east-southeast, toward the Rio Grande. The velocity of groundwater flow ranges from about 20 to 250 ft/yr (LANL 1998, 058841, p. 2-7). Details of depths to the regional aquifer, flow directions and rates, and well locations are presented in various Laboratory documents (Purtymun 1995, 045344; LANL 1997, 055622; LANL 2000, 066802).

#### **3.2.2.2 Vadose Zone**

The unsaturated zone from the mesa surface to the top of the regional aquifer is referred to as the vadose zone. The source of moisture for the vadose zone is precipitation, but much of it runs off, evaporates, or is absorbed by plants. The subsurface vertical movement of water is influenced by properties and conditions of the materials that make up the vadose zone.

Although water moves slowly through the unsaturated tuff matrix, it can move rapidly through fractures if saturated conditions exist (Hollis et al. 1997, 063131). Fractures may provide conduits for fluid flow but probably only in discrete, disconnected intervals of the subsurface. Because they are open to the passage of both air and water, fractures can have both wetting and drying effects, depending on the relative abundance of water in the fractures and the tuff matrix.

The Bandelier Tuff is very dry and does not readily transmit moisture. Most of the pore spaces in the tuff are of capillary size and have a strong tendency to hold water against gravity by surface-tension forces. Vegetation is very effective at removing moisture near the surface. During the summer rainy season when rainfall is highest, near-surface moisture content is variable because of higher rates of evaporation and of transpiration by vegetation, which flourishes during this time.

The various units of the Bandelier Tuff tend to have relatively high porosities. Porosity ranges between 30% and 60% by volume, generally decreasing for more highly welded tuff. Permeability varies for each

cooling unit of the Bandelier Tuff. The moisture content of native tuff is low, generally less than 5% by volume throughout the profile (Kearl et al. 1986, 015368; Purtymun and Stoker 1990, 007508).

#### **4.0 SITE DESCRIPTIONS AND PROPOSED INVESTIGATION ACTIVITIES**

The following sections present site descriptions, summaries of previous investigation activities, proposed sampling activities, and proposed remedial activities. Table 4.0-1 summarizes the investigation strategy for each SWMU or AOC, and Table 4.0-2 provides analytical methods for the site characterization activities proposed in this work plan.

The Upper Sandia Canyon Aggregate Area has been disturbed as a result of many years of new construction and demolition of former structures. Before sampling is conducted, geodetic and geophysical methods will be used to verify specific SWMU and AOC boundaries. The sampling locations proposed in this work plan may be relocated as a result of these surveys; however, the overall sampling strategy will remain the same.

##### **4.1 TA-03**

TA-03 is located on the western end of South Mesa and is almost completely developed. The core operational facilities for the Laboratory are located at TA-03, including the principal administration buildings, the library, the Chemistry and Metallurgy Research Building, the Beryllium Technology Facility, a gas-fired electrical generating plant, and a former sanitary wastewater treatment plant. Roads and large paved parking areas surround the buildings. Several building complexes are fenced for controlled access.

Transport mechanisms include airborne surface soil, infiltration through the vadose zone, continued dissolution and advective/dispersive transport of chemical and radiological contaminants contained in subsurface soil and bedrock, and disturbance and uptake of contaminants by plants and animals. Potential receptors include laboratory workers and ecological receptors in the undeveloped areas.

No natural surface-water bodies are present within TA-03. During summer thunderstorms and spring snowmelt, runoff from the mesa top flows into storm drains, down hillsides, and into both Sandia and Mortandad Canyons. Surface-water runoff and erosion of contaminated surface soil could lead to contamination of bench areas on the hillside and surface water off-site. Surface water may also access subsurface contaminants exposed by soil erosion. Groundwater sampling for Upper Sandia Canyon is addressed in the Sandia Canyon investigation report (LANL 2006, 094161). This work plan only addresses the collection of soil and tuff samples.

Samples collected for TA-03 and analyses requested for decision-level data are presented in Table 4.1-1; for screening-level data in Table 4.1-2. Decision-level data are presented in Tables 4.1-3 to 4.1-10; screening-level data in Tables 4.1-11 to 4.1-15. All laboratory analytical data (both decision-level and screening-level) are also provided in Appendix B of the HIR (LANL 2008, 100693). Figures 4.1-1 to 4.1-57 include base maps, maps showing inorganic chemicals and radionuclides detected above BVs/FVs and detected organic chemicals, and maps showing the proposed sampling locations for TA-03 sites.

##### **4.1.1 SWMU 03-002(c), Former Storage Area**

###### **Site Description**

SWMU 03-002(c) is the site of a former 19-ft × 15-ft wood storage shed (former structure 03-1494) located 100 ft west of the former Johnson Controls, Inc., administrative office (former building 03-0070)

(Figure 4.1-1). From the early 1960s to 1984, the shed was used to store containers of liquid and powdered pesticides and herbicides. The shed was removed in 1989 and the floor was disposed of as hazardous waste (LANL 1993, 020947). Between 1994 and 1996, the original concrete pad beneath the shed was surrounded by a new concrete pad that covered the site (LANL 1996, 052930, p. 41). The eastern portion of the concrete pad was paved over with asphalt in 2003 as part of the construction of an access road and parking lot (LANL 2008, 099214).

### Previous Investigations

A Phase I RFI was conducted at SWMU 03-002(c) in 1994 to determine if there had been a release of pesticides from the storage shed (LANL 1996, 052930, p. 41). Six soil samples, including one duplicate, were collected from five locations. At four locations under the concrete pad, samples were collected from a depth of 0 to 0.5 ft below ground surface (bgs). At the fifth location, downgradient of the bermed pad, a sample was collected from a depth of 0 to 0.25 ft bgs. All samples were submitted for laboratory analyses of inorganic chemicals, semivolatile organic compounds (SVOCs), polychlorinated biphenyls (PCBs), pesticides, herbicides, gross-alpha, -beta, and -gamma radiation, and tritium. One sample collected from the 0- to 0.5-ft interval was also submitted for laboratory analysis of volatile organic compounds (VOCs) (LANL 1996, 052930, p. 44). Requested analyses are presented in Table 4.1-2.

Screening-level data are presented in Table 4.1-11. Sampling locations are shown in Figures 4.1-2, 4.1-3, and 4.1-4. Cadmium, manganese, mercury, and silver were each detected in one sample above BVs; zinc and calcium were each detected above BVs in two and three samples, respectively. Organic chemicals and radionuclides were not detected.

### Proposed Activities

The nature and extent of contamination have not been defined at this site. Therefore, eight surface and subsurface soil samples will be collected from four locations to confirm the results of the previous investigation (Figure 4.1-5). The samples will be collected from two depths (0 to 1 ft and at the soil/tuff interface) and analyzed for inorganic chemicals, VOCs, SVOCs, PCBs, pesticides, and cyanide. No high explosives (HE) or radionuclides are associated with this SWMU; therefore, no samples will be analyzed for nitrate, perchlorate, or radionuclides. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

#### 4.1.2 SWMU 03-003(c), Equipment Storage Area—PCB Site

##### Site Description

SWMU 03-003(c) was a temporary equipment storage area for used dielectric fluids and capacitors located on the south side of former building 03-0287 (LANL 1993, 020947, p. 6-24) (Figure 4.1-6). Building 03-0287 was constructed between 1966 and 1968 to house a magnetic confinement experiment for the heating and confinement of hot plasmas. The experiment, known as the Scyllac Project, operated from 1972 to 1978. The experiment was energized by a capacitor bank housing 3300 sealed non-PCB capacitors. The sealed capacitors contained a non-PCB dielectric oil, and each of the associated spark-gap switches required approximately 2 qt of non-PCB mineral oil for electrical insulation (LANL 1995, 057590, p. 6-69). Before this experiment was decommissioning in the mid-1980s, oil samples from spark gap switches and swipe samples from numerous surfaces within the room where the equipment was housed were analyzed for PCBs. Results showed PCB concentrations of less than 2 parts per million (ppm). During the decommissioning of the experiment, some of the capacitors were temporarily stored outside the building at SWMU 03-003(c). Swipe samples collected from the pavement were found to be



free of PCBs (LANL 1995, 051878, p. 2-15). Before the remodeling of building 03-0287 in late 1992 and early 1993, a single surface soil sample was collected from the south side of building 03-0287 to supplement the previous PCB survey of the building's interior. No PCBs were detected (LANL 1993, 020947, p. 6-24).

### **Previous Investigations**

In 2001 (before decontamination and decommissioning [D&D] of building 03-0287), three asphalt samples were collected from three locations at SWMU 03-003(c), and three fill samples were collected from beneath the asphalt at a depth of 0 to 0.5 ft bgs (LANL 2001–2002, 100703, p. 13). Observations recorded by field personnel during sample collection activities indicated no staining or odors. Samples were submitted for laboratory analysis of PCBs (LANL 2005, 100704, p. 3). Requested analyses are presented in Table 4.1-1.

In 2003 and 2004, building 03-0287 underwent D&D activities to make way for the National Security Science Building (NSSB). Following the removal of building 03-0287 and all surrounding asphalt, including the location of SWMU 03-003(c), approximately 10 ft of clean fill was placed over the entire site to accommodate the NSSB (LANL 2008, 099214).

Decision-level data are presented in Tables 4.1-6 and 4.1-9. Sampling locations and detected results are shown in Figure 4.1-7. Aroclor-1254 was detected at 14 mg/kg in asphalt sample RC03-01-0013 (location 03-14455) and 0.043 mg/kg in fill sample RC03-01-0016 (location 03-14458) directly beneath asphalt sample RC03-01-0013. Aroclor-1254 was detected at 0.64 mg/kg in asphalt sample RC03-01-0016 (location 03-14456) and was not detected in fill sample RC03-01-0017 (location 03-14459) directly beneath asphalt sample RC03-01-0014. At sampling location 03-14454, Aroclor-1254 was not detected in asphalt sample RC-3-01-0012 but was detected at 0.054 mg/kg in fill sample RC03-01-0015 directly beneath the asphalt.

### **Proposed Activities**

No sampling is proposed for this SWMU because previous investigation results have determined the nature and extent of contamination. The area was excavated and buried under 10 ft of fill in preparation for the construction of the NSSB building.

#### **4.1.3 AOC 03-003(d), Transformer Pad—PCB Only Site**

##### **Site Description**

AOC 03-003(d) is a concrete pad located east of building 03-0141 where two former PCB-containing transformers, structures 03-0146 and 03-0176, were located (Figure 4.1-8). These transformers (PCB identification numbers 5008 and 5009) contained PCB concentrations greater than 500 ppm and were removed in 1991 and 1992, respectively, in accordance with the DOE/Albuquerque Operations Office Environmental Restoration and Waste Management Five-Year Plan (LANL 1995, 057590). Because no stains were visible on the concrete pad after the transformers were removed, the area was considered free of contamination and new non-PCB transformers were relocated on the same concrete pad. Additional concrete was added to extend the existing pad in 1993 (LANL 1995, 057590, p. 6-63).

##### **Previous Investigations**

Samples have not been collected at this AOC.

## Proposed Activities

The nature and extent of contamination have not been defined at this site. Therefore, five concrete chip samples will be collected from the surface of the pad to determine if PCBs are present and six surface samples will also be collected near the pad from three locations at two depths (0 to 1 ft and 1 to 2 ft) to determine if PCBs have migrated from the concrete pad (Figure 4.1-12). Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

### 4.1.4 AOC 03-003(f), Transformer Area—PCB Only Site

#### Site Description

AOC 03-003(f) is an area in the basement of the Sigma building (building 03-0066) where nine PCB-containing transformers were formerly located (Figure 4.1-13). The transformers were removed in 1991 in accordance with the DOE/Albuquerque Operations Office Environmental Restoration and Waste Management Five-Year Plan (LANL 1995, 057590). Under this plan, any evidence of a release was sampled and cleaned up in accordance with Toxic Substances Control Act (TSCA) requirements (40 Code of Federal Regulations [CFR] 761). Leaks were observed under the transformers, the stained areas were double washed and rinsed, and postcleanup sampling was done to verify the completion of cleanup as required by TSCA PCB spill cleanup requirements (40 CFR 761.130). For all but one of the PCB-containing transformers, samples collected following their removal indicated that PCB concentrations were less than 10 ppm, the U.S. Environmental Protection Agency (EPA) TSCA cleanup standard. Stained concrete slabs for all the transformers were removed in 1992 and taken to TA-54, Area G. Soil and gravel samples collected from beneath the excavated concrete pads in building 03-0066 indicated PCB concentrations less than 1.6 ppm.

During the removal efforts, approximately three gallons of PCB-containing dielectric fluid were spilled from a 1500-kV transformer located in the J-3 wing of the Building 03-0066 basement. When the transformer was placed on its side for removal from the building, fluid leaked onto the plastic liner inside a containment basin. Approximately 1 qt of fluid leaked from the containment basin onto the concrete basement floor and was subsequently cleaned up in accordance with TSCA PCB spill clean up requirements. After several double wash/double rinse efforts, a pigmented epoxy sealer "plasite" was applied to the spill area (LANL 1995, 057590, pp. 6-65, 6-66).

#### Previous Investigations

On March 17, 1995, confirmatory swipes were collected from four location of the concrete basement floor of building 03-0066 and analyzed for PCBs. The results showed PCB concentrations in all four samples to be below  $2.5 \mu\text{g}/100 \text{ cm}^2$ , which is less than the EPA TSCA cleanup standard of  $10 \mu\text{g}/100 \text{ cm}^2$  (LANL 1995, 057590, p. 6-66).

## Proposed Activities

The nature and extent of contamination have not been defined at this site. Therefore, nine swipe samples will be collected from the basement area that formerly housed the transformers and analyzed for PCBs to confirm the results of the previous investigation and define the extent of contamination (Figure 4.1-17). Table 4.0-1 provides a summary of the proposed sampling locations, and analytical suites.

#### **4.1.5 AOC 03-003(g), Transformer Area—PCB Only Site**

##### **Site Description**

AOC 03-003(g) is the location of a former PCB-containing transformer located in the basement of building 03-0035 (Figure 4.1-13). The transformer contained dielectric fluid with PCB concentrations greater than 500 ppm. In 1984 the transformer was replaced with a non-PCB transformer in accordance with the DOE/Albuquerque Operations Office Environmental Restoration and Waste Management Five-Year Plan (LANL 1995, 057590). Oil staining was not present on the concrete upon removal of the transformer. Archival research revealed no record of releases (LANL 1995, 057590, p. 6-65).

##### **Previous Investigations**

Samples have not been collected from this AOC.

##### **Proposed Activities**

The nature and extent of contamination have not been defined at this site. Therefore, three swipe samples will be collected from the surface of the concrete pad and analyzed for PCBs to determine if PCBs are present (Figure 4.1-17). Table 4.0-1 provides a summary of the proposed sampling locations, and analytical suites.

#### **4.1.6 AOC 03-003(o), Former Non-PCB Capacitor Bank**

##### **Site Description**

AOC 03-003(o) is the location of a former 60-kV capacitor bank in former building 03-0287 (Figure 4.1-6) used as part of an experiment for the Scyllac Project (LANL 1995, 057590, p. 6-69). The Scyllac experiment was energized by a capacitor bank housing 3300 sealed non-PCB capacitors. The sealed capacitors contained a non-PCB dielectric fluid oil and each of the associated spark-gap switches required approximately 2 qt of non-PCB mineral oil for electrical insulation (LANL 1995, 057590, p. 6-69). Before this experiment was decommissioned in the mid-1980s, oil samples from spark gap switches and swipe samples from numerous surfaces within the room where the equipment was housed were analyzed for PCBs. The results showed PCB concentrations of less than 2 ppm.

During the decommissioning of building 03-0287, the capacitors were temporarily stored south of the building at AOC 03-003(o). Swipe samples were collected from the pavement at AOC 03-003(o) and were free of PCB contamination (LANL 1995, 057590, p. 6-69).

##### **Previous Investigations**

No RFI activities have been conducted at this SWMU. However, historical data from the site and data from AOC 03-003(c) confirm that nature and extent have been determined (see section 4.1.2).

##### **Proposed Activities**

No sampling is proposed for this site because it has been characterized and no analytes were detected. Building 03-0287 underwent D&D activities in 2003 and 2004 to make way for the NNSB building. Following the removal of building 03-0287 [including AOC-03-003(o)], approximately 10 ft of clean fill was placed over the entire site before the NNSB building was constructed.

#### 4.1.7 Consolidated Unit 03-009(a)-00

Consolidated Unit 03-009(a)-00 includes SWMUs 03-009(a), 03-028, 03-029, 03-036(a), 03-036(c), 03-036(d), and 03-045(g), and AOCs 03-043(b), 03-043(d), and 03-043(h) (Figure 4.1-1). All these sites are associated with the former asphalt batch plant operations. AOCs 03-043(d) and 03-043(h) are duplicates of SWMU 03-036(a) [SWMU 03-036(a) consists of two former asphalt emulsion tanks; the structure numbers of each duplicate AOC tank corresponds to the structure numbers of the SWMU 03-036(a) tanks] (LANL 1995, 057590, p. 6-19).

The disposal sites within this consolidated units contained items such as concrete, cured asphalt, and soil. Components of these materials include asphalt, petroleum hydrocarbons, water, and light distillates (LANL 1995, 057590, p. 6-15).

Each of the SWMUs and AOCs in this consolidated unit is discussed individually in sections 4.1.7.1 to 4.1.7.10. Proposed sampling for this consolidated unit is provided in the following sections.

##### 4.1.7.1 SWMU 03-009(a), Surface Disposal (Soil Fill)

###### Site Description

SWMU 03-009(a) is a 30-ft x 300-ft fill area located on the rim of a small tributary of Sandia Canyon south of the former TA-03 asphalt batch plant (LANL 1993, 020947, p. 6-16) (Figure 4.1-1). The fill was generated by asphalt plant operations and contained small amounts of concrete, fill, crushed tuff, and asphalt road-construction debris. A 20-ft section of asbestos pipe was observed at SWMU 03-009(a) in 1990; however, the pipe was not found during a 1992 site visit (LANL 1993, 020947, p. 6-17).

###### Previous Investigations

A Resource Conservation and Recovery Act (RCRA) facility investigation (RFI) was conducted at SWMU 03-009(a) in 2003 (LANL 2003, 079747). Three boreholes were advanced to a depth of 20 ft bgs and every 5-ft length of core was field screened for total petroleum hydrocarbons (TPH) diesel range organic (DRO) to guide sample collection. Borehole logs confirm fill materials to be present to a depth of approximately 16 ft bgs at the south end of the site and to a depth of approximately 4 ft bgs at the north end of the site. Samples were submitted for laboratory analyses of inorganic chemicals, VOCs, SVOCs, and TPH. Requested analyses are presented in Table 4.1-1.

Decision-level data are presented in Tables 4.1-3 and 4.1-4. Sampling locations and detected results are shown in Figures 4.1-2, 4.1-3 and 4.1-4. Selenium was detected above BV in two tuff samples, methylene chloride was detected in the fill sample and two tuff samples, and tetrachloroethene (PCE) was detected in the fill sample. SVOCs and TPH were not detected.

###### Proposed Activities

The extent of contamination has not been defined at this site. Twelve subsurface soil samples will be collected from three boreholes to define the vertical extent of contamination (Figure 4.1-5). The samples will be collected from four depths (soil/tuff interface, 9 to 10 ft, 14 to 15 ft, and 19 to 20 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, and cyanide. Four additional soil samples will be collected downgradient from two locations at two depths (0 to 1 ft and 1 to 2 ft) to define the lateral extent of contamination. These samples will be analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, and cyanide. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.



In addition, samples will be collected from the drainage downgradient of this site as part of the Sandia Canyon and Cañada del Buey investigation work plan (LANL 1999, 064617). Section 6.3 provides additional information about the reach investigations to be conducted in Sandia Canyon.

#### **4.1.7.2 SWMU 03-028, Surface Impoundment**

##### **Site Description**

SWMU 03-028 is a former 12-ft- × 15-ft- × 6-ft-deep concrete holding pond at the northeast corner of the former asphalt batch plant (Figure 4.1-1). The site was used as a settling pond for mineral dust and particulates captured by scrubber water from the plant. Water from the pond was recycled to the scrubber system and was replenished with potable water. Discharge from the pond to the SWMU 03-045(g) outfall (see section 4.1.7.10) was intermittent and averaged 300 gal./d when the plant was operational. Discharges from the outfall ceased in 1990 (LANL 1999, 064617, p. 2-7). In 2003, the empty and dry concrete pond was filled with pea gravel, and the surface of the site was paved with asphalt for use as a parking lot (LANL 2008, 099214).

##### **Previous Investigations**

RFI activities were performed during 2003 (LANL 2003, 079741). One soil and three tuff samples were collected from two boreholes in the former holding pond. The soil sample and one tuff sample were collected from one borehole at depths of 5 to 5.5 ft bgs and 19 to 19.5 ft bgs; the remaining two tuff samples were collected from the second borehole at depths of 7.5 to 8 ft bgs and 19.5 to 20 ft bgs. Samples were submitted for laboratory analyses of inorganic chemicals, SVOCs, VOCs, and TPH (Shaw Environmental Inc. 2003, 085517, pp. 10, 26). Requested analyses are presented in Table 4.1-1.

Decision-level data are presented in Tables 4.1-3, 4.1-4 and 4.1-5. Sampling locations and detected results are shown in Figures 4.1-2, 4.1-3 and 4.1-4. Aluminum, arsenic, barium, calcium, copper, lead, magnesium, and nickel were detected above BVs in one tuff sample. Selenium was detected above BV in all three tuff samples. Acetone and methylene chloride were detected in two tuff samples; bis(2-ethylhexyl)phthalate was detected in the soil sample; and benzoic acid was detected in one soil and one tuff sample. TPH was not detected.

##### **Proposed Activities**

No sampling is proposed for this site based on historical sampling. Previous sampling detected several inorganic chemicals at concentrations less than 2 times their respective BVs. The detected organic chemicals decrease in concentration with depth and are below the estimated quantitation limits (EQLs). Therefore, the nature and extent of contamination at this site have been defined.

#### **4.1.7.3 SWMU 03-029, Landfill**

##### **Site Description**

SWMU 03-029 is a 30-ft × 70-ft former landfill located approximately 300 ft south of building 03-0271 near the rim of Sandia Canyon (LANL 1999, 064617, p. 2-17) (Figure 4.1-18). Historically, this landfill received excess asphalt from the batch plant and was subsequently covered with sand. The fill raised and leveled the surface areas at the mesa rim. NMED issued a notice of violation to the Laboratory in November 1990 concerning pieces of asphalt, and an oily sheen found in the Sandia Canyon watercourse below building 03-0073 (LANL 1995, 057590, p. 6-23). The Laboratory completed a required corrective action at

SWMU 03-029 in early 1993 to remove the asphalt within the drainage and on the associated slope, regrade the watercourse and slope to support vegetation, extend the drainage, and construct a concrete berm to prevent additional exposure of asphalt buried in the fill. Dense grass cover was seeded and maintained on all fill slopes and disturbed areas (LANL 1995, 057590, p. 6-24). Water samples collected from the storm drain indicated that oil, grease, or other chemicals typically associated with asphalt plant operations were not present (LANL 1995, 057590 p. 6-24).

An accelerated corrective action (ACA) was proposed for completing the investigation and remediation of SWMU 03-029 in 2004 to accommodate the Laboratory's security perimeter project. SWMU 03-029 was situated in the proposed location for the security perimeter road (LANL 2004, 087474, p. 1). In May 2005, a ground-penetrating radar (GPR) and electromagnetic (EM) survey were conducted at SWMU 03-029. The survey results identified two possible locations for buried waste, which were further investigated by trenching. In July 2005, a total of 12 trenches were excavated to the top of bedrock, approximately 2 to 4 ft bgs, and varied in length from 20 ft to greater than 100 ft. Buried waste was not encountered in any of the trenches (LANL 2005, 091150, p. 10). Because buried waste was not encountered, the remaining proposed ACA activities for SWMU 03-029 were not completed (LANL 2005, 091150, p. 29).

### **Previous Investigations**

Samples have not been collected at this SWMU.

### **Proposed Activities**

The nature and extent of contamination have not been defined at this site. Geophysical surveys will be performed before sample collection to determine the location of potential buried debris (Figure 4.1-22). After the debris is located, at least six samples will be collected from two locations to define the nature and extent of contamination potentially associated with the landfill. Samples will be collected from three depths (at the soil/tuff interface, 4 to 5 ft, and 9 to 10 ft) and will be analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, and cyanide. If geophysical surveys do not locate the debris, samples will be collected from locations based on the historical description of the SWMU. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

In addition, samples will be collected downgradient of this SWMU as part of the investigation for SWMUs 03-045(g) and 03-045(e). Refer to sections 4.1.7.10 and 4.1.30 for more detailed information. Samples will also be collected from the drainage downgradient of this site as part of the Sandia Canyon and Cañada del Buey investigation work plan (LANL 1999, 064617). Section 6.3 provides additional information about the reach investigations to be conducted in Sandia Canyon.

#### **4.1.7.4 SWMU 03-036(a), Aboveground Tanks**

##### **Site Description**

SWMU 03-036(a) is the location of two former asphalt emulsion product tanks (structures 03-0075 and 03-0076), located at the former asphalt batch plant (Figure 4.1-1). The tanks were approximately 25 to 30 ft in diameter and 8 to 12 ft high, with a capacity of 30,000 to 50,000 gal. (LANL 1993, 020947, p. 6-30). The tanks were located within a soil-bermed secondary containment area approximately 225 ft southwest of building 03-0070 (LANL 1995, 057590, p. 6-19). Plant operations resulted in some small spills that were contained within the berms. In 1987, structure 03-0075 ruptured near its base and released 1500 gal. of asphalt emulsion. The spill was contained within the berm, mixed with sand, and disposed of at the Los Alamos County landfill. Between October 1988 and April 1989, both tanks were

removed, cut up, and disposed of in the Los Alamos County landfill. All soil around and beneath the tanks was also removed, mixed with sand, hardened, and deposited at the Los Alamos County landfill (LANL 1993, 020947, p. 6-30). The area was then used to store and prepare crack-sealing machines until batch plant operations ceased in 2002. The surface of the site was paved with asphalt for use as a parking lot in 2003 (LANL 2008, 099214).

### **Previous Investigations**

Before paving the site, sampling activities were conducted in 2003 to characterize the impact of the paving to several SWMUs in the vicinity (LANL 2003, 080912, p. 1). During the investigation, one shallow borehole was drilled at SWMU 03-036(a), and two tuff samples were collected at depths of 8.5 to 9 ft and 19.5 to 20 ft bgs. Samples were submitted for laboratory analyses of inorganic chemicals, VOCs, SVOCs, TPH-DRO, and TPH-gasoline range organic (GRO) (Shaw Environmental Inc., 2003, 085517, pp. 10, 26). Requested analyses are presented in Table 4.1-1.

Decision-level data are presented in Tables 4.1-3, 4.1-4, and 4.1-5. Sampling locations and detected results are shown in Figures 4.1-2, 4.1-3, and 4.1-4. Selenium was detected in one sample above BV. Acetone, PCE, and benzoic acid were also detected. TPH was not detected.

### **Proposed Activities**

No sampling is proposed because the nature of contamination has been defined at this site. Previous sampling detected selenium above BV. However, the selenium concentrations decreased with depth. Organic chemicals were detected at concentrations below the EQLs. Also, at the same sampling location, acetone and PCE concentrations decreased with depth. Currently, SWMU 03-036(a) is overlain with an asphalt parking lot.

#### **4.1.7.5 SWMU 03-036(c), Aboveground Tanks**

##### **Site Description**

SWMU 03-036(c) is the location of a former 30,000-gal. asphalt emulsion tank, structure 03-0178 (Figure 4.1-1). In 1963, structure 03-0178 was relocated to TA-03 from TA-49 to replace the underground asphalt emulsion storage tank, structure 03-0074 [AOC 03-043(a)]. Structure 03-0178 was formerly located approximately 150 ft southwest of building 03-0070. While in use, the tank was partially buried with sand and gravel-packed around the base. In 1989, the tank was removed, cut apart, and disposed of at the Los Alamos County landfill. An inspection determined the tank had not leaked (LANL 1995, 057590, p. 6-19). The former tank location was used to store aggregate and to mix feed for the asphalt batch plant until the plant was decommissioned in 2002. In 2003, the surface of the site was paved with asphalt for use as a parking lot (LANL 2008, 099214).

##### **Previous Investigations**

Before the site was paved, it was sampled in 2003 to characterize the impact of several SWMUs in the vicinity (LANL 2003, 080912, p. 1). During the investigation, one shallow borehole was drilled at SWMU 03-036(c), and two tuff samples were collected at depths of 3 to 4 ft and 19.5 to 20 ft bgs. Samples were submitted for laboratory analyses of inorganic chemicals, VOCs, SVOCs, TPH-DRO, and TPH-GRO (Shaw Environmental Inc., 2003, 085517, pp. 10, 26). Requested analyses are presented in Table 4.1-1.

Decision-level data are presented in Tables 4.1-3 and 4.1-4. Sampling locations and detected results are shown Figures 4.1-2, 4.1-3, and 4.1-4. Arsenic and selenium were detected above BVs in one sample. Acetone was detected in one sample.

### **Proposed Activities**

No additional sampling is proposed for this site because the nature and extent of contamination have been defined. The 2003 investigation analytical results showed detected inorganic chemicals decreased in concentration with depth. The only detected organic chemical (acetone) was detected at 20 ft at a concentration below EQL. Acetone was not detected in shallower samples. In addition, SWMU 03-036(c) is overlain with an asphalt parking lot.

#### **4.1.7.6 SWMU 03-036(d), Underground Tanks**

##### **Site Description**

SWMU 03-036(d) is the location of a former 10,000-gal. underground steel storage tank, structure 03-0335, that stored asphalt emulsion. Structure 03-0335 was located approximately 12 ft north of structure 03-0178 [SWMU 03-036(c)] (Figure 4.1-1). The tank was installed in 1967 and measured 8 ft in diameter × 28 ft long. In 1989, the tank was cleaned out, removed, cut apart, and disposed of at the Los Alamos County landfill. An inspection determined the tank had not leaked (LANL 1995, 057590, p. 6-19). The former tank location was used to store aggregate and to mix feed for the asphalt batch plant until the plant was decommissioned in 2002. In 2003, the surface of the site was paved with asphalt for use as a parking lot (LANL 2008, 099214).

##### **Previous Investigations**

Before the site was paved, it was sampled in 2003 to characterize the impact of several SWMUs in the vicinity (LANL 2003, 080912, p. 1). During the investigation, one shallow borehole was drilled at SWMU 03-036(d), and one tuff sample was collected at a depth of 4.5 to 5 ft bgs. The sample was submitted for laboratory analyses of inorganic chemicals, VOCs, SVOCs, TPH-DRO, and TPH-GRO (Shaw Environmental Inc., 2003, 085517, pp. 10, 26). Requested analyses are presented in Table 4.1-1.

Decision-level data are presented in Tables 4.1-3, 4.1-4, and 4.1-6. The sampling location and detected results are shown in Figures 4.1-2, 4.1-3, and 4.1-4. Lead and selenium were detected above BVs in one sample, and PCE and TPH-GRO were detected in one sample. SVOCs and TPH-DRO were not detected.

##### **Proposed Activities**

No sampling is proposed because the nature and extent of contamination have been defined. Previous sampling detected selenium and lead at concentrations less than 2 times their respective BVs. PCE was detected at a concentration below EQL, and TPH-DRO was detected. TPH results were compared with, and found to be below, NMED's TPH screening guidelines for industrial and residential land uses (NMED 2006, 094614). Based on the analytical results, the nature and extent of contamination are defined at this site.



#### **4.1.7.7 AOC 03-043(b), Aboveground Tank**

##### **Site Description**

AOC 03-043(b) is the location of a former 10,000-gal. asphalt emulsion storage tank, structure 03-0077, installed in 1948 (Figure 4.1-1). The tank was partially buried with sand and gravel packed around the base. In 1980, the tank was cleaned out, removed, cut up, and disposed of at the Los Alamos County landfill. Stained soil beneath and around the tank was excavated and taken to the landfill (LANL 1995, 057590, p. 6-18). The former tank location was used to store aggregate and to mix feed for the asphalt batch plant until it was decommissioned in 2002. In 2003, the surface of the site was paved with asphalt for use as a parking lot (LANL 2008, 099214).

##### **Previous Investigations**

Before the site was paved, it was sampled in 2003 to characterize the impact of several SWMUs in the vicinity (LANL 2003, 080912, p. 1). During the investigation, two shallow boreholes were drilled at AOC 03-043(b). Two tuff samples were collected from one borehole at depths of 9.5 to 10 ft bgs and 19.5 to 20 ft bgs. One tuff sample was collected from the second borehole at a depth of 19.5 to 20 ft bgs. Samples were submitted for laboratory analyses of inorganic chemicals, VOCs, SVOCs, TPH-DRO, and TPH-GRO (Shaw Environmental Inc., 2003, 085517, pp. 10, 26). Requested analyses are presented in Table 4.1-1.

Decision-level data are presented in Tables 4.1-3 and 4.1-4. Sampling locations and detected results are shown in Figures 4.1-2, 4.1-3, and 4.1-4. Aluminum, arsenic, barium, chromium, iron, lead, magnesium, nickel, and zinc were detected above BVs in one sample. Selenium was detected above BV in two samples. Acetone was detected in one sample. SVOCs and TPH were not detected.

##### **Proposed Activities**

No sampling is proposed for this site because the nature and extent of contamination have been defined. Inorganic chemicals decrease in concentration with depth. Acetone was detected below the EQL. In addition, the tank was removed, and the area is overlain with an asphalt parking lot.

#### **4.1.7.8 AOC 03-043(d), Aboveground Tank**

##### **Site Description**

AOC 03-043(d) is a duplicate of SWMU 03-036(a). Section 4.1.7 describes the proposed activities at SWMU 06-036(a).

#### **4.1.7.9 AOC 03-043(h), Aboveground Tank**

##### **Site Description**

AOC 03-043(h) is a duplicate of SWMU 03-036(a). Section 4.1.7 describes the proposed activities at SWMU 03-036(a)

#### 4.1.7.10 SWMU 03-045(g), Storm Drain

##### Site Description

SWMU 03-045(g) consists of a closed and locked storm drain that connected to an outfall, formerly permitted under the EPA National Pollutant Discharge Elimination System (NPDES) as EPA 04A109 (LANL 1993, 020947, p. 6-12). The outfall discharged to a tributary of Sandia Canyon directly south of the former asphalt batch plant (Figure 4.1-1). The storm drain has been closed and locked since late 1990. Outfall 04A109 had been permitted for the discharge of noncontact cooling water and was removed from the NPDES permit in 1994 (LANL 1999, 064617, p. 2-7). Since 1987, the only intentional discharge from the asphalt plant to the outfall was from a former holding pond (SWMU 03-028) used to collect dust from batching operations. Stormwater from parking lots, roads, and roof drains located west of the former asphalt batch plant also discharged to the outfall.

##### Previous Investigations

In 2003, four sediment samples were collected within the catch basin of the closed storm drain (located approximately 150 ft north of the outfall). The four sediment samples were collected from two locations at depths of 0 to 0.5 ft bgs and 1.5 to 2 ft bgs using a hand auger. Samples were submitted for laboratory analyses of inorganic chemicals, VOCs, SVOCs, TPH-DRO, and TPH-GRO (Shaw Environmental Inc., 2003, 085517, pp. 10, 26). Requested analyses are presented in Table 4.1-1.

Decision-level data are presented in Tables 4.1-3, 4.1-4, 4.1-5, and 4.1-6. Sampling locations and detected results are shown in Figures 4.1-2 and 4.1-3. Arsenic and lead were detected above BVs in one sample. Cadmium, cobalt, iron, manganese, potassium, and sodium were detected above BVs in two samples. Barium, copper, vanadium, and zinc were detected above BVs in three samples. Calcium, chromium, magnesium, and nickel were detected above BVs in all four samples. Butylbenzene(n-), isopropyltoluene(4-), trichloroethene (TCE), trimethylbenzene(1,2,4-), and trimethylbenzene(1,3,5-), and TPH-GRO were detected in one sample. Benzo(g,h,i)perylene was detected in two samples. Benzo(a)anthracene, benzo(a)pyrene, benzo(b)fluoranthene, benzo(k)fluoranthene, chrysene, indeno(1,2,3-cd)pyrene, and phenanthrene were detected in three samples. Methylene chloride, bis(2-ethylhexyl)phthalate, fluoranthene, and pyrene were detected in all four samples. TPH-DRO was not detected.

##### Proposed Activities

The nature and extent of contamination have not been defined at this site. Therefore, four samples will be collected from historical location 03-22536 at 1 to 2 ft and 4 to 5 ft to define vertical extent of contamination (Figure 4.1-5). Six soil samples will also be collected from three locations downgradient of the outfall within the drainage to determine the lateral extent of contamination (Figure 4.1-24). The samples will be collected from two depths (0 to 1 ft and 1 to 2 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-GRO and cyanide. No HE or radionuclides are associated with this SWMU; therefore, no samples will be analyzed for nitrate, perchlorate or radionuclides. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

Additional samples will be collected further downgradient of SWMU 03-045(g) as part of the investigation of SWMU 03-045(e). Section 4.1.30 provides further details.

#### **4.1.8 SWMU 03-009(i), Surface Disposal Site**

##### **Site Description**

SWMU 03-009(i) is an inactive surface disposal site located east of the liquid and compressed gas facility (building 03-0170) (Figure 4.1-25). This site consists of construction debris including crushed tuff, pieces of concrete, rock, and piles of fill. This surface disposal site ceased to be used in 1980 (LANL 1995, 057590, p. 6-4).

##### **Previous Investigations**

Samples have not been collected at this SWMU.

##### **Proposed Activities**

The nature and extent of contamination have not been defined at this site. Therefore, four test pits will be excavated, and two grab samples will be collected within each pit at depths of 5 ft and 10 ft to characterize the material (Figure 4.1-28). Two additional locations will be sampled downgradient of the disposal site. Four samples will be collected from these two locations at two depths (0 to 1 ft and 1 to 2 ft) to define lateral extent. Samples will be analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, and cyanide. No HE or radionuclides are associated with this SWMU; therefore, no samples will be analyzed for nitrate, perchlorate, or radionuclides. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

#### **4.1.9 Consolidated Unit 03-012(b)-00, Power Plant**

Consolidated Unit 03-012(b)-00 consists of a holding tank [SWMUs 03-014(q)] and two permitted outfalls [03-045(c) and 03-012(b)] and 03-045(b) (Figure 4.1-29). SWMU 03-045(b) is a duplicate of 03-012(b). The SWMUs within this consolidated unit are associated with the TA-03 power plant (building 03-0022) operations. SWMU 03-014(q) is a cooling-water holding tank; SWMUs 03-045(c), 03-012(b), and 03-045(b) are outfalls that discharge into a small tributary of Sandia Canyon directly south of the steam power (LANL 1996, 052930, p. 57). A gas turbine generator was installed on the eastern side of the power plant within the boundary of Consolidated Unit 03-012(b)-00 in 2007 (LANL 2008, 099214). Each SWMU is discussed individually in sections 4.1.9.1 to 4.1.9.4.

SWMUs 03-012(b) and 03-045(b) are the same discharge point for a permitted outfall associated with the TA-03 steam plant (building 03-0022). Discharge from a permitted outfall at the TA-46 Sanitary Wastewater Systems Consolidation (SWSC) plant is pumped to the TA-03 steam plant for reuse and is released to the SWMUs 03-012(b)/03-045(b) outfall. The outfall received effluent from two cooling towers (structures 03-0025 and -0058) and from the chlorine building (03-0024). Cooling tower 03-0025 was demolished in 1990, but the concrete foundation remains. Stormwater that collects in the concrete foundation of former cooling tower 03-0025 also flows to this outfall from pipe valves that previously were connected to the cooling system. Cooling tower 03-0058 remains and is inactive. From 1951 to 1985, treated effluent from the former TA-03 wastewater treatment plant (WWTP) was used in the two former cooling towers (03-0025 and -0058). Previously, chromates were used to treat cooling tower piping systems to inhibit corrosion; this practice ceased in the late 1970s. Cooling tower 03-0285 serves buildings 03-0132 and 03-1498. A new cooling tower (structure 03-0592) was constructed on the concrete pad of former cooling tower 03-0025 and although cooling tower 03-0058 was replaced, the new cooling tower was given the same structure number.

SWMU 03-014(q) is a holding tank, which receives blowdown from the boilers and wastewater from the water treatment area. Effluent is treated in the holding tank to adjust pH and hinder bacterial growth. Sulfuric acid or sodium hydroxide (as appropriate) is used to maintain a pH of 6 to 9. Effluent is dechlorinated before it is discharged into Sandia Canyon. Three uncontrolled releases of acidic wastewater to this outfall occurred on May 20 to May 21, 1990. Low potential of hydrogen (pH) values were observed in a 2.5-mi section of the watercourse below the outfall. Soda ash was added manually to the length of the watercourse, and a May 23, 1990, pH survey detected no pH measurements below 6.9. In compliance with the NPDES permits, the outfall effluent is monitored periodically for TSS, pH, and total chlorine.

SWMU 03-045(c) is a permitted outfall, located about 55 ft east of SWMU 03-012(b)/03-045(b). SWMU 03-045(c) receives effluent from a cooling tower (structure 03-0285), which serves the generators that power the Laboratory's computer system. This outfall may have received chromate-treated water.

In 2002, soil samples were collected around the mesa-top structures of Consolidated Unit 03-012(b)-00 to characterize site conditions and waste before a gas turbine generator and associated utilities were installed. The sampling objective was to determine if any releases to the mesa-top soil occurred from the cooling towers. Sampling was conducted within the anticipated footprint of the proposed utility corridor for the new gas turbine cooling towers (Caporuscio 2003, 088444, pp. 1-2). Twenty-eight fill samples were collected from 14 locations at depths of 0 to 0.5 ft and 0.5 to 1 ft; 4 fill samples were collected at four locations from a depth of 0.5 to 1 ft. The samples were analyzed for metals and hexavalent chromium. Requested analyses are presented in Table 4.1-1.

The 2002 decision-level data are presented in Table 4.1-3. Sampling locations and detected results are shown in Figures 4.1-30, 4.1-31, and 4.1-32. Mercury was detected above BV in 1 fill sample; copper was detected above BV in 2 fill samples; cadmium was detected above BV in 3 samples; chromium, silver, and zinc were detected above BVs in 6, 5, and 10 fill samples, respectively. Hexavalent chromium was detected in 17 fill samples. Detection limits for antimony, cadmium, silver, and thallium were greater than BVs in one fill sample.

In 2004, 18 soil samples were collected from nine locations at the planned location of a new utility trench for the gas turbine generator. The sampling activities included the collection of surface and subsurface soil samples from the mesa top directly north and east of a former cooling tower (structure 03-0025). Sixteen samples were collected from eight locations at depths of 0 to 0.5 ft and 3.5 to 4 ft bgs; two samples were collected from a ninth location at depths of 0.8 to 1.3 ft and 1.8 to 2.8 ft bgs. All samples were analyzed for metals and hexavalent chromium. Four surface soil samples were also analyzed for PCBs (LANL 2003, 080102; LANL 2003, 100705, pp. 2–20). Requested analyses are presented in Table 4.1-1.

The 2004 decision-level data are presented in Tables 4.1-3 and 4.1-6. Sampling locations and detected results are shown in Figures 4.1-30, 4.1-31, and 4.1-32. Zinc was detected above BV in three samples. Chromium and silver were detected above BVs in four and five samples, respectively. Hexavalent chromium was detected in five samples. The detection limit for cadmium was greater than BV in numerous samples. Aroclor-1254 and Aroclor-1260 were detected in three and four samples, respectively.

Proposed sampling for this consolidated unit is provided in the following sections.



#### 4.1.9.1 SWMU 03-012(b), Operational Release and Outfall

##### Site Description

SWMU 03-012(b) is the outfall associated with the TA-03 power plant, building 03-0022 (Figure 4.1-29). From 1951 to 1985, SWMU 03-012(b) discharged cooling water originating from treated effluent generated by the TA-03 WWTP (Consolidated Unit 03-014(a)-99). In the past, water from the WWTP was treated with chromates before it was used as cooling water at the power plant. The NPDES permit number for the outfall was previously identified as EPA 01A001, but is currently permitted as 001 on the 2007 NPDES authorization permit (EPA 2007, 099009). The outfall is currently authorized to discharge power plant wastewater from cooling towers, boiler blowdown drains, demineralizer backwash, floor and sink drains, and treated sanitary reuse to Sandia Canyon (EPA 2007, 099009, p. 1). The outfall discharges onto sand and gravel southeast of building 03-0022 and into a small tributary of Sandia Canyon. Discharge from another permitted outfall (13S) at the TA-46 SWSC plant is pumped to the TA-03 power plant for reuse and eventually discharges to SWMU 03-012(b). The outfall received effluent from two power plant cooling towers (structures 03-0025 and 03-0058) and the chlorine building (structure 03-0024). One cooling tower (structure 03-0025) was demolished in 1990, but until 1998, when a new cooling tower (structure 03-0592) was constructed at the same location (LANL 2008, 099214), the concrete foundation of structure 03-0025 collected stormwater that discharged to the outfall (LANL 1996, 052930, p. 56). The two cooling tower structures (03-0058 and 03-0592) are currently in operation and continue to discharge to SWMU 03-012(b) (LANL 2008, 099214).

A one-time release of sulfuric acid to the SWMU 03-012(b) outfall from the power plant holding tank, structure 03-0336 [SWMU 03-014(q)], occurred in 1990 (LANL 1995, 057590, p. 5-27-1). Low pH values were observed in a 2.5-mi section of the watercourse below the outfall. Soda ash was added along the watercourse to raise the pH. A subsequent survey detected no measurements below pH 6.9 (LANL 1996, 052930, p. 56).

##### Previous Investigations

RFI activities were conducted at SWMU 03-012(b) in 1994. Eleven soil and sediment samples were collected from five locations at a depth of 0 to 0.5 ft bgs. Four of the samples were collected from two locations (three from one location and one from another) near the outfall. Seven samples were collected from three downstream locations (three samples each from two locations and one from a third) to characterize the sediment in the outfall channel. All samples were submitted for laboratory analyses of PCBs, gross-alpha, -beta, and -gamma radiation, and tritium; eight samples were submitted for laboratory analysis of herbicides; five samples were submitted for laboratory analyses of inorganic chemicals, VOCs, SVOCs, pesticides, and gamma spectroscopy; one sample was submitted for laboratory analyses of isotopic plutonium, uranium, and strontium-90 (LANL 1996, 052930, pp. 57–60). Requested analyses are presented in Table 4.1-2.

Screening-level data are presented in Tables 4.1-11, 4.1-13, 4.1-14, and 4.1-15. Sampling locations are shown in Figures 4.1-30, 4.1-31, and 4.1-32. Arsenic, cadmium, lead, and nickel were detected in one sample above BVs. Chromium and silver were detected in two samples above BVs. Anthracene, benzo(a)anthracene, benzo(a)pyrene, benzo(b)fluoranthene, benzo(g,h,i)perylene, benzo(k)fluoranthene, chrysene, dibenz(a,h)anthracene, indeno(1,2,3-cd)pyrene, phenanthrene, pyrene, and total PCBs were detected in one sample. Fluoranthene was detected in two samples. Aroclor-1260 was detected in three samples. Plutonium-238, plutonium-239/240, uranium-234, uranium-235, and uranium-236 were detected above BVs/FVs in one sample. Tritium was detected in three samples.

## Proposed Activities

The nature and extent of contamination have not been defined at this site because it is an active outfall. During the investigation, sampling will be conducted to identify if any contaminants are present below the outfall. Eight sediment and soil samples will be collected from four locations along the drainage for SWMUs 03-045(c) and 03-012(b) (Figure 4.1-33). Samples will be collected from four locations along the drainage at two depths (0 to 1 ft and 1 to 2 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, cyanide, and PCBs. Sampling locations will be biased toward areas of sediment accumulation. No HE or radionuclides are associated with this SWMU; therefore, no samples will be analyzed for nitrate, perchlorate, or radionuclides. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

In addition, samples will be collected both upgradient and downgradient of this SWMU as part of the investigation for SWMUs 03-045(a), 03-045(c), and 03-045(f). Sections 4.1.9.4, 4.1.29, and 4.1.31 provide further details. Samples will also be collected from the drainage downgradient of this site as part of the Sandia Canyon and Cañada del Buey investigation work plan (LANL 1999, 064617). Section 6.3 provides additional information about the reach investigations to be conducted in Sandia Canyon. To complete the characterization of this site, additional sampling will be conducted when operations cease and the outfall becomes inactive.

### 4.1.9.2 SWMU 03-014(q), Holding Tank

#### Site Description

SWMU 03-014(q) (Figure 4.1-29) is the former effluent sewage storage tank (structure 03-0336) for the power plant (building 03-0022) (LANL 1990, 007511, p. 3-014). Between 1951 and 1985, the tank received and stored effluent from the former WWTP for use as cooling water for the power plant cooling towers (structures 03-0025 and 03-0058). The effluent was pumped to the holding tank and treated to hinder bacteria growth. In the past, chromates were used to treat the effluent (LANL 1993, 020947, p. 5-48).

#### Previous Investigations

Although samples have not been collected at this SWMU, soil and fill samples were collected within the vicinity of the SWMU during the 2002 and 2004 sampling activities for Consolidated Unit 03-012(b)-00, discussed in section 4.1.9. Requested analyses for sampling at Consolidated Unit 03-012(b)-00 are presented in Table 4.1-1. Data for Consolidated Unit 03-012(b)-00 are presented in Tables 4.1-3 and 4.1-6. Sampling locations and detected results for Consolidated Unit 03-012(b)-00 are shown in Figures 4.1-30, 4.1-31, and 4.1-32.

#### Proposed Activities

The nature and extent of contamination have not been defined at this site. Therefore, six samples will be collected from three locations upgradient and downgradient at two depths (0 to 1 ft and 1 to 2 ft) and analyzed for inorganic chemicals and PCBs to confirm previous sampling results and characterize the site (Figure 4.1-33). Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

#### **4.1.9.3 SWMU 03-045(b), Operational Release**

SWMU 03-045(b) is a duplicate of SWMU 03-012(b). Section 4.1.9.1 provides further details.

#### **4.1.9.4 SWMU 03-045(c), Outfall**

##### **Site Description**

SWMU 03-045(c) is an NPDES-permitted outfall (EPA 03A027), located approximately 55 ft east of SWMU 03-012(b) (LANL 1996, 052930, p. 56) (Figure 4.1-29). SWMU 03-045(c) receives effluent from a cooling tower (structure 03-0285), which serves the generators that power The Laboratory's computer system. SWMU 03-045(c) may have received chromate-treated water (LANL 1996, 052930, pp. 56–57). Outfall 03A027 is currently permitted for the discharge of cooling tower blowdown water and other wastewater from structure 03-0285 (EPA 2007, 099009).

##### **Previous Investigations**

Sampling has not been conducted at SWMU 03-045(c).

##### **Proposed Activities**

The nature and extent of contamination have not been defined at this site because it is an active outfall. Within this investigation sampling will be conducted to identify if any contaminants are present below the outfall. Eight sediment and soil samples will be collected from four locations along the drainage for SWMUs 03-045(c) and 03-012(b) (Figure 4.1-33). Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites. Section 4.1.9.1 provides further details on the proposed sampling.

In addition, samples will be collected both upgradient and downgradient of this SWMU as part of the investigation for SWMUs 03-045(a), 03-012(b), and 03-045(f). Sections 4.1.9.1, 4.1.29, and 4.1.31 provide further details. Samples will also be collected from the drainage downgradient of this site as part of the Sandia Canyon and Cañada del Buey investigation work plan (LANL 1999, 064617). Section 6.3 provides additional information about the reach investigations to be conducted in Sandia Canyon. To complete the characterization of this site, additional sampling will be conducted when operations cease and the outfall becomes inactive.

#### **4.1.10 Consolidated Unit 03-013(a)-00**

Consolidated Unit 03-013(a)-00 consists of SWMUs 03-013(a) and 03-052(f) (Figure 4.1-35). SWMU 03-013(a) is a storm drain that served building 03-0038 (Figure 4.1-34); SWMU 03-052(f) is the associated outfall located northeast of building 03-0207 (Figure 4.1-35) that ultimately discharged into Sandia Canyon (LANL 1996, 052930, p. 73). SWMU 03-013(b) (building 03-0038 floor drains, discussed in section 4.11) formerly drained into SWMU 03-052(f) but was rerouted to the sanitary sewer system in 1987 (LANL 1995, 057590, p. 5-25-1).

Proposed sampling for this consolidated unit is provided in the following sections.

#### 4.1.10.1 SWMU 03-013(a), Storm Drain

##### Site Description

SWMU 03-013(a) is a 1500-ft long corrugated metal pipe storm drain that served building 03-0038 (LANL 1996, 052930, p. 73) (Figures 4.1-34 and 4.1-35). The storm drain ran underground around building 03-0038, east along the south side of the Otowi Building (building 03-0261), and connected to four other storm drains before daylighting 100 ft east of the Otowi Building where it became an open concrete and rock-lined ditch (LANL 1993, 020947, p. 5-92). The open drain continued past transportable office buildings (buildings 03-1616 and 03-1617) and passed beneath streets and sidewalks to a point northeast of the Oppenheimer Study Center (structure 03-0207) where it discharged to former NPDES-permitted outfall EPA 03A023 [SWMU 03-052(f)] (Figure 4.1-35) before draining into Sandia Canyon (LANL 1993, 020947, p. 5-92).

Most of SWMU 03-013(a) was removed in 2004 to accommodate the construction of the NSSB and a new parking structure (LANL 2008, 099214). The corrugated metal pipe was managed as nonhazardous/nonradioactive industrial waste. Inspection of the drainline trench showed no evidence of a release from the drainpipe. A new storm drainline was installed west of SWMU 03-052(f) to manage stormwater runoff from the new NSSB parking structure.

##### Previous Investigations

RFI activities were conducted for SWMU 03-013(a) in the summer of 1994 as part of the RFI for Consolidated Unit 03-013(a)-00. Seven sediment samples (five samples plus one field duplicate and one collocated sample) were collected from five locations (at depths ranging from 0 to 0.6 ft) along the sides and within the SWMU 03-052(f) outfall channel 10 to 50 ft downstream from the outfall pipe (LANL 1995, 057590, p. 5-25-3). Sampling locations were biased to areas where sediment could be collected (LANL 1996, 052930, p. 75). Samples were field-screened and analyzed for gross-alpha, -beta, and -gamma radiation, tritium, inorganic chemicals, PCBs, VOCs, and SVOCs. Requested analyses are presented in Table 4.1-2.

Screening-level data are presented in Tables 4.1-11 and 4.1-14. Sampling locations are shown in Figures 4.1-36, 4.1-37, and 4.1-38. Chromium, copper, and mercury were detected above BVs in one sample. Lead was detected above BVs in three samples and zinc in six samples. Aroclor-1254 and total PCBs were detected in one sample. VOCs, SVOCs, and radionuclides were not detected.

The investigation also found low-level concentrations of polycyclic aromatic hydrocarbon (PAHs), which were attributed to runoff from the adjacent parking lot (LANL 1996, 052930, p. 82).

##### Proposed Activities

No sampling is proposed for SWMU 03-013(a) because most of this SWMU was excavated to accommodate the construction of the NSSB. Although the remaining portion of this drainline is inaccessible, SWMU 03-013(a) discharged to an associated storm drainage [SWMU 03-052(f)], which will be investigated, as described in section 4.1.10.2.



#### **4.1.10.2 SWMU 03-052(f), Outfall**

##### **Site Description**

SWMU 03-052(f) is a formerly NPDES-permitted outfall (EPA 03A023) (Figure 4.1-35) that received wastewater from floor drains [AOC 03-013(b)], sinks, water fountains and a storm drain [SWMU 03-013(a)] that served building 03-0038 (Figure 4.1-34) until 1987 when the drains in building 03-0038 were rerouted to the TA-03 sanitary sewer system. Stoddard solvents, dry acid, and caustic materials from the maintenance shop were discarded through sinks and floor drains to this outfall. Spent paint solvents and cutting oils contaminated with machined beryllium particles may also have been released to the floor drains during the 1960s and 1970s. In addition, cooling water for welding torches was discharged directly to the drains. The first spill was approximately 200 gal. of water/waste oil mixture that was discharged when an automatic compressor blowdown mechanism failed. A second spill from a ruptured air-compressor oil line resulted in the release of approximately 1 qt of compressor oil to the drain. This spill produced an oily sheen on the surface of the water at the outfall (LANL 1995, 057590, p. 5-25-1). A third spill occurred when approximately 15 gal. of diesel fuel was released from a ruptured truck fuel line into the utilities construction trench between buildings 03-1793 and 03-1794. On the same day, a clay sewer pipe in the utility trench broke, releasing approximately 2000 gal. of wastewater into the excavation. A sump was used to remove the wastewater from the excavation and the wastewater was discharged to SWMU 03-052(f). The diesel-contaminated asphalt and soil was removed and disposed of at Sigma Mesa. Runoff from parking lots and the surrounding areas also discharge to the outfall (LANL 1995, 057590, p. 5-25-2). Outfall 03A023 was removed from the NPDES permit on July 11, 1997.

##### **Previous Investigations**

RFI activities conducted at SWMU 03-052(f) are the same activities conducted for SWMU 03-013(a), which was part of the 1994 RFI for Consolidated Unit 03-013(a)-00 (LANL 1996, 052930, pp. 73–74, 77). Sampling conducted for SWMU 03-013(a) is reported in section 4.1.10.1. Requested analyses are presented in Table 4.1-2. Data are presented in Tables 4.1-11 and 4.1-14. Sampling locations are shown in Figures 4.1-36, 4.1-37, and 4.1-38.

##### **Proposed Activities**

The nature and extent of contamination have not been defined at this site. Fourteen sediment and soil samples will be collected at seven locations along the storm drainage to confirm previous sampling results and to define nature and extent of contamination (Figure 4.1-39). The samples will be collected at two depths (0 to 1 ft and 1 to 2 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, PCBs, cyanide, perchlorate, and radionuclides. No HE is associated with this SWMU; therefore, no samples will be analyzed for nitrate. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

#### **4.1.11 AOC 03-013(b), Floor Drains**

##### **Site Description**

AOC 03-013(b) consists of floor drains located in the basement of building 03-0038 (LANL 1993, 020947, p. 5-92) (Figure 4.1-35). The floor drains were located in the plasma-burning machine area, the metals-cutting room, and the pipe-fabrication shop. Until 1987, the floor drains emptied into a storm drain [SWMU 03-013(a)] (LANL 1993, 020947, p. 5-93). SWMU 03-013(b) ultimately discharged to the outfall at SWMU 03-052(f) (Figures 4.1-34 and 4.1-35) (LANL 1996, 052930, pp. 73–74). The piping for

SWMU 03-013(b) was rerouted to the sanitary sewer line in 1987. During the 1960s and 1970s, spent paint solvents and cutting oils contaminated with machined beryllium particles may have been released to the floor drains.

### **Previous Investigations**

RFI activities conducted at AOC 03-013(b) are the same activities conducted for SWMU 03-013(a), which was part of the 1994 RFI for Consolidated Unit 03-013(a)-00 (LANL 1996, 052930, pp. 73–74, 77).

Sampling conducted for SWMU 03-013(a) is discussed in section 4.1.10.1. Requested analyses are presented in Table 4.1-2. Data are presented in Tables 4.1-11 and 4.1-14. Sampling locations are shown in Figures 4.1-36, 4.1-37, and 4.1-38.

### **Proposed Activities**

No sampling is proposed for SWMU 03-013(b) because it was removed during the construction of the NSSB. SWMU 03-013(b) discharged to associated storm drainage [SWMU 03-052(f)] as described in section 4.1.10.2.

#### **4.1.12 SWMU 03-013(i), Operational Release**

##### **Site Description**

SWMU 03-013(i) is an area soil and gravel contamination from historical releases of hydraulic oil at buildings 03-0246 and 03-0247 (Figure 4.1-40). These buildings housed operations that involved testing the tensile strength of various steel cables used in conjunction with underground nuclear test assemblies. The cable control building (building 03-0246) and the cable stress building (building 03-0247) were collectively referred to as the Pull Test Facility. The facility was constructed before 1967 and operated until the mid-1980s when a replacement facility was constructed on Sigma Mesa. Building 03-0246 was constructed on a concrete slab that contained a hydraulic oil compressor and storage tank. Building 03-0247 was constructed on a concrete curb surrounding a gravel floor that contained two hydraulic rams used to perform the tensile strength testing. Hydraulic oil was provided to the rams through underground pipes between the buildings (LANL 2005, 091540, pp. 1-2).

Hydraulic oil is likely to have been released to the concrete slab floor inside building 03-0246 and subsequently flowed beneath the building walls and onto the soil surrounding the building. Soil staining was evident along the north side of the building and along the northeast and northwest corners. The gravel floor inside building 03-0247 was visibly stained with oil in several locations beneath the hydraulic ram assembly (LANL 2004, 087406, p. 1). Building 03-0247 and its contents were demolished and removed in 2005. The contents and the concrete slab of building 03-0246 were also demolished and removed in 2005. Following the demolition and removal of the concrete slab, approximately 144 ft<sup>2</sup> of contaminated soil was excavated from the footprint of building 03-0246. Following the demolition and removal of building 03-0247 and its gravel floor, an 8-in. concrete slab was exposed that was connected to the building foundation on the north and west sides. The slab was removed, and stained soil and debris were also removed from SWMU 03-013(i). Confirmation samples were collected at both locations after demolition and removal, and the excavation was backfilled and graded (LANL 2005, 091540, pp. 1-4).

##### **Previous Investigations**

Eight fill samples were collected from four locations following the excavation of the footprint of building 03-0246 from depths of 0 to 0.5 ft and at 1.5 ft bgs. Four confirmatory fill samples were also

collected from two locations downgradient of former building 03-0246 at depths of 0 to 0.5 ft and at 1.5 ft bgs. Four additional fill samples were collected at two locations within the footprint of building 03-0247 at depths of 0 to 0.5 ft and at 1.5 ft bgs (LANL 2005, 091540, pp. 4–5). A total of 16 samples were submitted for laboratory analyses of inorganic chemicals, SVOCs, PCBs, TPH-DRO, and TPH-GRO. Each of the samples collected from 1.5 ft bgs were also submitted for VOCs. Requested analyses are presented in Table 4.1-1.

Decision-level data are presented in Tables 4.1-3, 4.1-4, 4.1-5, and 4.1-6. Sampling locations are shown in Figures 4.1-41 and 4.1-42. Barium, copper, and nickel were detected above BVs; antimony, lead, and zinc were detected above BVs in three, seven, and eight samples, respectively; cadmium was detected above BV in eight samples. The detection limits for cadmium were greater than BVs in three samples and the detection limit for selenium was greater than BV in most samples. Acenaphthene and butanone(2-) were detected in one sample. Acenaphthylene, anthracene, isopropyltoluene(4-), and methylnaphthalene(2-) were detected in two samples. Benzoic acid, bis(2-ethylhexyl)phthalate, fluorene, and pyrene were detected in three samples. Acetone, fluoranthene, and phenanthrene were detected in four samples. Aroclor-1260 and Aroclor-1254 were detected in 10 and 12 samples, respectively. TPH-GRO and TPH-DRO were detected in 10 and 16 samples, respectively.

### **Proposed Activities**

The nature and extent of contamination have not been defined at this site. Thirty-two soil samples will be collected from 16 locations from two depths (0 to 1 ft and 4 to 5 ft) to define the extent of contamination (Figure 4.1-43). Samples will be submitted for analyses of inorganic chemicals, VOCs, SVOCs, TPH-DRO, cyanide, and PCBs. No HE or radionuclides are associated with this SWMU; therefore, no samples will be analyzed for nitrate, perchlorate, or radionuclides. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

#### **4.1.13 Consolidated Unit 03-014(a)-99**

Consolidated Unit 03-014(a)-99 consists of 20 of the 30 SWMUs and AOCs associated with the former WWTP that operated at TA-03 from 1951 to 1992, until the Laboratory's SWSC Plant became active in 1992 (LANL 1993, 020947, p. 5-46). The former WWTP is adjacent to and east of the utilities control center (building 03-0223) on the southern rim near the head of Sandia Canyon. The WWTP served TA-03, TA-43, TA-59, and TA-60, the trailer park on West Jemez Road, and holding tank and septic system wastes throughout the Laboratory. The WWTP also began treating sanitary wastes from TA-02 and TA-41 in 1990 and TA-21 in 1992. The WWTP had two parallel systems, the north plant (Plant 1) built in 1951, and the south plant (Plant 2) built in 1964. Each system consisted of entrance works, Imhoff tanks, dosing siphons, trickling filters, and final clarifying tanks. The plants were different in some physical dimensions but essentially functioned identically. The WWTP was designed with a 750,000 gal./d combined capacity (LANL 1993, 020947, p. 5-45). Although no longer operational, SWMUs and AOCs associated with Consolidated Unit 03-014(a)-99 are still present, the locations of which are shown in Figure 4.1-44.

Upon entering each plant, raw sewage was first metered at a splitter box (structure 03-0677), where the flow was diverted to either Plant 1 or Plant 2. The water passed through a comminutor that shredded large solid material. Manually cleaned bar racks were available for both plants when the comminutors were down for repair. Effluent flow was approximately 150,000 gal./d (LANL 1993, 020947, pp. 5-45–5-47). The splitter box, comminutor, and bar racks are collectively identified as SWMU 03-014(i) (LANL 1993, 020947, p. 5-46).

Water passed from the entrance works directly to the Imhoff tanks, structures 03-0049 and 03-0192 [SWMUs 03-014(a) and 03-014(e)], which functioned as settling/digestion tanks. Effluent water flowed from the Imhoff tanks to dosing siphons, structures 03-0048 and 03-0193 [SWMUs 03-014(b) and 03-014(f)], then to the trickling filters, structures 03-0047 and 03-0194 [SWMUs 03-014(c) and 03-014(g)], where organic waste was biologically digested through bacterial growth on rock media (LANL 1993, 020947, p. 5-47). Material sloughed from the trickling filter media settled in final clarifying tanks, structures 03-0046 and 03-0195 [SWMUs 03-014(d) and 03-014(h)]; the resulting sludge was then recirculated back to the head of the plant to allow solids to settle out in the Imhoff tanks (LANL 1993, 020947, p. 5-47).

Sludge collected in the Imhoff tanks was ultimately siphoned to four sludge drying beds, structures 03-0196, 03-0197, 03-0198, and 03-0199 [SWMUs 03-014(k), 03-014(l), 03-014(m), and 03-014(n)] located immediately north of the Imhoff tanks. Three of the four beds were used for sludge drying, while the fourth was used as a skimmer bed. Overflow sludge was directed to three additional sludge drying beds, structure 03-1871 [SWMU 03-014(o)], located north and downslope of the four sludge drying beds, and west of the chlorine contact chamber [SWMU 03-014(j)] (LANL 1993, 020947, p. 5-47). The four sludge drying beds, constructed in 1965, are referred to as the "upper beds," while the other three sludge drying beds, constructed in 1987, are referred to as the "lower beds" (LANL 1993, 020947, p. 5-46; LANL 1997, 056660.4, p. 57).

Effluent from the sludge beds flowed from a subsurface drain system to a holding tank, structure 03-1901 [SWMU 03-014(u)]. The contents of the tank were recirculated by truck to the head of the plant for additional treatment. From the late 1950s to the late 1970s, dried sludge was added to the soil around the entrance works as a soil amendment (LANL 1993, 020947, p. 5-47).

Additional AOCs and SWMUs addressed as part of Consolidated Unit 03-014(a)-99 include AOCs 03-014(b2) and 03-014(c2), historical outfalls associated with the former WWTP; SWMU 03-014(p), a lift station associated with the former WWTP; and SWMU 03-056(d), a drum storage area located on the north side and adjacent to SWMU 03-14(c) trickling filter (structure 03-0047).

RFI activities were performed at the former WWTP in 1994 and 1997. In 1994, the area around the Imhoff tanks and the two historical outfalls were sampled. The Imhoff tanks were sampled because treated sludge was directly applied to the soil in the grassy areas around the tanks. The historical outfalls [AOC 03-014(b2) and AOC 03-014(c2)] were sampled because AOC 03-014(b2) was an active outfall for the WWTP, and AOC 03-014(c2) was believed to be an out-of-service outfall trench but was subsequently identified as a storm drain trench and overflow outlet pipe outfall (LANL 1996, 052930, p. 83). In 1997, the sludge drying beds [SWMUs 03-014(k), 03-014(l), 03-014(m), and 03-014(o)] were sampled. SWMU 03-014(n) was scheduled for sampling; however, oil was discovered in the bed, which was subsequently remediated in early September 1997 (LANL 1997, 056660.4, p. 60). RFI activities for SWMUs and AOCs in Consolidated Unit 03-014(a)-99 are discussed in more detail in sections 4.1.13.1 to 4.1.13.20.

Proposed sampling for this consolidated unit is provided in the following sections.

#### **4.1.13.1 SWMU 03-014(a), Structure Associated with Former WWTP**

##### **Site Description**

SWMU 03-014(a) is the Imhoff tank (structure 03-0049) for Plant 1 of the former WWTP (Figure 4.1-44). Water and effluent passed from the entrance works directly to the Imhoff tank, which functioned as a settling/digestion tank (LANL 1993, 020947, p. 5-47).



## Previous Investigations

A Phase I RFI was performed at SWMUs 03-014(a) and 03-014(e) (section 4.1.13.7) in 1994. The area around these SWMUs (structures 03-0049 and 03-0192) was sampled to determine whether contaminants were released as a result of the application of sludge to the soil or from tank overflow (LANL 1996, 052930, p. 85).

Twelve soil samples (including two duplicates) were collected from five locations between and downgradient of the SWMUs. Two samples were collected from each location at depths of 0 to 1 ft bgs and 1 to 1.5 ft bgs. Samples from the 0- to 1-ft interval were submitted for laboratory analyses of inorganic chemicals, SVOCs, PCBs, pesticides, herbicides, gross-alpha, -beta, and -gamma radiation, gamma spectroscopy, isotopic plutonium and uranium, and tritium. Samples from the 1- to 1.5-ft interval were submitted for laboratory analyses of cyanide, VOCs, gross-alpha, -beta, and -gamma radiation, and tritium (LANL1996, 052930, p. 85). Requested analyses are presented in Table 4.1-2.

Screening-level data are presented in Tables 4.1-11, 4.1-14, and 4.1-15. Sampling locations are shown in Figures 4.1-45, 4.1-46, and 4.1-47. Cyanide was detected above BV in three samples. Cadmium, chromium, copper, lead, mercury, silver, and zinc were each detected above BVs in five samples. Aroclor-1260 was detected in four samples at concentrations less than 1 ppm. Americium-241, uranium-235, and uranium-238 were detected above BVs/FVs in one sample. Uranium-234 was detected above BV/FV in four samples. Plutonium-239/240 and plutonium-238 and were detected above BVs/FVs in four and five samples, respectively. VOCs, SVOCs, pesticides, and herbicides were not detected.

## Proposed Activities

The nature and extent of contamination have not been defined at this site. Fifteen soil samples will be collected from five locations to confirm the results of previous sampling events and to define the extent of contamination for SWMUs 03-014(a), 03-014(b), 03-014(e), and 03-014(f) because of their close proximity (Figure 4.1-48). The samples will be collected from three depths (0 to 1 ft, 1 to 2 ft, and soil/tuff interface) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, PCBs, cyanide, perchlorate, nitrate, and radionuclides. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

### 4.1.13.2 SWMU 03-014(b), Structure Associated with Former WWTP

#### Site Description

SWMU 03-014(b) is the dosing siphon (structure 03-0048) for Plant 1 of the former WWTP (Figure 4.1-44). Effluent from the Imhoff tank (structure 03-0049) flowed to the dosing siphon, which dispersed accumulated effluent water in an amount sufficient to run the trickling filter (structure 03-0047) rotary arms. The dosing siphon maintained the moisture throughout the trickling filter's rock media beds (LANL 1993, 020947, p. 5-47).

#### Previous Investigations

SWMU 03-014(b) was not specifically sampled as part of historical RFI activities, but soil samples collected as part of the 1994 RFI activities for SWMUs 03-014(a) and 03-014(e) were within the vicinity of SWMU 03-014(b). Samples for SWMU 03-014(a) are discussed in section 4.1.13.1. Requested analyses are presented in Table 4.1-2. Data are presented in Tables 4.1-11, 4.1-14, and 4.1-15. Sampling locations are shown in Figures 4.1-45, 4.1-46, and 4.1-47.

## Proposed Activities

The nature and extent of contamination have not been defined at this site. Fifteen soil samples will be collected from five locations to confirm the results of previous sampling events and to define the extent of contamination for SWMUs 03-014(a), 03-014(b), 03-014(e), and 03-014(f) because of their close proximity (Figure 4.1-48). Section 4.1.13.1 provides more detailed information regarding the proposed sampling for the four SWMUs. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

### 4.1.13.3 AOC 03-014(b2), Outfall

#### Site Description

AOC 03-014(b2) is a former NPDES-permitted outfall (EPA SSS01S) for the former WWTP (Figures 4.1-45, 4.1-46, and 4.1-47). The outfall received treated effluent from a flow-measurement weir north of the WWTP chlorination system [SWMU 03-014(j), see section 4.1.13.12] dosing and contact chamber via a 1.5-ft-diameter × 300-ft-long corrugated metal pipe. The outfall discharged to a rocky outcrop at the edge of Sandia Canyon (LANL 1993, 020947, p. 5-49). Outfall SSS01S was permitted for the discharge of wastewater and was removed from the NPDES permit in 1994 (LANL 1999, 064617, p. 27).

AOC 03-014(b2) received effluent from the former WWTP from 1989 to 1992, when the WWTP was decommissioned. AOC 03-014(b2) received treated effluent from the SWSC plant at TA-46 from 1992 to 1998, when the effluent was switched to the outfall at the power plant, building 03-0027. AOC 03-014(b2) was monitored 3 times per month for biochemical oxygen demand, total suspended solids (TSS), pH, fecal coliform, total chlorine, and radioactive constituents. From 1989 to 1993, radioactive constituents were reported over the detection limits (LANL 1993, 020947, p. 5-49).

#### Previous Investigations

A Phase I RFI was conducted at AOC 03-014(b2) in 1994 to determine whether discharge to the outfall resulted in the release of any contaminants to the site. Twelve sediment samples were collected from four locations along the outfall channel and in the outfall flow path in areas where sediment accumulated. Samples were submitted for laboratory analyses of inorganic chemicals, VOCs, SVOCs, PCBs, pesticides, herbicides, gross-alpha, -beta, and -gamma radiation, gamma spectroscopy, and tritium (LANL 1996, 052930, pp. 95–98). Requested analyses are presented in Table 4.1-2.

Screening-level data are presented in Tables 4.1-11, 4.1-12, 4.1-13, and 4.1-15. Sampling locations are shown in Figures 4.1-45, 4.1-46, and 4.1-47. Chromium was detected above BV in one sample. Lead and silver were detected above BVs in two samples. The analytes 4-isopropyltoluene, toluene, and bis(2-ethylhexyl)phthalate were detected in one sample. Cesium-137 was detected above BV/FV in one sample. Cobalt-60 was detected in one sample. Gross-alpha and -beta radiation were detected in four samples.

## Proposed Activities

The nature and extent of contamination have not been defined at this site. Ten soil samples will be collected from five locations to confirm the results of previous sampling events and to define the extent of contamination between the AOC and the Sandia Canyon reach S-1 (Figure 4.1-48). The samples will be collected from two depths (0 to 1 ft and 1 to 2 ft) and analyzed for inorganic chemicals, VOCs, SVOCs,

TPH-DRO, PCBs, cyanide, perchlorate, nitrate, and radionuclides. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

In addition, samples will be collected from the drainage downgradient of this site as part of the Sandia Canyon and Cañada del Buey investigation work plan (LANL 1999, 064617). Section 6.3 provides additional information about the reach investigations to be conducted in Sandia Canyon.

#### **4.1.13.4 SWMU 03-014(c), Structure Associated with Former WWTP**

##### **Site Description**

SWMU 03-014(c) is the trickling filter (structure 03-0047) for Plant 1 of the former WWTP (Figure 4.1-44). The trickling filter received effluent from the Imhoff tank (structure 03-0049) and dosing siphon (structure 03-0048) where organic waste was digested through bacterial growth on filter media. The filter bed is 72 ft in diameter x 6 ft deep with a design capacity of 325,000-gal./d (LANL 1993, 020947, p. 5-47).

##### **Previous Investigations**

SWMU 03-014(c) has not been sampled.

##### **Proposed Activities**

The nature and extent of contamination have not been defined at this site. Three samples will be collected from one location between SWMUs 03-014(c) and 03-014(g) to characterize the site (Figure 4.1-48). The samples will be collected from three depths (at the base of the tank, at the soil/tuff interface, and 5 ft below the soil/tuff interface) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, PCBs, cyanide, perchlorate, nitrate, and radionuclides. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

#### **4.1.13.5 AOC 03-014(c2), Outfall**

##### **Site Description**

AOC 03-014(c2) is an overflow outfall that formerly received treated effluent from the former WWTP from 1975 until the WWTP chlorination system [SWMU 03-014(j), see section 4.1.13.12] was constructed in 1985 (LANL 1993, 020947, pp. 5-48–5-49). The outfall was located on the north side of the chlorination system pump pit (structure 03-0166) (Figures 4.1-45, 4.1-46, and 4.1-47). Effluent for this outfall discharged as sheet flow onto a steep slope containing an erosion channel from stormwater runoff. The channel eventually trends northeast into Sandia Canyon. Soil and sediment were occasionally cleaned out of the channel with a backhoe and piled onto the upslope channel bank (LANL 1996, 052930, p. 103). Following the construction of the chlorination system, the outfall was rerouted underground from the pump pit (structure 03-0166) to the chlorination dosing and contact chamber where the final effluent discharged freely into Sandia Canyon from a flow measurement weir north of the contact chamber. This outfall was abandoned in 1988 or 1989, when the WWTP effluent was routed to a new outfall, AOC 03-014(b2) (section 4.1.13.3) (LANL 1993, 020947, p. 5-49).

An evaluation of the former WWTP blueprints during 1994 RFI activities identified the location of the original treated effluent outfall approximately 20 to 30 ft west of the original AOC 03-014(c2) outfall (LANL 1996, 052930, p. 116).

## Previous Investigations

A Phase I RFI was conducted at AOC 03-014(c2) in 1994. The sampling strategy was designed to determine whether discharge from the pump pit (structure 03-0166) overflow pipe resulted in the release of contaminants. Twenty sediment samples (including one duplicate) were collected at nine locations from depths of 0 to 1 ft bgs and 1 to 1.5 ft bgs. Samples from the 0- to 1-ft interval were submitted for laboratory analyses of inorganic chemicals, SVOCs, PCBs, pesticides, herbicides, gross-alpha, -beta, and -gamma radiation, gamma spectroscopy, isotopic plutonium and uranium, strontium-90, and tritium. Samples from the 1- to 1.5-ft interval were submitted for laboratory analyses of cyanide, VOCs, gross-alpha, -beta, and -gamma radiation, and tritium (LANL 1996, 052930, p. 106). Requested analyses are presented in Table 4.1-2.

Screening-level data are presented in Tables 4.1-11, 4.1-13, 4.1-14, and 4.1-15. Sampling locations are shown in Figures 4.1-45, 4.1-46, and 4.1-47. Calcium and zinc were detected above BVs in one sample. Lead and nickel were detected above BVs in three samples. Cadmium, chromium, copper, cyanide, mercury, and silver were detected above BVs in six samples. Benzo(a)pyrene, benzo(b)fluoranthene, benzo(g,h,i)perylene, benzo(k)fluoranthene, chrysene, fluoranthene, indeno(1,2,3-cd)pyrene, phenanthrene, and pyrene were detected in one sample. Aroclor-1260 was detected in eight samples below 1 ppm. Plutonium 239/240 and plutonium-238 were detected above BVs/FVs in one and six samples, respectively. Europium-152 and tritium were detected in two samples. VOCs, pesticides, and herbicides were not detected.

## Proposed Activities

The nature and extent of contamination have not been defined at this site. Ten samples will be collected from five locations to characterize the drainage, confirm the results of previous sampling event, and to define the extent of contamination (Figure 4.1-48). The samples will be collected from two depths (0 to 1 ft and 1 to 2 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, PCBs, cyanide, perchlorate, nitrate, and radionuclides. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

In addition, four samples will be collected at two locations to confirm the results of previous sampling event (Figure 4.1-48). Samples will be collected at two depths (0 to 1 ft and 2 to 3 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, PCBs, cyanide, perchlorate, nitrate, and radionuclides. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

In addition, samples will be collected from the drainage downgradient of this site as part of the Sandia Canyon and Cañada del Buey investigation work plan (LANL 1999, 064617). Section 6.3 provides additional information about the reach investigations to be conducted in Sandia Canyon.

### 4.1.13.6 SWMU 03-014(d), Structure Associated with Former WWTP

#### Site Description

SWMU 03-014(d) is the secondary clarifier (structure 03-0046) for Plant 1 of the former WWTP (Figure 4.1-45). Material sloughed from the trickling filter media settled in the secondary clarifying tank. The resulting sludge was subsequently recirculated back to the head of the plant (LANL 1993, 020947, p. 5-47).



## Previous Investigations

SWMU 03-014(d) has not been sampled.

## Proposed Activities

The nature and extent of contamination have not been defined at this site. Nine soil samples will be collected from three locations to characterize SWMUs 03-014(d) and 03-014(h) (Figure 4.1-48). The samples will be collected from three depths (at the base of the tank, at the soil/tuff interface, and 5 ft below the soil/tuff interface) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, PCBs, cyanide, perchlorate, nitrate, and radionuclides. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

### 4.1.13.7 SWMU 03-014(e), Structure Associated with Former WWTP

#### Site Description

SWMU 03-014(e) is the Imhoff tank (structure 03-0192) for Plant 2 of the former WWTP (Figure 4.1-45). Water and effluent passed from the entrance works directly to the Imhoff tank, which functioned as a settling/digestion tank (LANL 1993, 020947, p. 5-47).

#### Previous Investigations

A Phase I RFI was performed at SWMUs 03-014(e) and 03-014(a) (section 4.1.13.1) in 1994. The area around the Imhoff tanks, structures 03-0192 and 03-0049, were sampled to determine whether contaminants were released to the environment as a result of applying sludge to the soil or from tank overflow (LANL 1996, 052930, p. 85).

The 1994 RFI sampling activities and results relevant to SWMU 03-014(e) are discussed in section 4.1.13.1. Requested analyses are presented in Table 4.1-2. Data are presented in Tables 4.1-11, 4.1-14, and 4.1-15. Sampling locations are shown in Figures 4.1-45, 4.1-46, and 4.1-47.

#### Proposed Activities

The nature and extent of contamination have not been defined at this site. Fifteen soil samples will be collected from five locations to confirm the results of previous sampling events and to define the extent of contamination for SWMUs 03-014(a), 03-014(b), 03-014(e), and 03-014(f) because of their close proximity (Figure 4.1-48). Section 4.1.13.1 provides more detailed information regarding the proposed sampling for the four SWMUs. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

### 4.1.13.8 SWMU 03-014(f), Structure Associated with Former WWTP

#### Site Description

SWMU 03-014(f) is the dosing siphon (structure 03-0193) for Plant 2 of the former WWTP (Figure 4.1-44). Effluent from the Imhoff tank (structure 03-0192) flowed to the dosing siphon, which dispersed, accumulated effluent water in an amount sufficient to run the trickling filter (structure 03-0194) rotary arms. The dosing siphon maintained the moisture throughout the trickling filter's rock media beds (LANL 1993, 020947, p. 5-47).

## Previous Investigations

SWMU 03-014(f) was not specifically sampled as part of historical RFI activities, but samples collected from SWMUs 03-014(a) (section 4.1.13.1) and 03-014(e) are within the vicinity of SWMU 03-014(f). Requested analyses for SWMU 03-014(a) are presented in Table 4.1-2. Data are presented in Tables 4.1-11, 4.1-14, and 4.1-15. Sampling locations are shown in Figures 4.1-45, 4.1-46, and 4.1-47.

## Proposed Activities

The nature and extent of contamination have not been defined at this site. Fifteen soil samples will be collected from five locations to confirm the results of previous sampling events and to define the extent of contamination for SWMUs 03-014(a), 03-014(b), 03-014(e), and 03-014(f) because of their close proximity (Figure 4.1-48). Section 4.1.13.1 provides more detailed information regarding the proposed sampling for the four SWMUs. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

### 4.1.13.9 SWMU 03-014(g), Structure Associated with Former WWTP

#### Site Description

SWMU 03-014(g) is the trickling filter (structure 03-0047) for Plant 2 of the former WWTP (Figure 4.1-44). The trickling filter received effluent from the Imhoff tank (structure 03-0192) and dosing siphon (structure 03-0193) where organic waste was digested through bacterial growth on filter media. The filter bed is 72 ft in diameter × 6 ft deep with a design capacity of 325,000-gal./d (LANL 1993, 020947, p. 5-47).

#### Previous Investigations

SWMU 03-014(g) has not been sampled.

#### Proposed Activities

The nature and extent of contamination have not been defined at this site. Three soil samples will be collected from one location between SWMUs 03-014(c) and 03-014(g) to confirm that a release of contaminants did not occur (Figure 4.1-48). The samples will be collected from three depths (at the base of the tank, at soil/tuff interface, and 5 ft below interface) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, PCBs, cyanide, perchlorate, and radionuclides. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

### 4.1.13.10 SWMU 03-014(h), Structure Associated with Former WWTP

#### Site Description

SWMU 03-014(h) is the secondary clarifier (structure 03-0195) for Plant 2 of the former WWTP (Figure 4.1-44). Material sloughed from the trickling filter media settled in the secondary clarifying tank where resulting sludge was subsequently recirculated back to the head of the plant (LANL 1993, 020947, p. 5-47).

#### Previous Investigations

SWMU 03-014(h) has not been sampled.

## **Proposed Activities**

The nature and extent of contamination have not been defined at this site. Nine soil samples will be collected from three locations to characterize SWMUs 03-014(d) and 03-014(h) (Figure 4.1-48). Section 4.1.13.6 provides more detailed information regarding the proposed sampling. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

### **4.1.13.11 SWMU 03-014(i), Structure Associated with Former WWTP**

#### **Site Description**

SWMU 03-014(i) consists of three structures: a splitter box (structure 03-0677) where raw sewage is first metered and split between Plant 1 or Plant 2, a comminutor where large objects and material are shredded, and a bar screen. These structures were built in 1951 (LANL 1993, 020947, pp. 5-45–5-47) (Figure 4.1-44).

#### **Previous Investigations**

SWMU 03-014(i) has not been sampled.

#### **Proposed Activities**

The nature and extent of contamination have not been defined at this site. Twelve soil samples will be collected from three locations to characterize the site (Figure 4.1-48). The samples will be collected from four depths (0 to 1 ft, at the base of the structure, at the soil/tuff interface, and 5 ft below the soil/tuff interface) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, PCBs, cyanide, perchlorate, nitrate, and radionuclides. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

### **4.1.13.12 SWMU 03-014(j), Structure Associated with Former WWTP**

#### **Site Description**

SWMU 03-014(j), the chlorination system for the former WWTP, consists of two structures: a pump pit, structure 03-2209 (formerly indentified as structure 03-0166), and a dosing and contact chamber. Both structures are located approximately 100 ft north of structure 03-0166 (Figure 4.1-44). The pump pit is a 9-ft- × 11-ft- × 10-ft-deep concrete pit that contains an effluent pump with a steel grating cover. The dosing and contact chamber is a 15-ft × 15-ft × 6-ft concrete pit with a concrete flow weir that is 225 ft<sup>2</sup> (LANL 1990, 007511, p. 3-014). When the chlorination system became active in 1985, SWMU 03-014(c2), the original WWTP outfall, was abandoned (LANL 1993, 020947, p. 5-49).

#### **Previous Investigations**

SWMU 03-014(j) has not been sampled.

#### **Proposed Activities**

The nature and extent of contamination have not been defined at this site. Six samples will be collected from two locations to define nature and extent of contamination at the pump pit (Figure 4.1-48). The samples will be collected from three depths (at the base of the structure, at soil/tuff interface, and 5 ft

below interface). An additional two samples will be collected from one location at the contact chamber to define nature of potential contamination. These samples will be collected from two depths (0 to 1 ft and at the soil/tuff interface) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, PCBs, cyanide, perchlorate, nitrate, and radionuclides. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

#### **4.1.13.13 SWMU 03-014(k), Structure Associated with Former WWTP**

##### **Site Description**

SWMU 03-014(k), structure 03-0196, is one of four unlined sludge-drying beds [SWMUs 03-014(k), 03-014(l), 03-014(m), and 03-014(n)] located north of the Imhoff tanks (Figure 4.1-44). These beds received sludge siphoned from the Imhoff tanks. Three of the four beds were used for drying sludge, while the fourth bed, SWMU 03-014(n), was used as a skimmer bed (LANL 1993, 020947, pp. 5-46–5-47).

SWMU 03-014(k) consists of an unlined sludge-drying bed excavated into the tuff. The sludge bed measures 35 ft × 10 ft (LANL 1990, 007511, p. 3-014). A 3-ft-high soil berm covered with 2 in. of asphalt separates the upper beds. The asphalt is broken and cracked in various places, exposing the underlying soil/tuff (LANL 1997, 056660.4, p. 58).

##### **Previous Investigations**

A Phase I RFI was conducted in 1997 at SWMU 03-014(k). One sampling location was selected for SWMU 03-014(k) near the inlet pipes on the south side of the drying bed. Three samples were collected from three depths: one from filter (fill) material within the bed and two from successive 1-ft intervals (in tuff) beneath the bed. All samples were submitted for laboratory analyses of inorganic chemicals, SVOCs, PCBs, pesticides, herbicides, isotopic plutonium and uranium, strontium-90, and tritium. One tuff sample was also submitted for laboratory analysis of VOCs. Requested analyses are presented in Table 4.1-1.

Decision-level data are presented in Table 4.1-3. Sampling locations and detected results are shown in Figures 4.1-45, 4.1-46, and 4.1-47. Mercury and silver were detected above BVs in the fill sample; copper was detected above BV in one tuff sample; chromium, nickel, and zinc were detected above BVs in the two tuff samples. The detection limits for antimony and cadmium were greater than BVs in several samples. Organic chemicals and radionuclides were not detected.

##### **Proposed Activities**

The nature and extent of contamination have not been defined at this site. Ten samples will be collected from historical sampling locations 03-03264, 03-03265, 03-03266, 03-03201, and 03-03202 to confirm the results of the previous sampling event and to define the vertical extent of contamination within and beneath the beds at SWMUs 03-014(k) to 03-014(n) (Figure 4.1-48). The samples will be collected from two depths (4 to 5 ft and 6 to 7 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, PCBs, cyanide, perchlorate, nitrate, tritium, and radionuclides. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

An additional 16 soil samples will be collected from four locations around and downgradient of SWMUs 03-014(k) to 03-014(n) (Figure 4.1-48). The samples will be collected from four depths (0 to 1 ft bgs, 0 to 1 ft beneath the sand and gravel layer at the base of bed, at bed/tuff interface, and 5 ft below the bed/tuff interface) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, PCBs, cyanide,



perchlorate, nitrate, tritium, and radionuclides. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

#### **4.1.13.14 SWMU 03-014(l), Structure Associated with Former WWTP**

##### **Site Description**

SWMU 03-014(l), structure 03-0197, is one of four unlined sludge-drying beds [SWMUs 03-014(k), 03-014(l), 03-014(m), and 03-014(n)] located north of the Imhoff tanks (Figure 4.1-44) that received sludge siphoned from the Imhoff tanks (LANL 1993, 020947, pp. 5-46–5-47). SWMU 03-014(l) consists of an unlined sludge drying bed excavated into the tuff. The sludge bed measures 40 ft x 20 ft (LANL 1990, 007511, p. 3-014). A 3-ft-high soil berm covered with 2 in. of asphalt separates the upper beds. The asphalt is broken and cracked in various places exposing the underlying soil/tuff (LANL 1997, 056660.4, p. 58).

##### **Previous Investigations**

A Phase I RFI was conducted in 1997 at SWMU 03-014(l). One sampling location was selected from the middle of the drying bed SWMU 03-014(l). Three samples were collected from three depth intervals at the sampling location: one from filter (fill) material within the bed and two from successive 1-ft intervals (in tuff) beneath the bed. All samples were submitted for laboratory analyses of inorganic chemicals, SVOCs, PCBs, pesticides, herbicides, isotopic plutonium and uranium, strontium-90, and tritium. One tuff sample was also submitted for laboratory analysis of VOCs. Requested analyses are presented in Table 4.1-1.

Decision-level data are presented in Tables 4.1-3, 4.1-4, 4.1-6, and 4.1-7. Sampling locations and detected results are shown in Figures 4.1-45, 4.1-46, and 4.1-47. Copper, mercury, and silver were each detected above BVs in the fill sample; copper and nickel were detected above BVs in one tuff sample; chromium was detected above BV in the two tuff samples. The detection limits for antimony and cadmium were greater than BVs. Toluene was detected in one tuff sample and Aroclor-1254 was detected in the fill sample. Tritium was detected in one tuff sample. Pesticides herbicides, isotopic plutonium and uranium, and strontium-90 were not detected.

##### **Proposed Activities**

The nature and extent of contamination have not been defined at this site. Ten samples will be collected from historical sampling locations 03-03264, 03-03265, 03-03266, 03-03201, and 03-03202 within and beneath the beds at SWMUs 03-014(k) to 03-014(n). An additional 16 soil samples will be collected from four locations around and downgradient of SWMUs 03-014(k) to 03-014(n) (Figure 4.1.48).

Section 4.1.13.13 provides more detailed information regarding the proposed sampling. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

#### **4.1.13.15 SWMU 03-014(m), Structure Associated with Former WWTP**

##### **Site Description**

SWMU 03-014(m), structure 03-0198, is one of four unlined sludge-drying beds [SWMUs 03-014(k), 03-014(l), 03-014(m), and 03-014(n)] located north of the Imhoff tanks (Figure 4.1-44) (LANL 1993, 020947, pp. 5-46–5-47). SWMU 03-014(m) consists of an unlined sludge drying excavated into the tuff. The sludge bed measures 40 ft x 20 ft (LANL 1990, 007511, p. 3-014). A 3-ft-high soil berm covered with

2 in. of asphalt separates the upper beds. The asphalt is broken and cracked in various places, exposing the underlying soil/tuff (LANL 1997, 056660.4, p. 58).

### Previous Investigations

A Phase I RFI was conducted in 1997 at SWMU 03-014(m). Ten samples were collected from three locations. At one location, one sample was collected from filter (fill) material within the bed, and two samples were collected from successive 1-ft intervals (in tuff) beneath the bed. All samples from this location were submitted for laboratory analyses of inorganic chemicals, SVOCs, PCBs, herbicides, pesticides, isotopic plutonium and uranium, strontium-90, and tritium. One tuff sample from this location was also submitted for laboratory analysis of VOCs. Filter material samples were collected from the second locations at three successive 0.5-ft intervals and submitted for laboratory analyses of SVOCs and PCBs. Filter material samples were collected from the final location at four successive 6-in. intervals and submitted for laboratory analyses of SVOCs and PCBs. Requested analyses are presented in Table 4.1-1.

Decision-level data are presented in Tables 4.1-3, 4.1-5, and 4.1-6. Sampling locations and detected results are shown in Figures 4.1-45, 4.1-46, and 4.1-47. Cadmium, chromium, copper, lead, mercury, silver, and zinc were detected above BVs in one fill sample; copper was detected above BV in one tuff sample; and chromium and nickel were detected above BVs in the two tuff samples. The detection limits for antimony were greater than BV in all samples. Acenaphthene, anthracene, benzo(a)anthracene, benzo(a)pyrene, benzo(b)fluoranthene, benzo(g,h,i)perylene, carbazole, chrysene, dibenz(a,h)anthracene, dibenzofuran, dichlorobenzene(1,4-), fluoranthene, fluorene, indeno(1,2,3-cd)pyrene, naphthalene, phenanthrene, pyrene, and Aroclor-1254 were detected in one fill sample. Aroclor-1260 was detected in three fill samples. Herbicides, pesticides, isotopic plutonium and uranium, strontium-90, and tritium were not detected.

### Proposed Activities

The nature and extent of contamination have not been defined at this site. Ten samples will be collected from historical sampling locations 03-03264, 03-03265, 03-03266, 03-03201, and 03-03202 within and beneath the beds at SWMUs 03-014(k) to 03-014(n). An additional 16 soil samples will be collected from four locations around and downgradient of SWMUs 03-014(k) to 03-014(n) (Figure 4.1-48).

Section 4.1.13.13 provides more detailed information regarding the proposed sampling. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

#### 4.1.13.16 SWMU 03-014(n), Structure Associated with Former WWTP

##### Site Description

SWMU 03-014(n), structure 03-0199, is one of four unlined sludge-drying beds [SWMUs 03-014(k), 03-014(l), 03-014(m), and 03-014(n)] located north of the Imhoff tanks (Figure 4.1-44) (LANL 1993, 020947, pp. 5-46, 5-47). SWMU 03-014(n) consists of an unlined sludge drying bed excavated into the tuff. The bed measures 40 ft x 20 ft (LANL 1990, 007511, p. 3-014). A 3-ft-high soil berm covered with 2 in. of asphalt separates the upper beds. The asphalt is broken and cracked in various places, exposing the underlying soil/tuff (LANL 1997, 056660.4, p. 58).

## Previous Investigations

During RFI sampling activities at SWMU 03-014(n), oil was discovered in the bed, which was subsequently remediated in September 1997 (LANL 1997, 056660.4, p. 60). Four samples were collected from two locations. At the first location, one sample was collected from the filter (fill) material within the bed, and two samples were collected from successive 1-ft intervals (in tuff) beneath the bed; each of these samples was submitted for laboratory analyses of inorganic chemicals, VOCs, SVOCs, PCBs, herbicides, pesticides, TPH-DRO, isotopic plutonium and uranium, strontium-90, and tritium. At the second location, one sample was collected from the filter material and submitted for laboratory analyses of inorganic chemicals, VOCs, SVOCs, herbicides, pesticides, and TPH-DRO. Four additional soil, fill, and sludge samples were collected from a depth of 0 to 0.5 ft bgs following remediation activities and submitted for analysis of TPH-DRO. Requested analyses are presented in Table 4.1-1.

Decision-level data are presented in Tables 4.1-3, 4.1-4, 4.1-5, 4.1-6, and 4.1-9. Sampling locations and detected results are shown in Figures 4.1-45, 4.1-46, and 4.1-47. Antimony, barium, cadmium, calcium, chromium, lead, and nickel were detected above BVs in one fill sample. Copper, mercury, silver, and zinc were detected above BVs in two fill samples. Chromium, mercury, nickel, and silver were detected above BVs in one tuff sample. Copper was detected above BV in two tuff samples. The detection limits for antimony and selenium were greater than BVs in the tuff samples. Acetone was detected in one fill and one tuff sample; butylbenzylphthalate was detected in one fill sample; and bis(2-ethylhexyl)phthalate was detected in on two fill samples and one tuff sample. TPH-DRO was detected in three fill samples and two tuff samples; and TPH-lubrication range organic (LRO) was detected in one soil, one sludge, and two fill samples. No radionuclides were detected.

## Proposed Activities

The nature and extent of contamination have not been defined at this site. Ten samples will be collected from historical sampling locations 03-03264, 03-03265, 03-03266, 03-03201, and 03-03202 within and beneath the beds at SWMUs 03-014(k) to 03-014(n) (Figure 4.1-48). An additional 16 soil samples will be collected from four locations around and downgradient of SWMUs 03-014(k) to 03-014(n). Section 4.1.13.13 provides more detailed information regarding the proposed sampling. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

### 4.1.13.17 SWMU 03-014(o), Structure Associated with Former WWTP

#### Site Description

SWMU 03-014(o) consists of three polypropylene-lined sludge-drying beds (structure 03-1871) excavated into tuff. SWMU 03-014(o) is located north and downslope of the four upper sludge-drying beds [SWMUs 03-014(k), 03-014(l), 03-014(m), and 03-014(n)] (Figure 4.1-44). The drying beds were constructed in 1987, and each bed measures 22 ft x 60 ft and accommodated approximately 8000 gal. of liquid sludge (LANL 1993, 020947, pp. 5-46, 5-47). Berms separating the beds are covered with asphalt and the asphalt has not deteriorated (LANL 1997, 056660.4, p. 58).

## Previous Investigations

A Phase I RFI was conducted at SWMU 03-014(o) in 1997. One sampling location was selected for each of the three beds at SWMU 03-014(o). Two locations were near the inlet pipes on the south side of the two outer beds, and the third location was near the center of the middle bed. Samples were collected from three depth intervals at each location: one from filter (fill) material within the bed and two from

successive 1-ft intervals (in tuff) beneath the bed. Nine samples were collected from the three locations and submitted for laboratory analyses of inorganic chemicals, SVOCs, PCBs, pesticides, herbicides, isotopic plutonium and uranium, strontium-90, and tritium. Three tuff samples collected from the deepest interval at each location were also submitted for laboratory analysis of VOCs (LANL 1997, 056660.4, pp. 59–62). Requested analyses are presented in Table 4.1-1.

Decision-level data are presented in Tables 4.1-3, 4.1-4, 4.1-5, 4.1-6, and 4.1-7. Sampling locations and detected results are shown in Figures 4.1-45, 4.1-46, and 4.1-47. Lead was detected above BV in one fill sample; cadmium, chromium, and zinc were detected above BVs in two fill samples; and copper, mercury, and silver were detected above BVs in three fill samples. Copper was detected above BV in one tuff sample, silver was detected above BV in two tuff samples, nickel was detected above BV in three tuff samples, and chromium was detected above BV in five tuff samples. The detection limits for antimony and cadmium were greater than BVs in numerous samples. Acetone was detected in one tuff sample; acenaphthylene, anthracene, benzoic acid, carbazole, dibenz(a,h)anthracene, Aroclor-1260, methyl chlorophenoxy acetic acid (MCPA), and 2-(2-methyl-4-chlorophenoxy)propionic acid (MCPA) were each detected in one fill sample; benzo(a)anthracene, benzo(a)pyrene, benzo(b)fluoranthene, benzo(g,h,i)perylene, benzo(k)fluoranthene, chrysene, fluoranthene, indeno(1,2,3-cd)pyrene, phenanthrene, and pyrene were detected in two fill samples. Uranium-234 was detected above BV/FV in one fill sample; strontium-90 was detected above BVs/FVs in one fill and one tuff sample; and plutonium-239/240 was detected above BVs/FVs in one tuff and two fill samples. Tritium was detected in two fill samples.

### **Proposed Activities**

The extent of contamination has not been defined at this site. Two soil samples will be collected from historical sampling location 03-03204 in the center bed to define the vertical extent of contamination. In addition, four samples will be collected from two locations from each of the other beds to confirm previous sampling results (Figure 4.1.48). The samples will be collected from two depths (4 to 5 ft and 6 to 7 ft) and analyzed for metals and cyanide. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

An additional 16 soil samples will be collected from four locations to define the lateral and vertical extent of contamination at SWMU 03-014(o) (Figure 4.1-48). The samples will be collected from four depths (0 to 1 ft bgs, 0 to 1 ft beneath the sand and gravel layer at the base of bed, at the bed/tuff interface, and 5 ft below the bed/tuff interface) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, PCBs, cyanide, perchlorate, nitrate, and radionuclides. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

#### **4.1.13.18 SWMU 03-014(p), Structure Associated with Former WWTP**

##### **Site Description**

SWMU 03-014(p) is a sewage lift station (structure 03-0265) associated with the former WWTP and the SWSC (Figure 4.1-44). The lift station was constructed in 1966 of reinforced concrete built over a 42-in. diameter cast-iron basin. The structure measures 6 ft × 10 ft × 5 ft (LANL 1990, 007511, p. 3-014). SWMU 03-014(p) is active and currently associated with SWSC (LANL 2008, 099214).

##### **Previous Investigations**

SWMU 03-014(p) has not been sampled.



## Proposed Activities

No sampling is proposed for this SWMU because it is an active lift station. Sanitary lift stations throughout the Laboratory, including those at TA-03, are equipped with alarms to prevent overflow, and to date no releases to the environment from the SWMU 03-014(p) lift station have been documented. Additional information to document the site conditions related to the potential for past releases will be collected during the investigation and presented in the investigation report.

### 4.1.13.19 SWMU 03-014(u), Structure Associated with Former WWTP

#### Site Description

SWMU 03-014(u) is a former 1500-gal. holding tank (structure 03-1901) that collected effluent from the former WWTP sludge beds [SWMUs 03-014(k), 03-014(l), 03-014(m), 03-014(n), and 03-014(o)]. SWMU 03-014(u) is located approximately 50 ft northeast of the chlorination system dosing and contact chamber (Figure 4.1-44). The holding tank was installed in 1988 (LANL 1990, 007511, p. 3-014). Effluent from the sludge beds flowed through a subsurface drain system to the holding tank. The contents of the holding tank were recirculated by truck to the head of the plant for additional treatment (LANL 1993, 020947, p. 5-47). SWMU 03-014(u) was abandoned in 1992 following the decommissioning of the WWTP (LANL 2008, 099214).

#### Previous Investigations

SWMU 03-014(u) has not been sampled.

#### Proposed Activities

The nature and extent of contamination have not been defined at this site. Nine soil samples will be collected from three locations around the tank (Figure 4.1-48). The samples will be collected from three depths (0 to 1 ft, at the base of the tank, and at the soil/tuff interface) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, PCBs, cyanide, perchlorate, nitrate, and radionuclides. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

### 4.1.13.20 SWMU 03-056(d), Drum Storage

#### Site Description

SWMU 03-056(d) is a drum-storage area located on the northeast side of the Plant 1 trickling filter [SWMU 03-014(c)] (Figure 4.1-44). The area has been in use since about 1965 and consists of two bermed areas that measure 25 ft x 5 ft x 10 in. deep. The berms were constructed in 1989. Before 1989, only containers of lubricating oil were stored on pallets over bare soil. Active containers were mounted in racks with drip pans beneath. In 1993, lubricating oil and a partially full 55-gal. container of motor oil were stored at the site. Stains were noted within the bermed area, but none were observed outside the berm. The asphalt floor of the bermed area was covered with oil-absorbing material (LANL 1995, 057590, p. 6-48).

#### Previous Investigations

SWMU 03-056(d) has not been sampled.

## **Proposed Activities**

The nature and extent of contamination have not been defined at this site. Two soil samples will be collected from one location (Figure 4.1-48). The samples will be collected from two depths (0 to 1 ft and at the soil/tuff interface) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, PCBs, and cyanide. No HE or radionuclides are associated with this SWMU; therefore, no samples will be analyzed for nitrate, perchlorate, or radionuclides. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

### **4.1.14 SWMU 03-014(r), Lift Station Associated with Former WWTP**

#### **Site Description**

SWMU 03-014(r) is a sewage lift station (structure 03-0693) located south of building 03-0271 (Figure 4.1-18) associated with the former WWTP. The lift station was built in the 1970s and consisted of two 7.5 horsepower pumps (LANL 1990, 007511, p. 3-014). SWMU 03-014(r) is active and currently associated with SWSC (LANL 2008, 099214).

#### **Previous Investigations**

SWMU 03-014(r) has not been sampled.

#### **Proposed Activities**

No sampling is proposed for this SWMU because it is an active lift station. Sanitary lift stations throughout the Laboratory, including those at TA-03, are equipped with alarms to prevent overflow, and to date no releases to the environment from the SWMU 03-014(r) lift station have been documented. Additional information to document the site conditions related to the potential for past releases will be collected during the investigation and presented in the investigation report.

### **4.1.15 SWMU 03-014(s), Lift Station Associated with Former WWTP**

#### **Site Description**

SWMU 03-014(s) is a sewage lift station (structure 03-1693) associated with the former WWTP. The lift station was built in the 1970s and is located south of the university house (building 03-0443) (Figure 4.1-35). The lift station contains two pumps and measures 5 ft in diameter × 11 ft deep (LANL 1990, 007511, p. 3-014). SWMU 03-014(s) is active and currently associated with SWSC (LANL 2008, 099214).

#### **Previous Investigations**

SWMU 03-014(s) has not been sampled.

#### **Proposed Activities**

No sampling is proposed for this SWMU because it is an active lift station. Sanitary lift stations throughout the Laboratory, including those at TA-03, are equipped with alarms to prevent overflow, and to date no releases to the environment from the SWMU 03-014(s) lift station have been documented. Additional

information to document the site conditions related to the potential for past releases will be collected during the investigation and presented in the investigation report.

#### **4.1.16 AOC 03-014(v), Drain Associated with Former WWTP**

##### **Site Description**

AOC 03-014(v) was a floor drain within a former garage (building 03-0036) (Figure 4.1-49). The drain was connected to the sanitary sewer line, which flowed to the WWTP. The drain was installed in 1953 (LANL 1990, 007511, p. 3-014).

Building 03-0036 was removed in 1999 in preparation for construction of building 03-2327, the Nicholas C. Metropolis Computing Center. During the demolition of the gas station, three AOCs [03-014(v), 03-027, and C-03-015] were removed. Soil surrounding AOC C-03-015 (a former underground storage tank) and below the building footprint was excavated. Approximately 60 yd<sup>3</sup> of contaminated soil was removed during the demolition. Two fill samples were collected from one location at depths of 3 to 3.5 ft and 4 to 4.5 ft and submitted for laboratory analyses of inorganic chemicals, VOCs, PCBs, and TPH. Additional soil was subsequently excavated from the area to accommodate the foundation of building 03-2327. The area was excavated to a depth of approximately 15 ft belowgrade. The depth of the excavation was approximately 8 ft deeper than the two confirmation samples collected in 1999.

##### **Previous Investigations**

Analyses requested for the two fill samples collected in 1999 are summarized in Table 4.1-1. Decision-level data are presented in Tables 4.1-3 and 4.1-6. Sampling locations and detected results are shown in Figures 4.1-50 and 4.1-51. Cobalt was detected slightly above its BV in one sample, and TPH-DRO was detected in both samples.

##### **Proposed Activities**

No sampling is proposed for this site because it was remediated during the construction of the Computing Center Building (building 03-2327). Confirmation samples detected cobalt above BV but below 2 times the BV. TPH-DRO was detected at the base of the excavation and was removed in preparation for the new construction. Analytical results demonstrate nature and extent of contamination are defined at this site.

#### **4.1.17 AOC 03-014(y), Drain Associated with Former WWTP**

##### **Site Description**

AOC 03-014(y) is a floor drain in the basement of the press building (building 03-0035) (Figure 4.1-13) that formerly discharged to the sanitary sewer. The drain was installed in 1954 and became inactive in 1981 (LANL 1993, 020947, p. 5-46). Building 03-0035 was constructed in 1953 and housed operations to fabricate enriched uranium-loaded graphite and carbide fuel elements. Enriched uranium (uranium-235) was processed in an area located in the northern portion of the first floor of the building. The rest of the building was used to fabricate cable assemblies in support of the weapons program, rack mechanics, the Meson Physics Facility, and service programs.

## Previous Investigations

AOC 03-014(y) has not been sampled.

## Proposed Activities

No sampling is proposed for this AOC because it is an active part of the sanitary sewer system.

### 4.1.18 Consolidated Unit 03-015-00

Consolidated Unit 03-015-00 includes SWMU 03-015 and AOC 03-053 (Figure 4.1-8). SWMU 03-015 is a former NPDES-permitted outfall that received effluent from janitorial sinks and roof and floor drains from building 03-0141 until the lines to the outfall were decommissioned in early 1993 (LANL 1996, 052930, p. 121). AOC 03-053 is the basement of building 03-0141, which housed electrochemical and depleted uranium (DU) processing facilities. The floor drains in this area previously discharged to SWMU 03-015 and were rerouted to the TA-50 radioactive liquid waste (RLW) line before 1992 (LANL 1995, 057590, p. 5-24-1).

Proposed sampling for this consolidated unit is provided in the following sections.

#### 4.1.18.1 SWMU 03-015, Outfall

##### Site Description

SWMU 03-015 is an outfall located between Eniwetok Drive and the security fence northeast of the building 03-0141 (Figure 4.1-8) (LANL 1996, 052930, p. 121). This SWMU is a formerly NPDES-permitted outfall EPA 04A140 that was removed from the permit in 1995 (LANL 1999, 064617, p. 2-7). The outfall historically received effluent from janitorial sinks as well as from floor and roof drains of building 03-0141. From 1962 to 1990, building 03-0141 housed electrochemical and DU-processing facilities. Powder characterization, plasma flame spray processing, beryllium processing, and DU-processing operations also took place. In 1992, the basement floor drains in building 03-0141 were rerouted to the TA-50 RLW line, and the roof drains were rerouted to an existing storm sewer outfall in Mortandad Canyon. Lines draining to SWMU 03-015 were decommissioned in 1993 (LANL 1995, 057590, p. 5-24-1).

## Previous Investigations

RFI activities were conducted at SWMU 03-015 in 1994. Four surface soil samples and one sediment sample were collected from five locations downgradient of the outfall in the associated drainage channel. All samples were collected from a depth 0 to 1.5 ft bgs and analyzed for inorganic chemicals, SVOCs, gross-alpha, -beta, and -gamma radiation, gamma spectroscopy, isotopic plutonium and uranium, and tritium. The fourth soil sample was analyzed for inorganic chemicals, SVOCs, gross-alpha, -beta, and -gamma radiation, and tritium. The sediment sample was analyzed for inorganic chemicals, gross-alpha, -beta, and -gamma radiation, and tritium (LANL 1996, 052930, pp. 121–124). Requested analyses are presented in Tables 4.1-1 and 4.1-2.

Decision-level and screening-level data are presented in Tables 4.1-3, 4.1-11, 4.1-13, and 4.1-15. Sampling locations and detected results are shown in Figures 4.1-9, 4.1-10, and 4.1-11. Barium and lead were detected above BVs in the sediment sample; lead, mercury, nickel, and silver were detected above BVs in one soil sample. The detection limit for selenium was greater than BV in one sample. Acenaphthene, anthracene, benzo(a)anthracene, benzo(a)pyrene, benzo(b)fluoranthene,



benzo(g,h,i)perylene, benzo(k)fluoranthene, chrysene, dibenz(a,h)anthracene, dibenzofuran, fluorene, indeno(1,2,3-cd)pyrene, naphthalene, and phenanthrene were detected in one soil sample; fluoranthene and pyrene were detected in two soil samples. Uranium-234, uranium-235, and uranium-238 were detected above BV/FV in one soil sample. Europium-152 and gross-alpha radiation were detected in one soil sample; gross-beta radiation was detected in two soil samples.

### **Proposed Activities**

The nature and extent of contamination have not been defined at this site. Sixteen sediment and soil samples will be collected from eight locations to characterize SWMU 03-015 and AOC 03-053 (Figure 4.1-12). The samples will be collected from two depths (0 to 1 ft and 1 to 2 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, PCBs, cyanide, perchlorate, and radionuclides. Sampling locations will be biased in the outfall area and areas of sediment accumulation. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

#### **4.1.18.2 AOC 03-053, Operational Facility**

##### **Site Description**

AOC 03-053 (Figure 4.1-8) consists of floor drains in the basement area of building 03-0141. The floor drains historically discharged to SWMU 03-015 (section 4.1.18.1) but were rerouted to the TA-50 RLW line before 1992. From 1962 to 1990, building 03-0141 housed electrochemical and DU-processing facilities. Powder characterization, plasma flame spray processing, beryllium processing, and DU-processing operations also took place (LANL 1995, 057590, p. 5-24-1).

##### **Previous Investigations**

Samples collected from SWMU 03-015 during the 1994 RFI were used to evaluate potential contamination at AOC 03-053 (LANL 1996, 052930, p. 121). Sampling locations are shown in Figures 4.1-9, 4.1-10, and 4.1-11. Decision-level and screening-level data are presented in Tables 4.1-3, 4.1-11, 4.1-13, and 4.1-15

### **Proposed Activities**

The nature and extent of contamination have not been defined at this site. Sixteen sediment and soil samples will be collected from eight locations to characterize AOC 03-053 and its outfall, SWMU 03-015 (Figure 4.1-12). Section 4.1.18.1 provides more details regarding the proposed sampling. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

#### **4.1.19 AOC C-03-016, Oil Metal Bin**

##### **Site Description**

AOC C-03-016 is a former oil cleanout bin located within the former asphalt batch plant (Figure 4.1-1). The bin was approximately 4 ft wide × 16 ft long × 3 ft deep, had a hinged lid, and was buried with the top flush with the ground surface. The bin was installed in the mid-1970s and contained used asphalt emulsion oil, which was applied to roads before laying asphalt. Photographs from the 1970s and 1980s show extensive stains in the immediate vicinity of the bin. In the late 1980s, the area surrounding the oil cleanout bin was excavated, and new sand and gravel fill was put around the bin (LANL 1995, 057590, pp. 6-26–6-27). The bin and stained soil around the bin were removed in the late 1990s (LANL 2003,

080912, p. 4). The surface of the site was paved with asphalt for use as a parking lot in 2003 (LANL 2008, 099214).

### Previous Investigations

Sampling was conducted at AOC C-03-016 in 2003 before the planned construction of a new parking structure; however, the parking structure was never built. Two shallow boreholes were drilled at AOC C-03-016. Two tuff samples were collected from one borehole at depths of 1 to 1.5 ft bgs and 16 to 16.5 ft bgs. Three tuff samples were collected from the second borehole at a depth of 4 to 5 ft bgs, 9.5 to 10 ft bgs, and 19.5 to 20 ft bgs. All samples were submitted for laboratory analyses of inorganic chemicals, VOCs, SVOCs, TPH-DRO, and TPH-GRO (Shaw Environmental Inc., 2003, 085517, pp. 1, 7–8, 10, 26–27). Requested analyses are presented in Table 4.1-1.

Decision-level data are presented in Tables 4.1-3 and 4.1-4. Sampling locations and detected results are shown in Figures 4.1-2 and 4.1-3. Aluminum, arsenic, beryllium, calcium, chromium, iron, magnesium, manganese, nickel, and vanadium were detected above BVs in one sample. Barium and copper were detected above BVs in two samples. Lead and selenium were detected above BVs in three and five samples, respectively. Bis(2-ethylhexyl)phthalate was detected in two samples. TPH-DRO and TPH-GRO were also detected in two samples. VOCs were not detected.

### Proposed Activities

The extent of vertical contamination has not been defined at this site. Previous sampling detected several inorganic chemicals above BVs and detected organic chemicals that increased with depth. Two soil samples will be collected from historical sampling location 03-22533. Samples will be collected from two depths (17 to 18 ft and 19 to 20 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, TPH-GRO, and cyanide (Figure 4.1-5). Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

#### 4.1.20 SWMU 03-021, Outfall

##### Site Description

SWMU 03-021 is an outfall and associated daylight channel located approximately 60 ft north of the north exterior wall of the liquid and compressed gas facility (building 03-0170) (Figure 4.1-25). The outfall is a formerly NPDES-permitted outfall (EPA 04A094) and was removed from the 1997 permit (LANL 1999, 064617, p. 2-7). The outfall discharged caustic wash and rinse water from compressed-gas cylinder cleaning operations from 1964 to 1976. Cylinders were washed and stripped of paint using a caustic soda solution before they were repainted. Washing and stripping were done in a below floor-grade pit in the northern part of building 03-0170. A 2-in.-diameter iron outfall pipe in an open ditch carried the caustic wash and rinse water from the pit. Discharge from the end of the outfall pipe was directed into a northeast-trending surface ditch that continued about 180 ft to the main north-south drainage ditch. Cylinders were screened for radioactive contamination and cleaned of any exterior oil, dirt, and grease before they were brought to building 03-0170, in the adjacent parking lot. The SWMU was not used after 1976, when the compressed gas suppliers assumed cylinder washing and painting responsibilities. The exact location of this SWMU is not known because of regrading and other construction work completed in preparation for nearby building 03-1650, the compressed-gas cylinder storage shed. Construction of building 03-1650 resulted in placement of 5 to 10 ft of fill material over the former outfall area. Potential contaminants at this SWMU are organic and inorganic chemicals (LANL 1995, 057590, pp. 5-14-1–5-14-3).

## Previous Investigations

RFI activities were performed at this SWMU in 1997. One soil sample was collected from one location within the area of the former NPDES outfall area at a depth of 0 to 1 ft bgs. Ten soil samples were collected at five locations along two transects positioned across the former location of the channel (LANL 1997, 056660.4, pp. 79–82). Four samples were collected from two of the locations at depths of 2 to 3 ft bgs and 3 to 4 ft bgs; four samples were collected from two other locations at depths of 3 to 4 ft bgs and 4 to 5 ft bgs; two samples were collected from the fifth location at depths of 2.75 ft to 3.75 ft and 3.75 ft to 4.25 ft. All samples were analyzed for metals and SVOCs; one sample was also analyzed for VOCs Sample. Requested analyses are presented in Table 4.1-1.

Decision-level data are presented in Table 4.1-3 and 4.1-4. Sampling locations and detected results are shown in Figures 4.1-26 and 4.1-27. Cobalt, copper, iron, and nickel were detected above BVs in one sample. Chromium and thallium were detected above BVs in three samples; zinc was detected above BV in six samples; lead was detected above BV in nine samples. VOCs and SVOCs were not detected. The detection limit for antimony was greater than its BV in two samples

## Proposed Activities

The extent of contamination has not been defined at this site. Four samples will be collected from historical sampling locations 03-0331 and 03-03329 to define the vertical extent of contamination and confirm Phase I RFI results (Figure 4.1-28). The samples will be collected from two depths (4 to 5 ft and 6 to 7 ft) and analyzed for inorganic chemicals and cyanide. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

Twelve additional samples will be collected from six locations near the outfall and drainlines to define the extent of contamination in the drainage (Figure 4.1-28). The samples will be collected from two depths (0 to 1 ft and 1 to 2 ft, if possible) and analyzed for inorganic chemicals, VOCs, SVOCs, and cyanide. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

### 4.1.21 AOC 03-027, Lift Wells

#### Site Description

AOC 03-027 consists of two former concrete-block-lined lift wells located in the floor below the hydraulic lifts at a former garage, building 03-0036 (Figure 4.1-49). The lift wells collected wash water and residual oil from the floor of vehicle maintenance bays. Lift well contents were manually pumped to 55-gal. containers that were emptied into the station's oil/water separator before being discharged to the sanitary sewer. A bottle-washing operation was conducted in building 03-0036 from 1976 to 1980. New sample vial bottles were immersed in a 35% concentration nitric acid bath and triple-rinsed with deionized water. The rinse water was reused several times before it was discharged to floor drains. The floor drains eventually discharged to storm drains (LANL 1995, 057590, pp. 6-54–6-55).

#### Previous Investigations

Building 03-0036 was removed in 1999 in preparation for construction of building 03-2327, the Nicholas C. Metropolis Computing Center. During the task of demolishing the gas station, three AOCs [03-014(v), a floor drain, 03-027, and C-03-015, an underground storage tank] were removed as a presumptive remedy. Soil surrounding the underground storage tank and below the building footprint was excavated. Approximately 60 yd<sup>3</sup> of TPH-contaminated soil was removed during the demolition project.

Additional soil was subsequently excavated from the area to a depth of approximately 15 ft belowgrade to accommodate the foundation of building 03-2327.

Following the demolition of building 03-0036 and before the foundation for building 03-2327 was excavated, nine fill and tuff samples were collected from six locations associated with the former lift wells (two fill samples from a depth of 7 to 7.5 ft bgs; four fill samples from a depth of 7.5 to 8 ft bgs; two tuff samples from a depth of 8.5 to 9 ft bgs; and one tuff sample from a depth of 9 to 9.5 ft bgs). The samples were submitted for laboratory analyses of inorganic chemicals, VOCs, PCBs, TPH-DRO, and TPH-GRO. Requested analyses are presented in Table 4.1-1.

Decision-level data are presented in Tables 4.1-3, 4.1-4, and 4.1-6. Sampling locations and detected results are shown in Figures 4.1-50 and 4.1-51. Aluminum, beryllium, iron, magnesium, nickel, and sodium were detected above BVs in one fill sample; zinc was detected above BV in two fill samples. The detection limit for antimony was above the BV in three samples. Butanone(2-), isopropylbenzene, and PCE were detected in one fill sample; butylbenzene(sec-), isopropyltoluene(4-), propylbenzene(1-) and xylene were detected in two fill samples; butylbenzene(n-), trimethylbenzene (1,3,5-), and TPH-GRO were detected in three fill samples; trimethylbenzene(1,2,4-) was detected in four fill samples; TPH-DRO was detected in five fill and three tuff samples. PCBs were not detected.

### **Proposed Activities**

No sampling is proposed for this site because the nature and extent of contamination have been defined at this site. Confirmation samples detected several concentrations of inorganic chemicals above BVs but below 2 times BVs. Several organic chemicals were also detected. All detected analytes decrease in concentration with depth, except for TPH-DRO and TPH-GRO at the base of the excavation. Based on the analytical results, the nature and extent of contamination are defined at this site.

#### **4.1.22 AOC 03-036(b), Former Aboveground Storage Tanks**

##### **Site Description**

AOC 03-036(b) is the location of two former 25- to 50-gal. aboveground storage tanks that contained No. 2 diesel fuel. The tanks associated with the former asphalt batch plant were located 100 ft west of the plant (building 03-0073) and were surrounded by a 3-ft soil berm (Figure 4.1-1). To prevent sticking, diesel fuel from the tanks was applied to dump truck beds before they were loaded with asphalt. Residual fuel was collected in an aboveground metal catch basin on the east side of the berm. Before 1989, kerosene was stored in the tanks and used for the same purpose as the No. 2 diesel fuel. Periodic drips and splashes from the tanks stained the gravel (LANL 1995, 057590, p. 6-27). The tanks began operating in 1960 (LANL 2003, 080912, p. 3), and operations ceased in 2003. In 2002, the two tanks, soil berm, and stained soil were removed during the D&D of the former asphalt batch plant.

##### **Previous Investigations**

Sampling activities were conducted at AOC 03-036(b) in 2003 before the planned construction of a new parking structure (Shaw Environmental Inc., 2003, 085517, p. 1). As part of the sampling activities, two boreholes were drilled at the site. Three tuff samples were collected from one borehole at depths of 11 to 11.5 ft bgs, 14.5 to 15 ft bgs, and 19.5 to 20 ft bgs; one soil and two tuff samples were collected from the second borehole at depths of 10 to 11 ft bgs, 14.5 to 15 ft bgs, and 19.5 to 20 ft bgs. All samples were field screened for organic chemicals and submitted for laboratory analyses of inorganic chemicals, VOCs, SVOCs, TPH-DRO, and TPH-GRO. Field-screening results did not indicate elevated concentrations of



organic chemicals; however, a strong odor was noted during drilling and sampling activities (Shaw Environmental Inc., 2003, 085517, pp. 7-8, 10, 27). Requested analyses are presented in Table 4.1-1.

Decision-level data are presented in Tables 4.1-3, 4.1-4, 4.1-5, and 4.1-6. Sampling locations and detected results are shown in Figures 4.1-2 and 4.1-3. Barium, beryllium, calcium, copper, and zinc were detected above BVs in one tuff sample. Lead and selenium were detected above BVs in three and five tuff samples, respectively. PCE and trimethylbenzene(1,2,4-) were detected in the single soil sample; acetone, and phenanthrene were detected in one tuff sample. Methylnaphthalene(2-) and TPH-DRO were detected in two tuff samples; TPH-GRO was detected in all six samples.

### **Proposed Activities**

The nature and extent of contamination have not been defined at this site. Six soil and tuff samples will be collected from two locations to define the extent of contamination (Figure 4.1-5). The samples will be collected from three depths (14 to 15 ft, 19 to 20 ft, and 24 to 25 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, cyanide, TPH-GRO, and TPH-DRO. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

#### **4.1.23 SWMU 03-037, Underground Storage Tanks**

##### **Site Description**

SWMU 03-037 is a below-grade, 9000-gal. concrete tank located in the basement of the Sigma Building, building 03-0066 (Figure 4.1-13) (LANL 1993, 020947, p. 6-11). The tank began operation in 1960 (LANL 1990, 007511, p. 3-037). The tank is divided into two 4500-gal., unlined sections that are fitted with separate covers. One section was used to store spent cyanide solution, while the other section stored nitric, sulfuric, and hydrochloric acid solutions from electroplating operations. Both sections discharged to the industrial waste line. In 1989, the waste line serving the cyanide tank collapsed and leaked. The leak was repaired, and two core samples collected along the route of the line were analyzed for potential contaminants.

##### **Previous Investigations**

In 1991, an interim action reconnaissance survey was performed. Samples screened for gross-alpha, -beta, and -gamma radiation were below background. Samples were also analyzed for total uranium. Analytes were below screening action levels (LANL 1993, 020947, pp. 6-11–6-12). Additional analytical samples have not been collected at this site.

##### **Proposed Activities**

No sampling is proposed for this SWMU because it is currently active, and regular inspections of the tank are performed by facility personnel to ensure no releases to the environment occur. This SWMU is located within an active nuclear facility, and it cannot be safely or practicably investigated at the current time.

#### **4.1.24 AOC 03-038(c), Waste Lines**

##### **Site Description**

AOC 03-038(c) is a 2-in. cast-iron drainline that formerly carried rinse solution from a copper electroplating bath in building 03-0028 (room 46) to the industrial waste line (Figure 4.1-51). The electroplating bath initially operated in the 1960s and was used to plate very small parts of printed circuit boards. By 1971 the operation was terminated and was moved to building 03-0040. During the electroplating process, water was sprayed through rows of holes in a manifold on either side of the rinse sink. Minute amounts of plating and acid solutions were washed off the circuit boards and down the drain. Spent plating baths and the spent acid-strip solutions were transported to TA-50 for treatment. These solutions contained cyanide, chromic sulfuric acid, and hydrochloric acid. The amounts and concentrations of contaminants are not known. The electroplating bath met EPA point-source category standards until it ceased operation in the early 1970s. The drainpipe was cut and capped inside the wall to make it inaccessible. According to the building manager, no releases from the drainpipe have occurred (LANL 1995, 057590, pp. 6-72, 6-73).

##### **Previous Investigations**

Samples have not been collected at this site.

##### **Proposed Activities**

The nature and extent of contamination has not been defined at this site. Four soil samples will be collected from the location where the former drainline exited the building to characterize the site (Figure 4.1-53). The samples will be collected from two locations at two depths (0 to 1 ft and 1 to 2 ft) and analyzed for inorganic chemicals and cyanide. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

#### **4.1.25 AOC 03-038(d), Waste Lines**

##### **Site Description**

AOC 03-038(d) is an industrial waste line associated with the liquid waste treatment system. Between the 1950s and 1970s, the industrial drains from buildings 03-0032 and 03-0034 connected the two buildings to the old industrial waste line (Figure 4.1-54), which was replaced with a new line in 1986. The new line connected building 03-0034 to the RLW facility in TA-50, while the drains in building 03-0032 were connected to the sanitary sewer. The industrial waste line was completely removed between 1981 and 1986, and no releases were found (LANL 1995, 057590, p. 6-45).

##### **Previous Investigations**

Samples have not been collected at this site.

##### **Proposed Activities**

The nature and extent of contamination had not been defined at this site. Ten soil samples will be collected from five locations to characterize the site (Figure 4.1-55). The samples will be collected from two depths (0 to 1 ft and 1 to 2 ft) to characterize the site. Samples will be analyzed for inorganic

chemicals and cyanide. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

#### **4.1.26 AOC 03-043(a), Aboveground Storage Tank**

##### **Site Description**

AOC 03-043(a) is a former 20,000-gal. underground storage tank, structure 03-0074, installed in 1948 at the former asphalt batch plant for storing asphalt emulsion (Figure 4.1-1). The tank was removed in 1963, disassembled, disposed of at the Los Alamos County landfill, and replaced by another storage tank, structure 03-0178 [AOC 03-043(f)]. The area was used for aggregate (sand and gravel) storage and feed mixing for the former asphalt batch plant. No record of releases to the environment is associated with this AOC. Review of historical aerial photographs revealed no staining in the area of AOC 03-043(a) (LANL 1995, 057590, pp. 6-12, 6-18). In 2003, the surface of the site was paved with asphalt for use as a parking lot. Before paving, sampling was conducted to characterize the potential impact of several SWMUs in the vicinity (LANL 2003, 080912, p. 1).

##### **Previous Investigations**

Samples were collected within the vicinity of AOC 03-043(a) as part of sampling activities for SWMUs 03-036(c) and 03-36(d). Results of these sampling activities are discussed in sections 4.1.7.5 and 4.1.7.6. Decision-level data are presented in Tables 4.1-3, 4.1-4, and 4.1-6. Sampling locations and detected results are shown Figures 4.1-3 and 4.1-4.

##### **Proposed Activities**

No sampling is proposed for this AOC because the nature and extent of contamination have been defined at this site. Although previous sampling identified inorganic chemicals in the area, the contaminant concentrations decrease with depth. Organic chemicals were also detected but at concentrations less than EQLs. In addition, AOC 03-043(a) is now covered by an asphalt parking lot.

#### **4.1.27 AOC 03-043(f), Aboveground Storage Tank**

AOC 03-043(f) is a duplicate of SWMU 03-036(c). Section 4.1.7.5 describes the proposed activities at SWMU 03-036(c).

#### **4.1.28 AOC 03-043(g), Aboveground Storage Tank**

AOC 03-043(g) is a duplicate of SWMU 03-036(d). Section 4.1.7.6 describes the proposed activities at SWMU 03-036(d).

#### **4.1.29 SWMU 03-045(a), Outfall**

##### **Site Description**

SWMU 03-045(a) is an outfall from the Laboratory's power plant (building 03-0022) which operated from the 1950s to 1993 (Figure 4.1-29). The primary outflow from the building to SWMU 03-045(a) was noncontact water from steam condensate. In addition, water from floor drains in the basement, first floor, mezzanine, heater floor, platform, and roof drains of the steam plant previously discharged to this outfall. In 1989, an oil/water separator was installed near the outfall to prevent oil from building operations

reaching the outfall. In 1993, the separator was removed and the discharge pipe was capped (LANL 1995, 057590, p. 6-71). In mid-1991, a diesel fuel release of approximately 100 to 200 gal. occurred from the two aboveground diesel fuel tanks at building 03-0022. As the system was being pressurized, a faulty fitting on a fuel line to the diesel tanks caused the release (LANL 1995, 057590, p. 6-79). The release [SWMU 03-036(j)] occurred directly above SWMU 03-045(a) and flowed down the slope south of the steam plant into the drainage channel (LANL 1996, 055035, Attachment B, p. 1, Attachment D, p. 1). The spill was contained approximately 120 yd east of the leak. The drainage was blocked, and an extensive cleanup was performed to remove all diesel fuel and diesel-contaminated soil (LANL 1995, 057590, p. 6-79). The remediation included removing soil and sediment in and around SWMU 03-045(a) and replacing it with clean fill (LANL 1995, 057590, p. 6-71).

### **Previous Investigations**

Samples have not been collected at this site.

### **Proposed Activities**

The nature and extent of contamination have not been defined at this site. Ten sediment and soil samples will be collected from five locations to confirm the previous sampling and to define nature and extent of contamination (Figure 4.1-33). The samples will be collected from two depths (0 to 1 ft and 1 to 2 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, TPH-LRO, cyanide, and PCBs. Sampling locations will be biased to the outfall area and areas of sediment accumulation. No HE or radionuclides are associated with this SWMU; therefore, no samples will be analyzed for nitrate, perchlorate, or radionuclides. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

In addition, samples will be collected from the drainage downgradient of this site as part of the Sandia Canyon and Cañada del Buey investigation work plan (LANL 1999, 064617). Section 6.3 provides additional information about the reach investigations to be conducted in Sandia Canyon.

#### **4.1.30 SWMU 03-045(e), Outfall**

##### **Site Description**

SWMU 03-045(e) is an inactive outfall from a floor drain in an oil pump house (structure 03-0057) located at the TA-03 power plant, building 03-0022. One line from each of two diesel storage tanks (structure 03-0026 and former structure 03-0027) passed through the pump house to the steam plant (Figure 4.1-23). Valves in the pump house operated each line and allowed diesel to flow from one or both storage tanks. The drain was in place to prevent the pump house from filling with diesel fuel if a valve junction should rupture or leak. The drain and associated piping were plugged in 1989. A concrete apron is located at the point where the drainline discharged to Sandia Canyon (LANL 1995, 057590, pp. 6-7–6-8).

##### **Previous Investigations**

Samples have not been collected at this site.



## **Proposed Activities**

The nature and extent of contamination have not been defined at this site. Eight soil samples will be collected from four locations downgradient of the outfall to define nature and extent of potential contamination (Figure 4.1-24). The samples will be collected from two depths (0 to 1 ft and 1 to 2 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, cyanide, and TPH-DRO. No HE or radionuclides are associated with this SWMU; therefore, no samples will be analyzed for nitrate, perchlorate, or radionuclides. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

In addition, samples will be collected from the drainage downgradient of this site as part of the Sandia Canyon and Cañada del Buey investigation work plan (LANL 1999, 064617). Section 6.3 provides additional information about the reach investigations to be conducted in Sandia Canyon.

### **4.1.31 SWMU 03-045(f), Outfall**

#### **Site Description**

SWMU 03-045(f) is an outfall from a sink drain that served the utilities control center (building 03-0223) from 1950 to the late 1980s (Figure 4.1-29). The outfall was located on the north side of the building and emptied into Sandia Canyon. The sink was used as a quench tank for welding and cutting. No known releases of hazardous wastes or constituents from the sink or from SWMU 03-045(f) occurred (LANL 1995, 057590, p. 6-8). The sink was removed in the late 1980s. In 1993, the outfall was vegetated. Visual inspection found no distinct erosion, indicating the outfall did not discharge large quantities of water (LANL 1996, 055035, Appendix A, p. 1).

#### **Previous Investigations**

Samples have not been collected at this site.

#### **Proposed Activities**

The nature and extent of contamination have not been defined at this site. Ten sediment and soil samples will be collected from five locations to define nature and extent of contamination (Figure 4.1-33). The samples will be collected from two depths (0 to 1 ft and 1 to 2 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, cyanide, nitrate, and PCBs. Sampling locations will be biased to the outfall and sediment accumulations. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

In addition, samples will be collected both upgradient and downgradient of this SWMU as part of the investigation for SWMUs 03-045(a), 03-045(c), and 03-012(b). Sections 4.1.9.1, 4.1.9.4, and 4.1.29 provide more detailed information. Samples will also be collected from the drainage downgradient of this site as part of the Sandia Canyon and Cañada del Buey investigation work plan (LANL 1999, 064617). Section 6.3 provides additional information about the reach investigations to be conducted in Sandia Canyon.

#### 4.1.32 SWMU 03-045(h), Outfall

##### Site Description

SWMU 03-045(h) is a former NPDES-permitted outfall (EPA 03A024) located in TA-03 at the north perimeter of the Sigma Complex security fence, approximately 50 ft north of a cooling tower (structure 03-0187) (Figure 4.1-13). The outfall was formerly permitted for the discharge of treated cooling water and stormwater. It served a former cooling tower that was replaced by a smaller cooling tower (structure 03-0187) between 1997 and 1998. The outfall was plugged in 1997 during the removal of the previous cooling tower and was removed from the NPDES permit in 2007 (EPA 2007, 099009). The cooling tower was constructed in 1953 and was inactive from the late 1980s to early 1995 when it was reactivated. The area at the outfall pipe is about 3-ft wide x 6-ft long. Effluent drained into a corrugated metal storm drainpipe that trended northeast and east of structure 03-0187 where it combined with more stormwater runoff from surrounding areas. The drainage continued south and joined a channel north of Eniwetok Drive that ultimately drained into Sandia Canyon. Routine water treatment began in 1968. Treatment included biocides and fungicides to reduce algae growth and chelating agents such as ethylenediaminetetraacetic acid to inhibit corrosion.

##### Previous Investigations

No sampling activities have been conducted at this SWMU; however, RFI sampling activities were conducted in 1997 at AOC 03-052(b), located northeast and downgradient from the corrugated metal storm drain pipe into which SWMU 03-045(h) discharged. RFI sampling activities for AOC 03-052(b) are discussed in section 4.1.37.

##### Proposed Activities

The nature and extent of contamination have not been defined at this site. This SWMU will be investigated as part of the Upper Mortandad Aggregate Area (LANL 2007, 098954). Discharges from this SWMU that went underground and eventually daylighted and drained into AOC 03-052(b) will be investigated (Figure 4.1-17). Section 4.1.37 and (Figure 4.1-17) provides more information regarding the proposed sampling at AOC 03-052(b).

#### 4.1.33 SWMU 03-046, Aboveground Wastewater Treatment Tank

##### Site Description

SWMU 03-046 is an aboveground wastewater neutralization tank located within TA-03 approximately 60 ft southeast of the Laboratory's steam plant, building 03-0022. The Laboratory received a certificate of completion for this SWMU from NMED during the writing of this work plan (NMED 2008, 100116). Therefore, this SWMU will not be investigated as part of this work plan.

#### 4.1.34 AOC 03-047(d), Storage Area

##### Site Description

AOC 03-047(d) is the location of a former container storage area located on the east side of the power plant building 03-0022 (Figure 4.1-29). The storage area consisted of an asphalt pad where drums of new motor oil, used oil, and Stoddard solvent were stored from 1954 to 1989. A new location for an upgraded materials storage area was selected in 1989. The asphalt pad was removed in 1989 when the storage

area was decommissioned (LANL 1995, 057590, p. 6-83). A voluntary corrective action (VCA) was implemented at the site in 1995 that involved the characterization, excavation, and removal of soil. Approximately 6 yd<sup>3</sup> of soil were excavated to a depth of 4 to 6 in. from a 20 ft x 20 ft area that encompassed the AOC and adjacent soil directly north and east of the AOC boundary. The site was subsequently restored by backfilling and compacting the excavated area, followed by revegetation (LANL 2002, 073868.138, p. 5).

### **Previous Investigations**

As part of the 1995 VCA, three soil samples were collected from the top 6 in. of the excavated area and analyzed for inorganic chemicals, VOCs, SVOCs, PCBs, and pesticides. Requested analyses are presented in Table 4.1-2.

In January 2002, soil was excavated within the boundary of AOC 03-047(d) before a concrete pad was installed for an emergency backup generator and transformer for the TA-03 steam plant. Shortly after the area had been excavated, a 6-in. main potable-water-supply line to the steam plant ruptured, releasing approximately 250,000 gal. of water. As a result, soil and fill along the entire eastern wall of building 03-0022, including soil and fill within and around the AOC boundary, was eroded. Soil that washed into the excavation was subsequently removed. The concrete support pad and an emergency generator and transformer were installed at the site during the spring and summer of 2002 (LANL 2002, 073868.138, p. 8).

### **Proposed Activities**

The nature and extent of contamination have been defined at this site, and no additional sampling is proposed. The VCA conducted in 1995 characterized the site and demonstrated that contaminants pose no potential unacceptable risk to humans and ecological receptors (LANL 2002, 073868.138, p. 19).

#### **4.1.35 AOC 03-047(g), Drum Storage**

##### **Site Description**

AOC 03-047(g) is a drum storage area where drums of acetone, vacuum pump oil, and ethylene glycol were stored under a canopy on the north side of building 03-0141 (Figure 4.1-8). During a 1989 site reconnaissance survey, staining was found on the cement. During a site visit in September 1993, the building manager stated that the area had been used for approximately 20 yr to store product oil and occasionally solvents. Only one drum was on the pad when the site visit was conducted. The drum contained mineral oil and was used for vacuum pumps. As oil was dispensed, spills were known to occur. Stains were evident on the concrete around the barrel; however, the staining did not continue beyond the concrete, indicating that small oil spills did not migrate off the concrete pad (LANL 1995, 057590, p. 6-46).

##### **Previous Investigations**

Samples have not been collected at this site.

##### **Proposed Activities**

The nature and extent of contamination have not been defined at this site. Eight samples will be collected from four locations (Figure 4.1-12). The samples will be collected from two depths (0 to 1 ft and 1 to 2 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, PCBs, cyanide, nitrate, and

perchlorate. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

#### **4.1.36 AOC 03-051(c), Soil Contamination—Vacuum Pump Leak**

##### **Site Description**

AOC 03-051(c) consists of two areas of stained asphalt attributed to operational leaks vacuum pump oil (LANL 1995, 057590, p. 6-84). One area, measuring approximately 6 ft × 6 ft, was located on the east side of building 03-0141 (Figure 4.1-8). The second area, located at the northeast corner of the building, measured approximately 10 ft × 15 ft (LANL 1996, 053780, p. 15).

##### **Previous Investigations**

A VCA was performed at this AOC in August 1995. The stained areas of asphalt were removed, and soil was excavated until unstained soil was reached. Soil samples were field-screened for radioactivity, PAH, TPH, x-ray fluorescence (XRF) inorganic chemicals, and VOCs. The first set of XRF samples showed elevated thallium levels. After the results from cleanup verification samples were received, cleanup activities resumed to remove an additional 2 to 3 in. of thallium-contaminated soil. Two samples collected after soil excavation was completed showed no elevated thallium levels. The excavated areas were backfilled with soil and gravel and compacted (LANL 1996, 053780, pp. 14–16). Before the area was backfilled, four soil samples were collected from four locations (two samples at each excavation) at depths of 0 to 0.5 ft bgs to verify site cleanup. Samples were analyzed for inorganic chemicals, SVOCs, and pesticides. Requested analyses are presented in Table 4.1-2.

Screening-level data and are presented in Table 4.1-11. Sampling locations are shown in Figures 4.1-8, 4.1-9, and 4.1-10. Lead and zinc were both detected above BVs in one sample. Cadmium was detected above BV in four samples. SVOCs and pesticides were not detected

##### **Proposed Activities**

The nature and extent of contamination have not been defined at this site. Four samples will be collected from two locations to confirm the results of the VCA (Figure 4.1-12). The samples will be collected from two depths (2 to 3 ft and 4 to 5 ft) and analyzed for inorganic chemicals, SVOCs, PCBs, cyanide, nitrate, perchlorate, and TPH-DRO. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

#### **4.1.37 AOC 03-052(b), Storm Drainage**

##### **Site Description**

AOC 03-052(b) consists of five storm-drain-access areas located about 20 ft north and west of the Sigma Building, building 03-0066 (Figure 4.1-13). Surface runoff flows across the surrounding area into the system at two locations: the system on the northeast side of building 03-0066 discharges to a storm drain outlet just north of Eniwetok Drive and a single storm drain located on the northwest side of building 03-0066 discharges to a low-lying grassy area (LANL 1995, 057590, p. 5-15-1). This AOC was investigated with AOC 03-056(k), a container storage area and loading dock at building 03-0066 (see section 4.1.42). Contaminants associated with AOC 03-056(k) may have been released into the AOC 03-052(b) storm drain system. Potential contaminants are inorganic chemicals and DU (LANL 1995, 057590, pp. 5-15-3–5-15-4).



## Previous Investigations

RFI activities were conducted at this AOC in 1997. Two soil and/or fill samples were collected from each of five locations and one from a fifth location corresponding to the storm drain access areas. Samples were collected from a depth of 0 to 1 ft bgs and from a depth ranging from 1 to 5 ft bgs. Two of the samples were collected at one collocated location. The samples were field screened for radioactivity and organic chemicals. Screening did not detect organic chemicals, and radioactivity was at or below background levels (LANL 1997, 056660.4, p. iv). All samples were analyzed for metals and isotopic uranium. One sample was also analyzed for VOCs. Requested analyses are presented in Table 4.1-1.

Decision-level data are presented in Table 4.1-3. Sampling locations and detected results are shown in Figures 4.1-14 and 4.1-15. Cadmium, manganese, and nickel were detected above BVs in one sample; cobalt, lead, and zinc were detected above BVs in two samples. Detection limits for antimony, cadmium, and silver were greater than BVs for most samples. Organic chemicals and radionuclides were not detected.

## Proposed Activities

The nature and extent of contamination have not been defined at this site. All five areas of AOC 3-052(b) will be sampled (Figure 4.1-17).

Four samples will be collected from historical locations 03-03291 and 03-03286 at two depths (7 to 8 ft and 10 to 11 ft). In addition, 20 additional samples will be collected from 10 locations (2 within each area) at two depths (1 to 2 ft and 4 to 5 ft) to define the extent of contamination (Figure 4.1-17). Samples will be analyzed for inorganic chemicals, VOCs, SVOCs, and cyanide. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

Six additional samples will be collected from three locations along the northern part of the drainage between the northwest and northeast polygons associated with this site (Figure 4.1-17). The samples will be collected from two depths (1 to 2 ft and 4 to 5 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, and cyanide. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

### 4.1.38 SWMU 03-054(c), Outfall

#### Site Description

SWMU 03-054(c) is a former cooling tower (structure 03-0156) and pump house (structure 03-0163) and an outfall that discharged to the storm sewer and ultimately to former NPDES-permitted outfall, EPA 03A023 [SWMU 03-052(f), see section 4.1.10.2]. The cooling tower and pump house were located southwest of the former Sherwood Complex (building 03-0105) and northwest of the former Syllac Building (building 03-0287) (Figure 4.1-56). Former structures 03-0156 and 03-0163 were used to cool an electromagnet formerly located in the Sherwood Complex. The outfall discharged to the storm sewer that was formerly located 25 ft east of the cooling tower.

#### Previous Investigations

The Laboratory's former Environmental, Safety, and Health group collected two composite surface soil samples directly north of the cooling tower in 1992 and two samples from the cooling tower in 1993 to characterize the structure and surrounding soil before D&D of the structures. Samples were screened for gross-alpha, -beta, and -gamma radiation and submitted for laboratory analysis of total chromium.

Chromium was not detected above the EPA action level (LANL 1995, 057590, pp. 6-71, 6-72). The cooling tower and pump house were dismantled and removed, leaving only the concrete pad of the former pump house at a depth of 10 ft bgs (LANL 2001, 071214).

The Syllac Building (building 03-0287) underwent D&D activities from 2003 to 2004, and the Sherwood Complex (building 03-0105) underwent D&D activities in 2001 (LANL 2002, 073868.4, Appendix B-7, p. 1). As part of the D&D of the Sherwood Complex in 2001, the former cooling tower location, including the subsurface concrete pad, the storm drain, and all associated piping and pavement, were removed (LANL 2001, 071214). Seven confirmation soil and fill samples were collected from seven locations at the bottom of the SWMU 03-054(c) excavation ranging from depths of 2 to 8.5 ft bgs. One grab sample was also collected from drain line excavated material and analyzed for metals and hexavalent chromium (Tucker 2001, 100702, pp. 1-3, 13-22). Requested analyses are presented in Table 4.1-1.

Decision-level data are presented in Table 4.1-3. Sampling locations and detected results are shown in Figure 4.1-57. Calcium, lead, and zinc were each detected above BVs in one sample. The detection limit for antimony was greater than the BV in all samples. Hexavalent chromium was not detected.

In 2004, six fill samples were collected from three locations at depths of 0 to 0.5 ft bgs and 0 to 2 ft bgs. Requested analyses are presented in Table 4.1-1 but are not shown in Figure 4.1-57 because no inorganic chemicals were detected above BVs.

### **Proposed Activities**

No additional sampling is proposed because the nature and extent of contamination have been defined at this site.

#### **4.1.39 SWMU 03-056(a), Storage Area**

##### **Site Description**

SWMU 03-056(a) is a used-oil accumulation facility built in 1986. The 12-ft x 45-ft structure is located approximately 15 ft north of building 03-0271 (Figure 4.1-18). The storage area has a concrete floor that slopes toward a sump and is surrounded by a concrete berm. The area is roofed, but the sides are open. No spills from the bermed area to the environment have occurred (LANL 1993, 020947, p. 6-36).

##### **Previous Investigations**

In 2001, samples were collected to determine the nature and extent of any residual TPH or lead contamination at the site. Four asphalt samples were collected adjacent to each side of the concrete storage pad, approximately 1 ft away from the edge of the pad. Soil samples were also collected directly beneath the asphalt (at depths of 0.5 to 1.0 ft bgs) at each of the four asphalt sampling locations for a total of eight samples (LANL 2001, 070937). All samples were submitted for laboratory analysis of metals; the soil samples were also submitted for analysis of TPH-DRO. Requested analyses are presented in Table 4.1-1.

Decision-level data are presented in Tables 4.1-3 and 4.1-8. Sampling locations and detected results are shown in Figures 4.1-19 and 4.1-20. Calcium was detected above BV in all four soil samples; silver and zinc were detected above BVs in one soil sample. TPH was not detected in any of the soil samples. Antimony, cadmium, and silver were detected in one asphalt sample; with the exception of selenium and thallium (which were not detected), all remaining inorganic chemicals were detected in all asphalt samples.

## Proposed Activities

The nature and extent of contamination have not been defined at this site. Eight soil samples will be collected from four locations adjacent to the concrete (one on each side of the concrete floor) (Figure 4.1-22). The samples will be collected from two depths (0 to 1 ft of soil beneath the concrete and 1 to 2 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, and cyanide. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

### 4.1.40 SWMU 03-056(c), Transformer Storage Area—PCB Site

#### Site Description

SWMU 03-056(c) is an inactive outdoor storage area located on the north side of a utilities shop, building 03-0223. The SWMU extends along the length of building 03-0223 to the south and is bounded by a security fence to the north (Figure 4.1-29) (Faulk 1995, 055741, p. 13). The outdoor storage area was used for storing electrical equipment, capacitors, and transformers with PCB-containing dielectric fluids. Waste solvents used for cleaning electrical equipment were also stored at this location in unmarked drums (LANL 1993, 020947, pp. 5-100–5-101). The types of solvents used at the site from 1967 to approximately 1981 are not known. Viking R30 (1,1,1-trichloroethane) was used from 1981 to 1990 (Faulk 1995, 055741, p. 13). Beginning in 1990 and continuing to 1992, a nonhazardous citrus-based solvent was used as a substitute for solvent-based cleaners. It is unknown whether the solvents used at the site were stored on-site. In addition, Transclene, which contains PCE, may have been stored at the site because it was used by an electrical equipment maintenance subcontractor to refill transformers in the field. It is believed that the maintenance crew disposed of all these waste materials at an approved waste-disposal facility. In 1991, the site's facility manager placed approximately 1 to 2 ft of clean fill on the area occupying the former storage area to elevate it and to reroute run-on drainage away from this site. In 1992, the storage area was decommissioned (LANL 2001, 071259, p. 6).

#### Previous Investigations

Previous investigation and cleanup activities were performed at SWMU 03-056(c) in 1994, 1995, and 1999. In 1994, a total of 21 soil samples, 19 confirmatory samples and 3 sample splits were collected from 18 locations (LANL 1994, 040397, pp. 1-49) at depths ranging from 0 to 3 ft belowgrade. Samples were analyzed for inorganic chemicals, SVOCs, PCB/pesticides, and VOCs. Samples were also screened for gross-alpha and -beta, -gamma, and tritium (LANL 2001, 071259, p. 10).

In 1995, the site was further characterized as part of an expedited cleanup to identify the lateral extent of soil containing residual PCBs. Ten samples were collected from the western slope area to better define the lateral extent of the PCB contamination. A 45-ft-diameter area was initially mapped to represent the area of suspected contamination. A 10-ft × 10-ft grid was placed over the area of suspected contamination and soil samples were collected within grid nodes. The results of the grid sampling effort were used to target areas for soil excavation. During soil excavation activities, the lateral extent of soil contamination was further defined to encompass an area approximately 130 ft long × 70 ft wide. The western slope excavation area was expanded in a northerly direction along the mesa edge. Additional site characterization samples were collected in the northern slope area of the site. PCB-contaminated soil was excavated from an area approximately 60 ft long × 70 ft wide. Also, three soil samples were collected from the ephemeral slope drainages, downslope from the north and west slope areas (LANL 2001, 071259, p. 10).

A VCA plan was developed in 1999 for removing PCB-contaminated soil from the western and northern slope areas and the ephemeral slope drainage areas. Because of the site's proximity to a watercourse, the PCB cleanup targets were less than 1 ppm of PCBs in soil. The VCA plan was approved by NMED in 2000 (LANL 2001, 071259, p. 2).

The remedial activities at the site, as specified in the VCA plan, began in August 2000. SWMU 03-056(c) was characterized using field screening techniques, PCB EnSys Soil Test, to determine the extent of PCB contamination (LANL 2001, 071259, p. 12). After site characterization, the contaminated soil and unconsolidated tuff were excavated. Approximately 2400 yd<sup>3</sup> of contaminated soil was excavated from the SWMU. During the excavation activities, field screening was used to provide immediate confirmation that all PCB-contaminated soil and unconsolidated tuff in the excavated area had been removed to a cleanup level of less than 1 ppm. Excavation field-screening activities results determined that contamination extended beyond the original SWMU boundary (LANL 2001, 071259, p. 17-20).

Following excavation activities, 89 confirmation samples were collected from 79 locations. All samples were submitted for laboratory analysis of PCBs. Twenty-one of these samples were also analyzed for metals and VOCs (LANL 2001, 071259, p. 17). Thirteen inorganic chemicals were detected above BVs. Seven organic chemicals were detected. Aroclor-1260 was detected at the highest frequency. In March 2001, the areas with elevated PCB detections were excavated. In April 2001, additional confirmation sampling was conducted. One sample was collected from each excavated location. All samples were analyzed for PCBs, and three samples were also analyzed for VOCs and metals (LANL 2001, 071259, p. 17). Confirmation sample results indicated the site met the EPA cleanup criterion for less than 1 ppm (LANL 2001, 071259, pp. iii-iv, 58). Results of final VCA activities are discussed in the VCA report (LANL 2001, 071259).

The VCA report for SWMU 03-056(c) was approved by EPA in November 2001 (EPA 2001, 072810) and by NMED in September 2002 (NMED 2002, 073363).

### **Proposed Activities**

No sampling is proposed because the nature and extent of contamination have been defined at this site.

#### **4.1.41 AOC 03-056(h), Container Storage Area**

##### **Site Description**

AOC 3-056(h) is described in the 1990 SWMU report (LANL 1990, 007511) as a container storage area near former buildings 03-0105 (the Sherwood Complex ) and 03-0287 (the Syllac Building) (Figure 4.1-56) (LANL 1990, 007511, p. 3-056.2). Several areas of potential contamination were identified with this AOC. Areas near former building 03-0287 were addressed under SWMU 03-003(c) and AOC 03-003(o) (discussed in sections 4.1.2 and 4.1.6, respectively). Building 03-0105 underwent D&D activities in 2001 (LANL 2002, 073868.4, Appendix B-7, p. 1). The site is currently occupied by the NSSB (building 03-1400).

Beginning in the mid-1950s, former building 03-0105 housed magnetic fusion energy experiments. Before a 1992 cleanout, a number of swipe samples were collected on various surfaces throughout the building. Results revealed no PCB contamination. During the salvage cleanout of former building 03-0105, some non-PCB oil was spilled north of the building. Swipe samples collected in this area at the time of the spill revealed no PCB contamination. A cable shed, structure 03-0252, located west of building 03-0105 was also removed during the 1992 decommissioning. Swipe samples collected from oil stains on the plywood floor and from beneath the floor yielded no PCBs (LANL 1995, 057590, pp. 6-64, 6-67-6-68).



Another area of potential contamination was on the southeast side of former building 03-0105. During a site reconnaissance visit in 1989, two transformers were observed inside a fenced area at this location. No oil stains were present on the asphalt around the transformers (LANL 1995, 057590, pp. 6-67–6-68).

On the west side of former building 03-0105, PCB spills were reported in September 1991 and March 1993. In the 1991 leak, soil beneath a leaking spigot was excavated until unstained soil was reached. In the 1993 incident, an oil stain under a transformer was double-washed/double-rinsed. On a site visit in 1994, only one stain was noted in the vicinity. Swipe samples at the location revealed no PCB concentrations above  $2.8 \mu\text{g}/100 \text{ cm}^2$  (LANL 1995, 057590, pp. 6-67, 6-68).

The PCB-containing transformers and capacitors described above have all been removed or replaced with non-PCB equipment in accordance with the DOE/Albuquerque Operations Office Environmental Restoration and Waste Management Five-Year Plan (LANL 1995, 057590). Under this plan, any evidence of a release was sampled and cleaned up in accordance with TSCA requirements (40 CFR 761). The documented releases of PCBs were remediated in accordance with the TSCA requirements found in 40 CFR 761 (LANL 1995, 057590, p. 6-67). In addition, approximately 10 ft of clean fill was placed over the entire site to accommodate the construction of the NSSB (LANL 2008, 099214).

### **Proposed Activities**

No sampling is proposed for this SWMU because the PCB-containing transformers and capacitors were removed or replaced with non-PCB equipment and because documented releases of PCBs were remediated in accordance with the TSCA requirements in 40 CFR 761 (LANL 1995, 057590, p. 6-67). In addition, this site is inaccessible and currently located beneath the foundation of a building (structure 03-1400).

#### **4.1.42 AOC 03-056(k), Container Storage Area**

##### **Site Description**

AOC 03-056(k) is a container storage area on the north side of a loading dock at the northwest corner of the Sigma Building, building 03-0066 (Figure 4.1-13). Waste oil, solvents, and radioactively contaminated graphite were kept in the storage area (LANL 1990, 007511, p. 3-056). Four documented releases of radiological materials to the environment may have contributed to contamination at this AOC. Potential contaminants were inorganic chemicals and DU (LANL 1995, 057590, pp. 5-15-1, 5-15-3–5-15-4).

##### **Previous Investigations**

RFI activities were conducted at this AOC in 1997. Ten soil and fill samples were collected from six locations at depths ranging from 0 to 4.5 ft bgs. Four asphalt samples were collected at four of the locations. Samples were field screened for organic chemicals and radioactivity. Screening did not detect organic chemicals, and radioactivity was at or below BVs (LANL 1997, 056660.4, pp. 101, 104). All samples were submitted for laboratory analysis of isotopic uranium; all soil and fill samples were submitted for laboratory analysis of metals. One asphalt sample and one fill sample were analyzed for gross-alpha and -beta radiation and by gamma spectroscopy. One fill sample was also analyzed for VOCs. Requested analyses are presented in Table 4.1-1.

Decision-level data are presented in Tables 4.1-3, 4.1-4, 4.1-7, and 4.1-10. Sampling locations and detected results are shown in Figures 4.1-14, 4.1-15, and 4.1-16. Lead was detected above BV in one sample, and copper was detected above BV in two fill samples. Detection limits for antimony, cadmium,

and silver were greater than BVs in the 10 soil and fill samples. Carbon disulfide and 2-butanone were detected in one sample. Gross-alpha and -beta radiation were detected in one fill sample; uranium-235 was detected above BV in one fill sample, and uranium-238 was detected above BV in three fill samples. Uranium-234, uranium-235, and uranium-238 were detected in all asphalt samples; gross-alpha and -beta radiation, cesium-134, and cesium-137 were detected in one asphalt sample.

### Proposed Activities

The nature and extent of contamination have not been defined at this site. Two deeper samples (3 to 4 ft and 6 to 7 ft) will be collected at sampling location 03-03290, and nine samples will be collected from three new locations to the south, west, and northeast of the historical sampling locations to define the vertical and lateral extents of inorganic chemical contamination (Figure 4.1-17). These samples will be collected from three depths (0 to 1 ft, 3 to 4 ft, and 6 to 7 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, and cyanide, and radionuclides. No HE was associated with this AOC; therefore, no samples will be analyzed for nitrate or perchlorate. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

To define the extent of organic chemical contamination detected, two deeper samples (3 to 4 ft and 6 to 7 ft) will be collected from sampling location 03-03281 (Figure 4.1-17). To characterize the organic chemical contamination at the AOC, four new locations will be sampled at two depths (1 to 2 ft and 3 to 4 ft). These eight samples will be analyzed for VOCs and SVOCs only.

#### 4.1.43 SWMU 03-056(I), Storage Area

##### Site Description

SWMU 03-056(I) (Figure 4.1-8) is an outdoor storage facility next to the east side of building 03-0141. Containers of disposable clothing contaminated with beryllium powder are staged in this area before disposal. Carboys used to store beryllium powder in water were also staged in this area. The carboys were usually in a tray that served as secondary containment. No known releases from the drums or carboys to the environment have occurred (LANL 1995, 057590, p. 6-11).

##### Previous Investigations

Samples were collected from this SWMU before the planned construction of a new beryllium storage vault. The collection of three asphalt samples and three surface soil samples from beneath the asphalt within the former staging area on the east side of building 03-0141 were proposed in the 2003 sample notification. The samples were to be submitted for total beryllium analysis (LANL 2003, 075992). In 2003, three asphalt samples were collected from three locations and three soil samples were collected from beneath the asphalt samples at depths of approximately 0.5 to 2.25 ft bgs (two samples) and 0.6 to 1.6 ft bgs (one sample). One soil sample was collected from a fourth location at a depth of 0 to 1.6 ft bgs. All samples were analyzed for metals rather than total beryllium. The requested analysis is presented in Table 4.1-1.

Decision-level data are presented in Tables 4.1-3 and 4.1-8. Sampling locations and detected results are shown in Figure 4.1-9. Manganese and zinc were detected above BVs in one soil sample. Calcium and copper were detected above BVs in two soil samples. Thallium and beryllium were detected in one and two asphalt samples, respectively. With the exception of antimony and silver (which were not detected in any asphalt samples), all remaining inorganic chemicals were detected in all three asphalt samples.

## Proposed Activities

The nature and extent of contamination have not been defined at this site. Five samples from the asphalt will be collected from five locations (Figure 4.1-12). In addition, five samples will be collected from the soil under the asphalt from the same locations as the asphalt samples. The samples will be collected from a depth of 2 to 3 ft below the asphalt to confirm the results from previous investigations. Samples will be analyzed for inorganic chemicals and cyanide. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites. Section 4.1.36 provides more information on the proposed sampling.

### 4.1.44 Consolidated Unit 03-059-00

Consolidated unit 03-059-00 consists of AOC 03-003(n) and SWMU 03-059. This consolidated unit is a former storage area adjacent to building 03-0271 (Figure 4.1-18). SWMU 03-059 was identified as the former salvage yard, and AOC 03-003(n) was the location of a one-time PCB spill in that salvage yard. SWMU 03-059 was used to store transformers, electrical equipment, batteries, and scrap metal pending sale or reuse. The spill area [AOC 03-003(n)] is identified as being approximately 20 ft south of the northwest corner of building 03-0271.

Proposed sampling for this consolidated unit is provided in the following sections.

#### 4.1.44.1 AOC 03-003(n), One-Time Spill—PCB Site

##### Site Description

AOC 03-003(n) is the location of a one-time PCB spill in the salvage yard (SWMU 03-059) located next to the south side of building 03-0271. The perimeter is fenced, except for the part that abuts building 03-0271 (Figure 4.1-18). With the exception of two small portions of the area, most of the area is asphalt-paved. The salvage yard was used to store transformers, electrical equipment, batteries, and scrap metal pending sale or reuse. Small and weather-sensitive items were stored inside building 03-0271. All other items were placed in and around the former salvage yard. The spill area identified as AOC 03-003(n) is approximately 20 ft south of the northwest corner of building 03-0271. At that location, a transformer ruptured in 1977 and leaked an estimated 10 gal. of PCB-contaminated oil into the soil. It is unclear whether the spill was cleaned up or if confirmation sampling was conducted. The drainage pattern west of building 03-0271 was altered in 1991 when the parking lot was regraded and base course was applied. The entire area received additional base course at least once since 1991. The salvage operation and materials were moved to the building 60-0002 in 1993. The former salvage-yard area is used as a parking lot and storage area for empty containers (LANL 1995, 057590, pp. 5-19-1, 5-19-3).

##### Previous Investigations

In 1994, two soil samples were collected from two locations within the area of the PCB spill at depths of 0 to 0.8 ft bgs. The samples were analyzed for PCBs, gross-alpha, -beta, and -gamma radiation, and tritium. Requested analyses are presented in Table 4.1-2 (as part of Consolidated Unit 03-059-00 samples). Sampling locations are shown in Figures 4.1-20 and 4.1-21. Data were of screening-level quality and no analytes were detected.

## Proposed Activities

The nature and extent of contamination have not been defined at this site. Eight soil samples will be collected from four locations to confirm the effectiveness of previous remedial actions (Figure 4.1-22). The samples will be collected from two depths (0 to 1 ft and 1 to 2 ft) and analyzed for PCBs only. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

### 4.1.44.2 SWMU 03-059, Storage Area—PCB Site

#### Site Description

SWMU 03-059 is a former salvage yard consisting of two areas. The first area is about 250 ft × 115 ft and is located adjacent to the south side of building 03-0271 (Figure 4.1-18). The perimeter is fenced, except for the part that abuts building 03-0271. With the exception of two small portions of the area, most of the area is asphalt-paved. The second area is about 100 ft × 60 ft, asphalt-paved, and fenced. Paving over both areas occurred incrementally over a period of years. Equipment also was stored outside the fenced areas.

#### Previous Investigations

In 1994, 10 asphalt samples were collected from 10 locations within the salvage yard at depths of 0 to 0.5 ft bgs. Samples were analyzed for PCBs, gross-alpha, -beta, and -gamma radiation, and tritium. Requested analyses are presented in Table 4.1-2 (as part of Consolidated Unit 03-059-00 samples). Screening-level data are presented in Table 4.1-15. Sampling locations are shown in Figures 4.1-20 and 4.1-21. Tritium was detected in three samples. PCBs were not detected.

## Proposed Activities

The nature and extent of contamination have not been defined at this site. Thirty-four samples will be collected from 17 locations beneath the asphalt to define nature and extent of potential contamination (Figure 4.1-22). The samples will be collected from two depths (0 to 1 ft and 2 to 3 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, PCBs, cyanide, perchlorate, and nitrate. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

### 4.1.45 AOC C-03-022, Kerosene Tanker Trailer

#### Site Description

AOC C-03-022 is the location of a former tanker trailer used to store and distribute kerosene for former asphalt batch plant operations. The tanker trailer was located in a bermed materials storage area on a hill directly north of the asphalt batch plant (Figure 4.1-1). The tanker was in service for approximately 15 yr and supplied kerosene through a gravity-feed line that had a valve near the oil distributor tank, AOC C-03-016, located approximately 12 ft south (directly below the hill) of the tanker. The tanker and gravity-feed line were removed in 1989, and kerosene was replaced with diesel fuel No. 2. There is no record of release or source of contamination associated with this storage tanker.

#### Previous Investigations

AOC C-03-022 has not been sampled.

## Proposed Activities

No sampling is proposed for this AOC because no releases were documented and the kerosene was dispensed at AOC C-03-016 (Figure 4.1-5). Sampling is proposed for AOC C-03-016. Section 4.1.19 provides further details.

### 4.2 TA-60

TA-60, also known as Sigma Site, was created from the eastern portion of TA-03 and lies on Sigma Mesa between Sandia and Mortandad Canyons. The buildings at TA-60 are all located on the western end of the mesa and contain Laboratory support and maintenance operations and contractor service facilities. The NTS test fabrication facility (building 60-0017), the NTS test tower (building 60-0018), several small abandoned experimental areas, including a solar pond and a test drill hole, a new asphalt batch plant, and storage sites for pesticides, topsoil, and tuff are also located at TA-60 (LANL 1999, 064617, p. 2-25).

Transport mechanisms include airborne surface soil, infiltration through the vadose zone, continued dissolution and advective/dispersive transport of chemical and radiological contaminants contained in subsurface soil and bedrock, and disturbance and uptake of contaminants by plants and animals. Potential receptors include laboratory workers and ecological receptors in the undeveloped areas.

During summer thunderstorms and spring snowmelt, runoff from the mesa top flows into storm drains, down hillsides, and into both Sandia and Mortandad Canyons. Surface-water runoff and erosion of contaminated surface soil may lead to contamination of bench areas on the hillside and surface water off-site. Surface water may also access subsurface contaminants exposed by soil erosion. Groundwater sampling for Upper Sandia Canyon is discussed in the Sandia Canyon Phase I sediment investigations summary report (LANL 2006, 094161). This work plan only addresses the collection of soil and tuff samples.

Samples collected for TA-60 and analyses requested for decision-level data are presented in Table 4.2-1; for screening-level data in Table 4.2-2. Decision-level data are presented in Tables 4.2-3 and 4.2-4; screening-level data in Tables 4.2-5 to 4.2-7. All laboratory analytical data (both decision-level and screening-level) are also provided in Appendix B of the HIR (LANL 2008, 100693). Figures 4.2-1 to 4.2-19 include base maps; maps showing inorganic chemicals and radionuclides detected above BVs/FVs and detected organic chemicals; and maps showing the proposed sampling locations for TA-60 sites.

#### 4.2.1 SWMU 60-002, Storage Area

##### Site Description

SWMU 60-002 consists of three former storage areas (designated as western, central, and eastern) on Sigma Mesa. The first area (western) measures approximately 200 ft x 300 ft and is located approximately 900 ft southeast of building 60-0002, on the north side of the unimproved road that traverses the mesa (Figure 4.2-1). Historically, piles of concrete blocks, wooden poles, tuff fill, and cables were stored at this location. A large mound of fill, with pieces of cured asphalt and concrete, was situated in the northern portion of the site. The second area (central) was located approximately 120 ft northwest of the pesticide storage facility (building 60-0029) and consisted of a 50-ft-diameter mound of fill approximately 10 ft high with construction debris including concrete fence post supports, pipe, metal strips, and wood (Figure 4.2-6). The third area (eastern) is on the south side of the unimproved road about 100 ft west of a surface impoundment [SWMU 60-005(a)] near the end of the mesa (Figure 4.2-10). This area was used to stage piles of broken cured asphalt chunks removed from roadways and parking



lots before if was recycled (LANL 2005, 100704). The eastern area is currently the site of an asphalt batch plant (Shaw Environmental Inc., 2003, 085517, p. 1).

### **Previous Investigations**

Sampling was conducted at the central area of SWMU 60-002 in 2004. Six soil samples were collected from five locations at depths of 0 to 1 ft bgs and 1.5 to 2 ft bgs. Five samples were analyzed for inorganic chemicals, VOCs, SVOCs, PCBs, and TPH. One sample was analyzed for SVOCs, PCBs, and TPH (LANL 2005, 100704, p. 5). Requested analyses are presented in Table 4.2-1.

Decision-level data are presented in Tables 4.2-3 and 4.2-4. Sampling locations are shown in Figures 4.2-7 and 4.2-8. Manganese was detected above BV in one sample. Acenaphthene, Aroclor-1254, Aroclor-1260, and TPH-GRO were each detected in two samples.

In 2003, sampling was conducted at the eastern area of SWMU 60-002 (LANL 2003, 080912, p. 4) that included the drilling of six boreholes. Ten soil and tuff samples were collected from five boreholes at two depth intervals ranging from 3 to 6 ft bgs and 13.5 to 17 ft bgs. Three tuff samples were collected from the sixth borehole at depths of 4 to 4.5 ft bgs, 8.5 to 9 ft bgs, and 14.5 to 15 ft bgs. All samples were submitted for laboratory analyses of inorganic chemicals, VOCs, SVOCs, and TPH. Requested analyses are presented in Table 4.2-1.

Decision-level data are presented in Tables 4.2-3 and 4.2-4. Sampling locations and detected results are shown in Figures 4.2-11 and 4.2-12. Barium, cobalt, and zinc were each detected above BVs in one soil sample; calcium and nickel were detected above BVs in two soil samples. Beryllium, cobalt, copper, manganese, and selenium were each detected above BVs in one tuff sample; iron and lead were detected above BVs in two tuff samples; arsenic, barium, calcium, chromium, magnesium, nickel, and vanadium were detected above BVs in three tuff samples; aluminum was detected above BV in four tuff samples. Fluoranthene, fluorene, and pyrene were each detected in one soil sample; hexanone(2-), was detected in one tuff sample; acetone was detected in five tuff samples; TPH-DRO was detected in all samples. The detection limits for cadmium and selenium in numerous soil and tuff samples were higher than BVs.

Samples have not been collected at the western area of SWMU 60-002. Although there is no specific data for this area, the location of the SWMU in relation to other sampling locations is shown in Figures 4.2-2, 4.2-3, and 4.2-4.

### **Proposed Activities**

The nature and extent of contamination have not been defined for SWMU 60-002 (west). Twenty-four soil samples will be collected from six boreholes to define nature and extent of contamination (Figure 4.2-5). The samples will be collected from four depths (0 to 1 ft, 4 to 5 ft, 9 to 10 ft, and 16 to 17 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, TPH-GRO, PCBs, and cyanide. No HE or radionuclides are associated with this SWMU; therefore, no samples will be analyzed for nitrate, perchlorate, or radionuclides. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

No sampling is proposed at SWMU 60-002 (central) and SWMU 60-002 (east) because the nature and extent of contamination have been defined. Previous investigations at these sites detected TPH. TPH results were compared with, and found to be below, NMED's TPH screening guidelines for industrial and residential land uses (NMED 2006, 094614).

#### **4.2.2 AOC 60-004(b), Storage Area**

##### **Site Description**

AOC 60-004(b) is a former staging area for 12 containers of diesel sludge removed from underground storage tanks at the power plant. The containers were stored at AOC 60-004(b) in 1988. The storage site is located northeast of the geothermal well mud pit at the east end of Sigma Mesa and is contained within the boundaries of AOC 60-004(d) (Figure 4.2-9). Potential contaminants were oil and petroleum products (LANL 1993, 020947, pp. 1-7, 5-70, 5-76).

##### **Previous Investigations**

RFI activities were performed at AOC 60-004(b) in 1994. Two soil samples were collected from two locations at depths of 0 to 1 ft bgs and submitted for laboratory analyses of inorganic chemicals, SVOCs, PCBs, and pesticides (LANL1996, 052930, pp. 149, 150). A third soil sample was collected south and adjacent to AOC 60-004(b) within the boundary of AOC 60-004(d). The sample was collected from a depth of 0 to 1 ft bgs and analyzed for VOCs and gross-alpha, -beta, and -gamma radiation. Requested analyses are presented in Table 4.2-2.

Screening-level data are presented in Tables 4.2-5 and 4.2-6. Sampling locations are shown in Figures 4.2-11, 4.2-12, and 4.2-13. Mercury was detected above BV in one sample. Bis(2-ethylhexyl)phthalate, phenol, and Aroclor-1254 were detected in one sample. VOCs and radionuclides were not detected.

##### **Proposed Activities**

The nature and extent of contamination have not been defined at this site. Twenty-five soil samples will be collected from five boreholes around AOCs 60-004(b) and 60-004(d) (Figure 4.2-14). The samples will be collected from five depths (0 to 1 ft, 2 to 3 ft, 4 to 5 ft, 9 to 10 ft, and 14 to 15 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, cyanide, and TPH-DRO. No HE or radionuclides are associated with this SWMU; therefore, no samples will be analyzed for nitrate, perchlorate, or radionuclides. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

#### **4.2.3 AOC 60-004(d), Storage Area**

##### **Site Description**

AOC 60-004(d) is an area formerly used to dismantle decommissioned underground storage tanks and to temporarily stage drums containing fluids removed from underground storage tanks. The site is located northeast of the geothermal well mud pit at the east end of Sigma Mesa (Figure 4.2-10). The area was first developed in 1979 during a drilling project for a geothermal well. The northern edge of the area was used to stage building rubble, concrete, and rebar. Potential contaminants were oil and petroleum products (LANL 1993, 020947, pp. 5-69, 5-70).

##### **Previous Investigations**

RFI activities conducted at AOC 60-004(d) in 1994 were the same as those for AOC 60-004(b), discussed in section 4.2.2. Requested analyses are presented in Table 4.2-2. Data are of screening-level quality and are presented in Tables 4.2-5 and 4.2-6. Sampling locations are shown in Figures 4.2-11, 4.2-12, and 4.2-13.

## Proposed Activities

The nature and extent of contamination have not been defined at this site. Twenty-five soil samples will be collected from five boreholes around AOCs 60-004(b) and 60-004(d) (Figure 4.2-14). The samples will be collected from five depths (0 to 1 ft, 2 to 3 ft, 4 to 5 ft, 9 to 10 ft, and 14 to 15 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, cyanide, and TPH-DRO. No HE or radionuclides are associated with this SWMU; therefore, no samples will be analyzed for nitrate, perchlorate, or radionuclides. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

### 4.2.4 AOC 60-004(f), Storage Area

#### Site Description

AOC 60-004(f) consists of two unpaved, bermed pads, Pad 2 and Pad 3, formerly used for new-product storage. The pads were constructed in 1978 when the maintenance warehouse (building 60-0002) was built (Figure 4.2-1). The pads were located southeast of building 60-0002. Pad 2 was 12 ft × 65 ft and Pad 3 was 12 ft × 40 ft. Both pads stored 55-gal. containers that dispensed Stoddard solvent, antifreeze, motor oil, grease, transmission fluid, and window-washing fluid. In 1985, 6-in. asphalt berms were built at the open ends of both pads to mitigate rainfall run-on and runoff problems. In 1990, all containers were removed from the pads. Both pads were stained and had a petroleum odor (LANL 1993, 020947, pp. 5-15–5-16).

#### Previous Investigations

RFI activities were conducted at AOC 60-004(f) in 1994. Thirteen samples were collected from five locations at Pad 2, and 11 samples were collected from five locations at Pad 3. At Pad 2, four samples (one sediment, one soil, and two tuff) were collected from one location at depths ranging from 0 to 7 ft bgs; four samples (two soil and two tuff) were collected from a second location at depths ranging from 1 to 6 ft bgs; three soil samples were collected from three locations at depths ranging from 1 to 2 ft bgs; and two sediment samples were collected from two locations at depths of 0 to 1.5 ft bgs. At Pad 3, four samples (two soil and two tuff) were collected from depths ranging from 1 to 6.5 ft bgs; four samples (two soil and two tuff) were collected from a second location at depths ranging from 1 to 6 ft bgs; and three samples (two soil and one tuff) were collected at a third location at depths ranging from 2 to 6 ft bgs. All samples were analyzed for radionuclides. Approximately half the samples were submitted for laboratory analyses of inorganic chemicals, VOCs, SVOCs, PCBs, and pesticides (LANL 1996, 052930, pp. 167–169). Requested analyses are presented in Table 4.2-2.

Screening-level data are presented in Tables 4.2-5, 4.2-6, and 4.2-7. Sampling locations are shown in Figures 4.2-2, 4.2-3, and 4.2-4. Aluminum was detected above BV in four tuff samples; arsenic was detected above BVs in one sediment and one tuff sample; barium was detected above BVs in two sediment and five tuff samples; calcium was detected above BV in two tuff samples; chromium was detected above BV in four tuff samples; copper was detected above BVs in one sediment and one soil sample; lead was detected above BV in one tuff sample; magnesium was detected above BV in four tuff samples; manganese was detected above BV in one soil sample; mercury was detected above BV in three tuff samples; nickel was detected above BV in one tuff sample; zinc was detected above BVs in one sediment and three soil samples. Aroclor-1254 and Aroclor-1260 were detected in one tuff sample. Tritium was detected in one soil, one sediment, and eight tuff samples. VOCs, SVOCs, and pesticides were not detected.

## Proposed Activities

The nature and extent of contamination have not been defined at this site. Twenty soil samples will be collected from five boreholes at AOC 60-004(f) (Figure 4.2-5). The samples will be collected from four depths (0 to 1 ft, 2 to 3 ft, 4 to 5 ft, and 9 to 10 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, cyanide, and TPH-DRO. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

### 4.2.5 SWMU 60-006(a), Septic System

#### Site Description

SWMU 60-006(a) is a decommissioned septic system located on Sigma Mesa near the northeast corner of the fence surrounding buildings 60-0017 and 60-0019. This septic system formerly served buildings 60-0017 (NTS test rack fabrication facility) and 60-0019 (NTS test tower) (Figure 4.2-6). The septic system consists of a 1000-gal. septic tank and associated 4-ft-wide x 50-ft-deep seepage pit. No outfall is associated with this system. Building 60-0017 began operating in 1986 to fabricate equipment for testing activities carried out at NTS. From 1986 to 1989, wastewater generated from facility bathrooms and seven floor drains, including one in a paint booth, was discharged to the septic system. In 1989, building 60-0017 was connected to the sanitary sewer. Potential contaminants are inorganic chemicals and organic chemicals (LANL 1993, 020947, pp. 5-63, 5-64).

#### Previous Investigations

RFI activities were performed at SWMU 60-006(a) in 1994 to determine whether the septic tank had been drained and, if not, whether its contents were hazardous. The tank was found to be full, and two waste characterization samples were collected from the sludge in the tank (LANL1996, 052930, pp. 181, 182). The samples were analyzed for inorganic chemicals, SVOCs, gross-alpha, -beta, and -gamma radiation, and tritium (LANL 1996, 052930, pp. 183, 185). Requested analyses are presented in Table 4.2-2.

Screening-level data are presented in Tables 4.2-5 and 4.2-7. There are no BVs for any analytes in sludge; therefore, only inorganic chemicals and tritium are reported as detected in both samples. SVOCs were not detected.

#### Proposed Activities

Both the septic tank and the seepage pit will be removed. The septic tank and its contents, and seepage pit materials will be removed and disposed of at an appropriate waste facility (Figure 4.2-9). Nine confirmatory soil samples will be collected from three boreholes at and near the inlet and outlet areas of the tank's former location to determine if a release to the environment has occurred. The samples will be collected from three depths (5 to 6 ft, 9 to 10 ft, and 14 to 15 ft) below the tank and analyzed for inorganic chemicals, VOCs, SVOCs, PCBs, cyanide, nitrate, perchlorate, and radionuclides. Additional excavation and sampling depends on the results of the initial analyses. Four soil samples will be collected from one borehole within the seepage to determine the nature and vertical extent of potential contamination (Figure 4.2-9). Samples will be collected from four depths (2 to 3 ft, 5 to 6 ft, 9 to 10 ft, and 14 to 15 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, and cyanide. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

#### 4.2.6 SWMU 60-007(a), Release

##### Site Description

SWMU 60-007(a) is a 50-ft × 100-ft former storage area located near the east end of Sigma Mesa (Figure-4.2-10) that was used to store equipment for the drilling of a geothermal well. Oil, hydraulic fluid, and similar materials were released to the environment. In 1992, areas of stained soil were removed, placed in containers, and disposed of by the user group. The remediated areas were covered with gravel. No sampling was conducted by the user group to confirm removal of the contamination (LANL 1996, 052930, pp. 189–190).

##### Previous Investigations

RFI activities were conducted at SWMU 60-007(a) in 1994. Eleven soil samples were collected from eight locations and field screened for PCBs and organic chemicals. With the exception of one sample, field test kits did not detect PCBs. Organic chemicals were detected at elevated readings, but moisture interference was suspected as the reason (LANL 1996, 052930, pp. 192–194). One fill and five soil samples were collected from five locations at depths of 0 to 1 ft bgs. Two samples were analyzed for inorganic chemicals, five were analyzed for VOCs, two were analyzed for SVOCs, and three were analyzed for PCBs. Five additional soil and fill samples were collected from four locations at depths of 0 to 1 ft bgs and analyzed for gross-alpha, -beta, and -gamma radiation. Requested analyses are presented in Tables 4.2-1 and 4.2-3.

Decision-level data are presented in Tables 4.2-3 and 4.2-4. Sampling locations and detected results are shown in Figures 4.2-11 and 4.2-12. Barium was detected above BV in one sample. Toluene was detected in one sample. SVOCs and PCBs were not detected.

Sampling was also performed at SWMU 60-007(a) in 2001 (LANL 2001, 070937, pp. 1, 4). Six fill samples were collected from six locations at depths of 0 to 0.25 ft bgs and 0 to 0.5 ft bgs. All samples were submitted for laboratory analyses of inorganic chemicals, PCBs, and TPH (LANL 2001–2002, 100703, pp. 2–3). Requested analyses are presented in Table 4.2-1.

Decision-level data are presented in Tables 4.2-3 and 4.2-4. Sampling locations and detected results are shown in Figures 4.2-11 and 4.2-12. Thallium was detected above BV in one sample. TPH-DRO and TPH-LRO were detected in two and three samples, respectively. No PCBs were detected.

##### Proposed Activities

The nature and extent of contamination have not been defined at this site. Twelve soil samples will be collected from four locations to define the nature and extent of contamination (Figure 4.2-14). The samples will be collected from three depths (0 to 1 ft, 2 to 3 ft, and 4 to 5 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, cyanide, and PCBs. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

#### 4.2.7 SWMU 60-007(b), Release

##### Site Description

SWMU 60-007(b) is a storm drainage ditch that starts approximately 600 ft from a paved area directly north of the motor pool building (building 60-0001) and extends to the bottom of Sandia Canyon (Figure 4.2-15). Two parking lots located east of building 60-0001 drain to a ditch that eventually joins the



SWMU 60-007(b) drainage ditch. Other former sources of potential contamination to the ditch are a steam-cleaning pad, a used-oil storage tank, and an oil/water separator. In addition, equipment that used PCB-containing oil was stored on an asphalt area east of building 60-0001 (LANL 1993, 020947, pp. 5-14–5-15). In 1986, the user group removed stained soil from the ditch (LANL 1996, 052930, p. 195).

### **Previous Investigations**

In 1994, RFI activities were conducted at SWMU 60-007(b) to determine if any contamination remained in the sediment after the 1986 soil removal. Eight samples were collected from seven locations in the east/west drainage ditch north of building 60-0001 and field-tested for PCBs; PCBs were not detected. In the north/south drainage ditch east of building 60-0001, seven locations were field-screened for organic chemicals. No organic chemicals were detected. Six soil and sediment samples were collected from four locations at depths ranging from 0 to 1.5 ft bgs. Two sediment samples were analyzed for metals; one soil and one sediment sample were analyzed for VOCs; two sediment samples were analyzed for SVOCs; and two samples were analyzed for PCBs. All samples were analyzed for gross-alpha, -beta radiation, and tritium (LANL 1996, 052930, pp. 195–199). Requested analyses are presented in Table 4.2-2.

Decision-level data are presented in Tables 4.2-5, 4.2-6, and 4.2-7. Sampling locations are shown in Figures 4.2-16, 4.2-17, and 4.2-18. Calcium was detected above BV in one sample.

Bis(2-ethylhexyl)phthalate was detected in one sample. Tritium was detected in three samples. VOCs and PCBs were not detected.

### **Proposed Activities**

The nature and extent of contamination have not been defined at this site. Twenty-four sediment samples will be collected from 12 locations within the drainage (Figure 4.2-19). Samples will be collected from two depths (0 to 1 ft and 1 to 2 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, TPH-DRO, cyanide, and PCBs. No HE or radionuclides are associated with this SWMU; therefore, no samples will be analyzed for nitrate, perchlorate, or radionuclides. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

### **4.3 TA-61**

TA-61 was created from a portion of TA-03 and is bounded on the north by Los Alamos Canyon and on the south by Sandia Canyon (LANL 1999, 064617, p. 2-27).

Transport mechanisms include airborne surface soil, infiltration through the vadose zone, continued dissolution and advective/dispersive transport of chemical and radiological contaminants contained in subsurface soil and bedrock, and disturbance and uptake of contaminants by plants and animals. Potential receptors include laboratory workers, constructions workers, and ecological receptors in the undeveloped areas.

During summer thunderstorms and spring snowmelt, runoff from the mesa top flows into storm drains, down hillsides, and into both Sandia and Mortandad Canyons. Surface-water runoff and erosion of contaminated surface soil could lead to contamination of bench areas on the hillside and surface water off-site. Surface water may also access subsurface contaminants exposed by soil erosion. Groundwater sampling for Upper Sandia Canyon is addressed in the Sandia Canyon investigation report (LANL 2006, 094161).

TA-61 has not been previously sampled; therefore, no data tables are included and Figures 4.3-1 to 4.3-3 include only the base maps and proposed sampling locations.

#### **4.3.1 SWMU 61-002, Transformer Storage Area—PCB Site**

##### **Site Description**

SWMU 61-002 is a former storage area at TA-61, east of the Radio Repair Shop (building 61-0023, formerly building 03-0282) on East Jemez Road (Figure 4.3-1). This storage area is part of a fenced area that measures 81 ft x 91 ft. Historically, the area was used to store capacitors and transformers. In addition, the storage area contained several oil-filled containers and unmarked containers. Before 1985, containers of PCB-contaminated oil were stored in this area and were known to have leaked. In 1986, elevated PCB concentrations were detected in 32 soil samples collected at this area. The area was subsequently excavated, backfilled with clean soil, and paved over with asphalt. After the 1986 remediation, the east side of the storage area was used to store electrical equipment, some of which contained PCBs (LANL 1993, 020947, p. 5-101). All storage operations were discontinued in 1992. Staining was observed on the surface of the asphalt. Potential contaminants are PCBs and possibly lead (LANL1996, 052930, p. 201).

##### **Previous Investigations**

In the summer of 1994, RFI activities were conducted at SWMU 61-002 to determine if PCBs were present in the stains on the asphalt or in surface soil downgradient from the site. Sampling locations were selected using the stained areas and a minor drainage area as reference points. Eighteen soil samples were collected from 16 locations (0 to 6 in. bgs). Samples were field-screened for VOCs, and analyzed for SVOCs, PCBs, and metals. Zinc was detected above BV. Elevated PCB concentrations were found in two samples in the drainage pathway at the farthest downgradient locations sampled. The RFI report recommended further investigation at SWMU 61-002 to identify the extent of contamination (LANL 1996, 052930, pp. 204–205). In 1997, 42 samples (soil, fill, tuff, and asphalt) were collected from 19 locations (0 to 1.8 ft bgs) and submitted to an off-site analytical laboratory for analysis of PCBs. PCBs were detected in 38 samples. No report was written for this sampling event. In 2004, an accelerated corrective action (ACA) work plan was submitted to NMED for the investigation and remediation of SWMU 61-002 (LANL 2004, 087474, p. 6).

In 2005, NMED approved the ACA work plan with modifications (NMED 2005, 087835). During the 2005 investigation and remediation of residual PCB contamination, petroleum-hydrocarbon contamination was discovered in the subsurface. As a result, in August 2005, two underground product lines and a total of 424 yd<sup>3</sup> of soil were removed. The contaminated area was further characterized in 2006. The results of the 2005 and 2006 sampling and remediation activities were reported in a remedy completion report (LANL 2007, 097315). A revised remedy completion report was submitted to NMED in November 2007 (LANL 2007, 100722).

##### **Proposed Activities**

No sampling is proposed for this site because it has already been remediated (LANL 2007, 100722).

#### **4.3.2 SWMU 61-005, Landfill**

##### **Site Description**

SWMU 61-005 consists of the Los Alamos County landfill. The landfill was established in 1974 and is owned by DOE and operated by Los Alamos County for use by the public, the county, and the Laboratory. It has a permit to manage nonhazardous solid waste and is regulated by NMED (LANL 1993, 020947, p. 6-9).

The landfill is located in TA-61 on the rim of Sandia Canyon near East Jemez Road. It consists of 400-ft<sup>2</sup> pits excavated into tuff (Figure 4.3-3). The pits are designed so runoff does not enter the canyon. Waste is deposited into the active pit and daily covered with soil. When full, the pit is capped and a new pit is put into service.

##### **Previous Investigations**

Samples have not been collected from this site.

##### **Proposed Activities**

No sampling is proposed for this SWMU because it is an active unit regulated under RCRA Subtitle D. Although a few active cells continue to accept waste, this landfill is currently being closed under RCRA Subtitle D.

#### **4.3.3 SWMU 61-006, Waste-Oil Tank**

##### **Site Description**

SWMU 61-006 is an active oil recycling area located at the Los Alamos County landfill (SWMU 61-005) (Figure 4.3-1). The oil recycling area consists of an open, lined pit approximately 10 ft × 20 ft × 7 ft deep that contains a 2500-gal. holding tank. An 8-ft-long pipe leads to a filling bin at ground level. Historically, three underground tanks were in the pit; in 1989, two of the tanks were removed (LANL 1990, 007514, p. 61-006). The area where the former tanks were located was excavated as a disposal pit for use at the landfill (LANL 1993, 020947, p. 6-10). The third tank was moved to its current location in the open, lined pit. The pit was covered, a leak detection system installed on the tank, and the pit was relined with an improved liner (LANL 1993, 020947, p. 6-10). Upgrades were completed in 2000.

##### **Previous Investigations**

Samples have not been collected from this site.

##### **Proposed Activities**

No sampling is proposed for this SWMU because it is an active RCRA-regulated unit under 40 CFR 279 and 20.4.1.1002 New Mexico Administrative Code, Standards for the Management of Used Oil. This SWMU has a leak detection system and a spill control and countermeasure plan that addresses releases to the environment.

#### **4.3.4 AOC C-61-002, Subsurface Contamination**

##### **Site Description**

AOC C-61-002 is an area of subsurface contamination that was encountered in 1995 during a drill rig test. The area is located in TA-61, approximately 15 ft north of building 61-0016, a former storage building (former structure 03-0326) (Figure 4.3-1). During the drilling test, an odor was noted, and contamination was encountered at 7 to 8 ft bgs. The contamination was suspected to be petroleum-based (e.g., diesel). A sample of the tuff was collected and the analysis showed the presence of diesel. Interviews conducted with personnel after the drilling was completed indicated that the source of the diesel may have been the previous road maintenance support work performed in the area (LANL 1995, 049550, p. 2).

##### **Past Investigations**

Samples have not been collected from this site.

##### **Proposed Activities**

The nature and extent of contamination have not been defined at this site. Thirty samples will be collected from five boreholes to define nature and extent of contamination (Figure 4.3-2). Samples will be collected from six depths (3 to 4 ft, 5 to 6 ft, 7 to 8 ft, 9 to 10 ft, 11 to 12 ft, and 14 to 15 ft) and analyzed for inorganic chemicals, VOCs, SVOCs, cyanide, and TPH-DRO. Table 4.0-1 provides a summary of the proposed sampling locations, depths, and analytical suites.

### **5.0 INVESTIGATION METHODS**

A summary of investigation methods to be implemented is presented in Table 5.0-1. The standard operating procedures (SOPs) used to implement these methods are available at <http://www.lanl.gov/environment/all/qa.shtml>.

Summaries of the field-investigation methods are provided below. Additional procedures may be added as necessary to describe and document quality-affecting activities.

Chemical analyses will be performed in accordance with the analytical statement of work (LANL 2000, 071233). Accredited contract analytical laboratories will use the most recent EPA- and industry-accepted extraction and analytical methods for chemical analyses of analytical suites.

#### **5.1 Field Surveys**

The following sections describe the field surveys that will be conducted at the Upper Sandia Canyon Aggregate Area.

##### **5.1.1 Geodetic Surveys**

Geodetic surveys will be conducted by a land surveyor in accordance to the latest version of SOP-03.11, Coordinating and Evaluating Geodetic Surveys, to locate historical structures and to document field activities such as sampling and excavation locations. The surveyors will use a Trimble GeoXT hand-held global-positioning system (GPS) or equivalent for the surveys. The coordinate values will be expressed in the New Mexico State Plane Coordinate System (transverse mercator), Central Zone, North American

Datum 1983. Elevations will be reported as per the National Geodetic Vertical Datum of 1929. All GPS equipment used will meet the accuracy requirements specified in the SOP.

### **5.1.2 Geophysical Surveys**

Geophysical surveys will be performed at selected sites to verify the location, dimensions, total depth, base profile, topography, low-elevation point, and downslope end using as-built construction drawings and boring logs. The surveys will verify locations determined from engineering drawings, site reconnaissance, and geodetic surveys and refine assessments of the subsurface structures. Geophysical methods employed may include electromagnetic, gravity, and ground-penetrating radar, as appropriate, to effectively delineate the materials or feature being surveyed.

## **5.2 Subsurface Characterization**

### **5.2.1 Drilling Methods for Boreholes**

Boreholes will be drilled by hollow-stem auger or hand-auger methods, as indicated in section 4. A brief description of these methods is provided below. Boreholes will be drilled in accordance with SOP-04.01, Drilling Methods and Drill Site Management. Selected boreholes will be geophysically logged with caliper, camera, neutron, and natural gamma tools according to the current versions of SOP-04.04, Contract Geophysical Logging, and SOP-07.05, Subsurface Moisture Measurements Using a Neutron Probe.

#### **5.2.1.1 Hollow-Stem Auger**

The hollow-stem auger consists of a hollow-steel shaft with a continuous spiraled steel flight welded onto the exterior of the stem. The stem is connected to an auger bit; when it is rotated, it transports cuttings to the surface. The hollow stem of the auger allows insertion of drill rods, split-spoon core barrels, Shelby tubes, and other samplers through the center of the auger so samples may be retrieved during drilling operations. The hollow stem also acts to case the borehole core temporarily so a well casing (riser) may be inserted down through the center of the auger once the desired depth is reached, thus minimizing the risk of possible collapse of the borehole. A bottom plug or pilot bit can be fastened onto the bottom of the auger to keep out most of the soil and/or water that tends to clog the bottom of the augers during drilling. Drilling without a center plug is acceptable if the soil plug, formed in the bottom of the auger, is removed before sampling or installing a well casing. The soil plug can be removed by washing out the plug using a side-discharge rotary bit or auguring out the plug with a solid-stem auger bit sized to fit inside the hollow-stem auger.

#### **5.2.1.2 Hand Auger**

Hand augers may be used to bore shallow holes (0 to 15 ft). The hand auger is advanced by turning or pounding the auger into the soil until the barrel is filled. The auger is removed and the sample is dumped out. Motorized units for one or two operators may be used and can reach depths up to 30 ft under certain conditions.



### 5.2.1.3 Borehole Abandonment

All boreholes will be properly abandoned according to the most recent version of SOP-5.03, Monitoring Well and RFI Borehole Abandonment, except those identified for completion as vapor-monitoring wells, moisture-monitoring wells, or groundwater-monitoring wells, by one of the following methods.

- Shallow boreholes, with a total depth of 20 ft or less, will be abandoned by filling the borehole with bentonite chips and then hydrated. Chips will be hydrated in 1- to 2-ft lifts. The borehole will be visually inspected while the bentonite chips are being added to ensure that bridging does not occur.
- Boreholes greater than 20 ft in depth will be pressure-grouted from the bottom of the borehole to the surface using the tremie pipe method. Acceptable grout materials include cement or bentonite grout, neat cement, or concrete.

The use of backfill materials such as bentonite and grout will be documented in a field logbook with regard to volume (calculated and actual), intervals of placement, and additives used to enhance backfilling. All borehole abandonment information will be provided in the investigation report.

## 5.3 Sample Collection

### 5.3.1 Surface Samples

Surface and shallow subsurface soil and sediment samples will be collected during drilling activities, in accordance with SOP-06.09, Spade and Scoop Method for the Collection of Soil Samples. Stainless-steel shovels, spades, scoops, and bowls will be used for ease of decontamination. Decontamination will be completed using a dry decontamination method with disposable paper towels and an over-the-counter cleaner, such as Fantastik or an equivalent. Disposable tools made of polystyrene or Teflon will also be used, if necessary. In some cases, for deeper sample intervals, hand-augering tools, including power augers, will be used to collect shallow subsurface samples if geologic material conditions permit. The tools to be used and their applicability are described in the current version of SOP-06.10, Hand Auger and Thin-Wall Tube Sampling. If the surface location is at bedrock, an axe or hammer and chisel will be used to collect samples.

Quality assurance/quality control (QA/QC) samples will include field duplicate samples, equipment blanks, trip blanks, and reagent blanks. These samples will be collected following the current version of SOP-01.05, Field Quality Control Samples, and will comply with a frequency of 10% of total samples collected for field duplicates and rinsate blanks. Trip blanks will be supplied and remain with analytical samples when samples are collected for VOC analysis. QA/QC samples are used to monitor the validity of the sample collection procedures.

Soil and sediment samples will be field-screened as described in the following sections and placed in the appropriate sample container(s) as grab samples collected with hand augers, scoops, or chiseling devices in accordance with the sampling guidance document and appropriate SOPs (SOP-01.01 to SOP-01.08).

### 5.3.2 Subsurface Samples

Following the current version of SOP-06.24, Sample Collection from Split-Spoon Samplers and Shelby Tube Samplers, and SOP-06.26, Core Barrel Sampling for Subsurface Earth Materials, subsurface samples will be collected from core extracted in a split-spoon core barrel. Samples collected for chemical

analysis will be placed in the appropriate sample containers depending on the analytical method requirement in accordance with the sampling guidance and appropriate SOPs listed in Table 5.0-1. The analytical suites for the samples from each borehole will vary according to the data requirements, as described in Table 4.0-1 and section 4 of this work plan.

QA/QC samples will include field duplicate samples, equipment blanks, trip blanks, and reagent blanks. These samples will be collected following the current version of SOP-01.05, Field Quality Control Samples, and will comply with a frequency of 10% of total samples collected for field duplicates and rinsate blanks. Trip blanks will be supplied and remain with analytical samples when samples are collected for VOC analysis. QA/QC samples are used to monitor the validity of the sample collection procedures.

Following the current version of SOP-12.01, field documentation of samples collected from fractures will include a detailed physical description of the fracture-fill material and rock matrix sampled. The volumes of fracture-fill and rock-matrix material included in the sample will be estimated from field measurements. Additional samples will be collected from the rock matrix adjacent to the fracture sample material to allow for comparison.

Field documentation will also include detailed borehole logs for each borehole drilled. The borehole logs will document the matrix material in detail and will include the results of all field screening; fractures and matrix samples will be assigned unique identifiers. All field documentation will be completed in accordance with the current version of SOP-12.01.

### **5.3.3 Excavation**

Excavations or test pits will be completed using a track excavator or backhoe at selected site(s). Excavated soil will be staged a minimum of 3 ft from the edge of the excavation, and excavations deeper than 4 ft bgs will be appropriately benched to allow access and egress, if necessary. After field screening, confirmation sampling, and any necessary overexcavation work are completed, the excavations and/or trenches will be backfilled with clean fill material. Excavators may also be used to collect grab samples for those locations where hand augers or power augers encounter refusal before the maximum proposed sampling depth.

## **5.4 Laboratory Analytical Methods**

The analytical suites vary by area as specified in section 4 and summarized in Table 4.0-1. All analytical suites are presented in the statement of work for analytical laboratories (LANL 2000, 071233). Sample collection and analysis will be coordinated with the Sample Management Office.

## **5.5 Health and Safety**

The field investigations described in this investigation work plan will comply with all applicable requirements pertaining to worker health and safety. An integrated work document and a site-specific health and safety plan will be in place before fieldwork is performed.

## **5.6 Equipment Decontamination**

Equipment for drilling and sampling will be decontaminated before and after drilling and sampling activities (as well as between drilling boreholes) to minimize the potential for cross-contamination. Drilling/exploration equipment that may come in contact with the borehole will be decontaminated by

steam-cleaning, by hot water pressure-washing, or by another method before each new borehole is drilled. All sampling and measuring equipment, including, but not limited to, stainless-steel sampling tools, split-barrel or core samplers, well-developing or purging equipment, groundwater-quality measurement instruments, and water-level measurement instruments, will be decontaminated in accordance with SOP-01.08, Field Decontamination of Drilling and Sampling Equipment. The equipment will be pressure-washed with a high-density polyethylene liner on a temporary decontamination pad. Cleaning solutions and wash water will be collected and contained for proper disposal. Decontamination solutions will be sampled and analyzed to determine the final disposition of the wastewater and the effectiveness of the decontamination procedures. All parts of the drilling equipment, including the undercarriage, wheels, tracks, chassis, and cab, will be thoroughly cleaned. Air filters on equipment operating in the exclusion zone will be decontaminated, removed, and replaced before the equipment leaves the site. Sites identified as radiological control areas based upon surface radiological surveys will have all equipment surveyed by a Health and Safety Radiation Control Division technician before it is released from the site.

## **5.7 Investigation-Derived Waste**

IDW generated during field-investigation activities may include, but is not limited to, drill cuttings; contaminated soil; contaminated personal protective equipment (PPE), sampling supplies, and plastic; fluids from the decontamination of PPE and sampling equipment; and all other waste that has potentially come into contact with contaminants

All IDW generated during field-investigation activities will be managed in accordance with applicable SOPs. These SOPs incorporate the requirements of all applicable EPA and NMED regulations, DOE orders, and Laboratory implementation requirements. Appendix B presents the IDW management plan.

## **5.8 Cleanup Activities**

Removal of the inactive components of SWMU 60-006(a) and septic tank are proposed for cleanup under this investigation work plan. Excavation of contaminated media, waste disposition, and confirmation sampling will be completed at this SWMU. This section summarizes proposed cleanup activities.

### **5.8.1 Description of Proposed Actions**

The general sequence of activities for waste excavation, transportation, disposal, and confirmation sampling is summarized below. Specific details for the site are provided in section 4.2.5.

#### **5.8.1.1 Removal of Septic Tank and Seepage Pit and Contaminated Soil**

The general sequence of waste-removal activities is summarized below:

- Mobilization
  - ❖ Assemble construction documents
  - ❖ Conduct construction readiness assessment
  - ❖ Conduct preconstruction meeting
  - ❖ Construct access roads
  - ❖ Construct staging area
  - ❖ Install temporary field trailers

- ❖ Determine limits of waste
- ❖ Mobilize heavy equipment to site
- ❖ Identify underground utilities
- Site preparation
  - ❖ Install fencing
  - ❖ Install stormwater controls
  - ❖ Abandon/relocate utilities
  - ❖ Conduct preexcavation survey
- Removal of waste
  - ❖ Excavate and evacuate waste
  - ❖ Stockpile and load drums and rolloff containers
  - ❖ Characterize for dispositioning
  - ❖ Transport to appropriate disposal facility
  - ❖ Survey limits of excavation
  - ❖ Perform confirmation sampling
  - ❖ Establish subgrade and survey
- Backfill
  - ❖ Backfill and compact
  - ❖ Vegetate surface
  - ❖ Survey finished surface
- Demobilization

#### **5.8.1.2 Waste Management and Disposal**

Management of all investigation waste including waste generated during cleanup is described in Appendix B.

#### **5.8.1.3 Transportation**

All waste will be hauled in rolloff containers, drums, or other appropriate containers directly to the selected disposal facility.

#### **5.8.1.4 Confirmation Sampling**

Confirmation sampling will be performed as described in section 4.2.5.

#### **5.8.1.5 Health and Safety**

Applicable Laboratory procedures will be referenced.

## **6.0 MONITORING PROGRAMS**

### **6.1 Groundwater**

Section IV.B.5.b.iii of the Consent Order requires monitoring and sampling of all monitoring wells in Sandia Canyon. Alluvial monitoring and observation wells in Sandia Canyon include SCA-1, SCA-2, SCA-3, SCA-4, SCA-5, SCO-1, and SCO-2. Of these, only alluvial monitoring well SCA-1 is located within the Upper Sandia Canyon Aggregate Area (Plate 1). The remainder of the SCA-series wells and wells SCO-1 and SCO-2 are located in the lower portion of Sandia Canyon. All these wells are monitored as part of the Interim Facility-Wide Groundwater Monitoring Plan (IFWGMP) (LANL 2007, 096665). Regional aquifer wells R-10, R-10a, and R-11 are screened and monitored as described in the IFWGMP.

### **6.2 Air**

The radiological air sampling network, AIRNET, measures environmental levels of airborne radionuclides, such as plutonium, americium, uranium, tritium, and some activation products that may be released from Laboratory operations. Air-sampling station 23 is located within TA-03 and air-sampling station 12 is located within TA-61. Particulate matter in the atmosphere is primarily caused by aerosolized soil. Each AIRNET sampler continuously collects particulate matter and water-vapor samples for approximately 2 wk per sampler. Neither sampler located within the Upper Sandia Canyon Aggregate Area exceeded action levels in 2006 sampling (LANL 2007, 098644). Continuous stack testing occurs throughout the Laboratory, and stack testing is conducted in TA-03; however, these stacks are not associated with buildings located within the Upper Sandia Canyon Aggregate Area.

Gamma and neutron radiation in the environment is also monitored through the use of 90 thermoluminescent dosimeter (TLD) stations located around the Laboratory. TLD station 23 is located within TA-03, and station 12 is located within TA-61. The Laboratory's annual environmental surveillance reports indicate dose equivalents at these stations are consistent with natural background radiation and with previous measurements (LANL 2007, 098644).

### **6.3 Sediment and Surface Water**

Base-flow water samples are collected at two locations in the Upper Sandia Canyon Aggregate Area: gaging stations E121 and E123. The samples collected from these locations monitor persistent surface water where effluent discharges maintain stream flow. Eleven stormwater runoff/sampling monitoring stations are located within the Upper Sandia Canyon Aggregate Area: E122.3, E122.35, E122.5, E123, S-SMA-0.2, S-SMA-1 (E122/E122.2), S-SMA-2 (E121), S-SMA-3, S-SMA-3.5, S-SMA-3.6, and SCS-2. Some of these locations are used to monitor stormwater runoff from industrial activities under the NPDES Multi-Sector General Permit (MSGP) and from SWMUs and AOCs while others are exclusively used to monitor stormwater runoff from SWMUs and AOCs under the Federal Facilities Compliance Act (FFCA)/Administrative Order. One sediment sampling station, "Sandia below Wetland," monitors contamination trends in sediment in the active channel (Plate 1).

Nine reaches in Sandia Canyon were selected for the first phase of sediment sampling in the work plan for Sandia Canyon and Cañada del Buey (LANL 1999, 064617); three of these reaches (S-1, S-2, and S-3) are located within the Upper Sandia Canyon Aggregate Area. This initial investigation collected sediment samples from 132 locations within the Upper Sandia Canyon Aggregate Area. These samples were submitted for full-suite analyses. The Phase 2 sediment investigation proposes collecting additional samples in two of the three reaches located within the Upper Sandia Canyon Aggregate Area: S-1 and S-3. Ten samples will be collected from three subreaches within S-1 and S-3: S-1N, S-1S, and S-3W.



These samples will be analyzed for the chemicals of potential concern identified during the first phase of sampling and include metals; hexavalent chromium; perchlorate; nitrate; pesticides; PCBs; PAHs; SVOCs; VOCs; TPH; americium-241; radionuclides (by gamma spectroscopy); plutonium-238, -239/240; strontium-90; thorium-228, -230, and -232; tritium; and uranium-234, -235, and -238 (LANL 2007, 098127, p. 19).

The data results from the Sandia Canyon investigations will be combined with the data results of the sampling proposed in this work plan to assess potential contaminant migration from sites within the Upper Sandia Canyon Aggregate Area. Additional data collected in Sandia Canyon under the FFCA, MSGP, and the IFWGMP also will be used in assessing potential contaminant migration from the Upper Sandia Canyon Aggregate Area sites.

## 7.0 SCHEDULE

The investigation work plan will be submitted to NMED by March 31, 2008. The scheduled notice date for NMED to approve this investigation work plan is August 13, 2008. Preparation of investigation activities is scheduled to start by September 22, 2008. Fieldwork is expected to start in March 2009 and will take approximately 9 mo to complete, with a scheduled finish date of December 31, 2009. The investigation report will be delivered to NMED on or before May 30, 2010.

## 8.0 REFERENCES AND MAP DATA SOURCES

### 8.1 References

*The following list includes all documents cited in this plan. Parenthetical information following each reference provides the author(s), publication date, and ER ID number. This information is also included in text citations. ER ID numbers are assigned by the Environmental Programs Directorate's Records Processing Facility (RPF) and are used to locate the document at the RPF and, where applicable, in the master reference set.*

*Copies of the master reference set are maintained at the NMED Hazardous Waste Bureau; the U.S. Department of Energy—Los Alamos Site Office; the U.S. Environmental Protection Agency, Region 6; and the Directorate. The set was developed to ensure that the administrative authority has all material needed to review this document, and it is updated with every document submitted to the administrative authority. Documents previously submitted to the administrative authority are not included.*

Abeelee, W.V., M.L. Wheeler, and B.W. Burton, October 1981. "Geohydrology of Bandelier Tuff," Los Alamos National Laboratory report LA-8962-MS, Los Alamos, New Mexico. (Abeelee et al. 1981, 006273)

Bailey, R.A., R.L. Smith, and C.S. Ross, 1969. "Stratigraphic Nomenclature of Volcanic Rocks in the Jemez Mountains, New Mexico," in *Contributions to Stratigraphy*, U.S. Geological Survey Bulletin 1274-P, Washington, D.C. (Bailey et al. 1969, 021498)

Broxton, D.E., G.H. Heiken, S.J. Chipera, and F.M. Byers, Jr., June 1995. "Stratigraphy, Petrography, and Mineralogy of Bandelier Tuff and Cerro Toledo Deposits," in *Earth Science Investigation for Environmental Restoration—Los Alamos National Laboratory, Technical Area 21*, Los Alamos National Laboratory report LA-12934-MS, Los Alamos, New Mexico, pp. 33-63. (Broxton et al. 1995, 050121)

- Broxton, D.E., P.A. Longmire, P.G. Eller, and D. Flores, June 1995. "Preliminary Drilling Results for Boreholes LADP-3 and LADP-4," in *Earth Science Investigation for Environmental Restoration—Los Alamos National Laboratory, Technical Area 21*, Los Alamos National Laboratory report LA-12934-MS, Los Alamos, New Mexico, pp. 93-109. (Broxton et al. 1995, 050119)
- Broxton, D.E., and S.L. Reneau, August 1995. "Stratigraphic Nomenclature of the Bandelier Tuff for the Environmental Restoration Project at Los Alamos National Laboratory," Los Alamos National Laboratory report LA-13010-MS, Los Alamos, New Mexico. (Broxton and Reneau 1995, 049726)
- Broxton, D.E., and S.L. Reneau, 1996. "Buried Early Pleistocene Landscapes Beneath the Pajarito Plateau, Northern New Mexico," *New Mexico Geological Society Guidebook: 47th Field Conference, Jemez Mountains Region, New Mexico*, pp. 325-334. (Broxton and Reneau 1996, 055429)
- Caporuscio, F., January 29, 2003. "Soil Characterization Report for the Installation of a New Gas Turbine Generator and Utilities at the TA-3 Power Plant," report prepared for Los Alamos National Laboratory by KSL Services and Eberline Services, Albuquerque, New Mexico. (Caporuscio 2003, 088444)
- Crowe, B.M., G.W. Linn, G. Heiken, and M.L. Bevier, April 1978. "Stratigraphy of the Bandelier Tuff in the Pajarito Plateau, Applications to Waste Management," Los Alamos Scientific Laboratory report LA-7225-MS, Los Alamos, New Mexico. (Crowe et al. 1978, 005720)
- EPA (U.S. Environmental Protection Agency), November 28, 2001. "Approval of the VCA Report under the Toxic Substance and Control Act (TSCA) 761.61(c) for PCB Site 3-056(c) at Los Alamos National Laboratory (LANL)," U.S. Environmental Protection Agency letter to M. Johansen (DOE-LAAO) from D. Neleigh (EPA Region 6), Dallas, Texas. (EPA 2001, 072810)
- EPA (U.S. Environmental Protection Agency), August 16, 2004. "EPA's Prior Decisions on SWMU/AOC Sites at Los Alamos National Laboratory (LANL)," U.S. Environmental Protection Agency letter to J. Bearzi (NMED-HRMB) from L.F. King (EPA Federal Facilities Section Chief), Dallas, Texas. (EPA 2004, 087296)
- EPA (U.S. Environmental Protection Agency), January 21, 2005. "EPA's Prior Decisions on SWMU/AOC Sites at Los Alamos National Laboratory (LANL)," U.S. Environmental Protection Agency letter to J. Bearzi (NMED-HRMB) from L.F. King (EPA Federal Facilities Section Chief), Dallas, Texas. (EPA 2005, 088464)
- EPA (U.S. Environmental Protection Agency), June 8, 2007. "Authorization to Discharge under the National Pollutant Discharge Elimination System, NPDES Permit No. NM 0028355," Region 6, Dallas, Texas. (EPA 2007, 099009)
- EPA (U.S. Environmental Protection Agency), December 2007. "EPA Region 6 Human Health Medium-Specific Screening Levels," U.S. EPA Region 6, Dallas, Texas. (EPA 2007, 099314)
- Faulk, D., June 19, 1995. "Archaeological Status Report for Site Remediation Activities at SWMU 3-056(c)," ERM/Golder memorandum to B. Larson (LANL) from D. Faulk (ERM/Golder), Los Alamos, New Mexico. (Faulk 1995, 055741)

- Goff, F., June 1995. "Geologic Map of Technical Area 21," in *Earth Science Investigations for Environmental Restoration—Los Alamos National Laboratory, Technical Area 21*, Los Alamos National Laboratory report LA-12934-MS, Los Alamos, New Mexico, pp. 7–18. (Goff 1995, 049682)
- Griggs, R.L., and J.D. Hem, 1964. "Geology and Ground-Water Resources of the Los Alamos Area, New Mexico," U.S. Geological Survey Water Supply Paper 1753, Washington, D.C. (Griggs and Hem 1964, 092516)
- Heiken, G., F.E. Goff, J. Stix, S. Tamanyu, M. Shafiqullah, S.R. Garcia, and R.C. Hagan, February 10, 1986. "Intracaldera Volcanic Activity, Toledo Caldera and Embayment, Jemez Mountains, New Mexico," *Journal of Geophysical Research*, Vol. 91, No. B2, pp. 1799-1816. (Heiken et al. 1986, 048638)
- Hollis, D., E. Vold, R. Shuman, K.H. Birdsell, K. Bower, W.R. Hansen, D. Krier, P.A. Longmire, B. Newman, D.B. Rogers, and E.P. Springer, March 27, 1997. "Performance Assessment and Composite Analysis for Los Alamos National Laboratory Material Disposal Area G," Rev. 2.1, Los Alamos National Laboratory document LA-UR-97-85, Los Alamos, New Mexico. (Hollis et al. 1997, 063131)
- Izett, G.A., and J.D. Obradovich, February 10, 1994. "<sup>40</sup>Ar/<sup>39</sup>Ar Age Constraints for the Jaramillo Normal Subchron and the Matuyama-Brunhes Geomagnetic Boundary," *Journal of Geophysical Research*, Vol. 99, No. B2, pp. 2925-2934. (Izett and Obradovich 1994, 048817)
- Kearl, P.M., J. Dexter, and M. Kautsky, December 1986. "Vadose Zone Characterization of Technical Area 54, Waste Disposal Areas G and L, Los Alamos National Laboratory, New Mexico, Report 4: Preliminary Assessment of the Hydrogeologic System through Fiscal Year 1986," UNC Technical Services report GJ-54, Grand Junction, Colorado. (Kearl et al. 1986, 015368)
- LANL (Los Alamos National Laboratory), November 1990. "Solid Waste Management Units Report," Vol. IV of IV (TA-51 through TA-74), Los Alamos National Laboratory document LA-UR-90-3400, Los Alamos, New Mexico. (LANL 1990, 007514)
- LANL (Los Alamos National Laboratory), November 1990. "Solid Waste Management Units Report," Vol. I of IV (TA-0 through TA-9), Los Alamos National Laboratory document LA-UR-90-3400, Los Alamos, New Mexico. (LANL 1990, 007511)
- LANL (Los Alamos National Laboratory), July 1993. "RFI Work Plan for Operable Unit 1114," Los Alamos National Laboratory document LA-UR-93-1000, Los Alamos, New Mexico. (LANL 1993, 020947)
- LANL (Los Alamos National Laboratory), August 1993. "Environmental Surveillance at Los Alamos During 1991," Los Alamos National Laboratory report LA-12572-ENV, Los Alamos, New Mexico. (LANL 1993, 023249)
- LANL (Los Alamos National Laboratory), August 1994. "Los Alamos National Laboratory Environmental Restoration Chain of Custody/Request for Analysis Forms for PRS 3-056(c)," Los Alamos National Laboratory, Los Alamos, New Mexico. (LANL 1994, 040397)

- LANL (Los Alamos National Laboratory), July 1995. "RFI Work Plan for Operable Unit 1114, Addendum 1," Los Alamos National Laboratory document LA-UR-95-731, Los Alamos, New Mexico. (LANL 1995, 057590)
- LANL (Los Alamos National Laboratory), August 3, 1995. "Notification of Two New Solid Waste Management Units (SWMUs)," Los Alamos National Laboratory letter to W.K. Honker (EPA Region 6) from J. Jansen (LANL ER Project Manager) and T. Taylor (DOE-LAAO), Los Alamos, New Mexico. (LANL 1995, 049550)
- LANL (Los Alamos National Laboratory), September 1995. "Request for Permit Modification, Units Proposed for NFA," Los Alamos National Laboratory document LA-UR-95-3319, Los Alamos, New Mexico. (LANL 1995, 051878)
- LANL (Los Alamos National Laboratory), October 25, 1995. "Draft Groundwater Protection Management Program Plan," Rev. 2, Los Alamos National Laboratory, Los Alamos, New Mexico. (LANL 1995, 050124)
- LANL (Los Alamos National Laboratory), February 1996. "RFI Report for 53 Potential Release Sites in TA-3, TA-59, TA-60, TA-61," Los Alamos National Laboratory document LA-UR-96-726, Los Alamos, New Mexico. (LANL 1996, 052930)
- LANL (Los Alamos National Laboratory), February 26, 1996. "Voluntary Corrective Action Completion Report for Potential Release Sites 03-003(p), 03-047(d), 03-051(c), Revision 1," Los Alamos National Laboratory document LA-UR-96-431, Los Alamos, New Mexico. (LANL 1996, 053780)
- LANL (Los Alamos National Laboratory), September 1996. "Request for Permit Modification, Units Proposed for NFA," Vol. I, Los Alamos National Laboratory document LA-UR-96-3357, Los Alamos, New Mexico. (LANL 1996, 055035)
- LANL (Los Alamos National Laboratory), April 1997. "Core Document for Canyons Investigations," Los Alamos National Laboratory document LA-UR-96-2083, Los Alamos, New Mexico. (LANL 1997, 055622)
- LANL (Los Alamos National Laboratory), September 1997. "RFI Report for TA-3 for Potential Release Sites 3-004(c,d), 3-007, 3-014(k,l,o), 3-021, 3-049(a), 3-052(b), 3-056(k), C-3-014," Los Alamos National Laboratory document LA-UR-97-3571, Los Alamos, New Mexico. (LANL 1997, 056660.4)
- LANL (Los Alamos National Laboratory), May 22, 1998. "Hydrogeologic Workplan," Los Alamos National Laboratory document LA-UR-01-6511, Los Alamos, New Mexico. (LANL 1998, 059599)
- LANL (Los Alamos National Laboratory), June 1998. "RFI Work Plan and SAP for Potential Release Sites 53-002(a), 53-002(b), and Associated Piping and Drainages at TA-53," Los Alamos National Laboratory document LA-UR-98-2547, Los Alamos, New Mexico. (LANL 1998, 058841)
- LANL (Los Alamos National Laboratory), September 22, 1998. "Inorganic and Radionuclide Background Data for Soils, Canyon Sediments, and Bandelier Tuff at Los Alamos National Laboratory," Los Alamos National Laboratory document LA-UR-98-4847, Los Alamos, New Mexico. (LANL 1998, 059730)

- LANL (Los Alamos National Laboratory), September 1999. "Work Plan for Sandia Canyon and Cañada del Buey," Los Alamos National Laboratory document LA-UR-99-3610, Los Alamos, New Mexico. (LANL 1999, 064617)
- LANL (Los Alamos National Laboratory), March 2000. "Installation Work Plan for Environmental Restoration Project, Revision 8," Los Alamos National Laboratory document LA-UR-00-1336, Los Alamos, New Mexico. (LANL 2000, 066802)
- LANL (Los Alamos National Laboratory), December 2000. "University of California, Los Alamos National Laboratory (LANL), I8980SOW0-8S, Statement of Work for Analytical Laboratories," Rev. 1, Los Alamos National Laboratory, Los Alamos, New Mexico. (LANL 2000, 071233)
- LANL (Los Alamos National Laboratory), July 10, 2001. "Sampling Notification," Los Alamos National Laboratory letter (ER2001-00574) to J. Young (NMED-HWB) from D. McInroy (ER Project), Los Alamos, New Mexico. (LANL 2001, 070937)
- LANL (Los Alamos National Laboratory), July 16, 2001. "Sampling Notification," Los Alamos National Laboratory letter (ER2001-0584) to J. Young (NMED-HWB) from D. McInroy (ER Project), Los Alamos, New Mexico. (LANL 2001, 071214)
- LANL (Los Alamos National Laboratory), September 2001. "Voluntary Corrective Action Completion Report for Potential Release Site 03-056(c)," Los Alamos National Laboratory document LA-UR-01-5349, Los Alamos, New Mexico. (LANL 2001, 071259)
- LANL (Los Alamos National Laboratory), July 23, 2001–March 13, 2002. "Field Notebook for SWMUs 03-001(k), 03-003(c), 03-011, 03-049(e), 03-056(a), 27-003, 39-007(a), 60-002, 60-007(a), and C-09-001," Los Alamos National Laboratory, Los Alamos, New Mexico. (LANL 2001–2002, 100703)
- LANL (Los Alamos National Laboratory), September 2002. "Voluntary Corrective Action Completion Report for Area of Concern C-03-020 at Technical Area 03 (Inactive Underground Storage Tanks)," Los Alamos National Laboratory document LA-UR-02-5963, Los Alamos, New Mexico. (LANL 2002, 073868.4)
- LANL (Los Alamos National Laboratory), September 2002. "RFI Report for Area of Concern 03-047(d) at Technical Area 03 (Former Container Storage Area)," Los Alamos National Laboratory document LA-UR-02-6158, Los Alamos, New Mexico. (LANL 2002, 073868.138)
- LANL (Los Alamos National Laboratory), March 27, 2003. "Sampling Notification," Los Alamos National Laboratory letter (ER2003-0257) to J. Young (NMED-HWB) from R. Bohn (LANL), Los Alamos, New Mexico. (LANL 2003, 075992)
- LANL (Los Alamos National Laboratory), August 29, 2003. "Sampling Notification," Los Alamos National Laboratory letter (ER2003-0562) to J. Young (NMED-HWB) from R. Bohn (LANL), Los Alamos, New Mexico. (LANL 2003, 079741)



- LANL (Los Alamos National Laboratory), September 2003. "Field Implementation Plan for Asphalt Batch Plant Solid Waste Management Units and Areas of Concern at Technical Areas 3 and 60," Los Alamos National Laboratory document LA-UR-03-6161, Los Alamos, New Mexico. (LANL 2003, 080912)
- LANL (Los Alamos National Laboratory), September 3, 2003. "Revision of August 29, 2003 (ER2003-0562) Sampling Notification," Los Alamos National Laboratory letter (ER2003-0568) to J. Young (NMED-HWB) from R. Bohn (LANL), Los Alamos, New Mexico. (LANL 2003, 079747)
- LANL (Los Alamos National Laboratory), November 2003. "Sample Collection Logs and Chain-of-Custody Forms for Consolidated Unit 03-012(b)-00," Los Alamos National Laboratory, Los Alamos, New Mexico. (LANL 2003, 100705)
- LANL (Los Alamos National Laboratory), November 12, 2003. "Sampling Notification," Los Alamos National Laboratory letter (ER2003-0721) to J. Young (NMED-HWB) from R. Bohn (LANL), Los Alamos, New Mexico. (LANL 2003, 080102)
- LANL (Los Alamos National Laboratory), September 2004. "Solid Waste Management Unit (SWMU) Assessment Plan for SWMU 03-013(i)," Los Alamos National Laboratory document LA-UR-04-6783, Los Alamos, New Mexico. (LANL 2004, 087406)
- LANL (Los Alamos National Laboratory), November 2004. "Accelerated Corrective Action Work Plan for the Investigation and Remediation of Area of Concern 03-001(i) and Solid Waste Management Units 03-029 and 61-002," Los Alamos National Laboratory document LA-UR-04-7879, Los Alamos, New Mexico. (LANL 2004, 087474)
- LANL (Los Alamos National Laboratory), May 2005. "Derivation and Use of Radionuclide Screening Action Levels, Revision 1," Los Alamos National Laboratory document LA-UR-05-1849, Los Alamos, New Mexico. (LANL 2005, 088493)
- LANL (Los Alamos National Laboratory), October 2005. "Solid Waste Management Unit (SWMU) Assessment Report for SWMU 03-003(c)" and "Solid Waste Management Unit (SWMU) Assessment Report for SWMU 60-002," 70% Drafts, Los Alamos National Laboratory, Los Alamos, New Mexico. (LANL 2005, 100704)
- LANL (Los Alamos National Laboratory), October 2005. "Solid Waste Management Unit (SWMU) Assessment Report for SWMU 03-013(i)," Los Alamos National Laboratory document LA-UR-05-7420, Los Alamos, New Mexico. (LANL 2005, 091540)
- LANL (Los Alamos National Laboratory), December 2005. "Remedy Completion Report for the Investigation and Remediation of Area of Concern 03-001(i) and Solid Waste Management Units 03-029 and 61-002," Los Alamos National Laboratory document LA-UR-05-8863, Los Alamos, New Mexico. (LANL 2005, 091150)
- LANL (Los Alamos National Laboratory), October 2006. "Mortandad Canyon Investigation Report," Los Alamos National Laboratory document LA-UR-06-6752, Los Alamos, New Mexico. (LANL 2006, 094161)

- LANL (Los Alamos National Laboratory), March 2007. "2007 General Facility Information," Los Alamos National Laboratory document LA-UR-07-1839, Los Alamos, New Mexico. (LANL 2007, 095364)
- LANL (Los Alamos National Laboratory), May 2007. "Remedy Completion Report for the Investigation and Remediation of Solid Waste Management Unit 61-002 at Technical Area 61," Los Alamos National Laboratory document LA-UR-07-2745, Los Alamos, New Mexico. (LANL 2007, 097315)
- LANL (Los Alamos National Laboratory), May 2007. "2007 Interim Facility-Wide Groundwater Monitoring Plan," Los Alamos National Laboratory document LA-UR-07-3271, Los Alamos, New Mexico. (LANL 2007, 096665)
- LANL (Los Alamos National Laboratory), September 2007. "Environmental Surveillance at Los Alamos During 2006," Los Alamos National Laboratory report LA-14341-ENV, Los Alamos, New Mexico. (LANL 2007, 098644)
- LANL (Los Alamos National Laboratory), September 2007. "Summary of Sandia Canyon Phase 1 Sediment Investigations," Los Alamos National Laboratory document LA-UR-07-6019, Los Alamos, New Mexico. (LANL 2007, 098127)
- LANL (Los Alamos National Laboratory), November 2007. "Investigation Work Plan for Upper Mortandad Canyon Aggregate Area," Los Alamos National Laboratory document LA-UR-07-7696, Los Alamos, New Mexico. (LANL 2007, 098954)
- LANL (Los Alamos National Laboratory), November 2007. "Historical Investigation Report for Upper Mortandad Canyon Aggregate Area," Los Alamos National Laboratory document LA-UR-07-7802, Los Alamos, New Mexico. (LANL 2007, 098955)
- LANL (Los Alamos National Laboratory), November 2007. "Remedy Completion Report for the Investigation and Remediation of Solid Waste Management Unit 61-002 at Technical Area 61, Revision 1," Los Alamos National Laboratory document LA-UR-07-7695, Los Alamos, New Mexico. (LANL 2007, 100722)
- LANL (Los Alamos National Laboratory), March 21, 2008. "Structure Searches for 3-287, 3-2422, and 3-36," online search results from the MOADS internal database at Los Alamos National Laboratory, Los Alamos, New Mexico. (LANL 2008, 099214)
- LANL (Los Alamos National Laboratory), March 2008. "Historical Investigation Report for Upper Sandia Canyon Aggregate Area," Los Alamos National Laboratory document LA-UR-08-1851, Los Alamos, New Mexico. (LANL 2008, 100693)
- NMED (New Mexico Environment Department), December 23, 1998. "Approval: Class III Permit Modification to Remove Ninety-nine (99) Solid Waste Management Units from the Department of Energy/Los Alamos National Laboratory RCRA Permit NM 0890010515," New Mexico Environment Department letter to T. Taylor (DOE-LAAO) and J.C. Browne (LANL Director) from E. Kelley (NMED-HRMB), Santa Fe, New Mexico. (NMED 1998, 063042)

- NMED (New Mexico Environment Department), May 2, 2001. "Approval of Class III Permit Modification to Remove Thirty (30) Solid Waste Management Units from the Department of Energy / Los Alamos National Laboratory RCRA Permit NM 0890010515," New Mexico Environment Department letter to D.A. Gurule (Area Manager/LAAO) and J.C. Browne (LANL Director) from G.J. Lewis (NMED-WWMD Director), Santa Fe, New Mexico. (NMED 2001, 070010)
- NMED (New Mexico Environment Department), September 20, 2002. "Approval of VCA Completion Report for PRS 3-056(c)," New Mexico Environment Department letter to J.C. Browne (LANL Director) and E. Trollinger (DOE-OLASO) from J.E. Young (NMED-HWB), Santa Fe, New Mexico. (NMED 2002, 073363)
- NMED (New Mexico Environment Department), March 14, 2005. "Notice of Approval as Modified, Accelerated Corrective Action Work Plan for the Investigation and Remediation of Area of Concern 03-001(i) and Solid Waste Management Units 03-029 and 61-002," New Mexico Environment Department letter to D. Gregory (DOE LASO) and G.P. Nanos (LANL Director) from J. Young (NMED), Santa Fe, New Mexico. (NMED 2005, 087835)
- NMED (New Mexico Environment Department), October 2006. "New Mexico Environment Department TPH Screening Guidelines," Santa Fe, New Mexico. (NMED 2006, 094614)
- NMED (New Mexico Environment Department), October 13, 2006. "Certificate of Completion for Area of Concern 03-001(i), Technical Area 03," New Mexico Environment Department letter to D. Gregory (DOE-LASO) and D. McInroy (LANL) from J.P. Bearzi (NMED-HWB), Santa Fe, New Mexico. (NMED 2006, 094384)
- NMED (New Mexico Environment Department), January 23, 2008. "Approval of Los Alamos National Laboratory Proposal for No Further Action," New Mexico Environment Department letter to D. Gregory (DOE-LASO) and D. McInroy (LANL) from J.P. Bearzi (NMED-HWB), Santa Fe, New Mexico. (NMED 2008, 100116)
- Nyhan, J.W., L.W. Hacker, T.E. Calhoun, and D.L. Young, June 1978. "Soil Survey of Los Alamos County, New Mexico," Los Alamos Scientific Laboratory report LA-6779-MS, Los Alamos, New Mexico. (Nyhan et al. 1978, 005702)
- Purtymun, W.D., December 1975. "Geohydrology of the Pajarito Plateau with Reference to Quality of Water, 1949-1972," Informal Report, Los Alamos Scientific Laboratory document LA-UR-02-4726, Los Alamos, New Mexico. (Purtymun 1975, 011787)
- Purtymun, W.D., January 1984. "Hydrologic Characteristics of the Main Aquifer in the Los Alamos Area: Development of Ground Water Supplies," Los Alamos National Laboratory report LA-9957-MS, Los Alamos, New Mexico. (Purtymun 1984, 006513)
- Purtymun, W.D., January 1995. "Geologic and Hydrologic Records of Observation Wells, Test Holes, Test Wells, Supply Wells, Springs, and Surface Water Stations in the Los Alamos Area," Los Alamos National Laboratory report LA-12883-MS, Los Alamos, New Mexico. (Purtymun 1995, 045344)
- Purtymun, W.D., J.R. Buchholz, and T.E. Hakonson, 1977. "Chemical Quality of Effluents and Their Influence on Water Quality in a Shallow Aquifer," *Journal of Environmental Quality*, Vol. 6, No. 1, pp. 29-32. (Purtymun et al. 1977, 011846)

- Purtymun, W.D., and A.K. Stoker, September 1990. "Perched Zone Monitoring Well Installation," Los Alamos National Laboratory document LA-UR-90-3230, Los Alamos, New Mexico. (Purtymun and Stoker 1990, 007508)
- Self, S., F.E. Goff, J.N. Gardner, J.V. Wright, and W.M. Kite, February 10, 1986. "Explosive Rhyolitic Volcanism in the Jemez Mountains: Vent Locations, Caldera Development, and Relation to Regional Structure," *Journal of Geophysical Research*, Vol. 91, No. B2, pp. 1779-1798. (Self et al. 1986, 021579)
- Shaw Environmental Inc., October 7, 2003. "Field Summary Report, TA-3 and TA-60 Asphalt Batch Plant RCRA Facility Investigation," report prepared for Los Alamos National Laboratory, Los Alamos, New Mexico. (Shaw Environmental, Inc., 2003, 085517)
- Smith, R.L., and R.A. Bailey, 1966. "The Bandelier Tuff: A Study of Ash-Flow Eruption Cycles from Zoned Magma Chambers," *Bulletin Volcanologique*, Vol. 29, pp. 83-103. (Smith and Bailey 1966, 021584)
- Smith, R.L., R.A. Bailey, and C.S. Ross, 1970. "Geologic Map of the Jemez Mountains, New Mexico," U.S. Geological Survey Miscellaneous Investigations Series, Map I-571, Washington, D.C. (Smith et al. 1970, 009752)
- Spell, T.L., I. McDougall, and A.P. Doulgeris, December 1996. "Cerro Toledo Rhyolite, Jemez Volcanic Field, New Mexico:  $^{40}\text{Ar}/^{39}\text{Ar}$  Geochronology of Eruptions between Two Caldera-Forming Events," *Geological Society of America Bulletin*, Vol. 108, No. 12, pp. 1549-1566. (Spell et al. 1996, 055542)
- Stix, J., F.E. Goff, M.P. Gorton, G. Heiken, and S.R. Garcia, June 10, 1988. "Restoration of Compositional Zonation in the Bandelier Silicic Magma Chamber Between Two Caldera-Forming Eruptions: Geochemistry and Origin of the Cerro Toledo Rhyolite, Jemez Mountains, New Mexico," *Journal of Geophysical Research*, Vol. 93, No. B6, pp. 6129-6147. (Stix et al. 1988, 049680)
- Stoker, A.K., March 31, 1993. "Direct Testimony of Alan K. Stoker on Behalf of Petitioners before the New Mexico Water Quality Control Commission," Los Alamos, New Mexico. (Stoker 1993, 056021)
- Tucker, K., August 10, 2001. "Sampling Activities at PRS 3-054(c)," Washington Group International, Inc., PMC Environmental, Science and Engineering Associates, Inc. (WGII/PMC/SEA), Los Alamos Team memorandum to file from K. Tucker (SEA), Los Alamos, New Mexico. (Tucker 2001, 100702)
- Vaniman, D., July 29, 1991. "Revisions to report EES1-SH90-17," Los Alamos National Laboratory memorandum EES1-SH91-12 to J.L. Gardner (EES-1) from D. Vaniman (EES-1), Los Alamos, New Mexico. (Vaniman 1991, 009995.1)
- Wohletz, K., June 1995. "Measurement and Analysis of Rock Fractures in the Tshirege Member of the Bandelier Tuff Along Los Alamos Canyon Adjacent to Technical Area-21," in *Earth Science Investigations for Environmental Restoration—Los Alamos National Laboratory, Technical Area 21*, Los Alamos National Laboratory report LA-12934-MS, Los Alamos, New Mexico. (Wohletz 1995, 054404)

## 8.2 Map Data Sources

Legend Item	Data Source
2-ft elevation contour	Hypsography, 2-ft Contour Interval; Los Alamos National Laboratory, ENV Environmental Remediation and Surveillance Program; 1991.
10-ft elevation contour	Hypsography, 10-ft Contour Interval; Los Alamos National Laboratory, ENV Environmental Remediation and Surveillance Program; 1991.
20-ft elevation contour	Hypsography, 20-ft Contour Interval; Los Alamos National Laboratory, ENV Environmental Remediation and Surveillance Program; 1991.
100-ft elevation contour	Hypsography, 100-ft Contour Interval; Los Alamos National Laboratory, ENV Environmental Remediation and Surveillance Program; 1991.
Upper Sandia Canyon Aggregate Area	Aggregate Areas; Los Alamos National Laboratory, ENV Environmental Remediation & Surveillance Program, ER2005-0496; 1:2,500 Scale Data; 22 September 2005.
Fence	Security and Industrial Fences and Gates; Los Alamos National Laboratory, KSL Site Support Services, Planning, Locating and Mapping Section; 06 January 2004; as published 27 April 2007.
Former Structure	Structures; Los Alamos National Laboratory, Facilities and Waste Operations Division; as published 20 March 2001.
Structure	Structures; Los Alamos National Laboratory, KSL Site Support Services, Planning, Locating and Mapping Section; 06 January 2004; as published 10 September 2007.
SWMU or AOC Consolidated Unit 03-012(b)-00 boundary	Potential Release Sites; Los Alamos National Laboratory, RRES Remediation Services Project, ER2005-0403; 1:2,500 Scale Data; 21 June 2005. Change control requests pending.
Paved road	Paved Road Arcs; Los Alamos National Laboratory, KSL Site Support Services, Planning, Locating and Mapping Section; 06 January 2004; as published 27 April 2007.
Unpaved road	Dirt Road Arcs; Los Alamos National Laboratory, KSL Site Support Services, Planning, Locating and Mapping Section; 06 January 2004; as published 27 April 2007.
TA boundary	Technical Area Boundaries; Los Alamos National Laboratory, Site Planning & Project Initiation Group, Infrastructure Planning Division; 21 December, 2006.








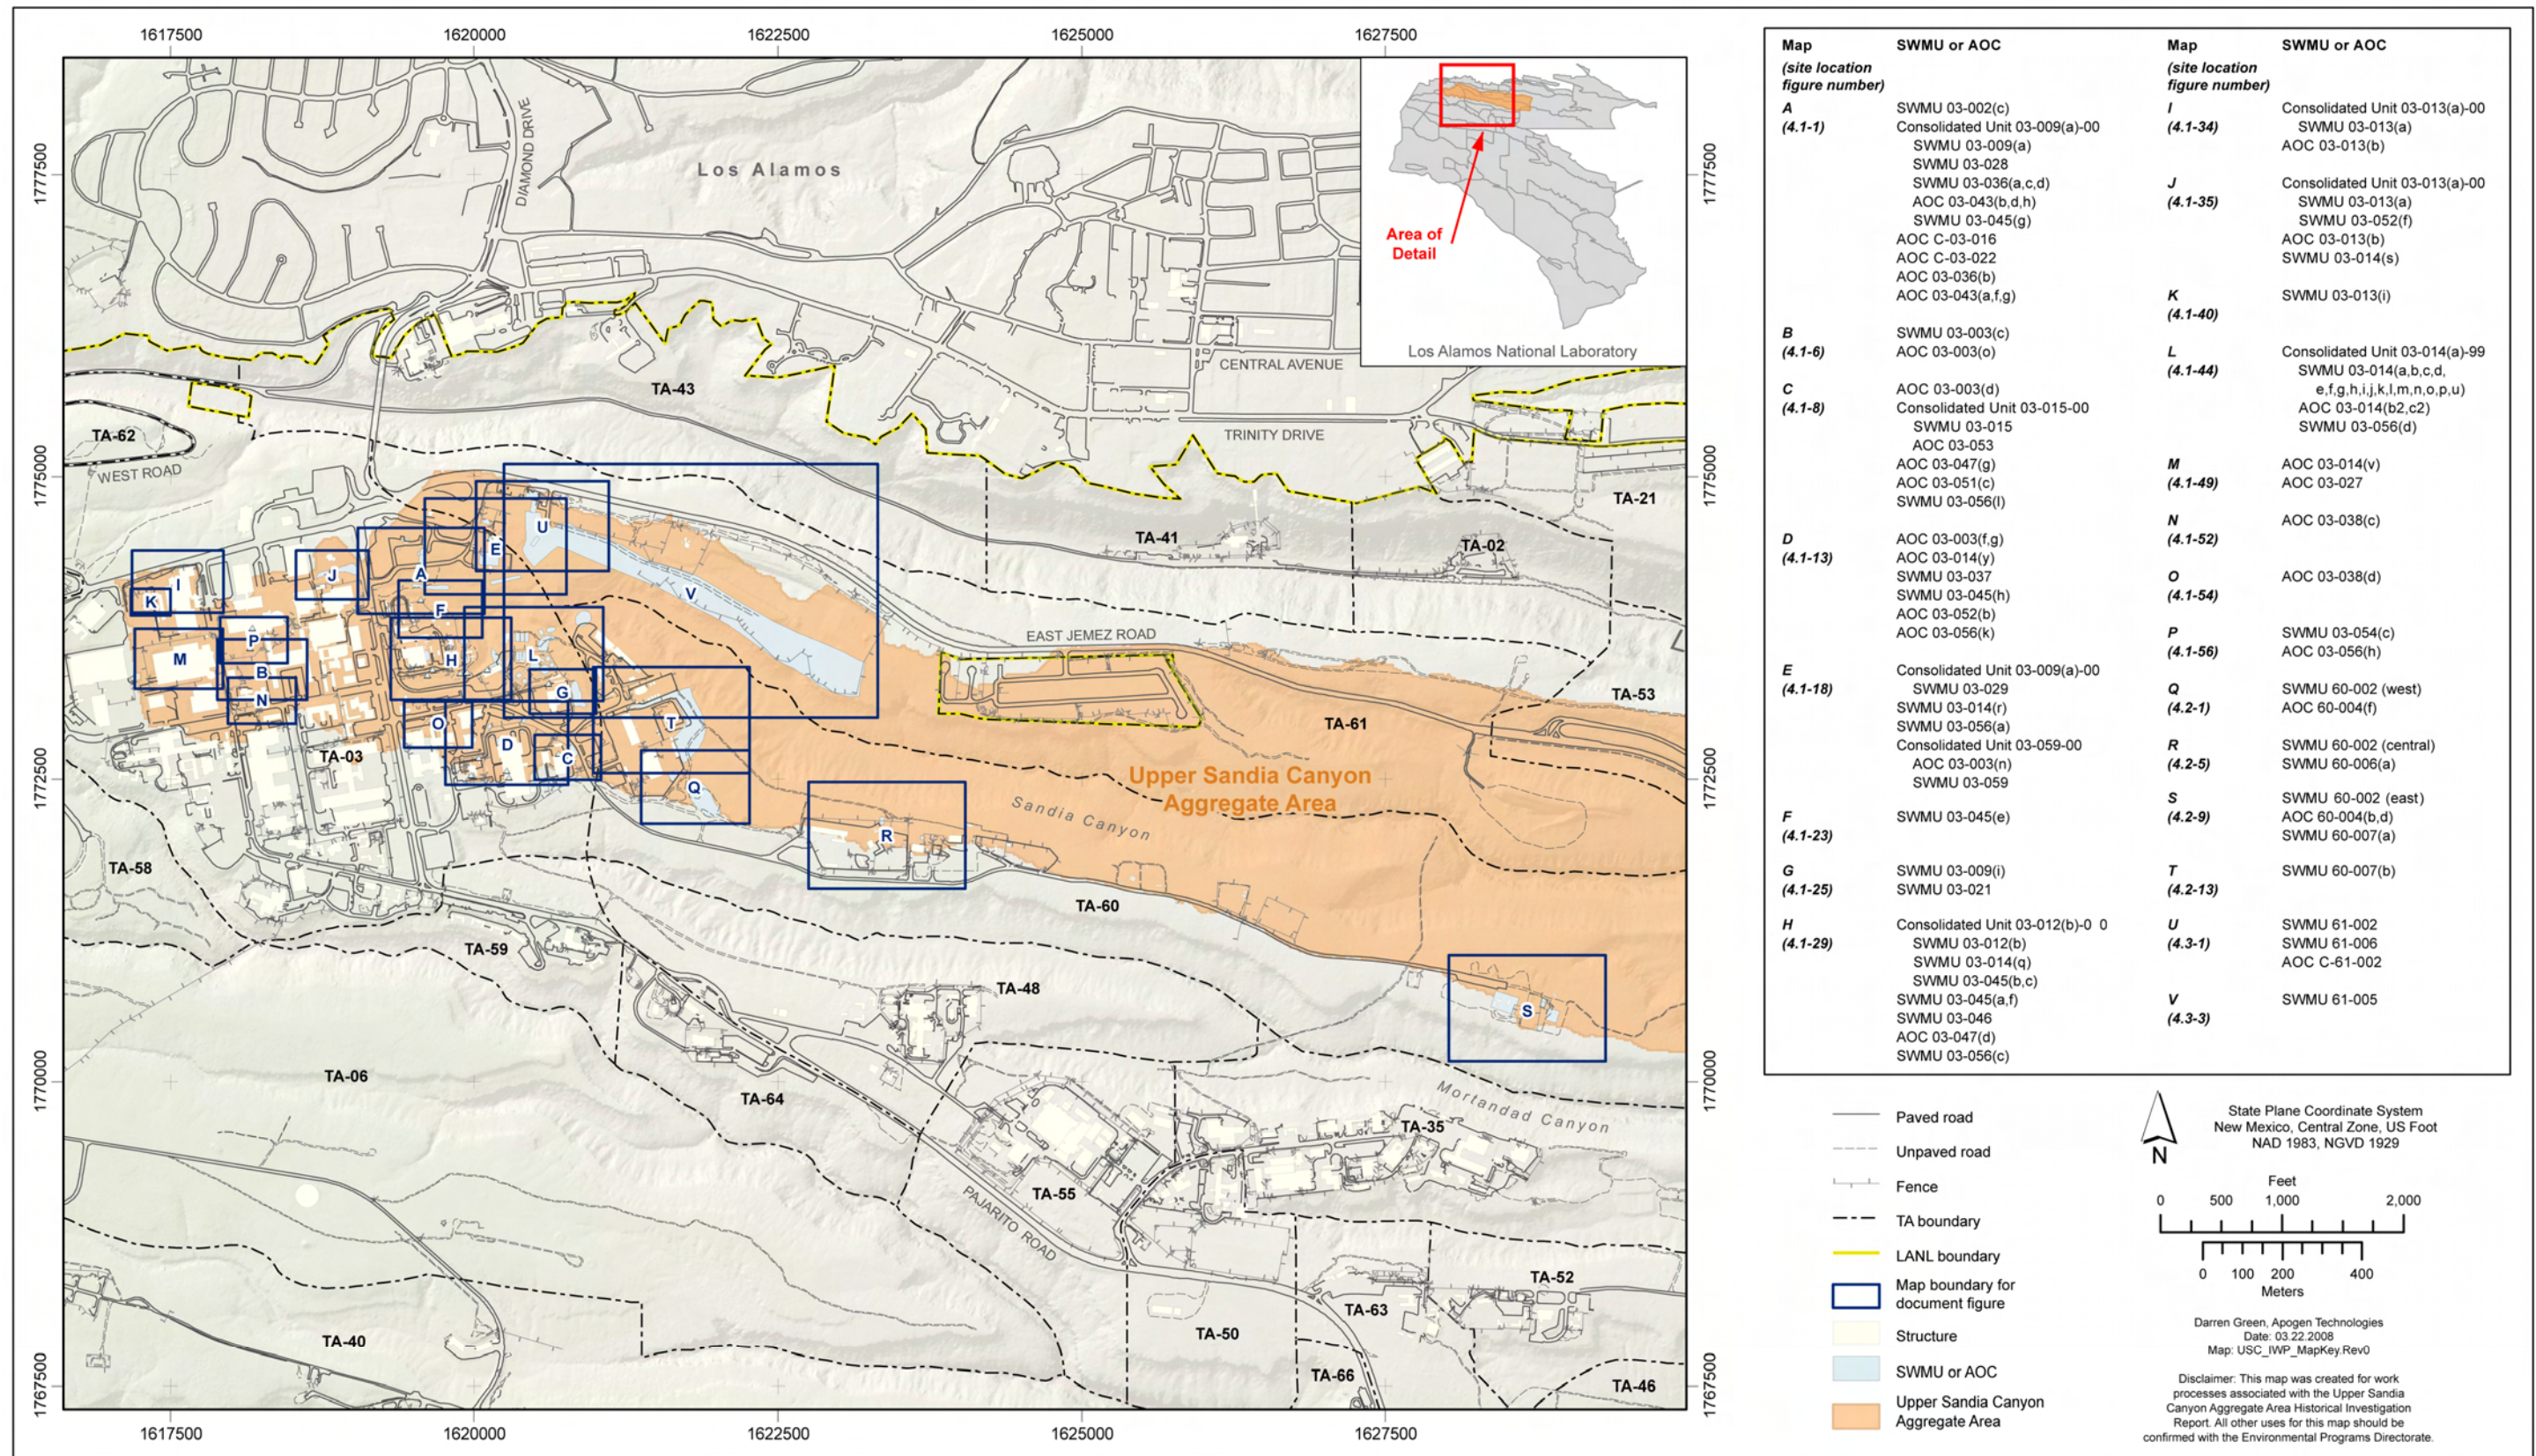


Figure 1.1-1 Upper Sandia Canyon Aggregate Area Map Key



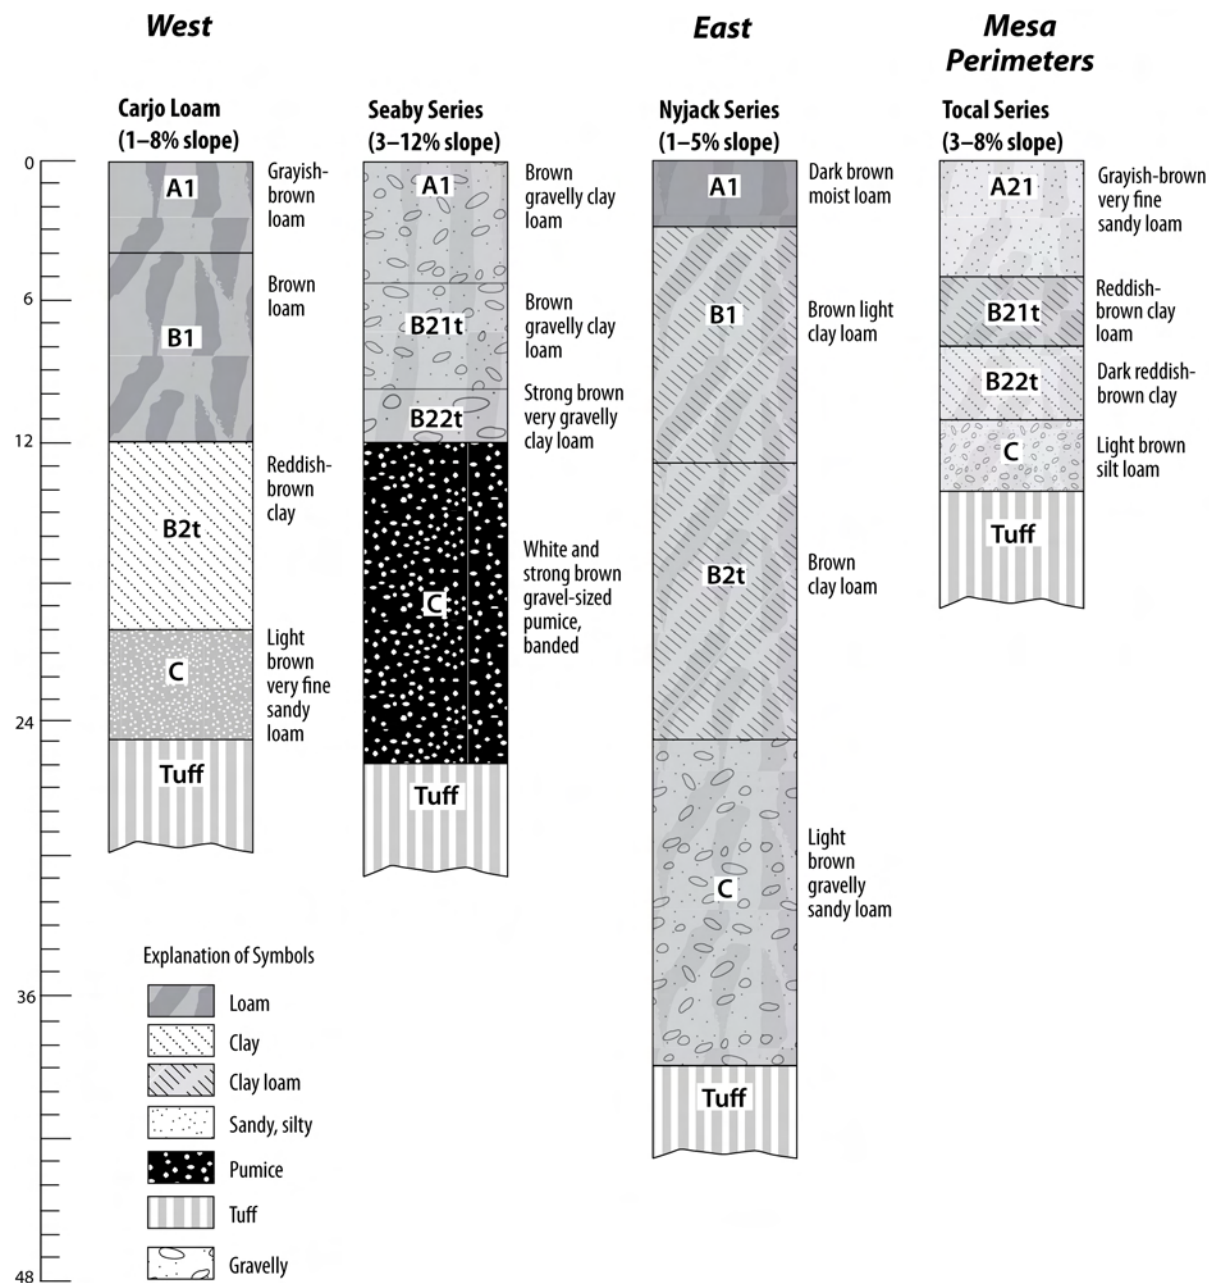

Note: Source: Nyhan et al. 1978, 005702. Modified by NWI 03/21/08.

Figure 3.1-1 Typical profiles of common soils at OU 1114 Operable Unit.

Bandelier Tuff	Tshirege Member	Qbt 4	Ash-Flow Units	
		Qbt 3		
		Qbt 2		
		Qbt 1v		
		Qbt 1g		
		Tsankawi Pumice Bed		
Cerro Toledo Interval		Volcaniclastic Sediments and Ash-Falls		
Bandelier Tuff	Otowi member	Ash-Flow Units		
		Guaje Pumice Bed		
Puye Formation	Fanglomerate	Fanglomerate Facies includes sand, gravel, conglomerate, and tuffaceous sediments		
	Basalt and Andesite	Cerros del Rio Basalts intercalated within the Puye Formation, includes up to four interlayered basaltic flows. Andesites of the Tschicoma Formation present in western part of plateau.		
	Fanglomerate	Fanglomerate Facies includes sand, gravel, conglomerate, and tuffaceous sediments; includes "Old Alluvium"		
	Axial facies deposits of the ancestral Rio Grande		Totavi Lentil	
	Santa Fe Group	Coarse Sediments	Coarse-Grained Upper Facies (formerly called the "Chaquehui Formation" by Purtymun 1995, 045344)	
Basalt				
Coarse Sediments				
Basalt				
Coarse Sediments				
Basalt				
Coarse Sediments				
Basalt				
Arkosic clastic sedimentary deposits	Undivided Santa Fe Group (includes Chamita[?] and Tesuque Formations)			

Note: Source: LANL 1999, 064617. Modified by NWI 03/21/08.

Figure 3.2-1 Generalized stratigraphy of bedrock geologic units of the Pajarito Plateau.



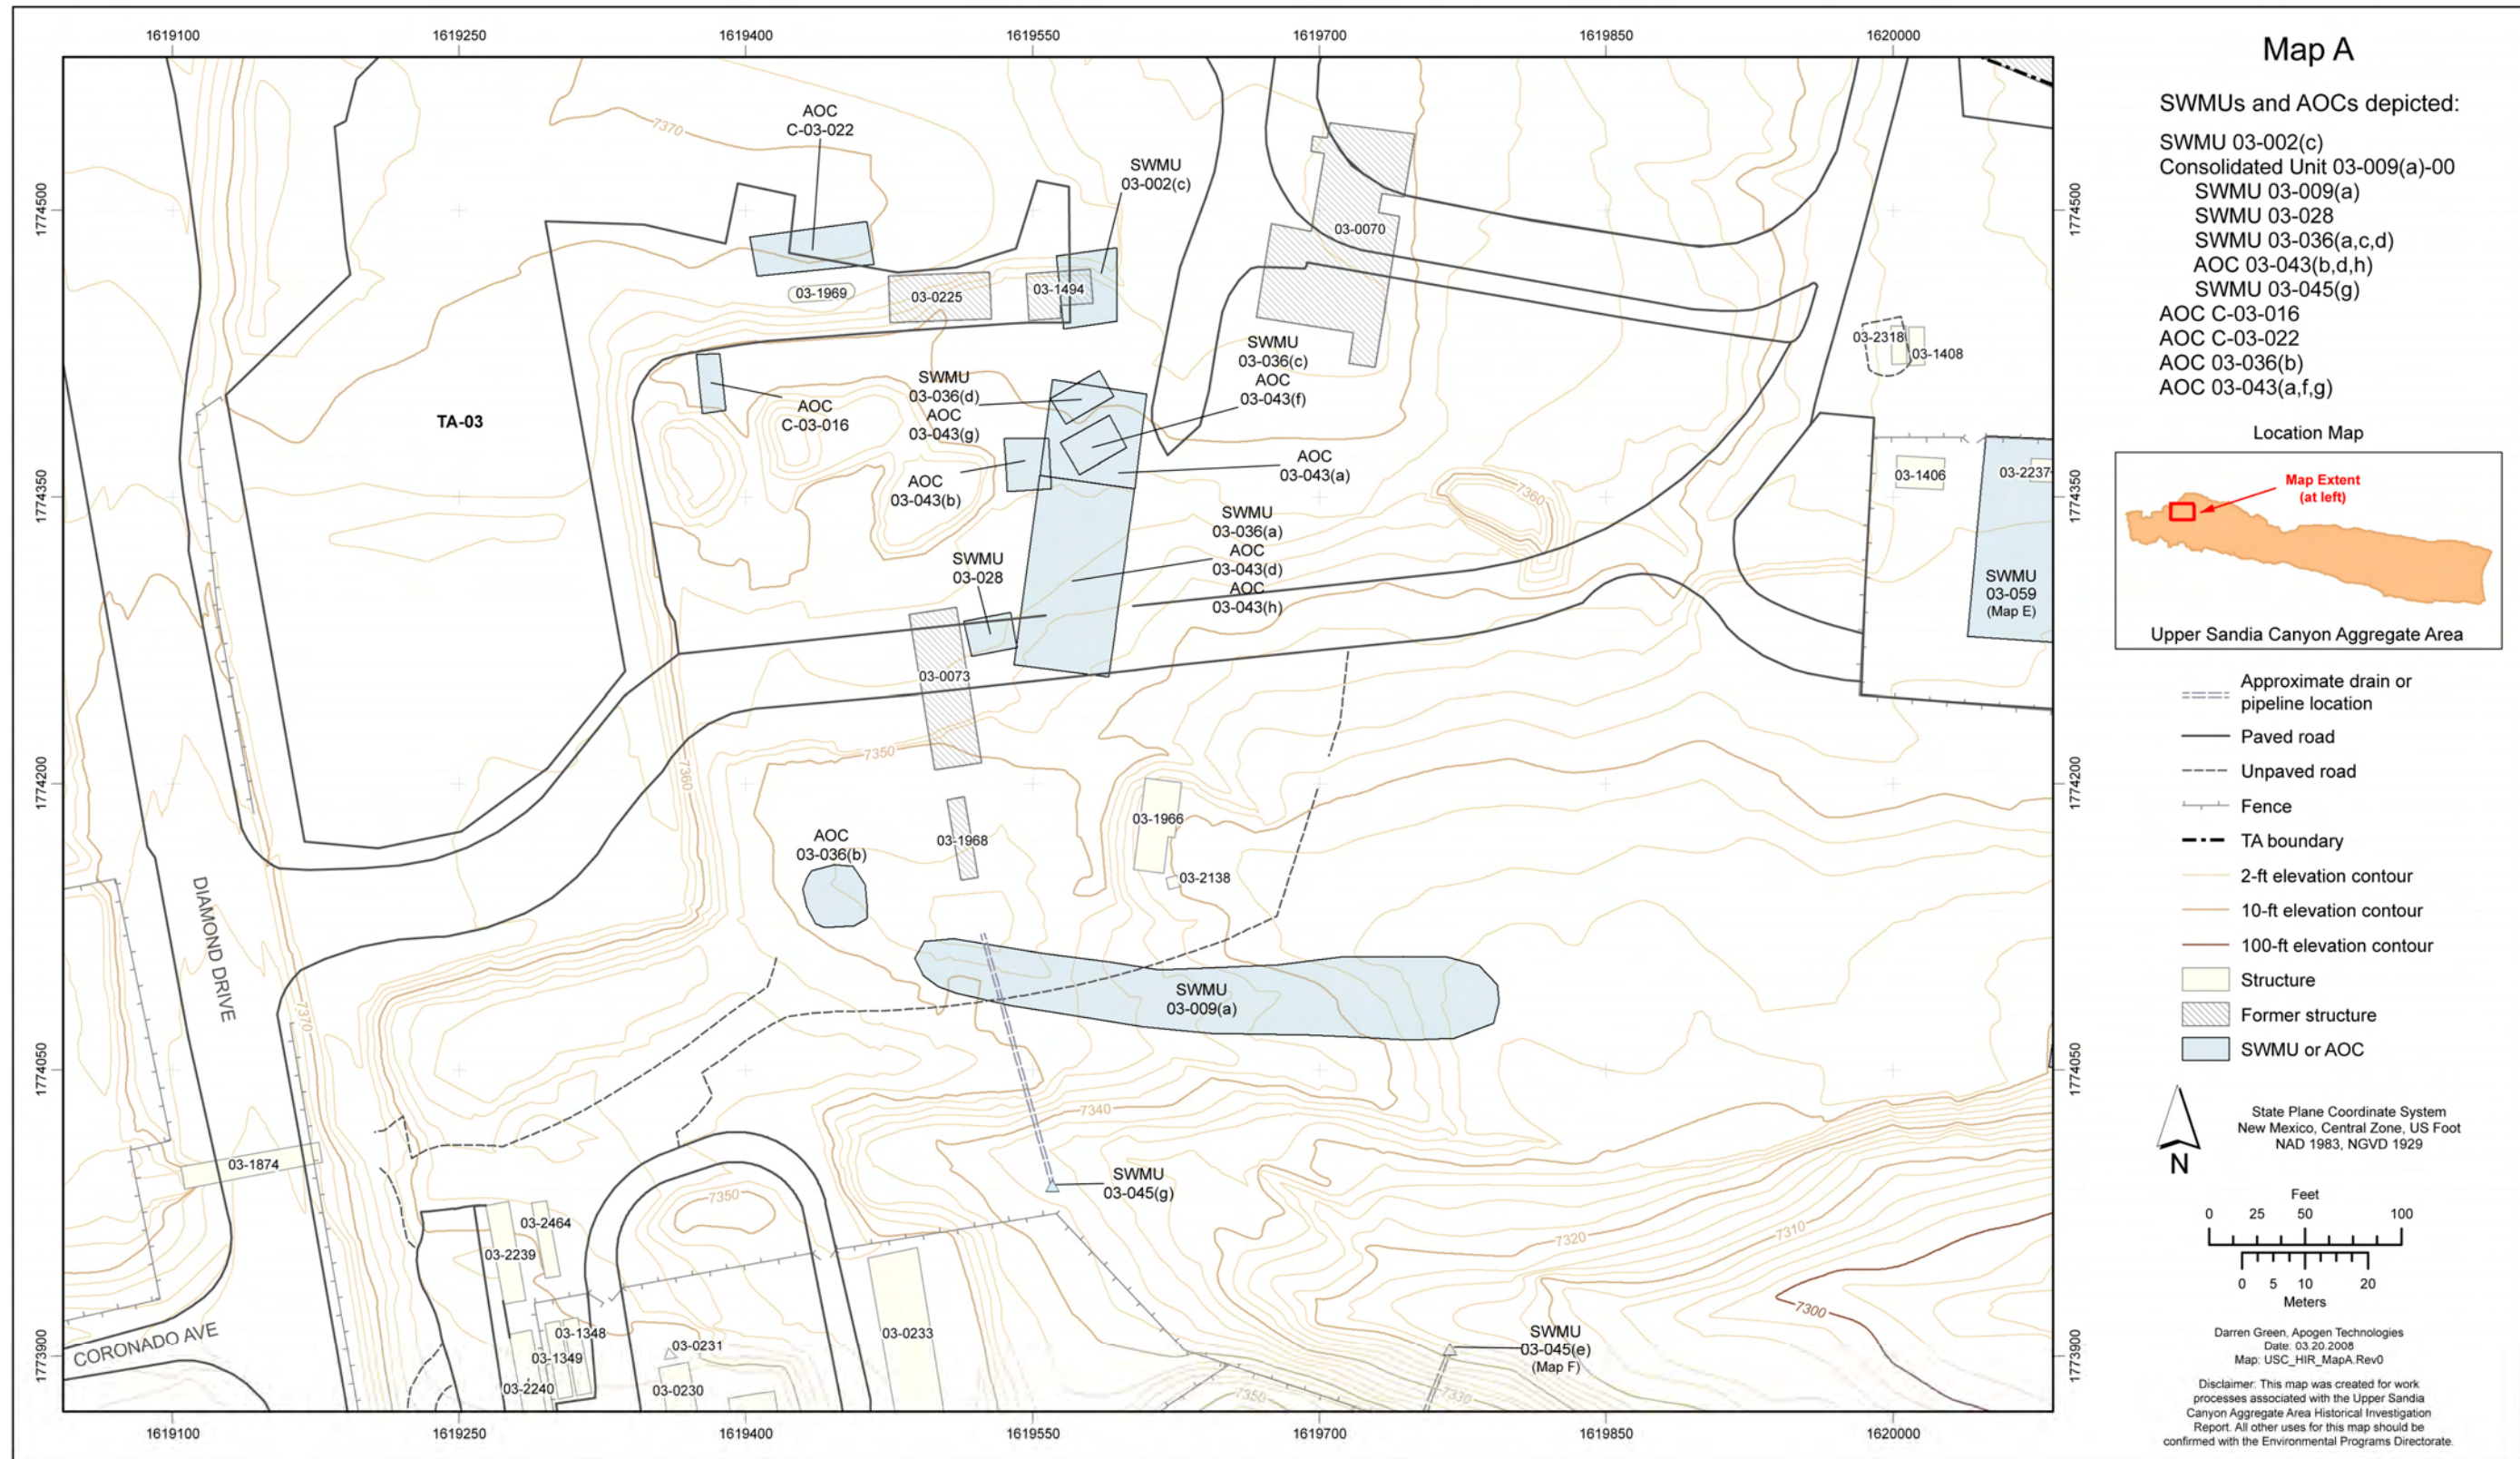


Figure 4.1-1 Map A site location



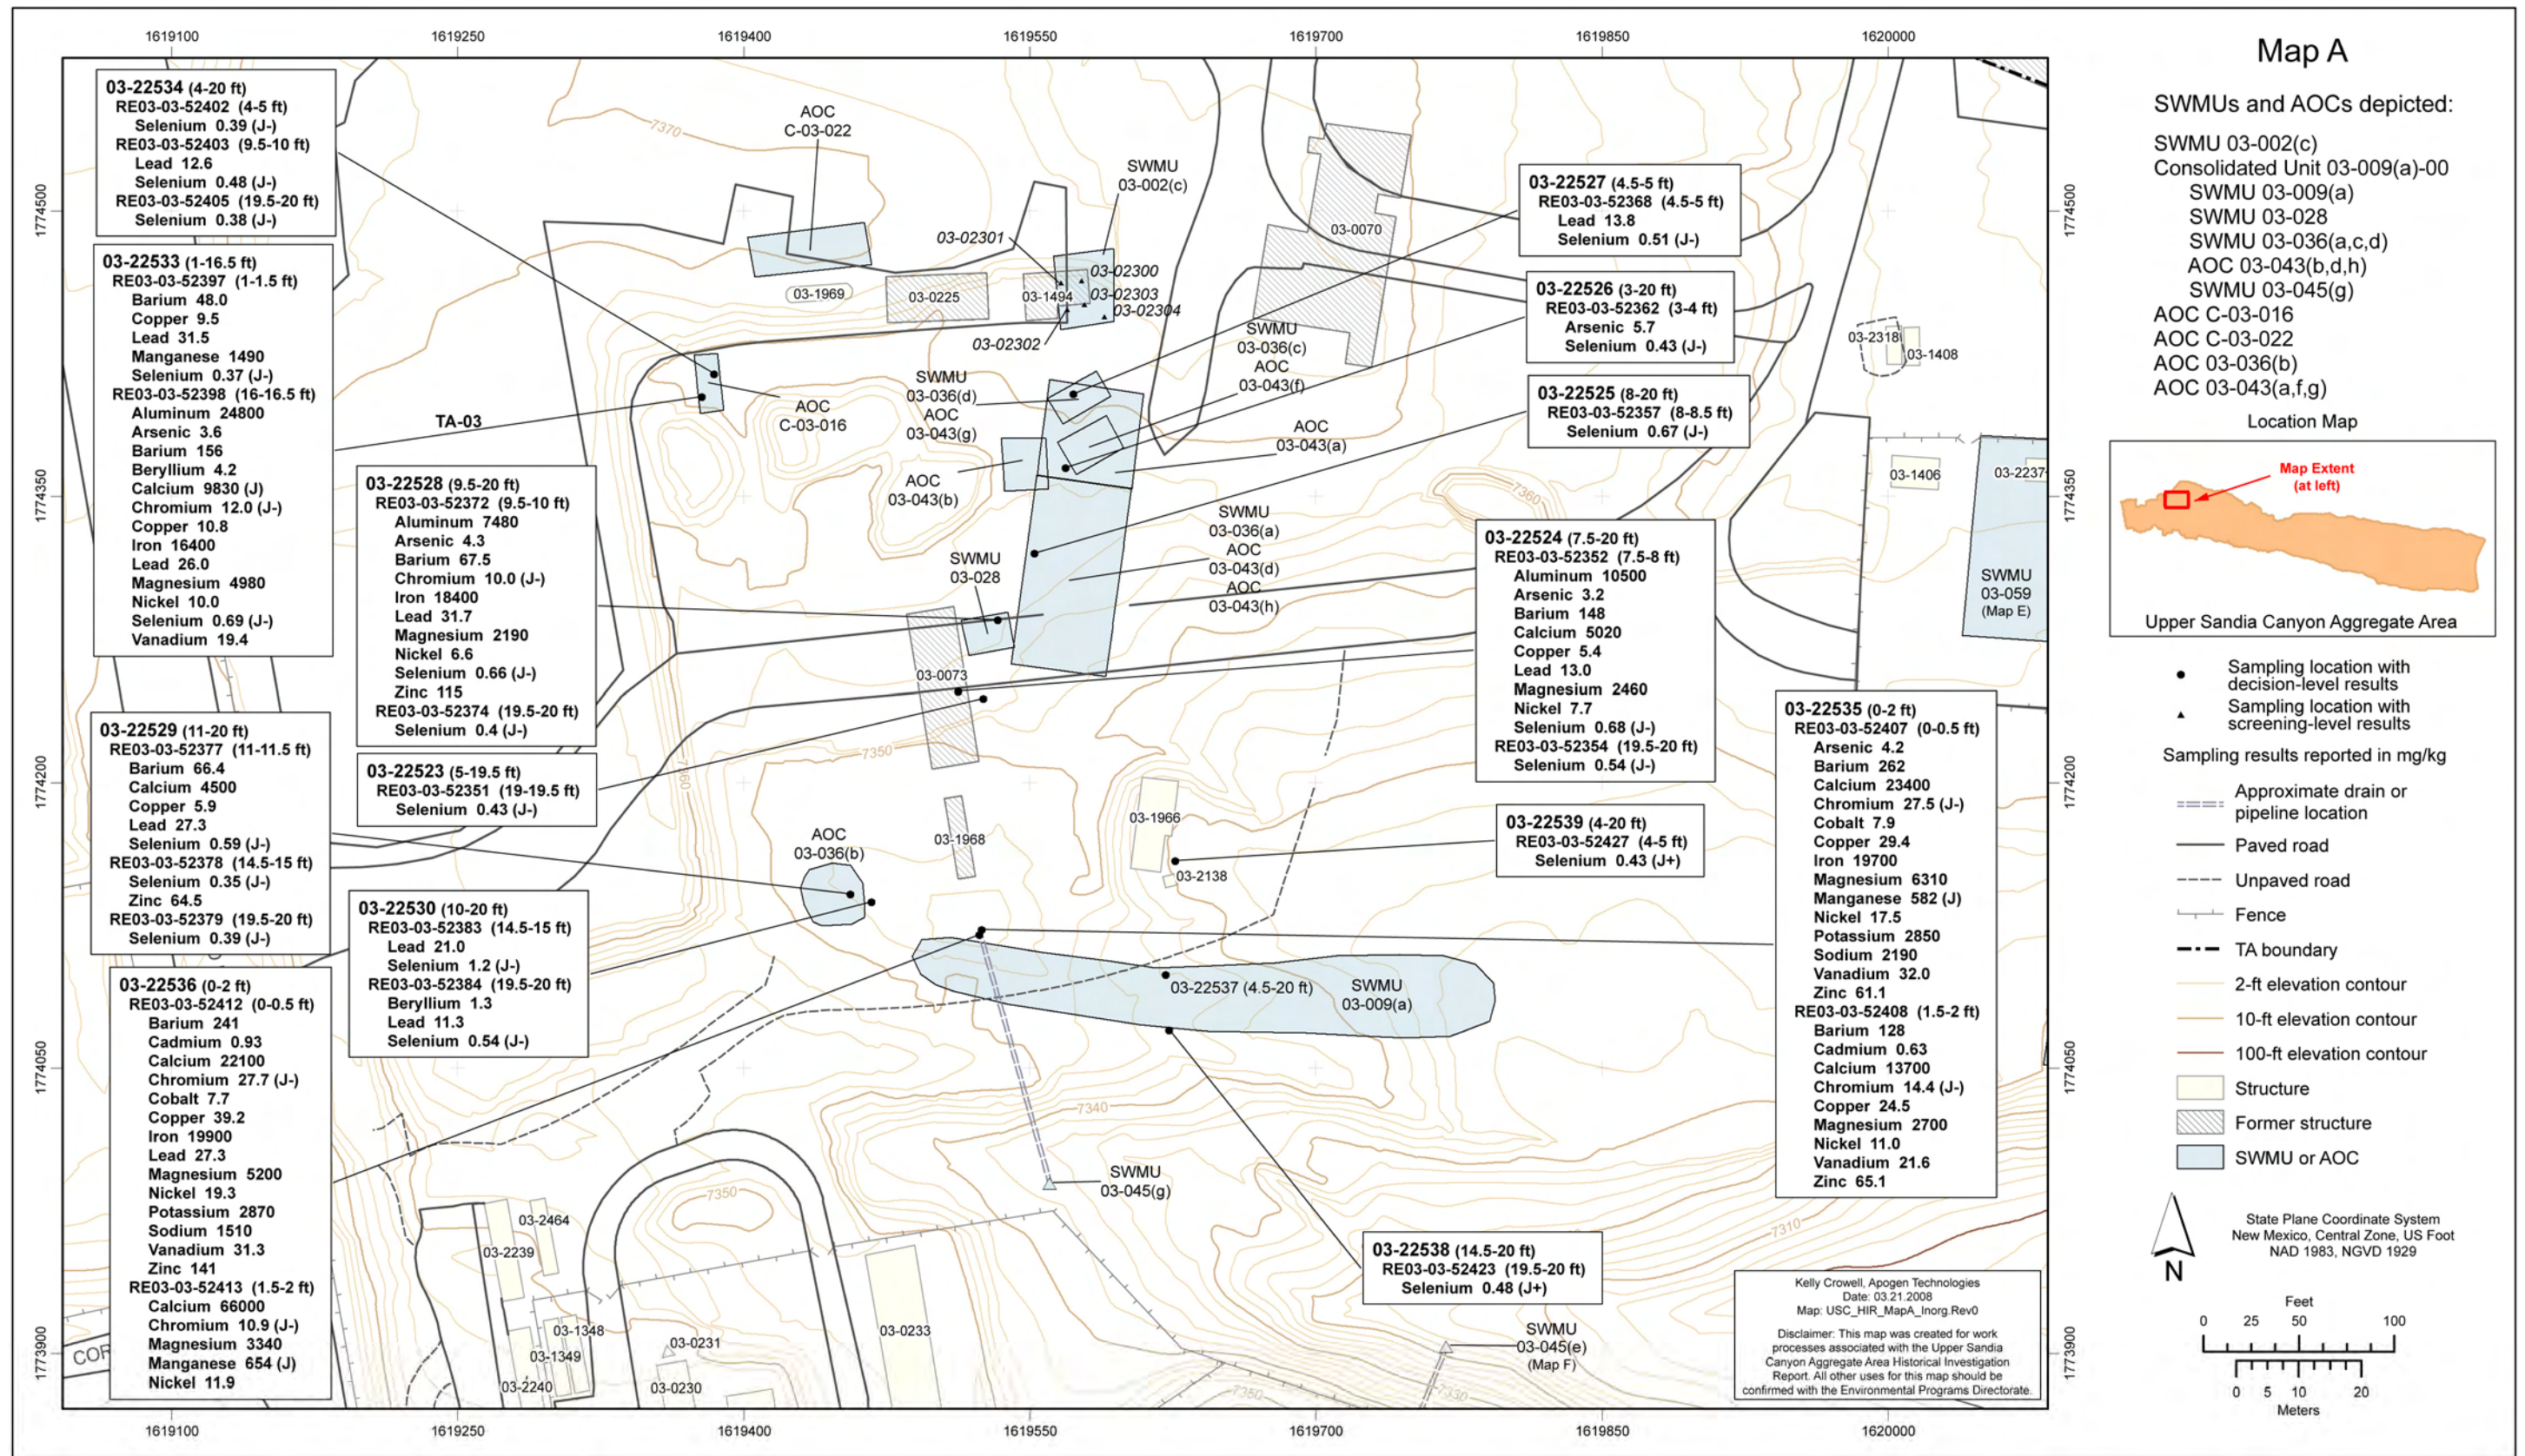


Figure 4.1-2 Map A inorganic chemical sampling locations and results detected above BVs



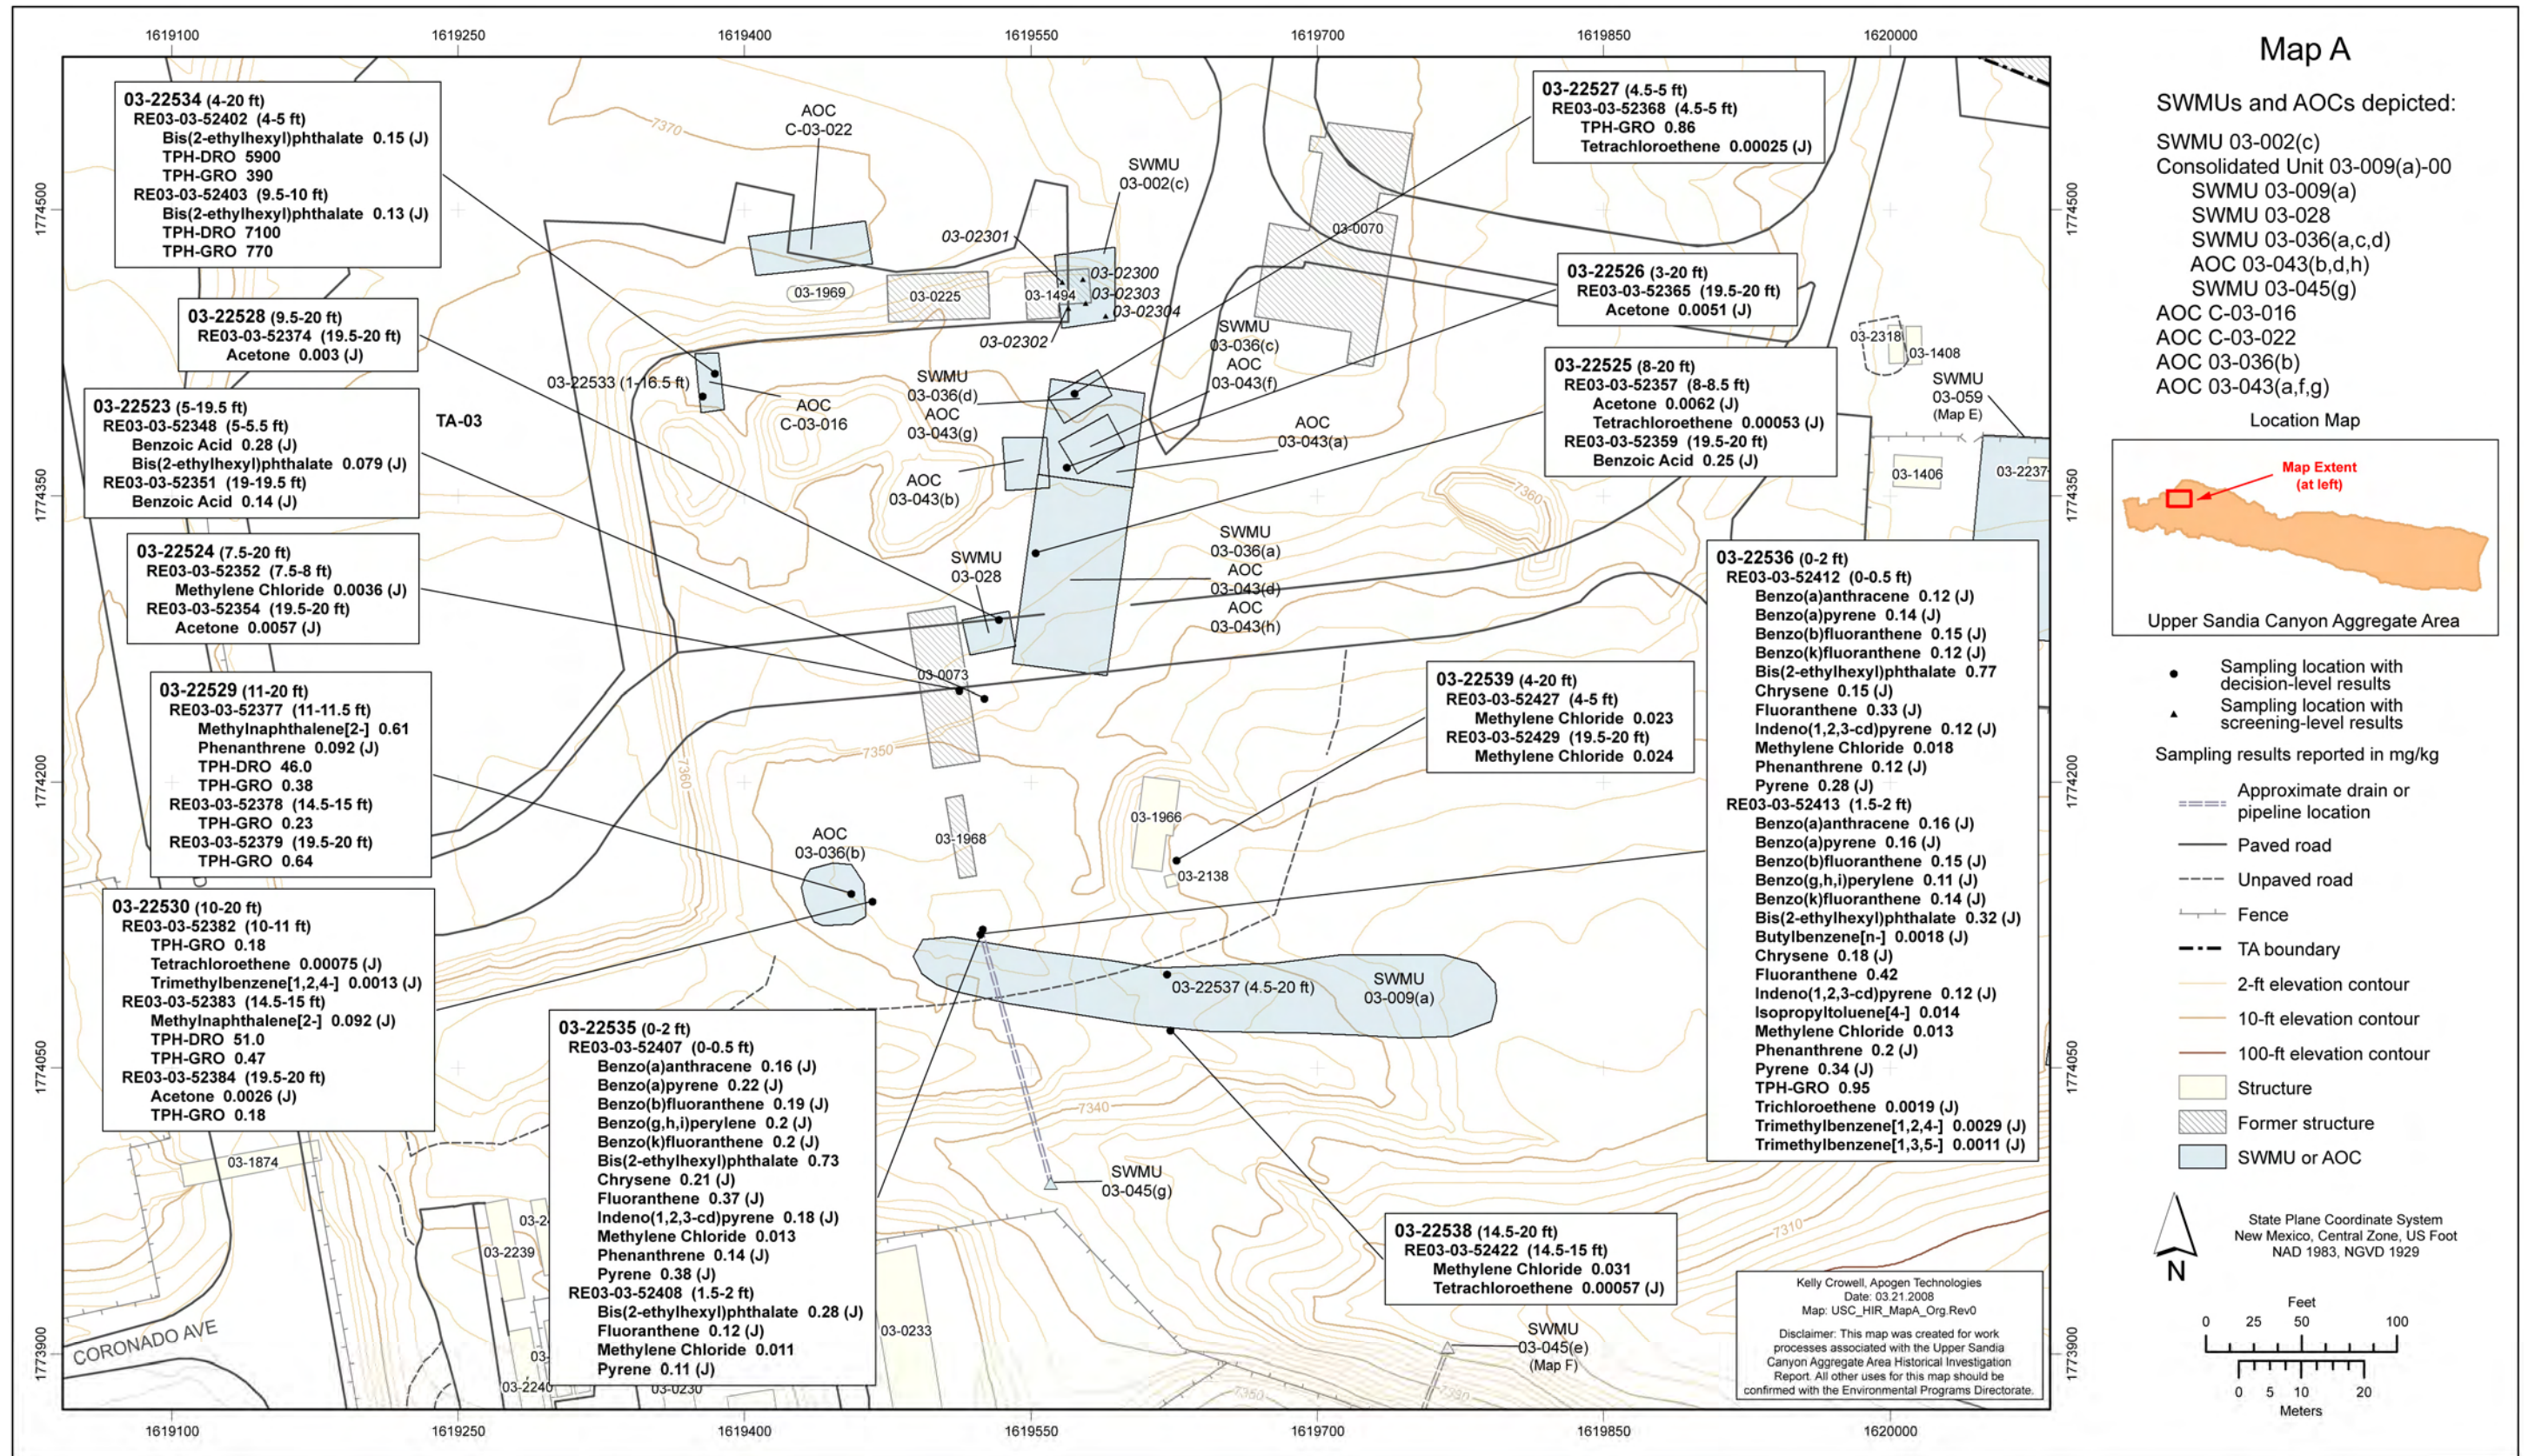


Figure 4.1-3 Map A organic chemical sampling locations and detected results



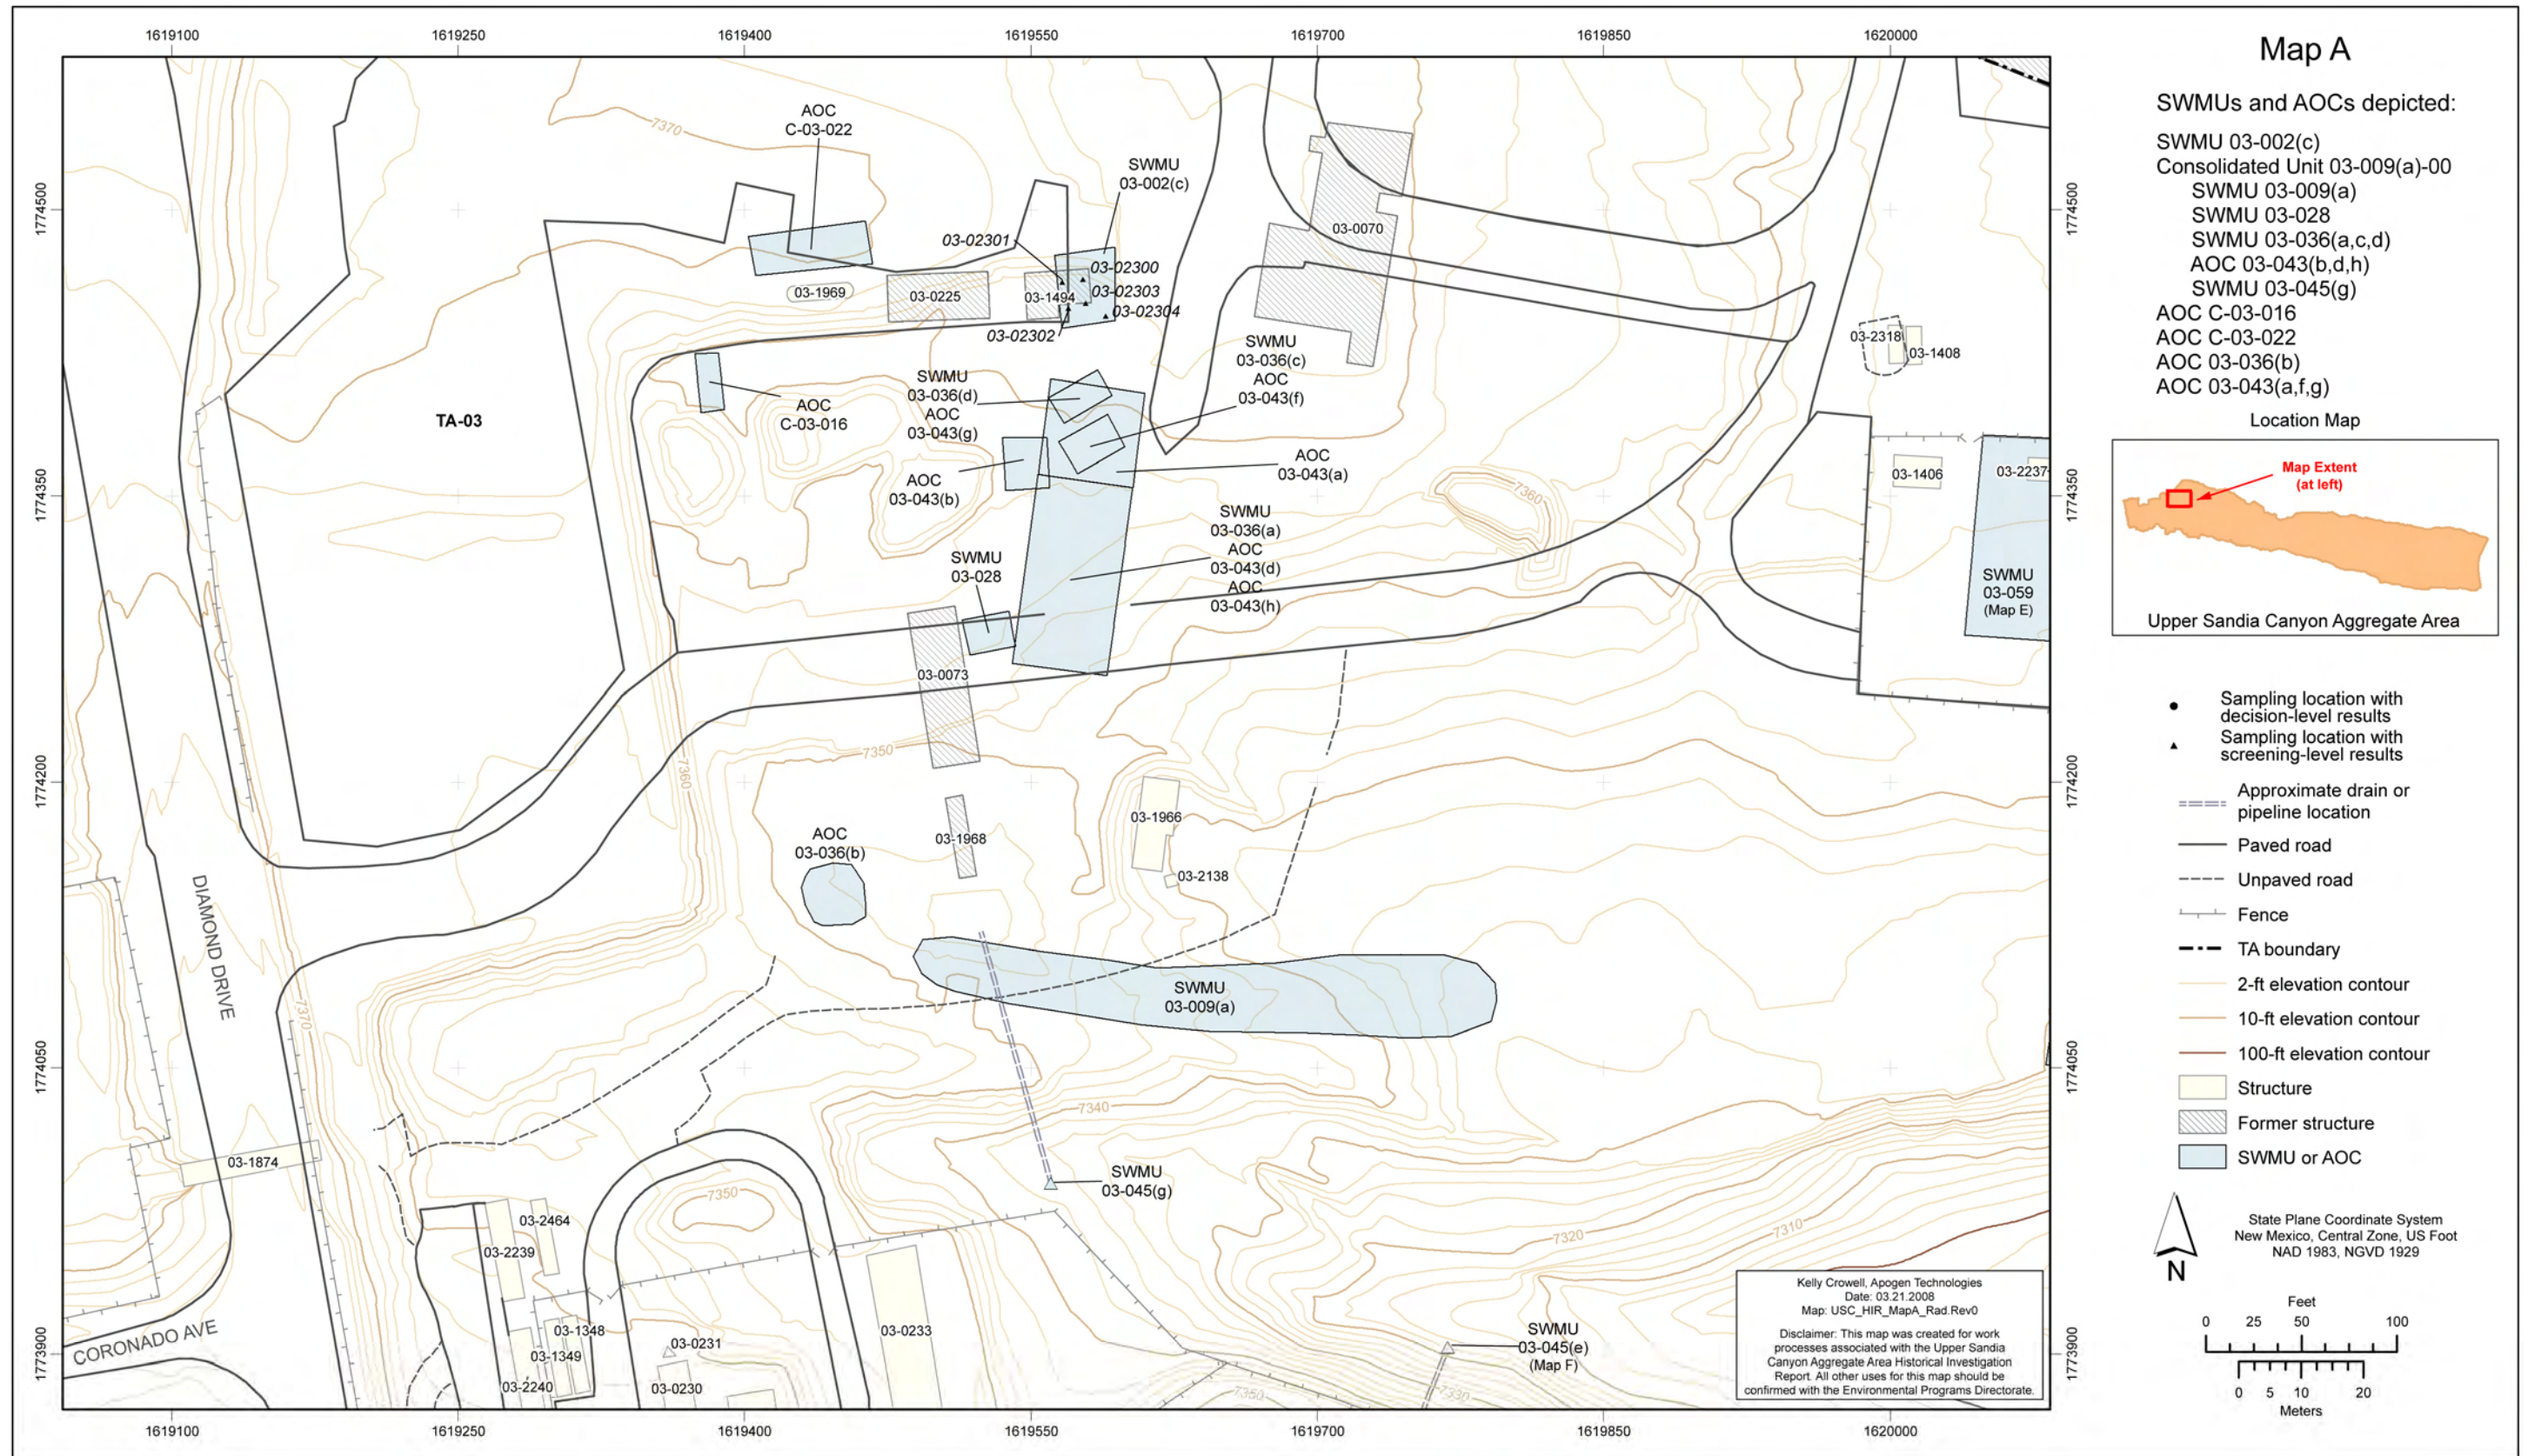


Figure 4.1-4 Map A radionuclide sampling locations



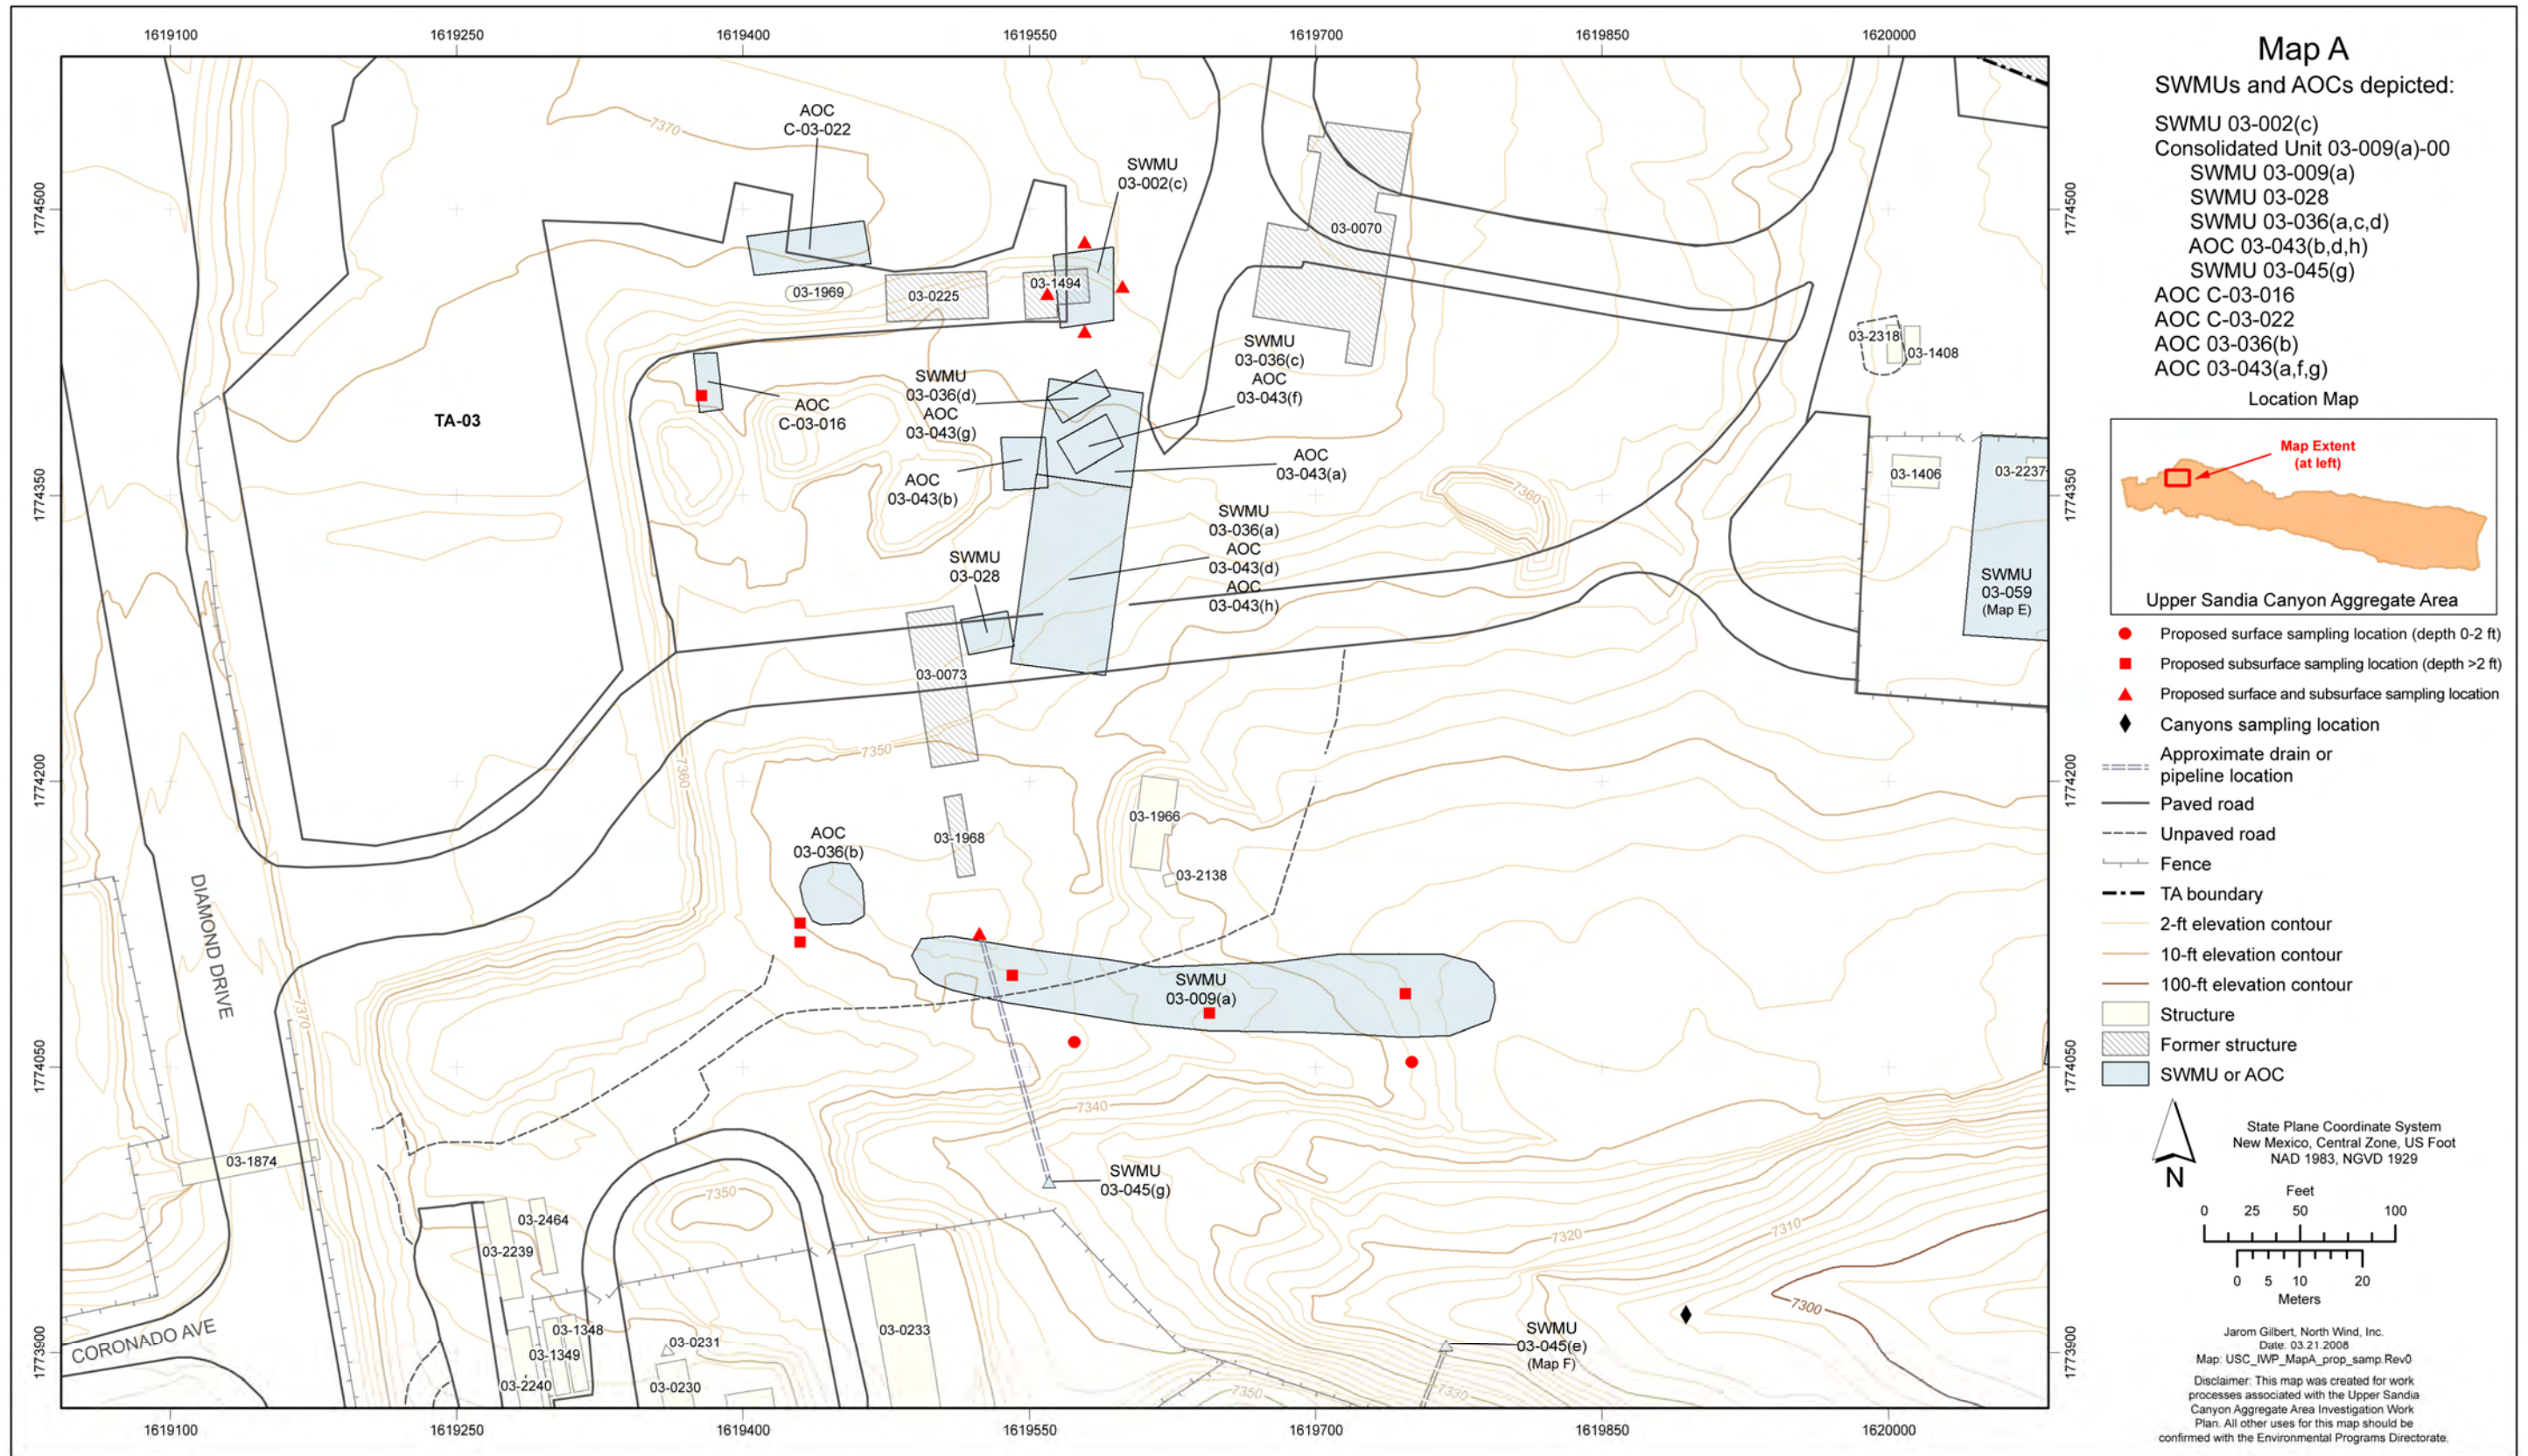


Figure 4.1-5 Map A proposed sampling locations



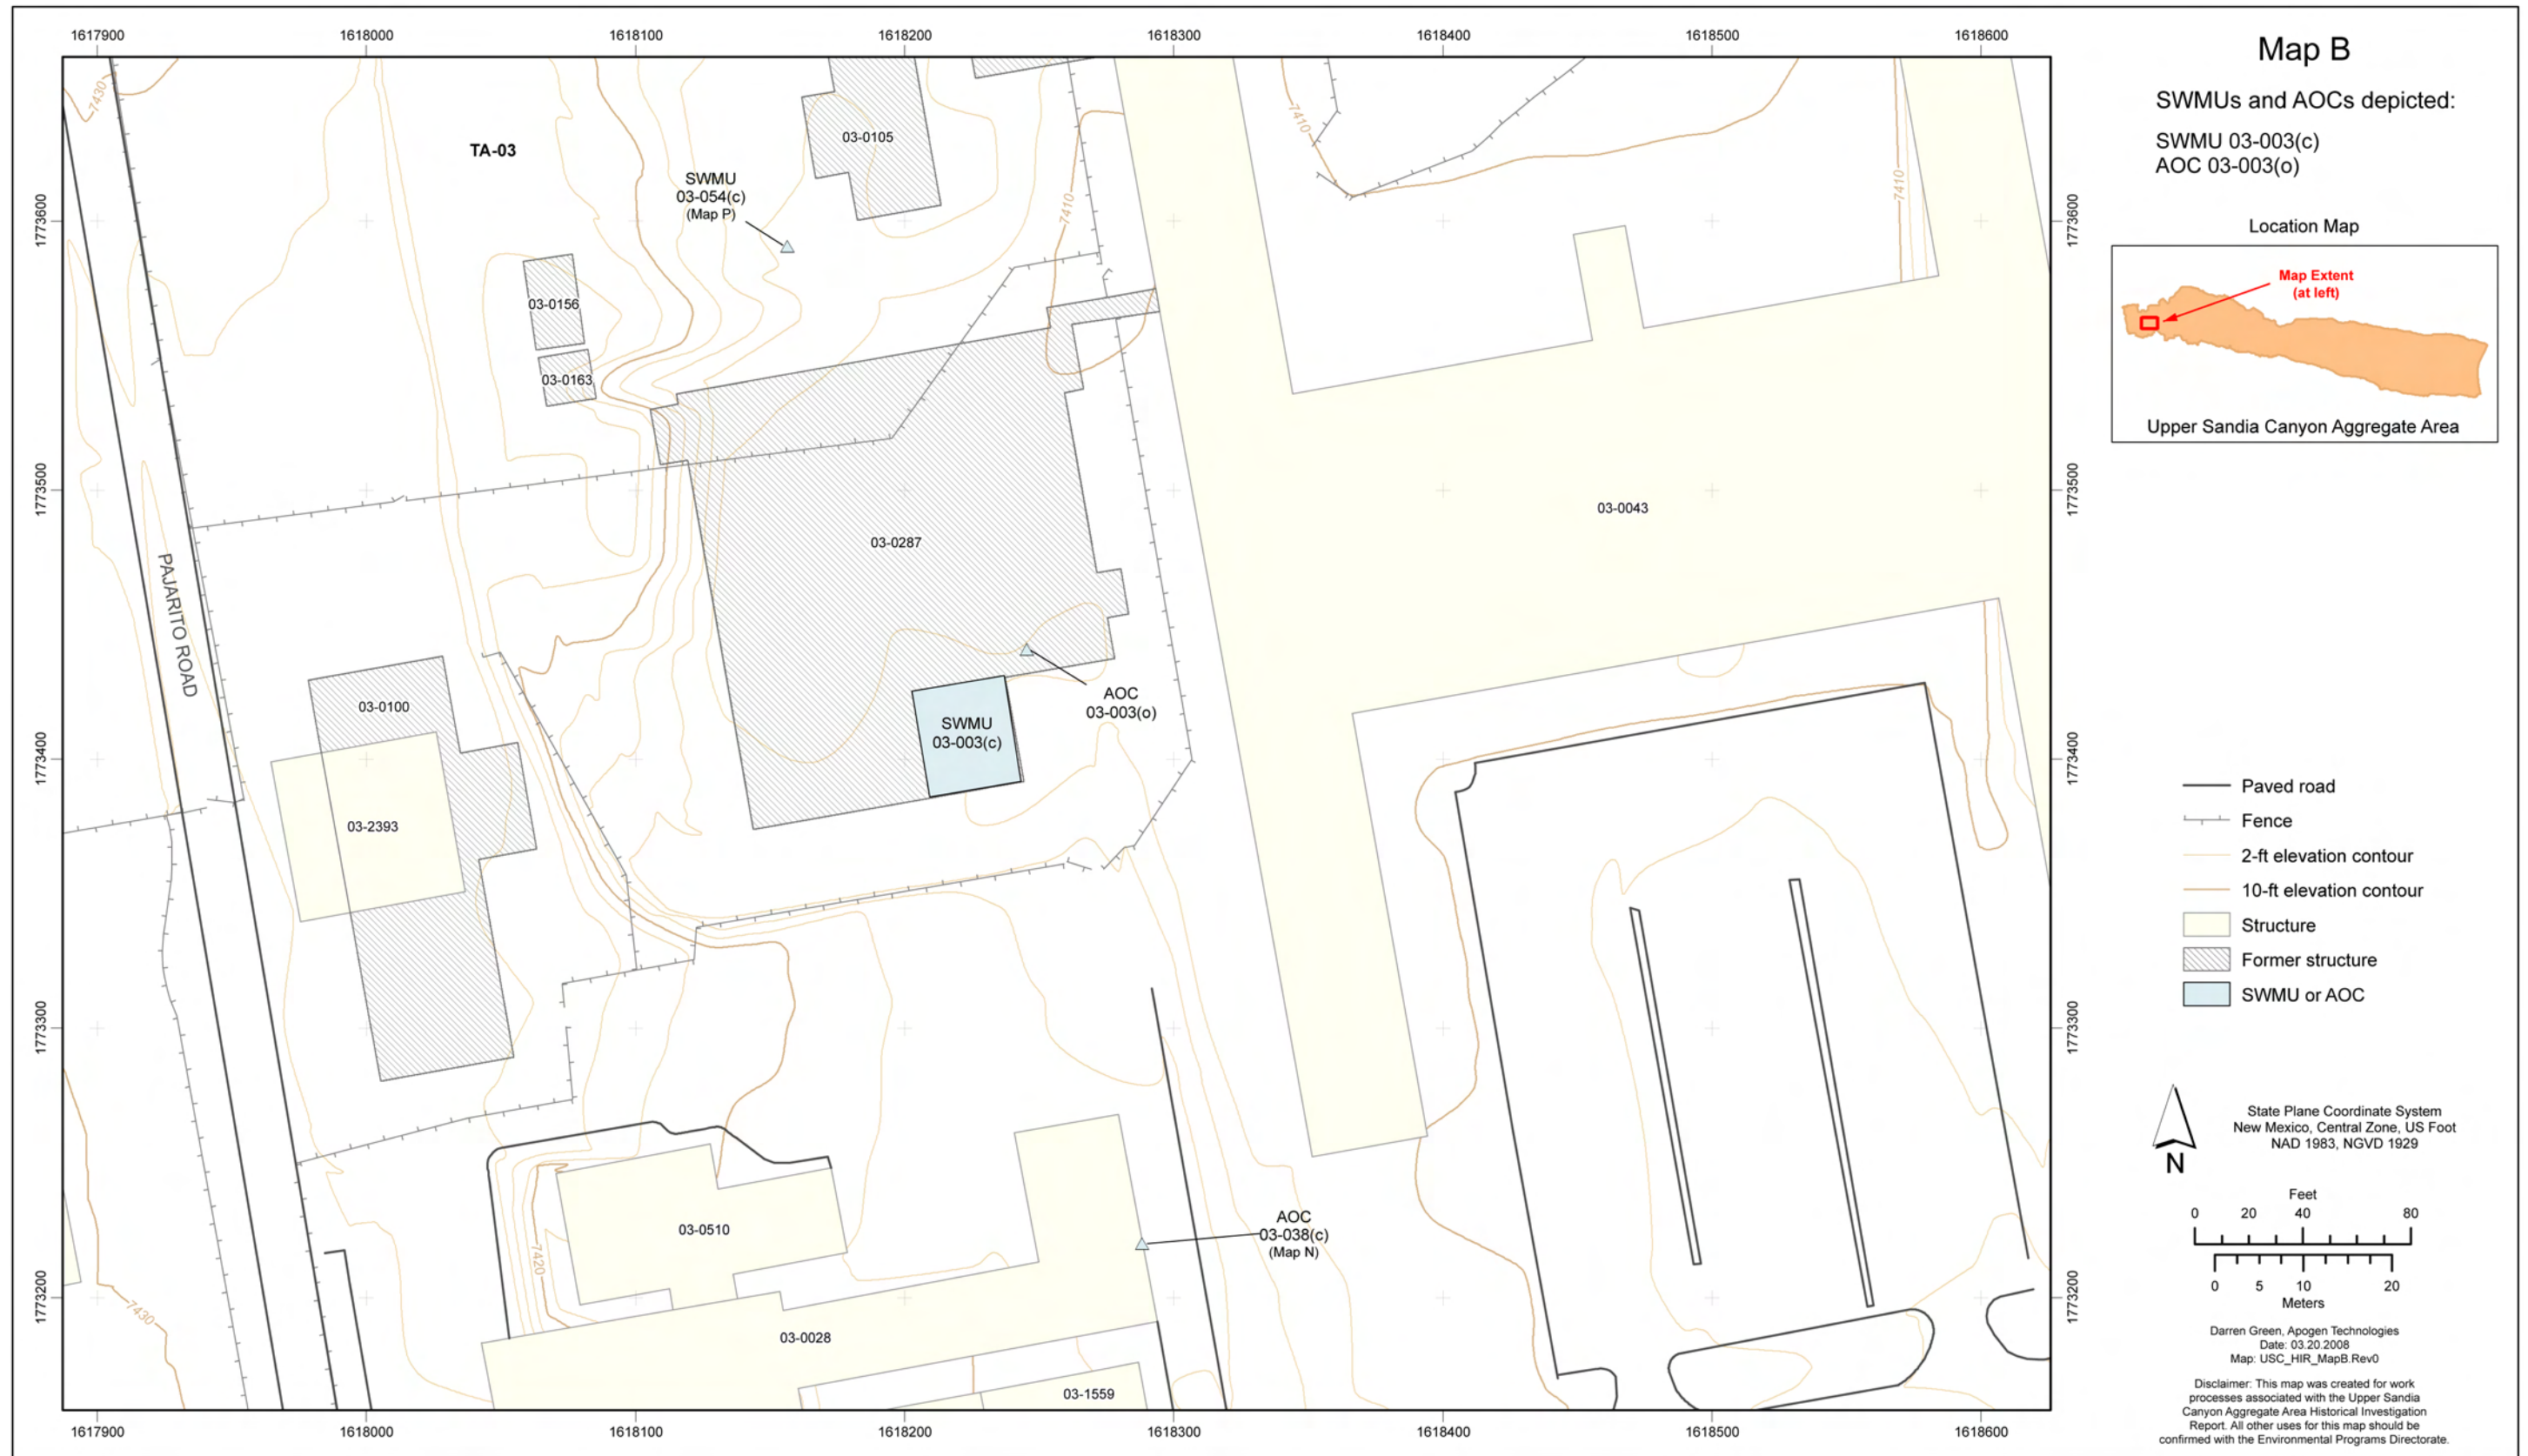


Figure 4.1-6 Map B site location



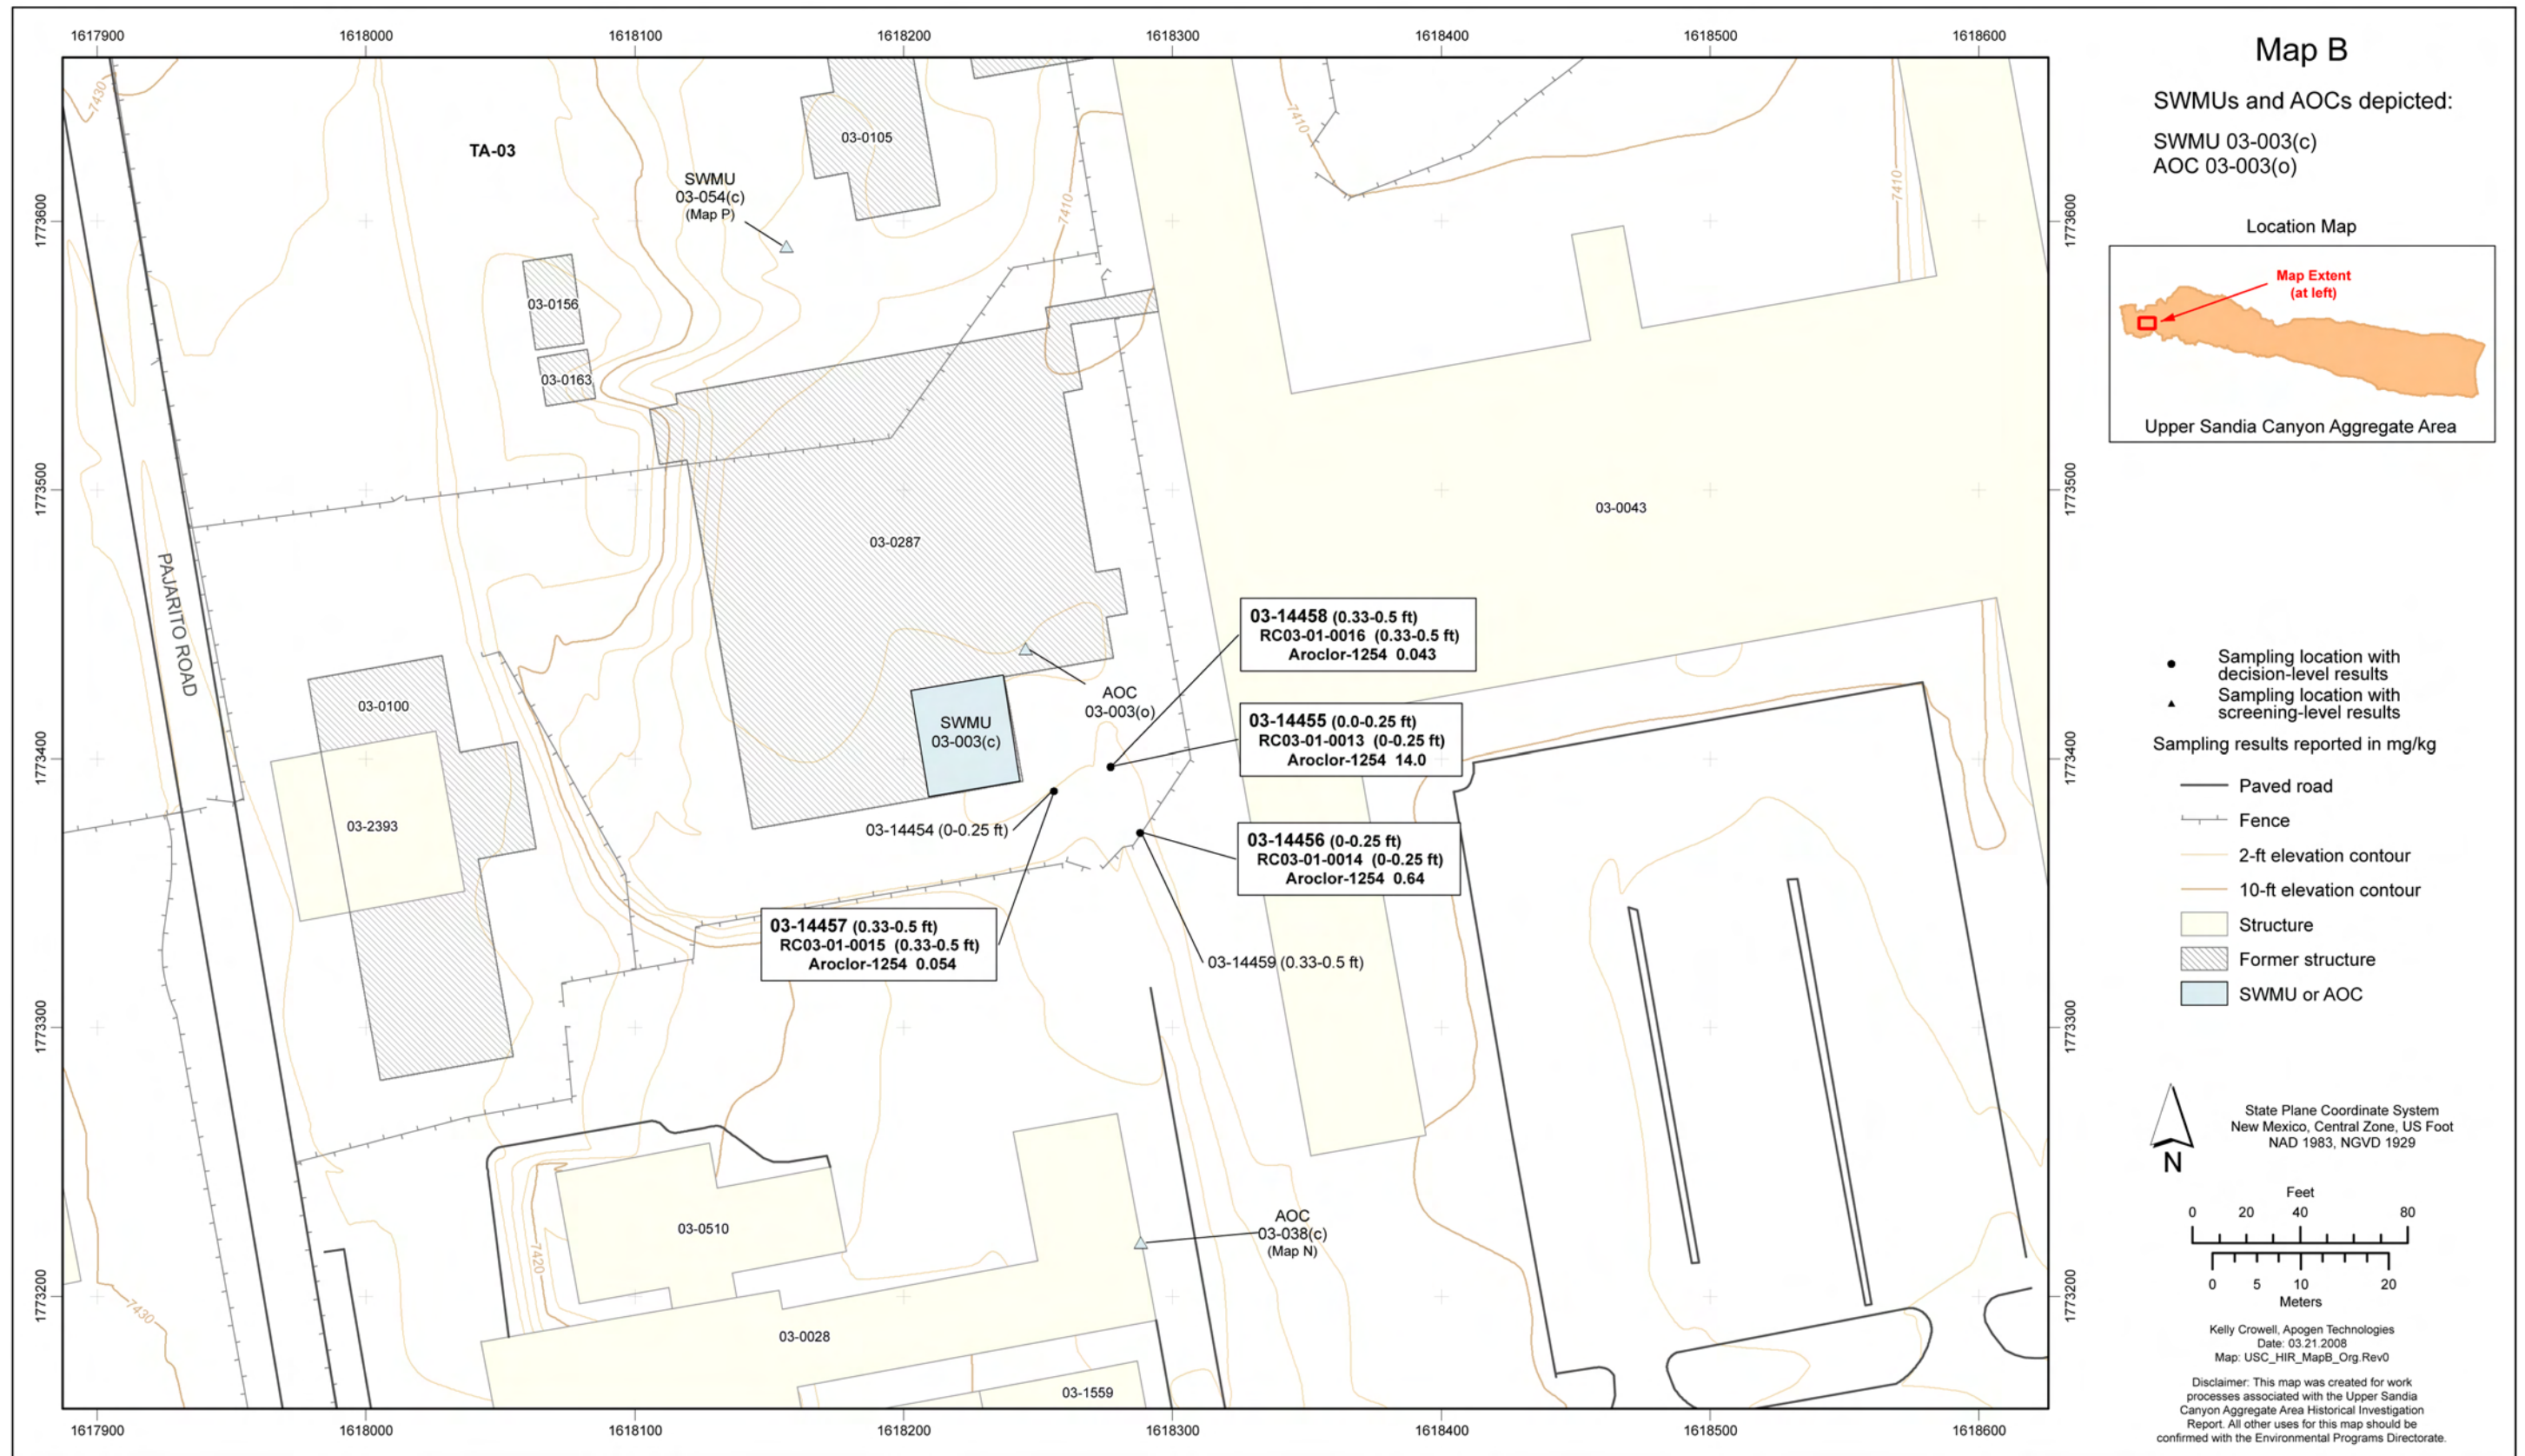


Figure 4.1-7 Map B organic chemical sampling locations and detected results



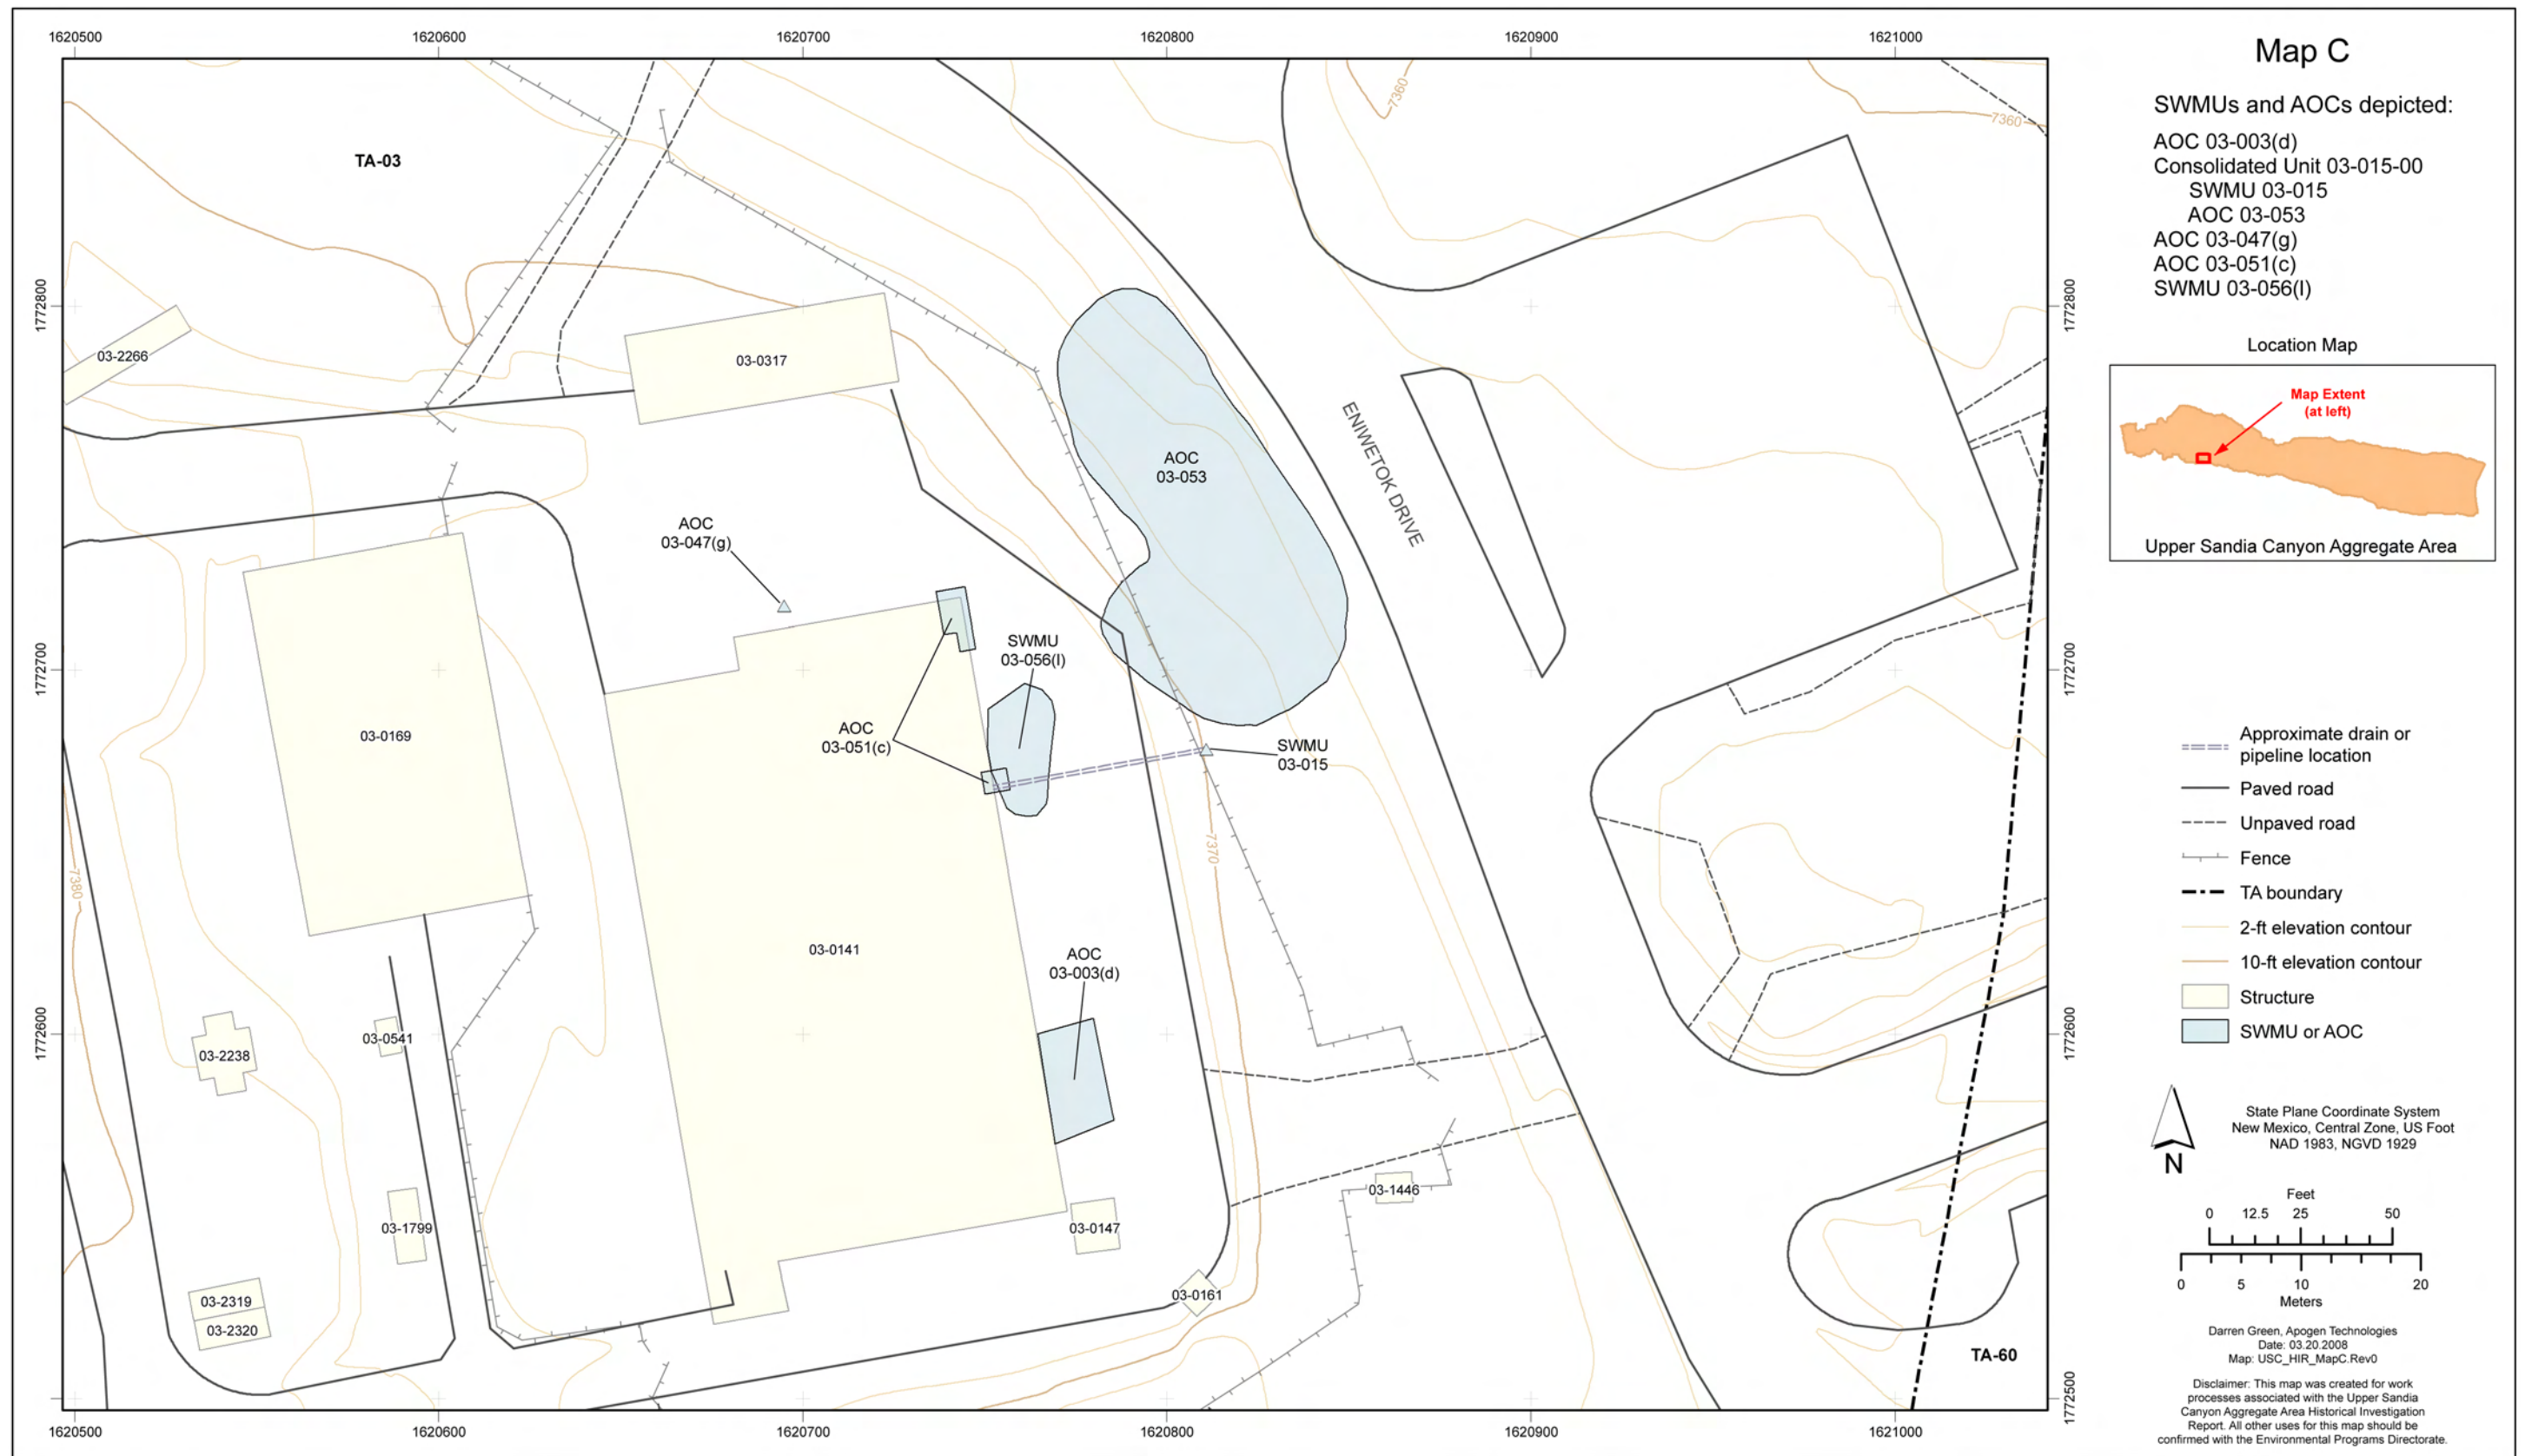


Figure 4.1-8 Map C site location

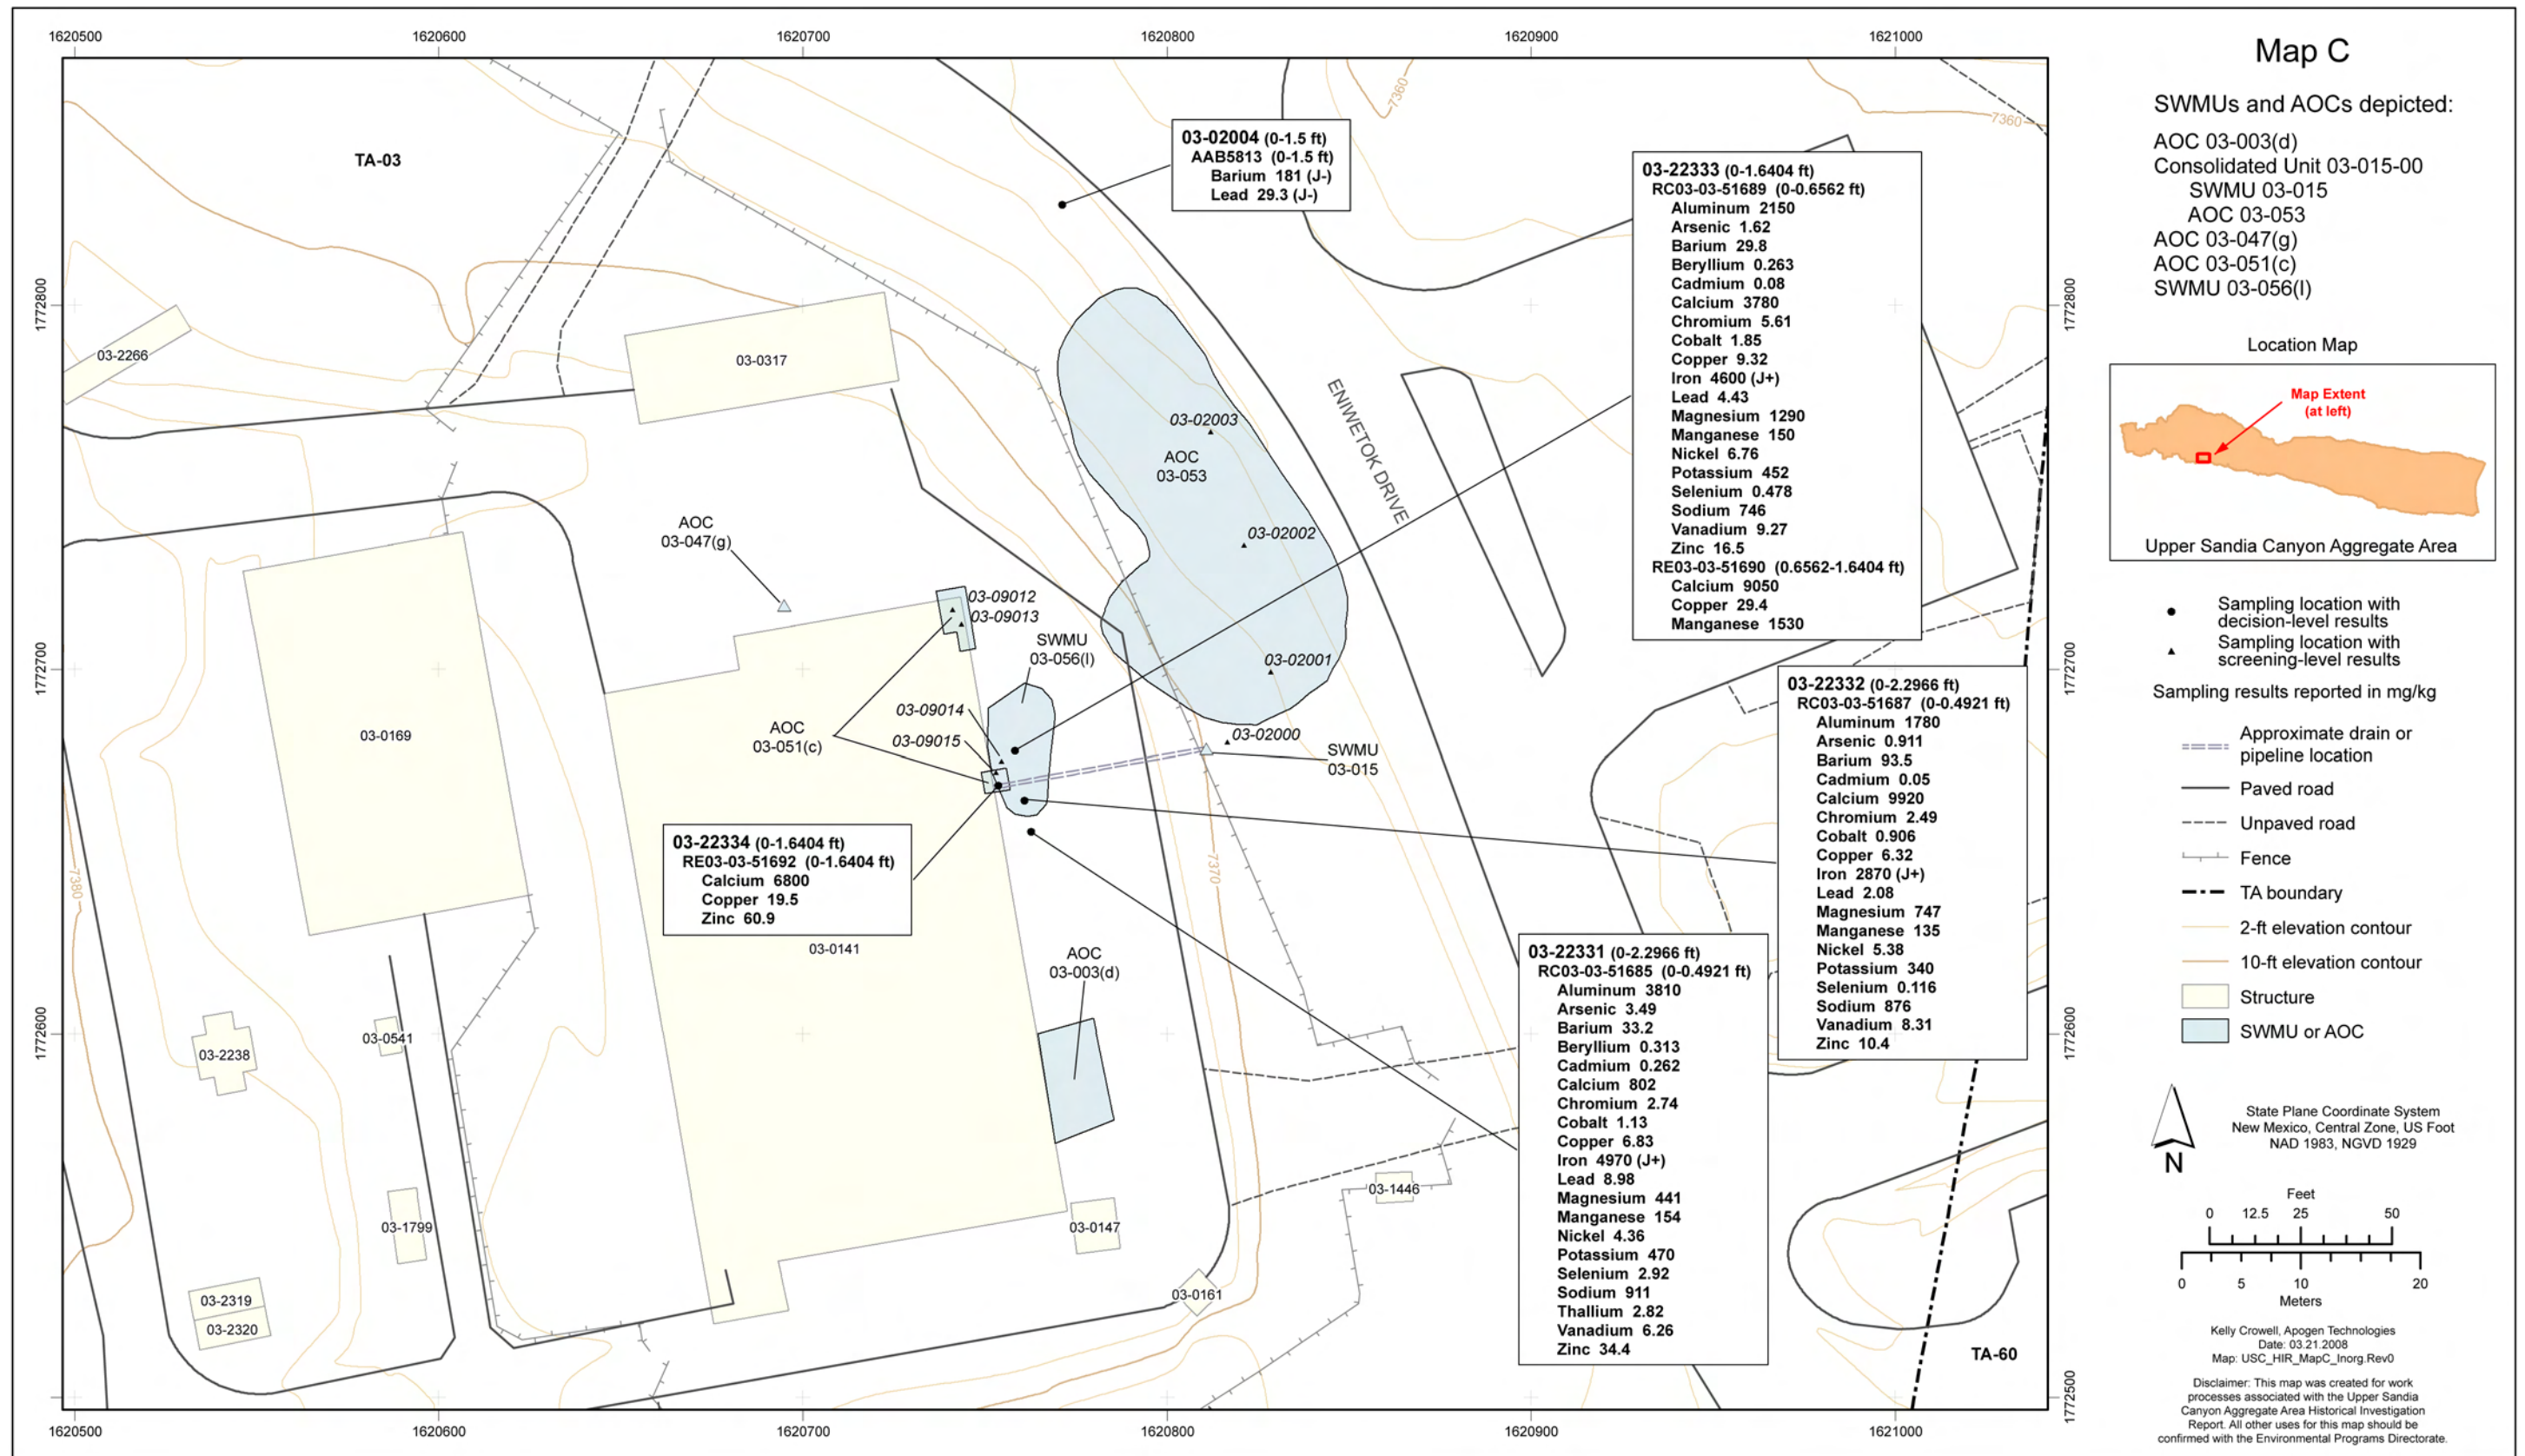


Figure 4.1-9 Map C inorganic chemical sampling locations and results detected above BVs





Figure 4.1-10 Map C organic chemical sampling locations



Figure 4.1-11 Map C radionuclide sampling locations



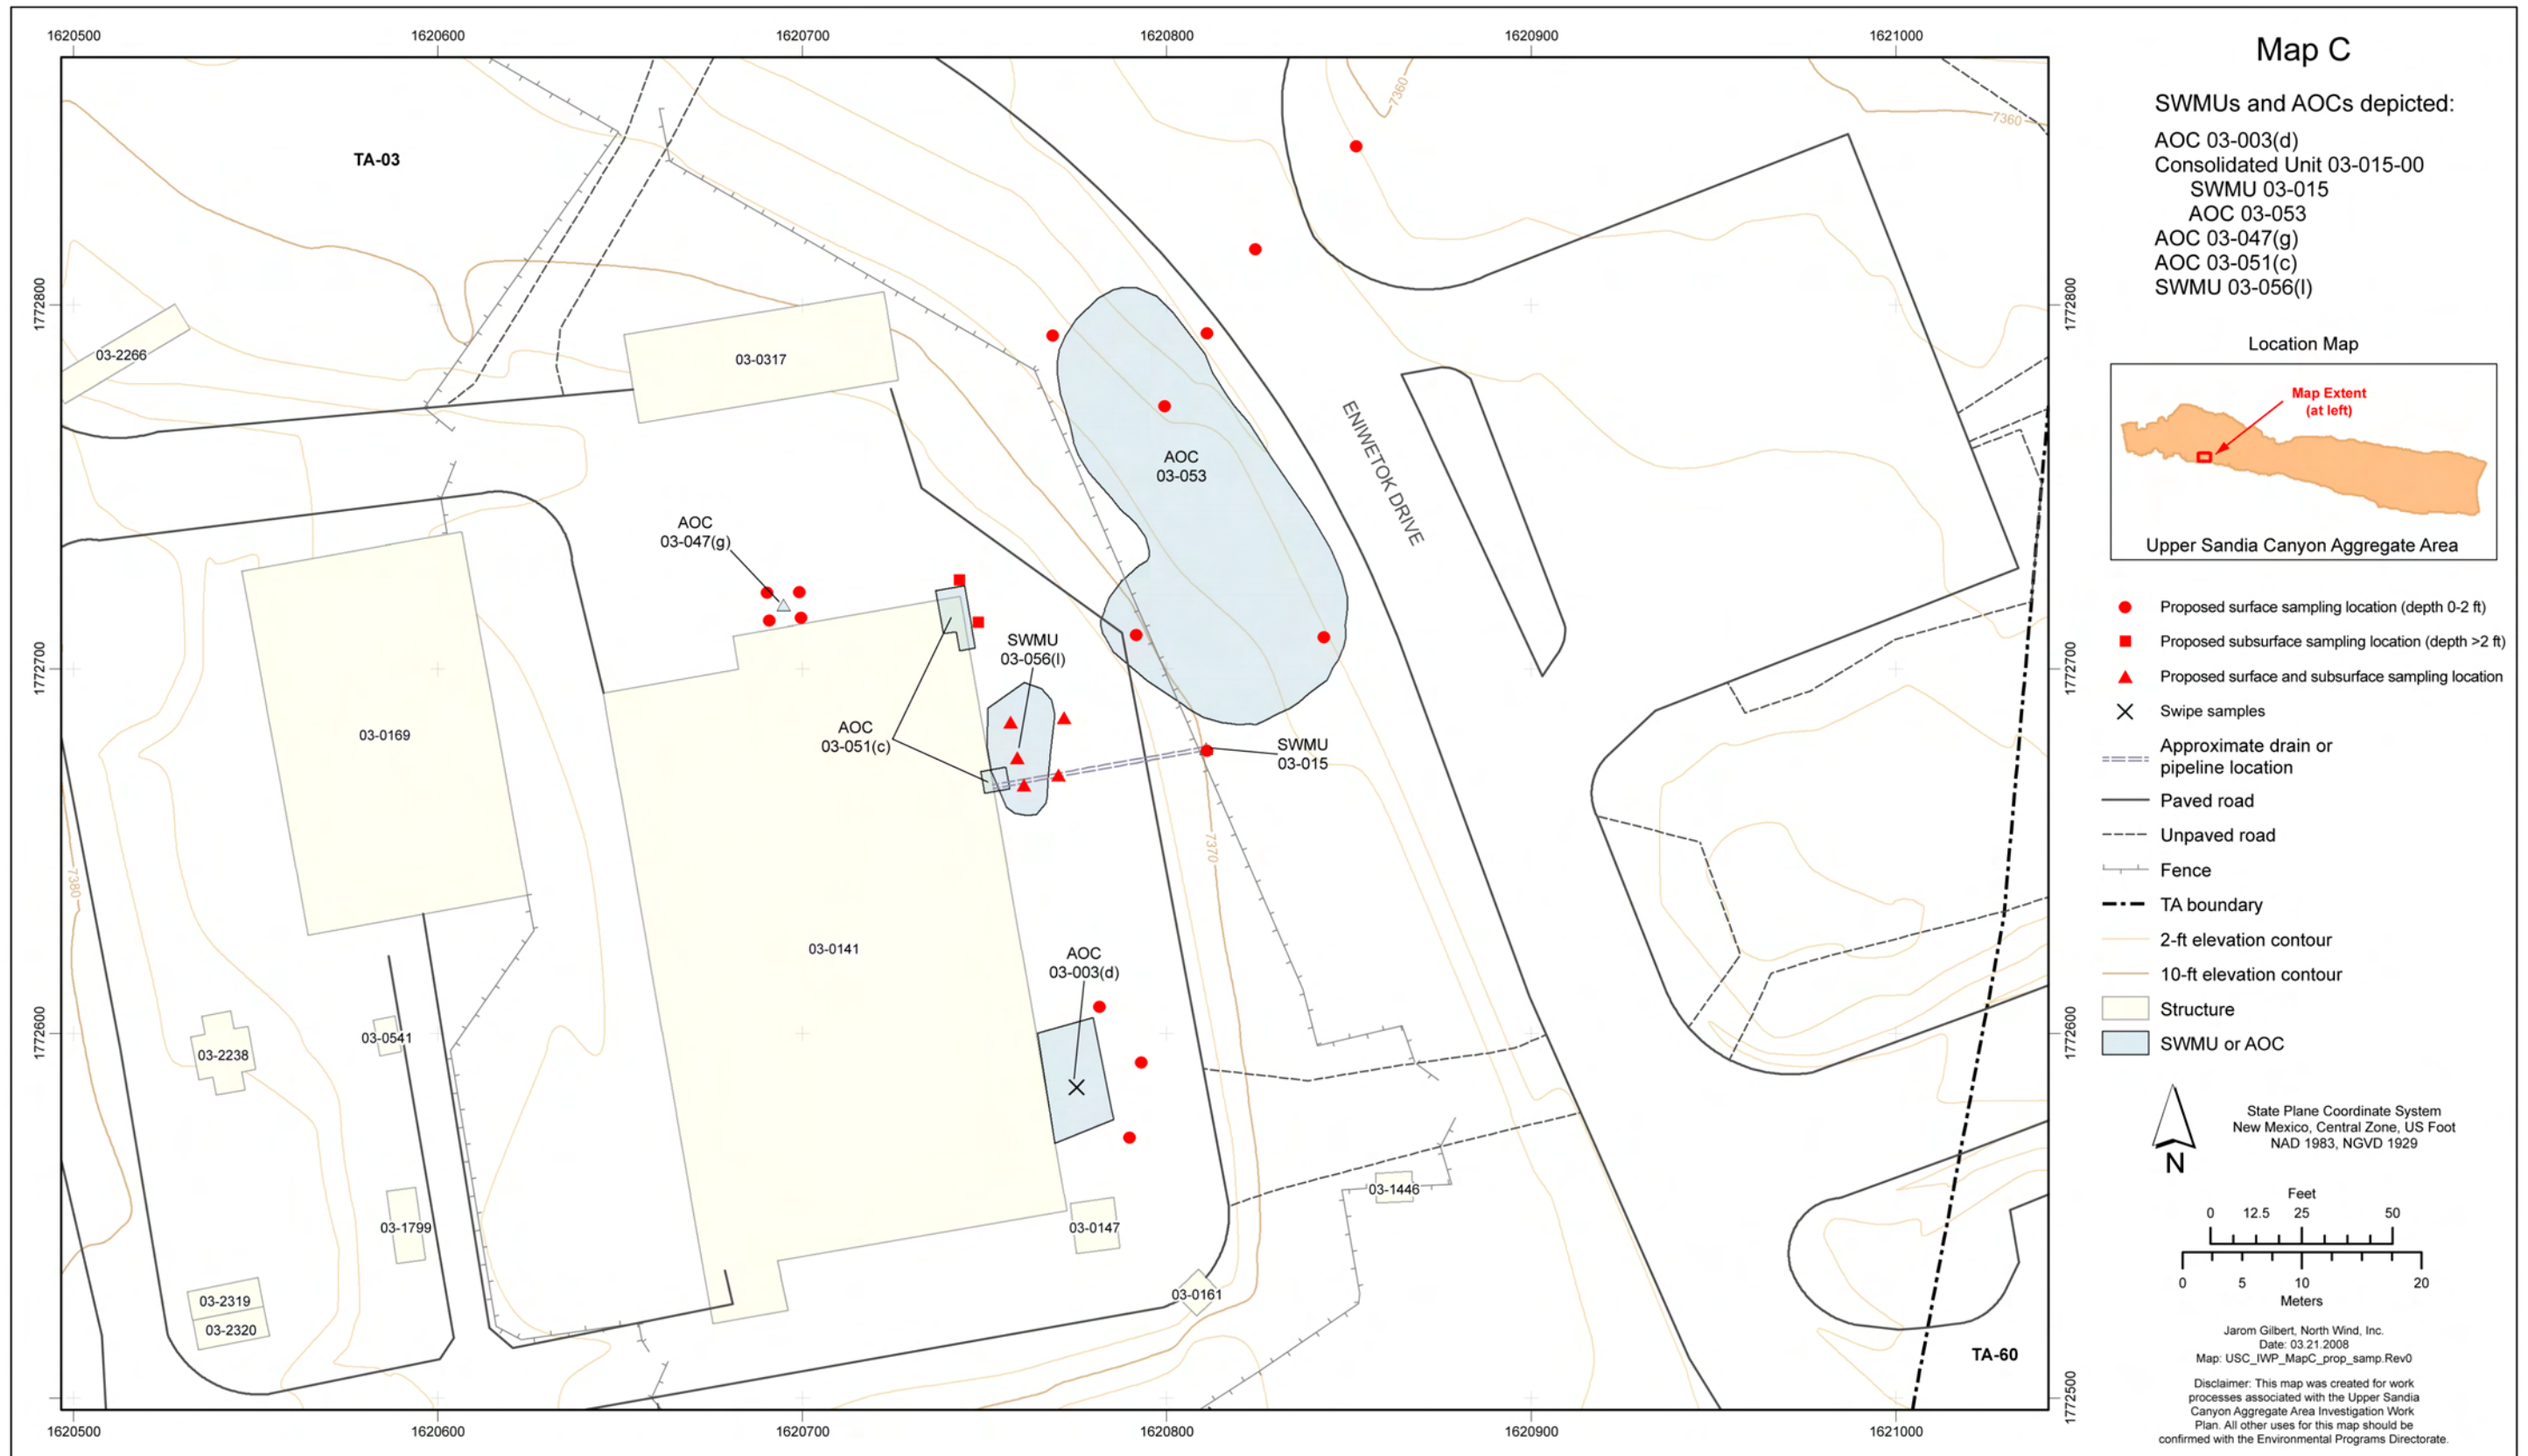


Figure 4.1-12 Map C proposed sampling locations



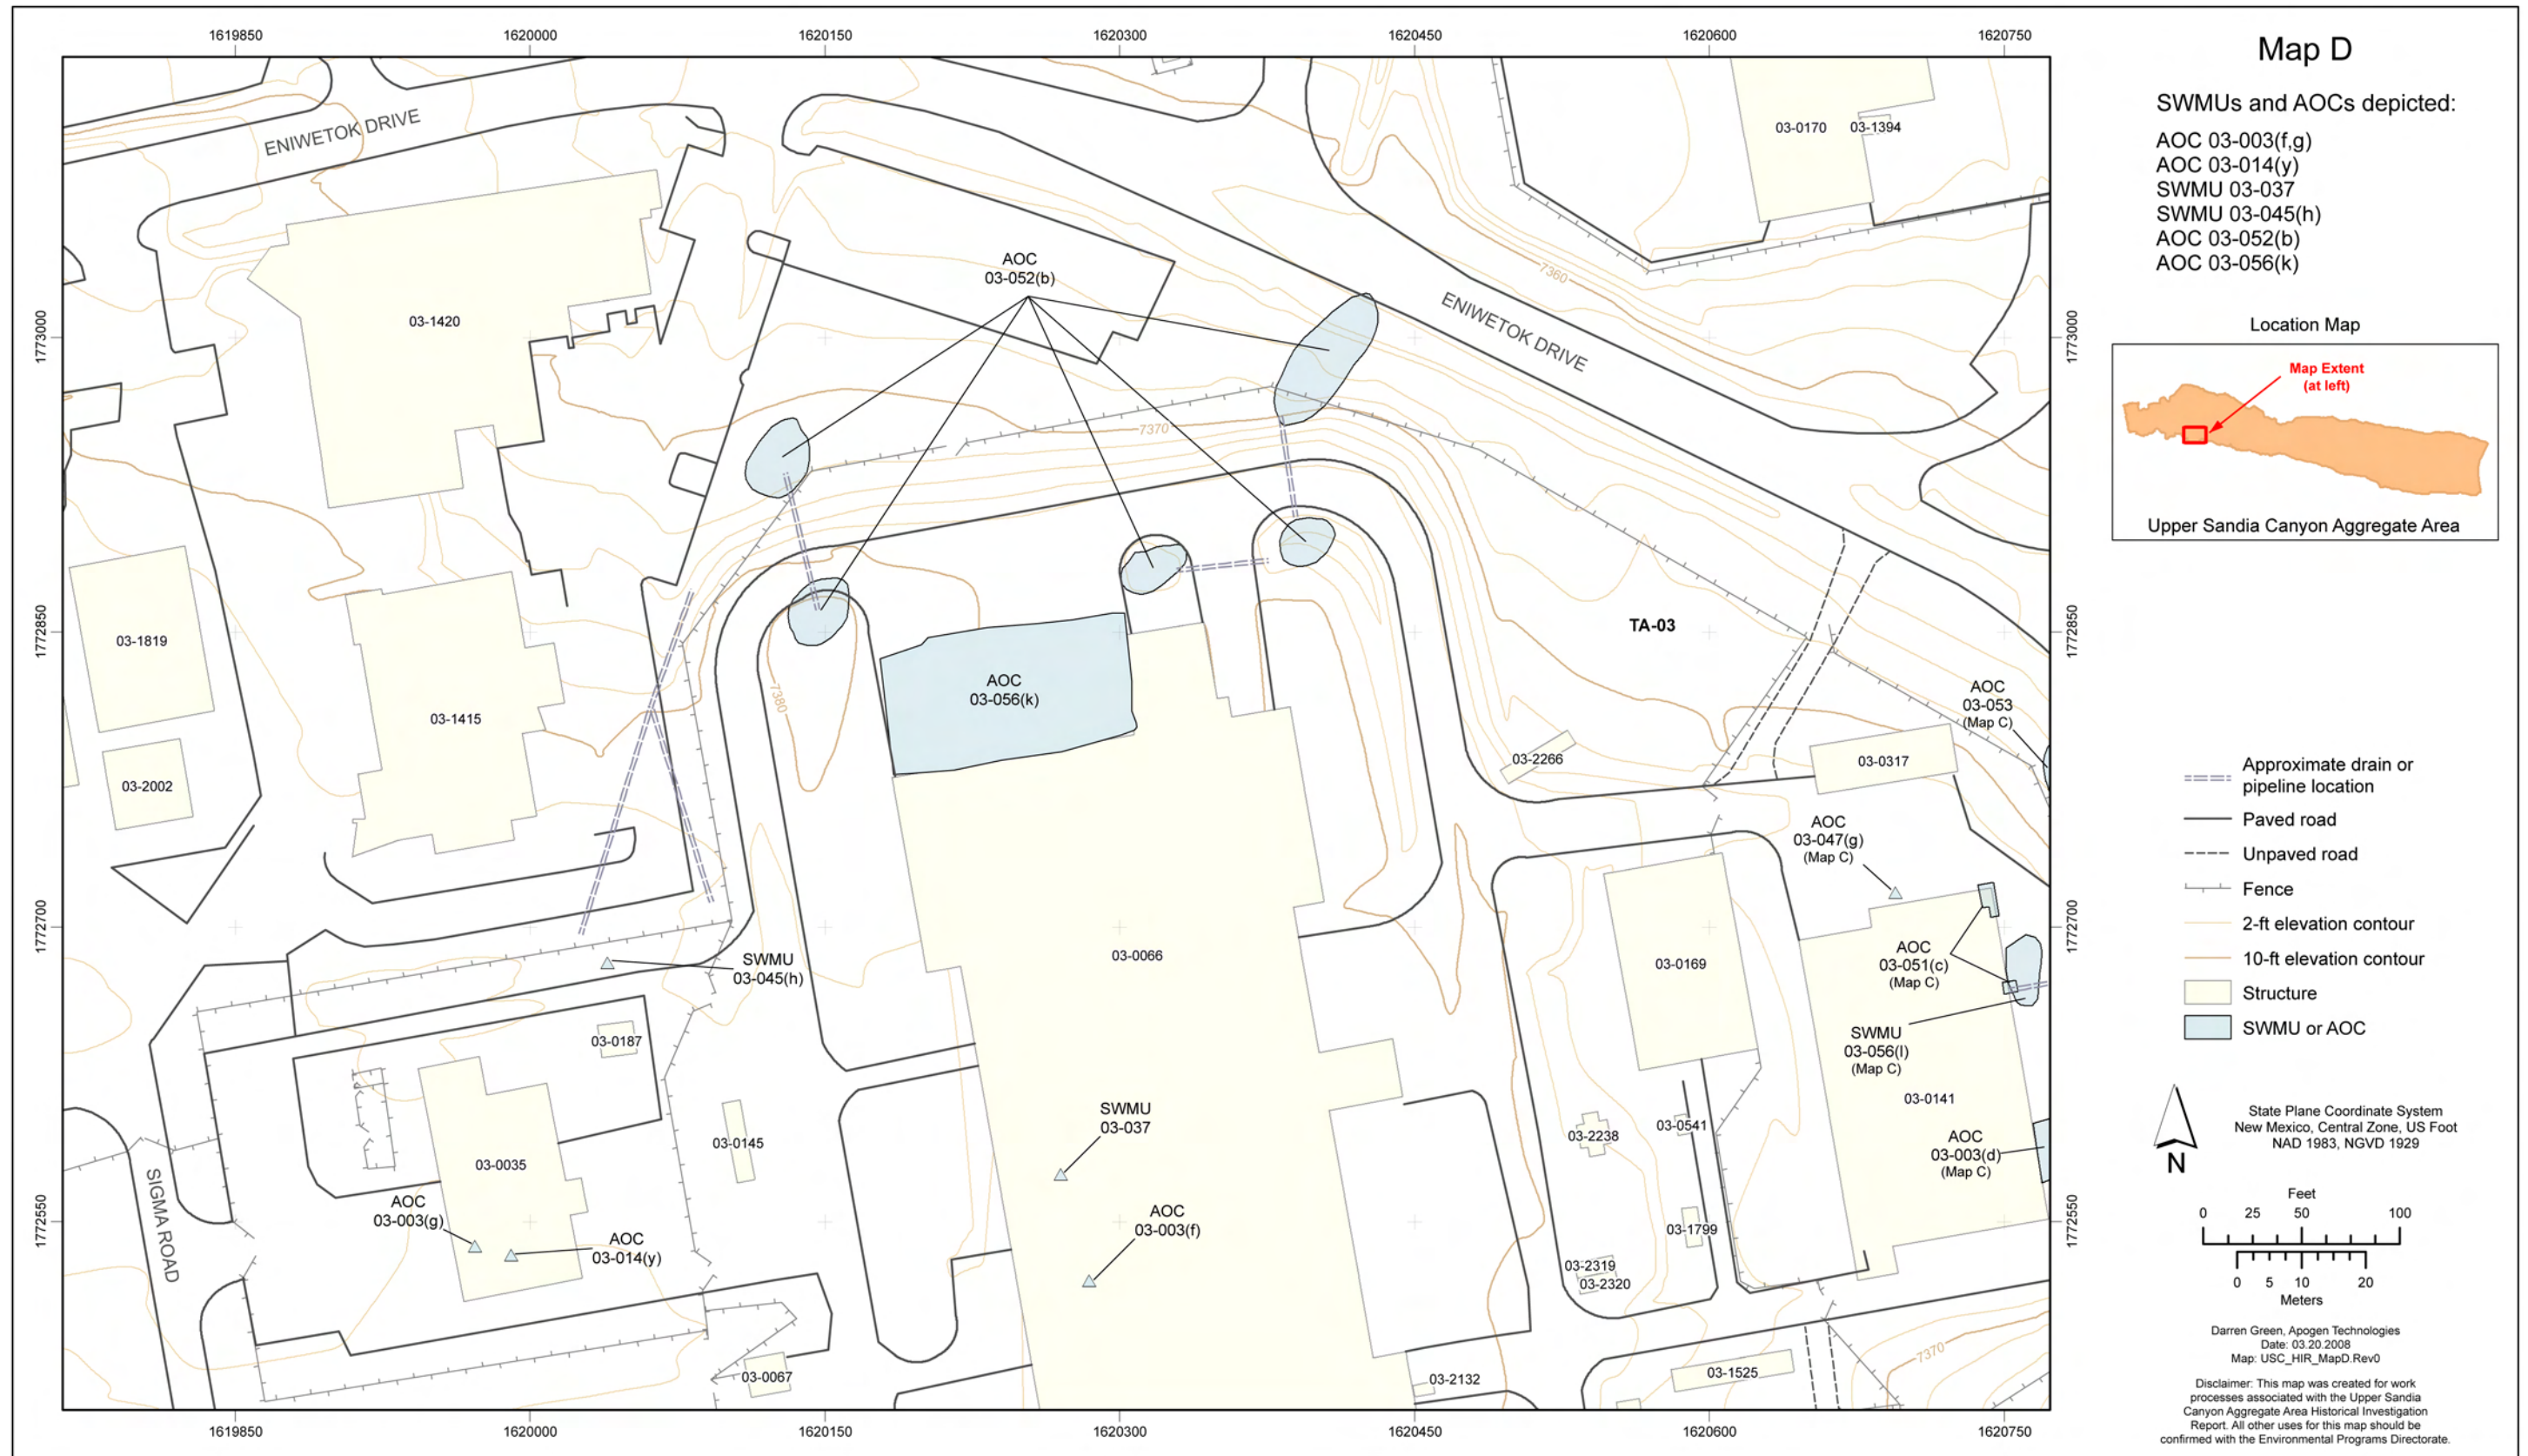


Figure 4.1-13 Map D site location



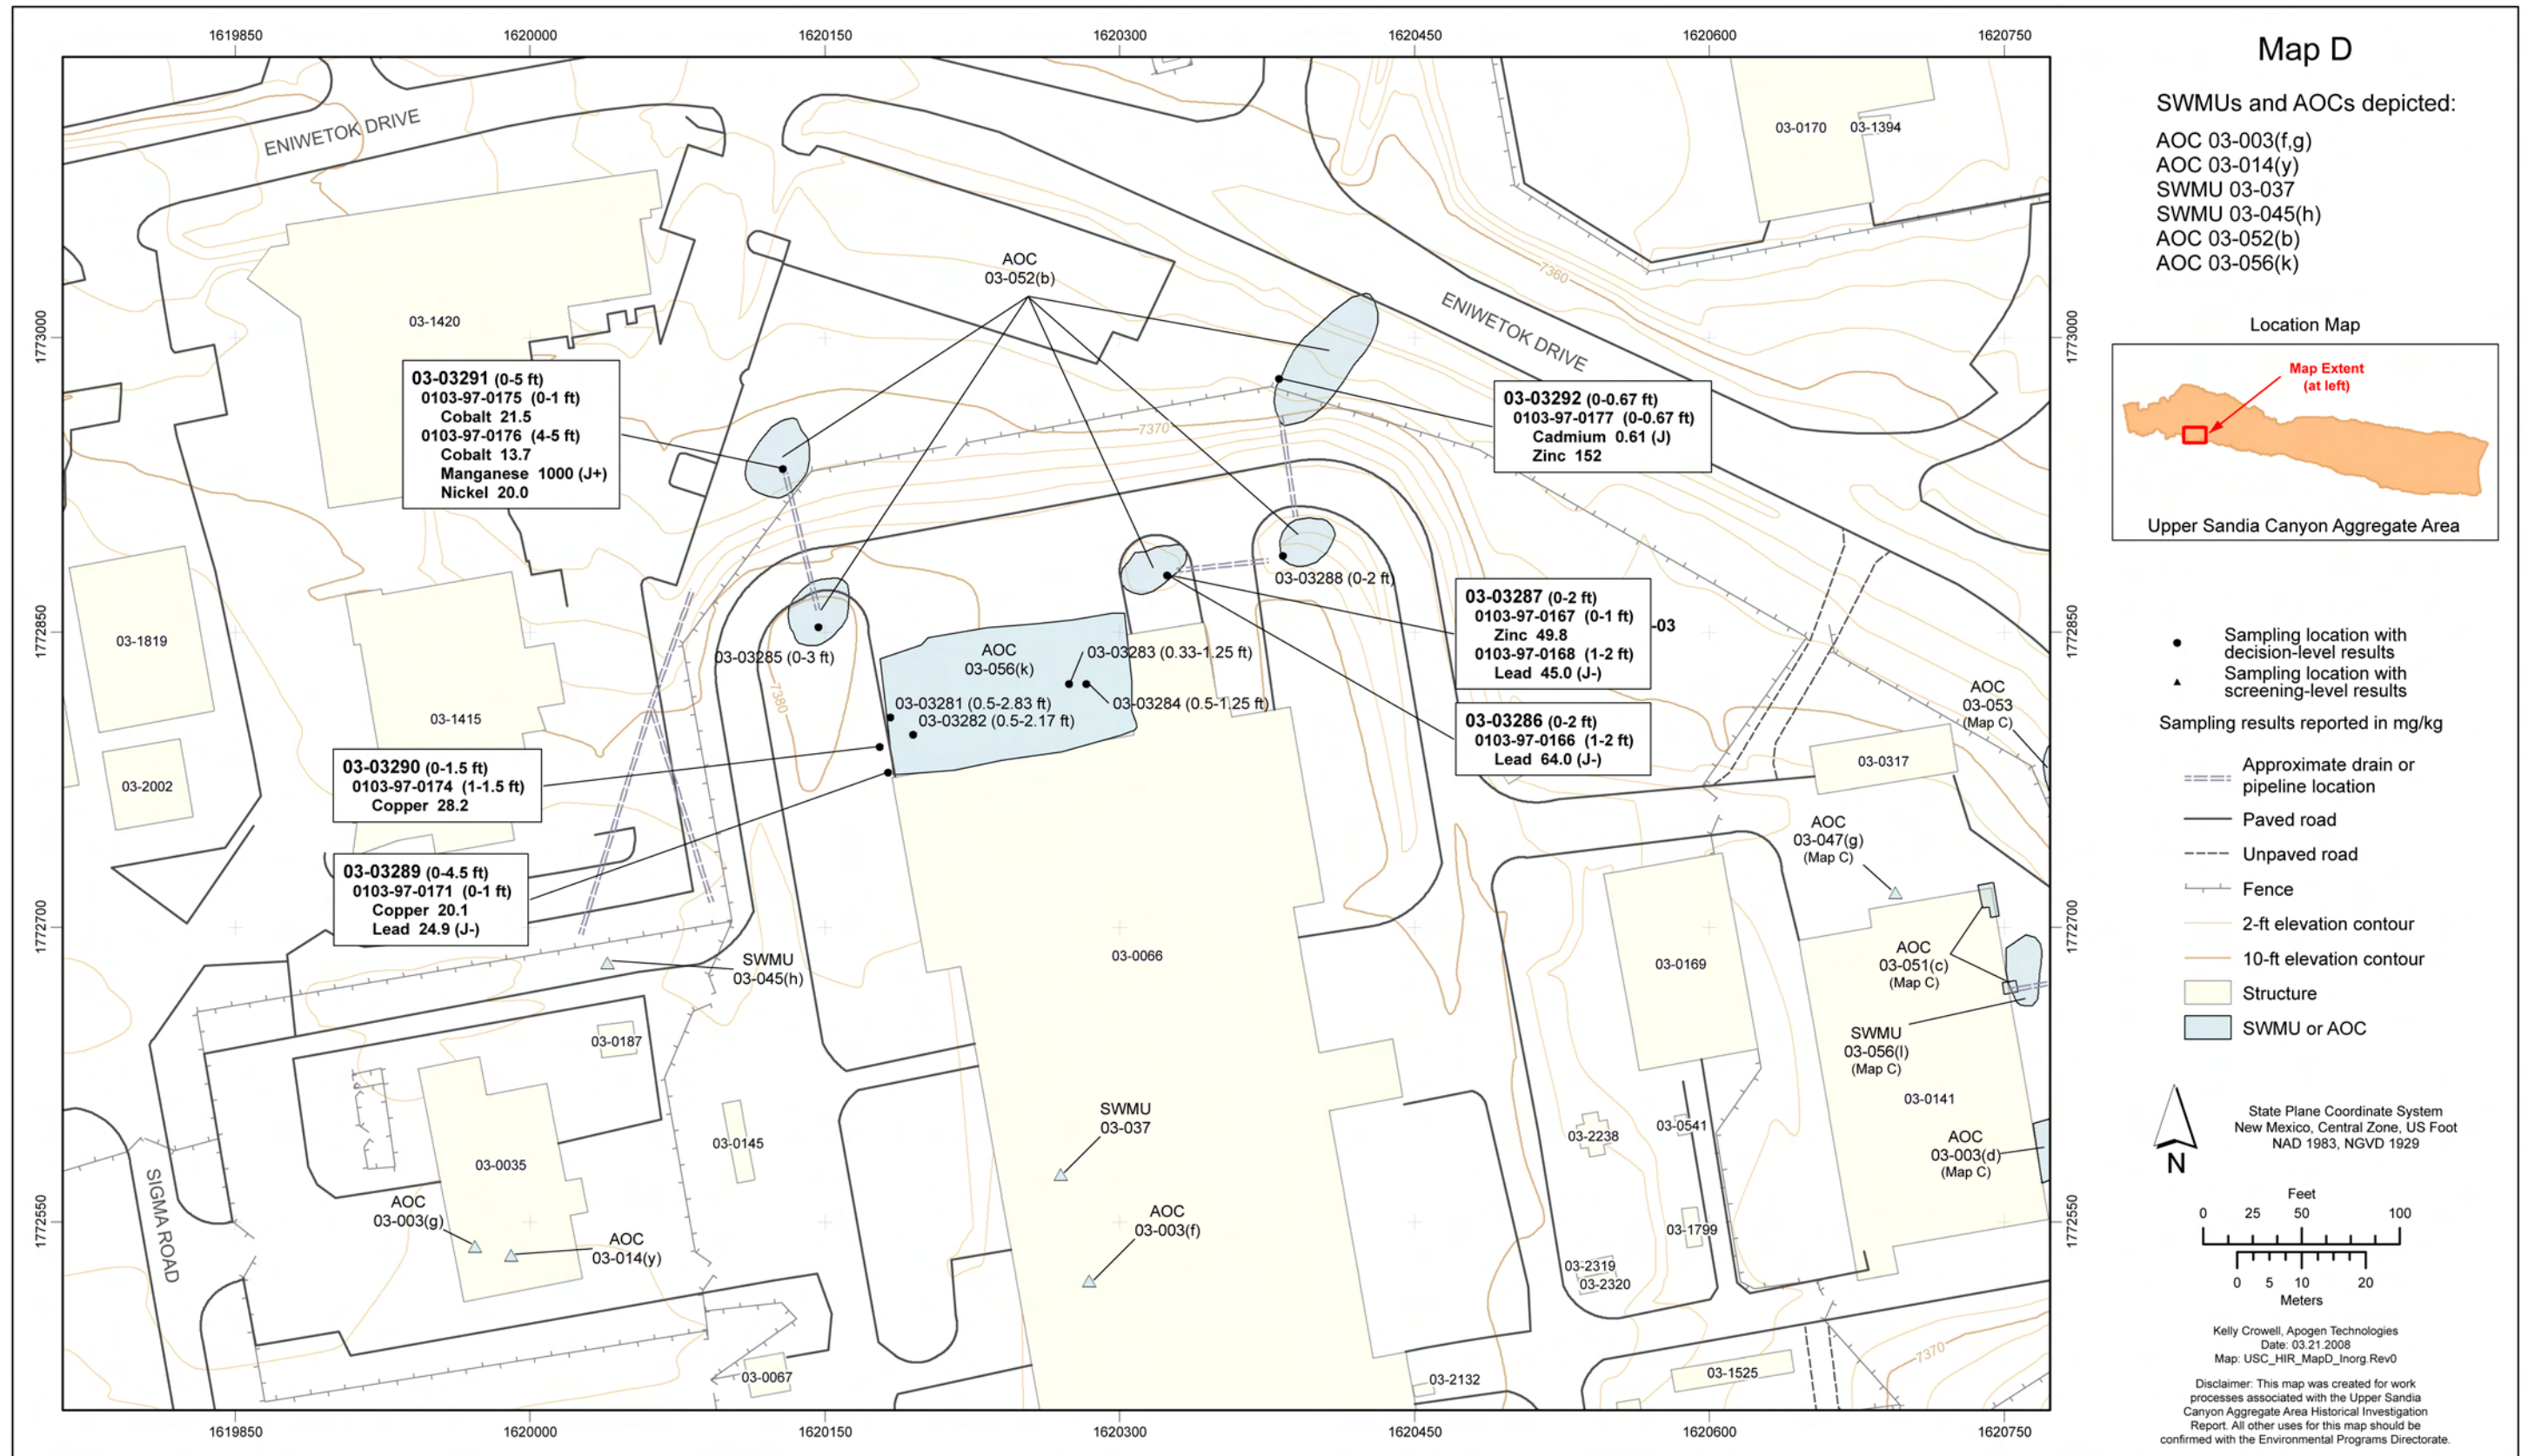


Figure 4.1-14 Map D inorganic chemical sampling locations and results detected above BVs



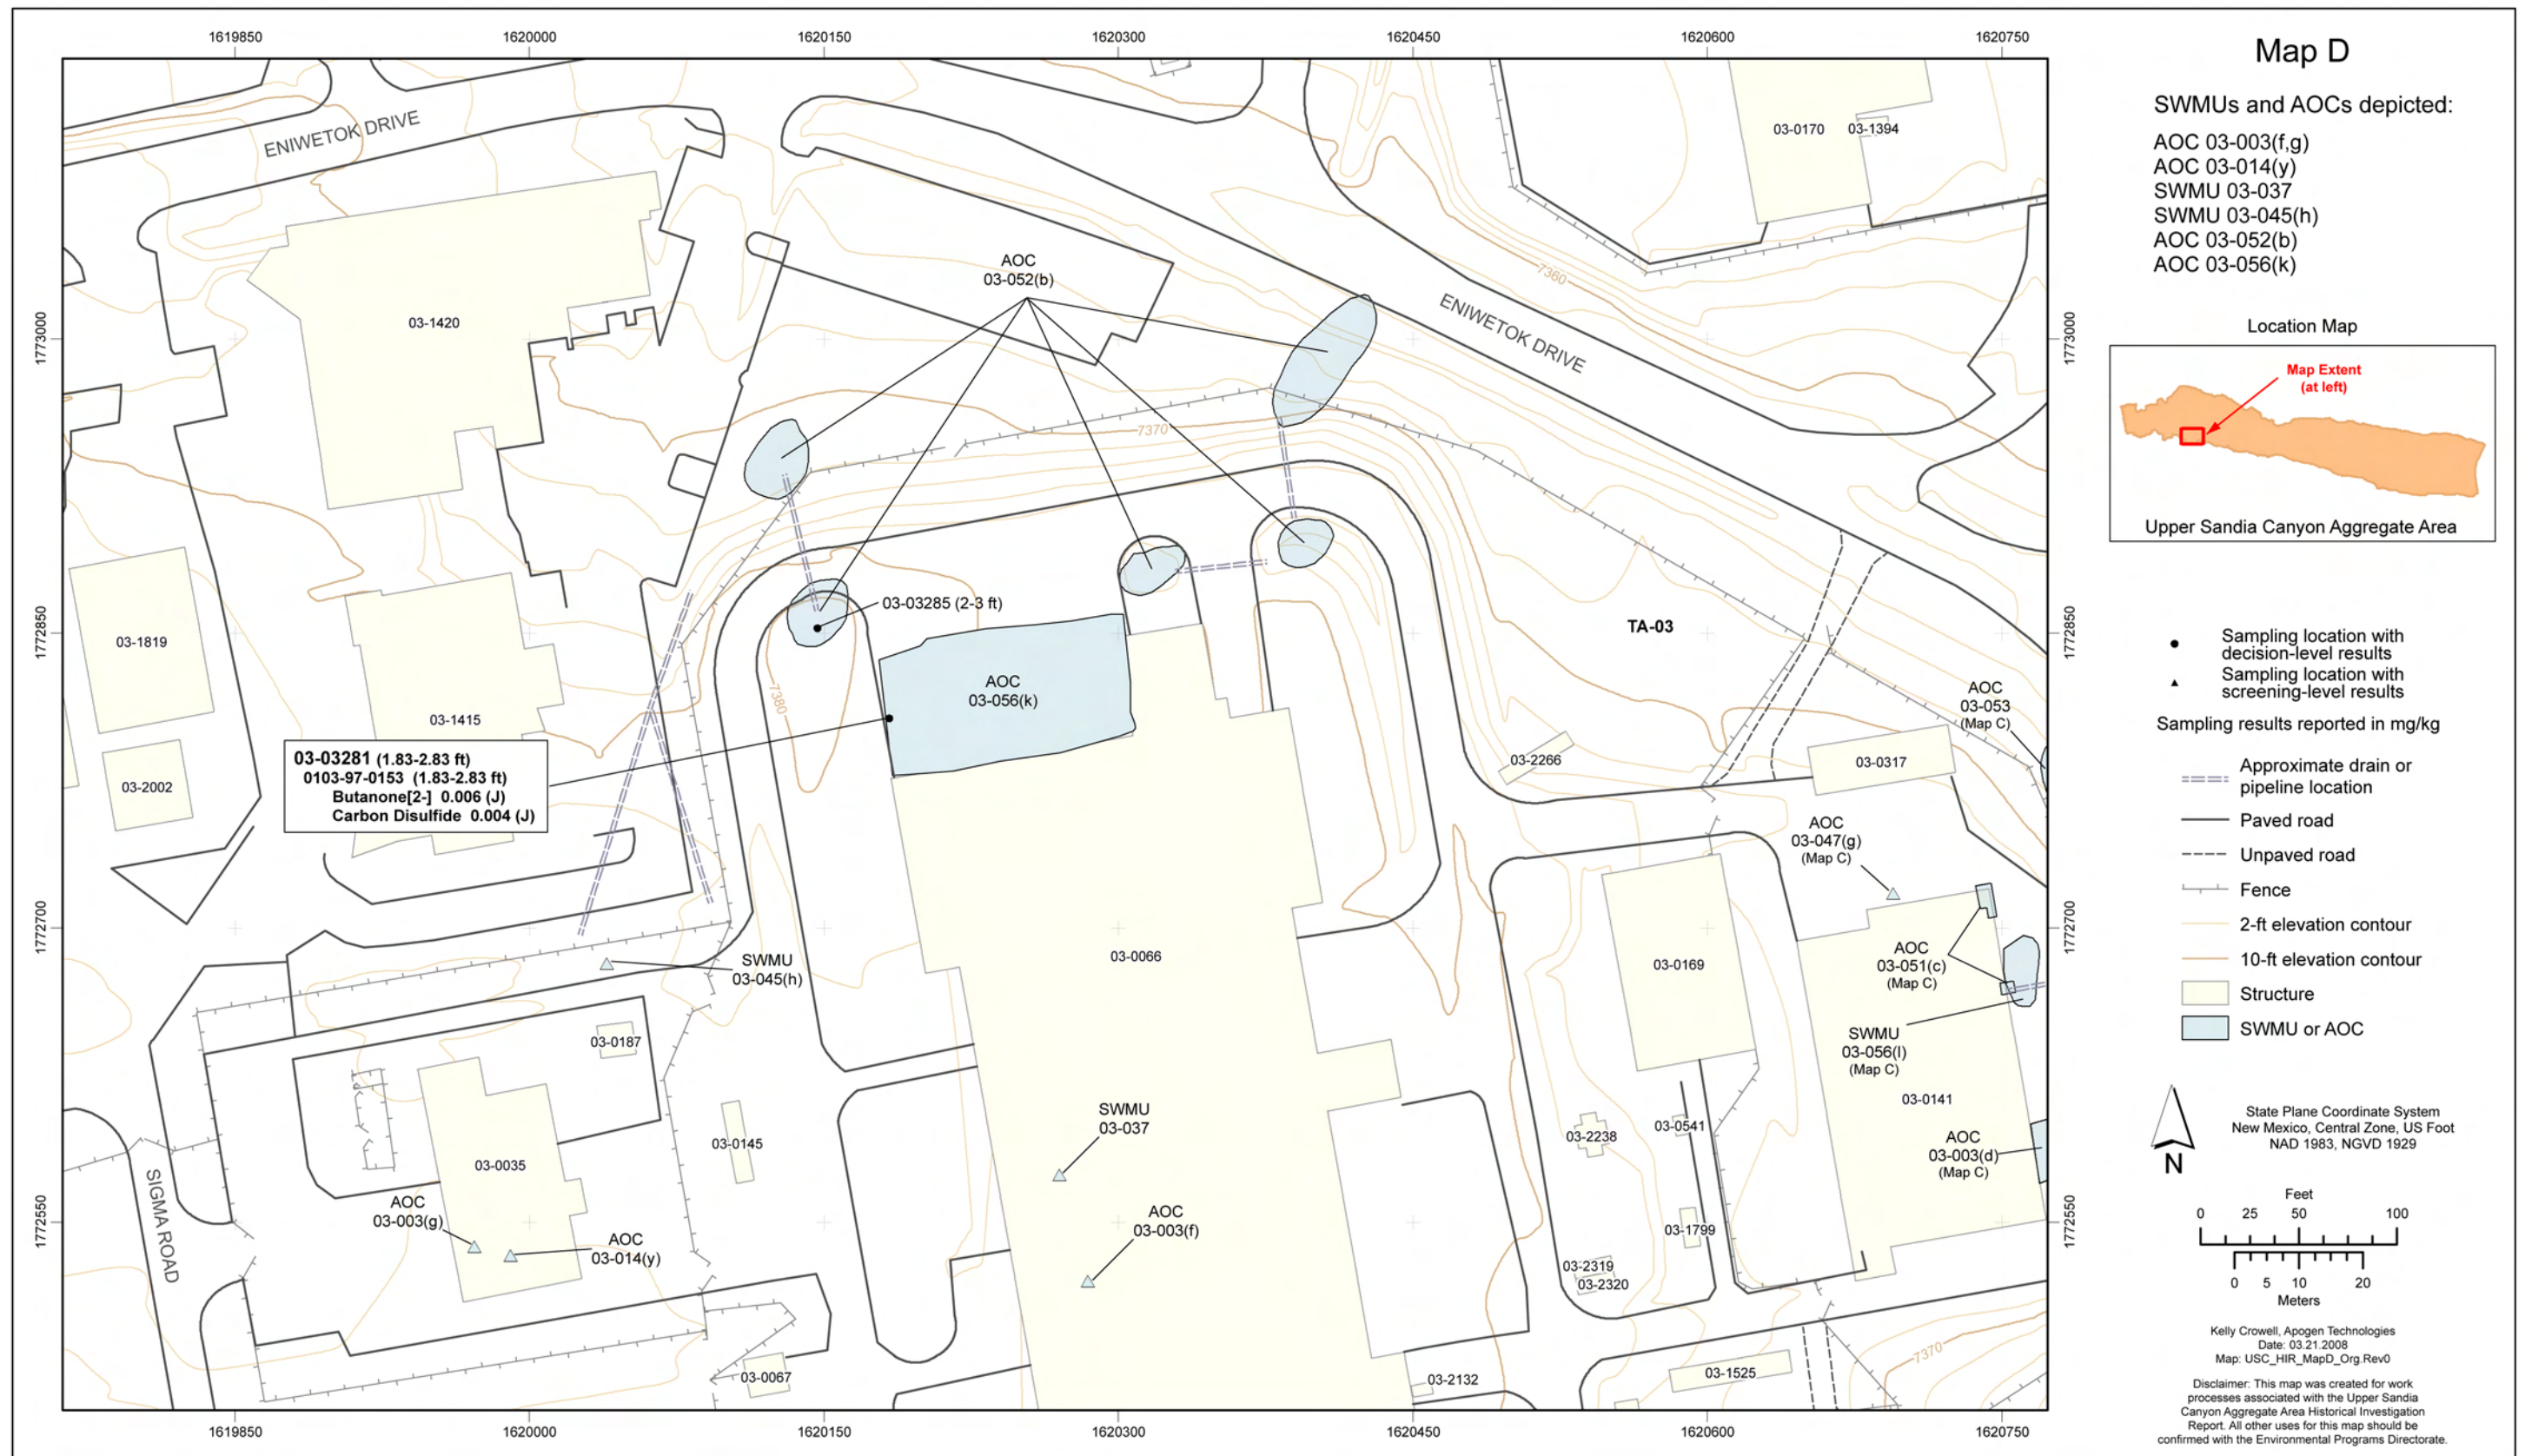


Figure 4.1-15 Map D organic chemical sampling locations and detected results



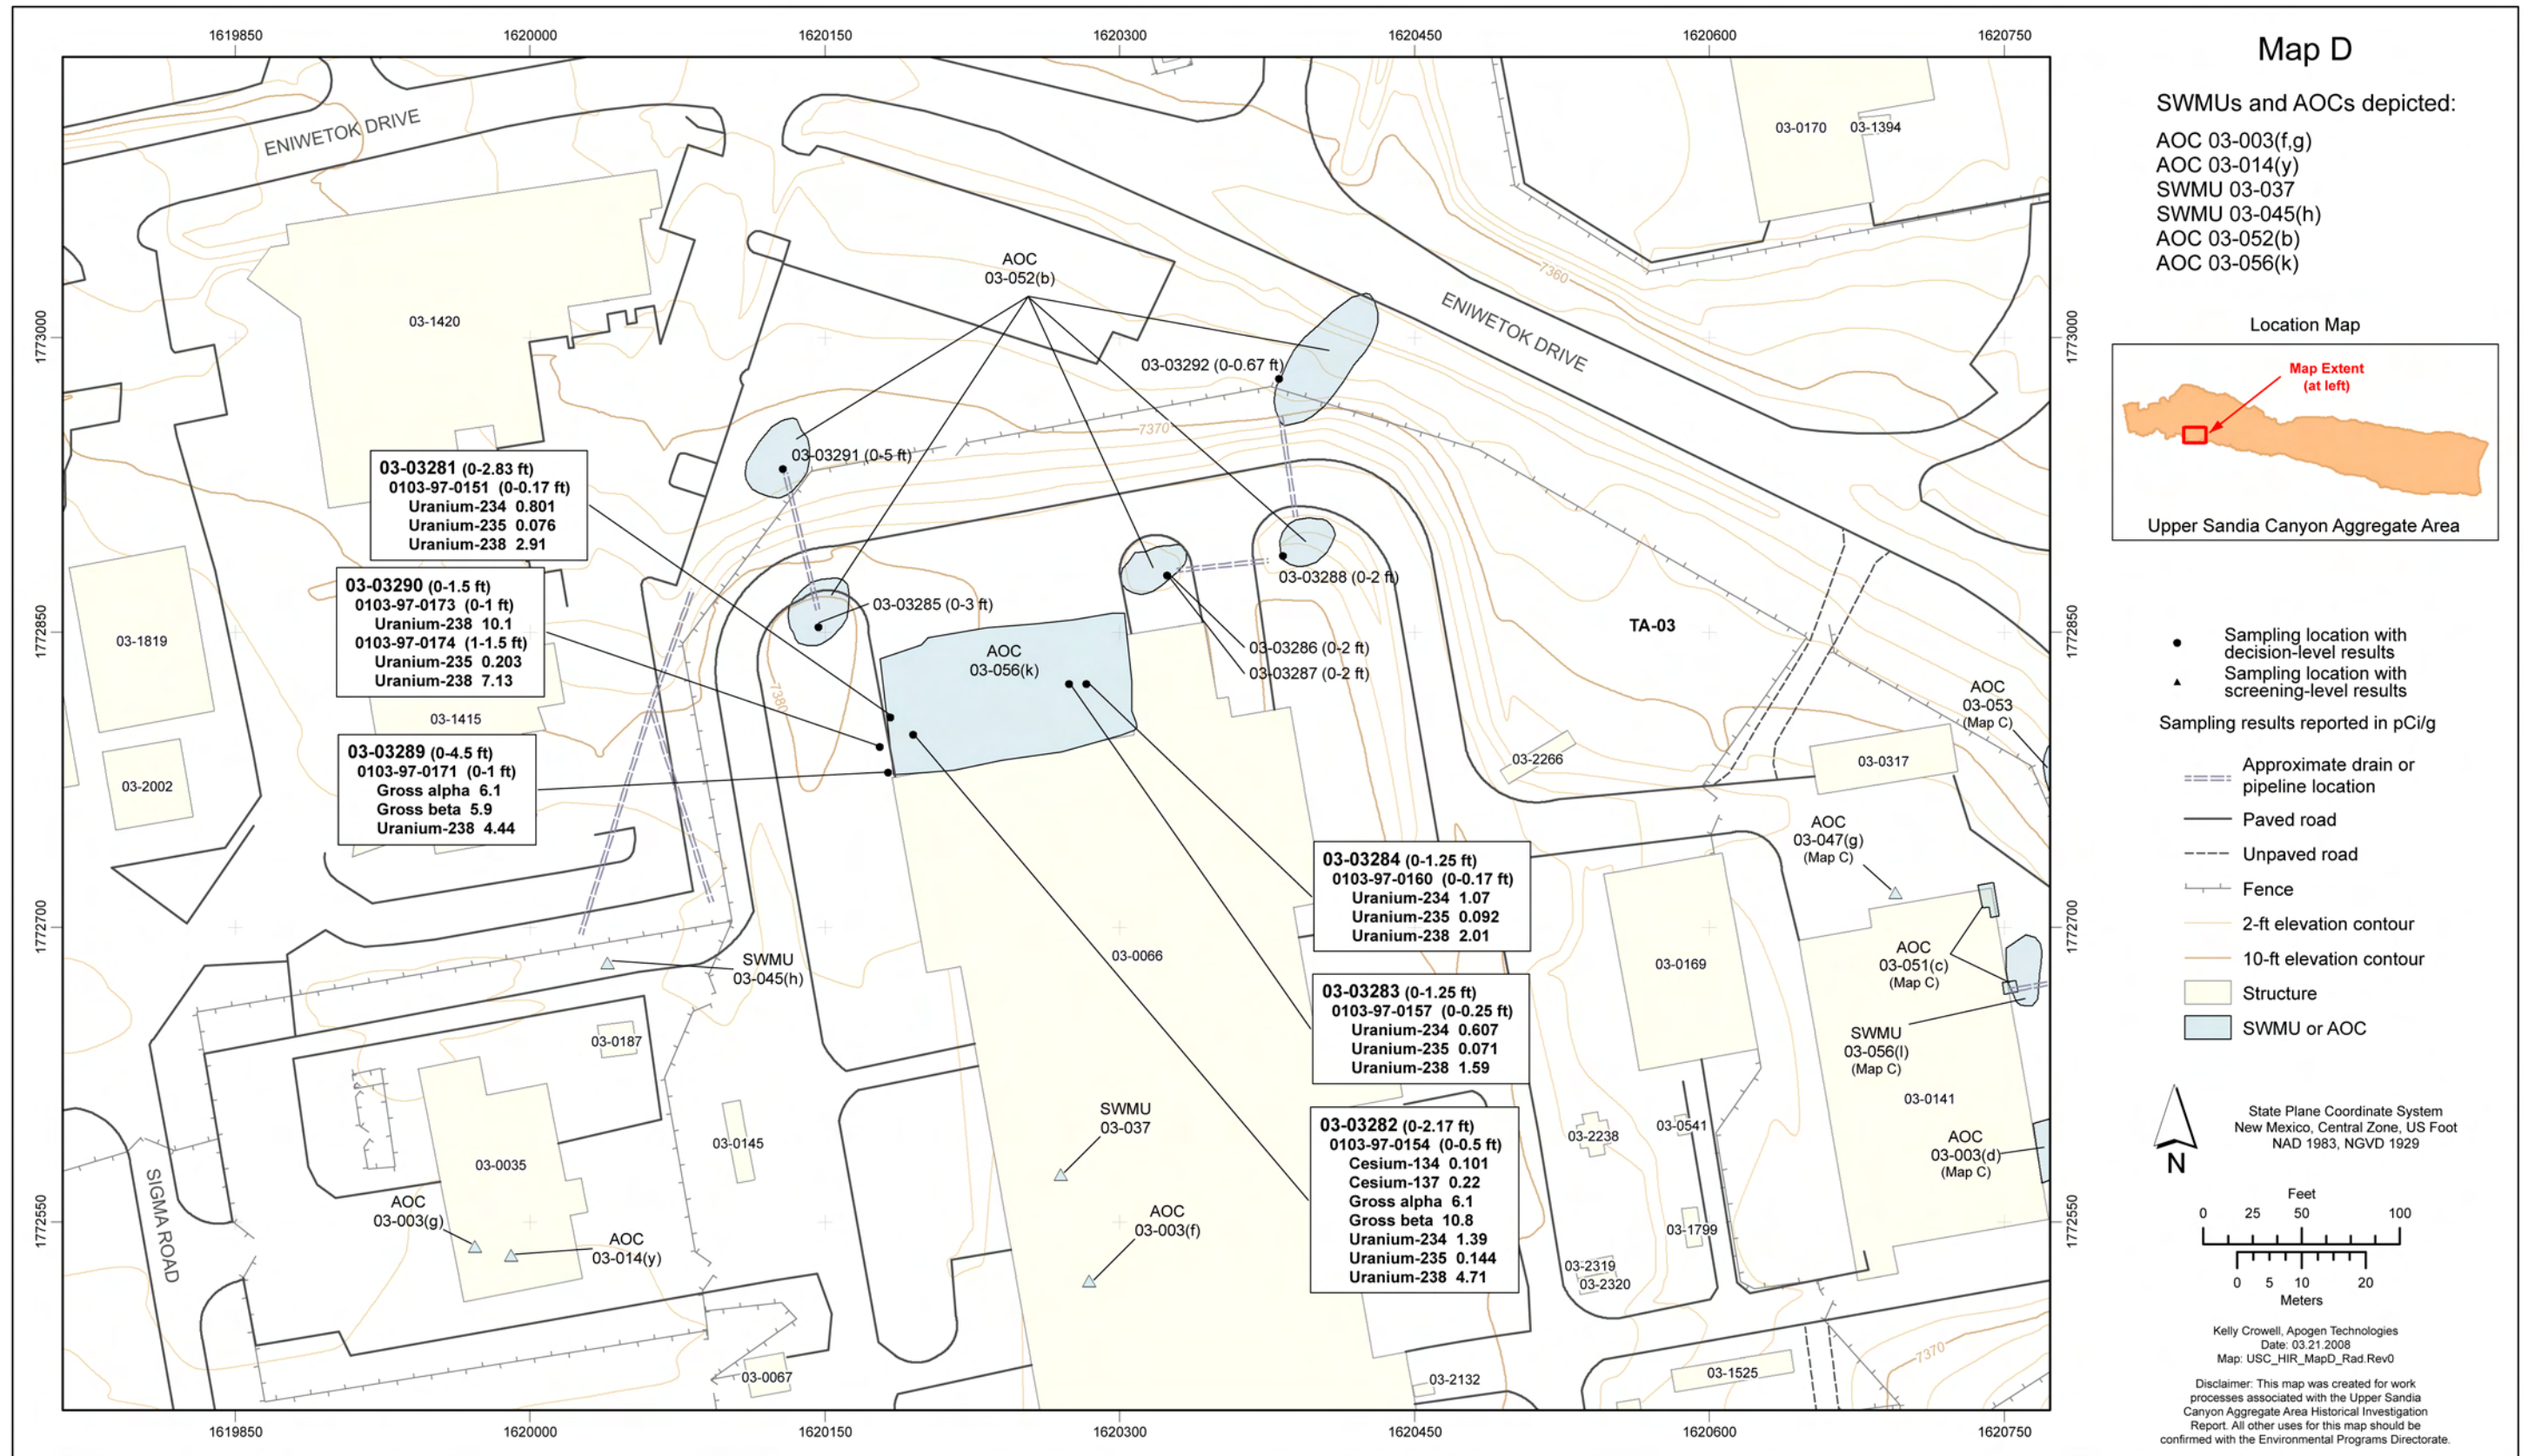


Figure 4.1-16 Map D radionuclide sampling locations and results detected above FVs/BVs



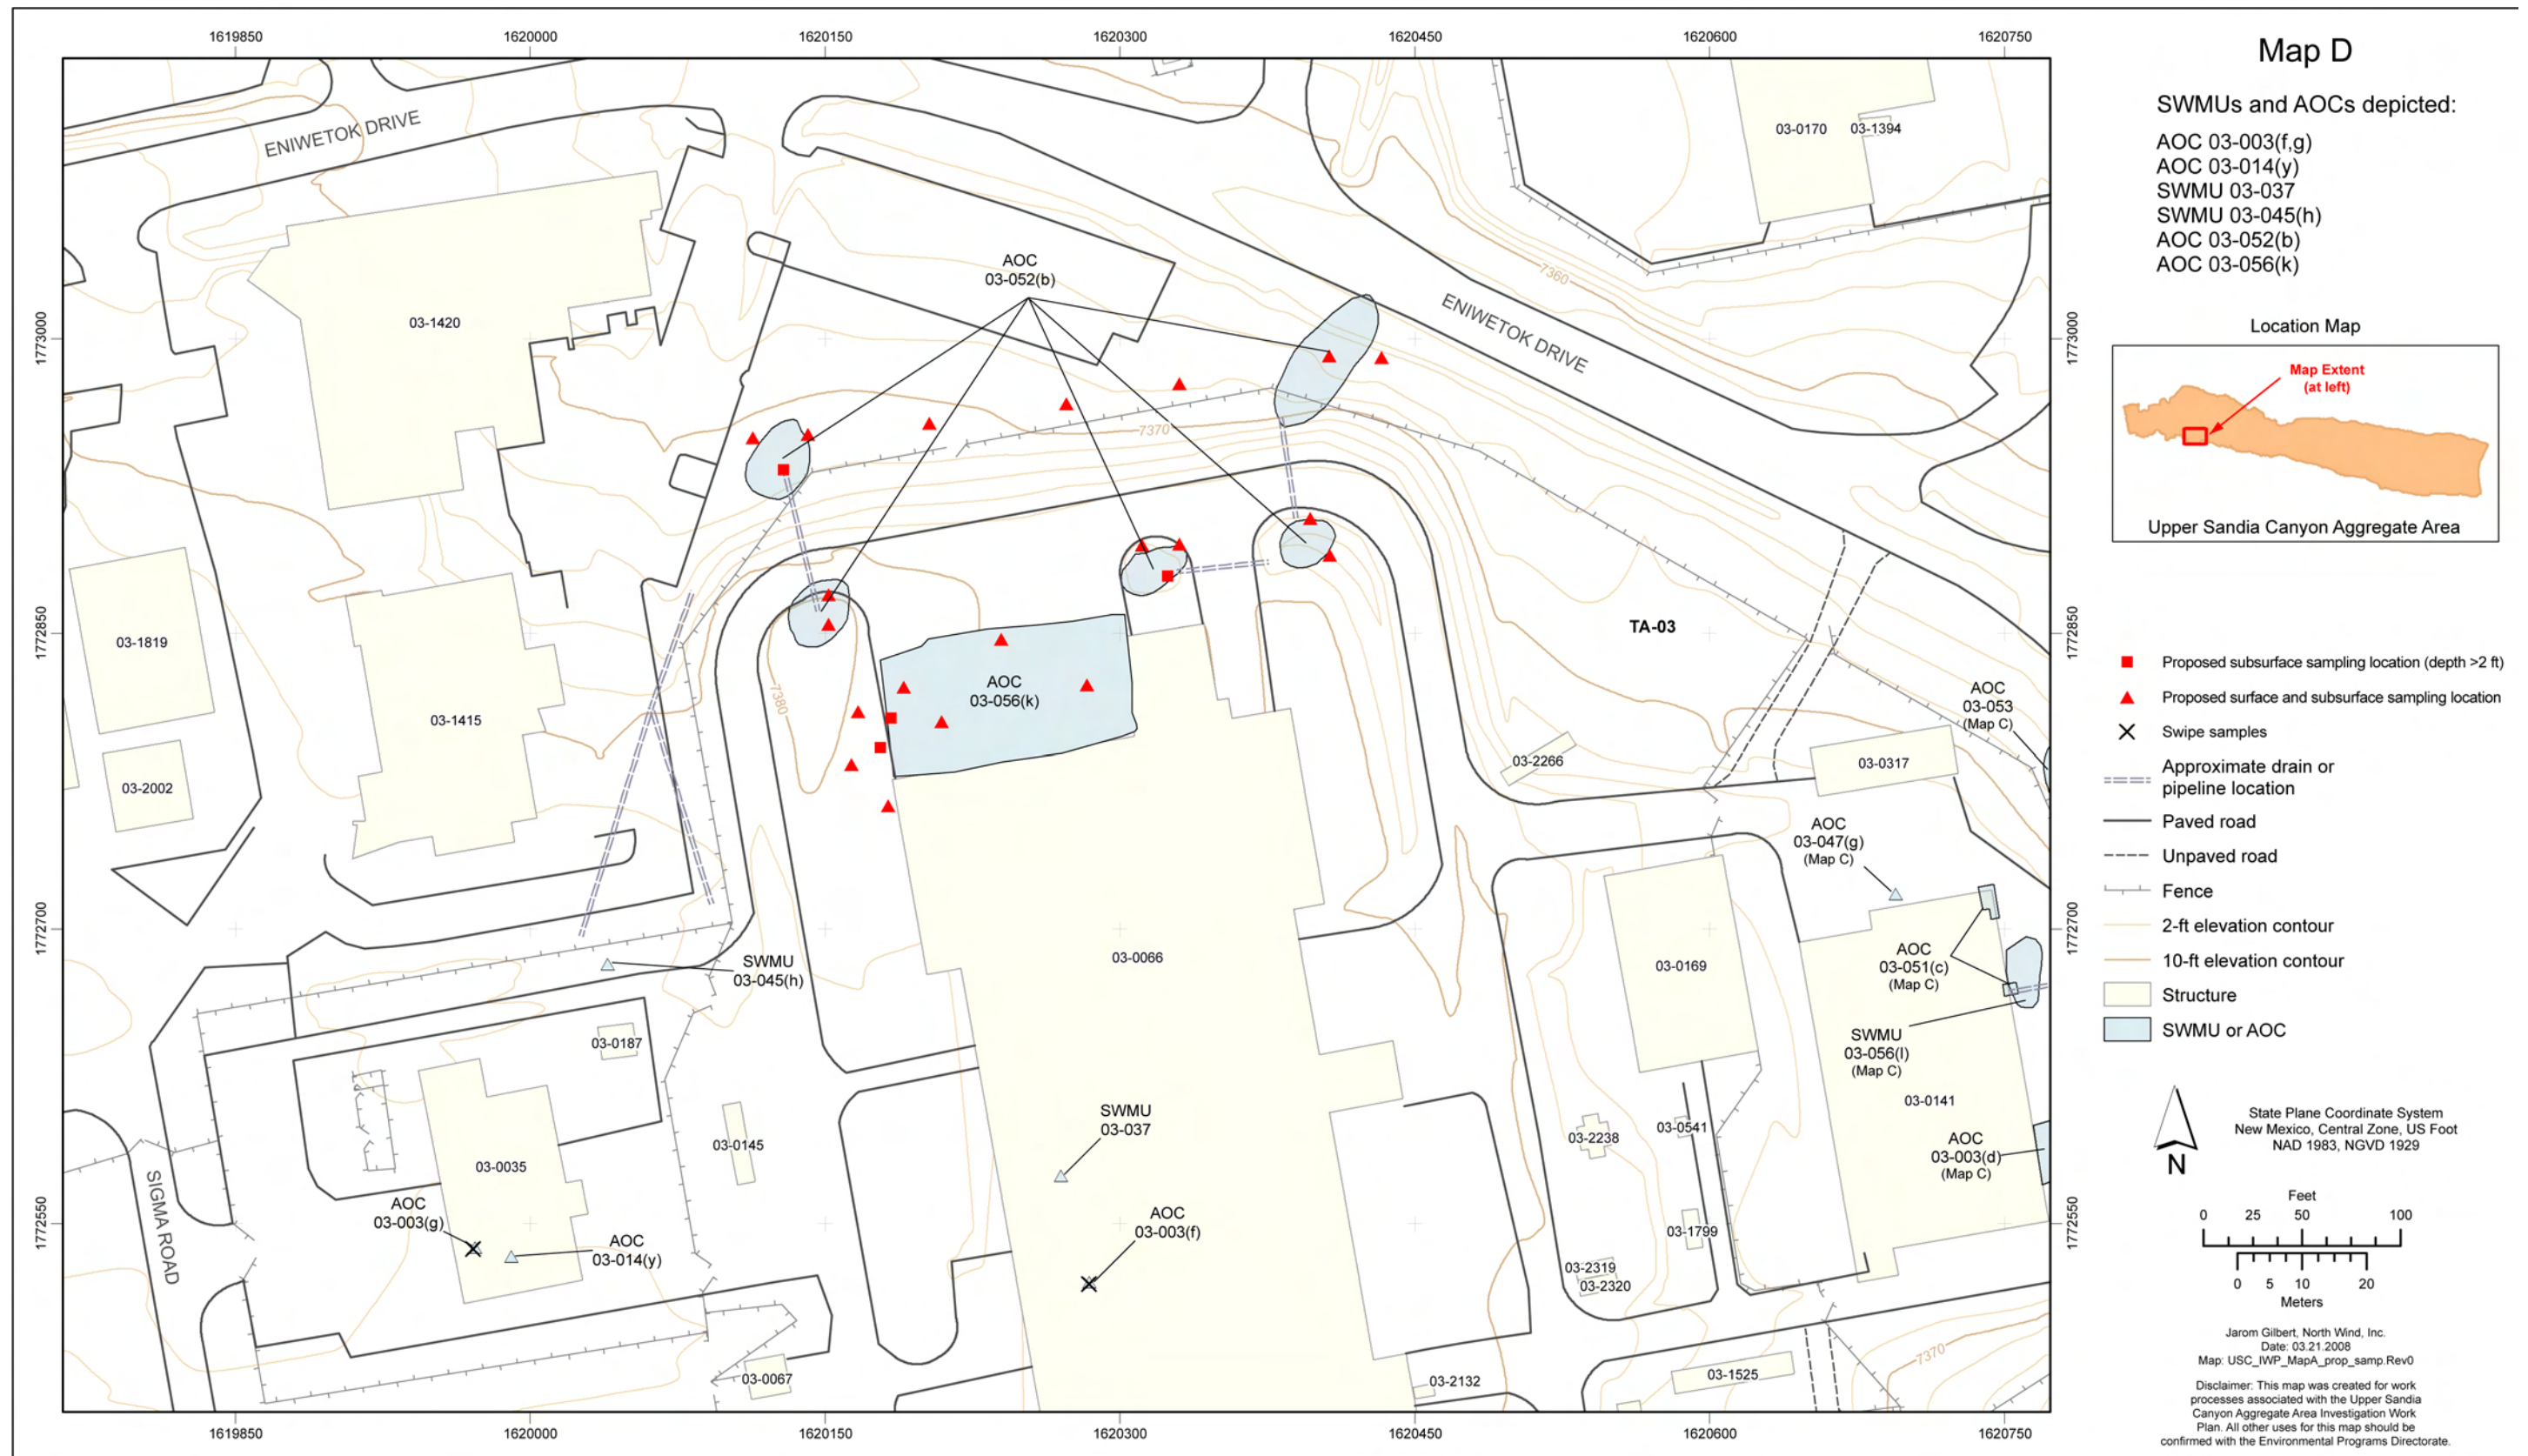


Figure 4.1-17 Map D proposed sampling locations



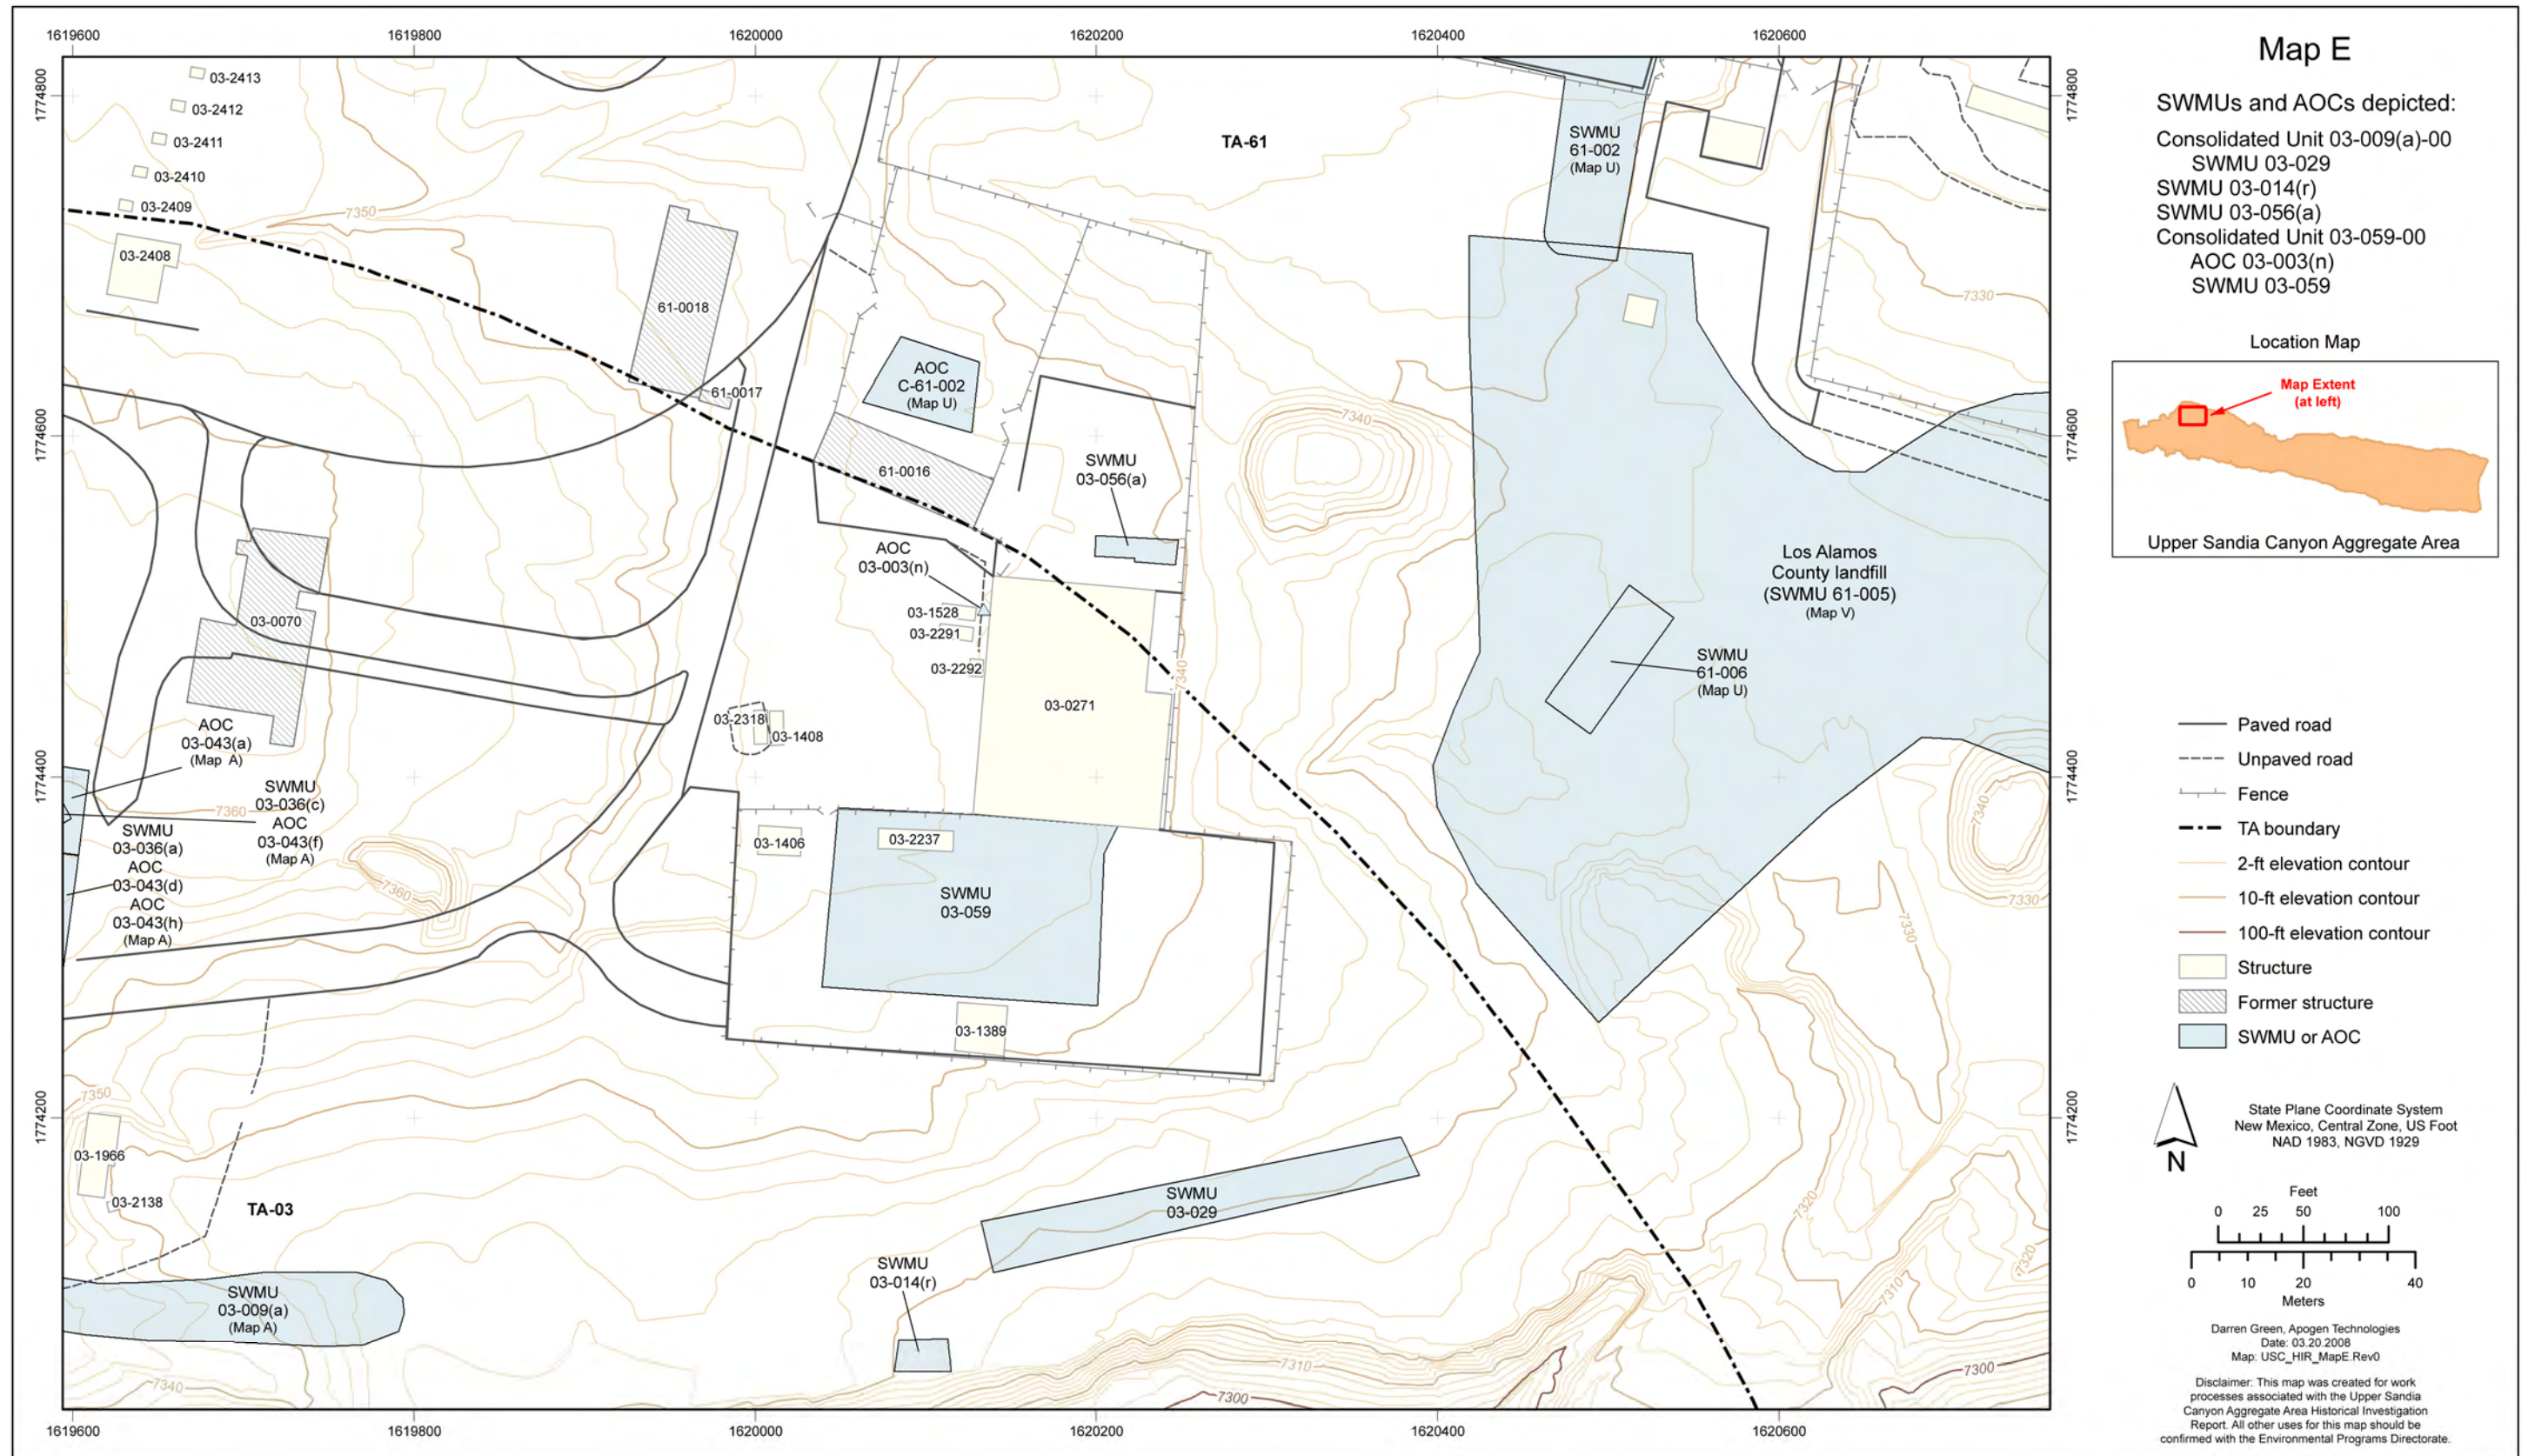


Figure 4.1-18 Map E site location



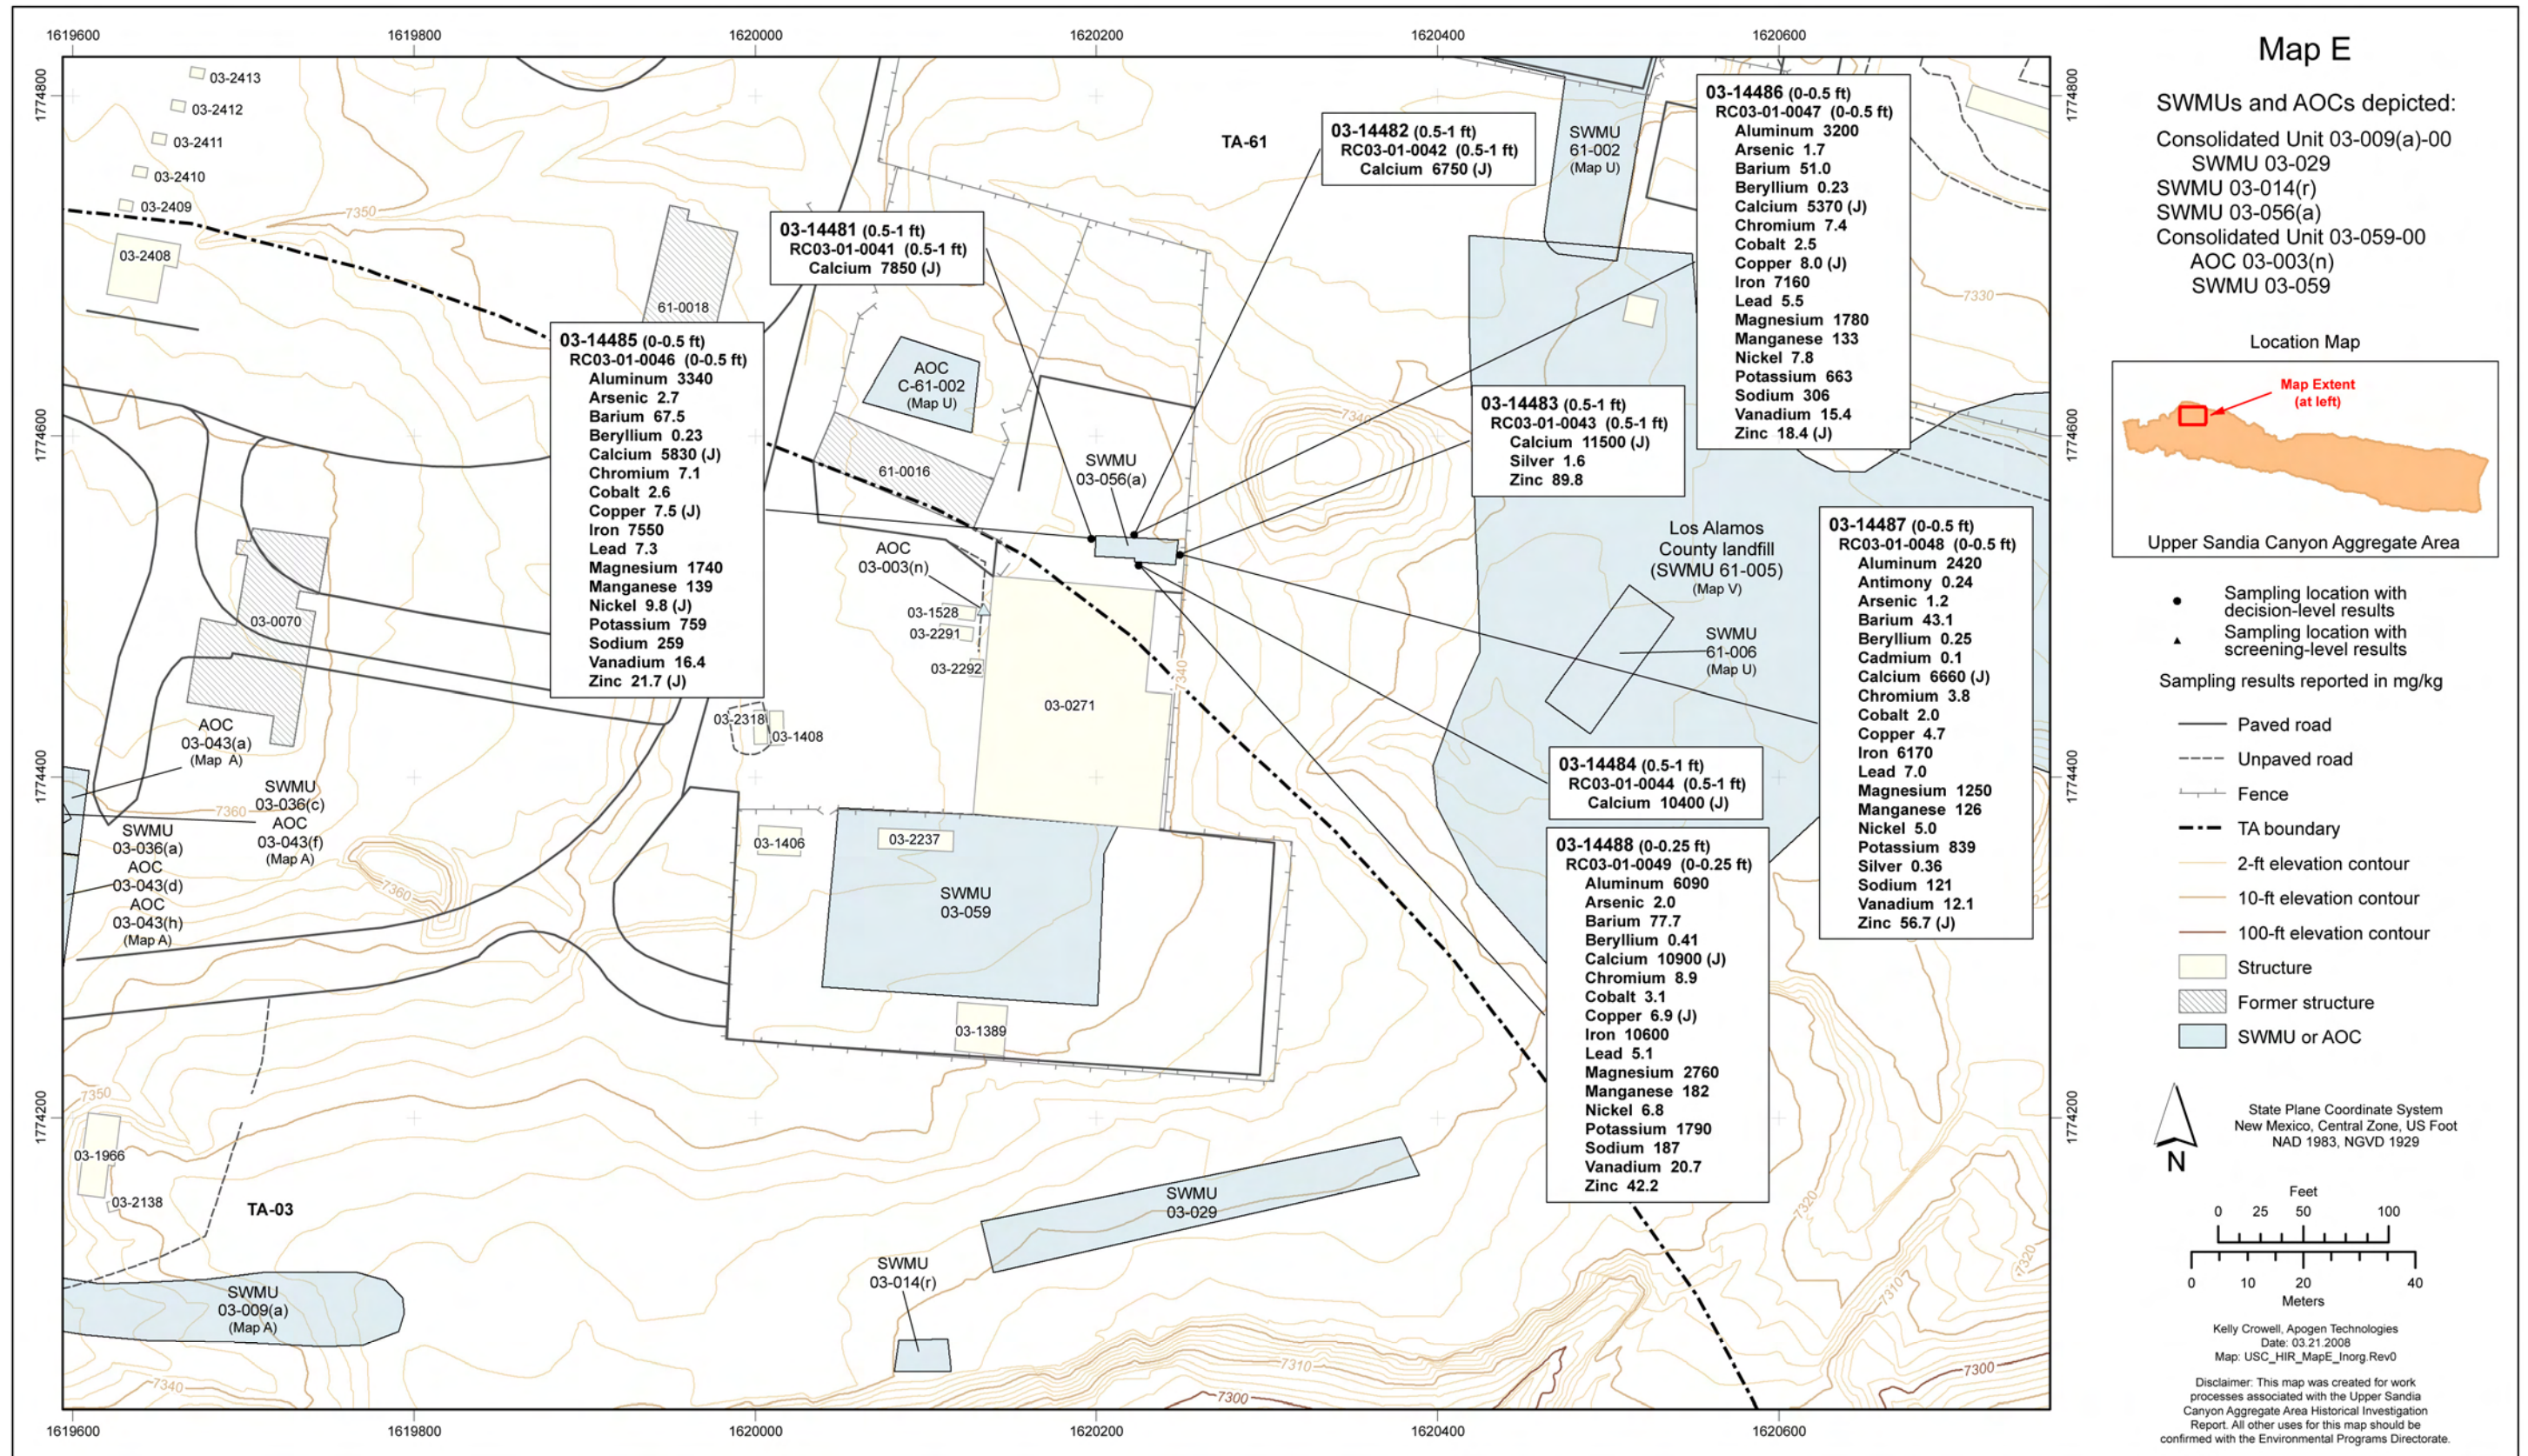


Figure 4.1-19 Map E inorganic chemical sampling locations and results detected above BVs



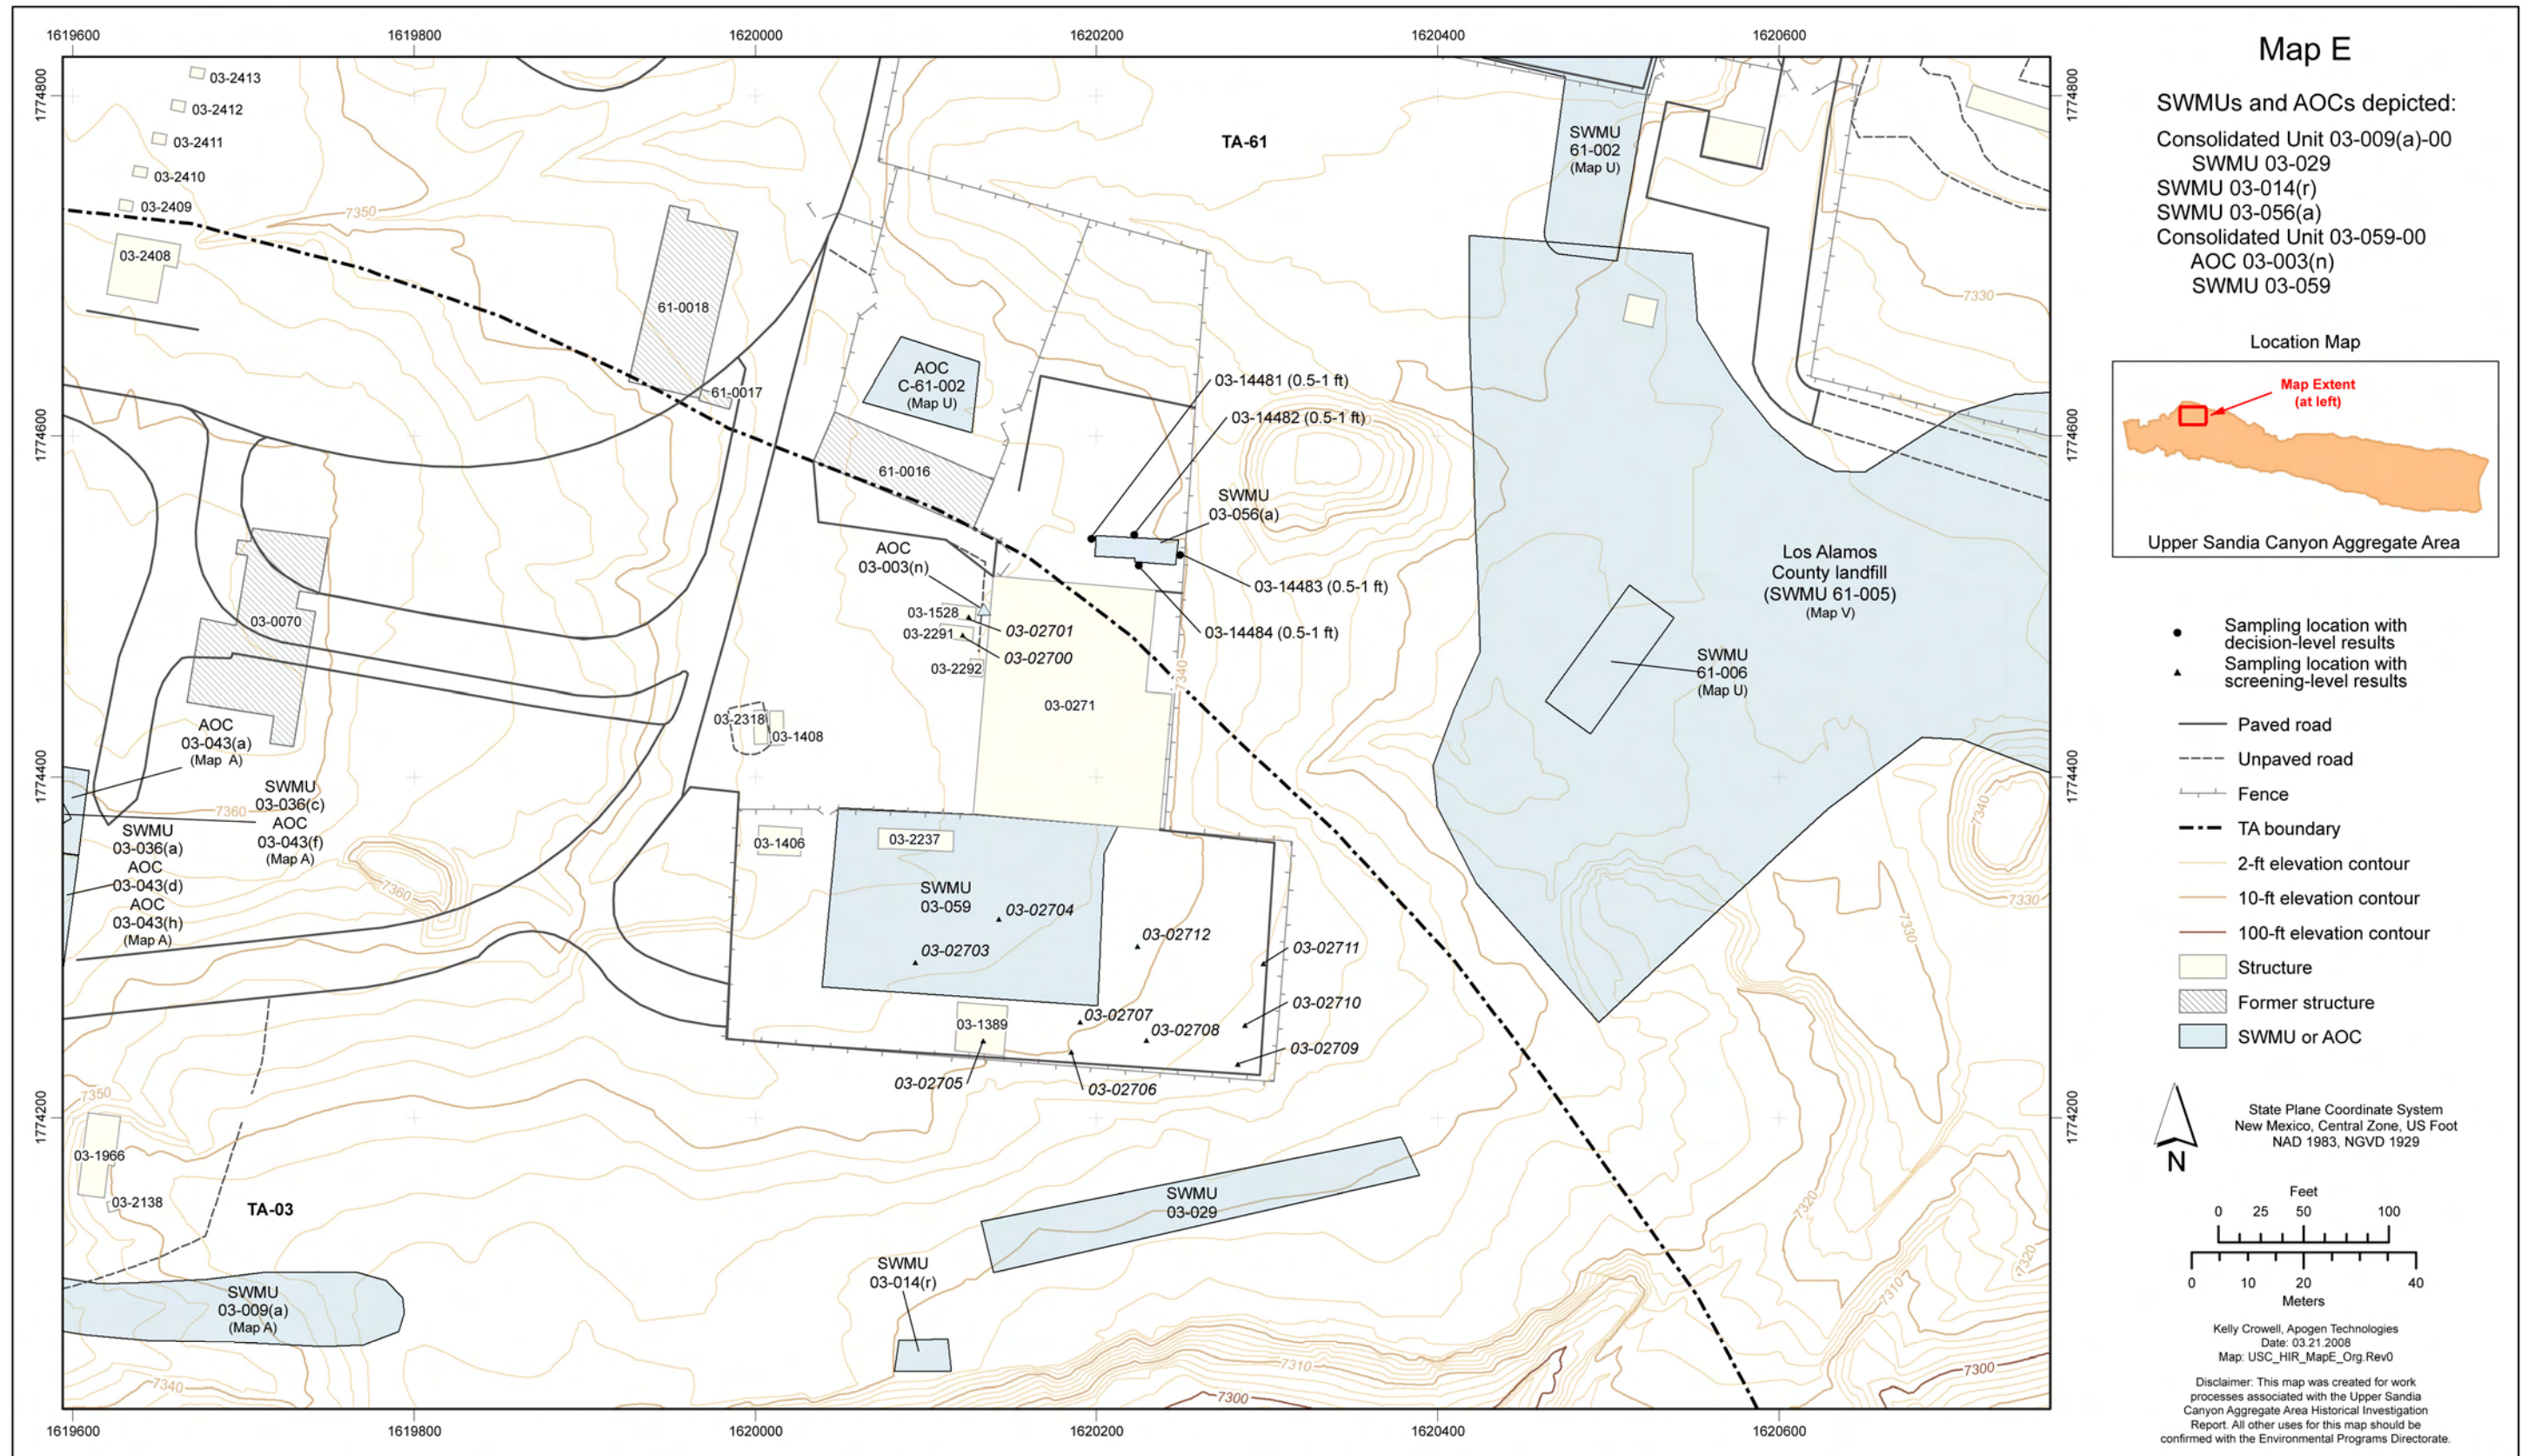


Figure 4.1-20 Map E organic chemical sampling locations



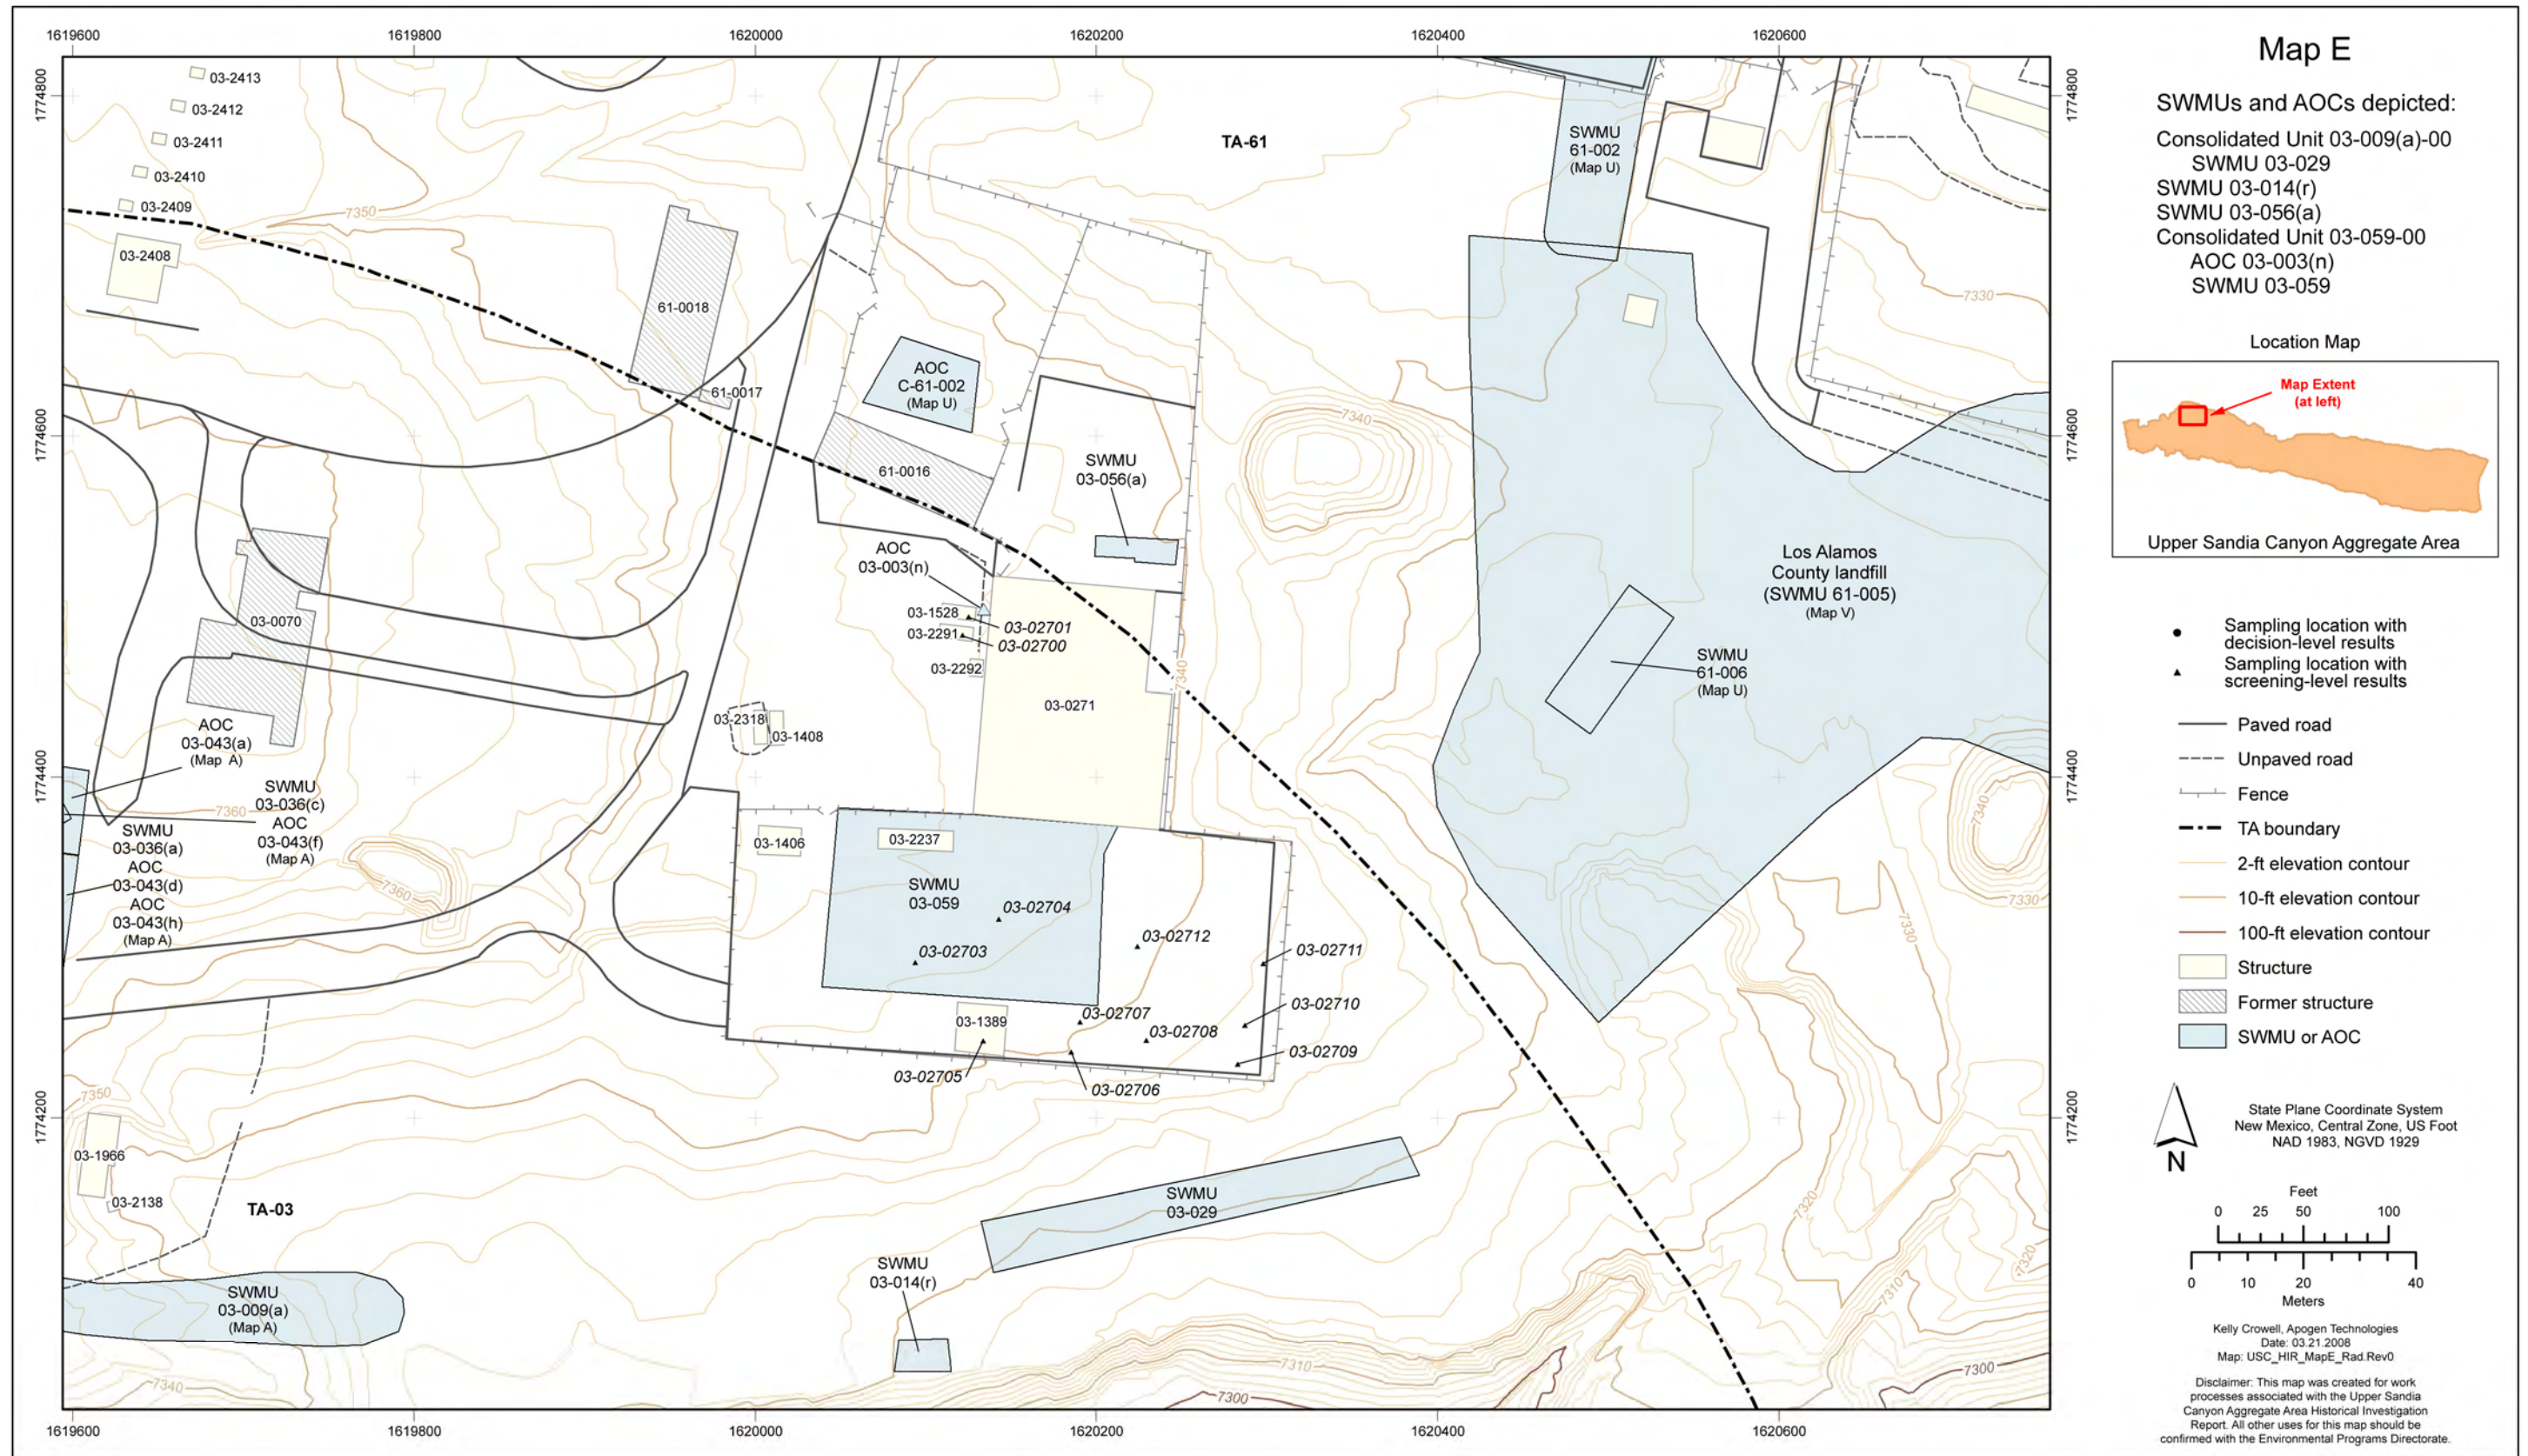


Figure 4.1-21 Map E radionuclide sampling locations



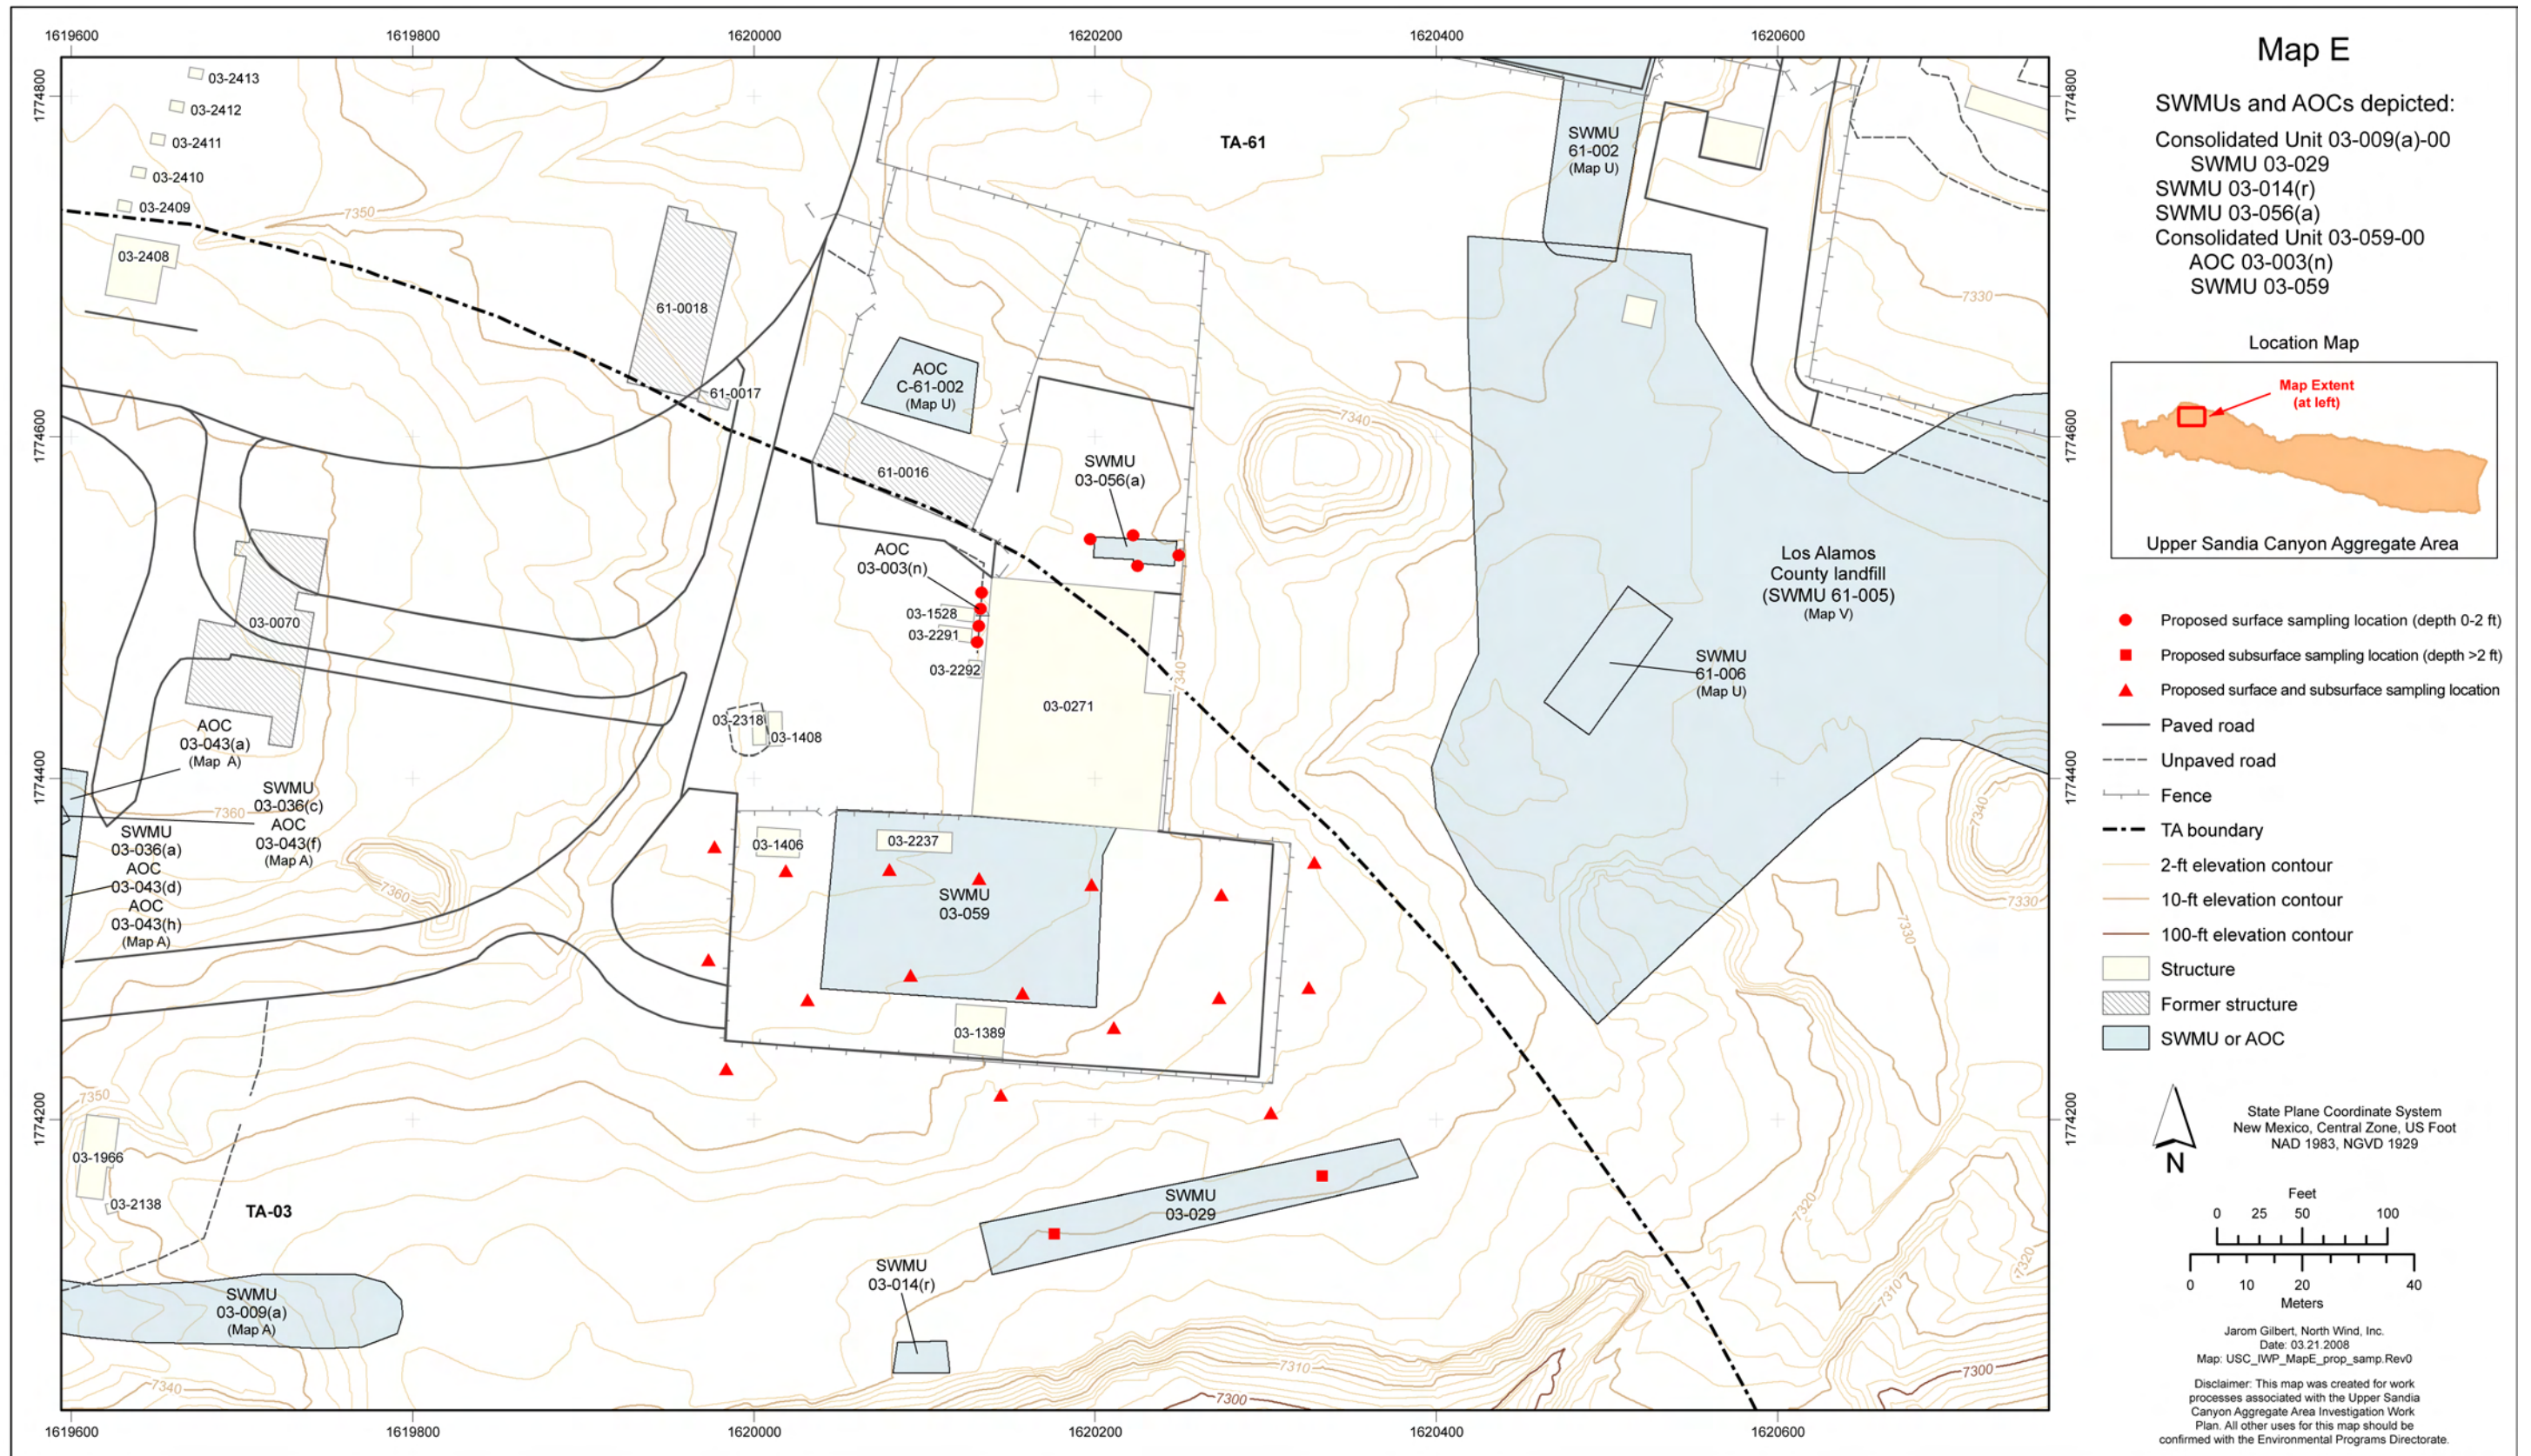


Figure 4.1-22 Map E proposed sampling locations



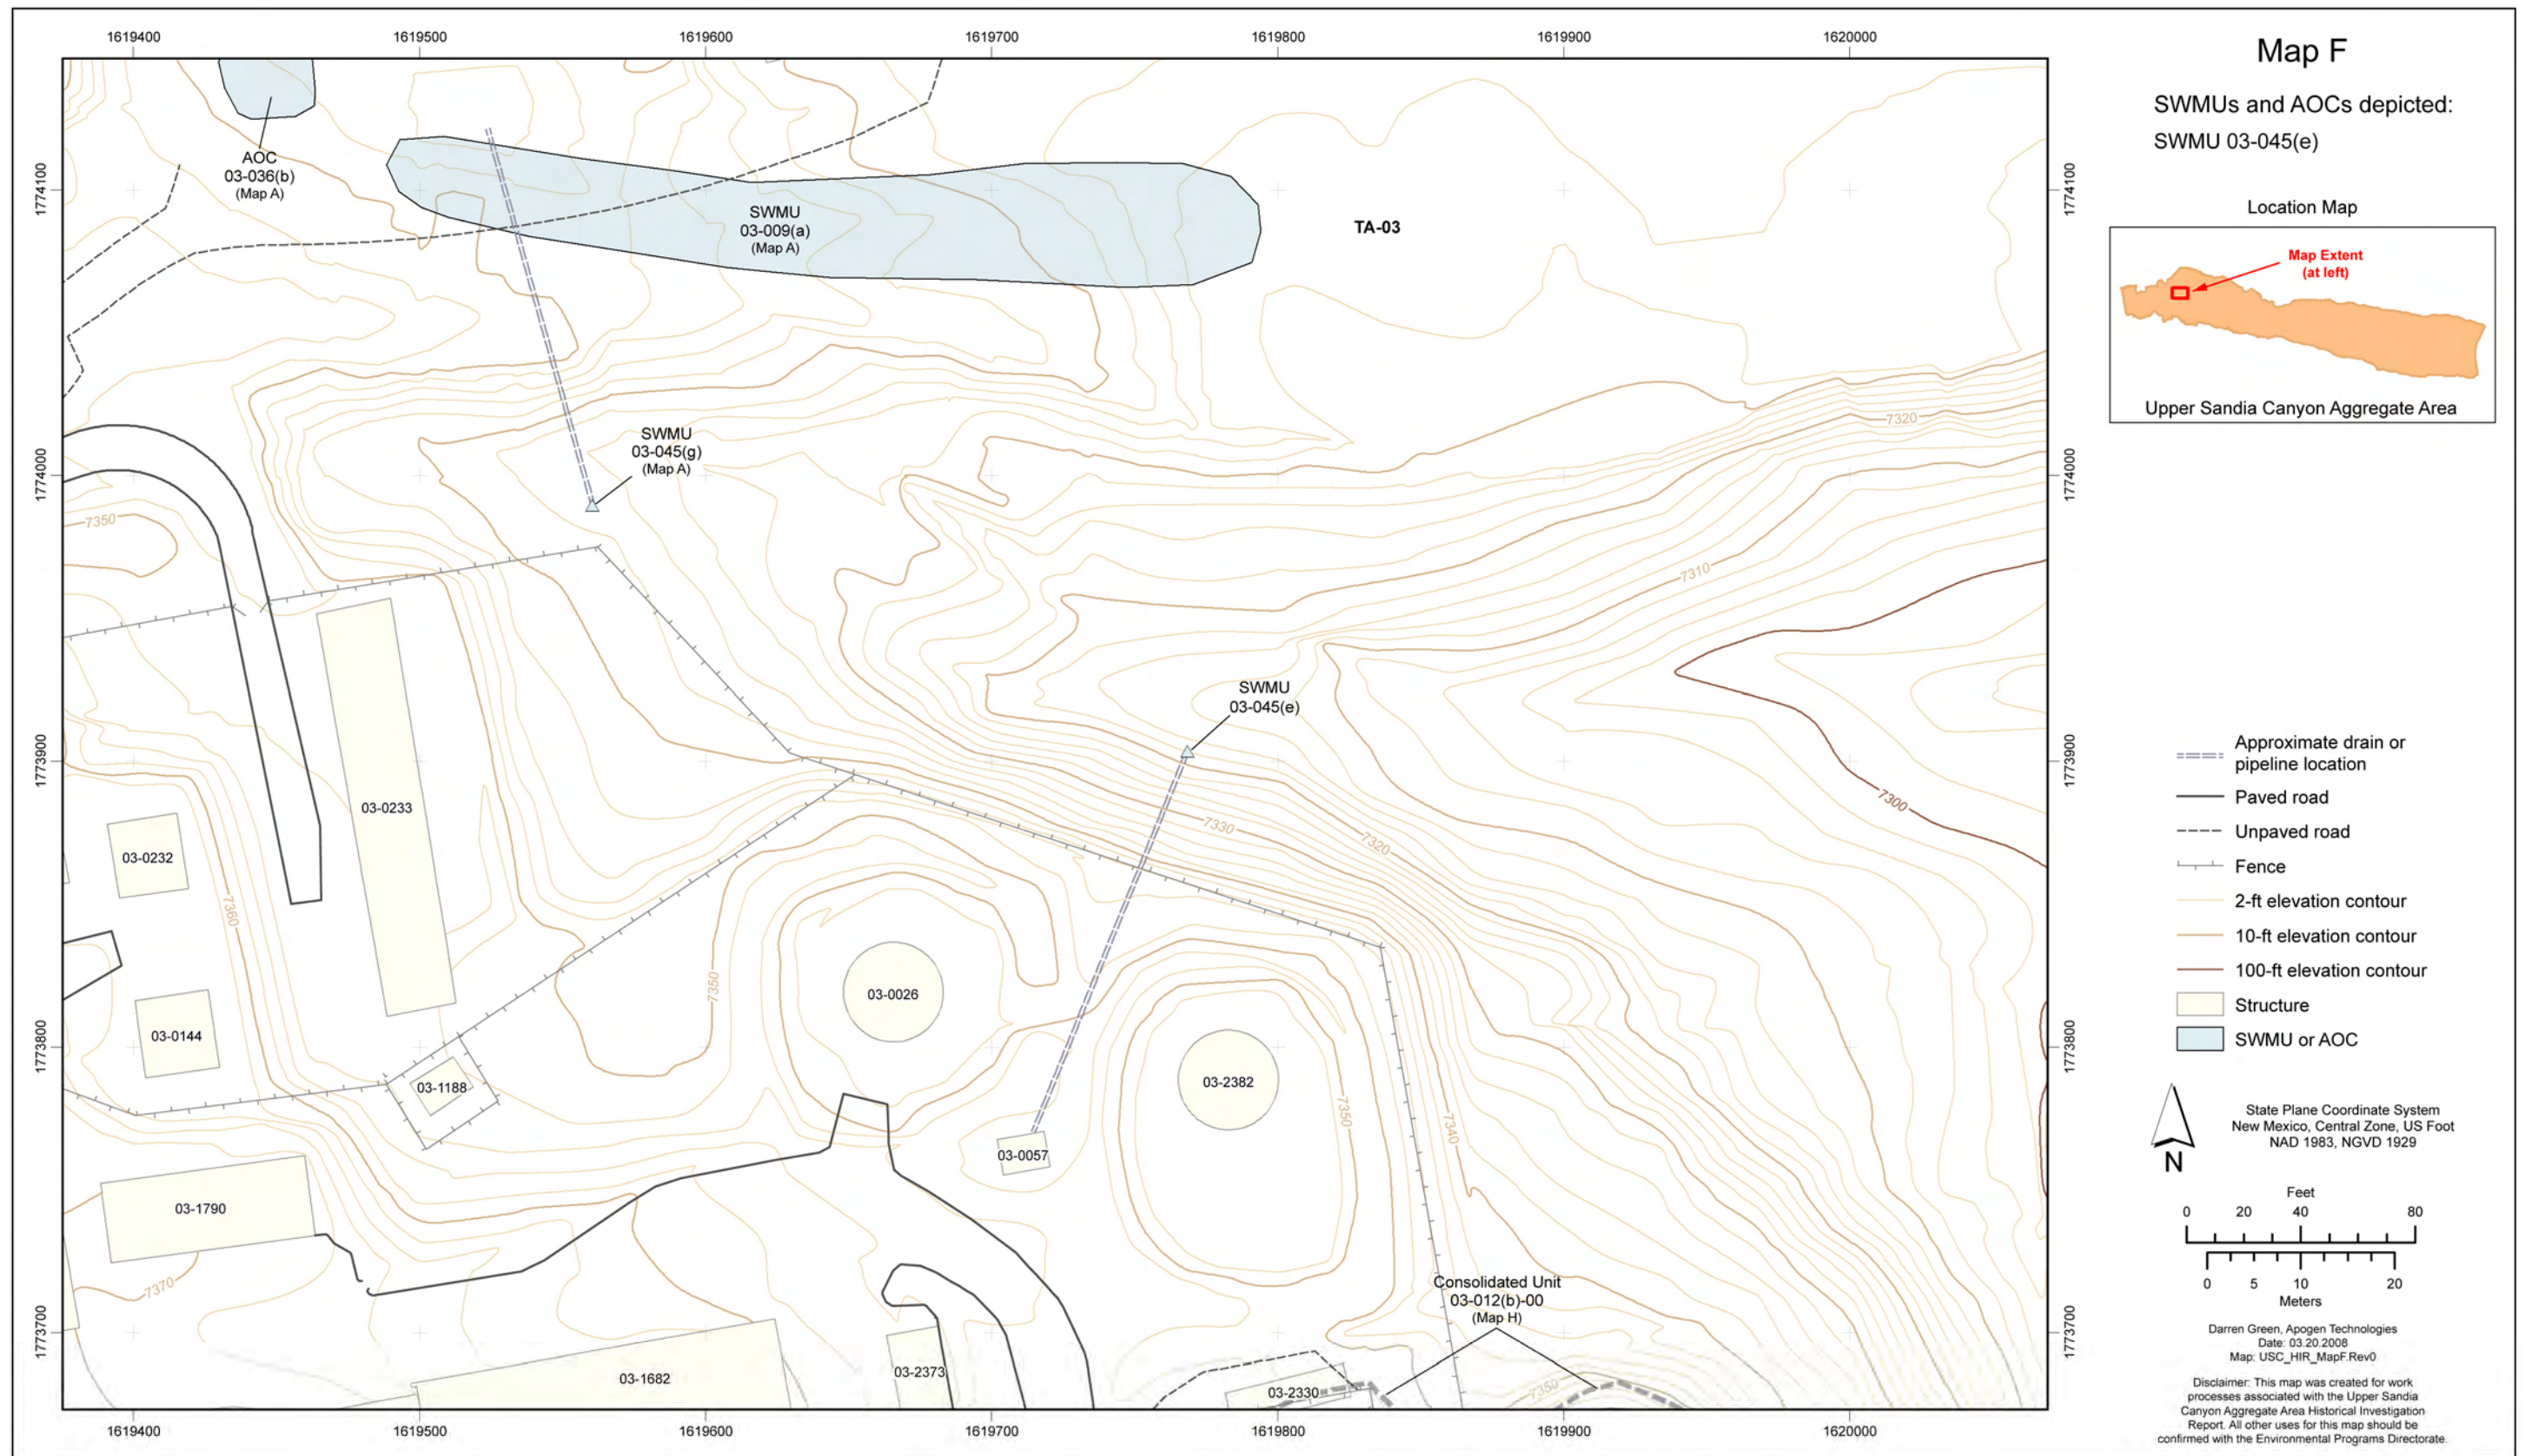


Figure 4.1-23 Map F site location



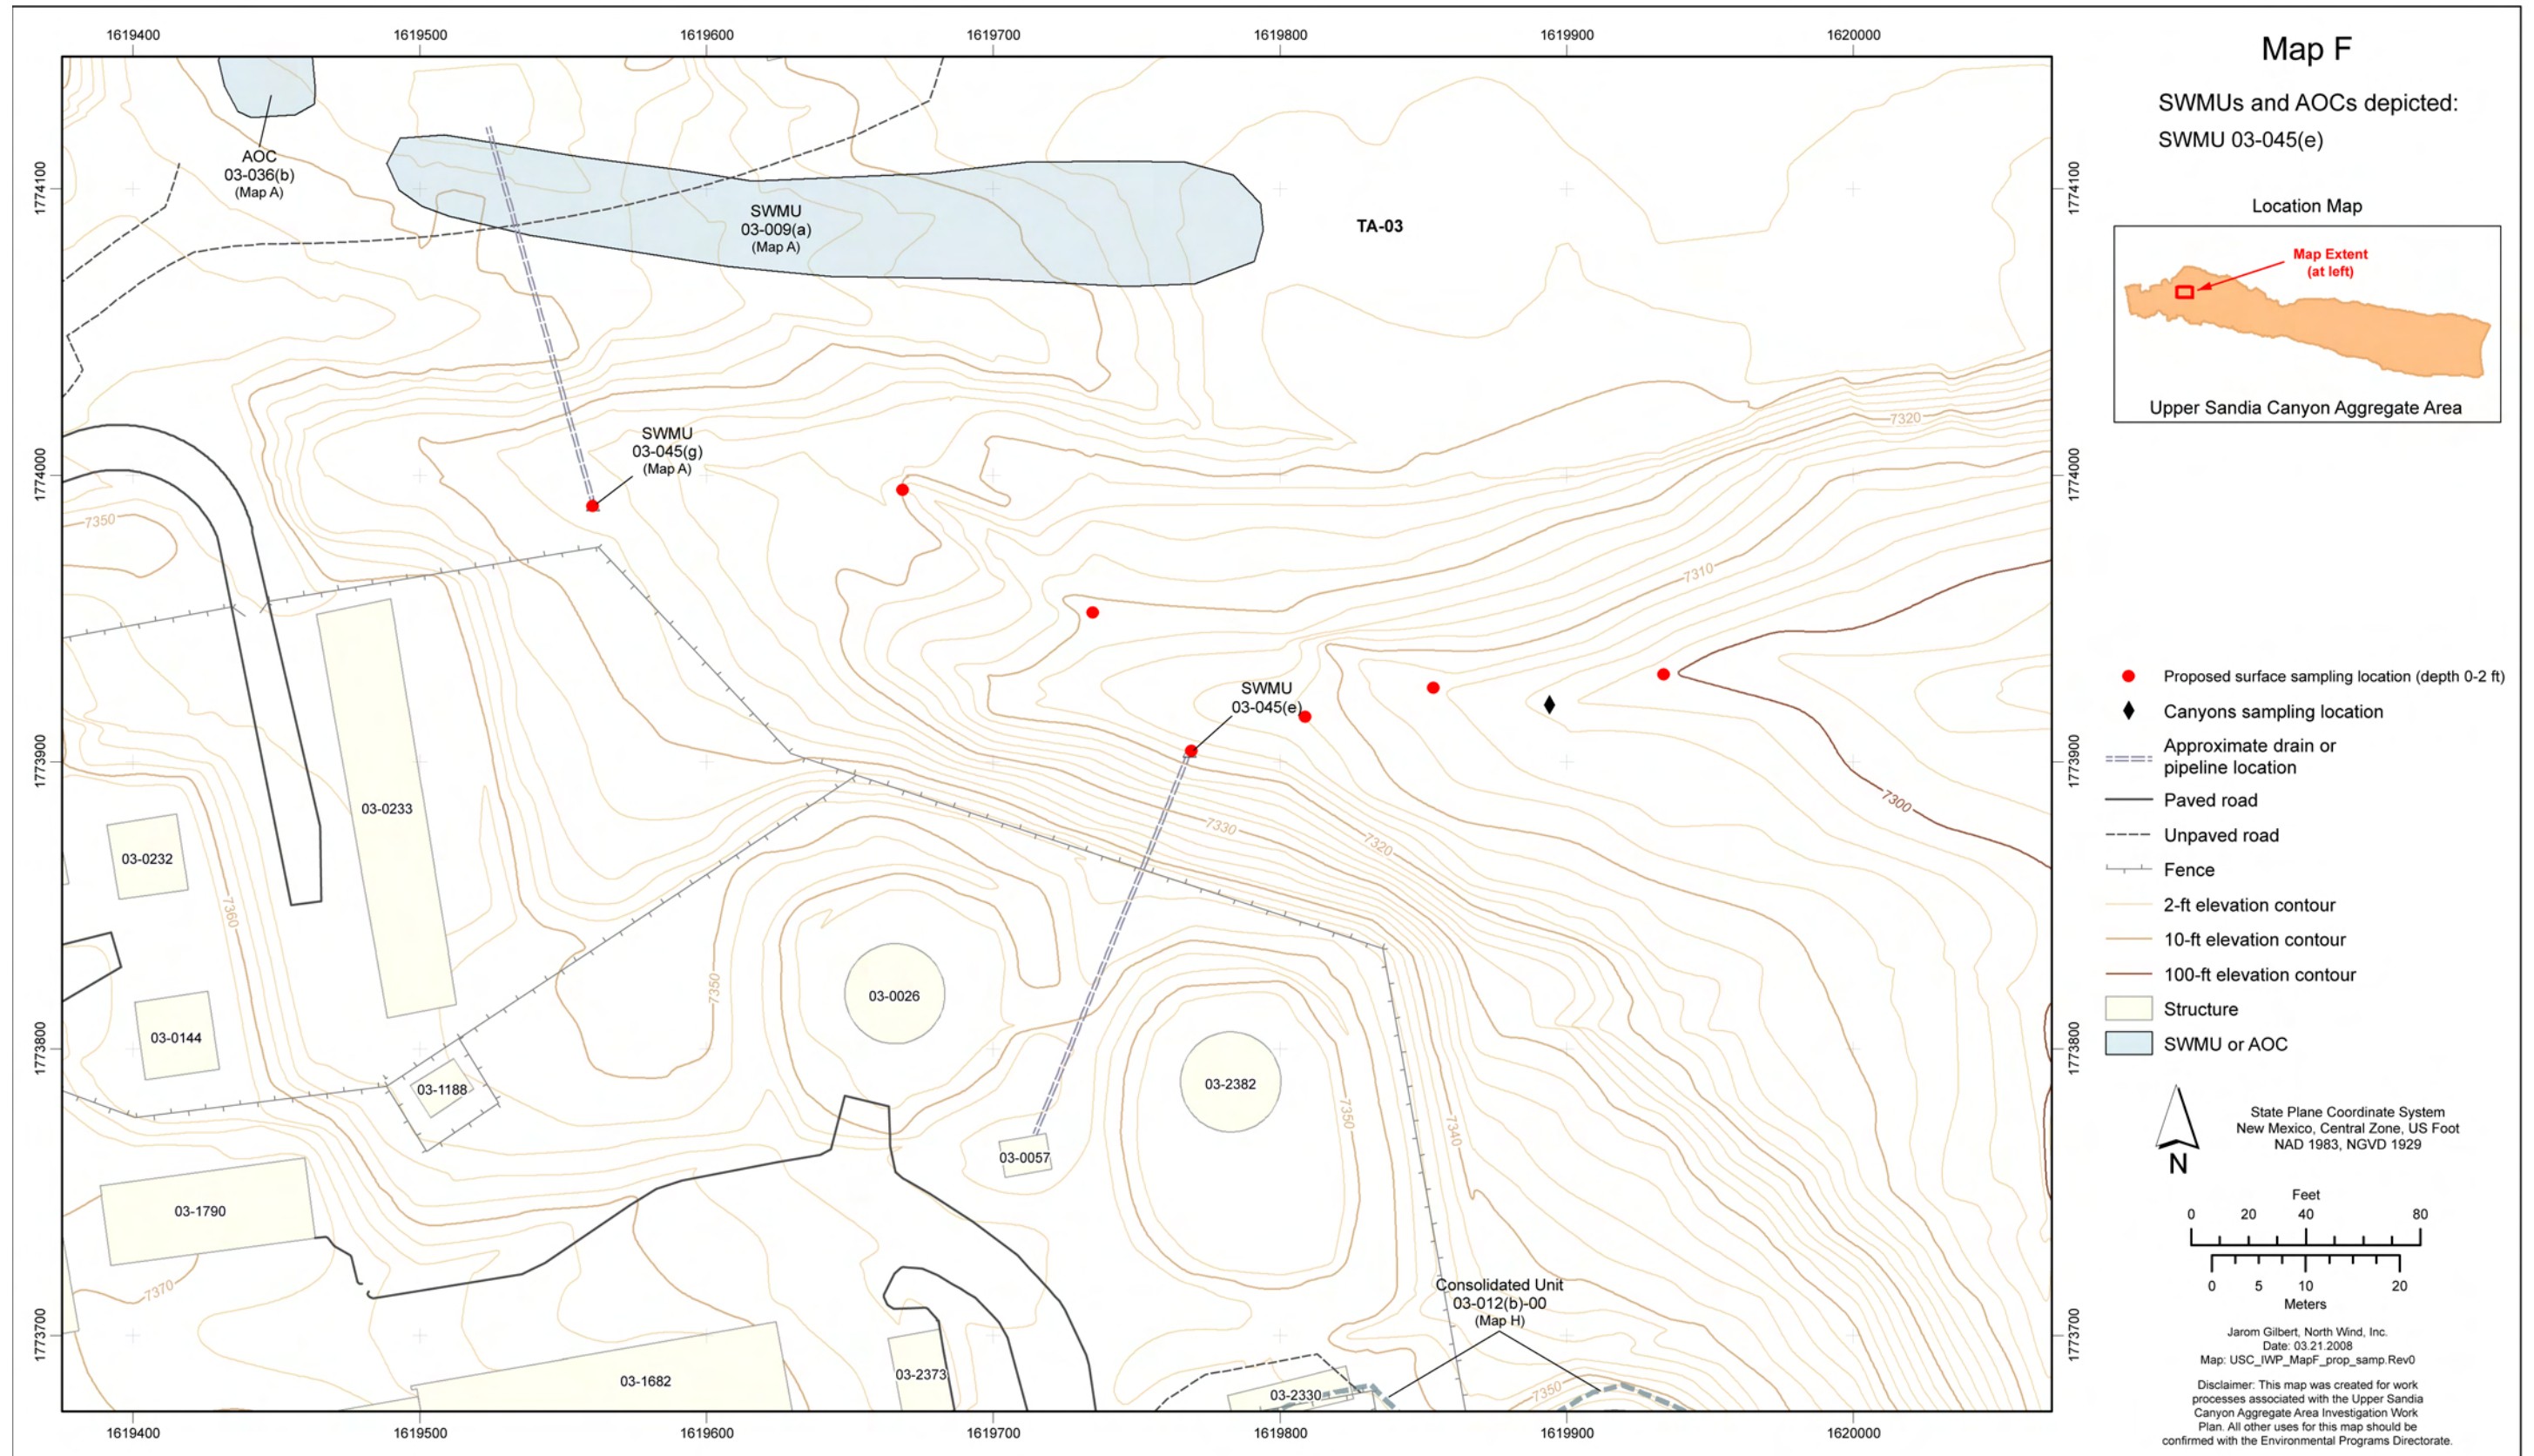


Figure 4.1-24 Map F proposed sampling locations



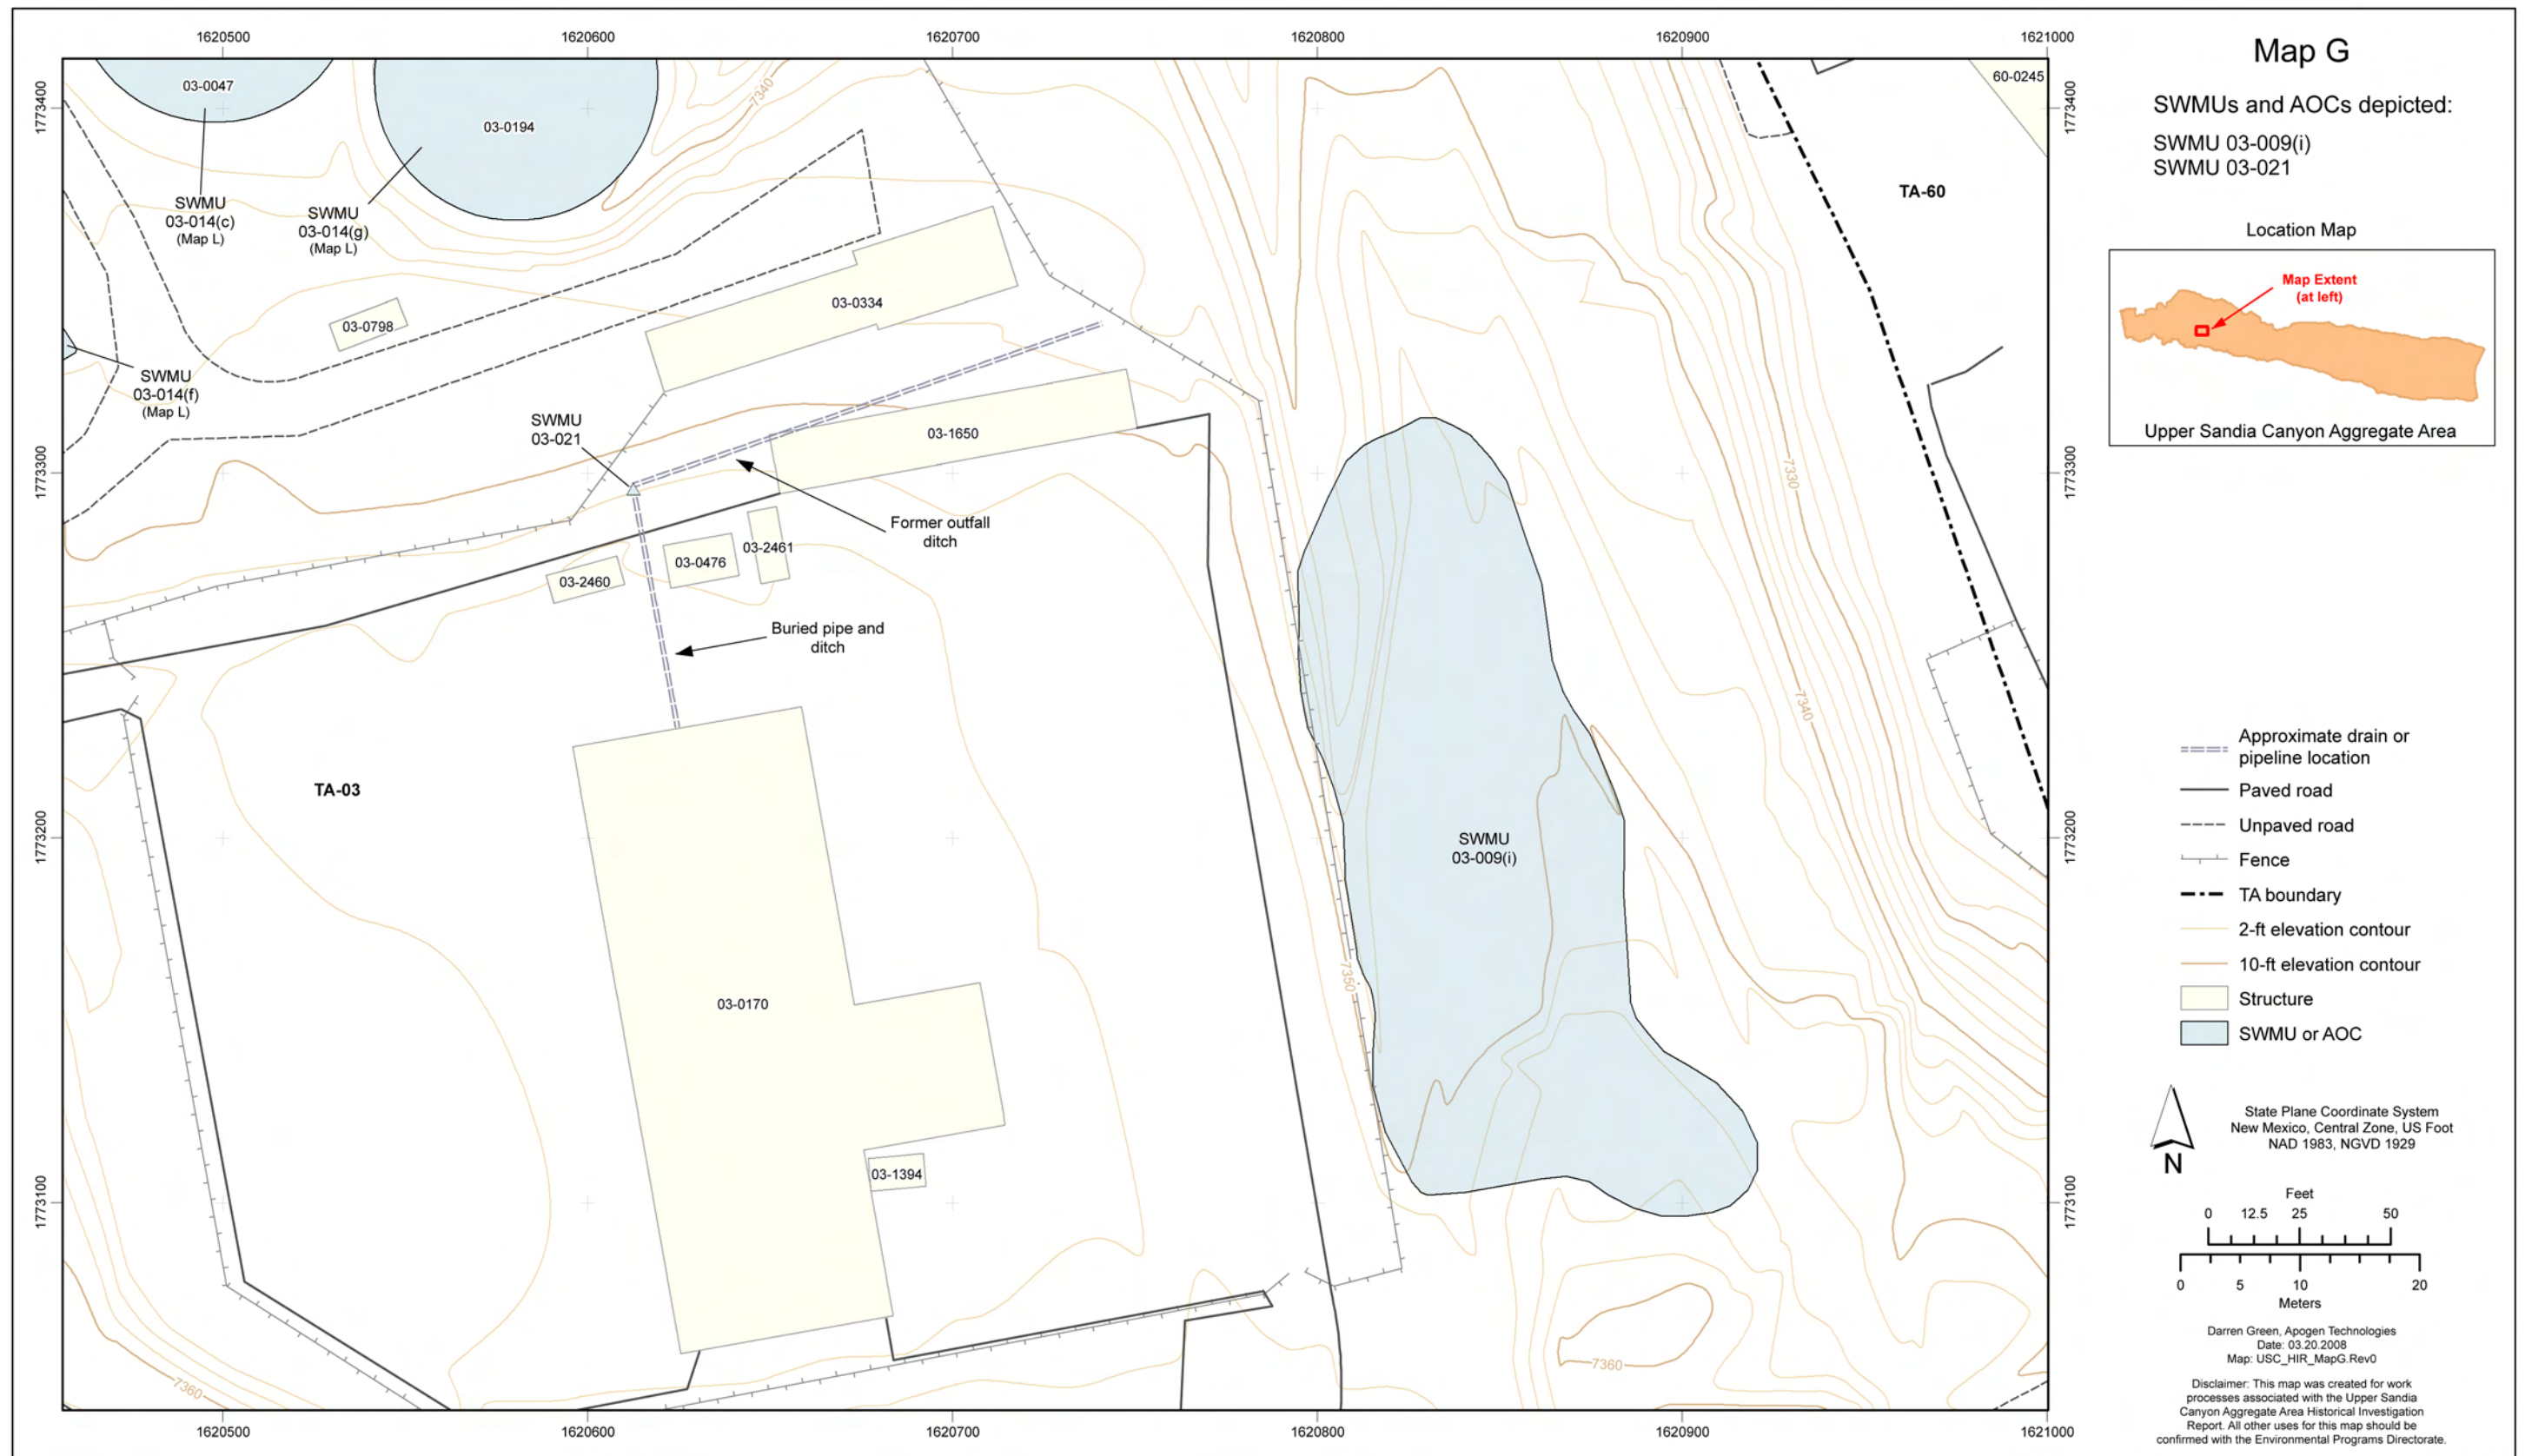


Figure 4.1-25 Map G site location



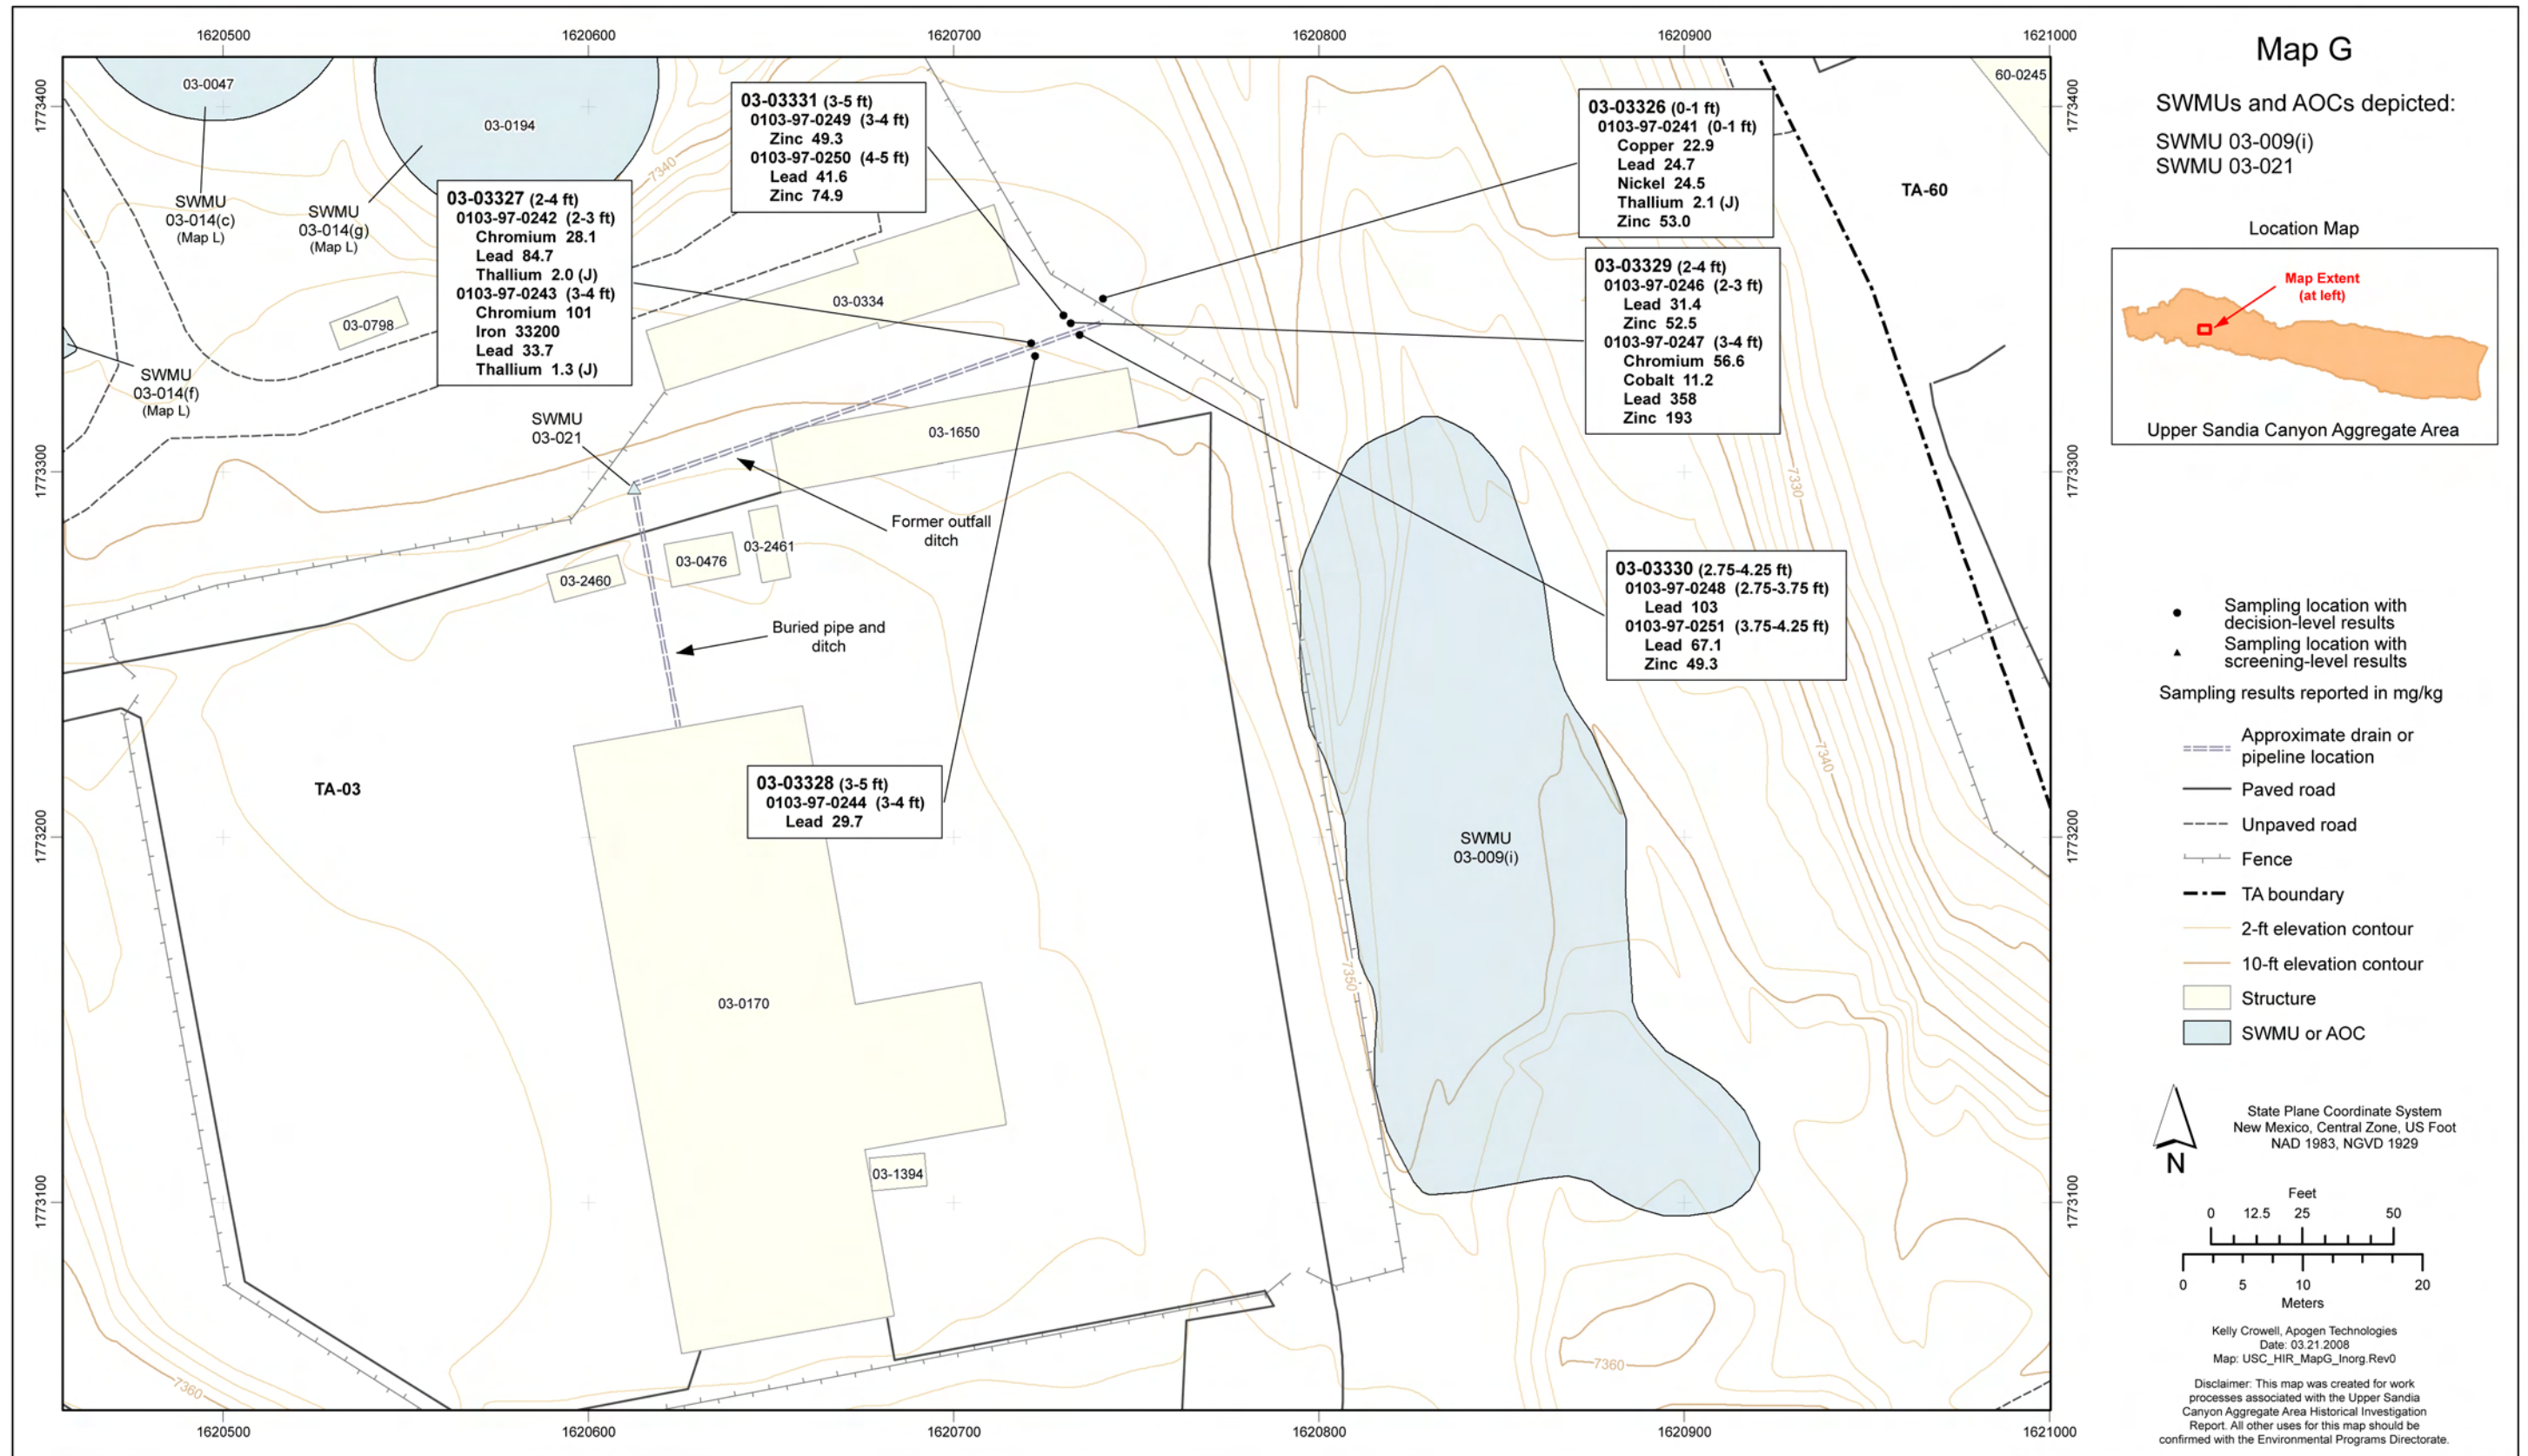


Figure 4.1-26 Map G inorganic chemical sampling locations and results detected above BVs



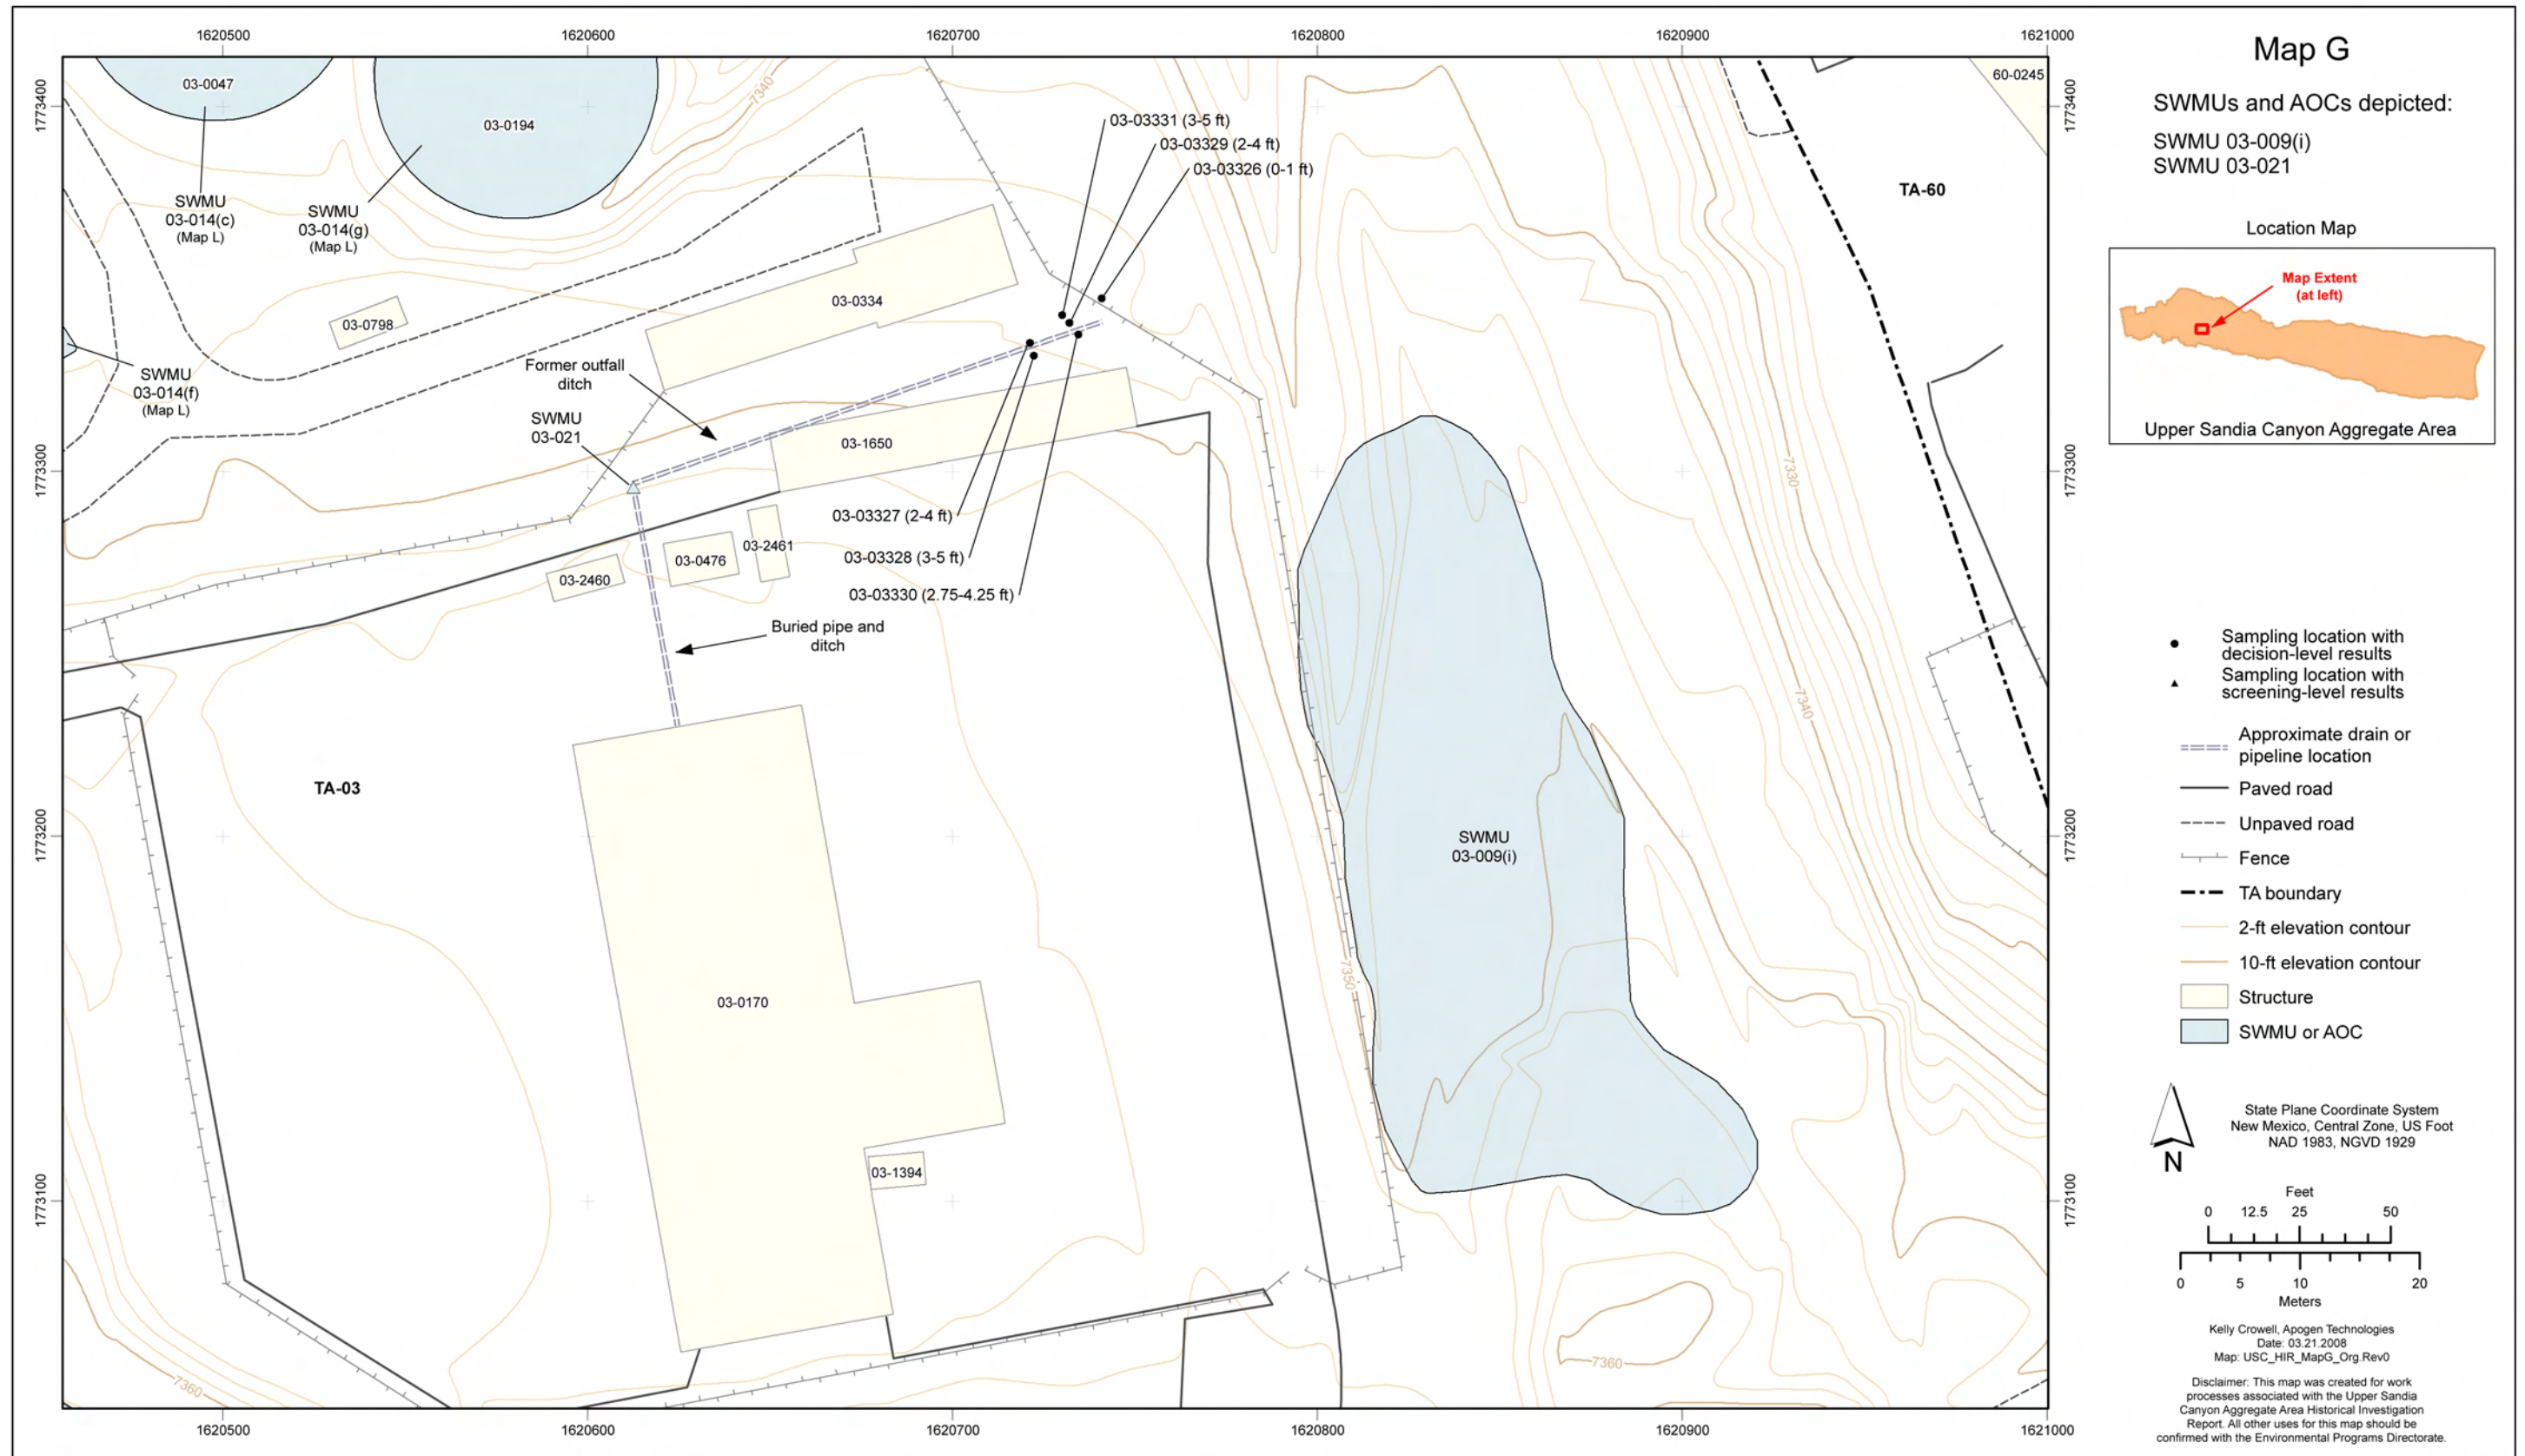


Figure 4.1-27 Map G organic chemical sampling locations



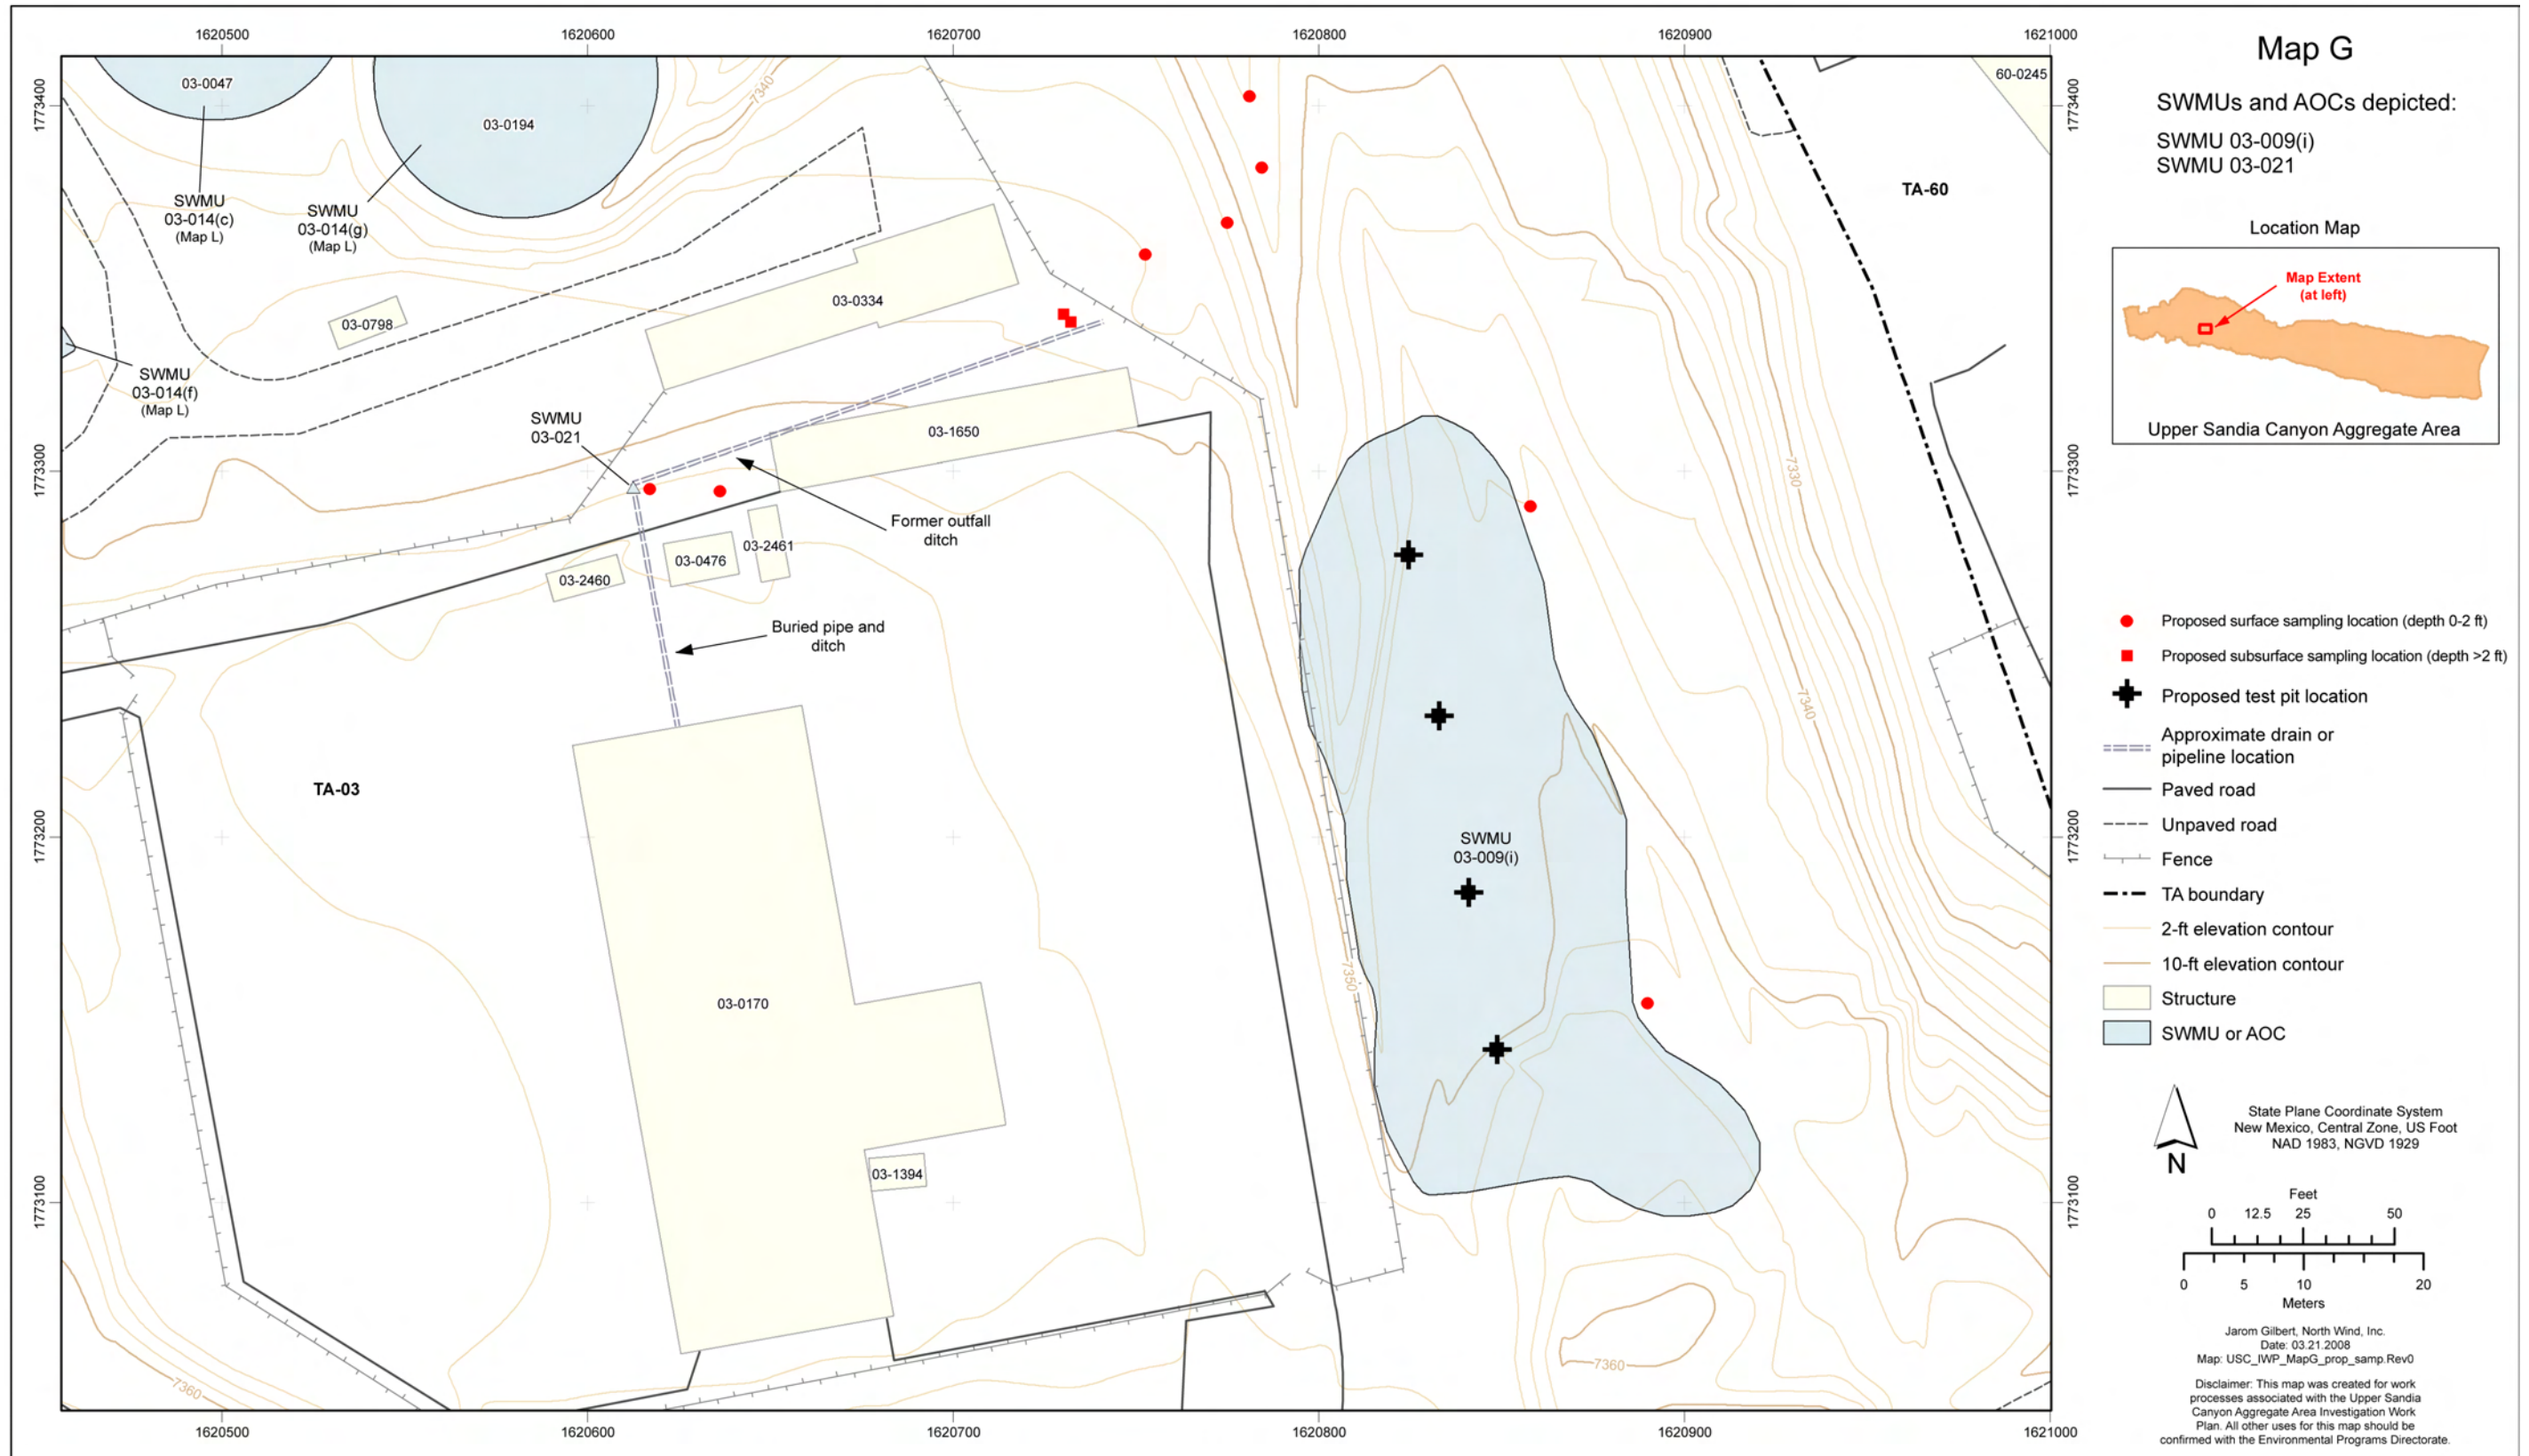


Figure 4.1-28 Map G proposed sampling locations



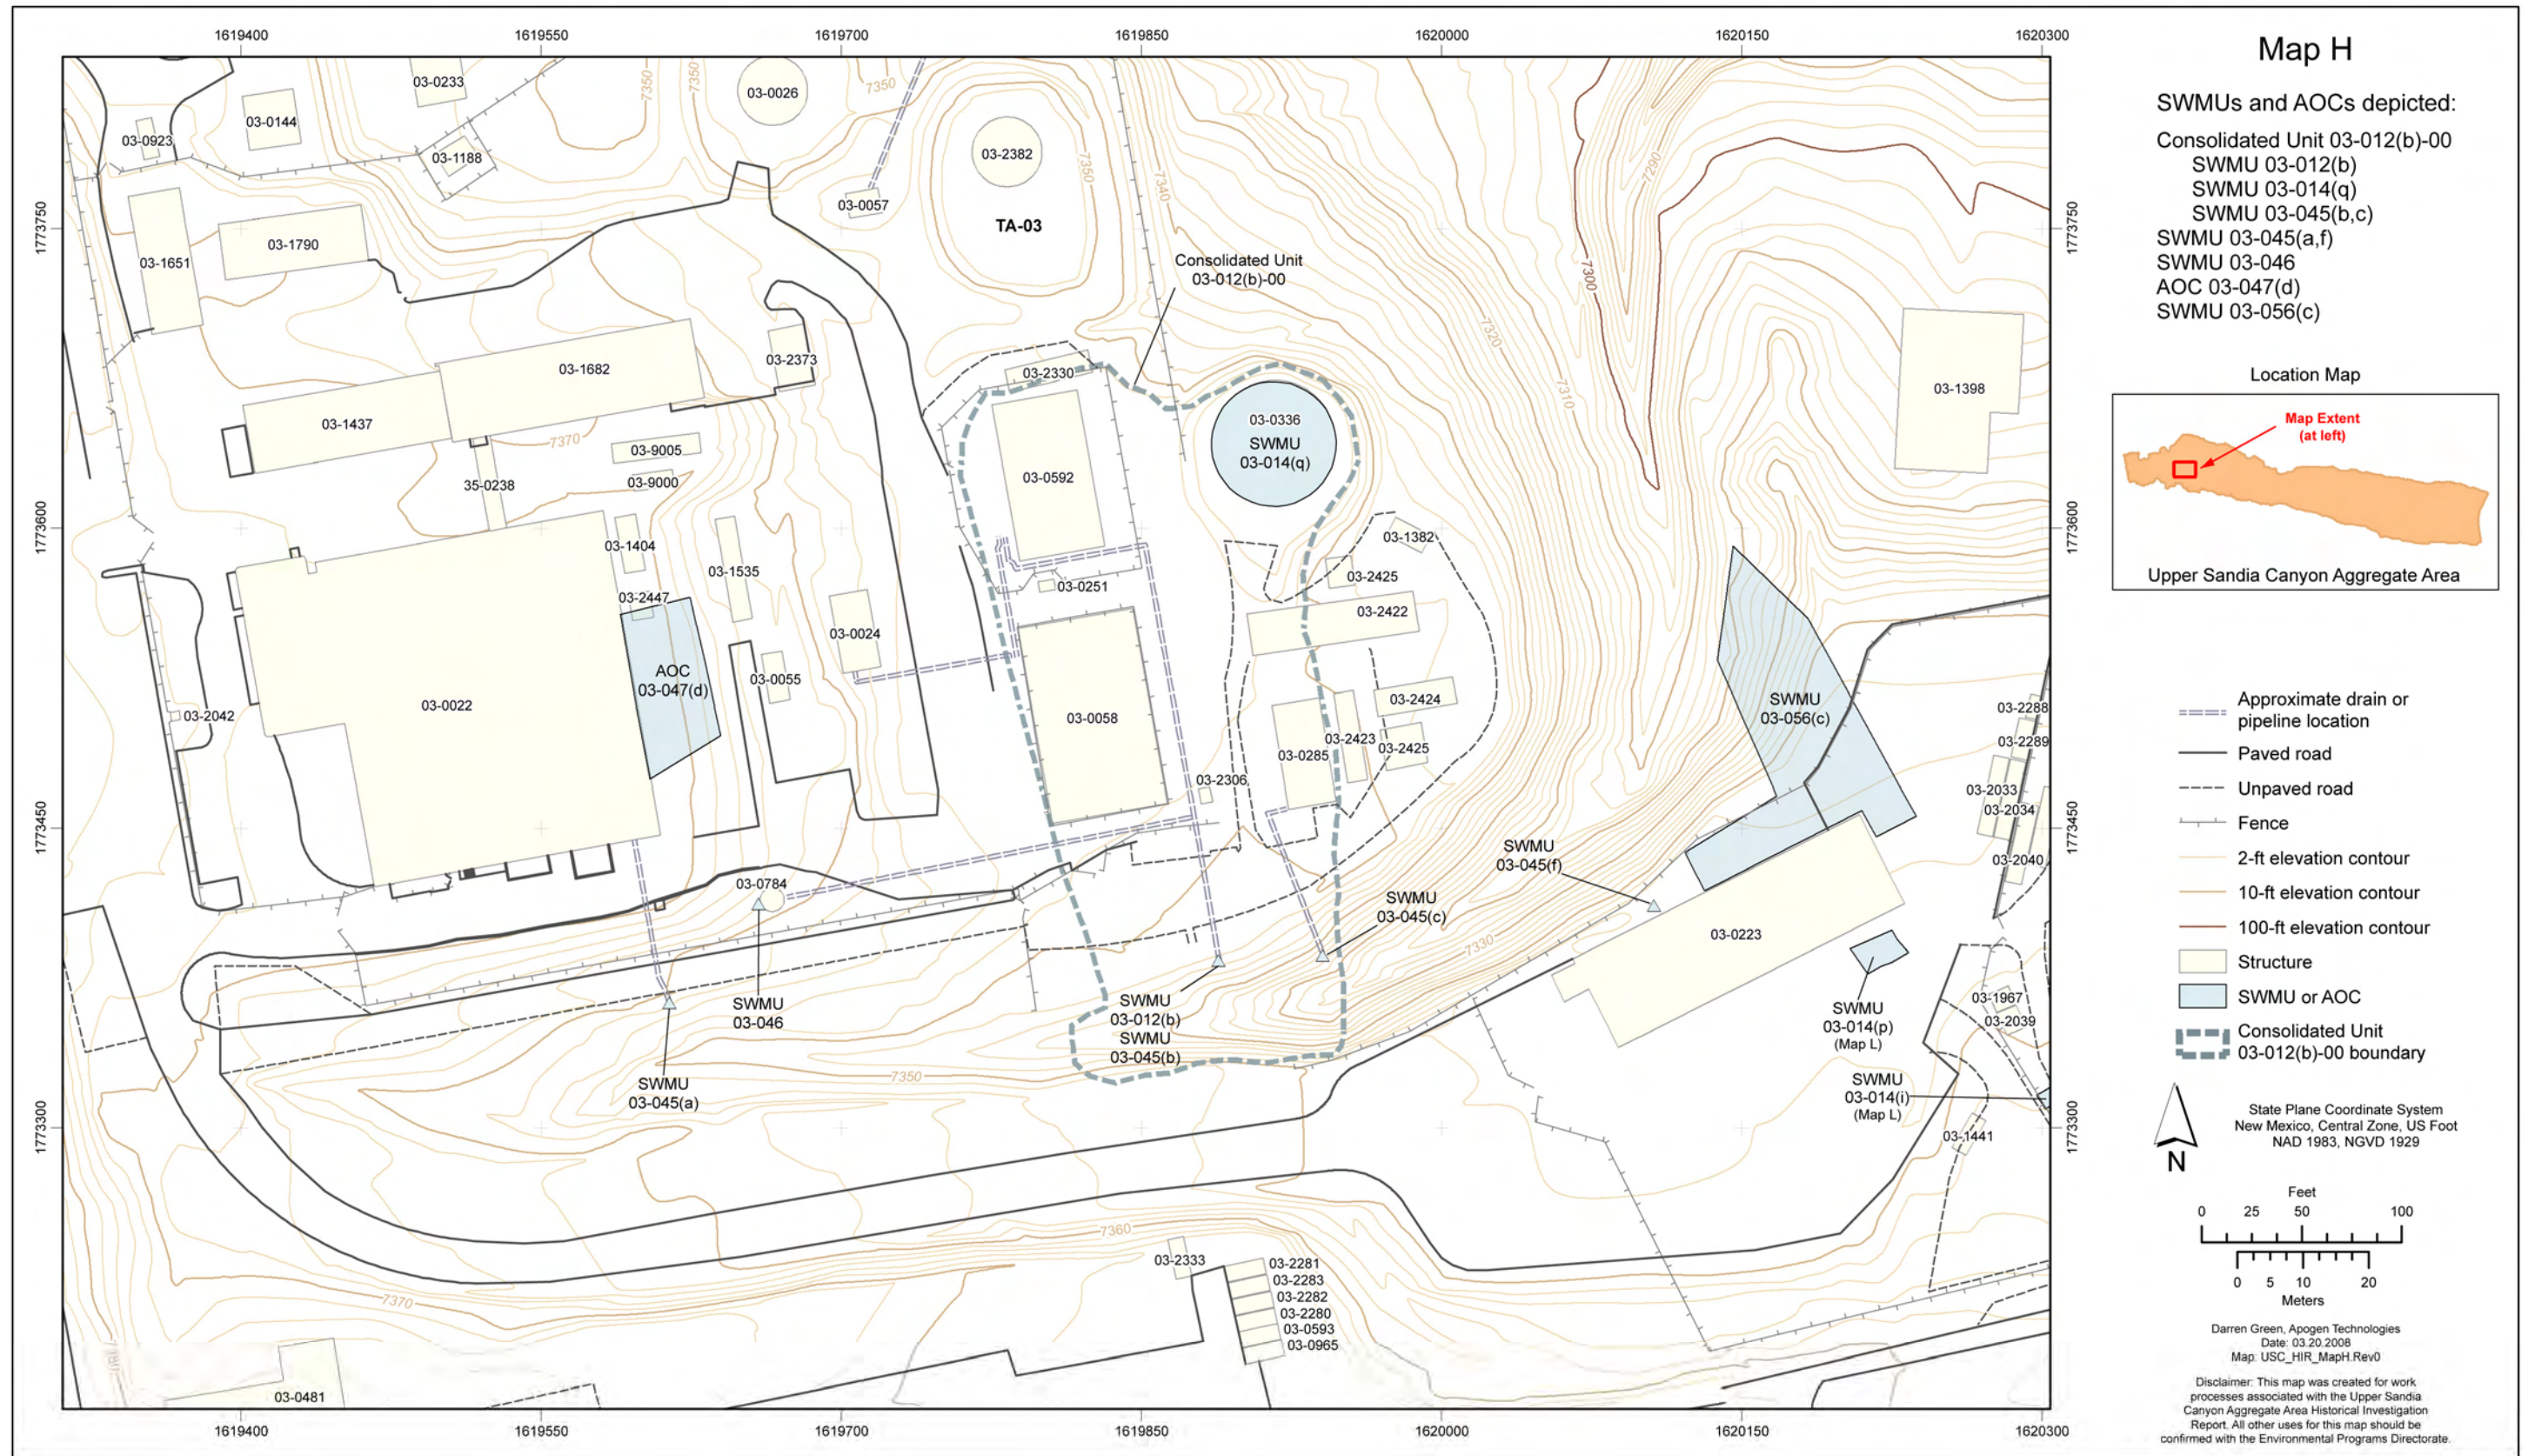


Figure 4.1-29 Map H site location



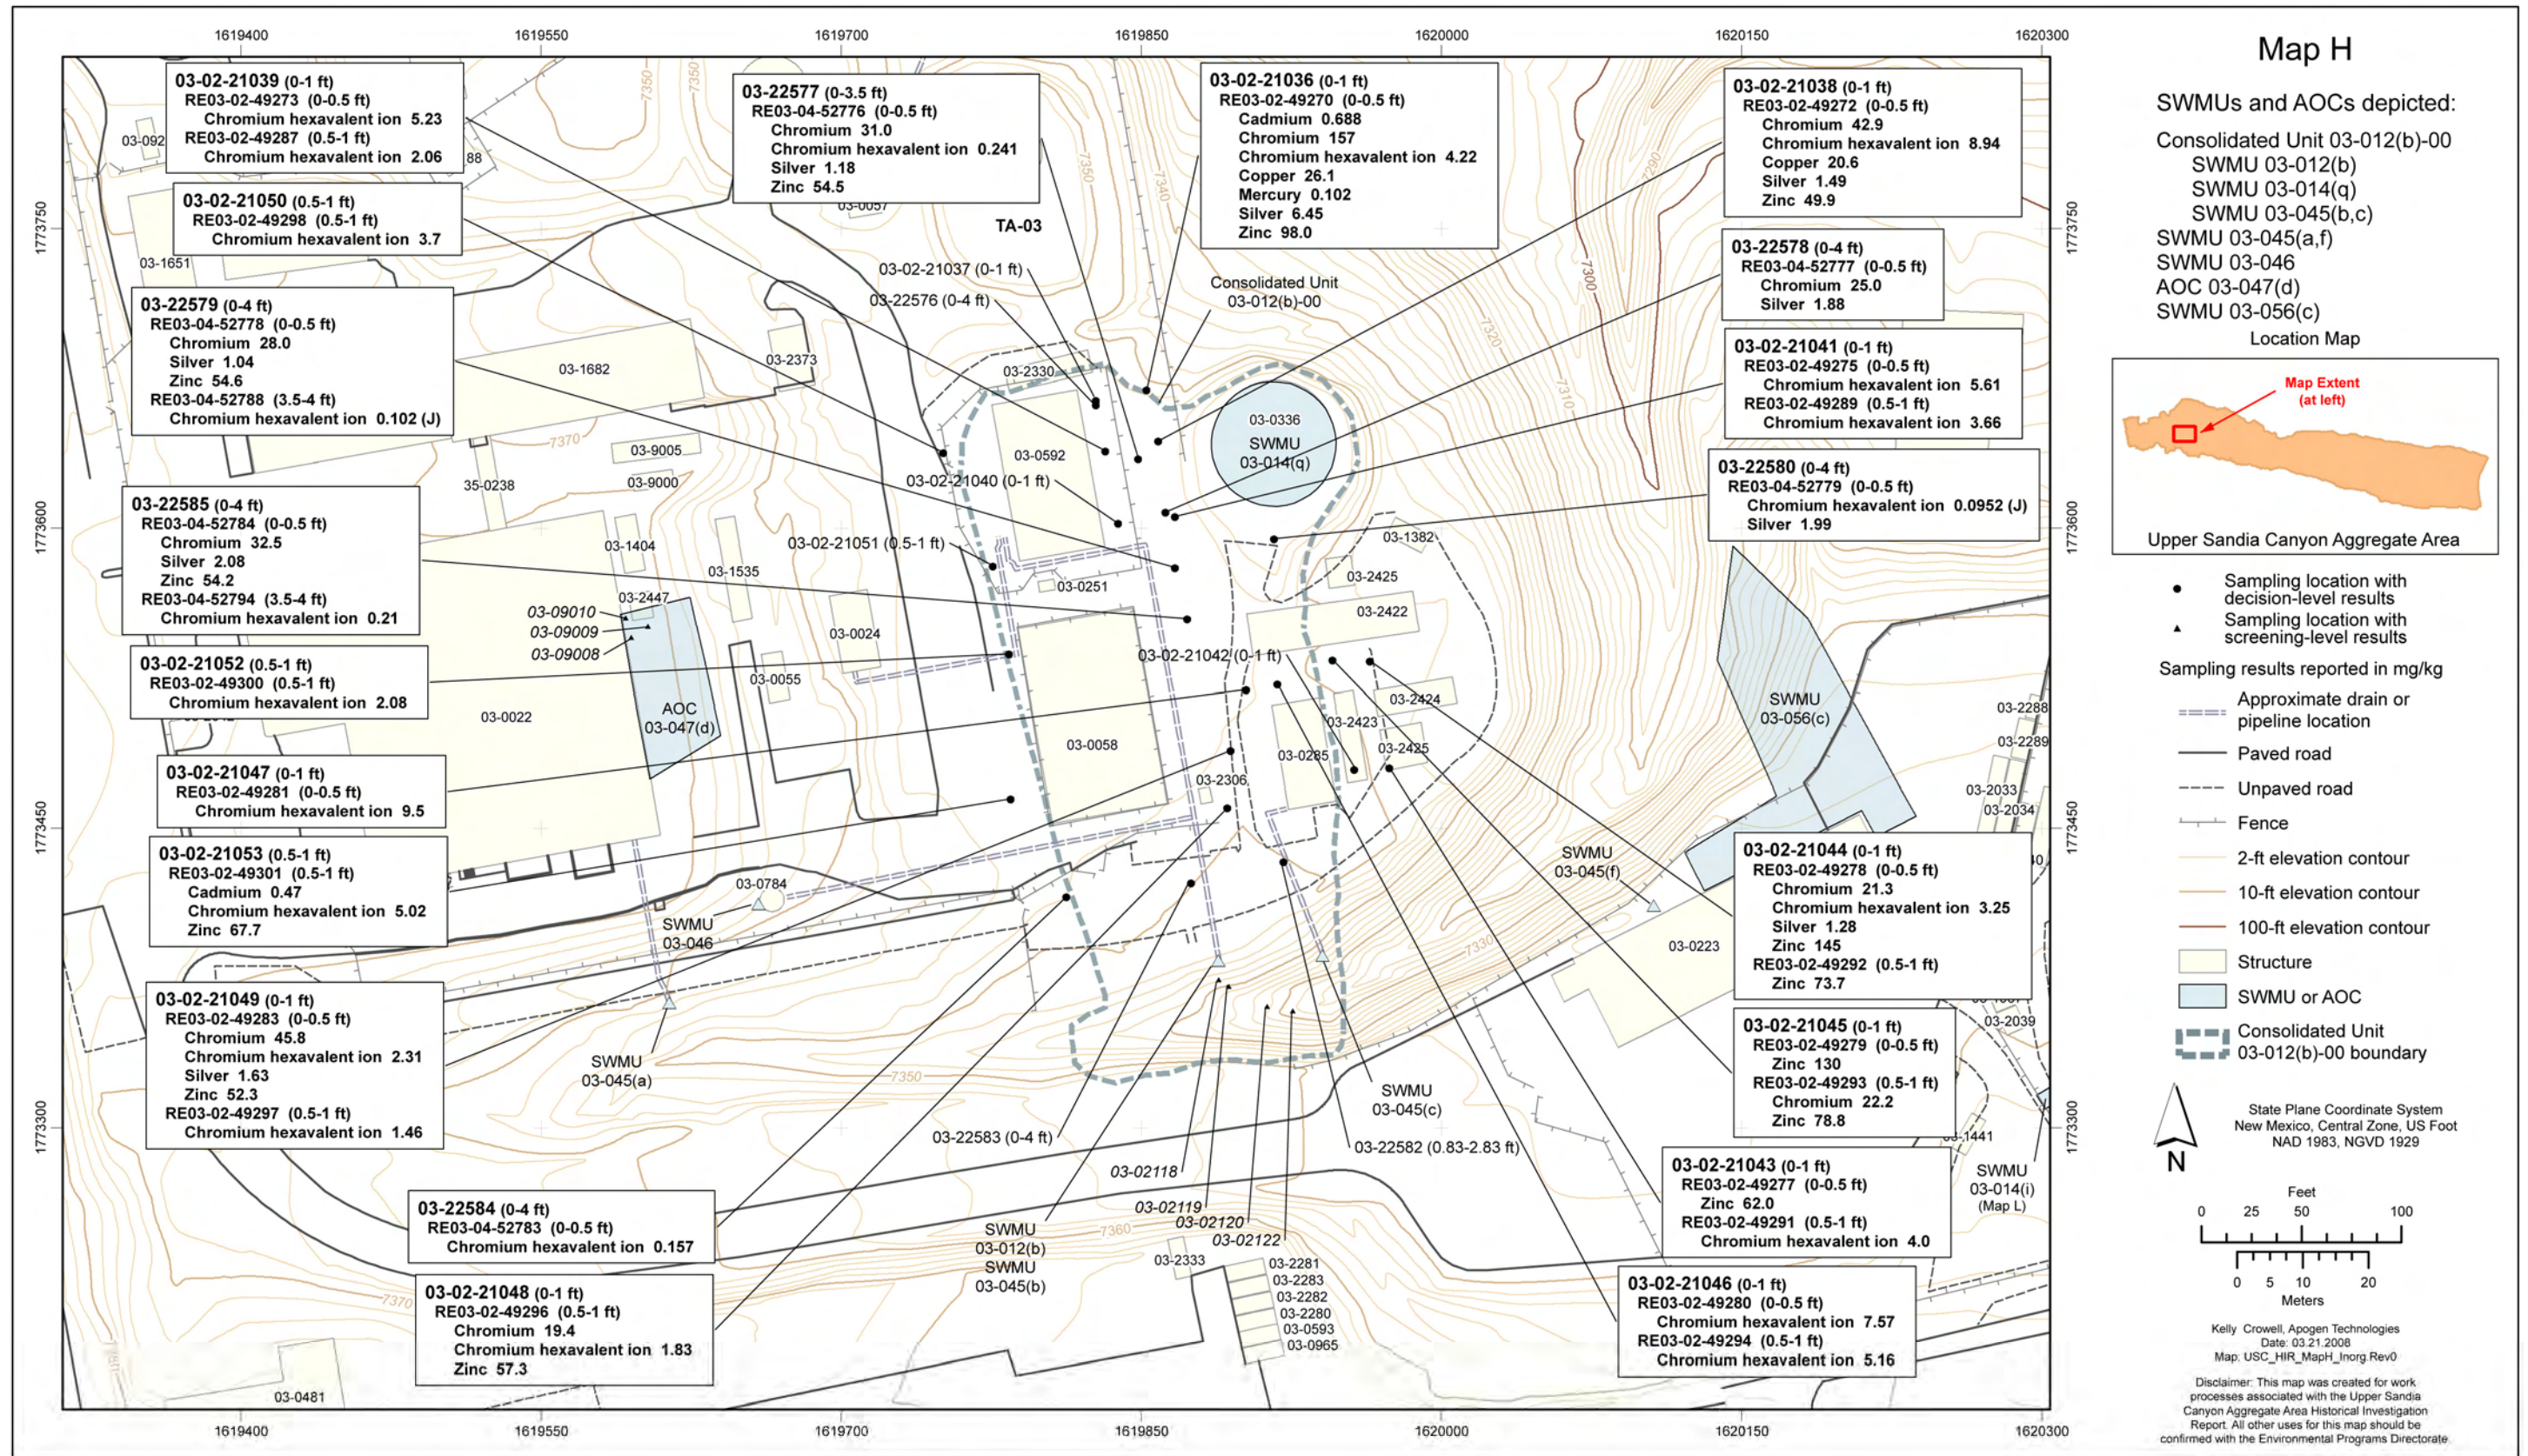


Figure 4.1-30 Map H inorganic chemical sampling locations and results detected above BVs



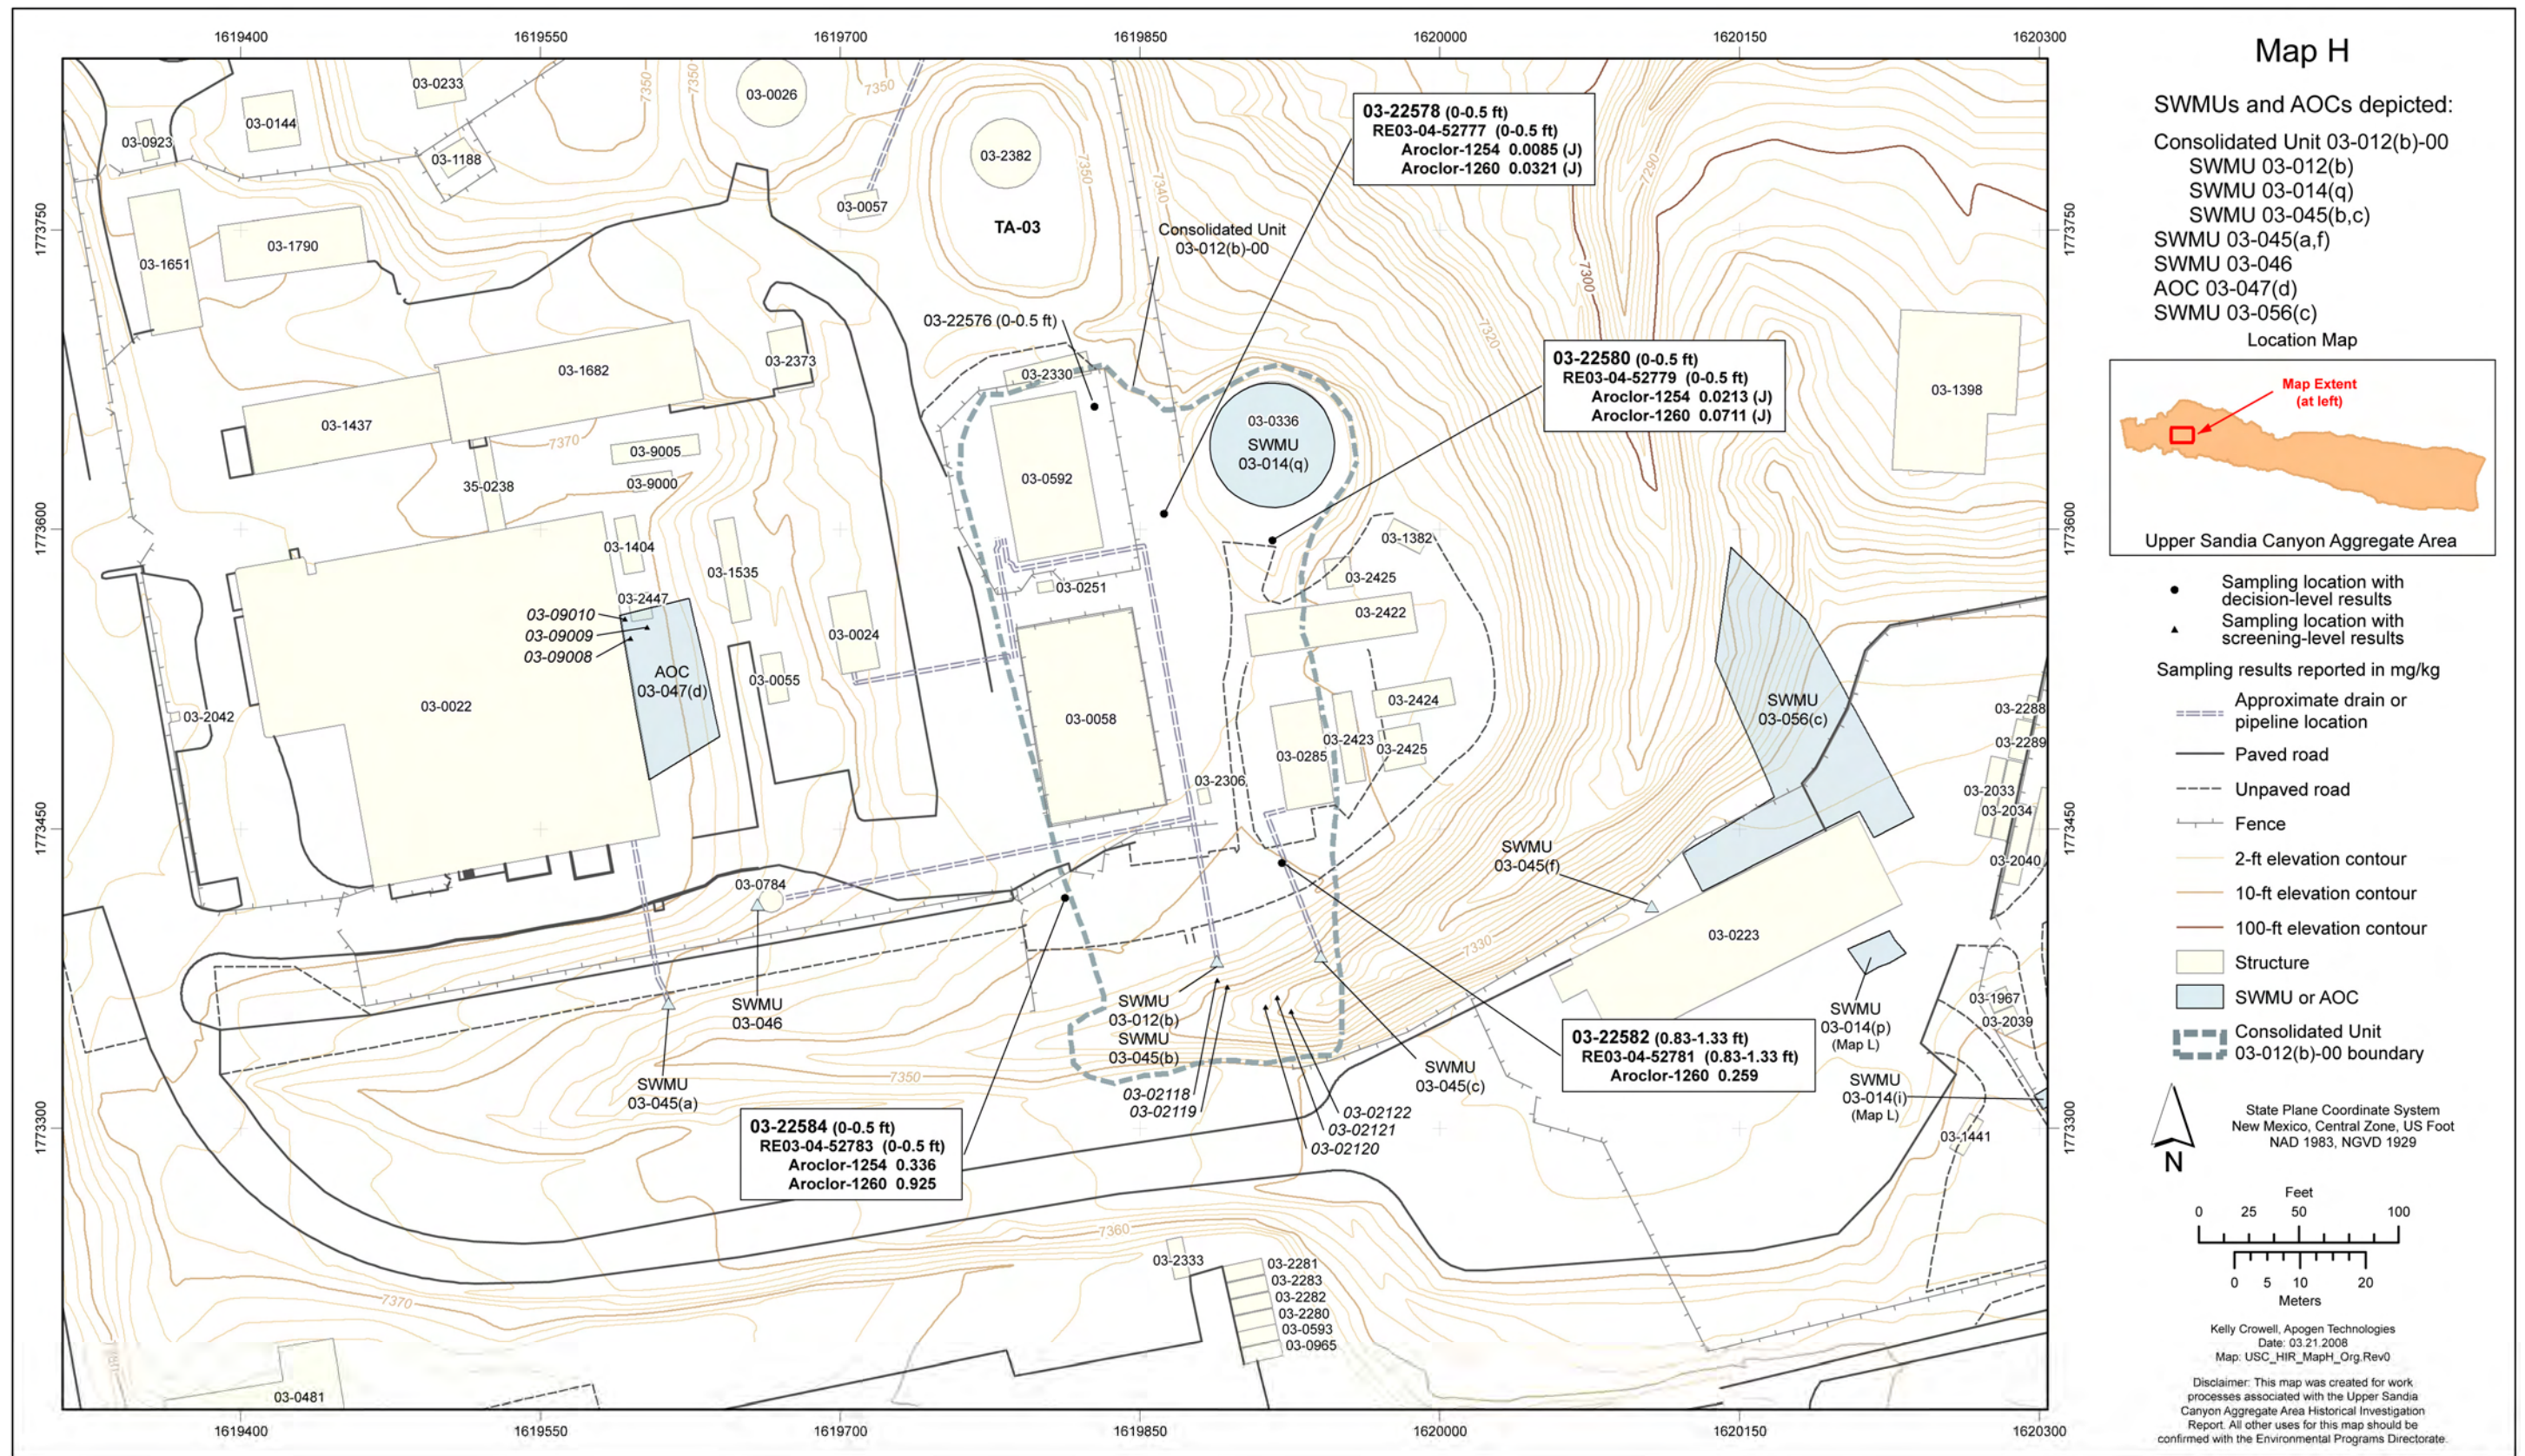


Figure 4.1-31 Map H organic chemical sampling locations and detected results



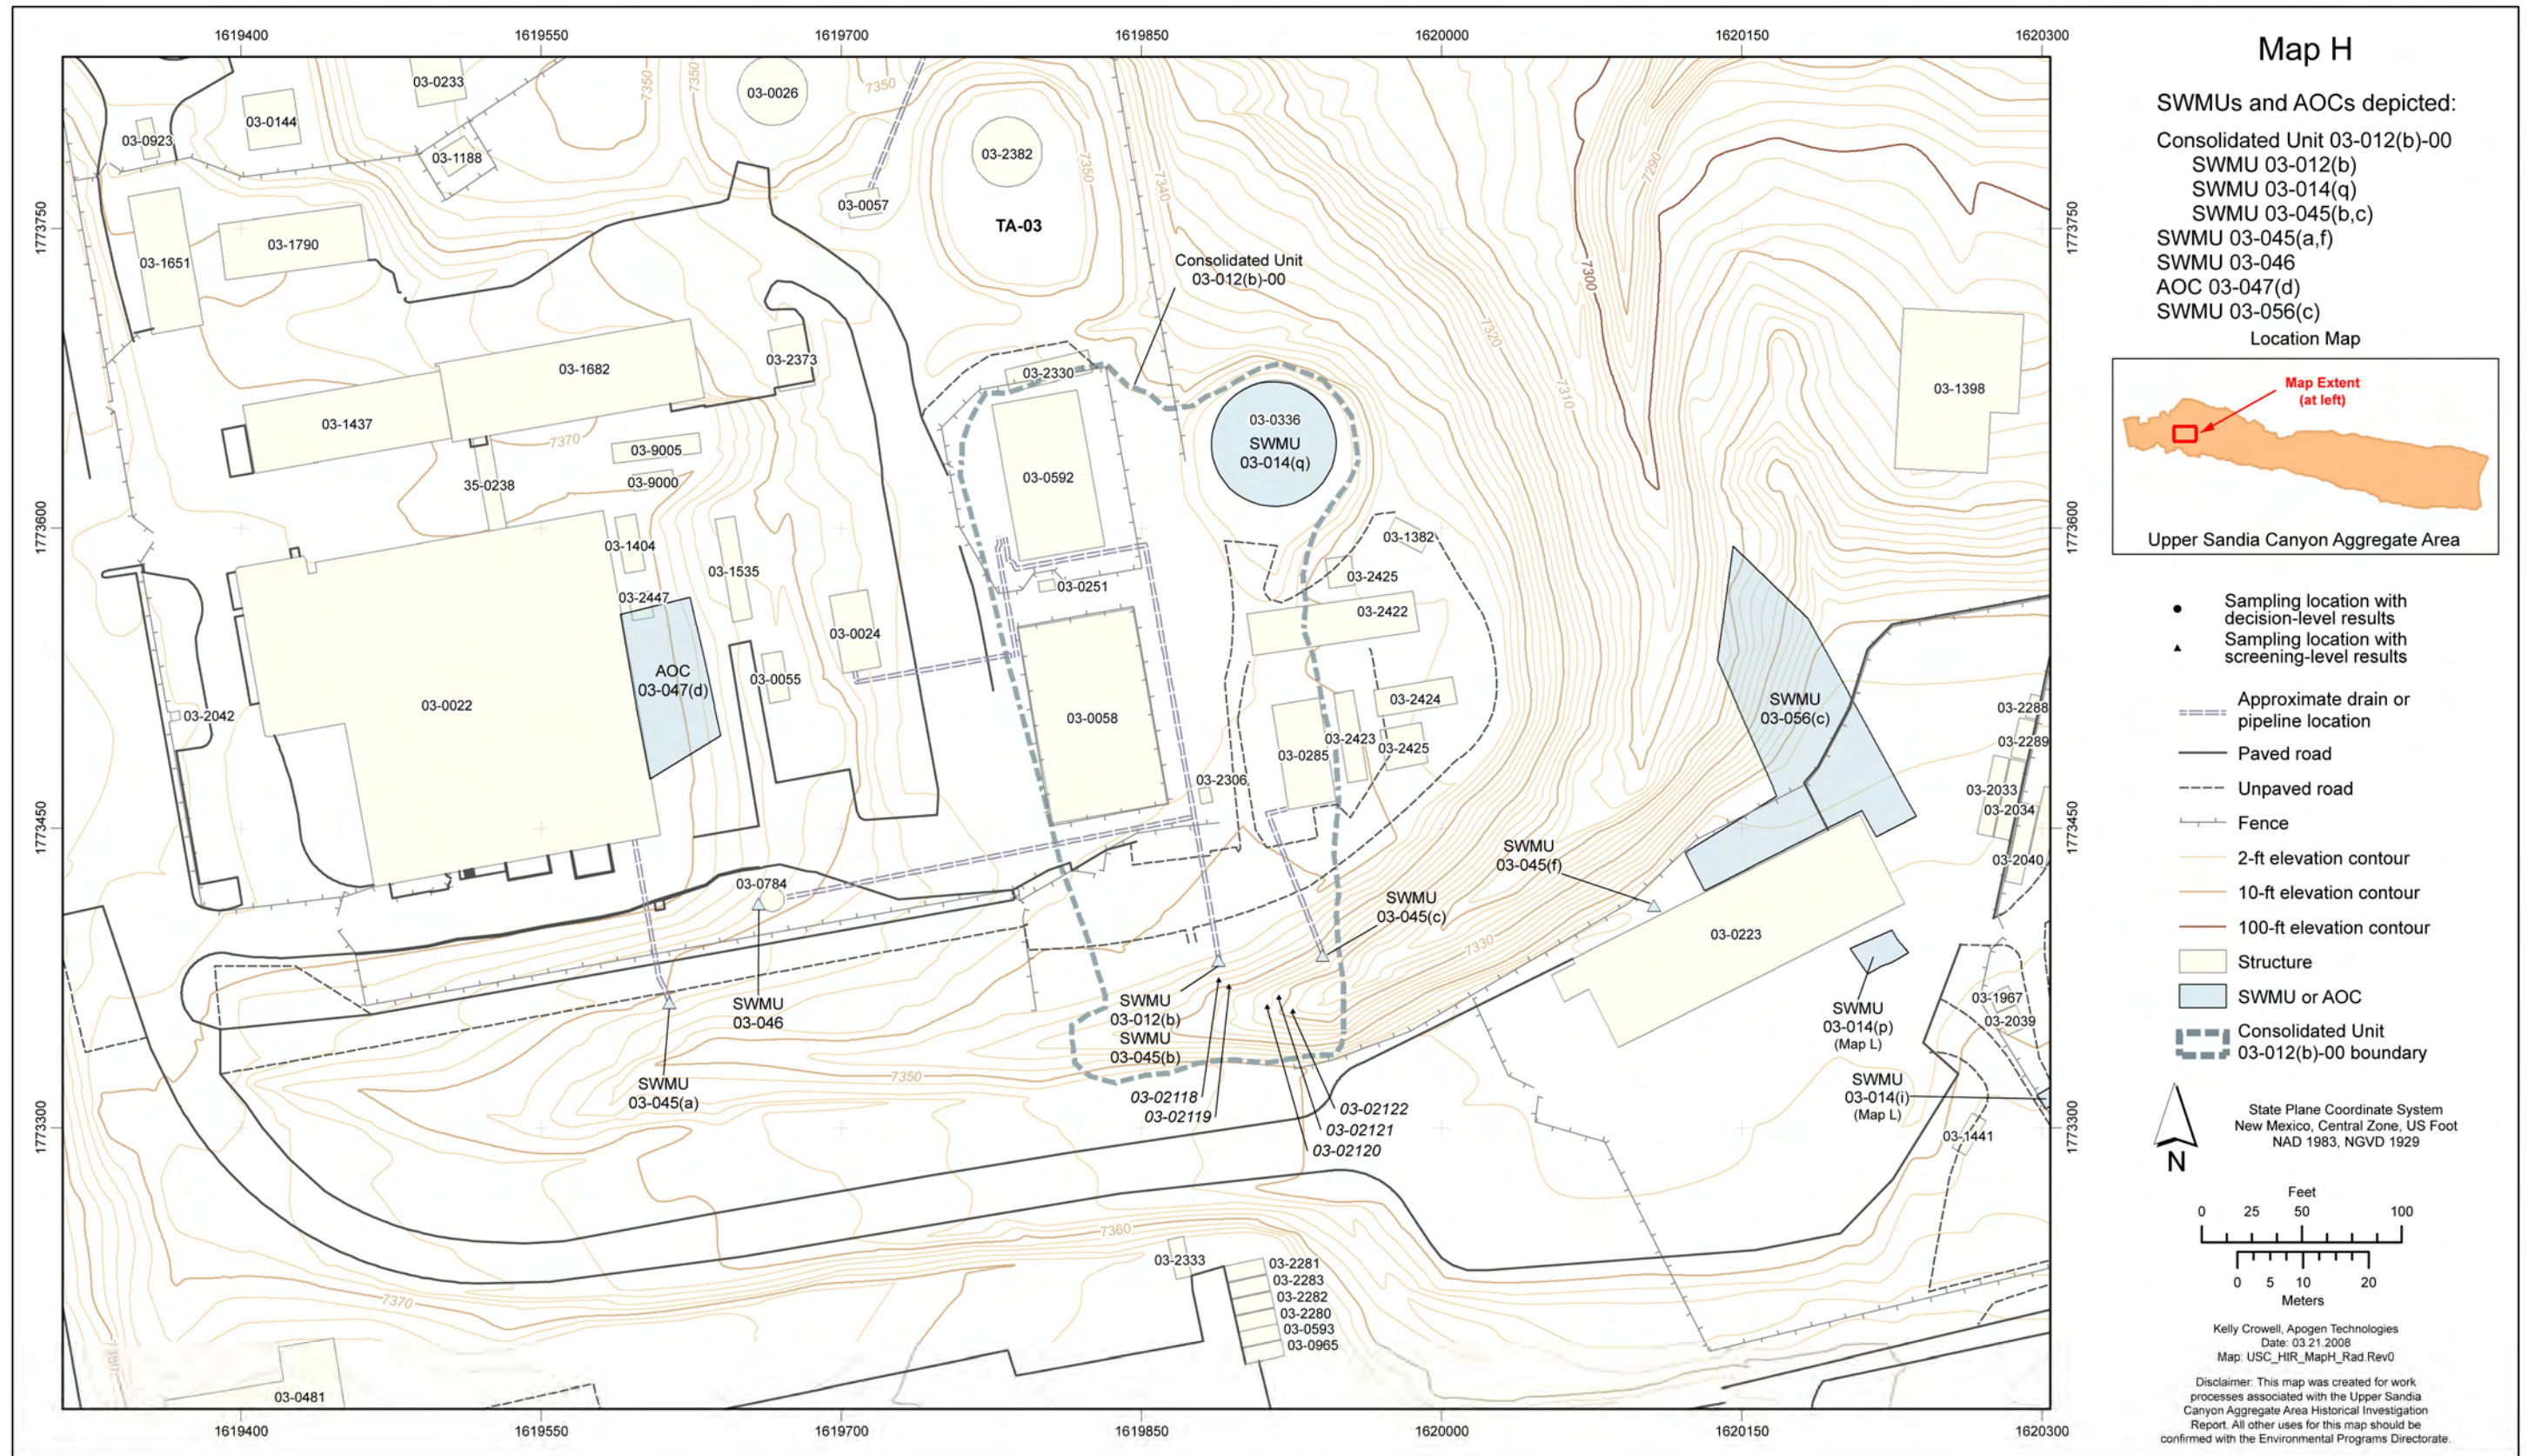


Figure 4.1-32 Map H radionuclide sampling locations



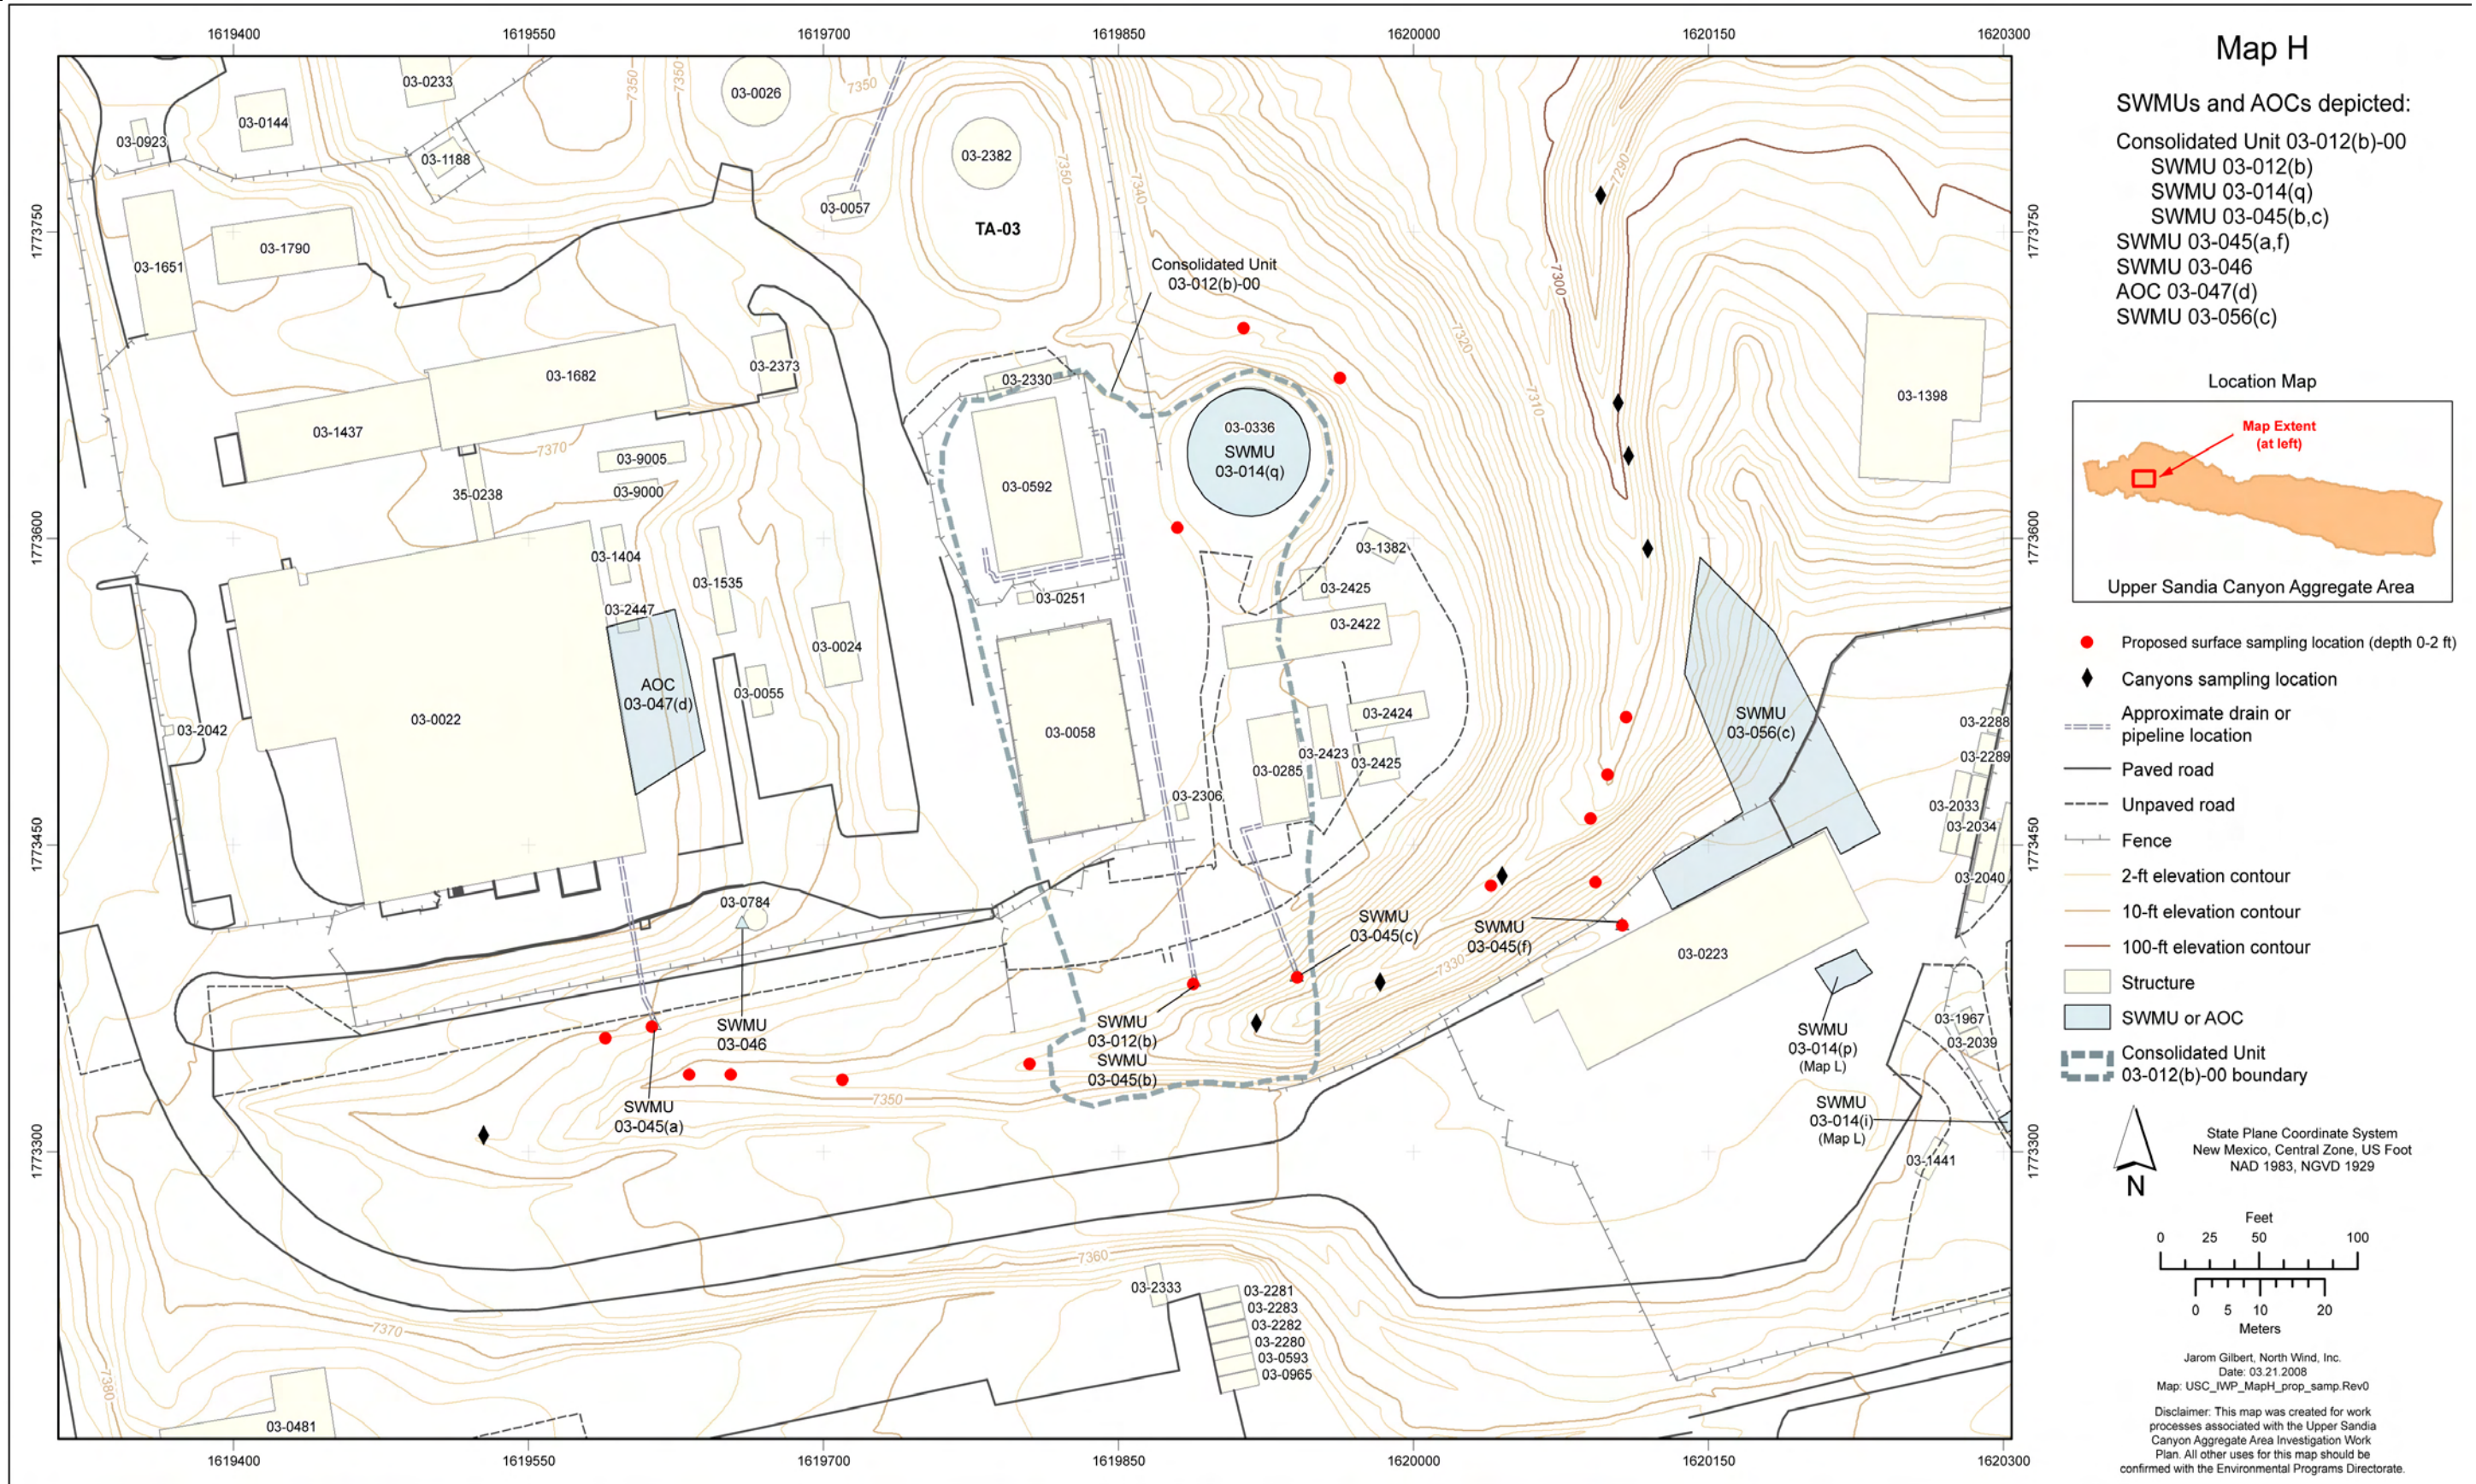


Figure 4.1-33 Map H proposed sampling locations



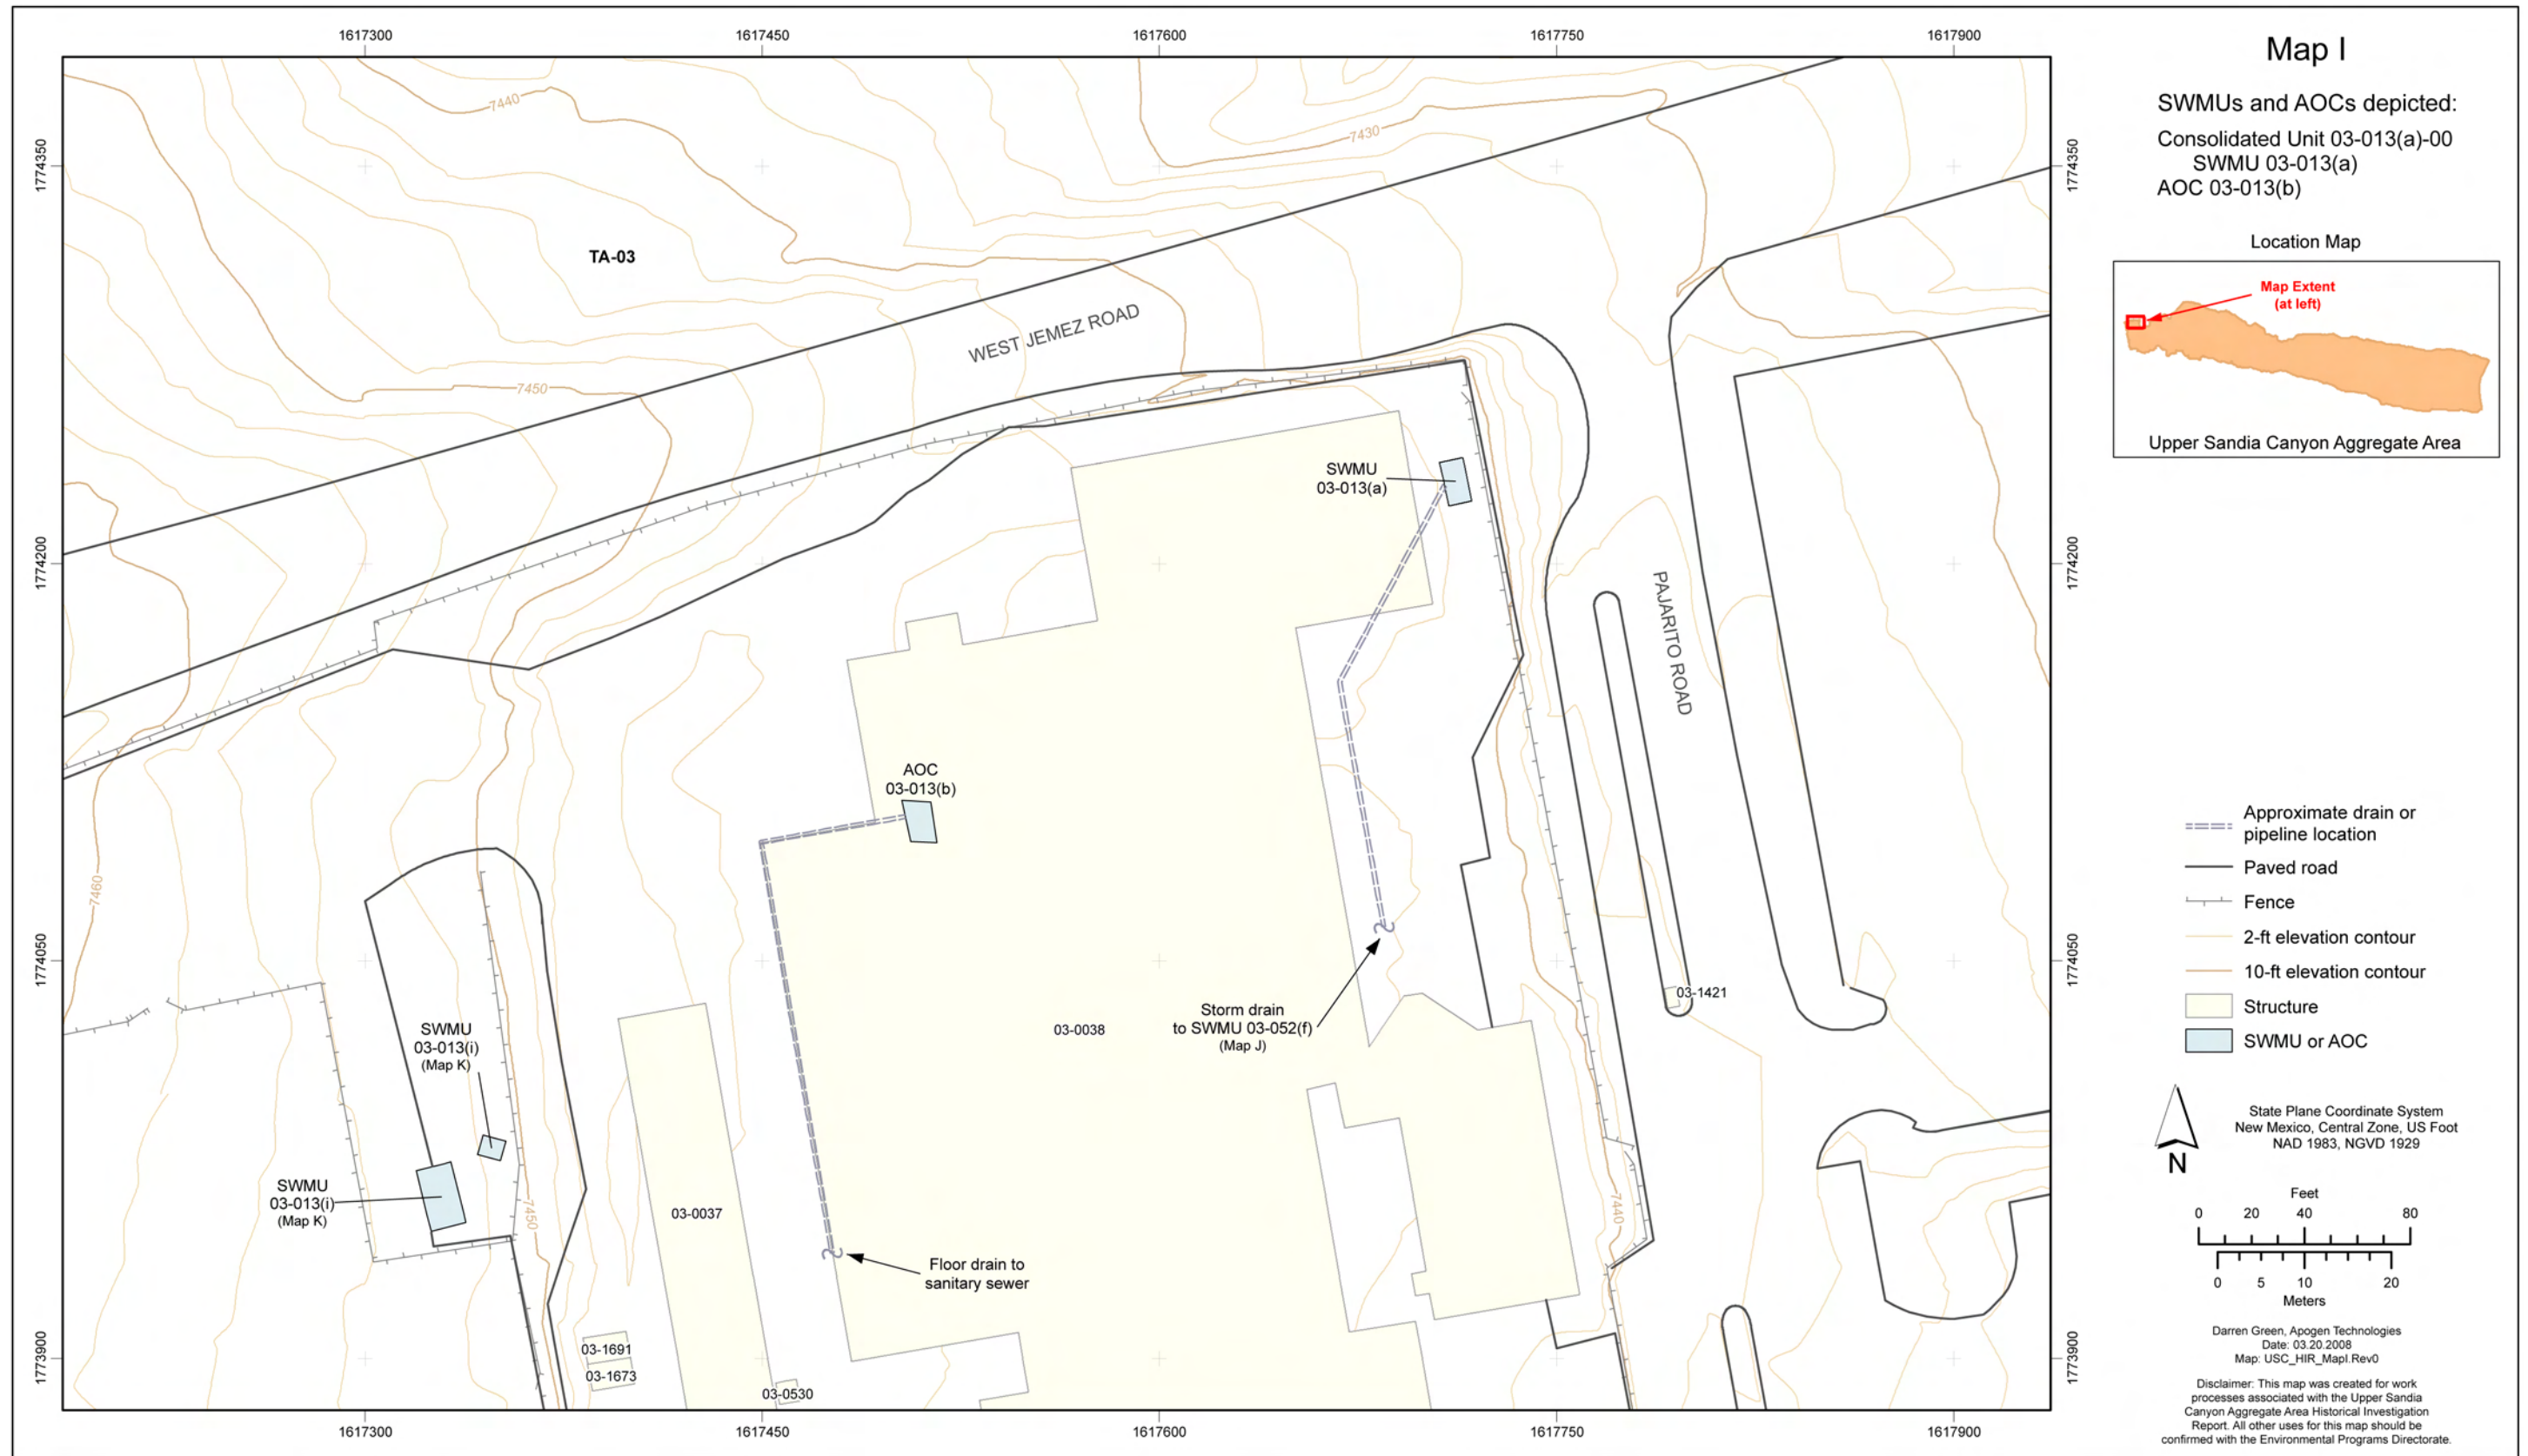


Figure 4.1-34 Map I site location

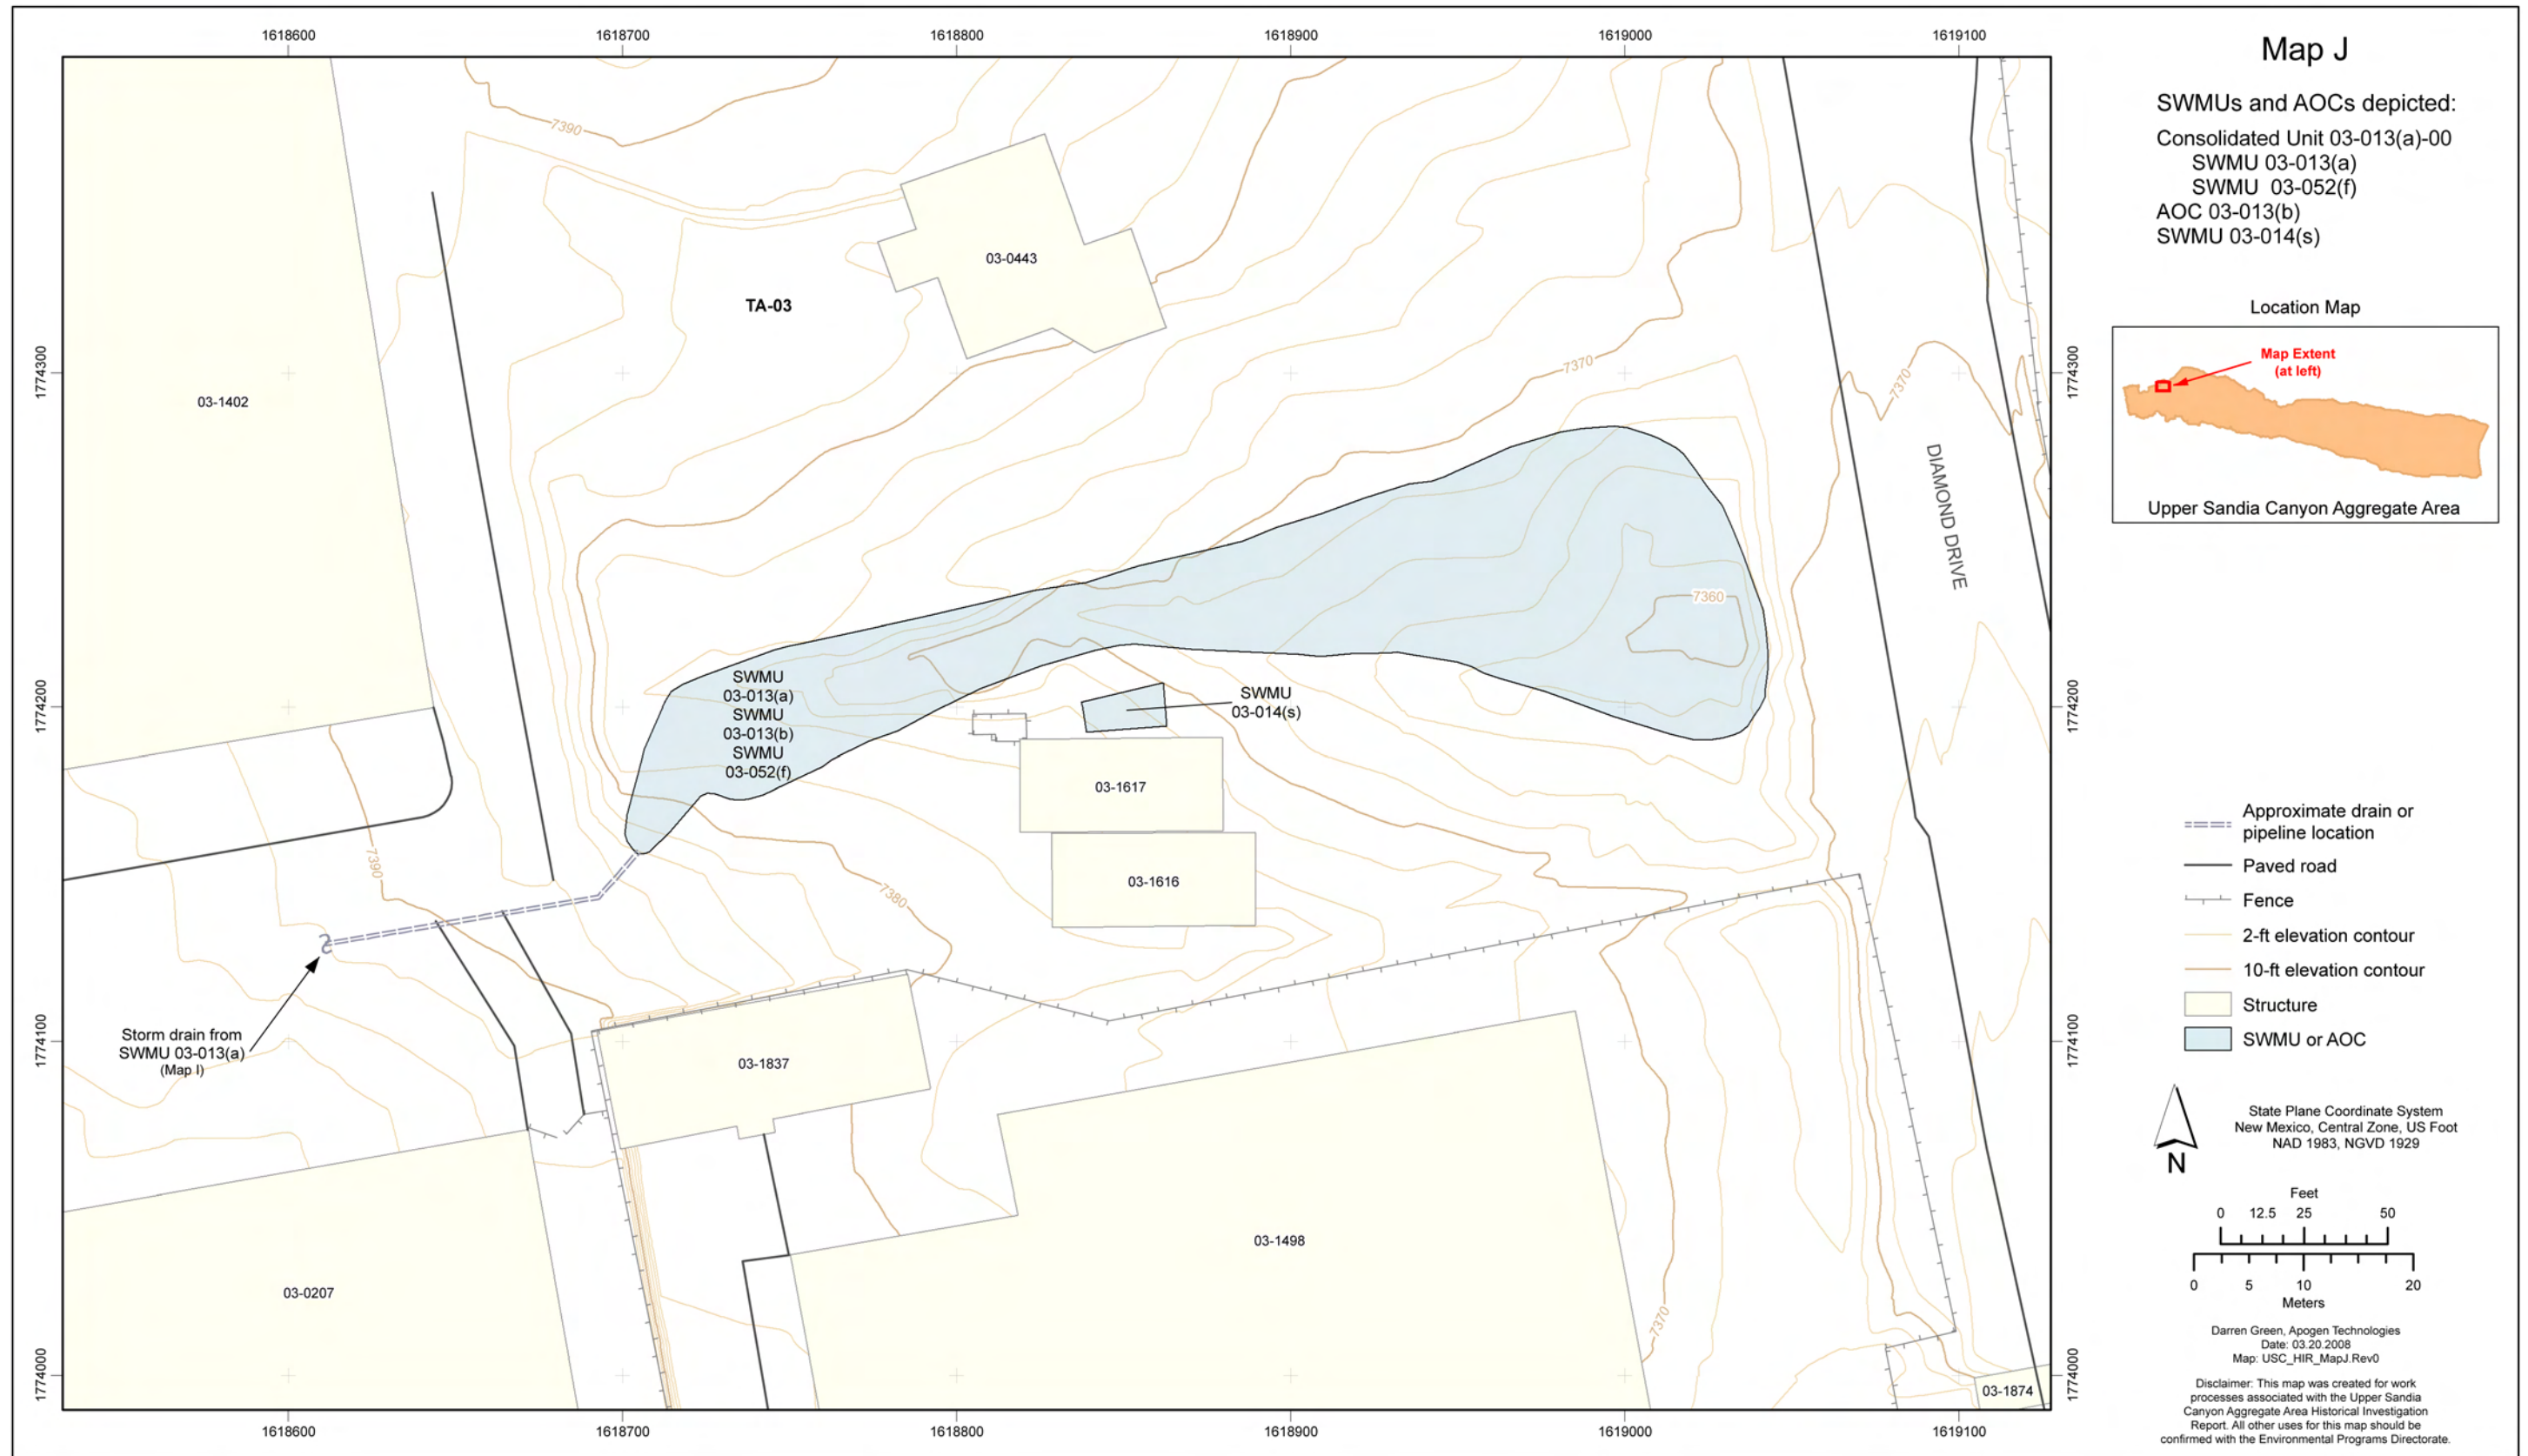


Figure 4.1-35 Map J site location



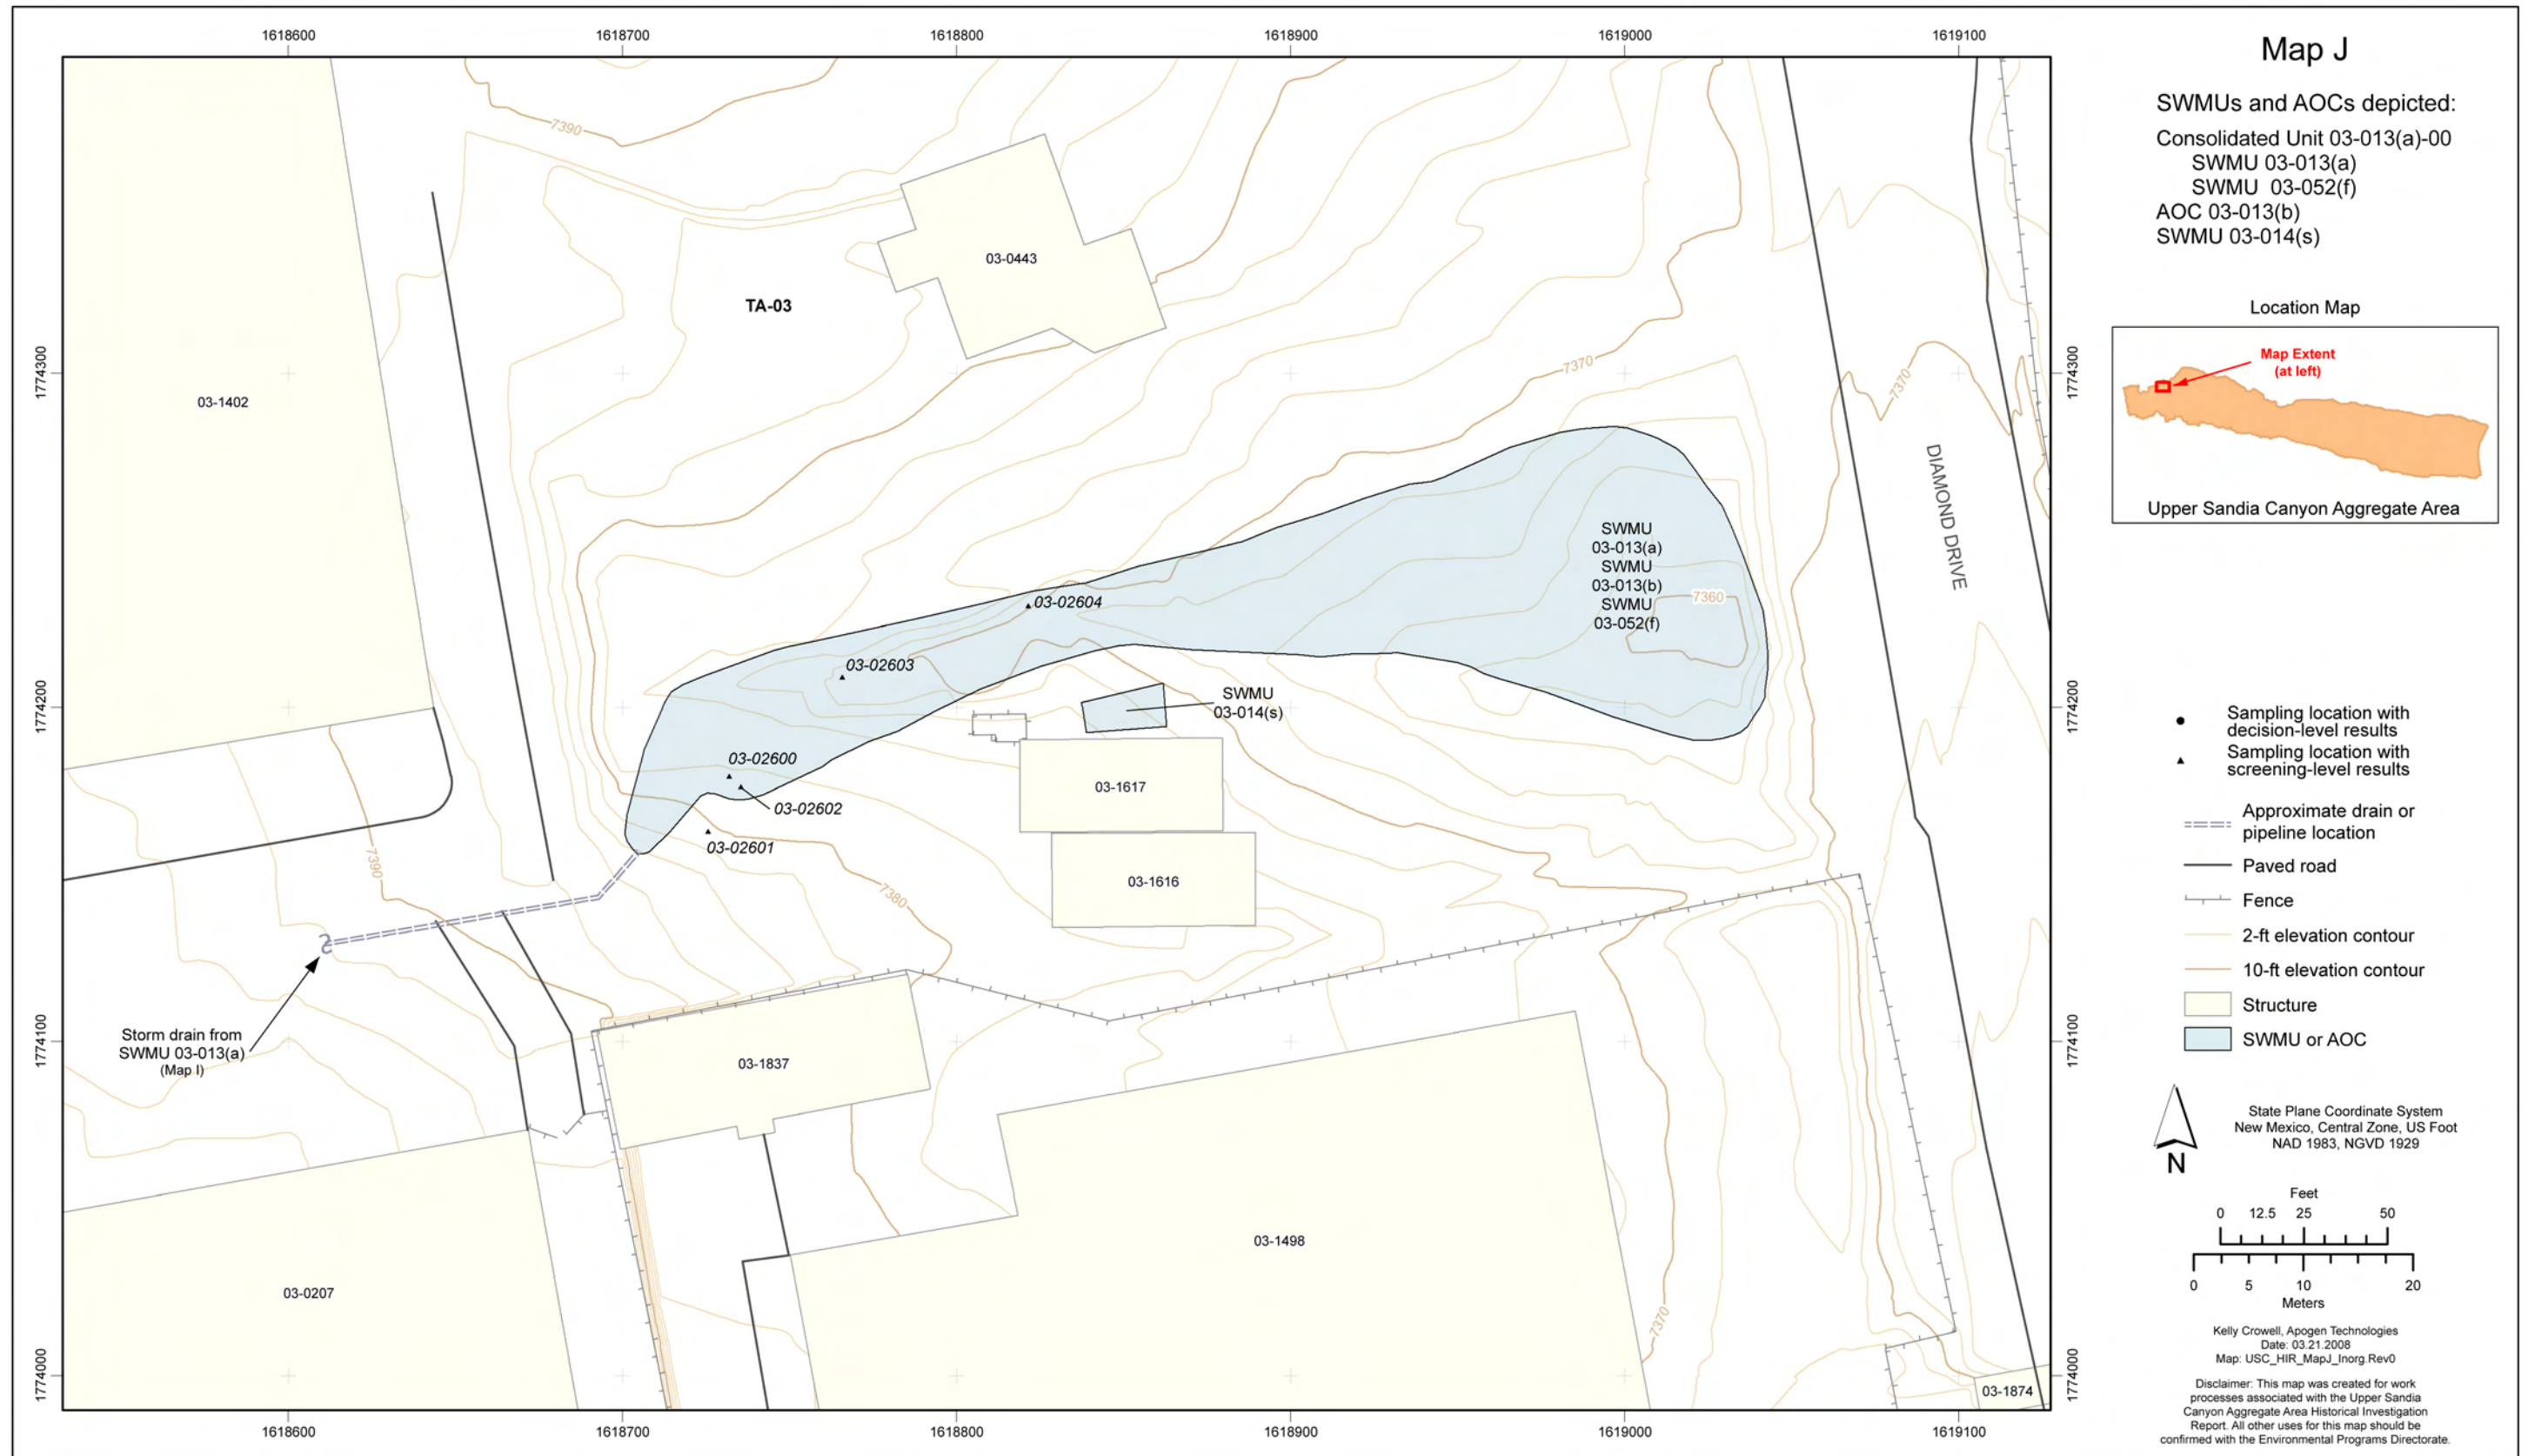


Figure 4.1-36 Map J inorganic chemical sampling locations

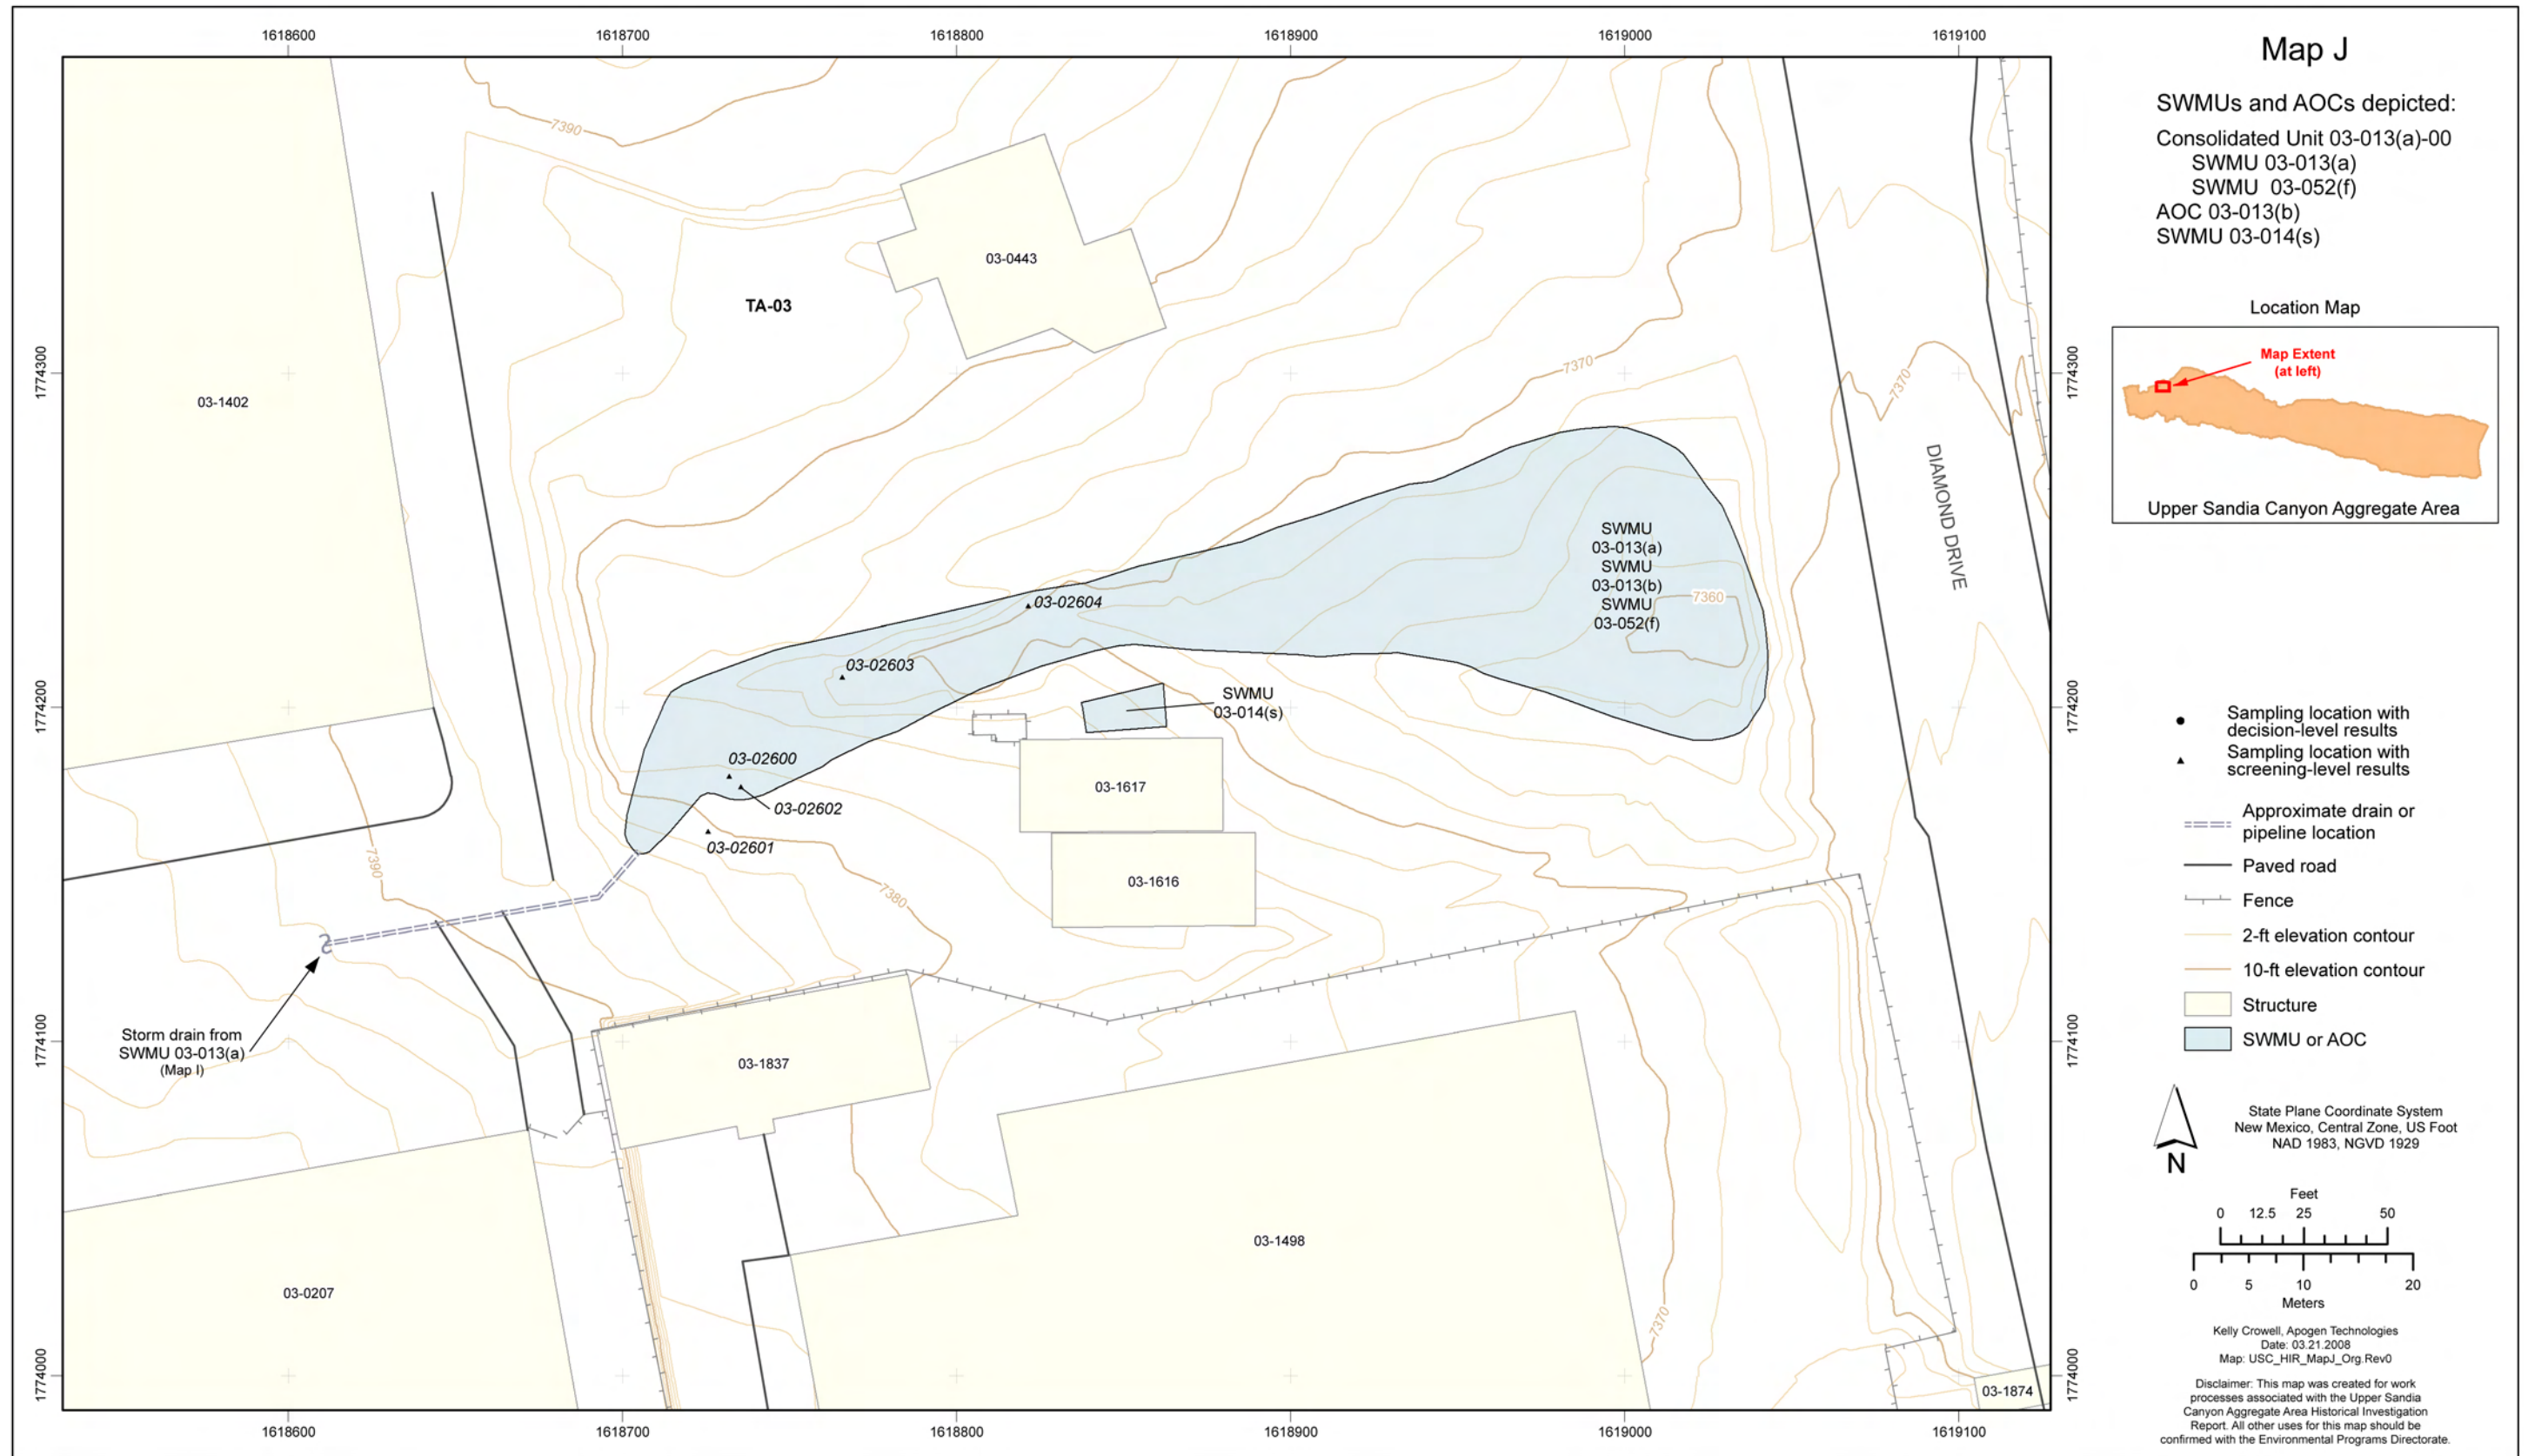


Figure 4.1-37 Map J organic chemical sampling locations



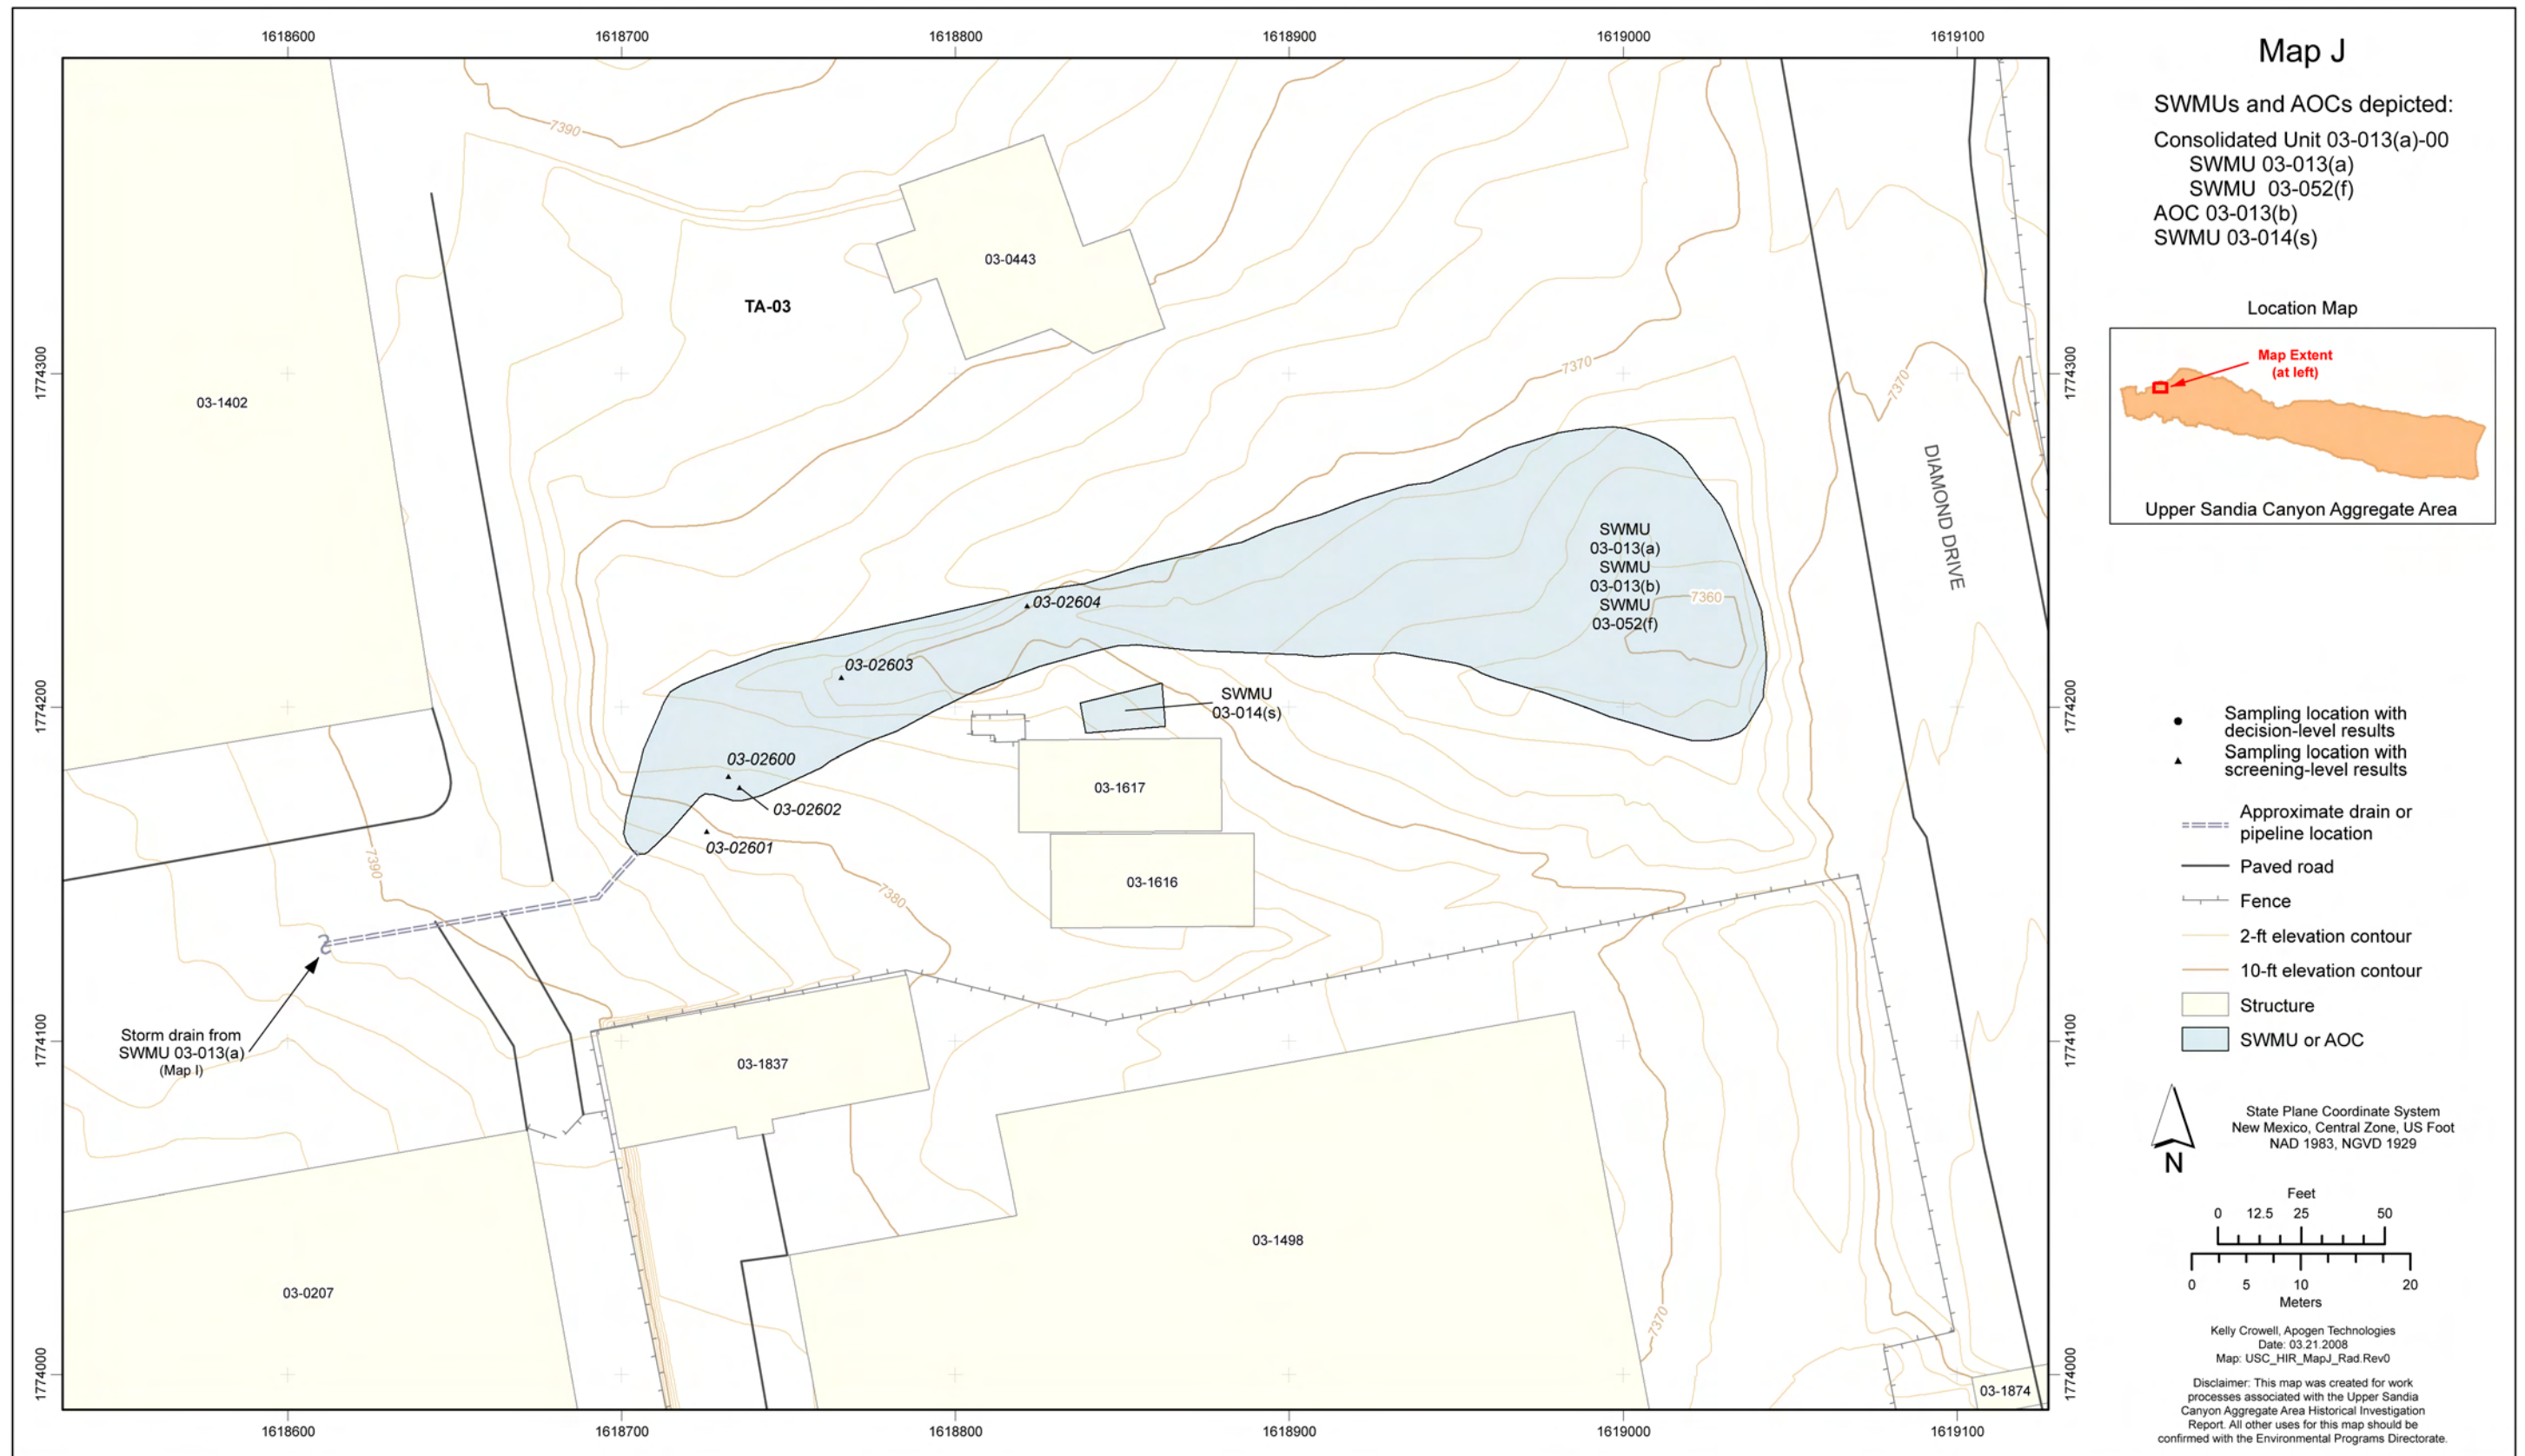


Figure 4.1-38 Map J radionuclide sampling locations

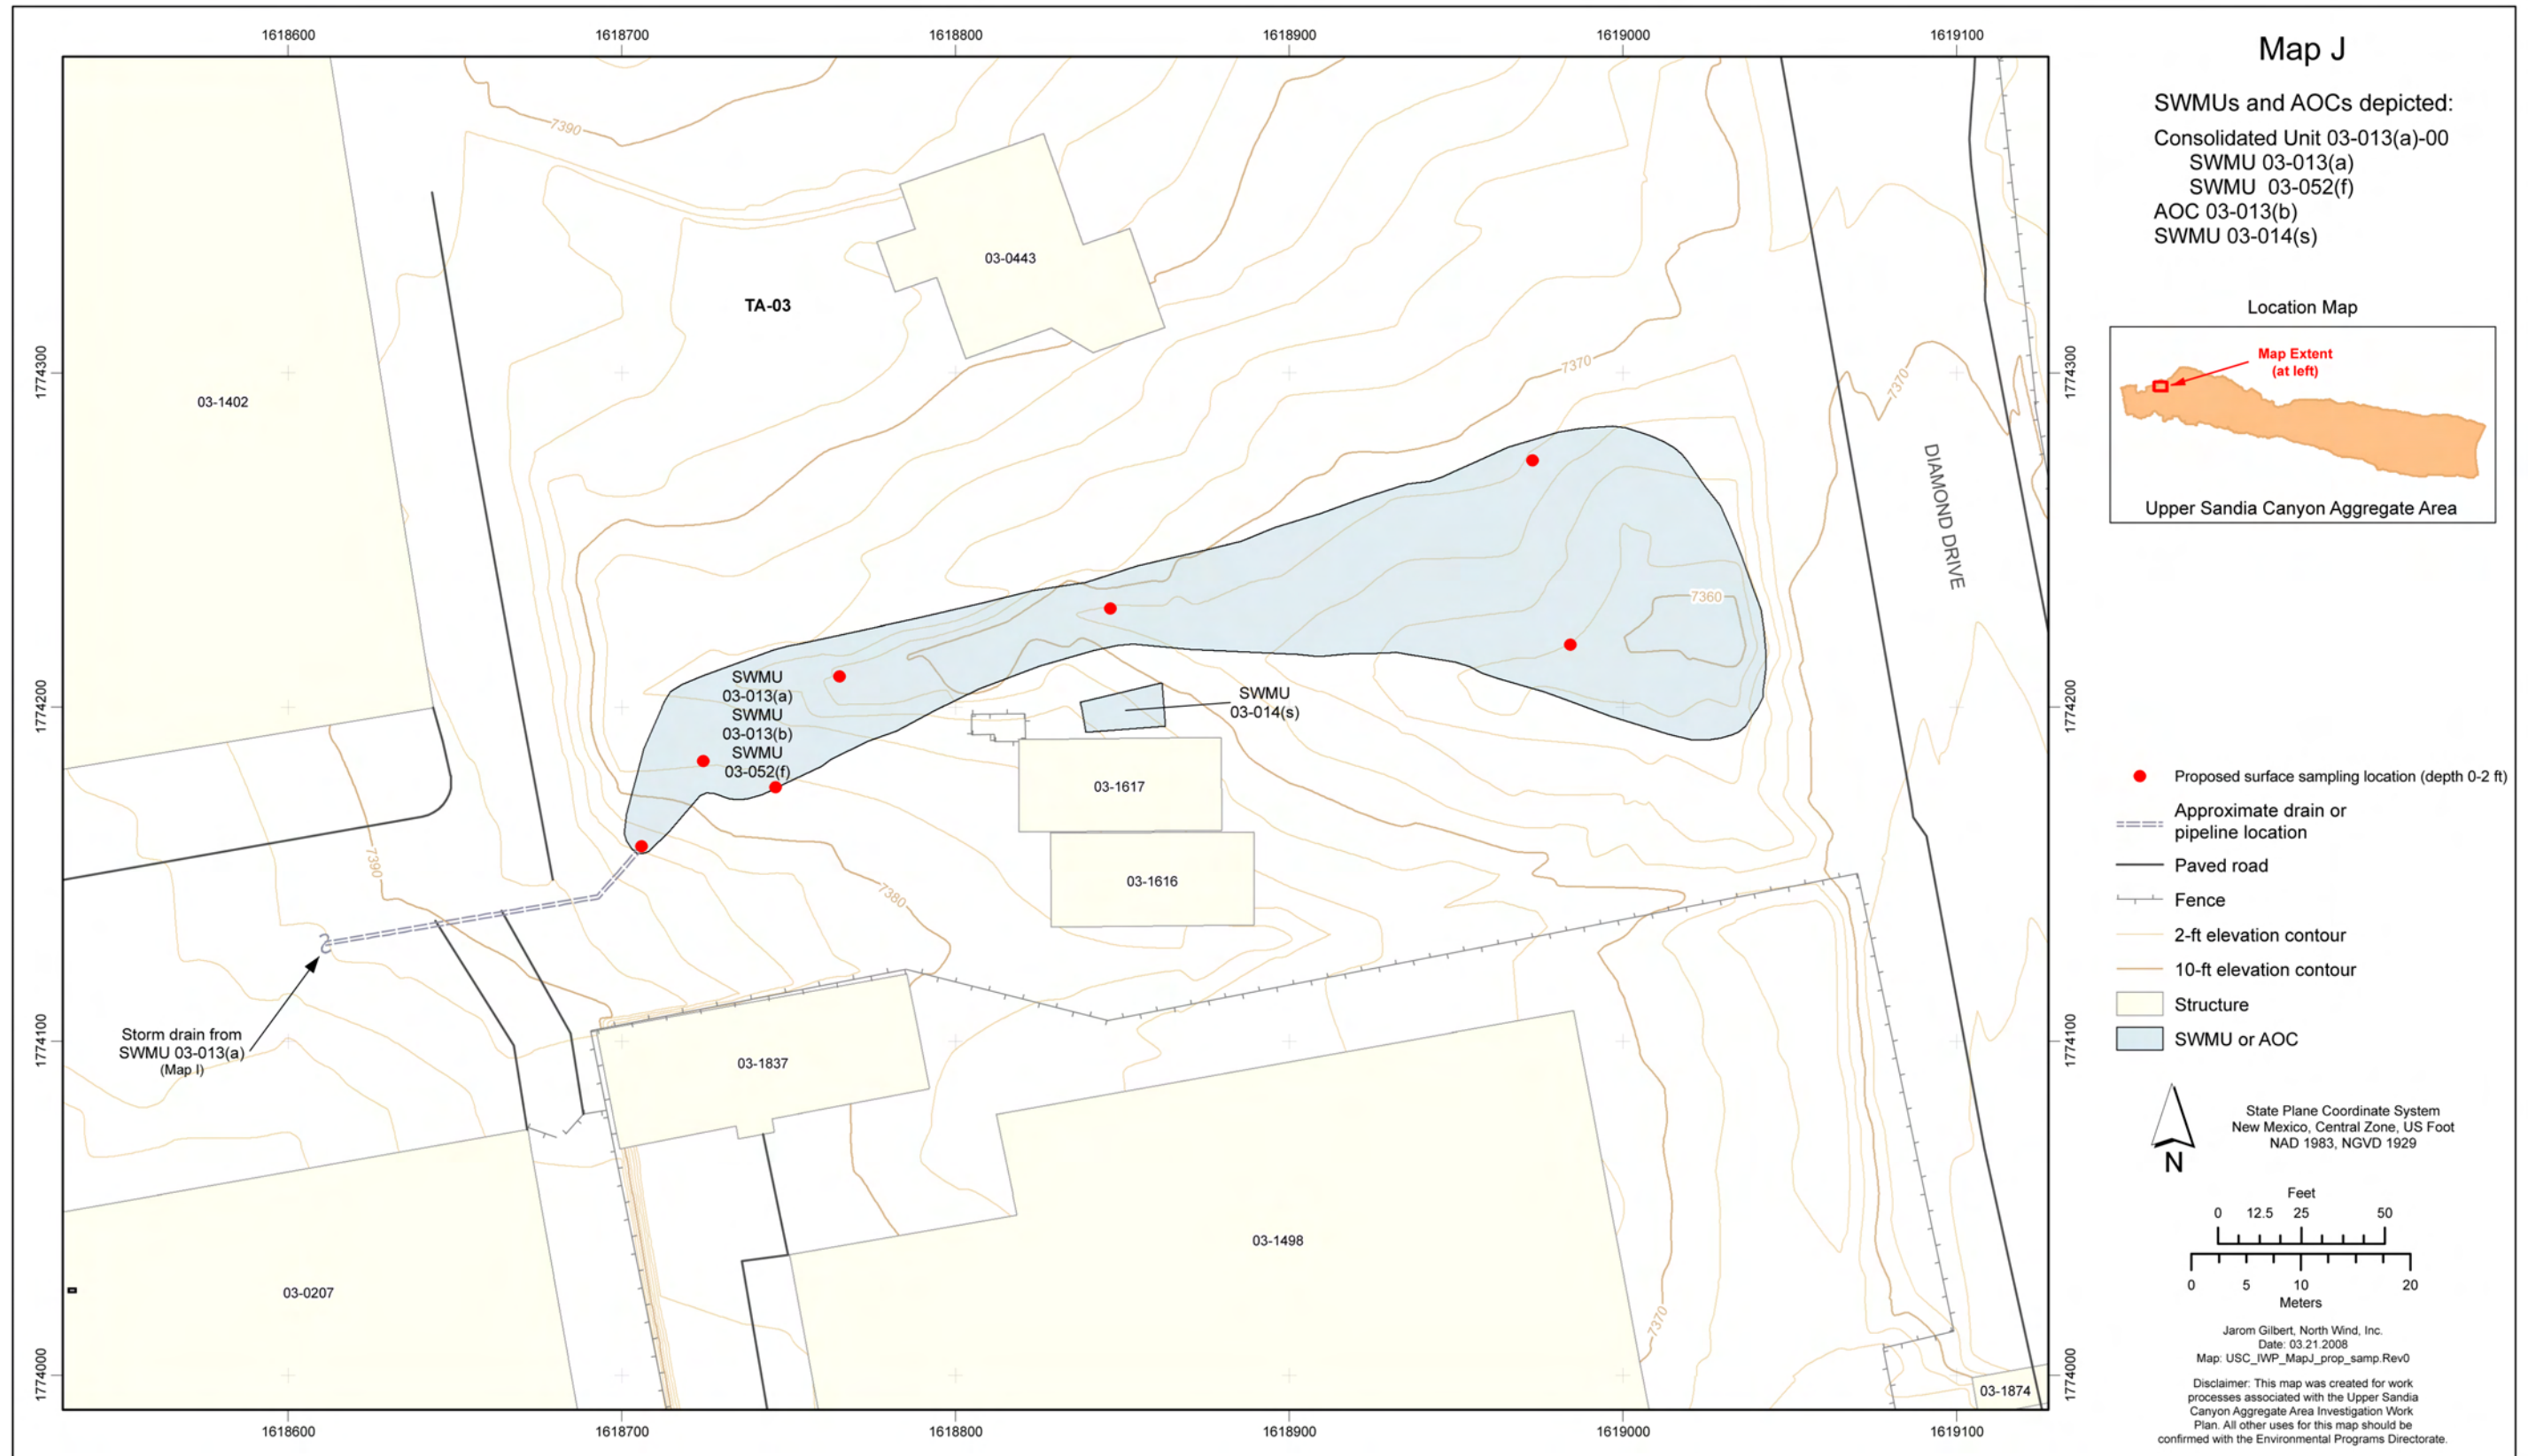


Figure 4.1-39 Map J proposed sampling locations



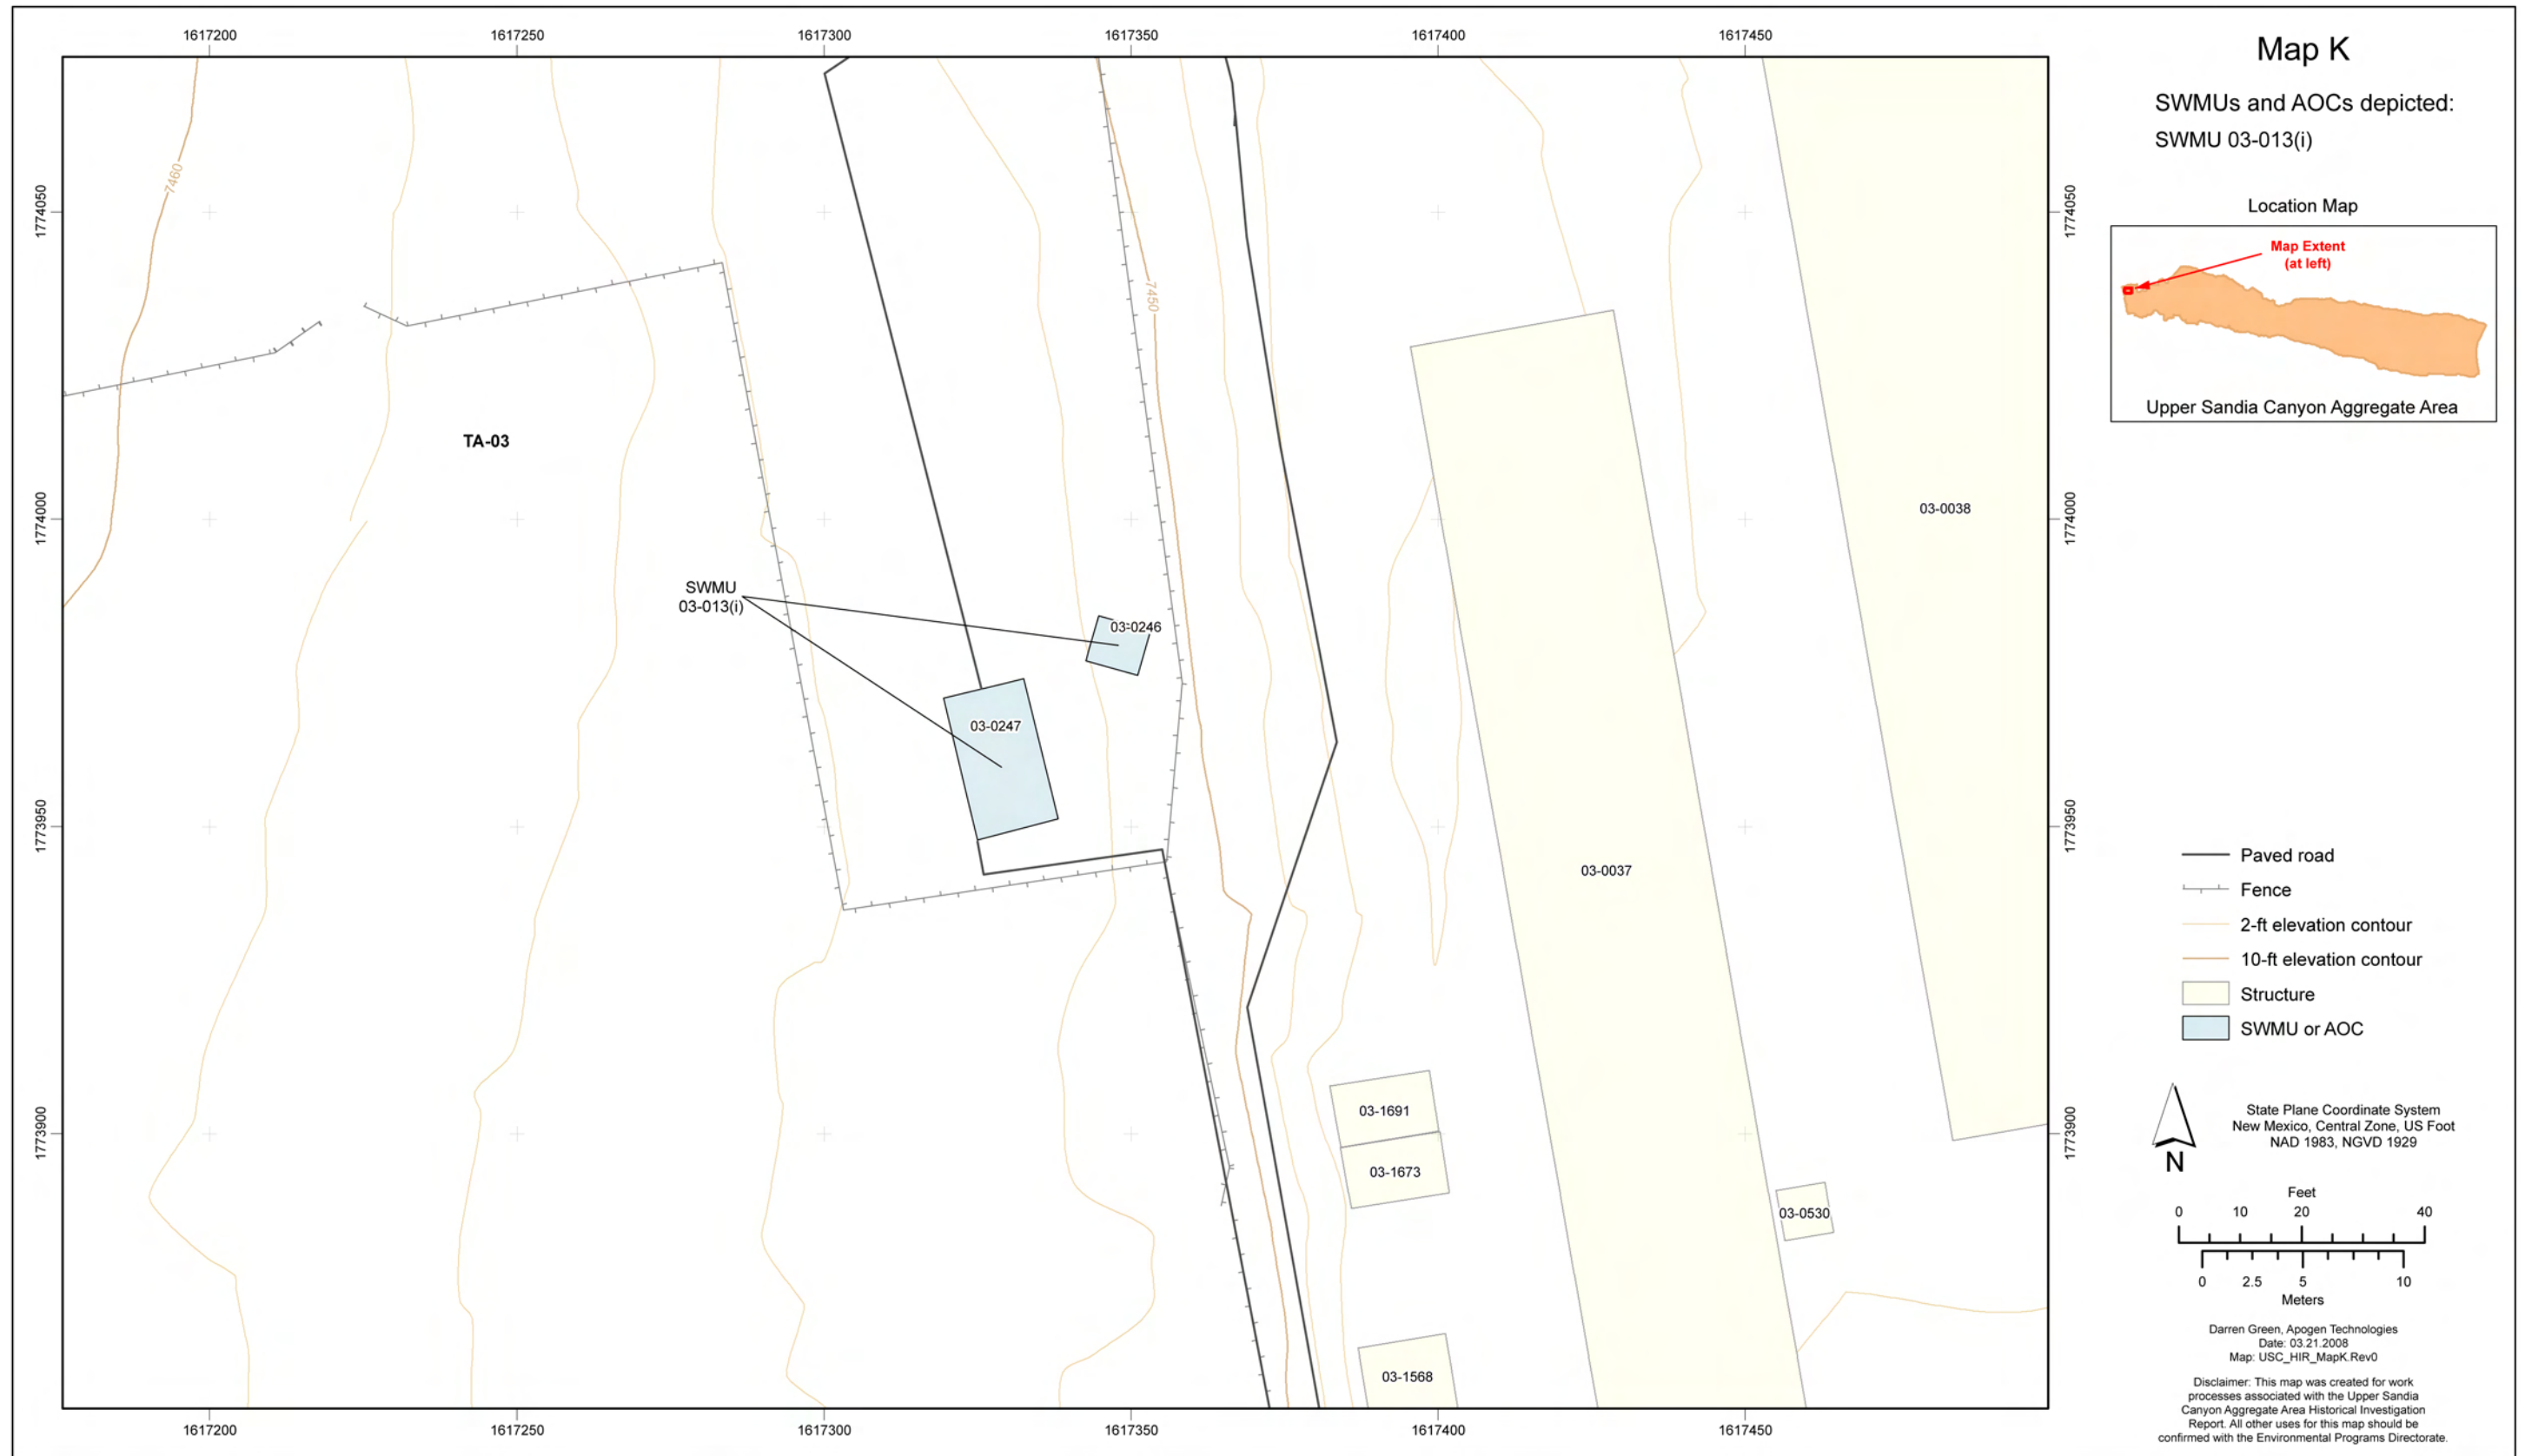


Figure 4.1-40 Map K site location

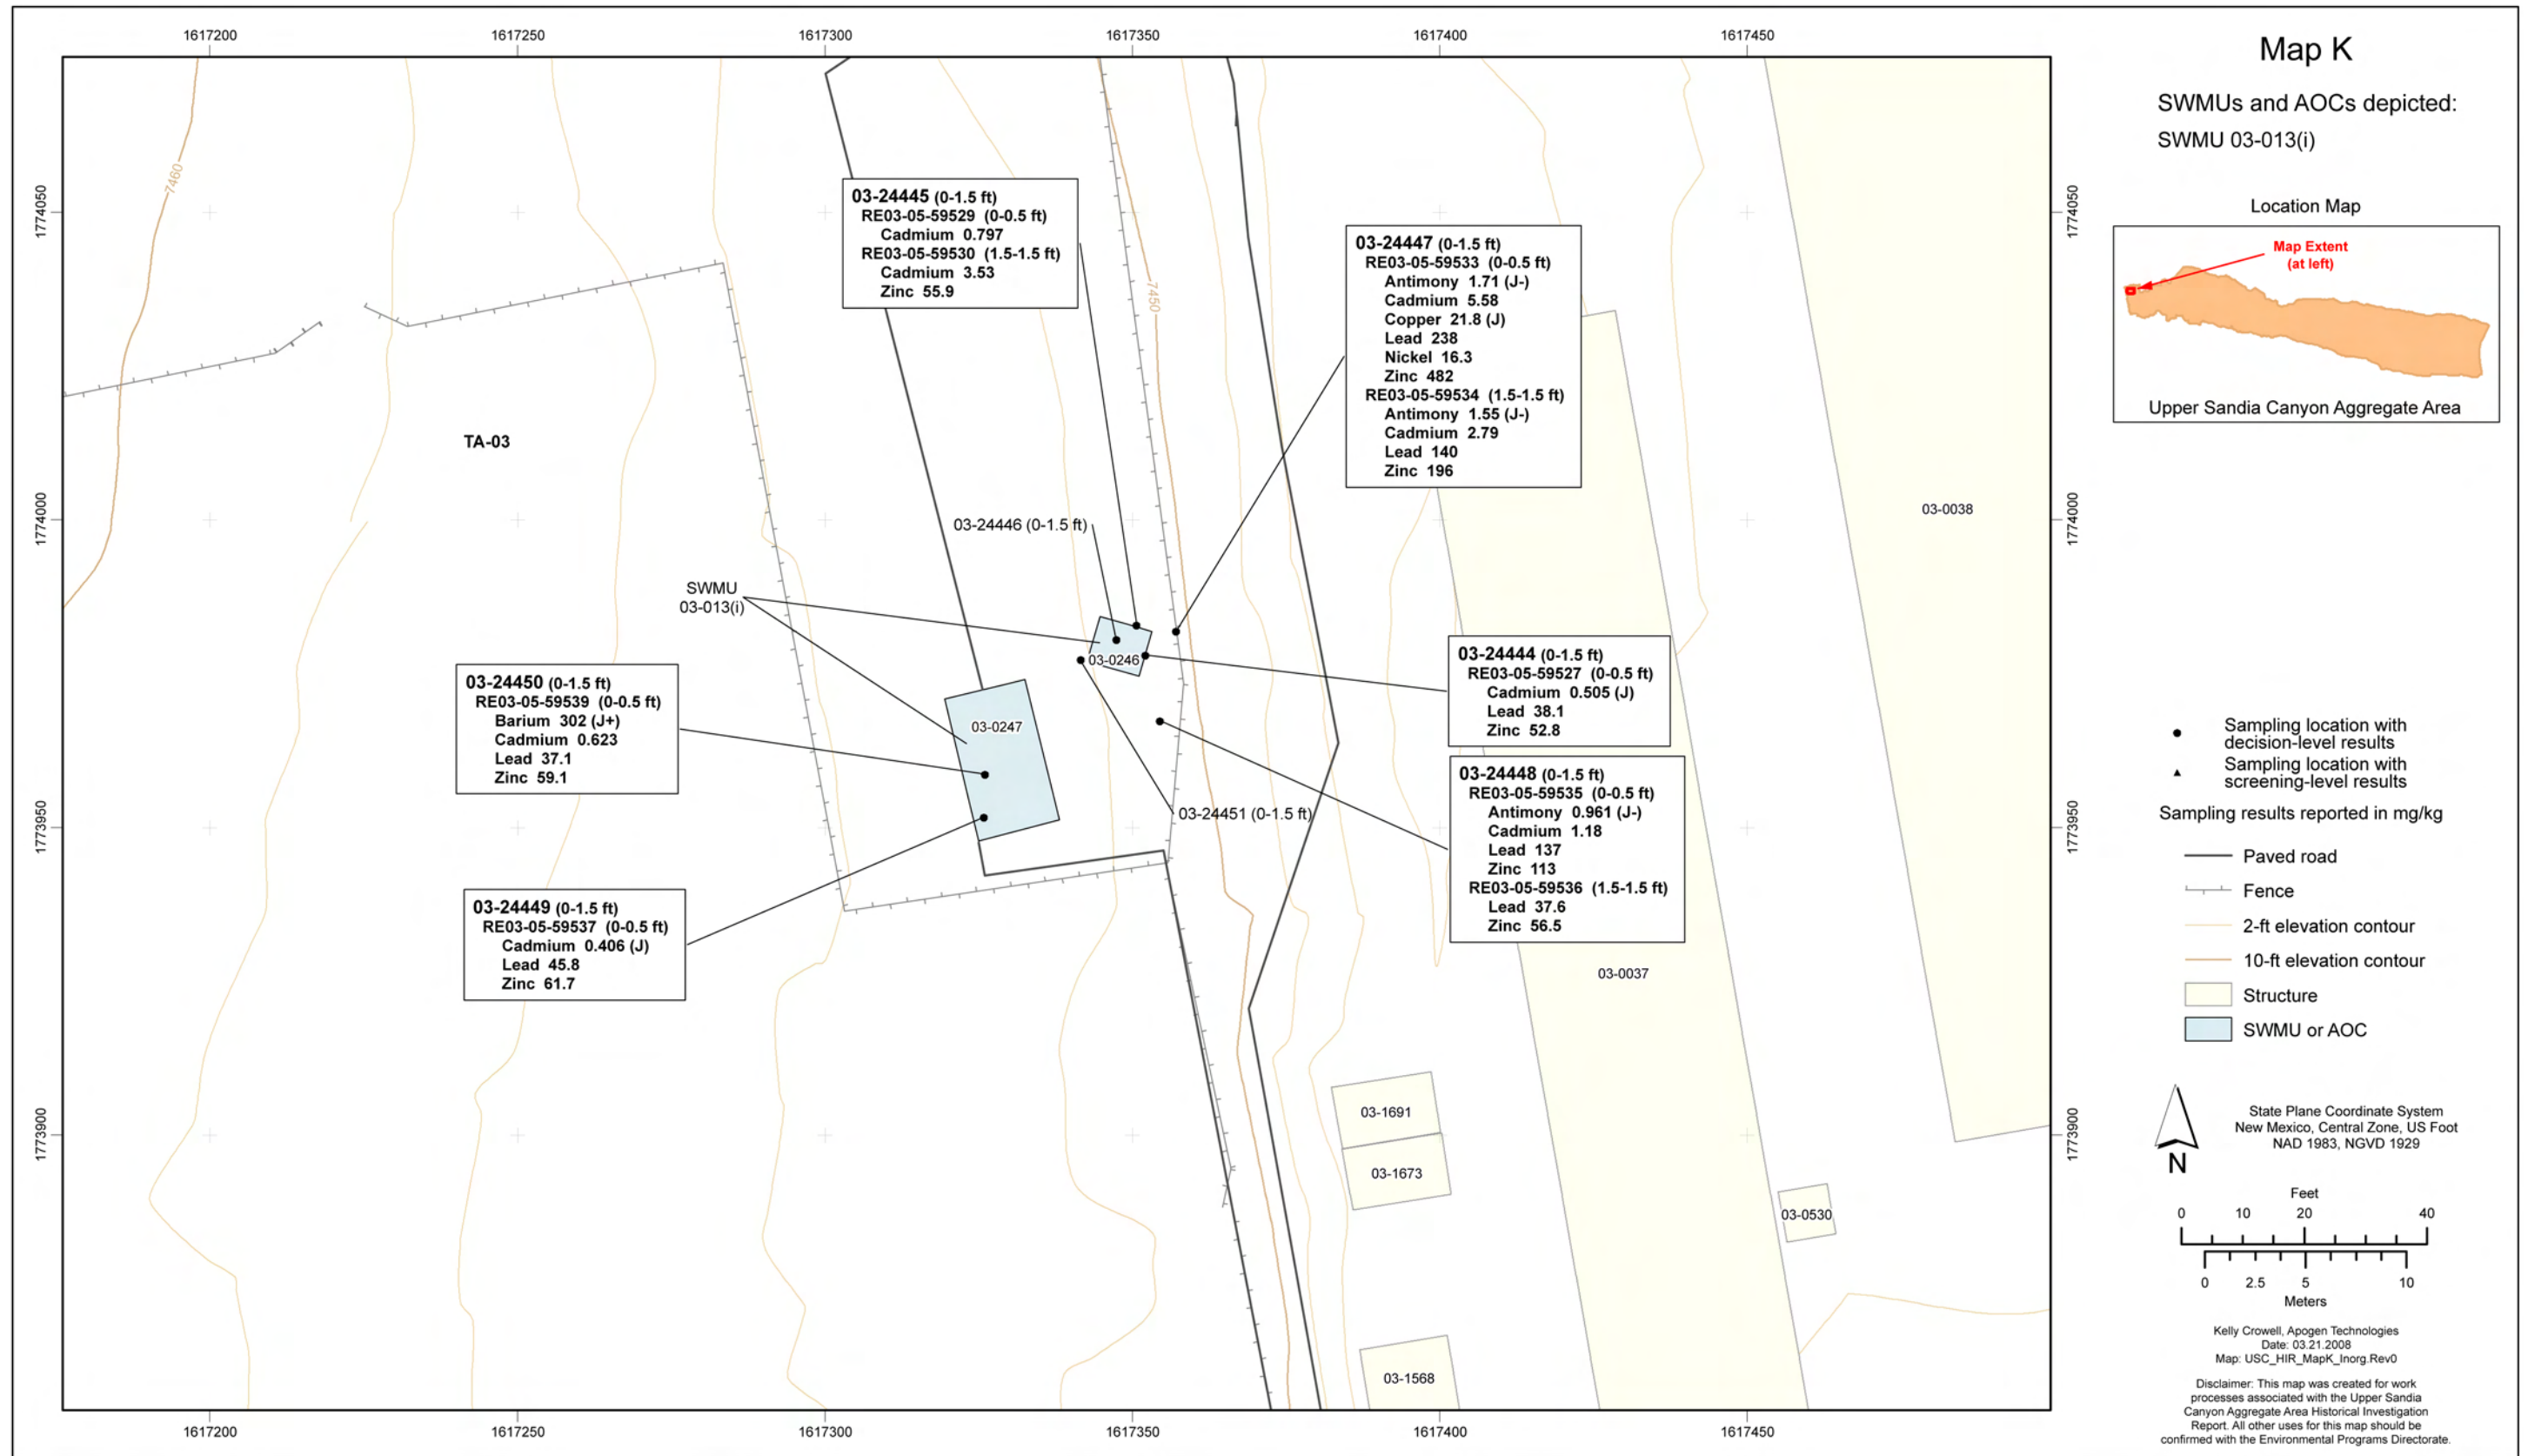


Figure 4.1-41 Map K inorganic chemical sampling locations and results detected above BVs

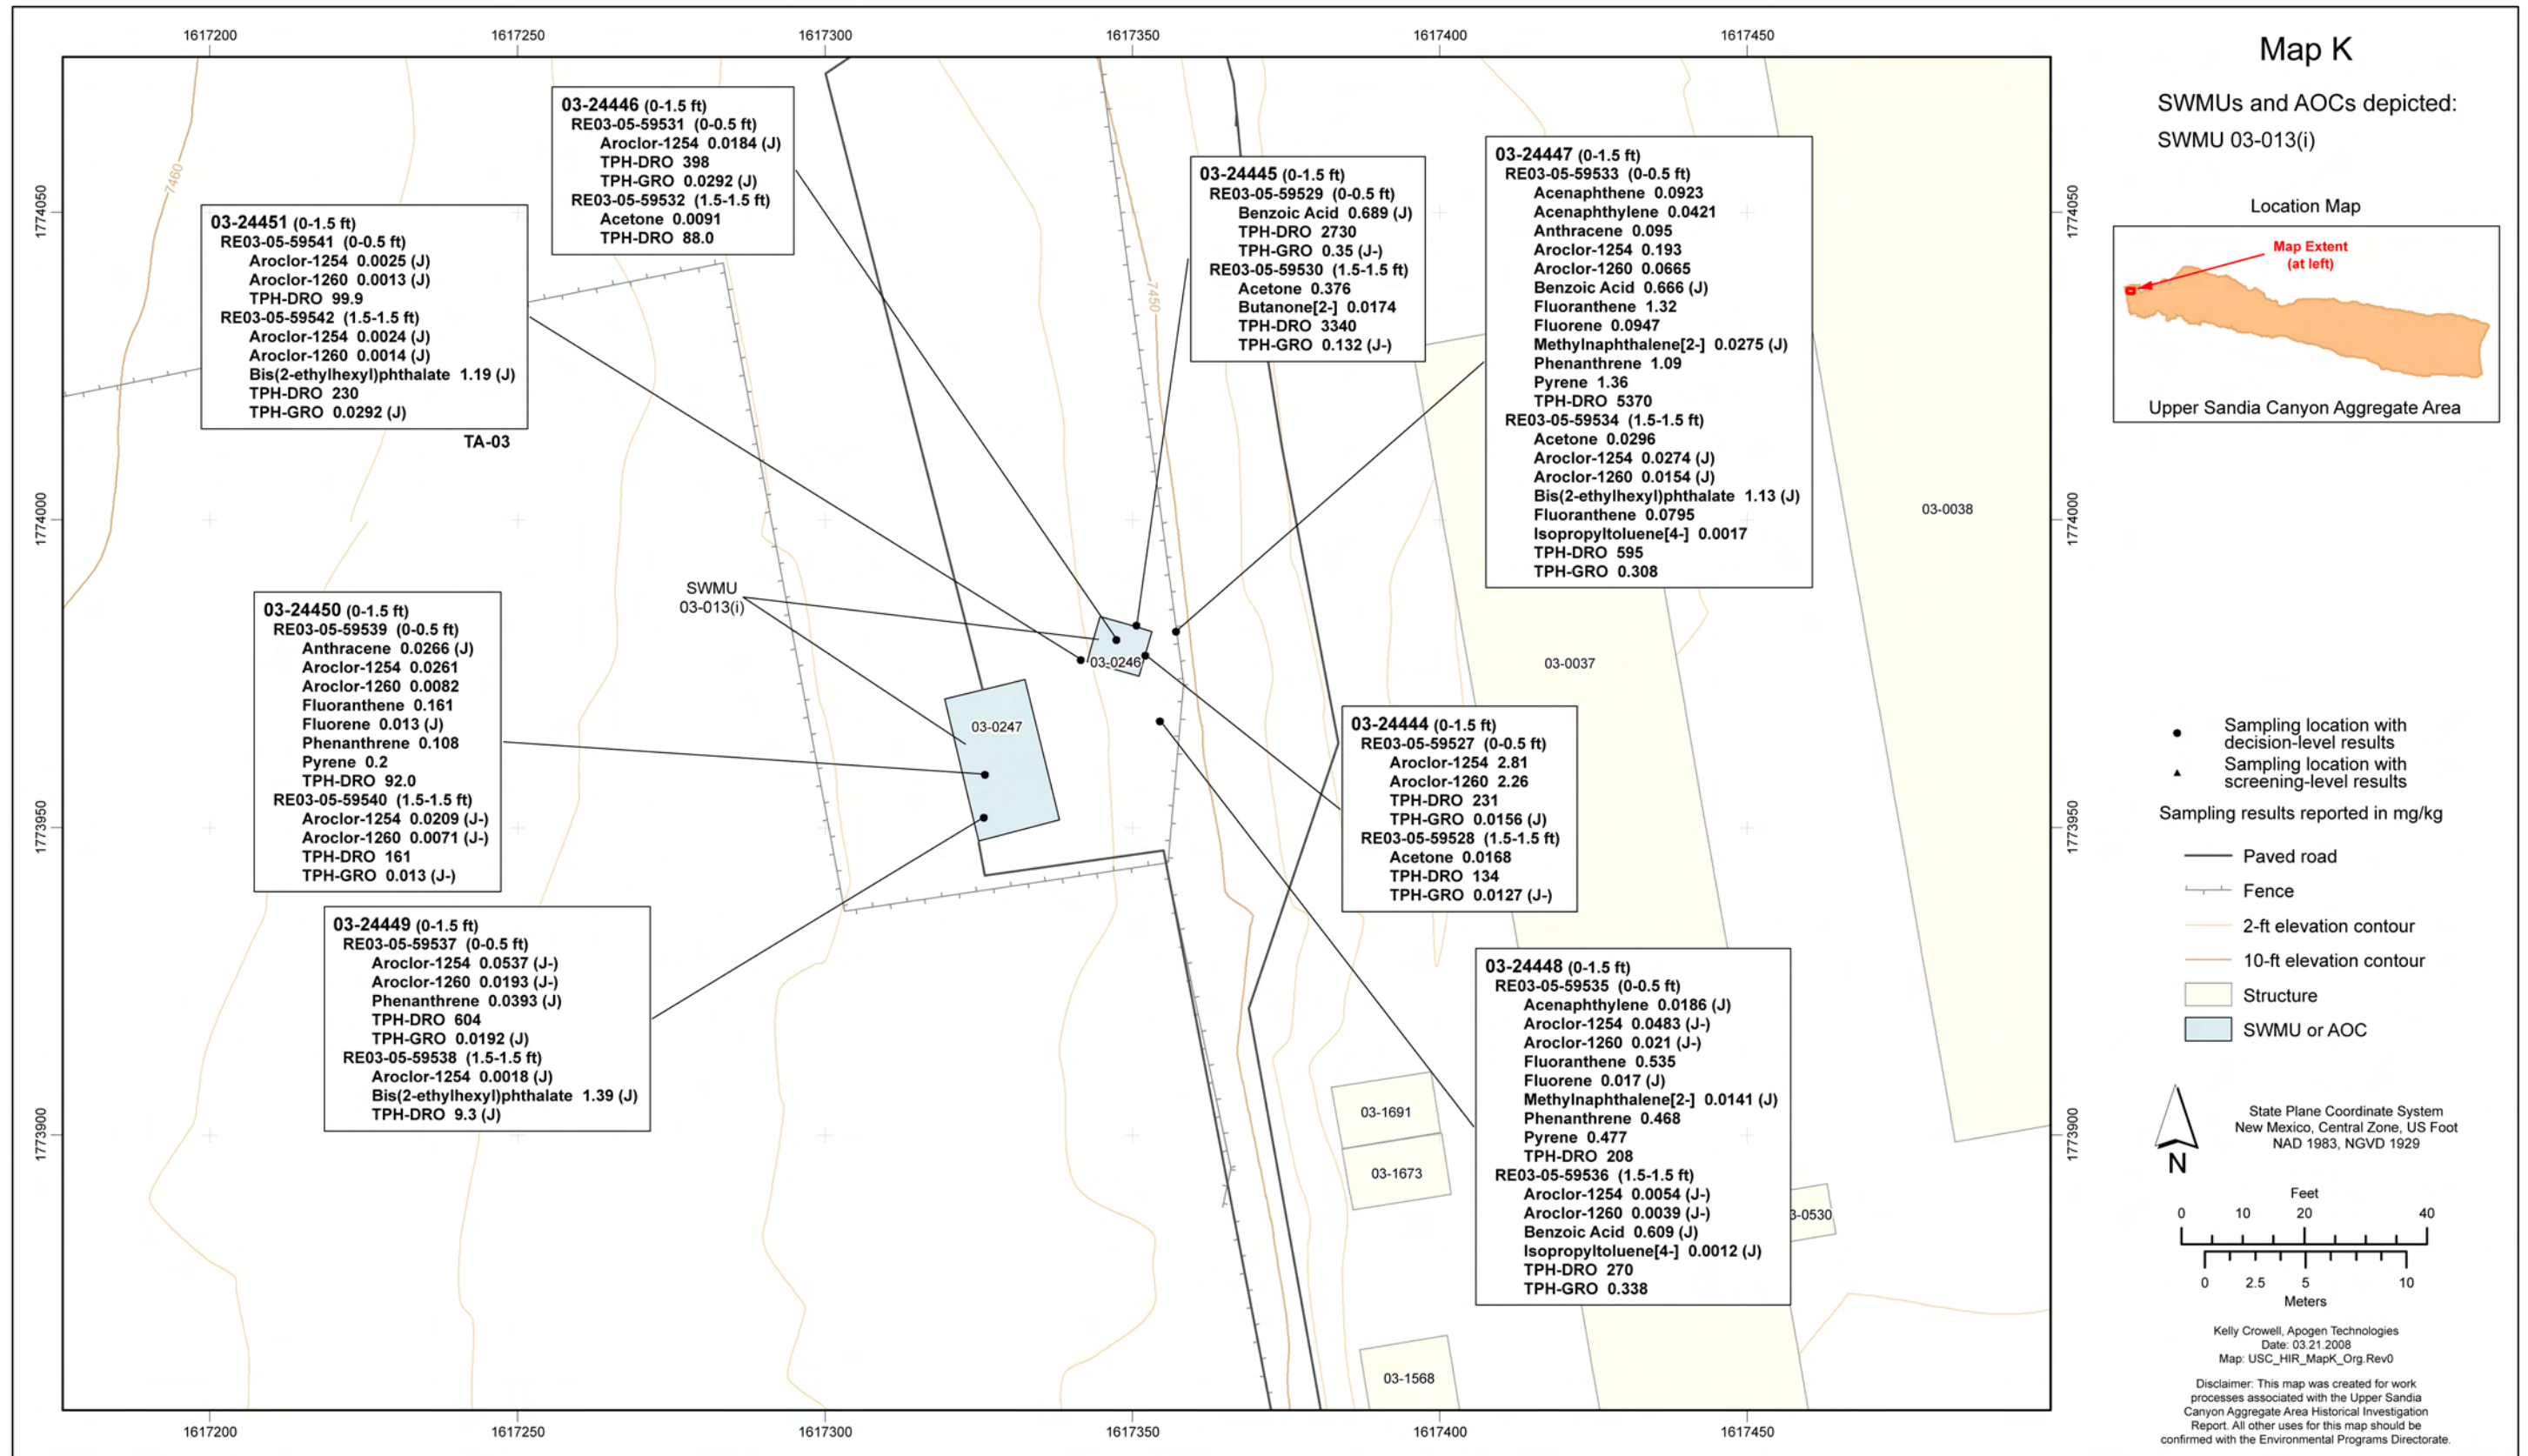


Figure 4.1-42 Map K organic chemical sampling locations and detected results



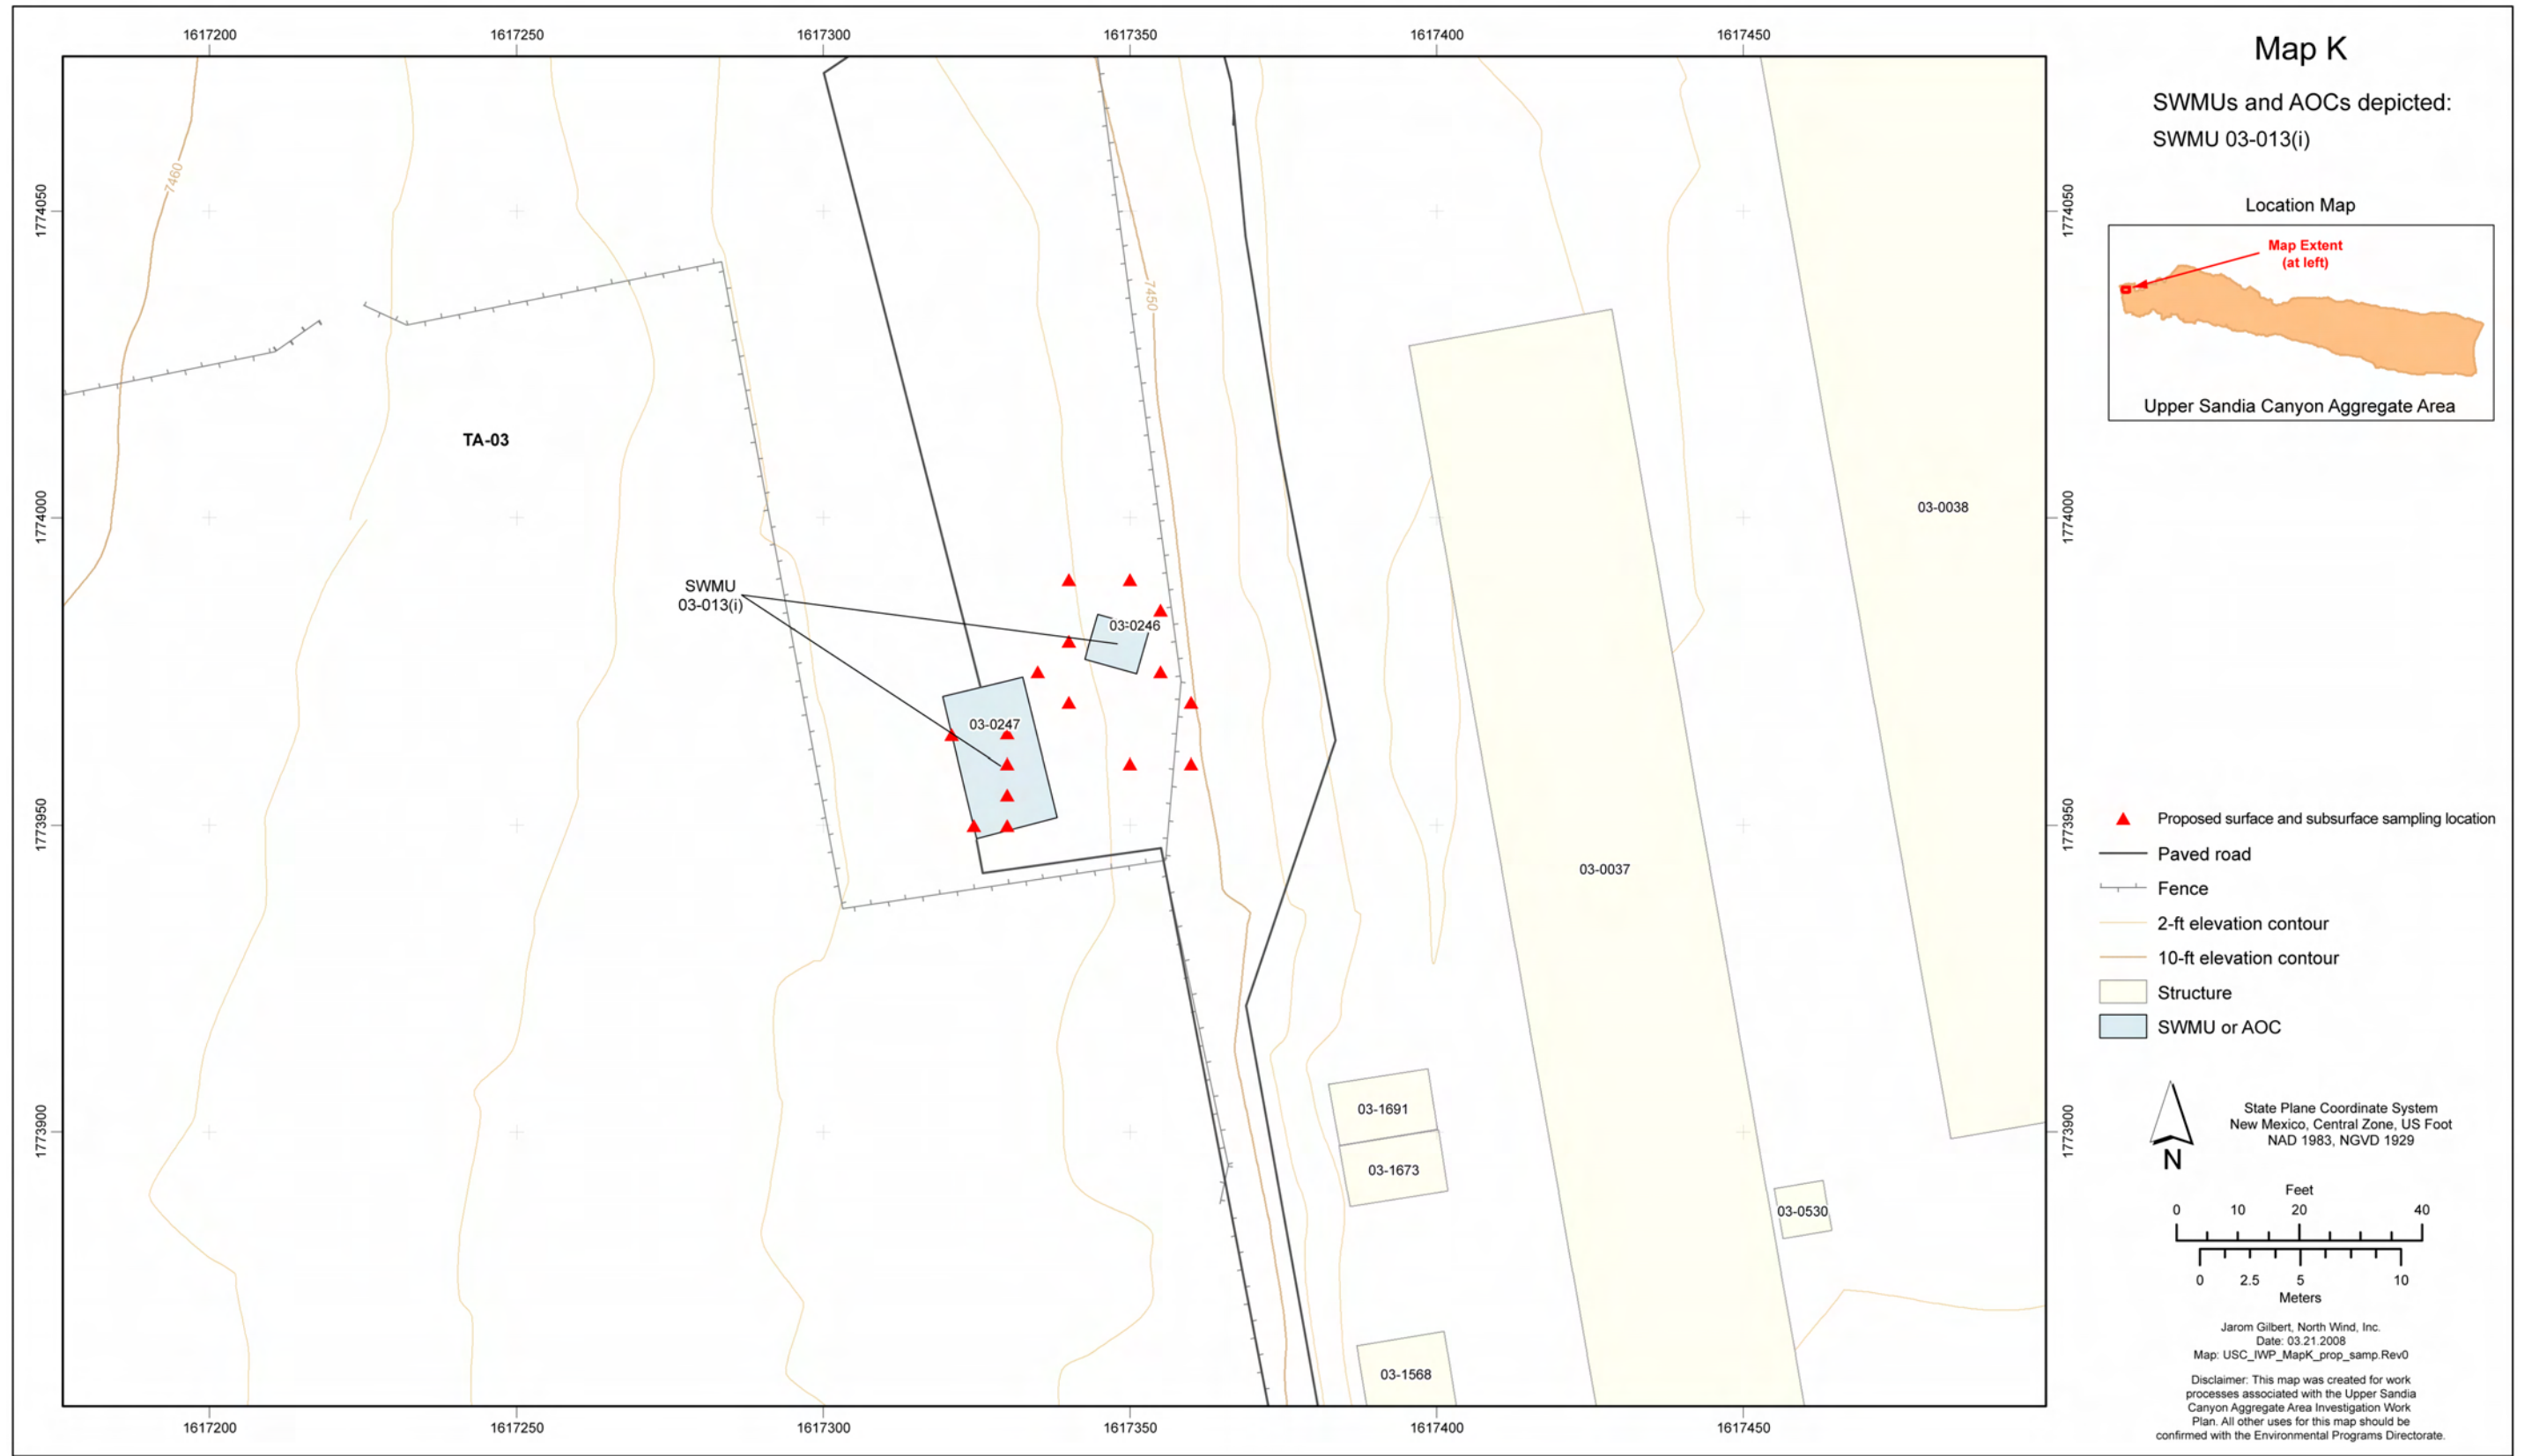


Figure 4.1-43 Map K proposed sampling locations



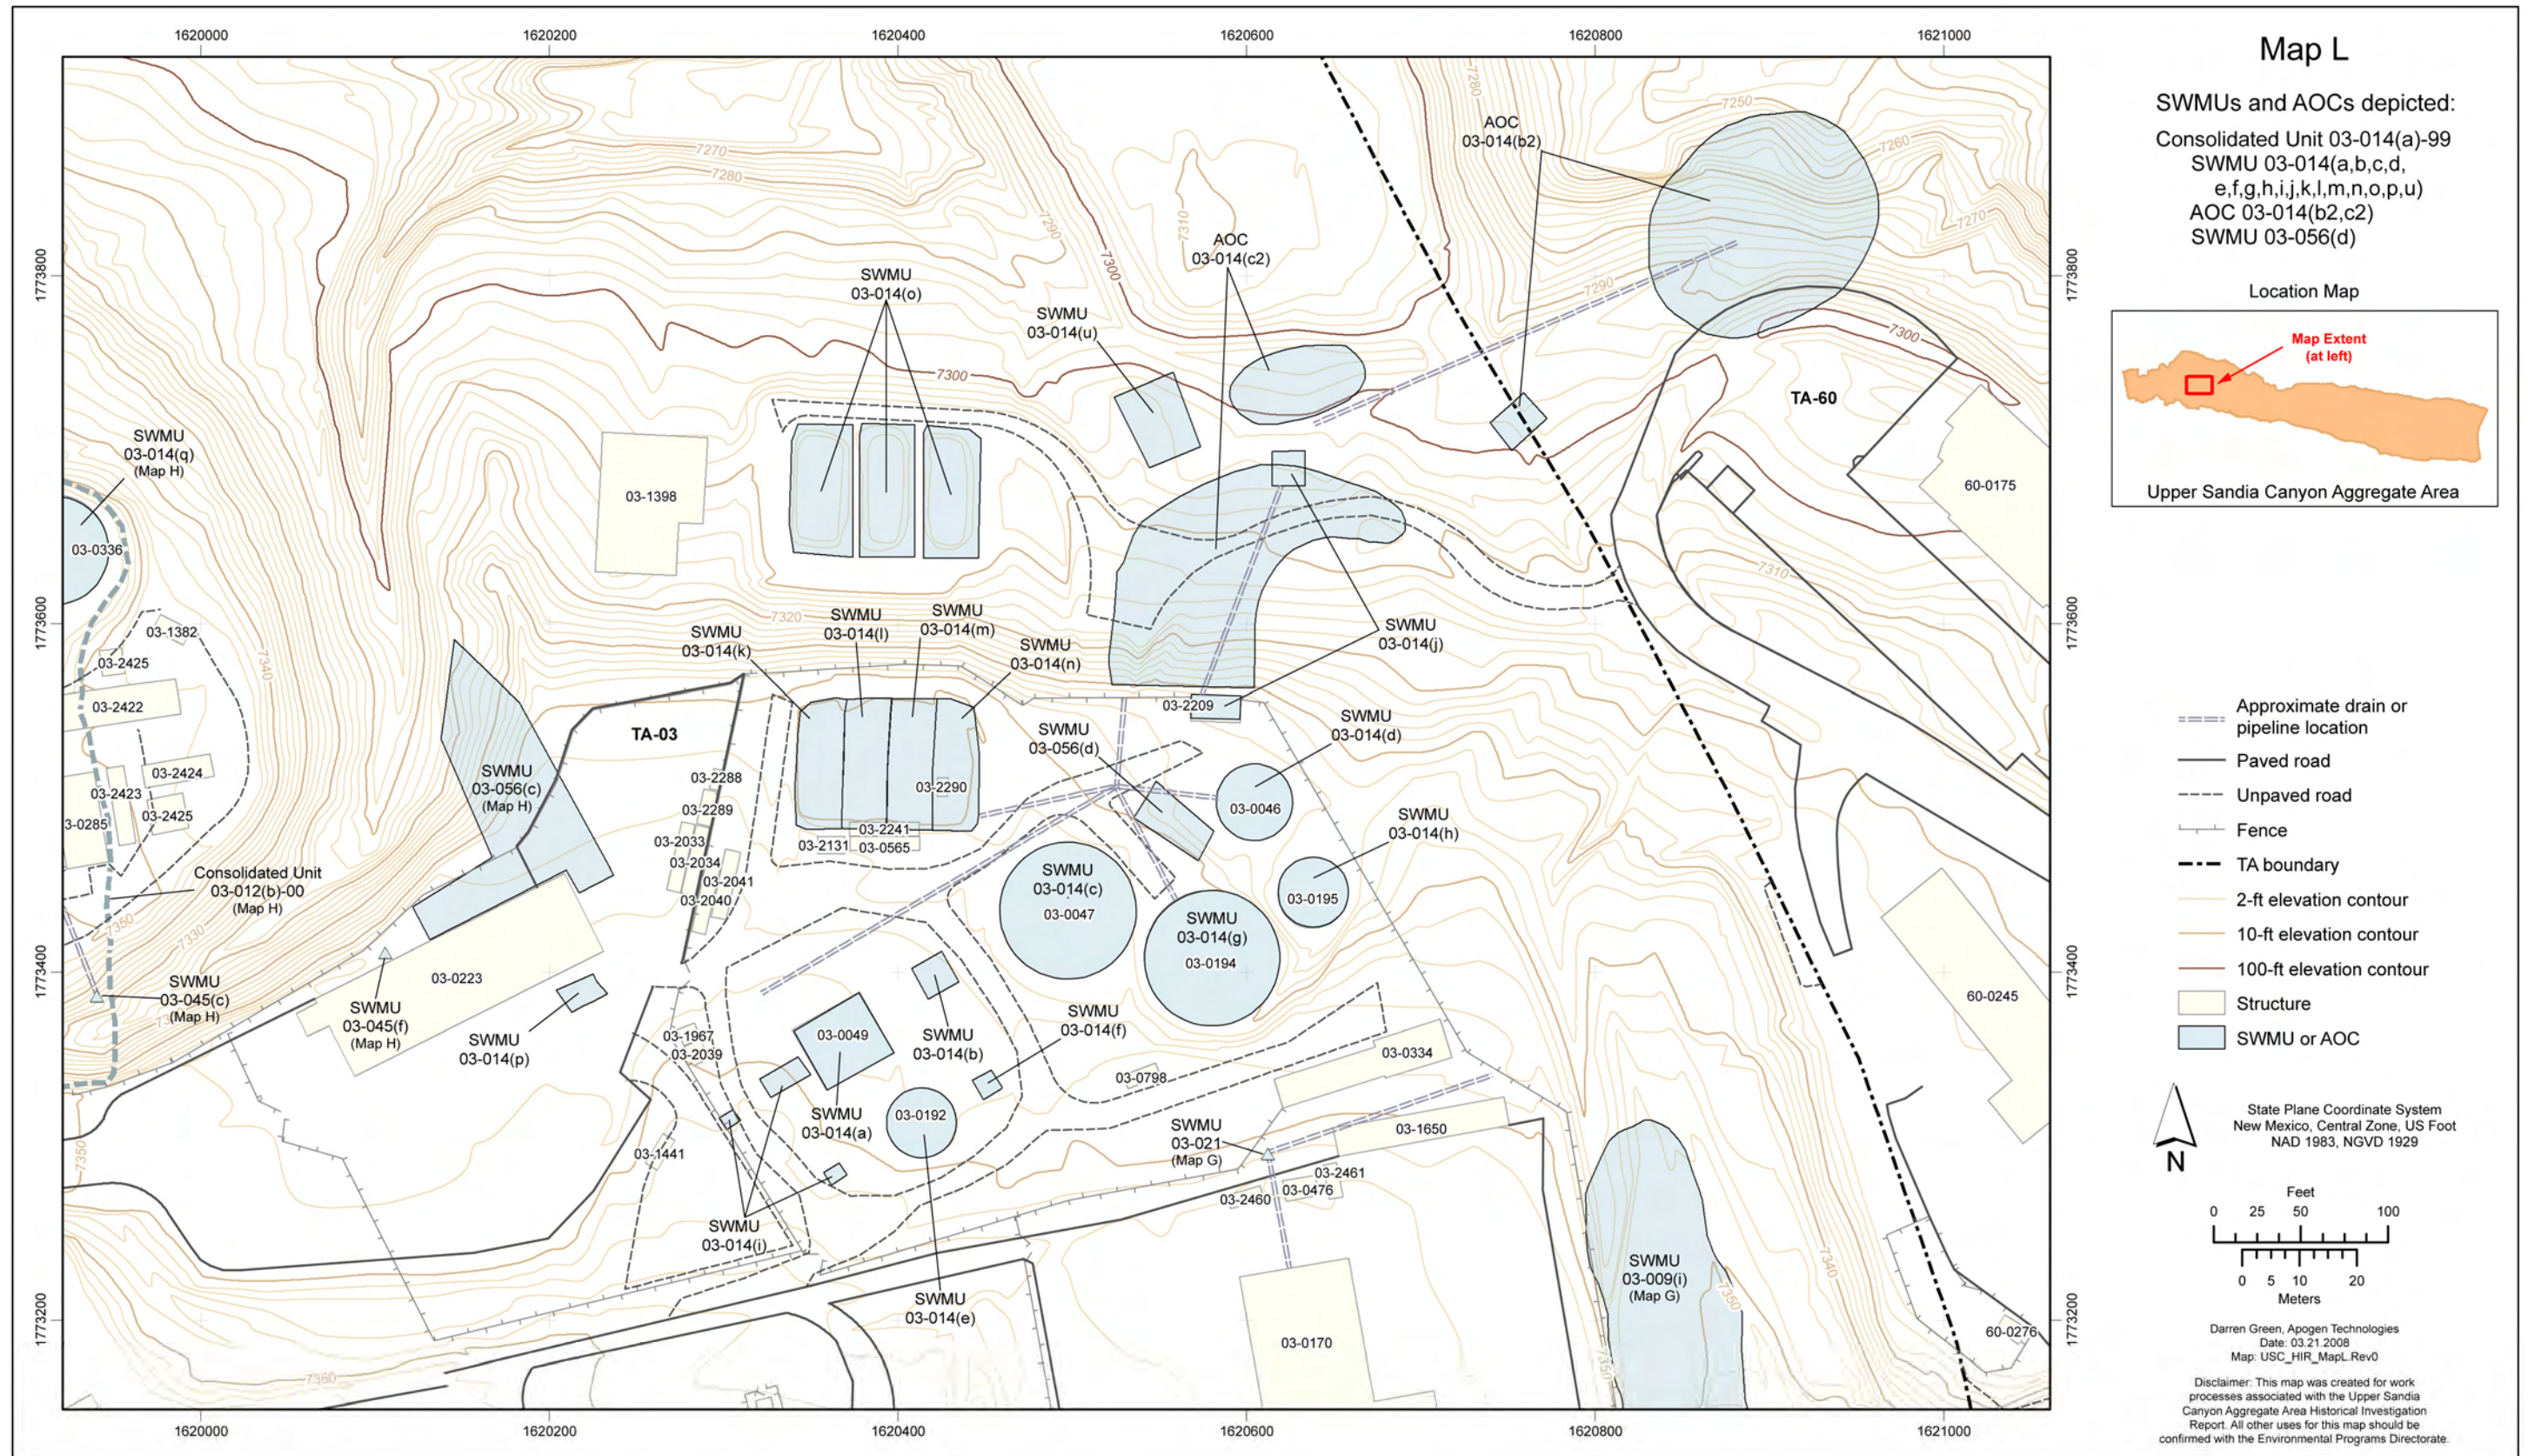


Figure 4.1-44 Map L site location



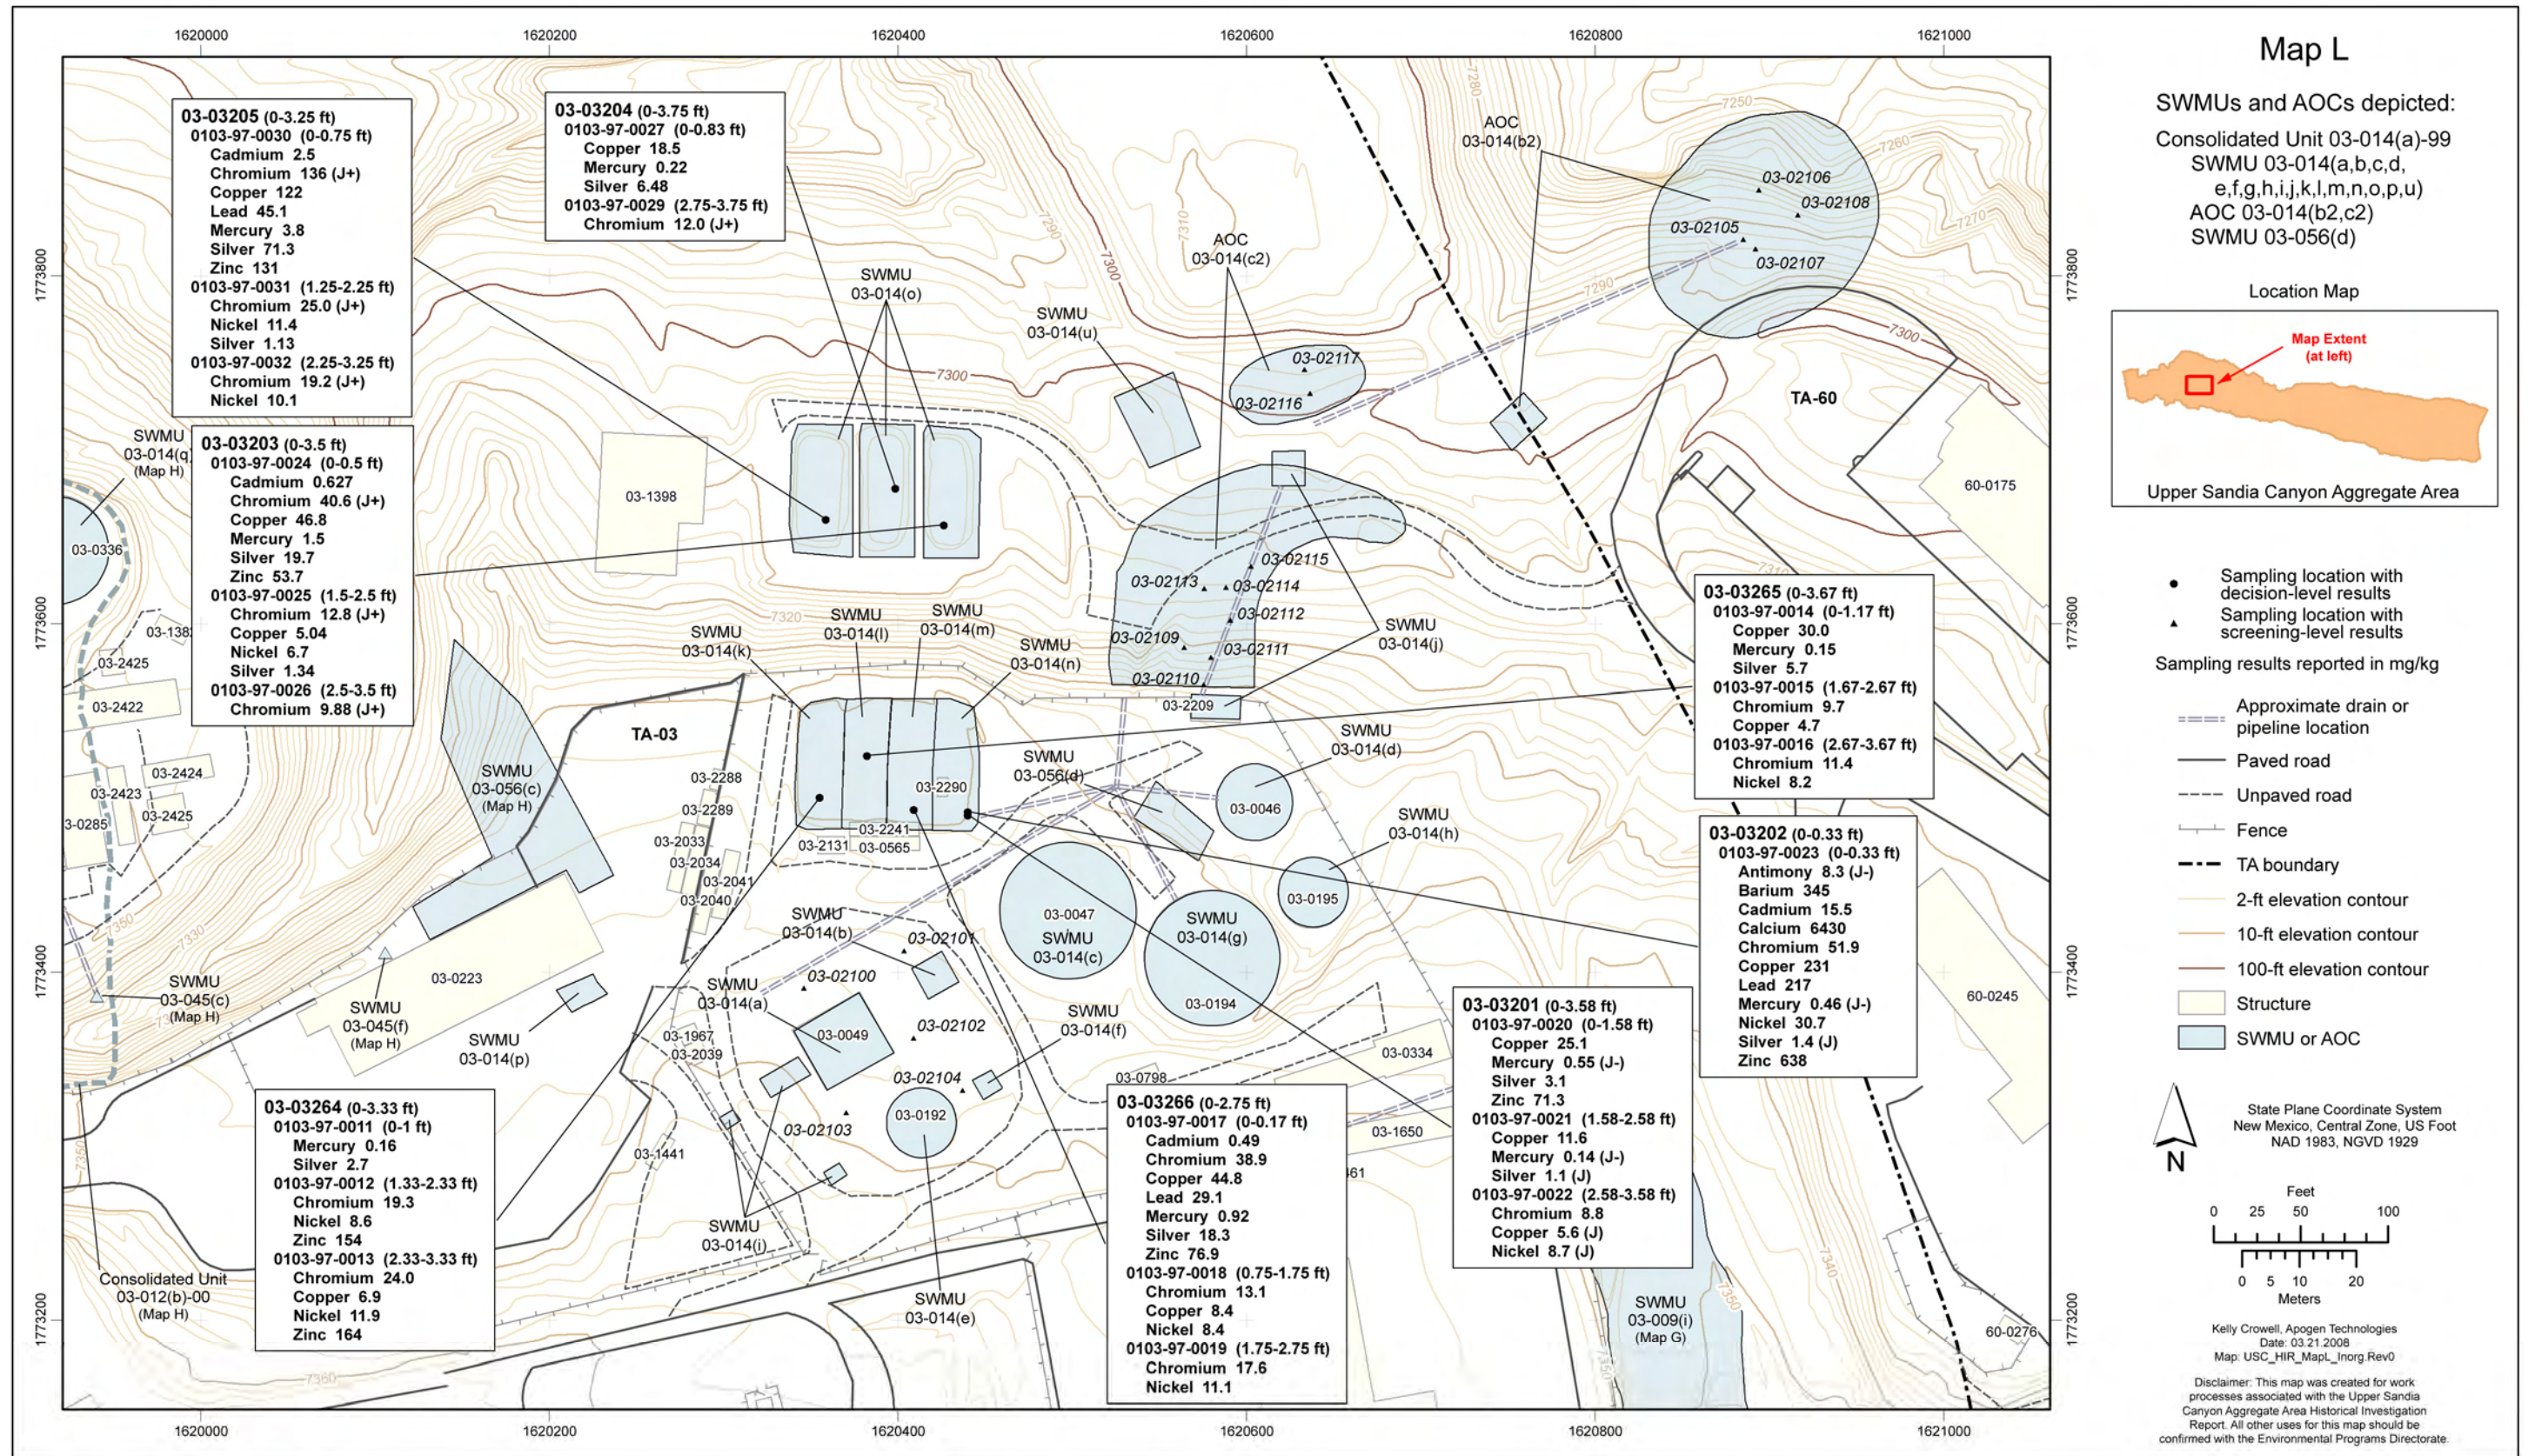


Figure 4.1-45 Map L inorganic chemical sampling locations and results detected above BVs



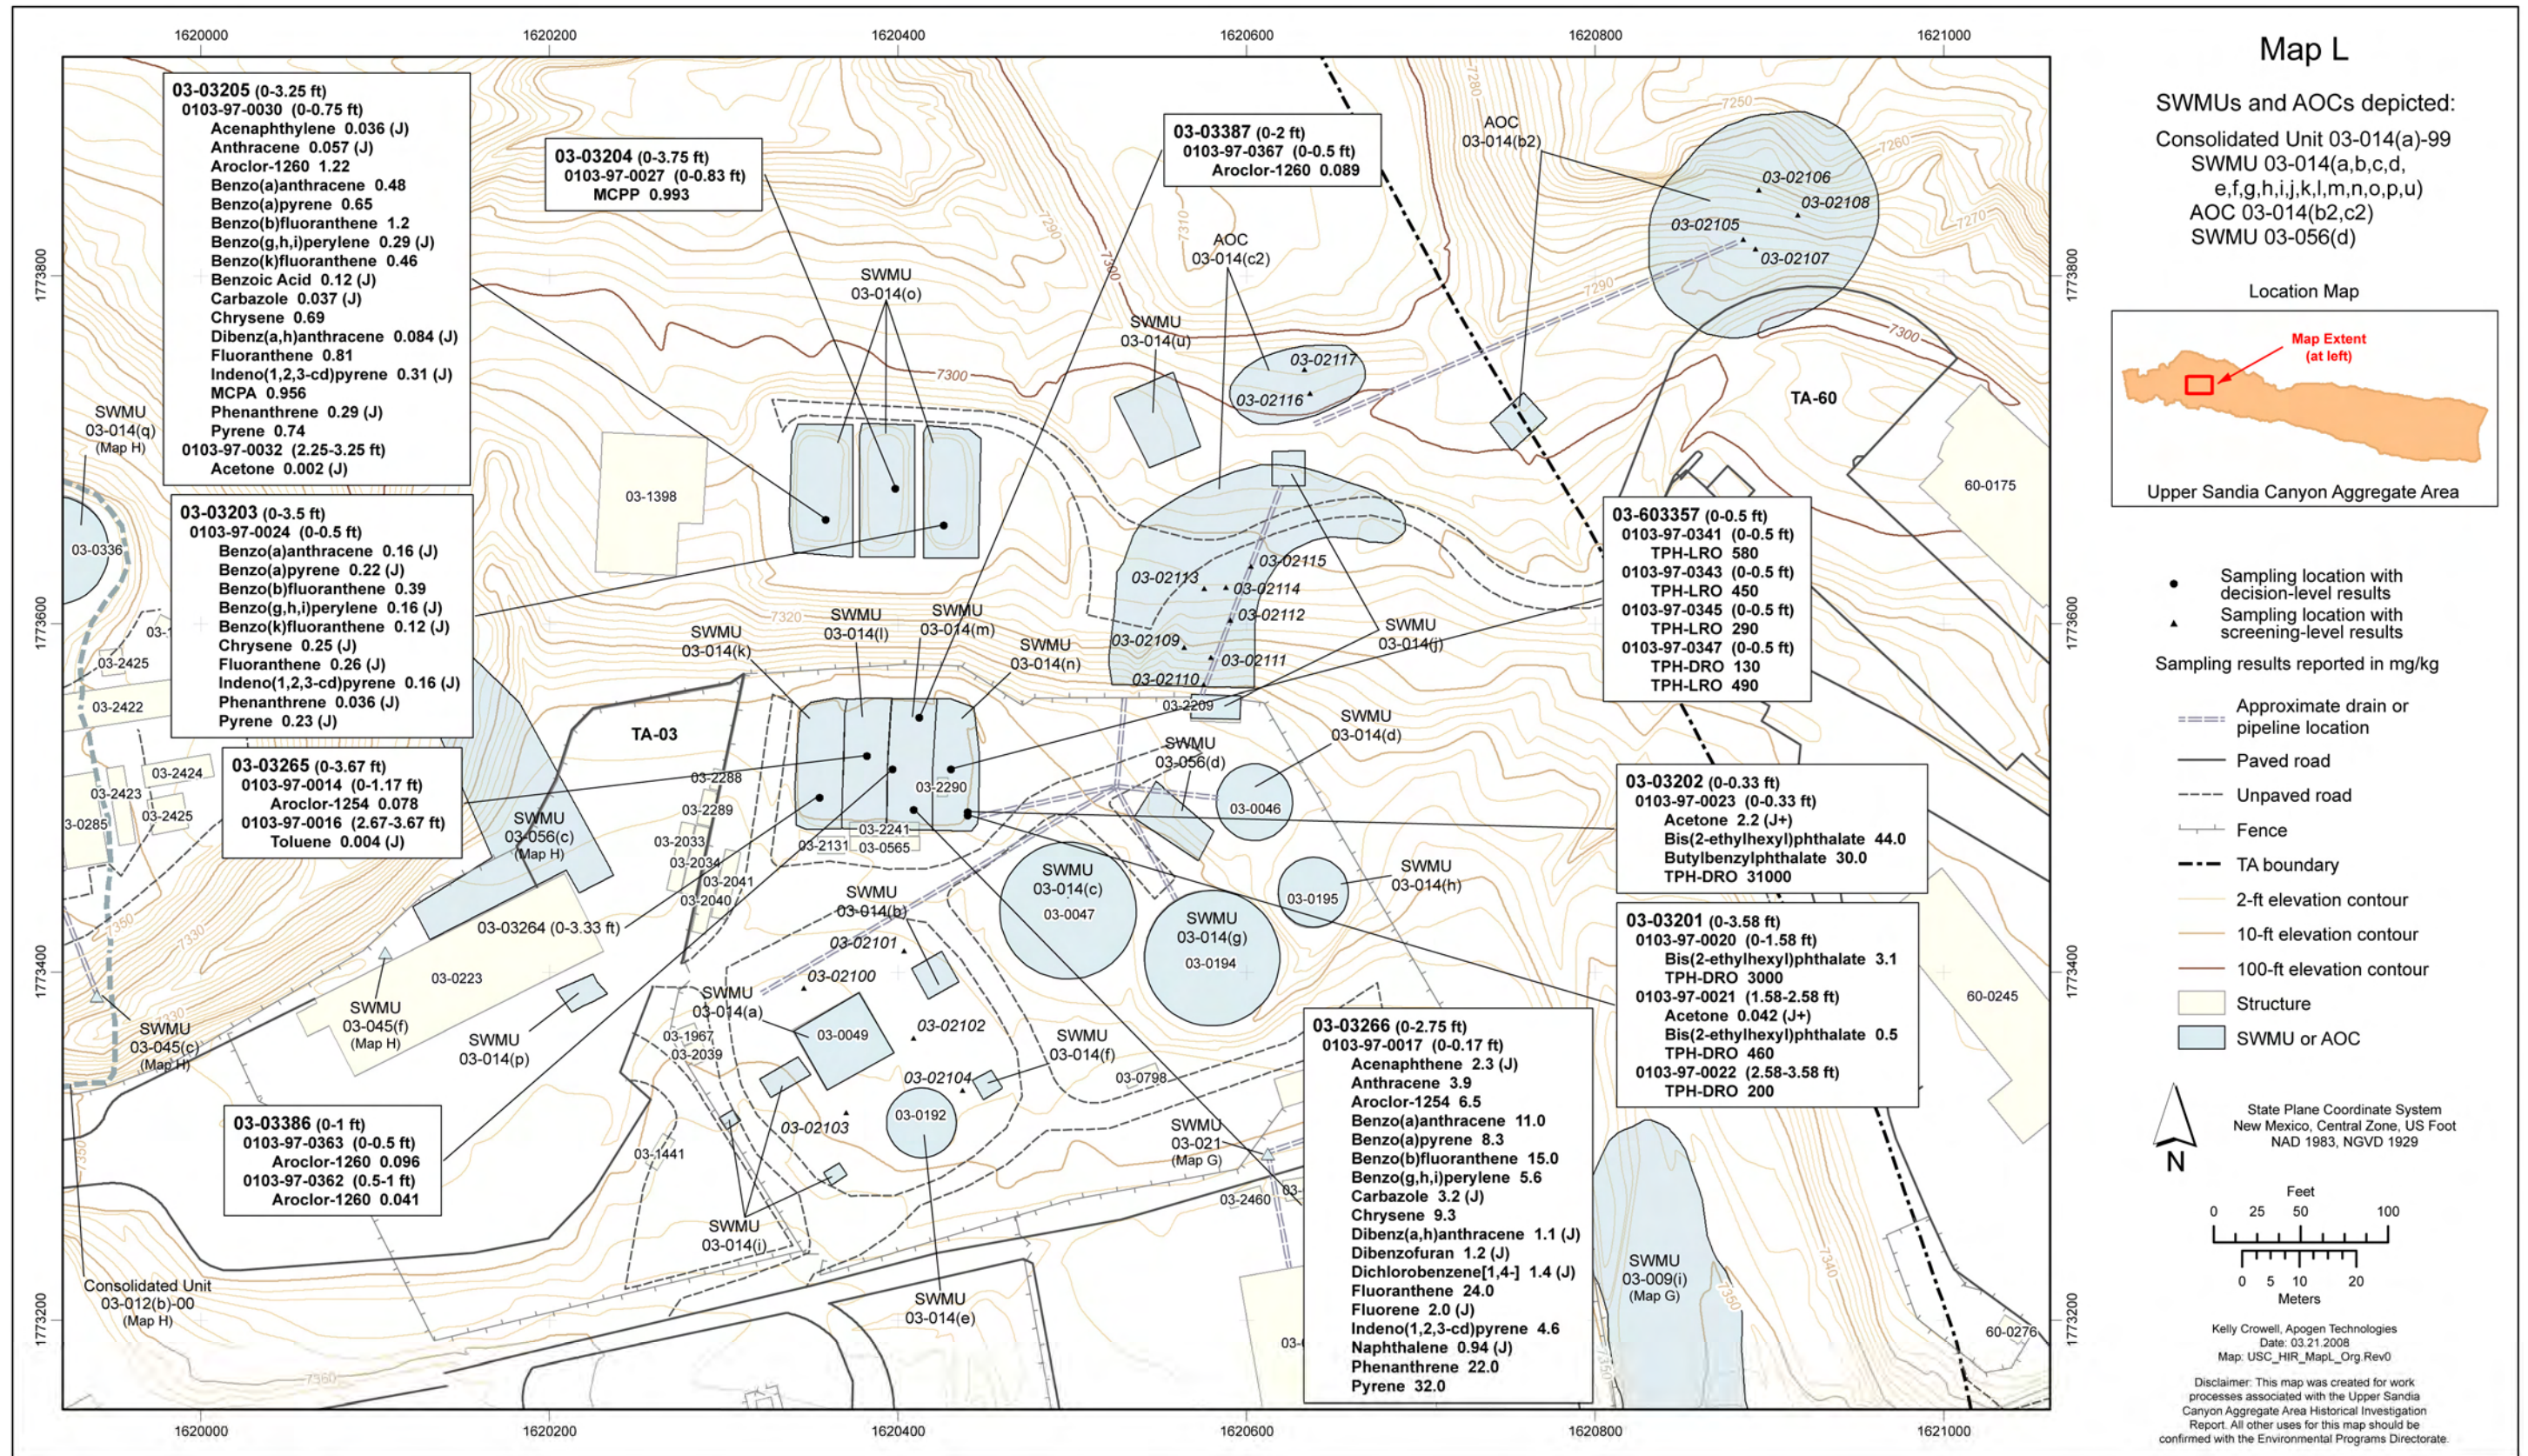


Figure 4.1-46 Map L organic chemical sampling locations and detected results



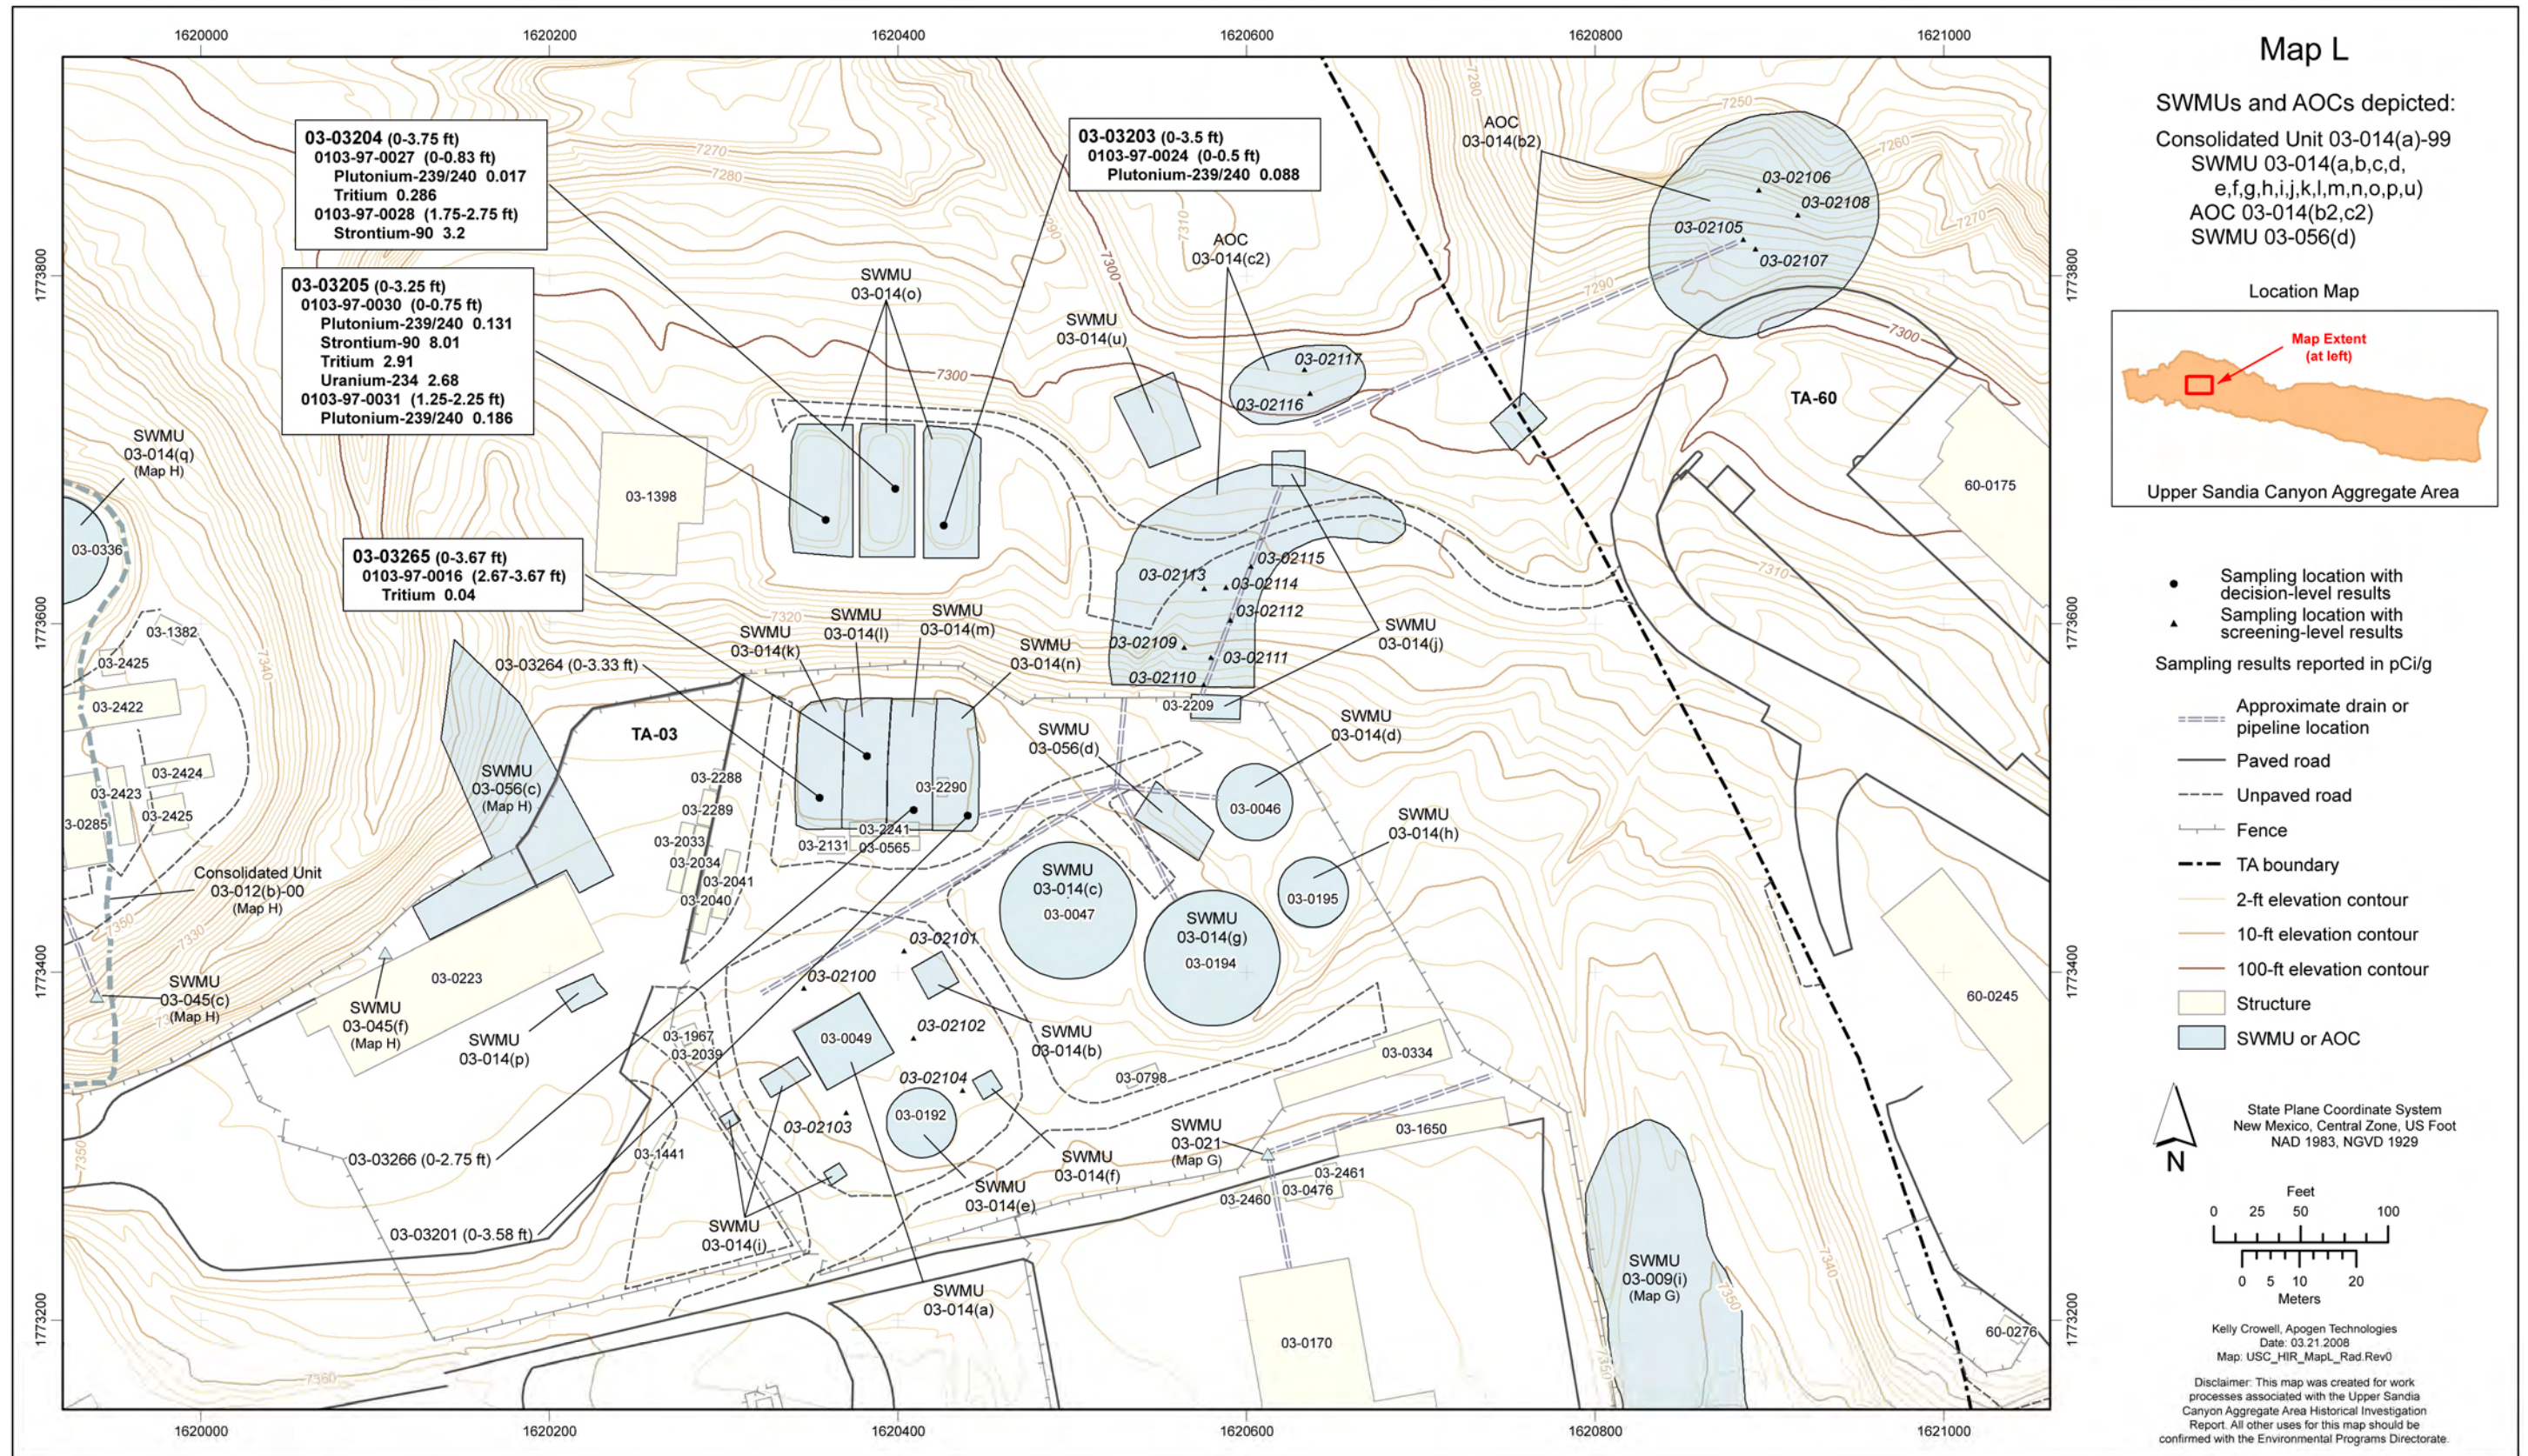


Figure 4.1-47 Map L radionuclide sampling locations and results detected above FVs/BVs



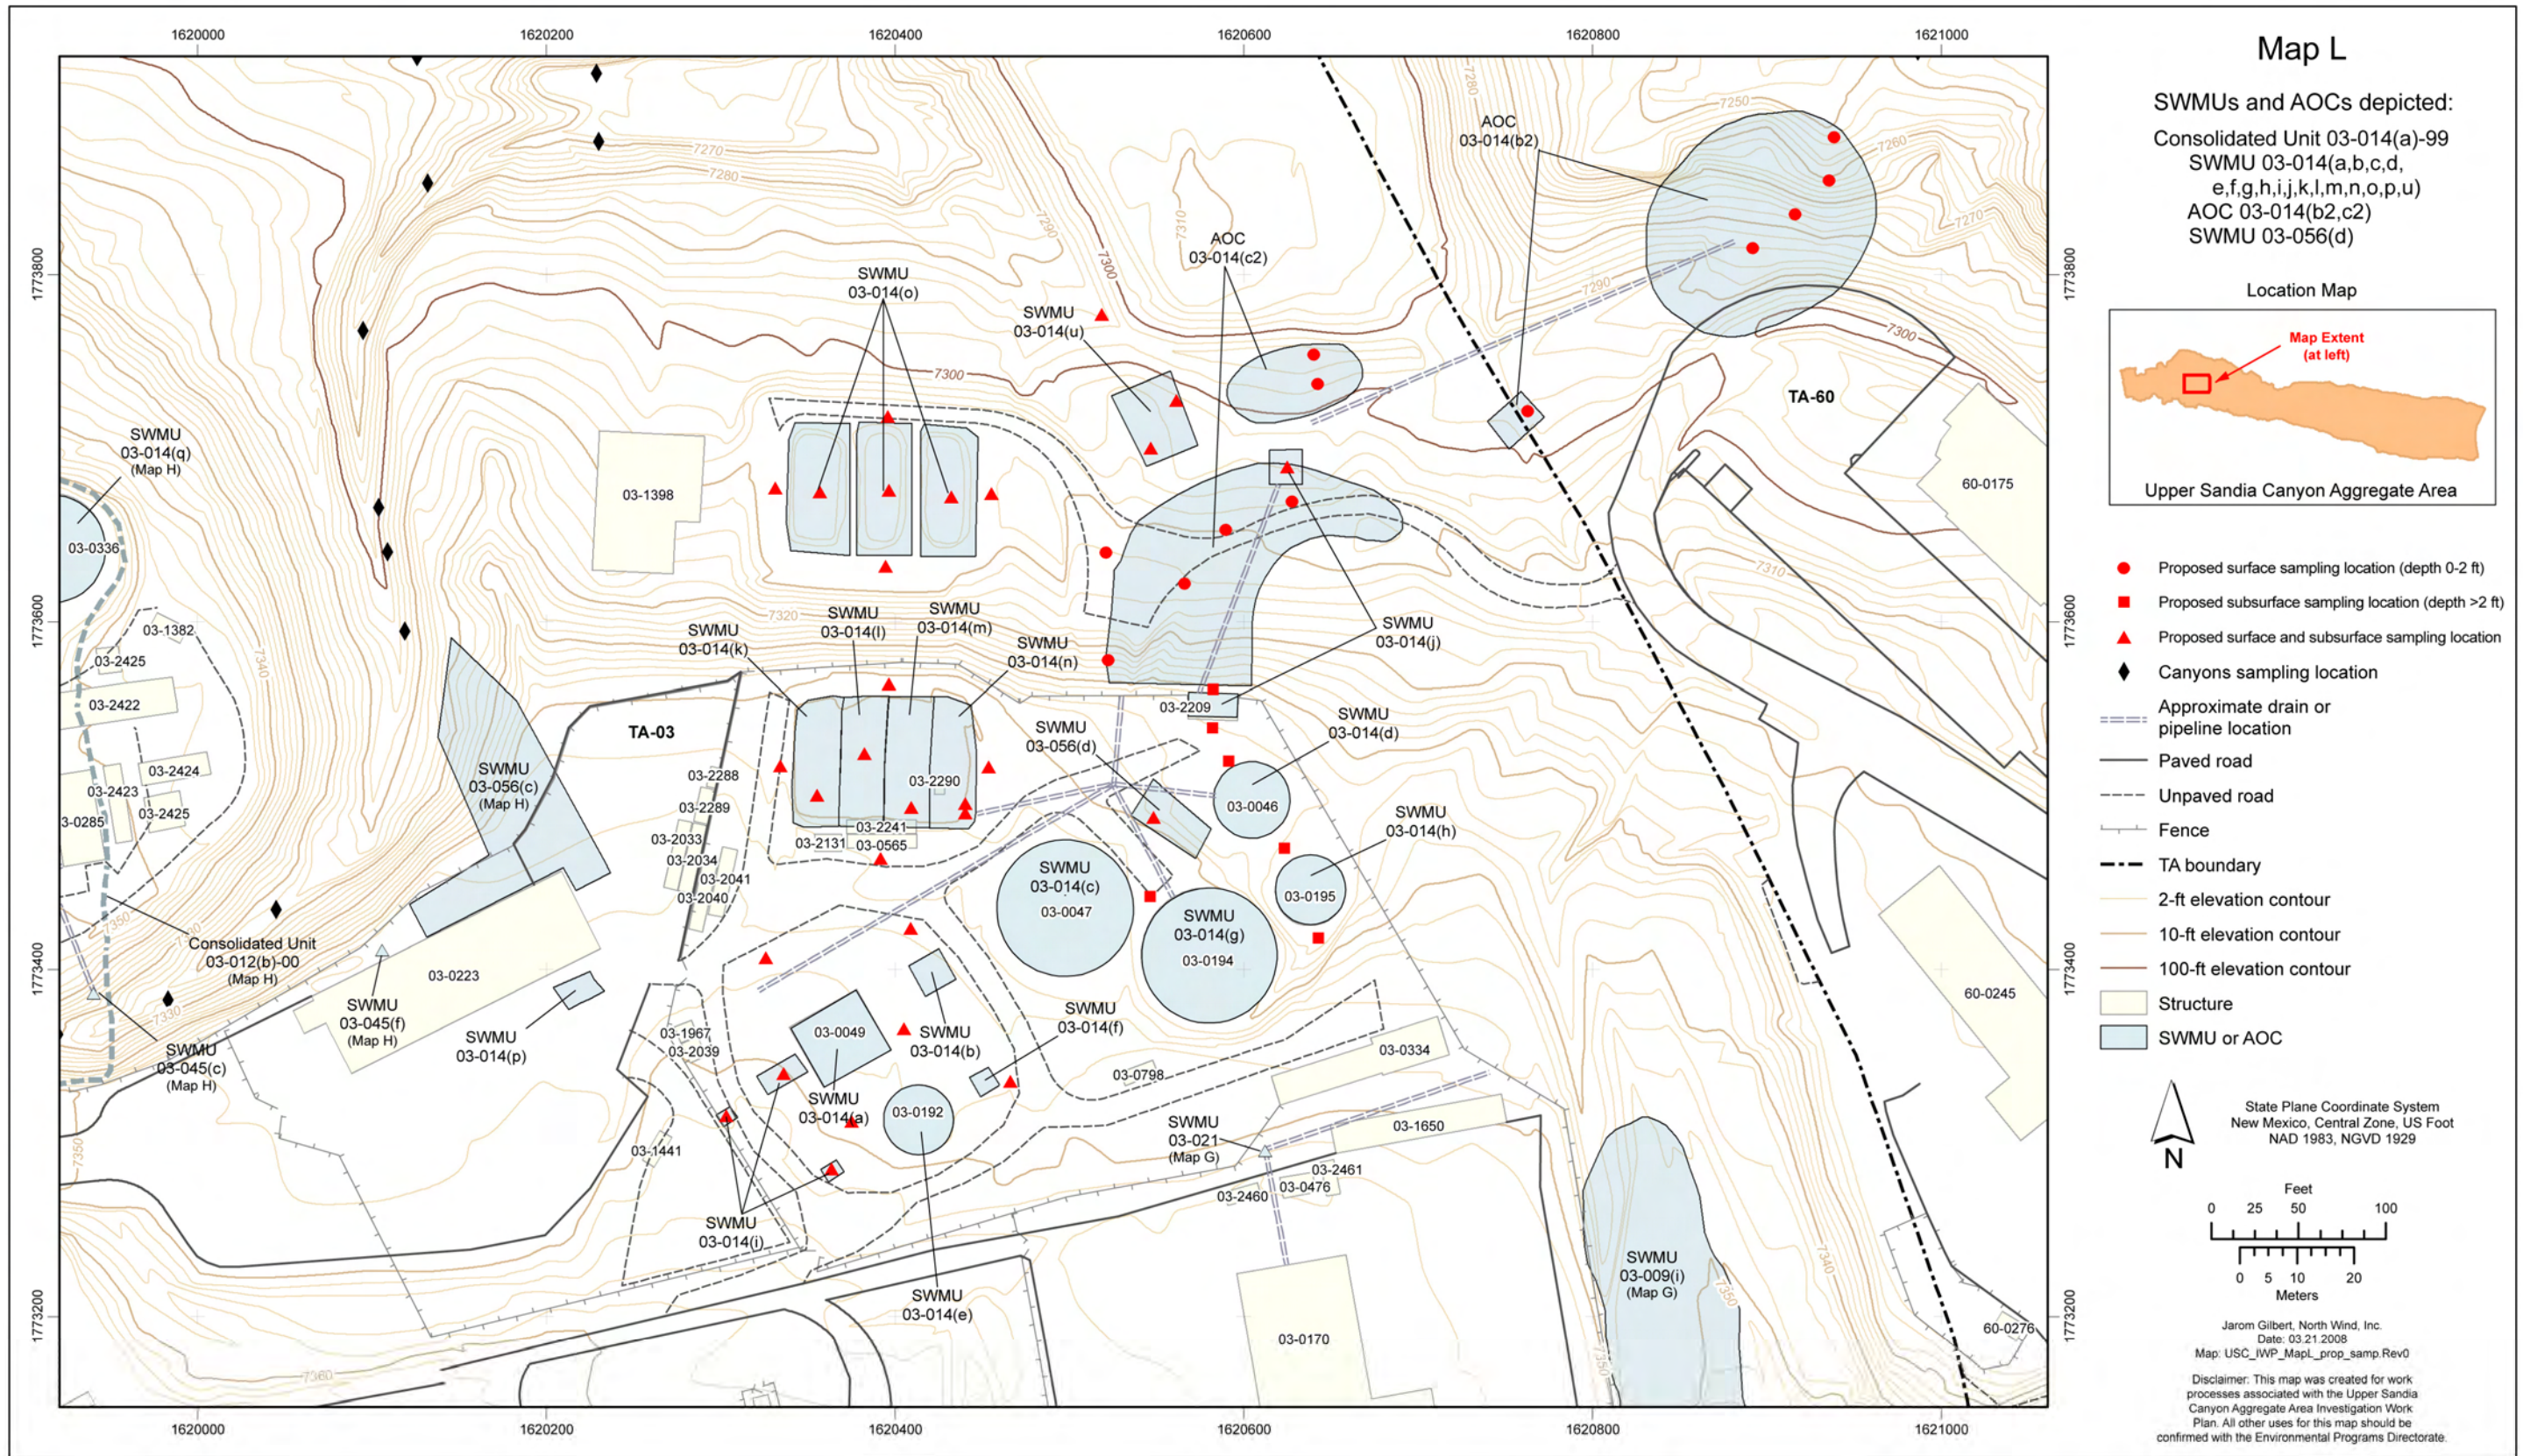


Figure 4.1-48 Map L proposed sampling locations



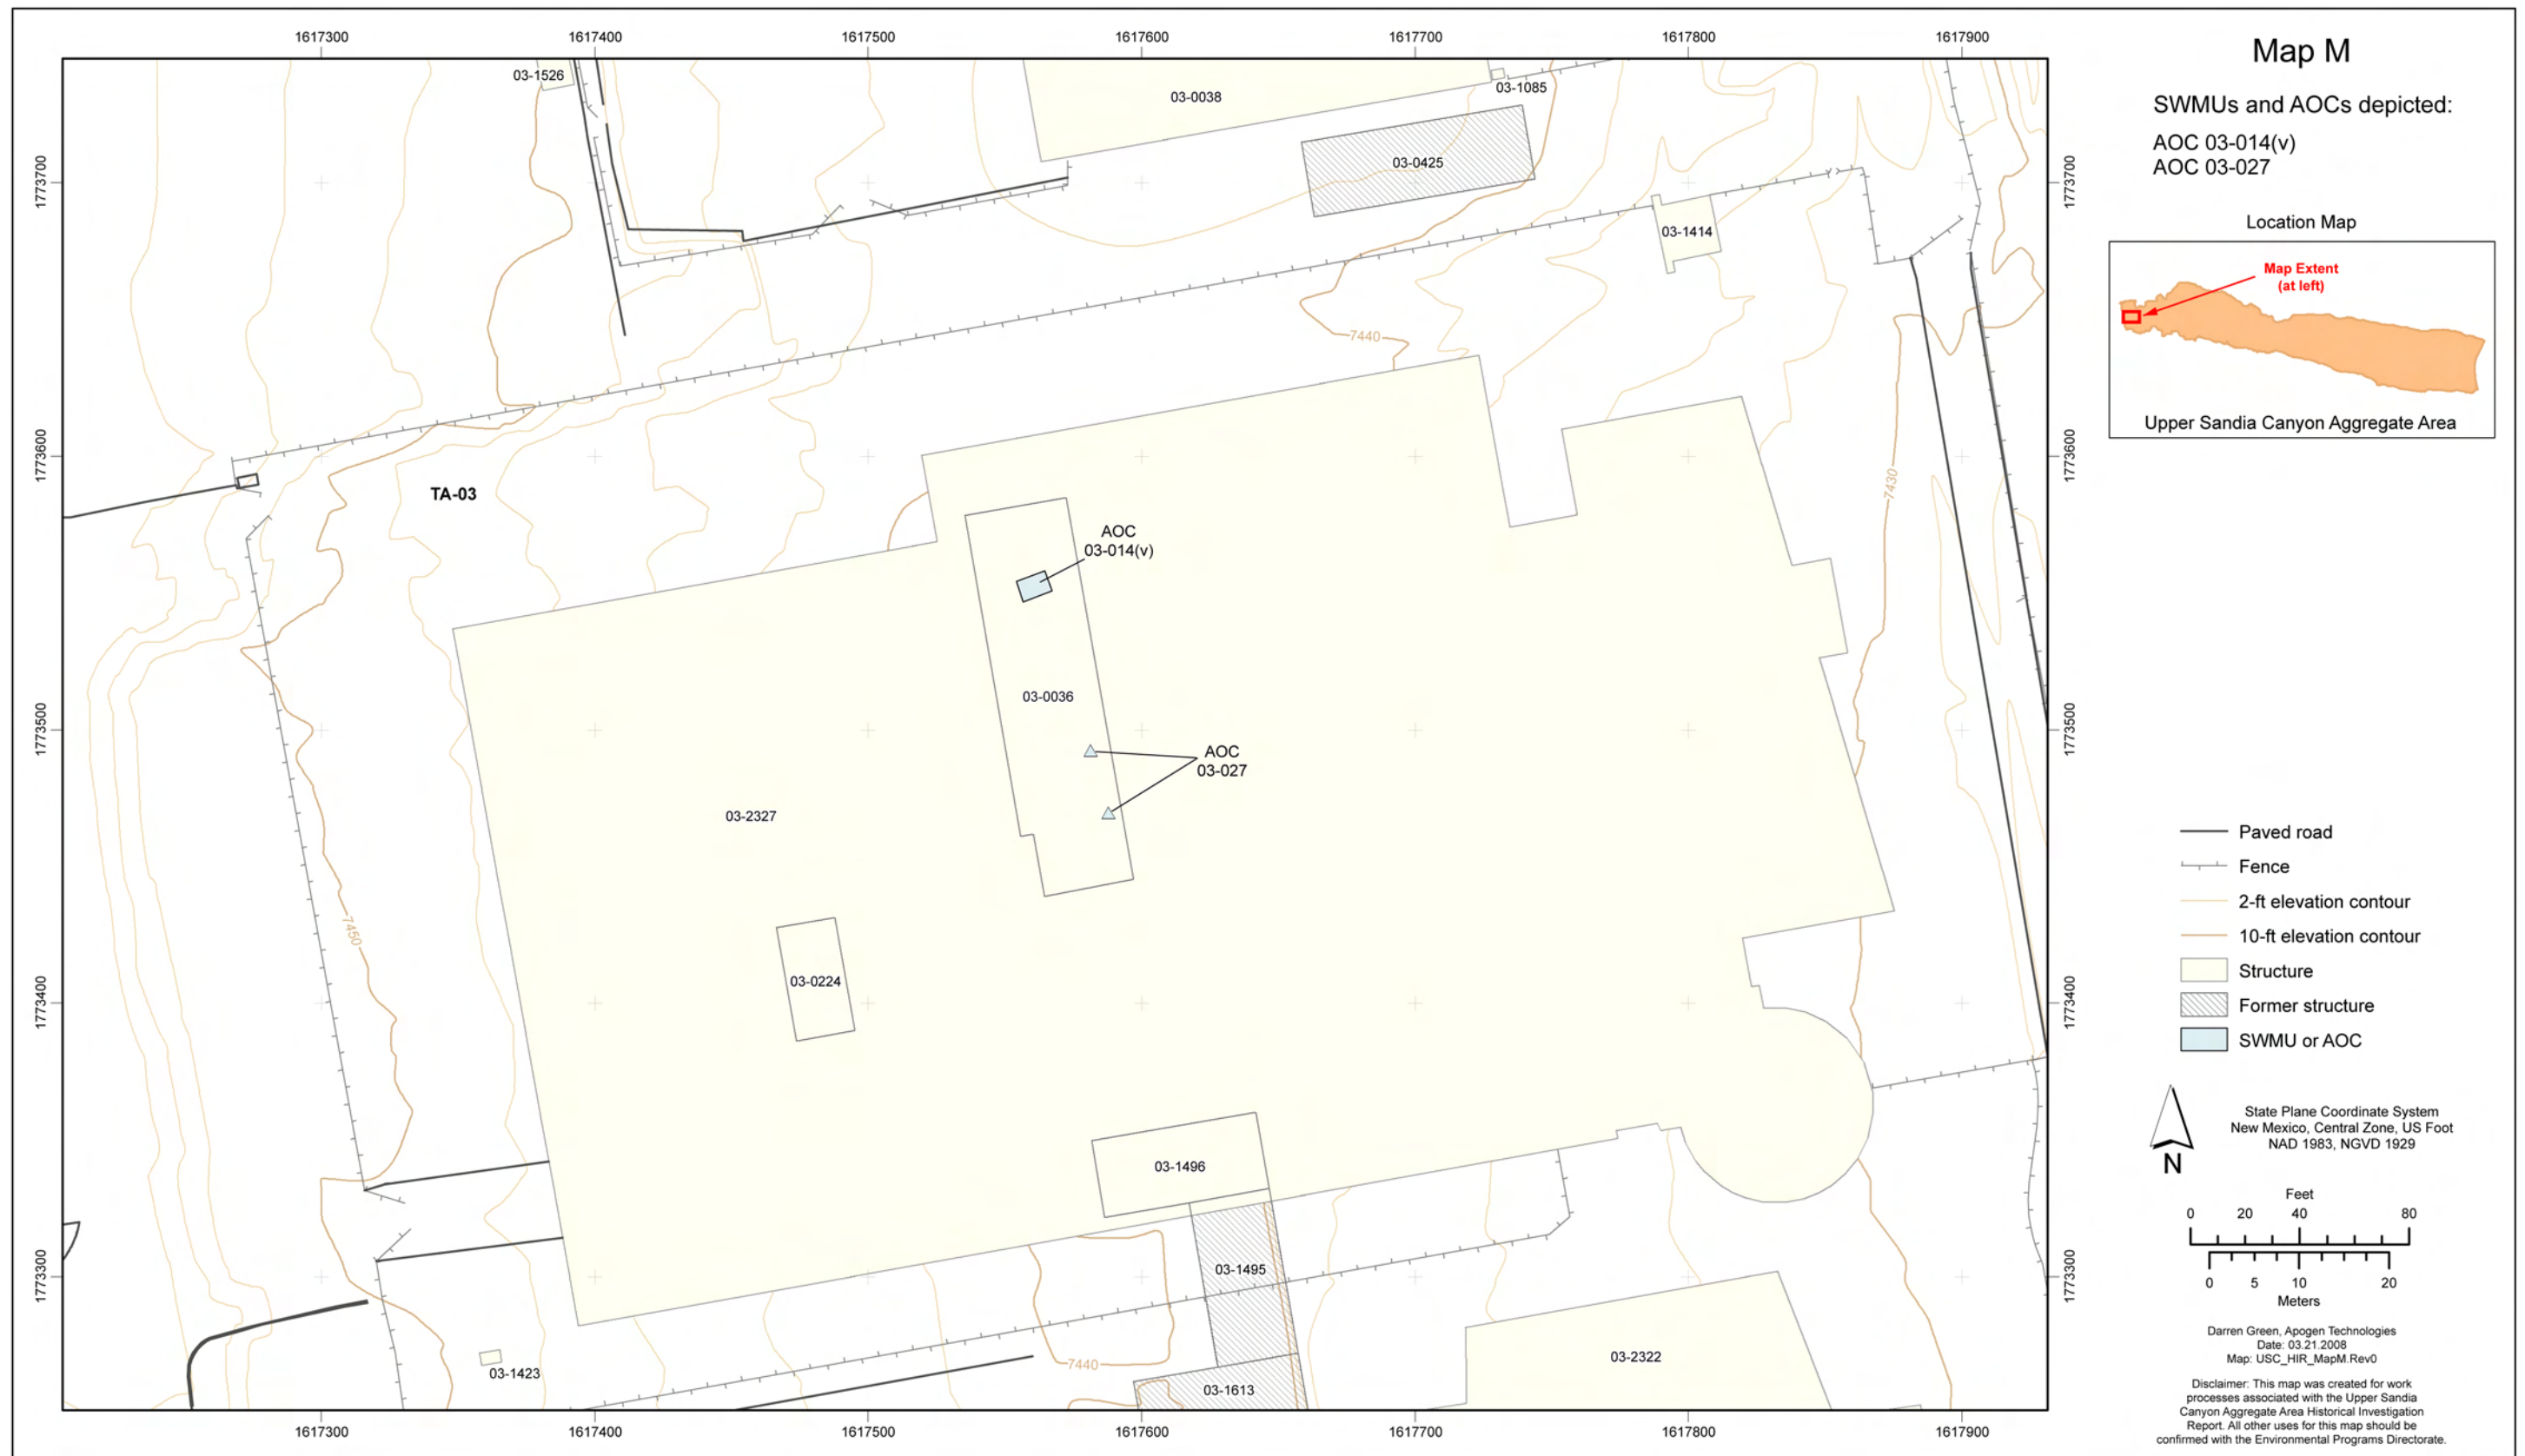


Figure 4.1-49 Map M site location

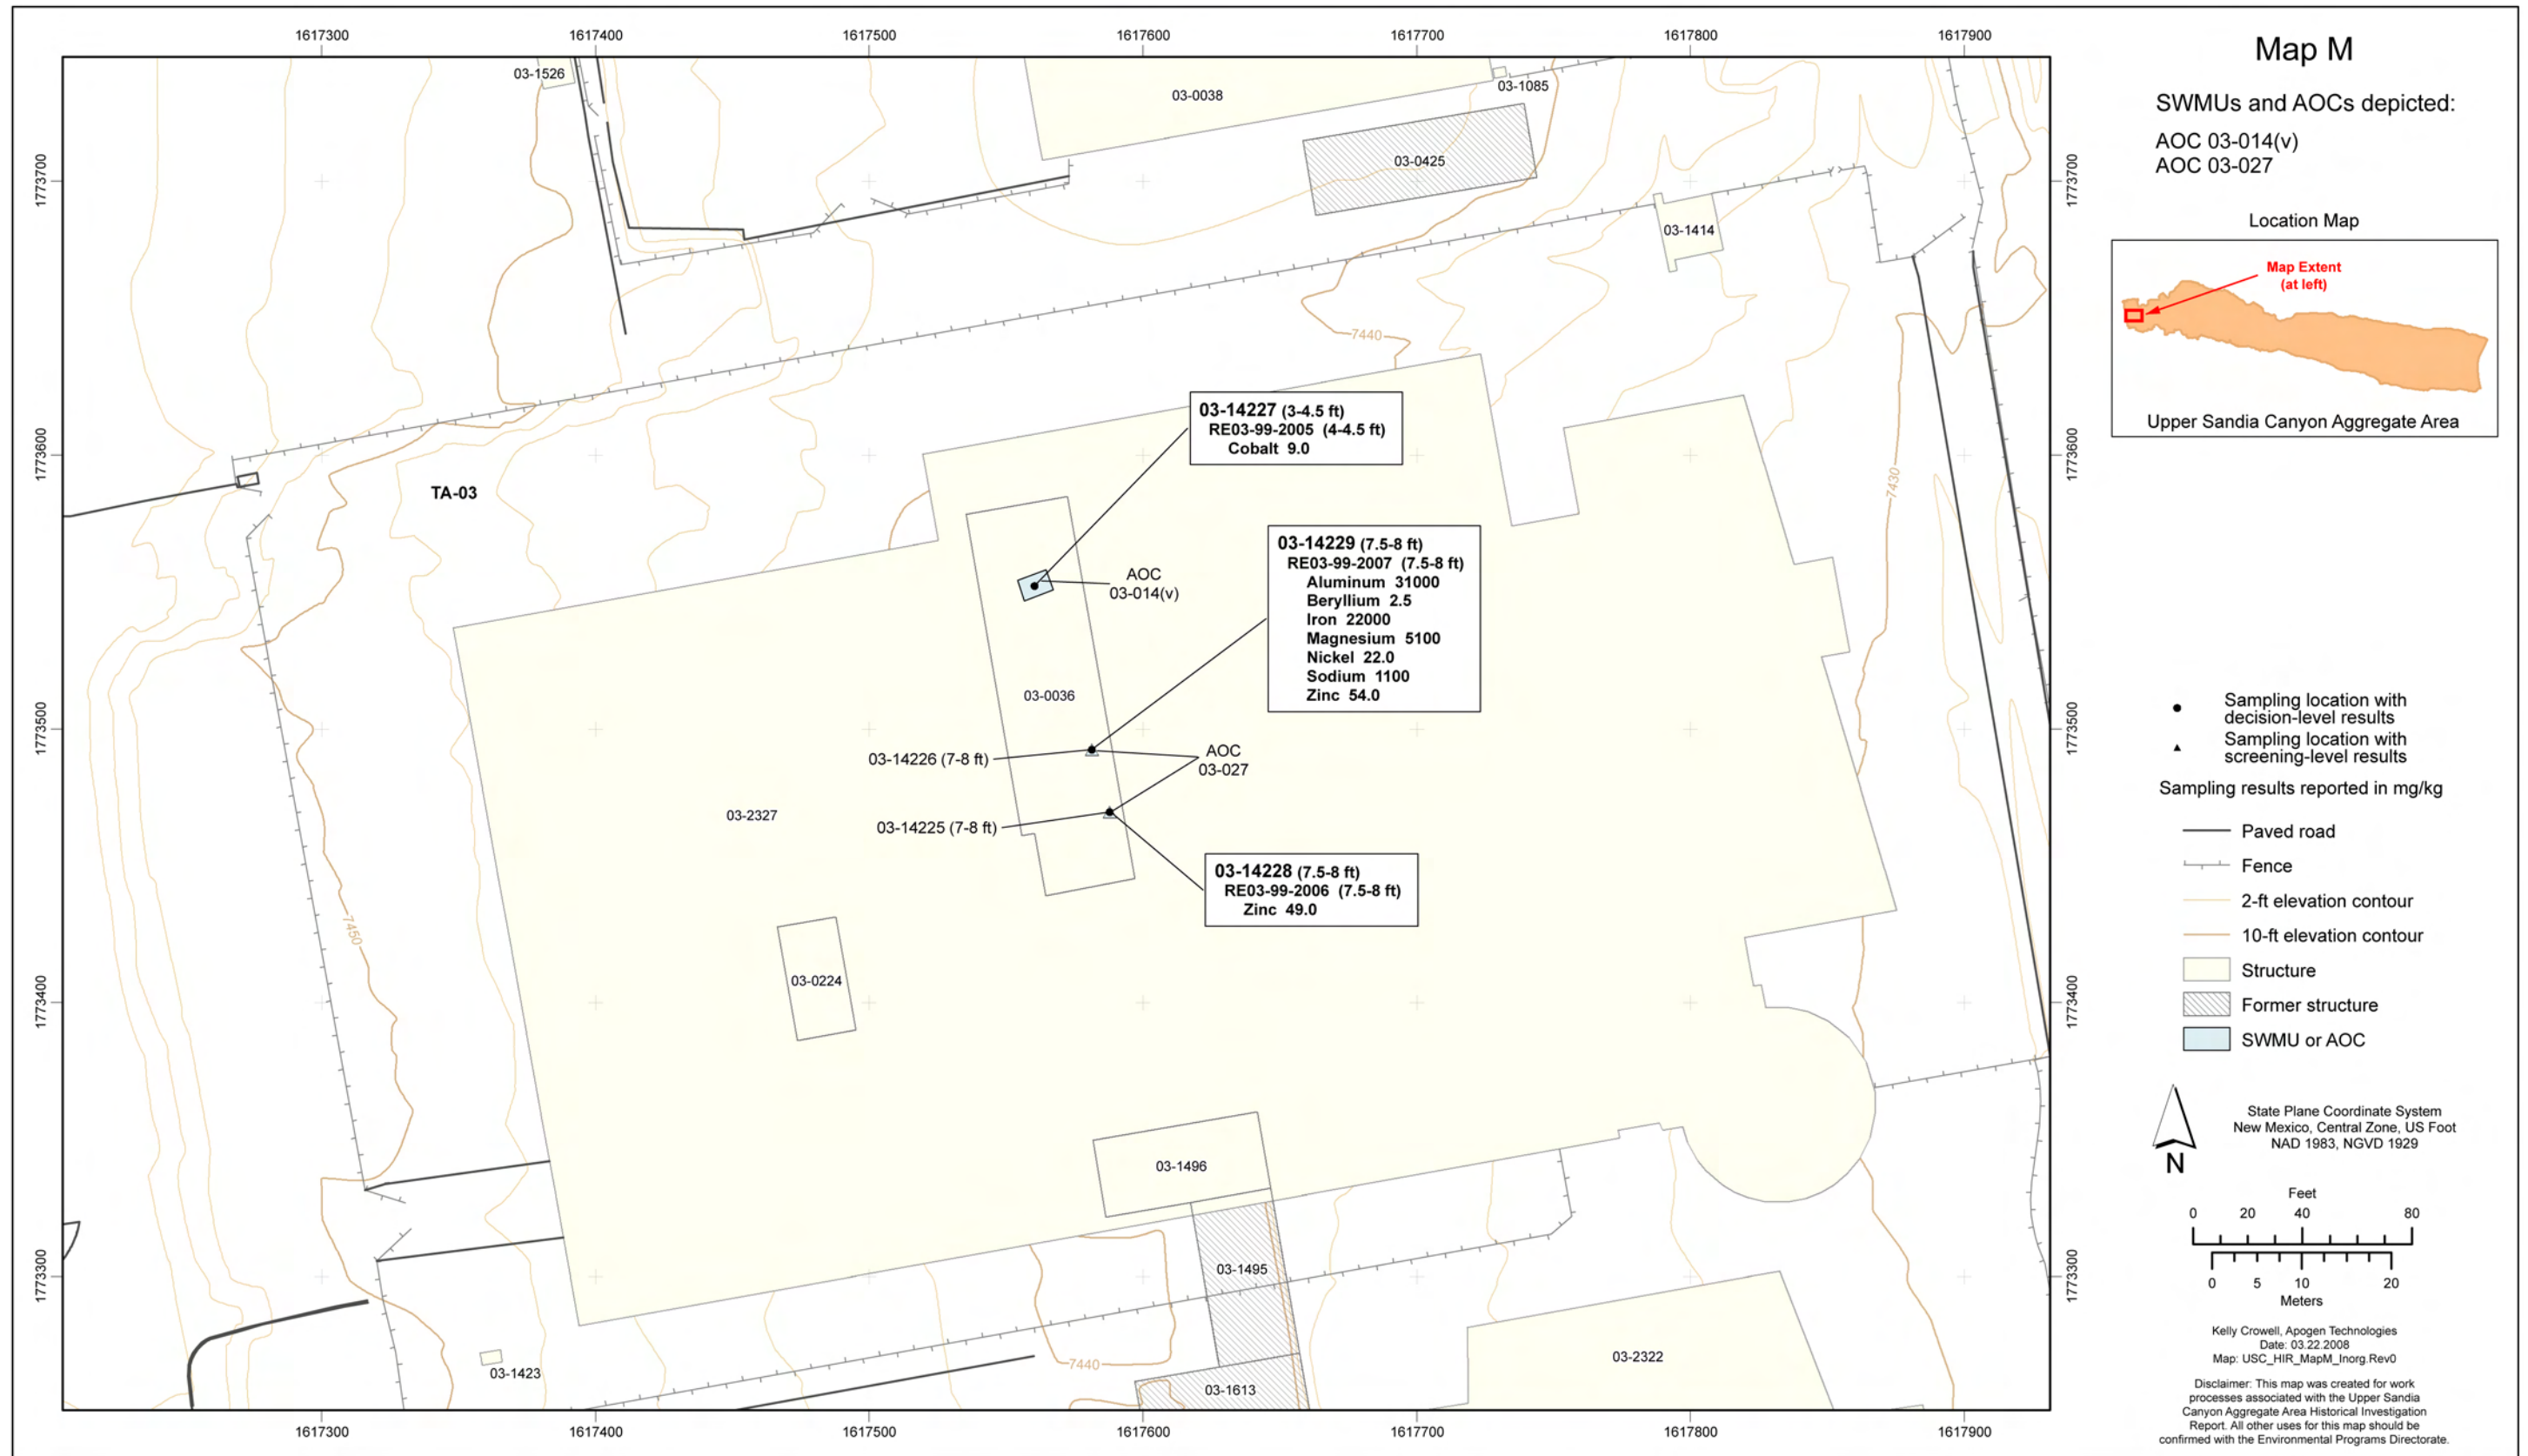


Figure 4.1-50 Map M inorganic chemical sampling locations and results detected above BVs



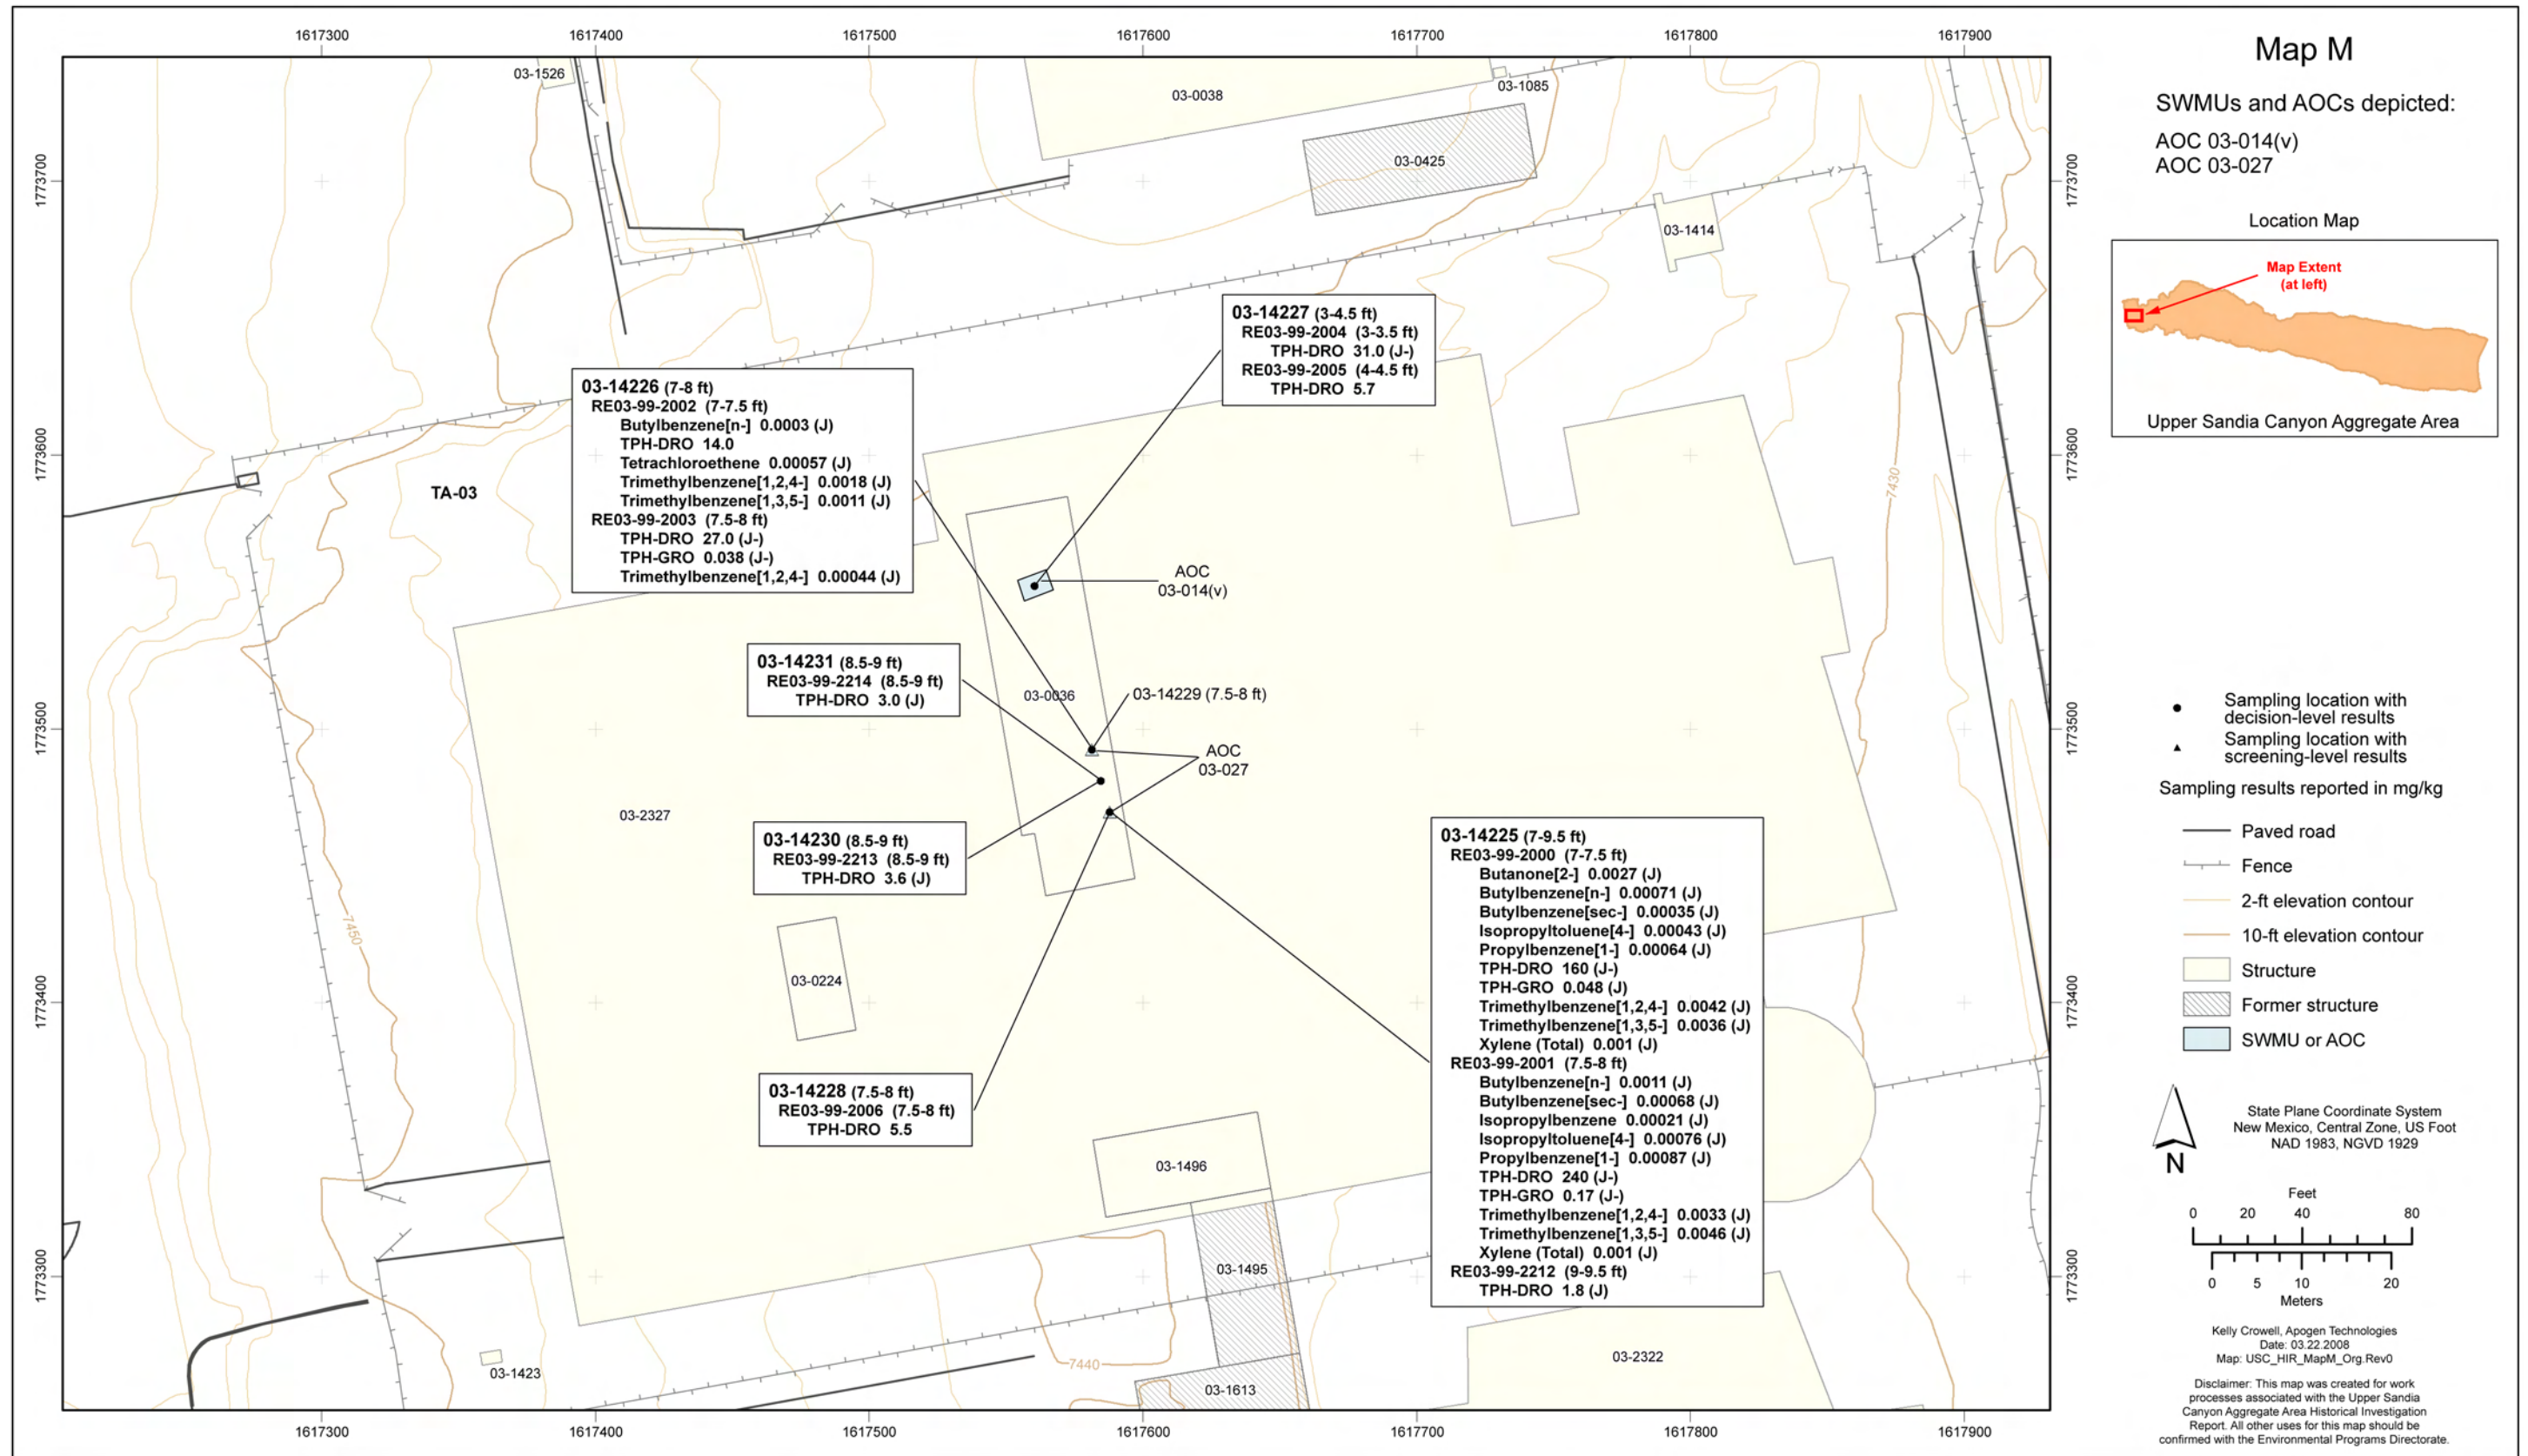


Figure 4.1-51 Map M organic chemical sampling locations and detected results



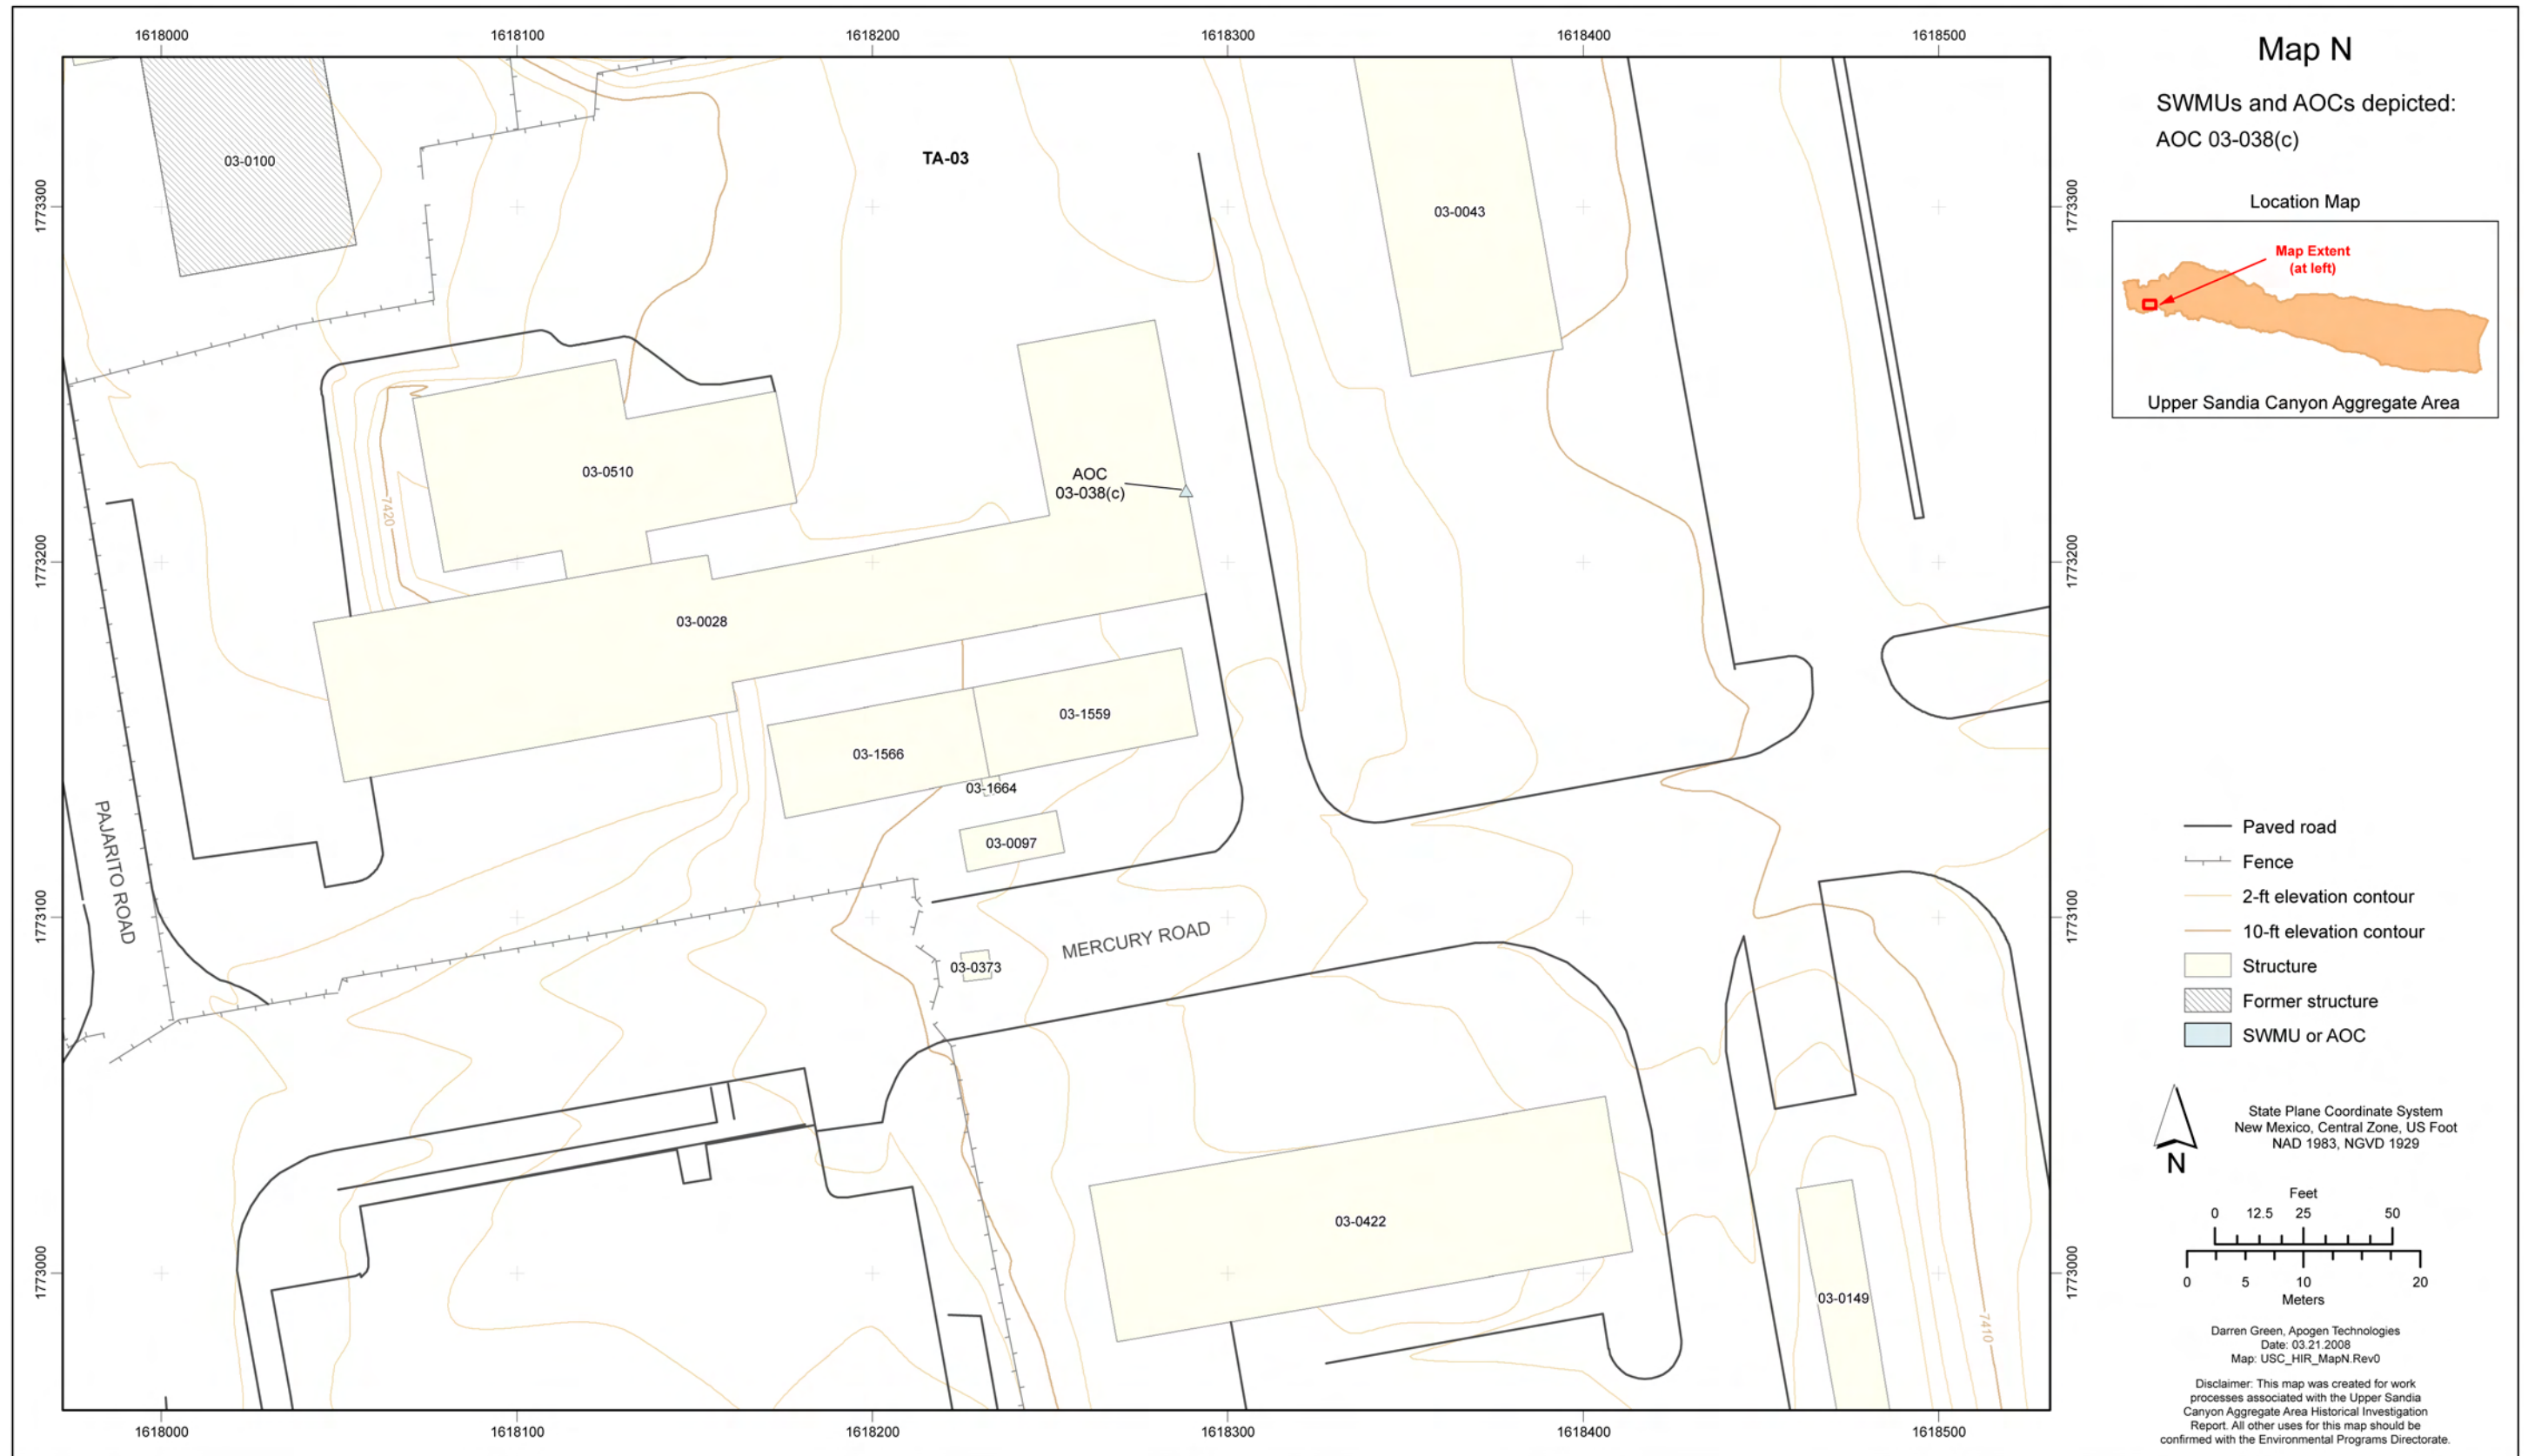


Figure 4.1-52 Map N site location

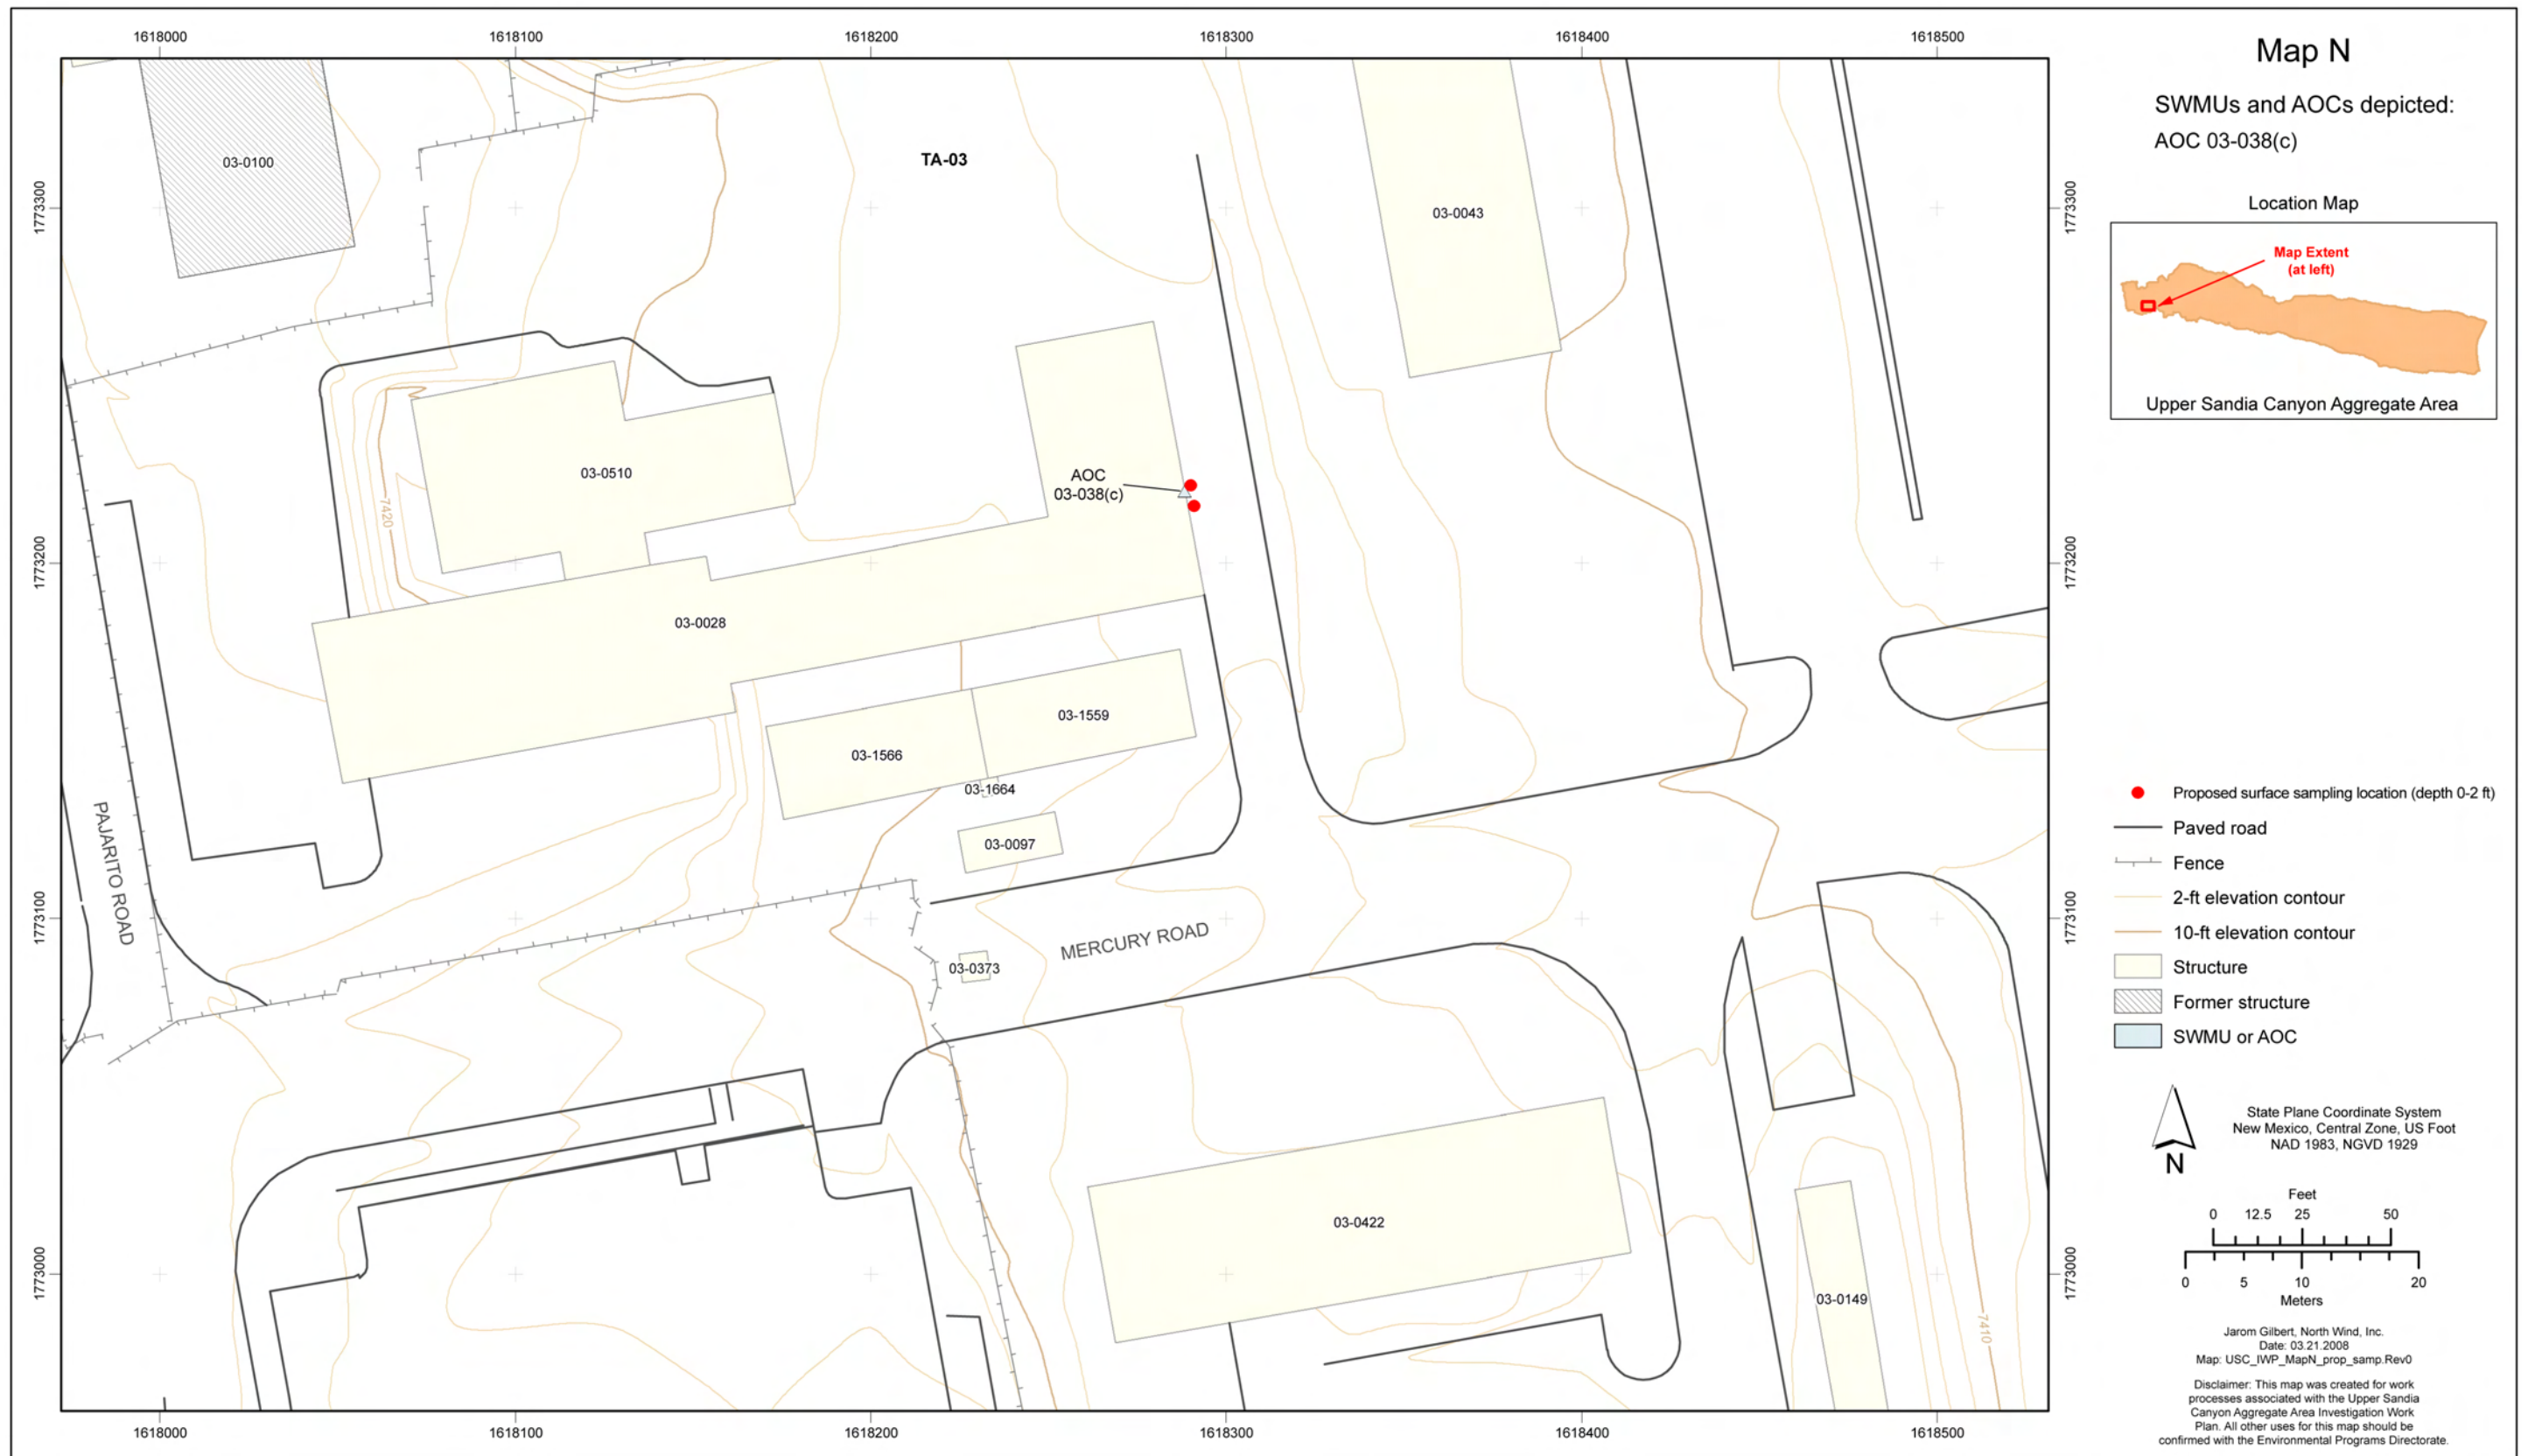


Figure 4.1-53 Map N proposed sampling locations



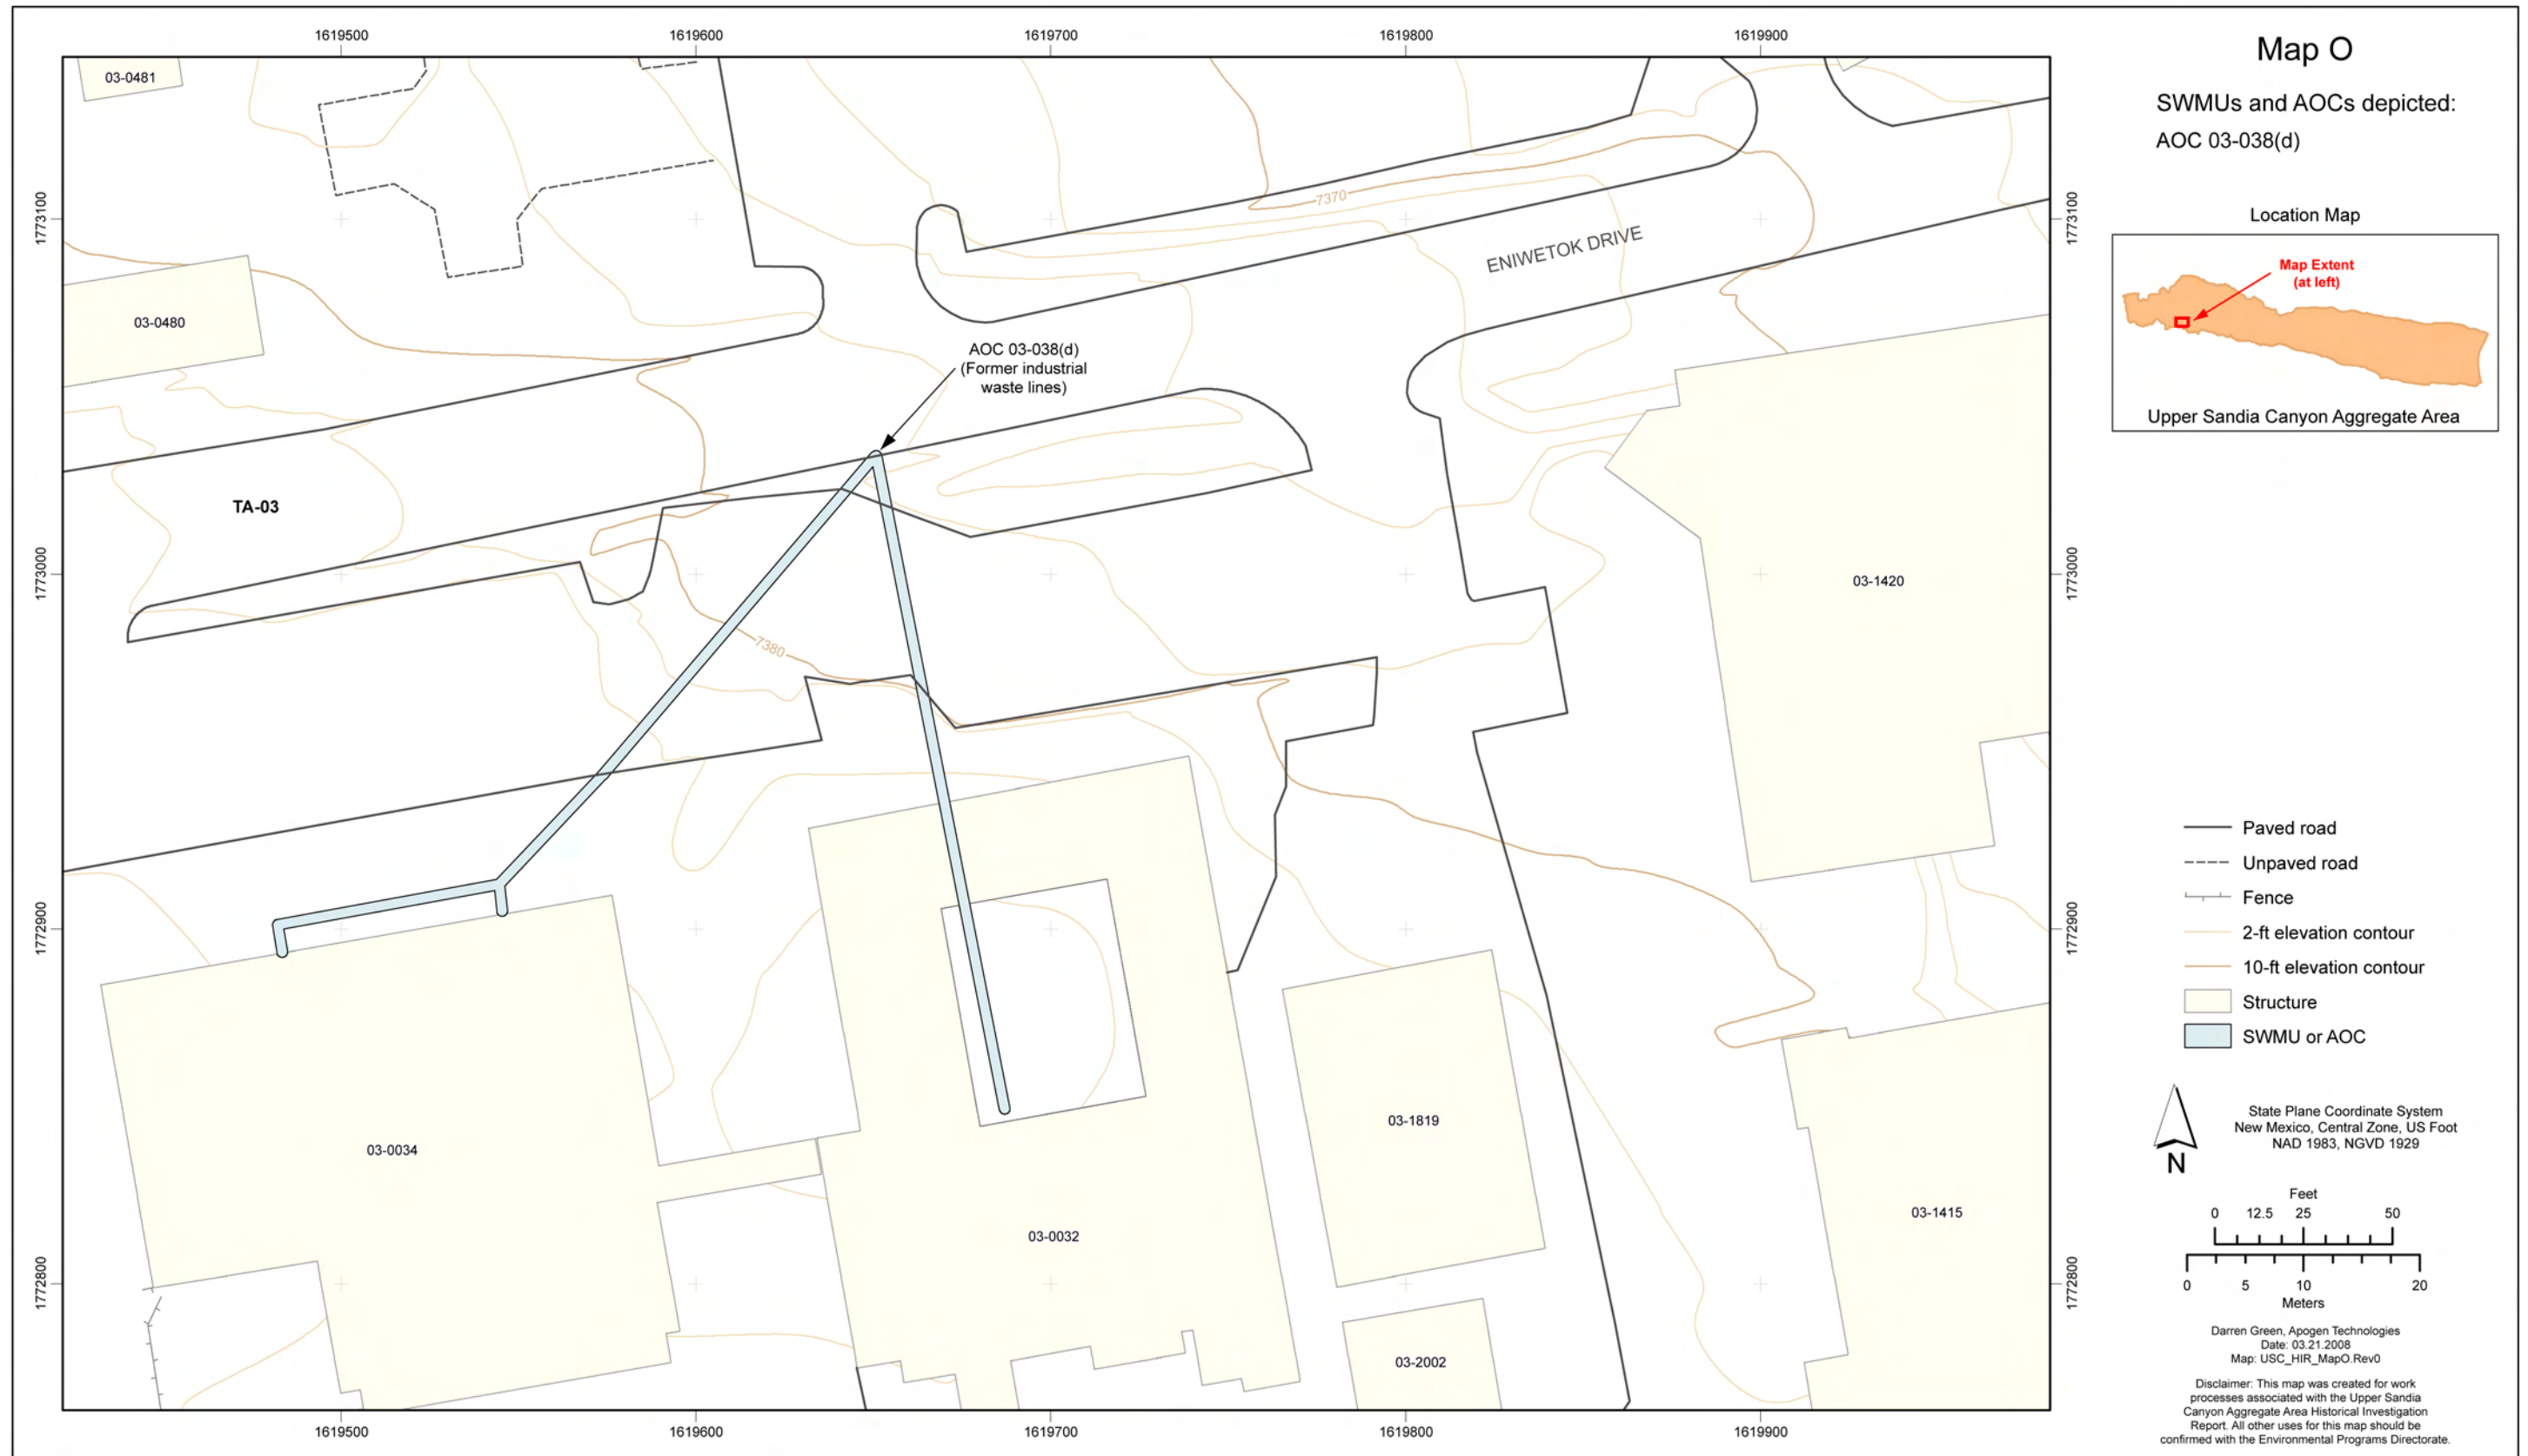


Figure 4.1-54 Map O site location



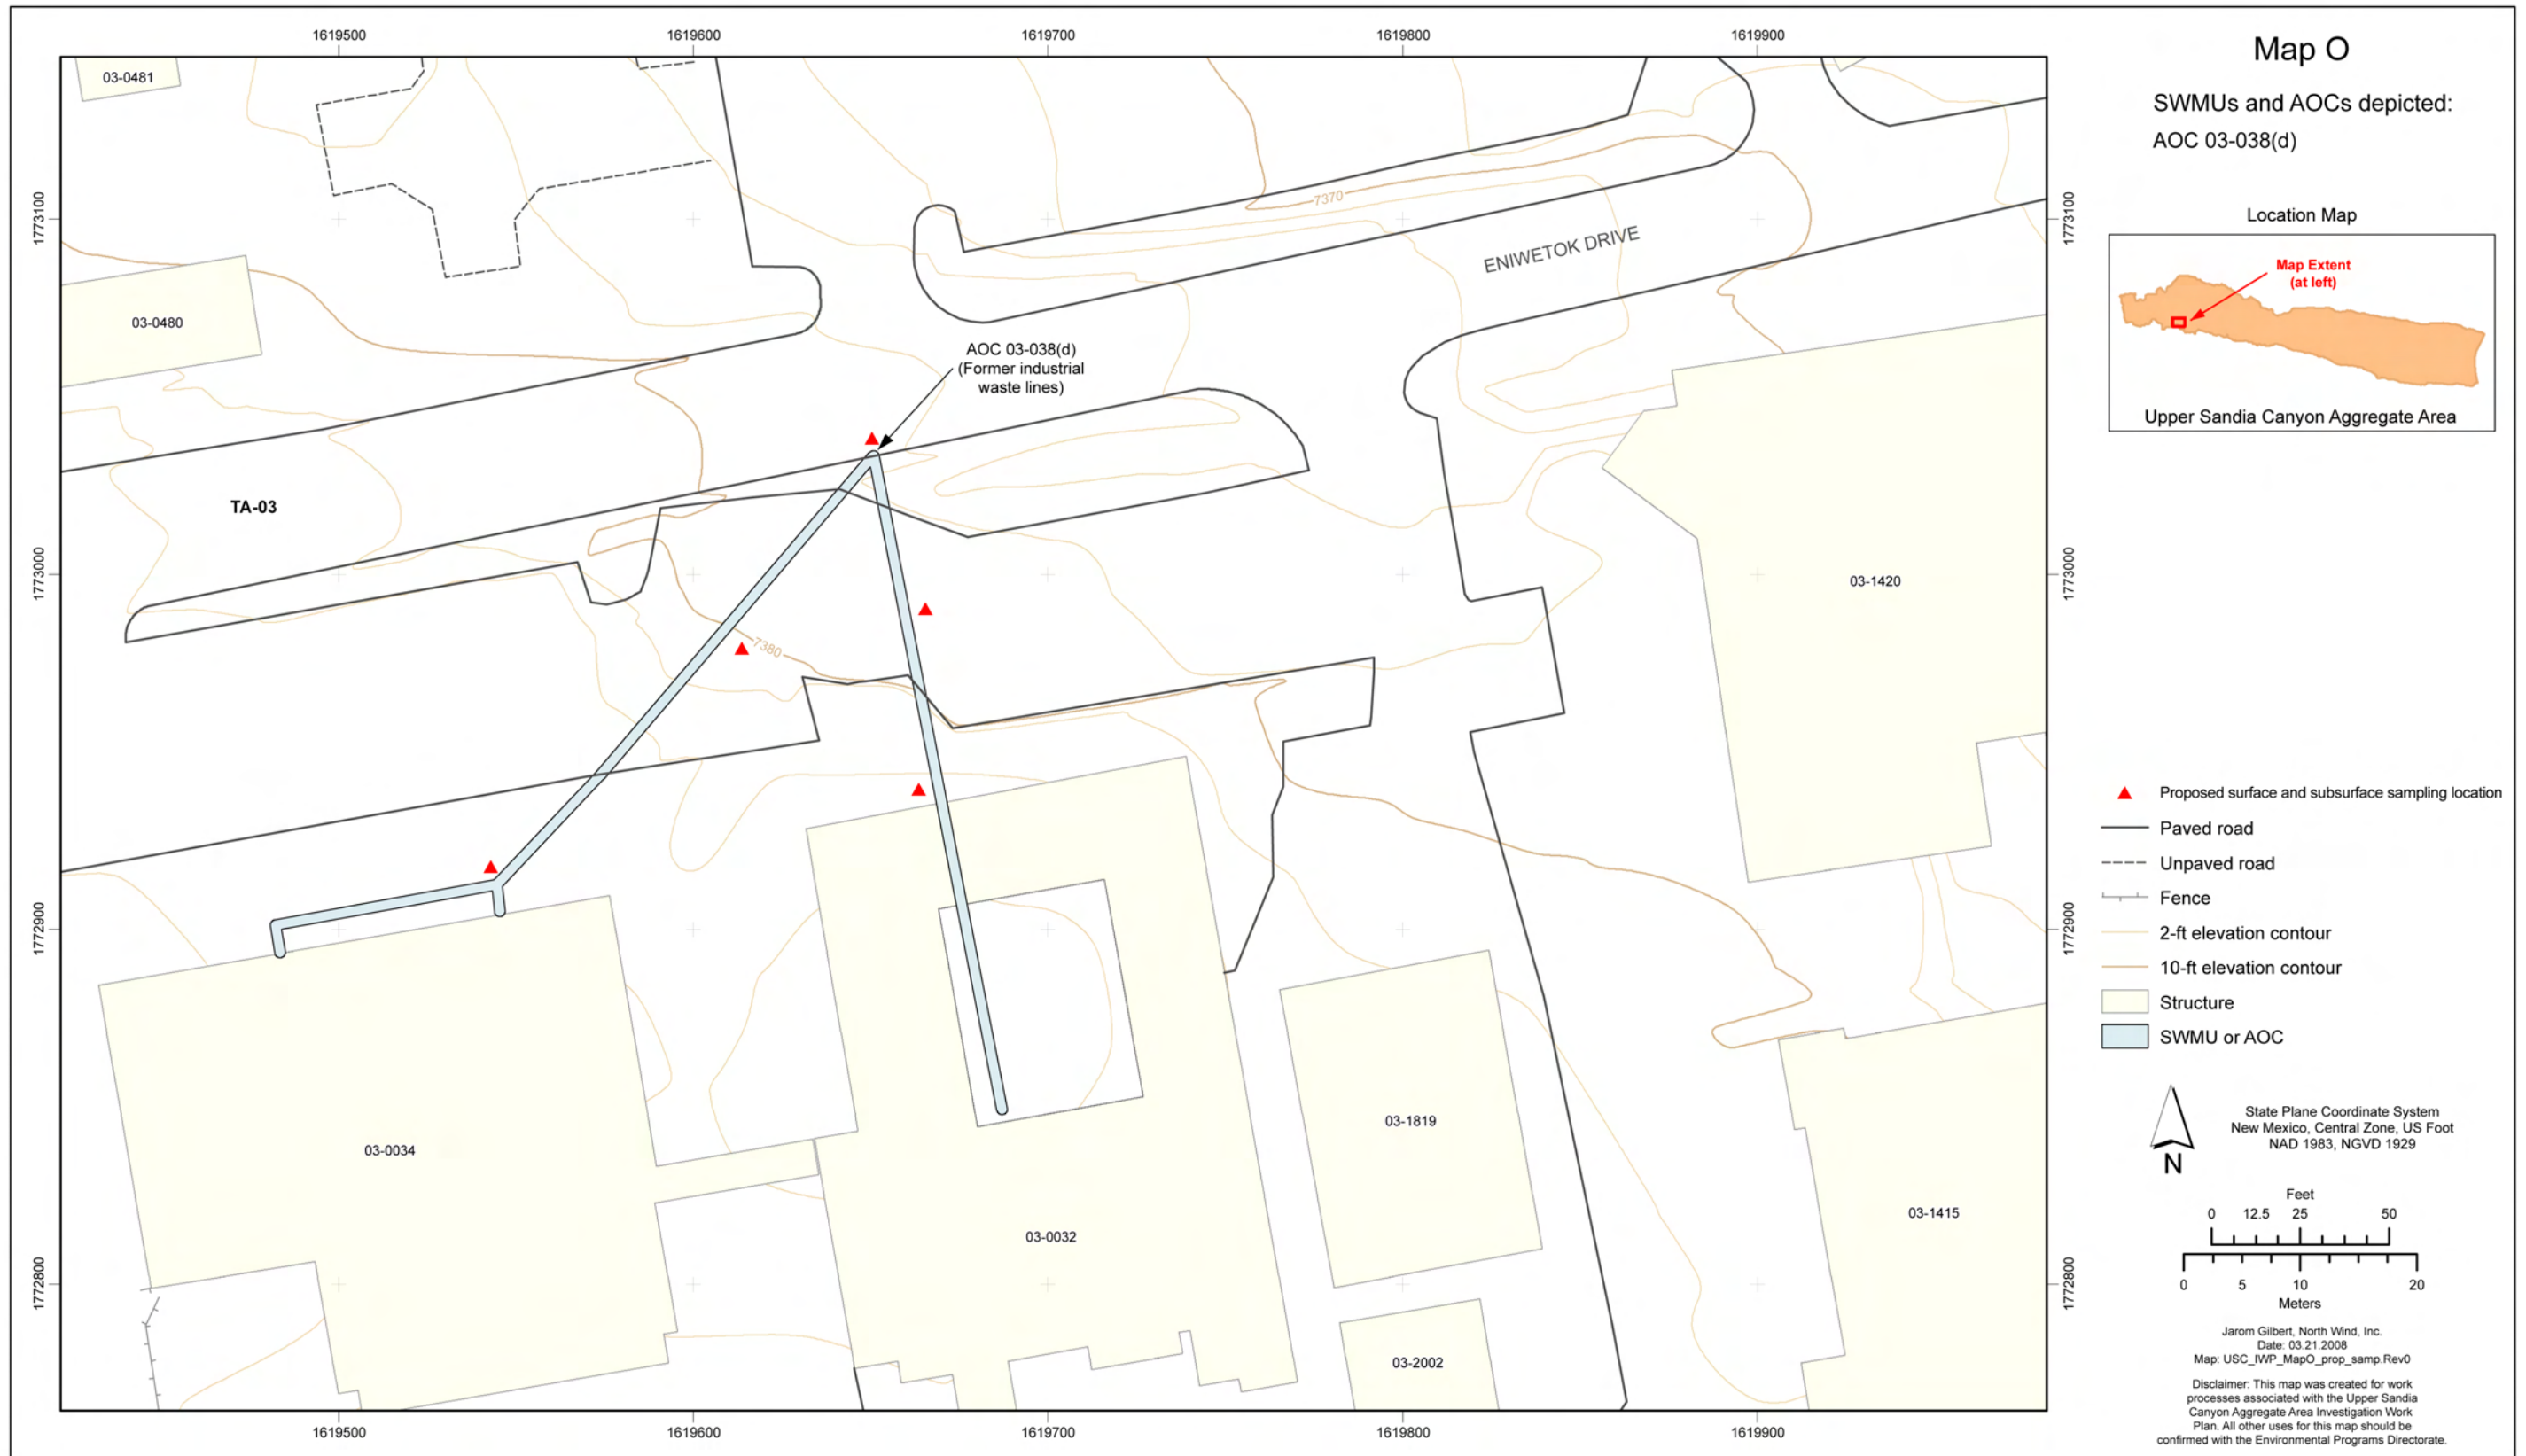


Figure 4.1-55 Map O proposed sampling locations

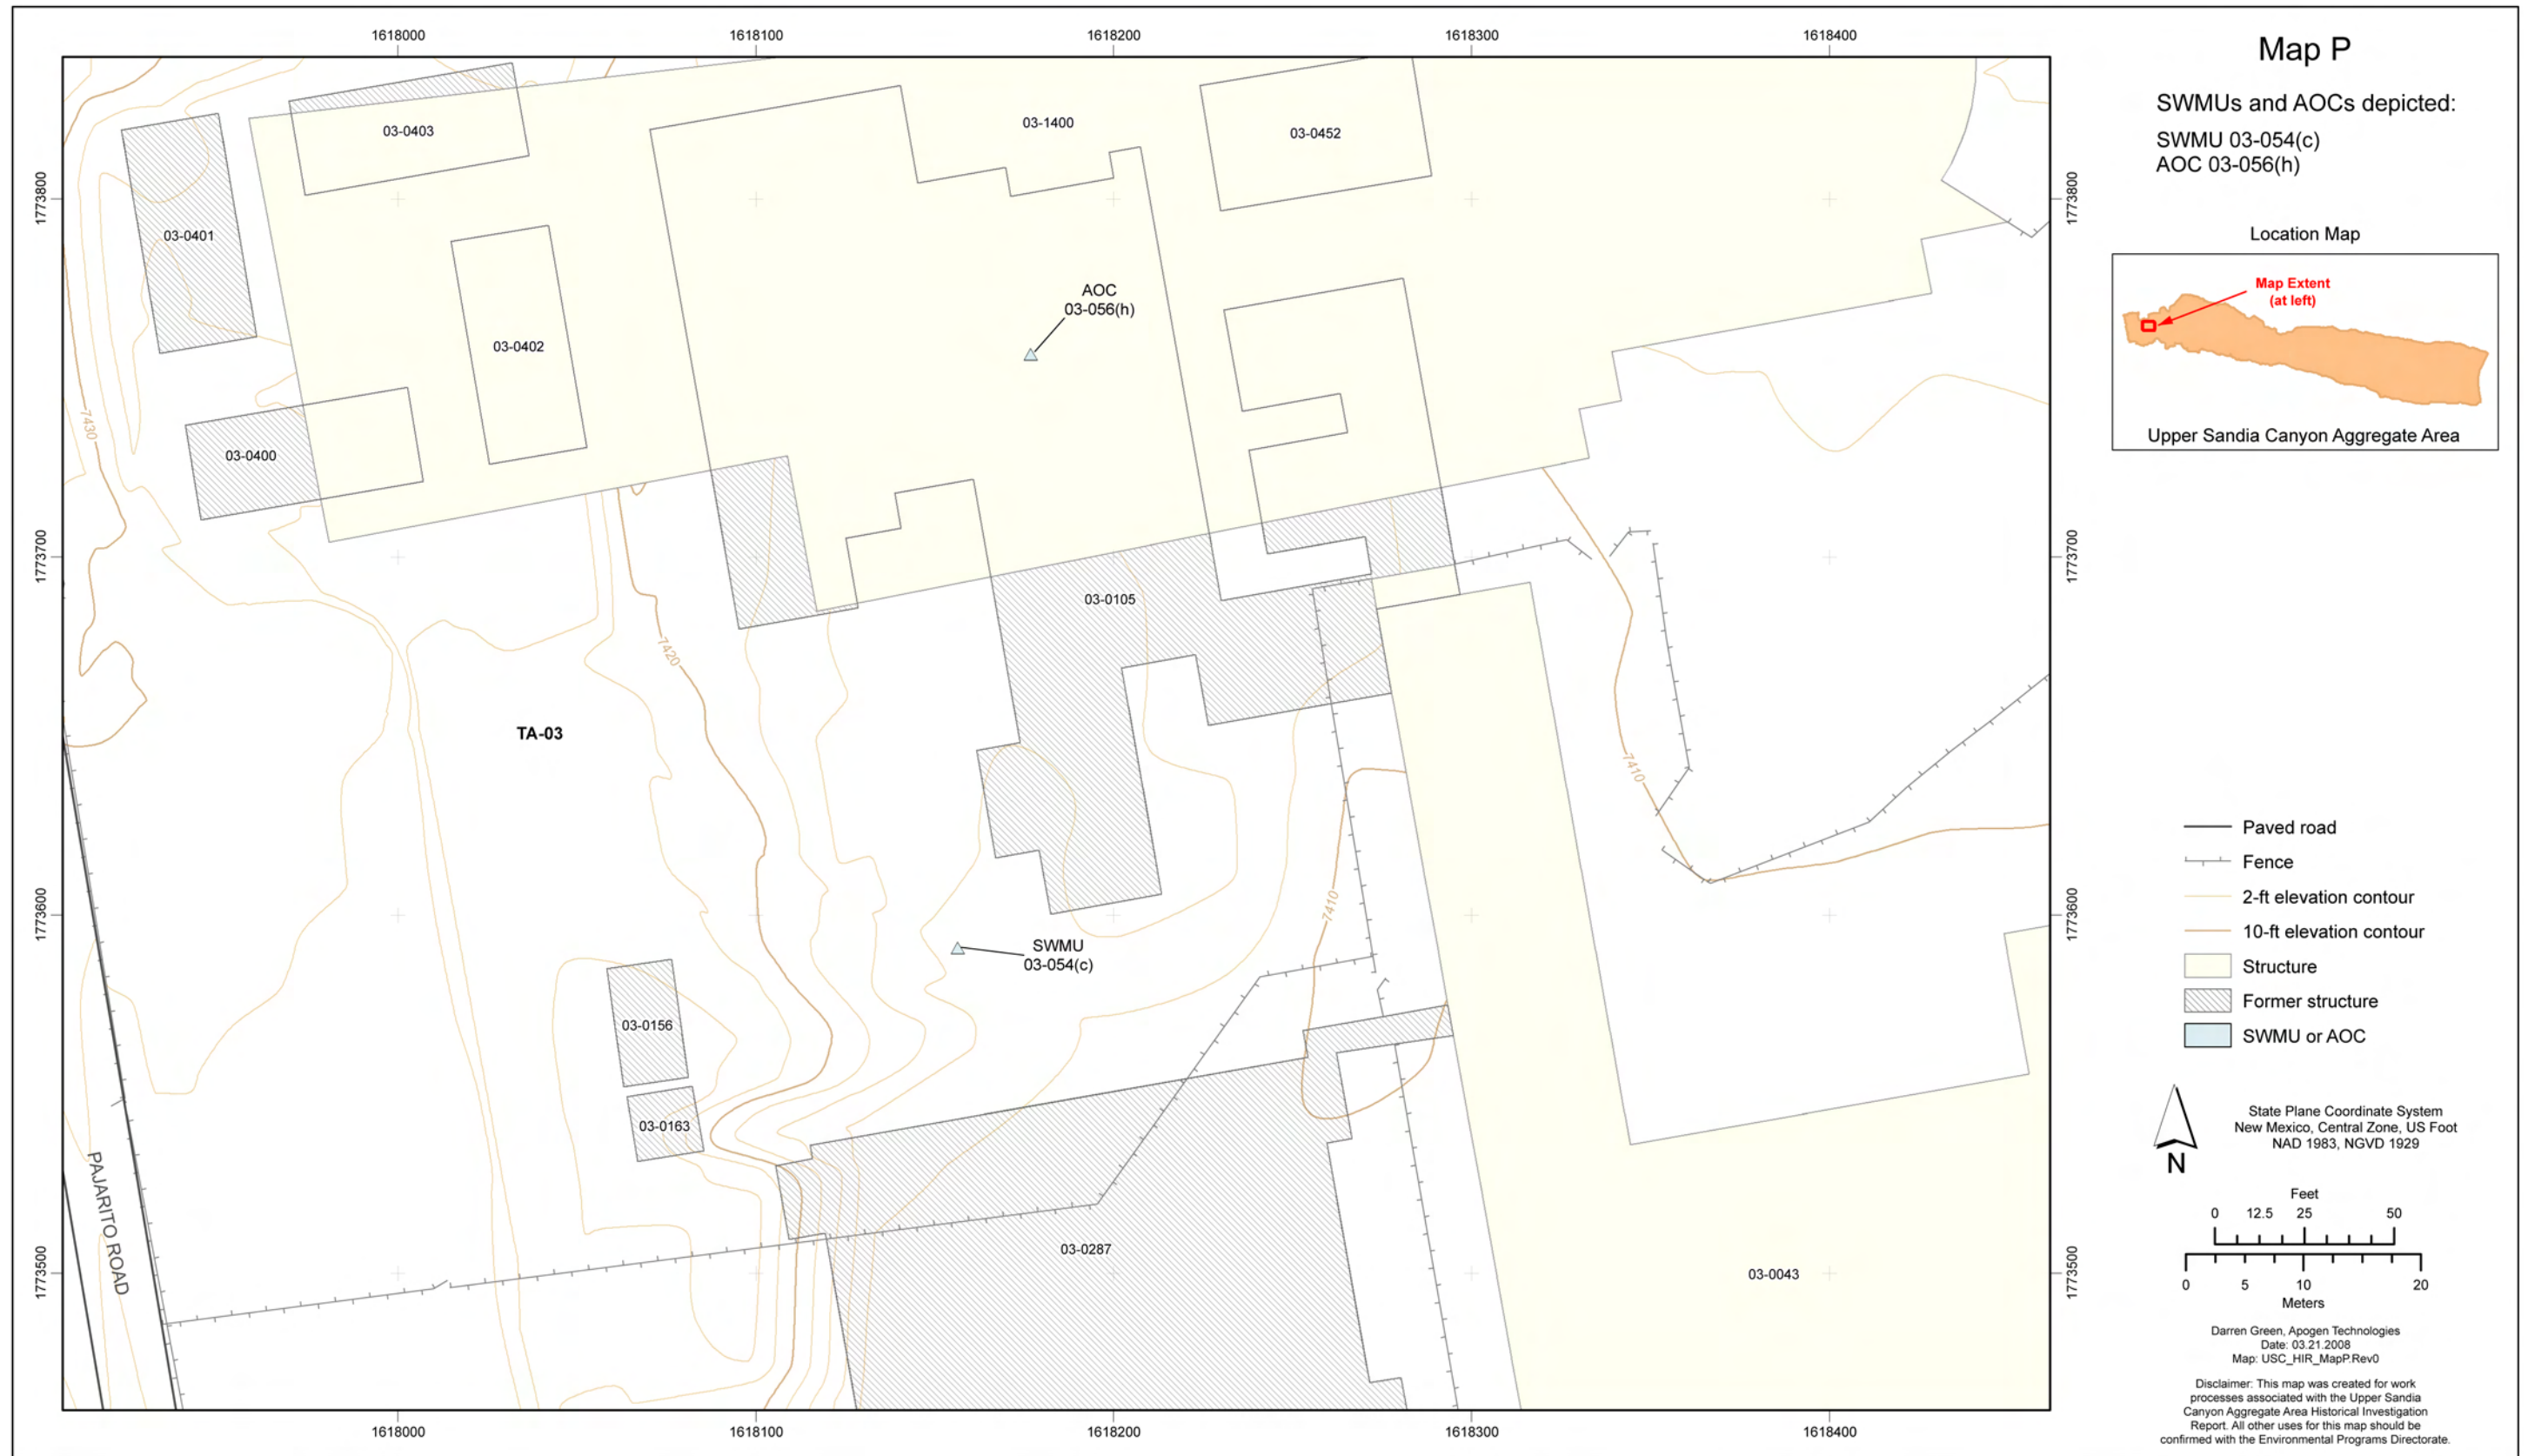


Figure 4.1-56 Map P site location



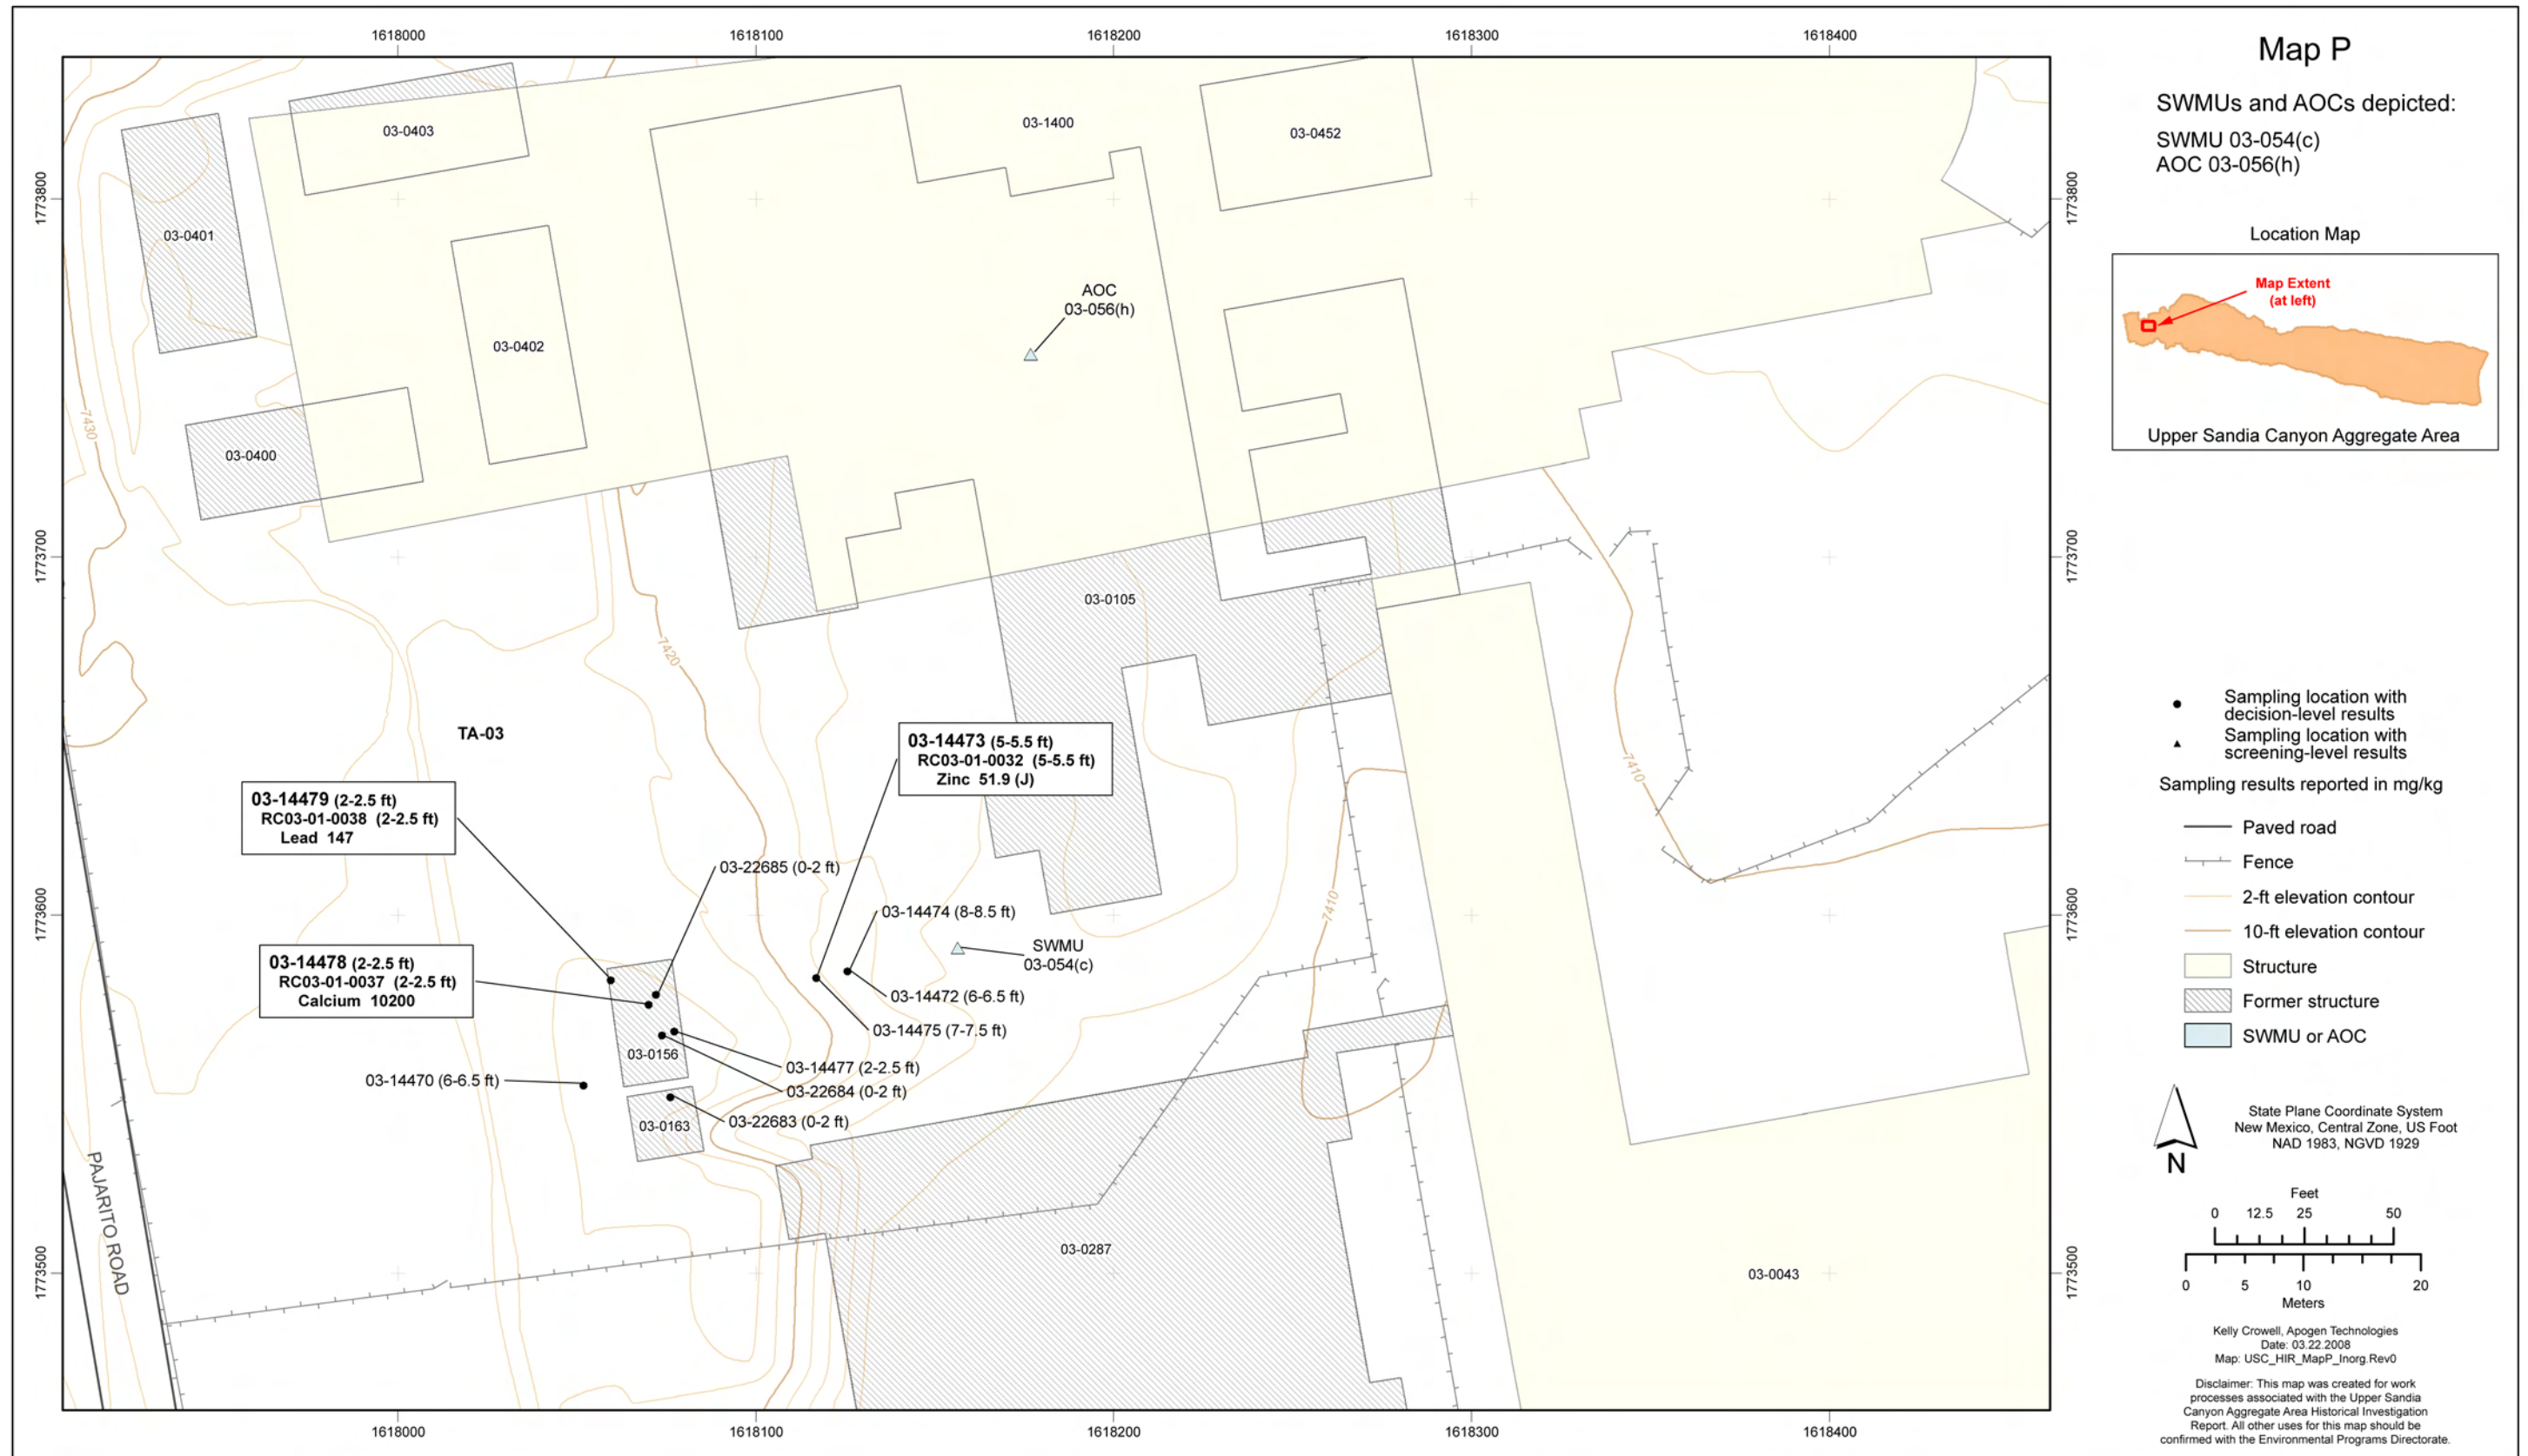


Figure 4.1-57 Map P inorganic chemical sampling locations and results detected above BVs



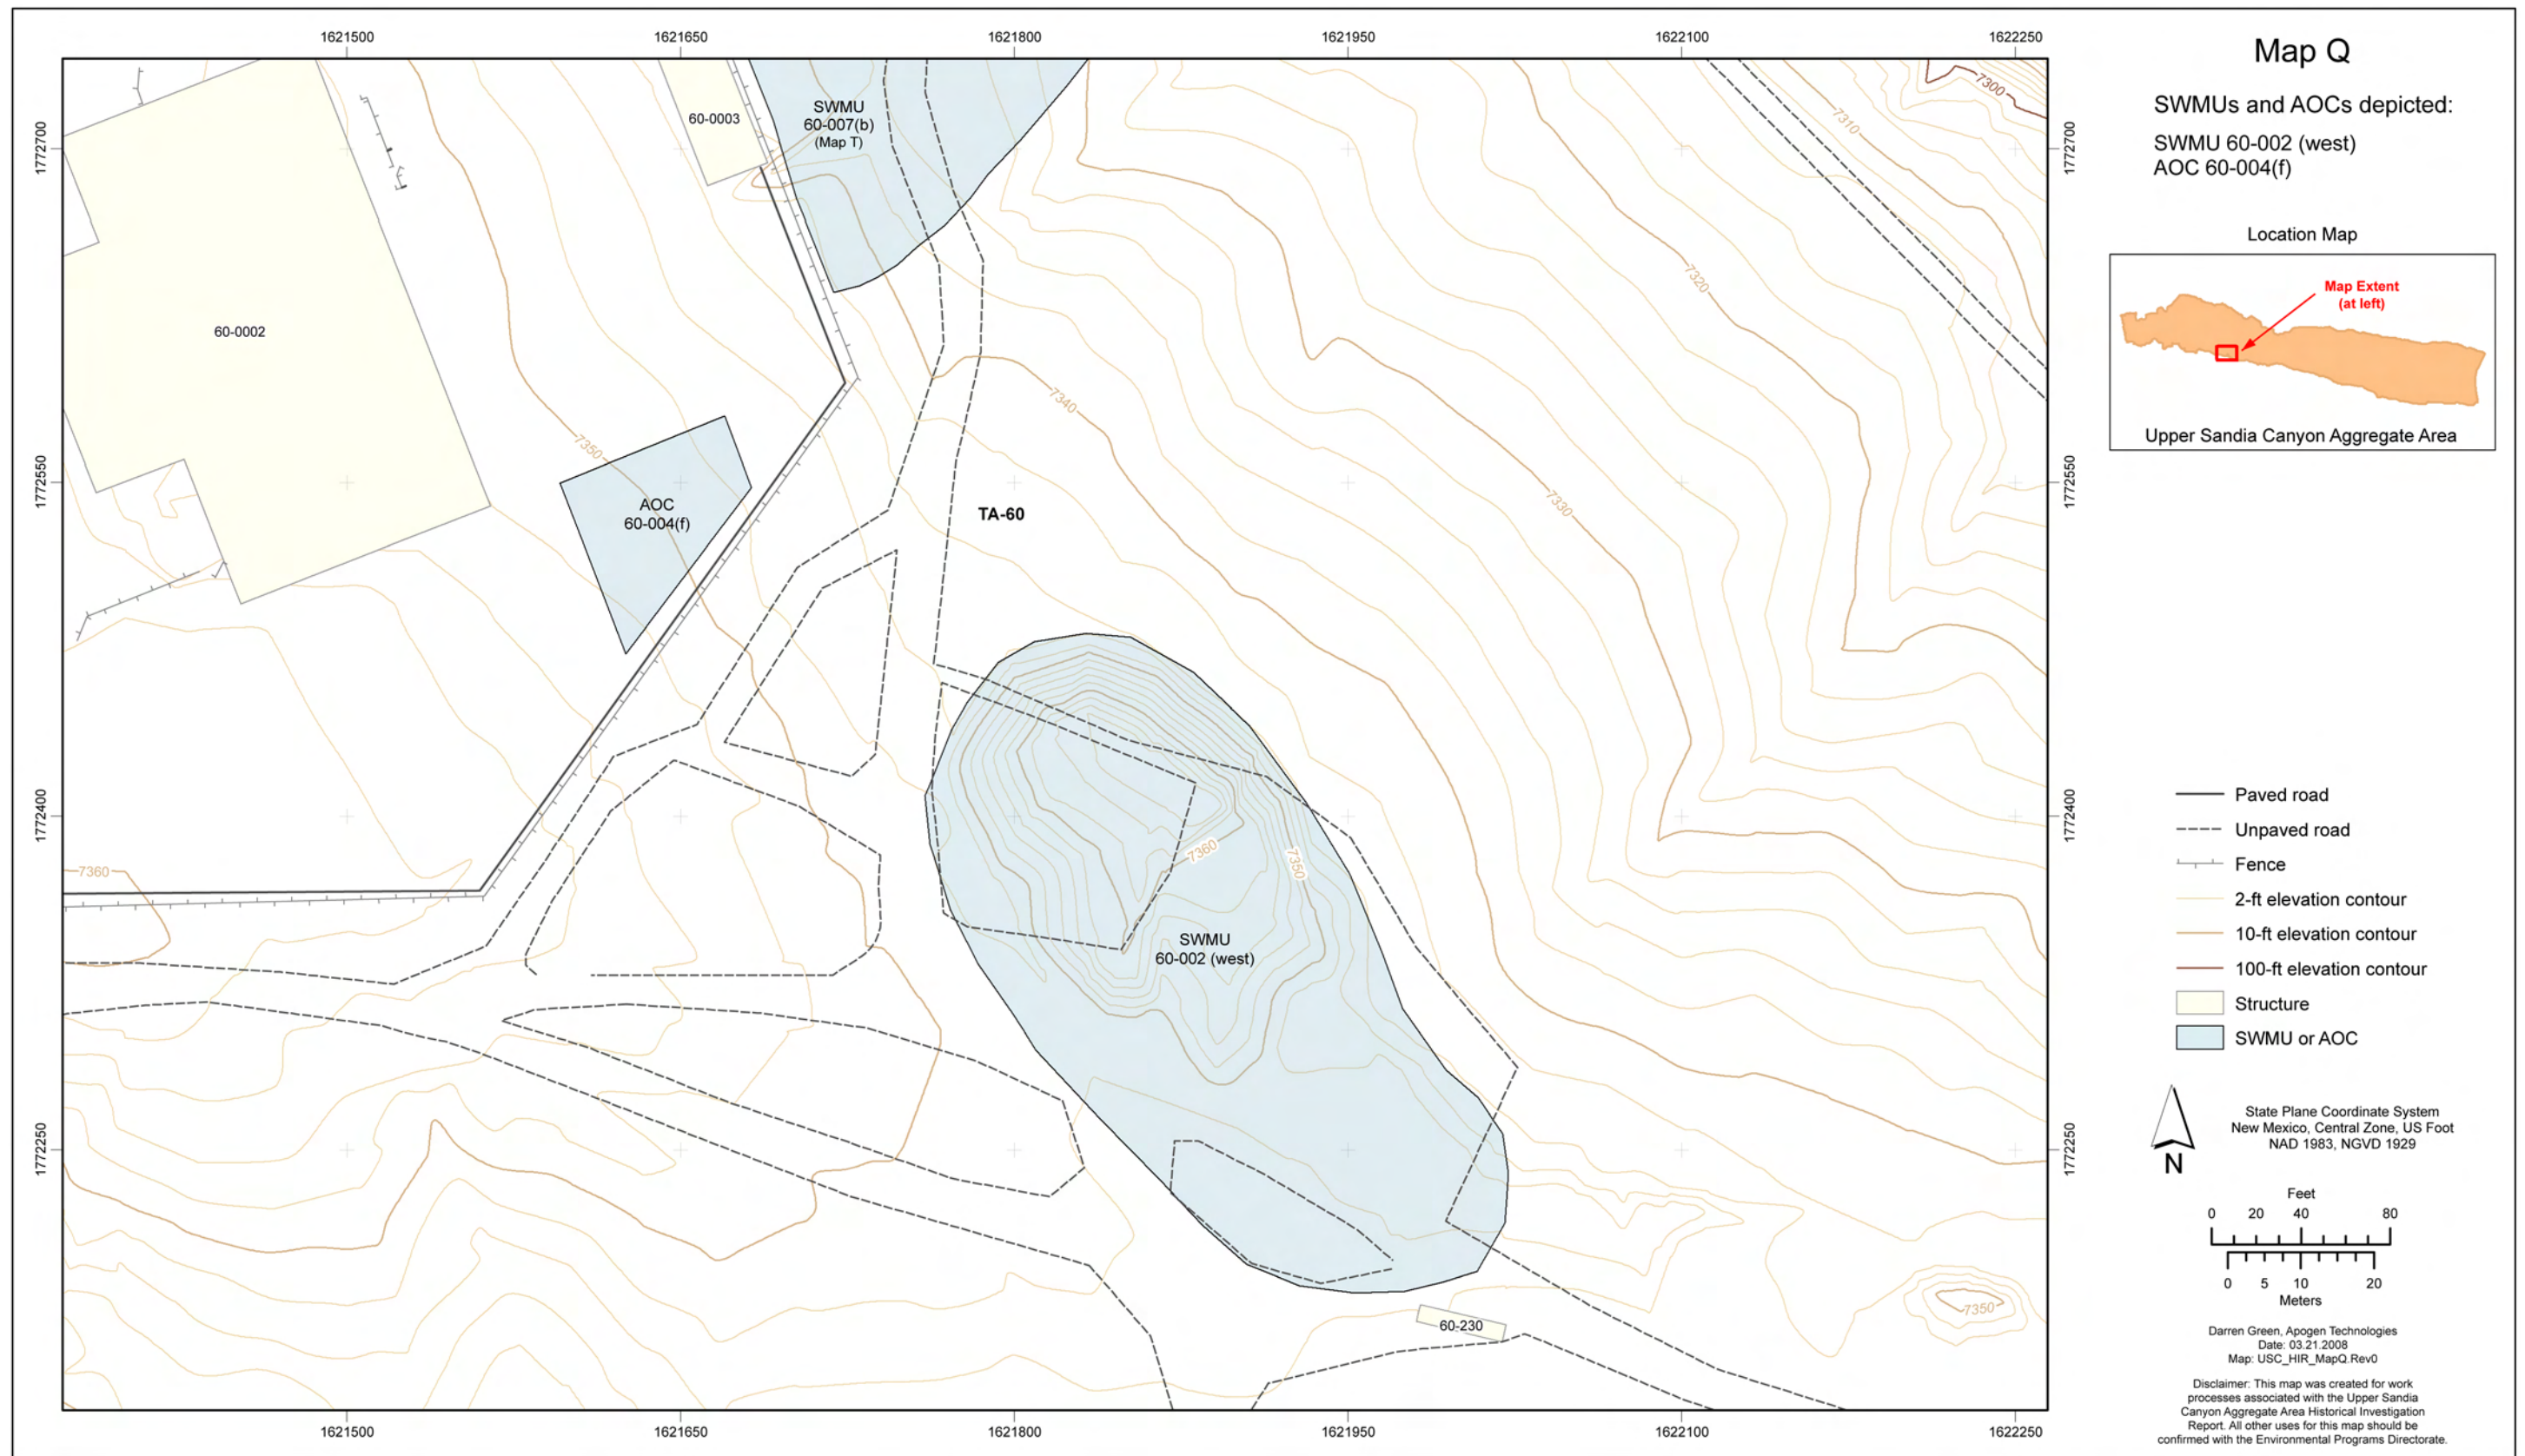


Figure 4.2-1 Map Q site location



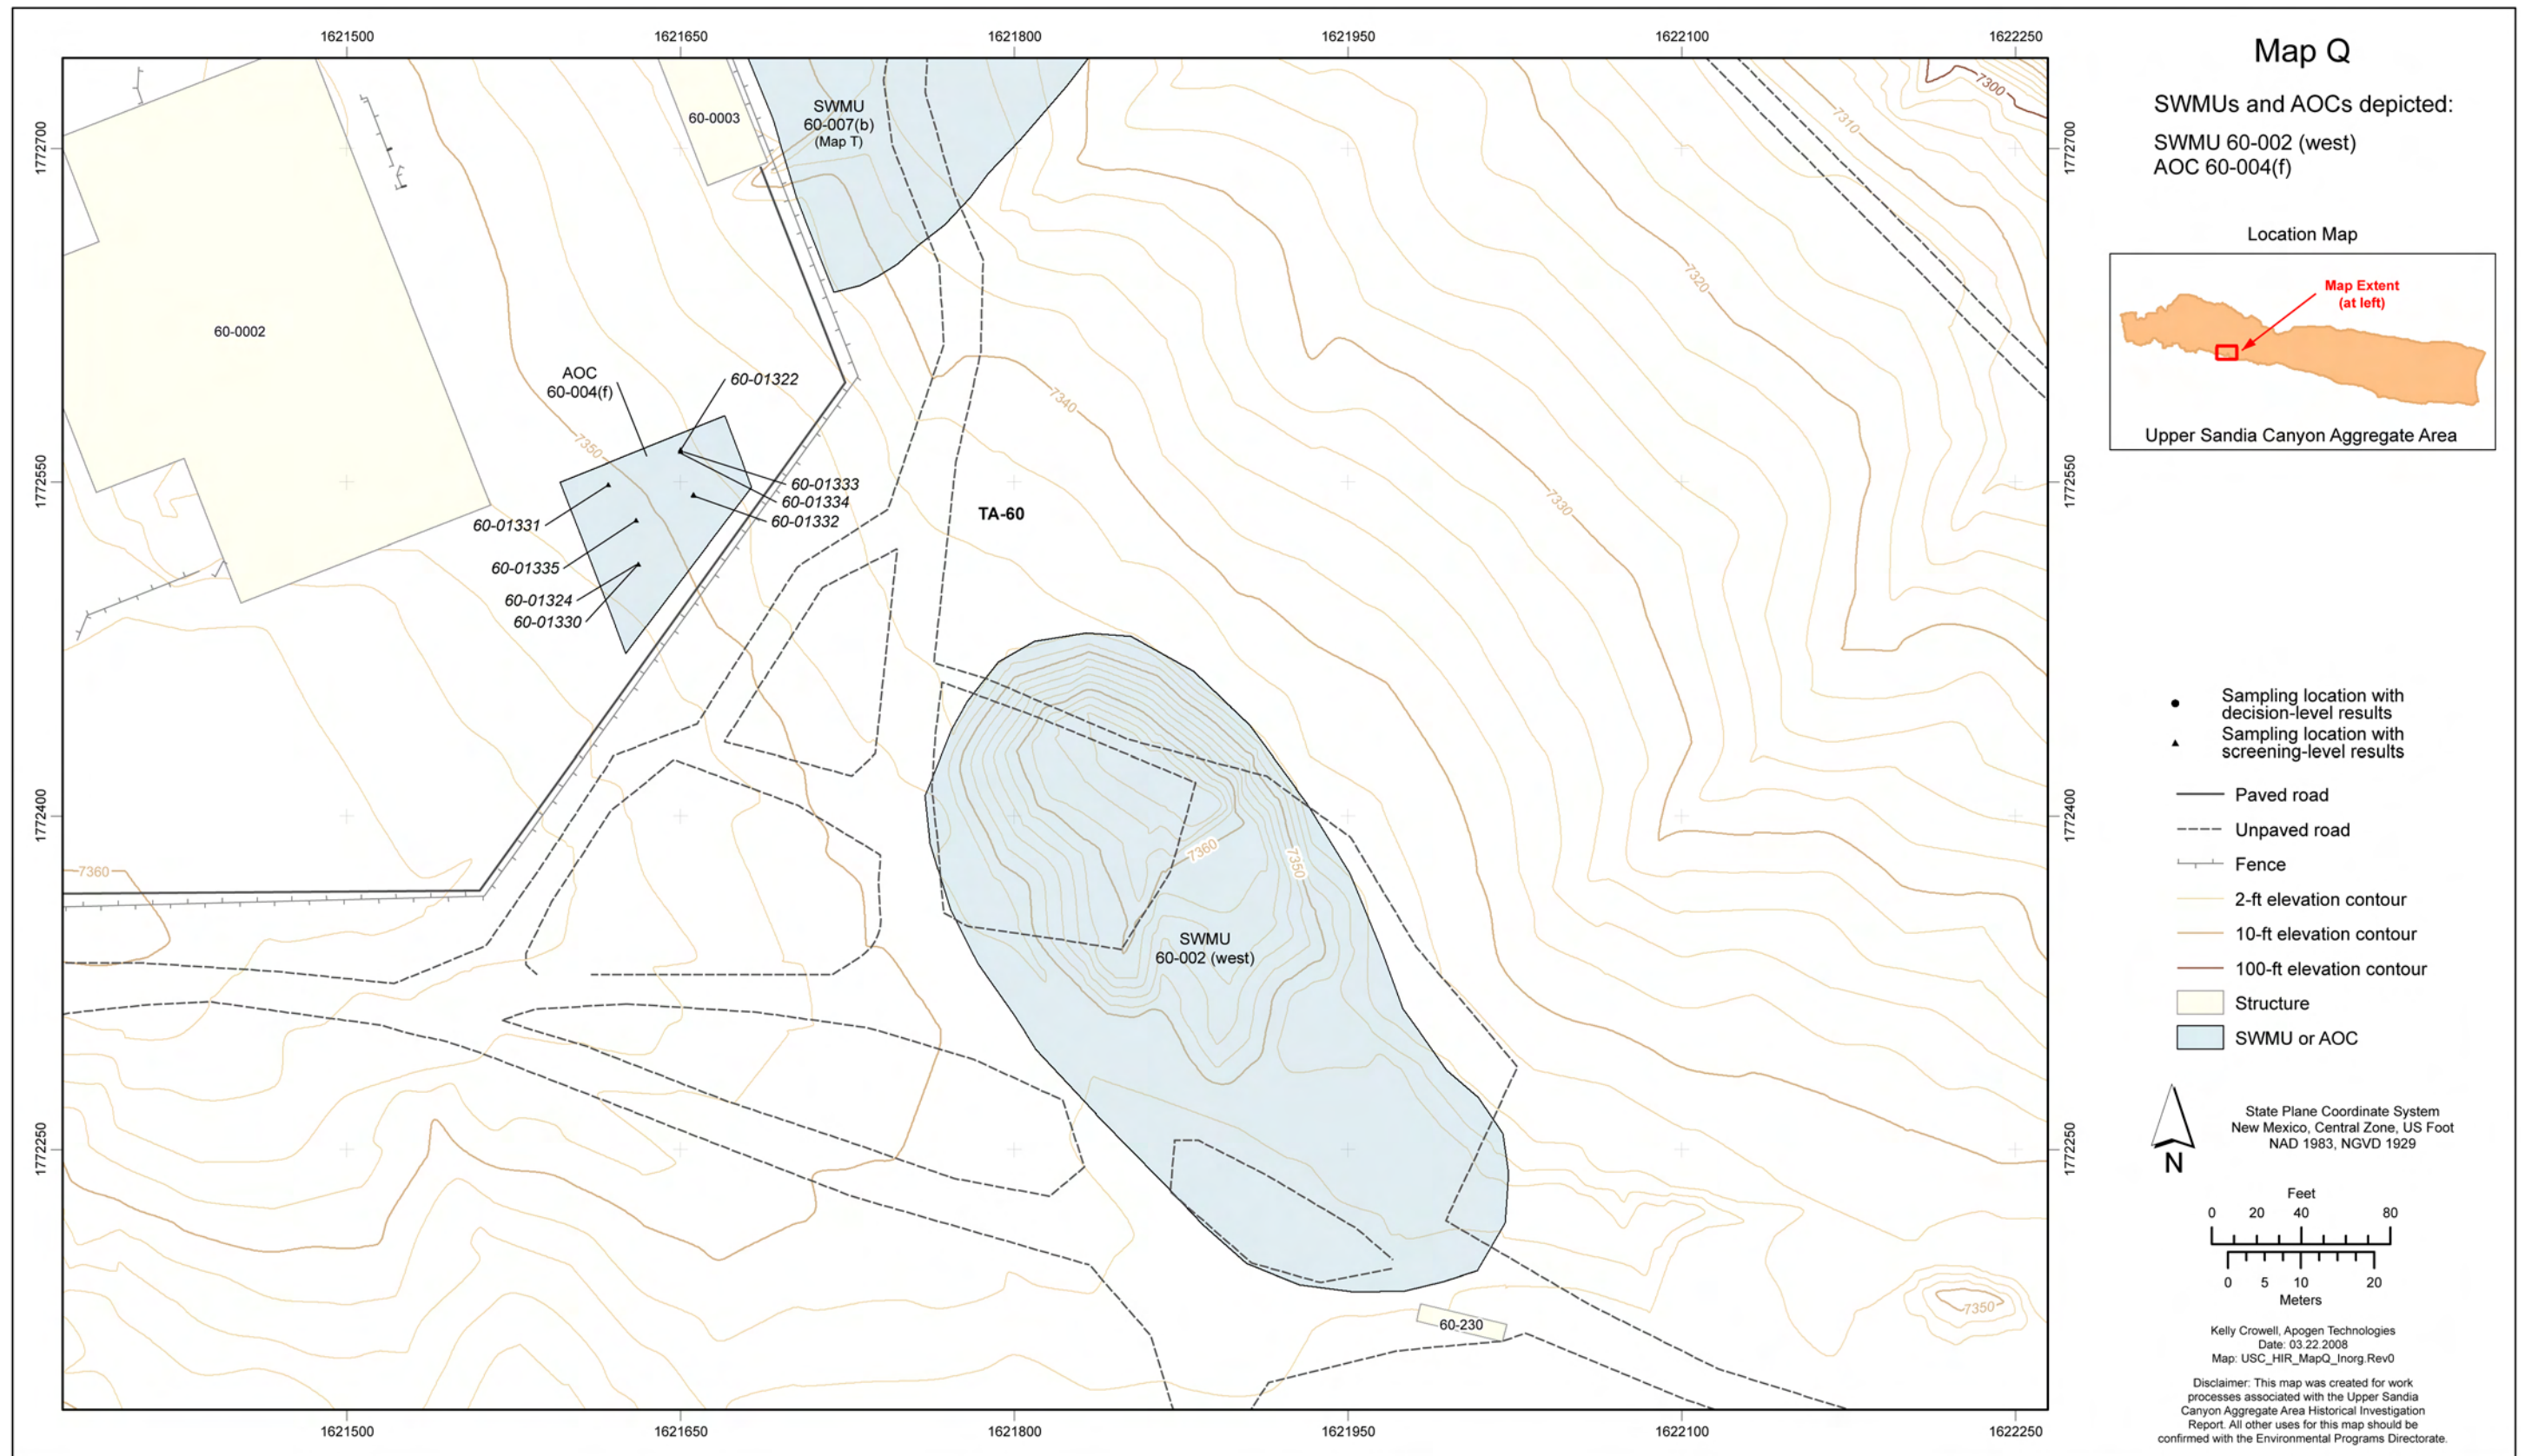


Figure 4.2-2 Map Q inorganic chemical sampling locations and results detected above BVs



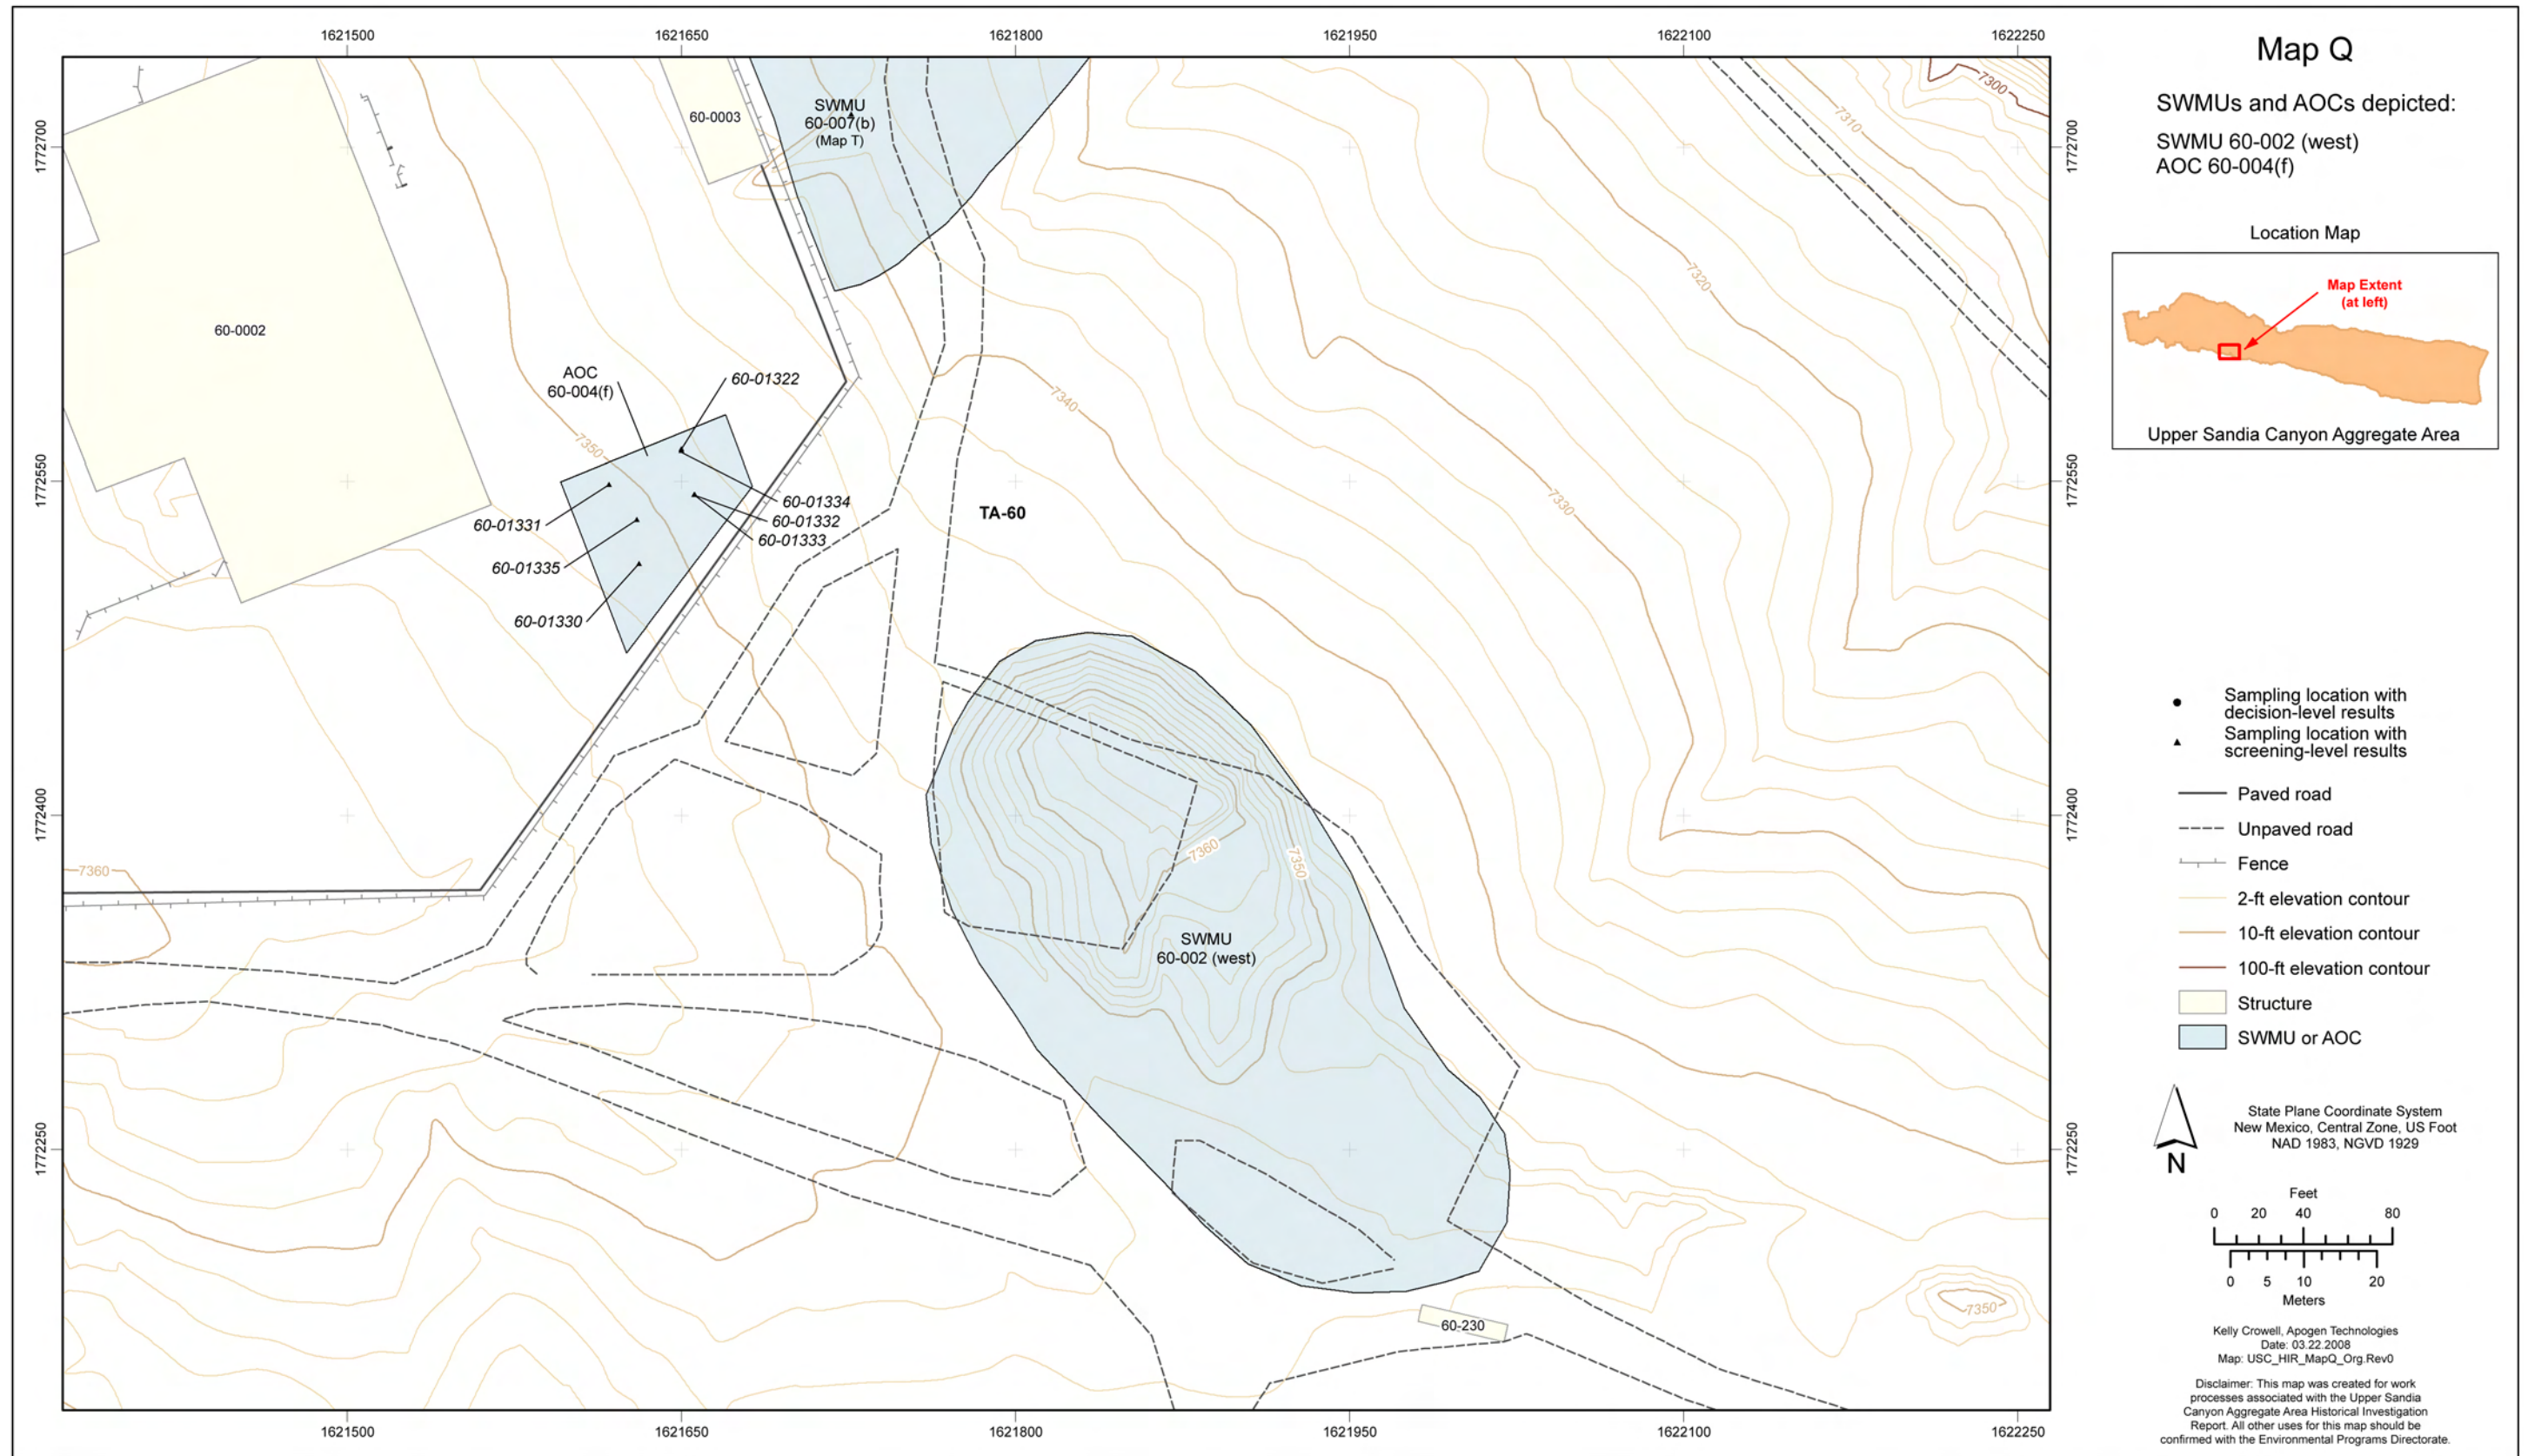


Figure 4.2-3 Map Q organic chemical sampling locations



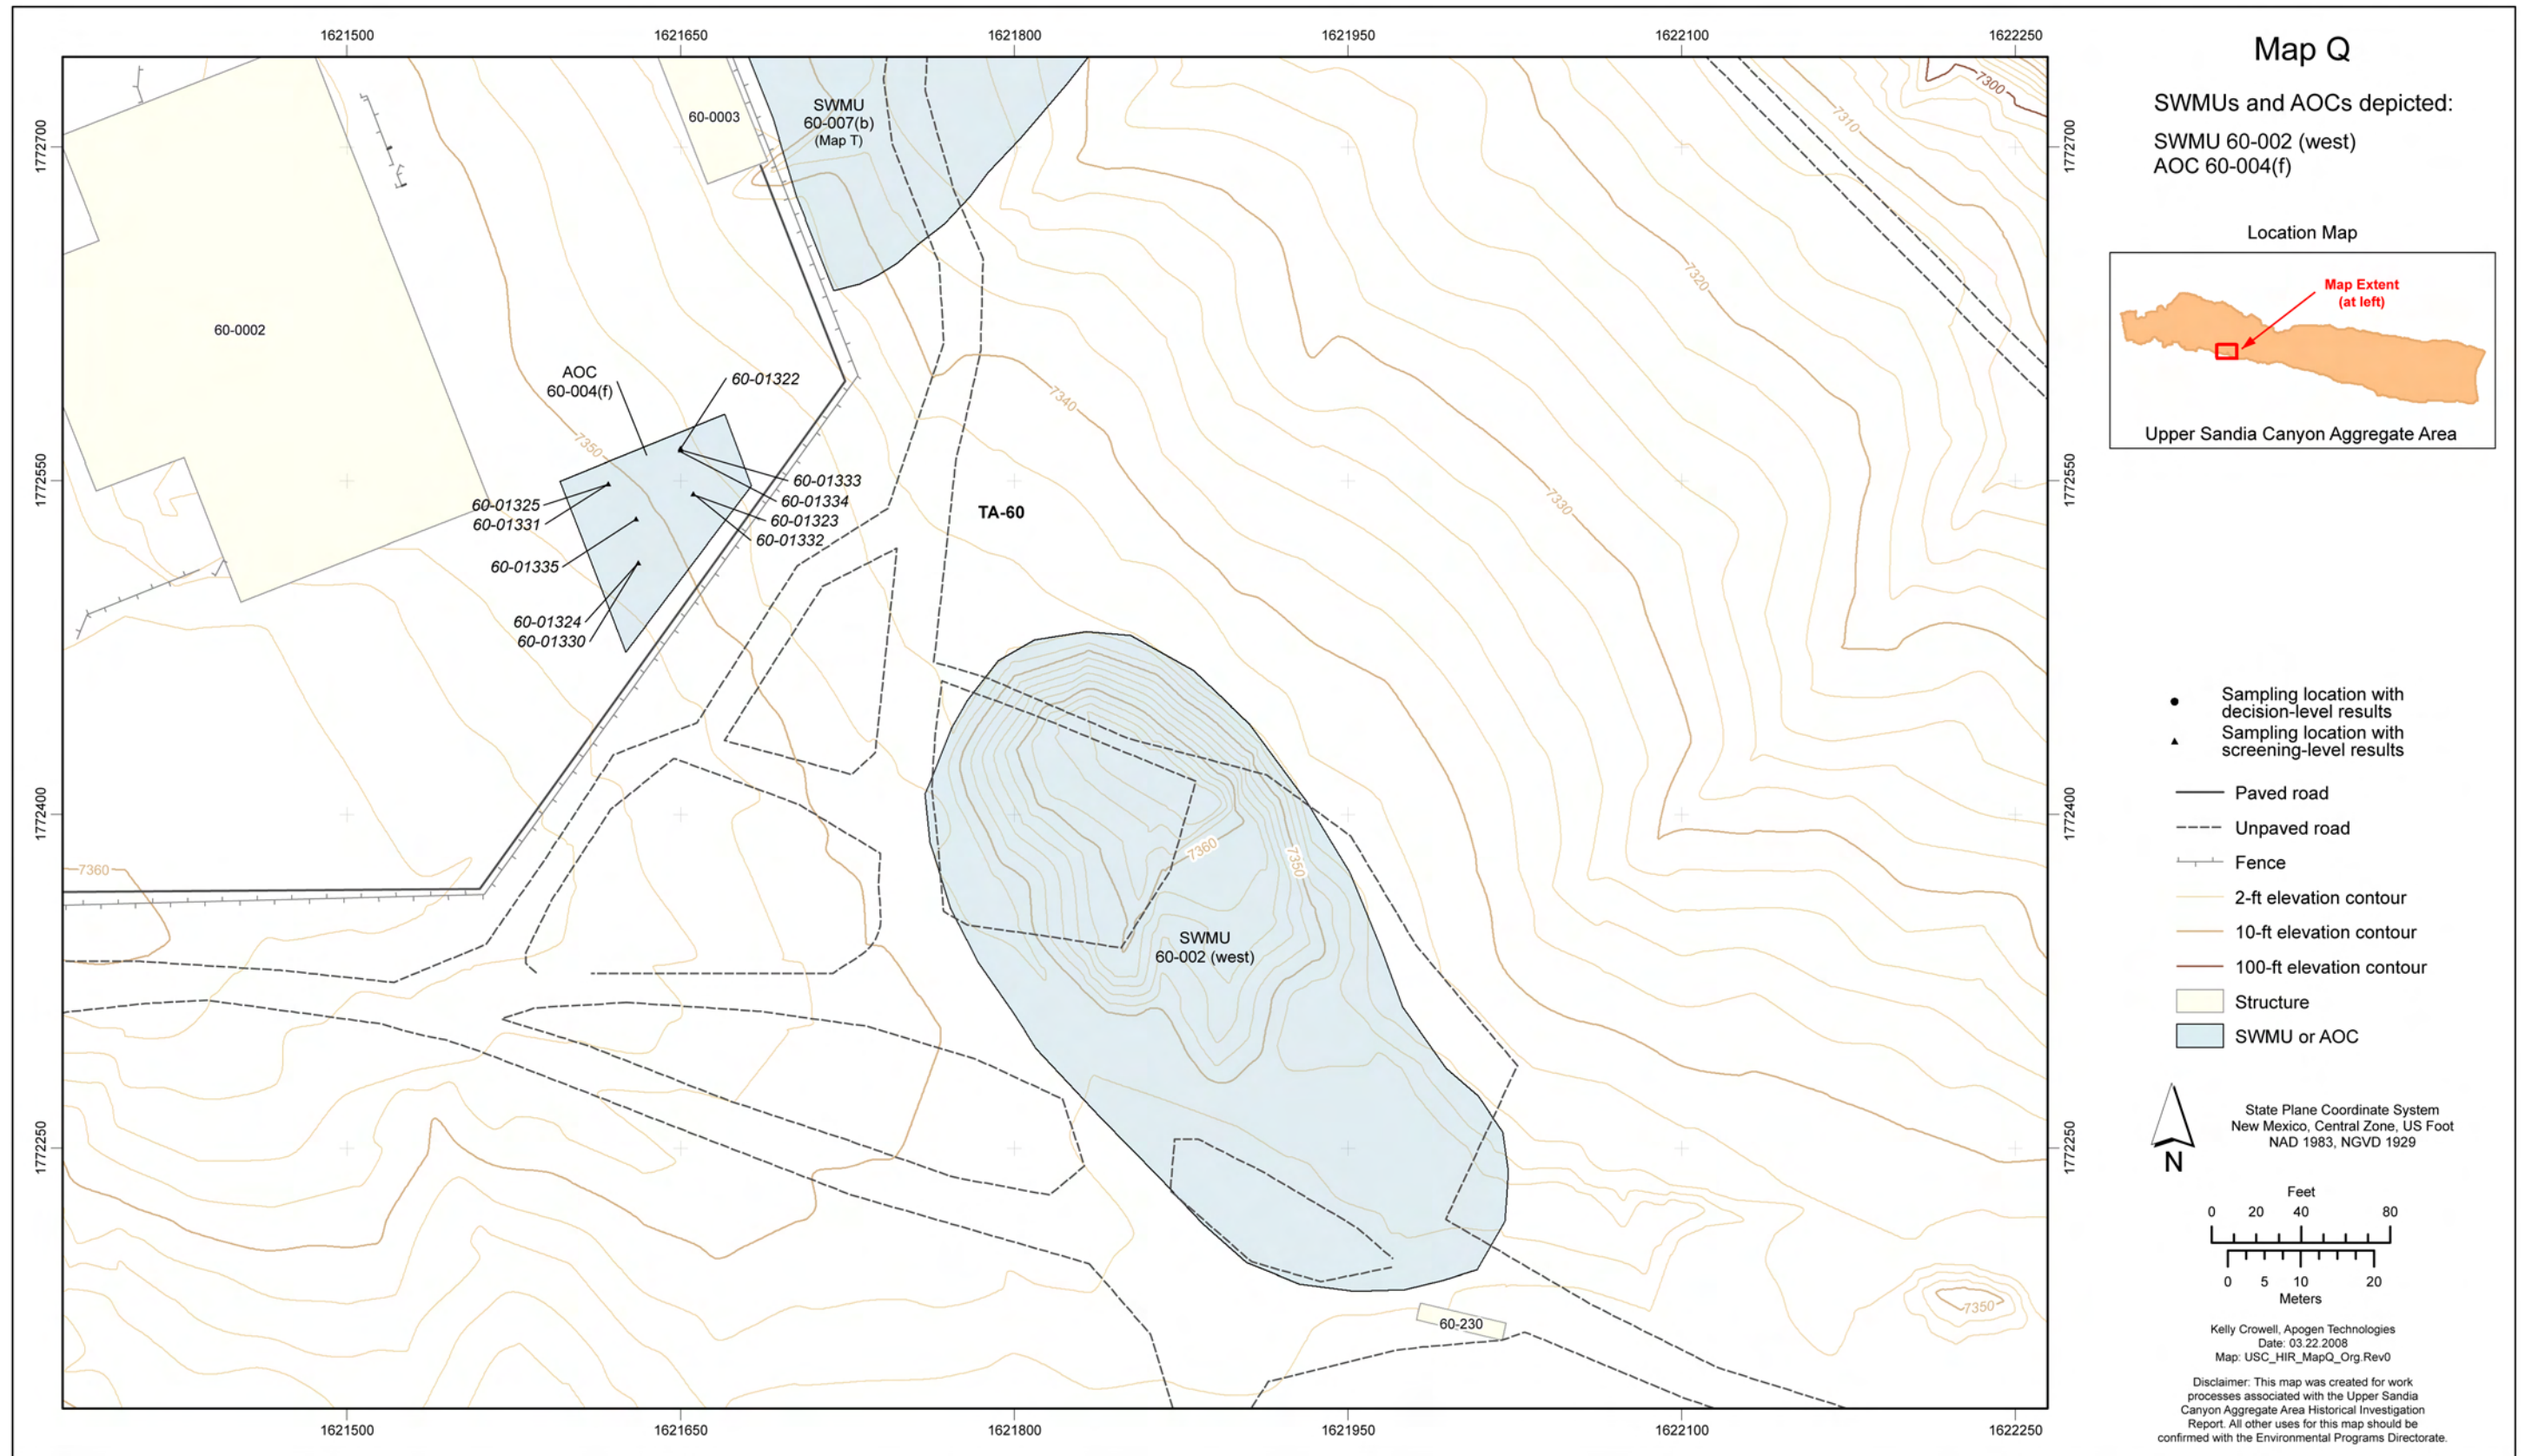


Figure 4.2-4 Map Q radionuclide sampling locations



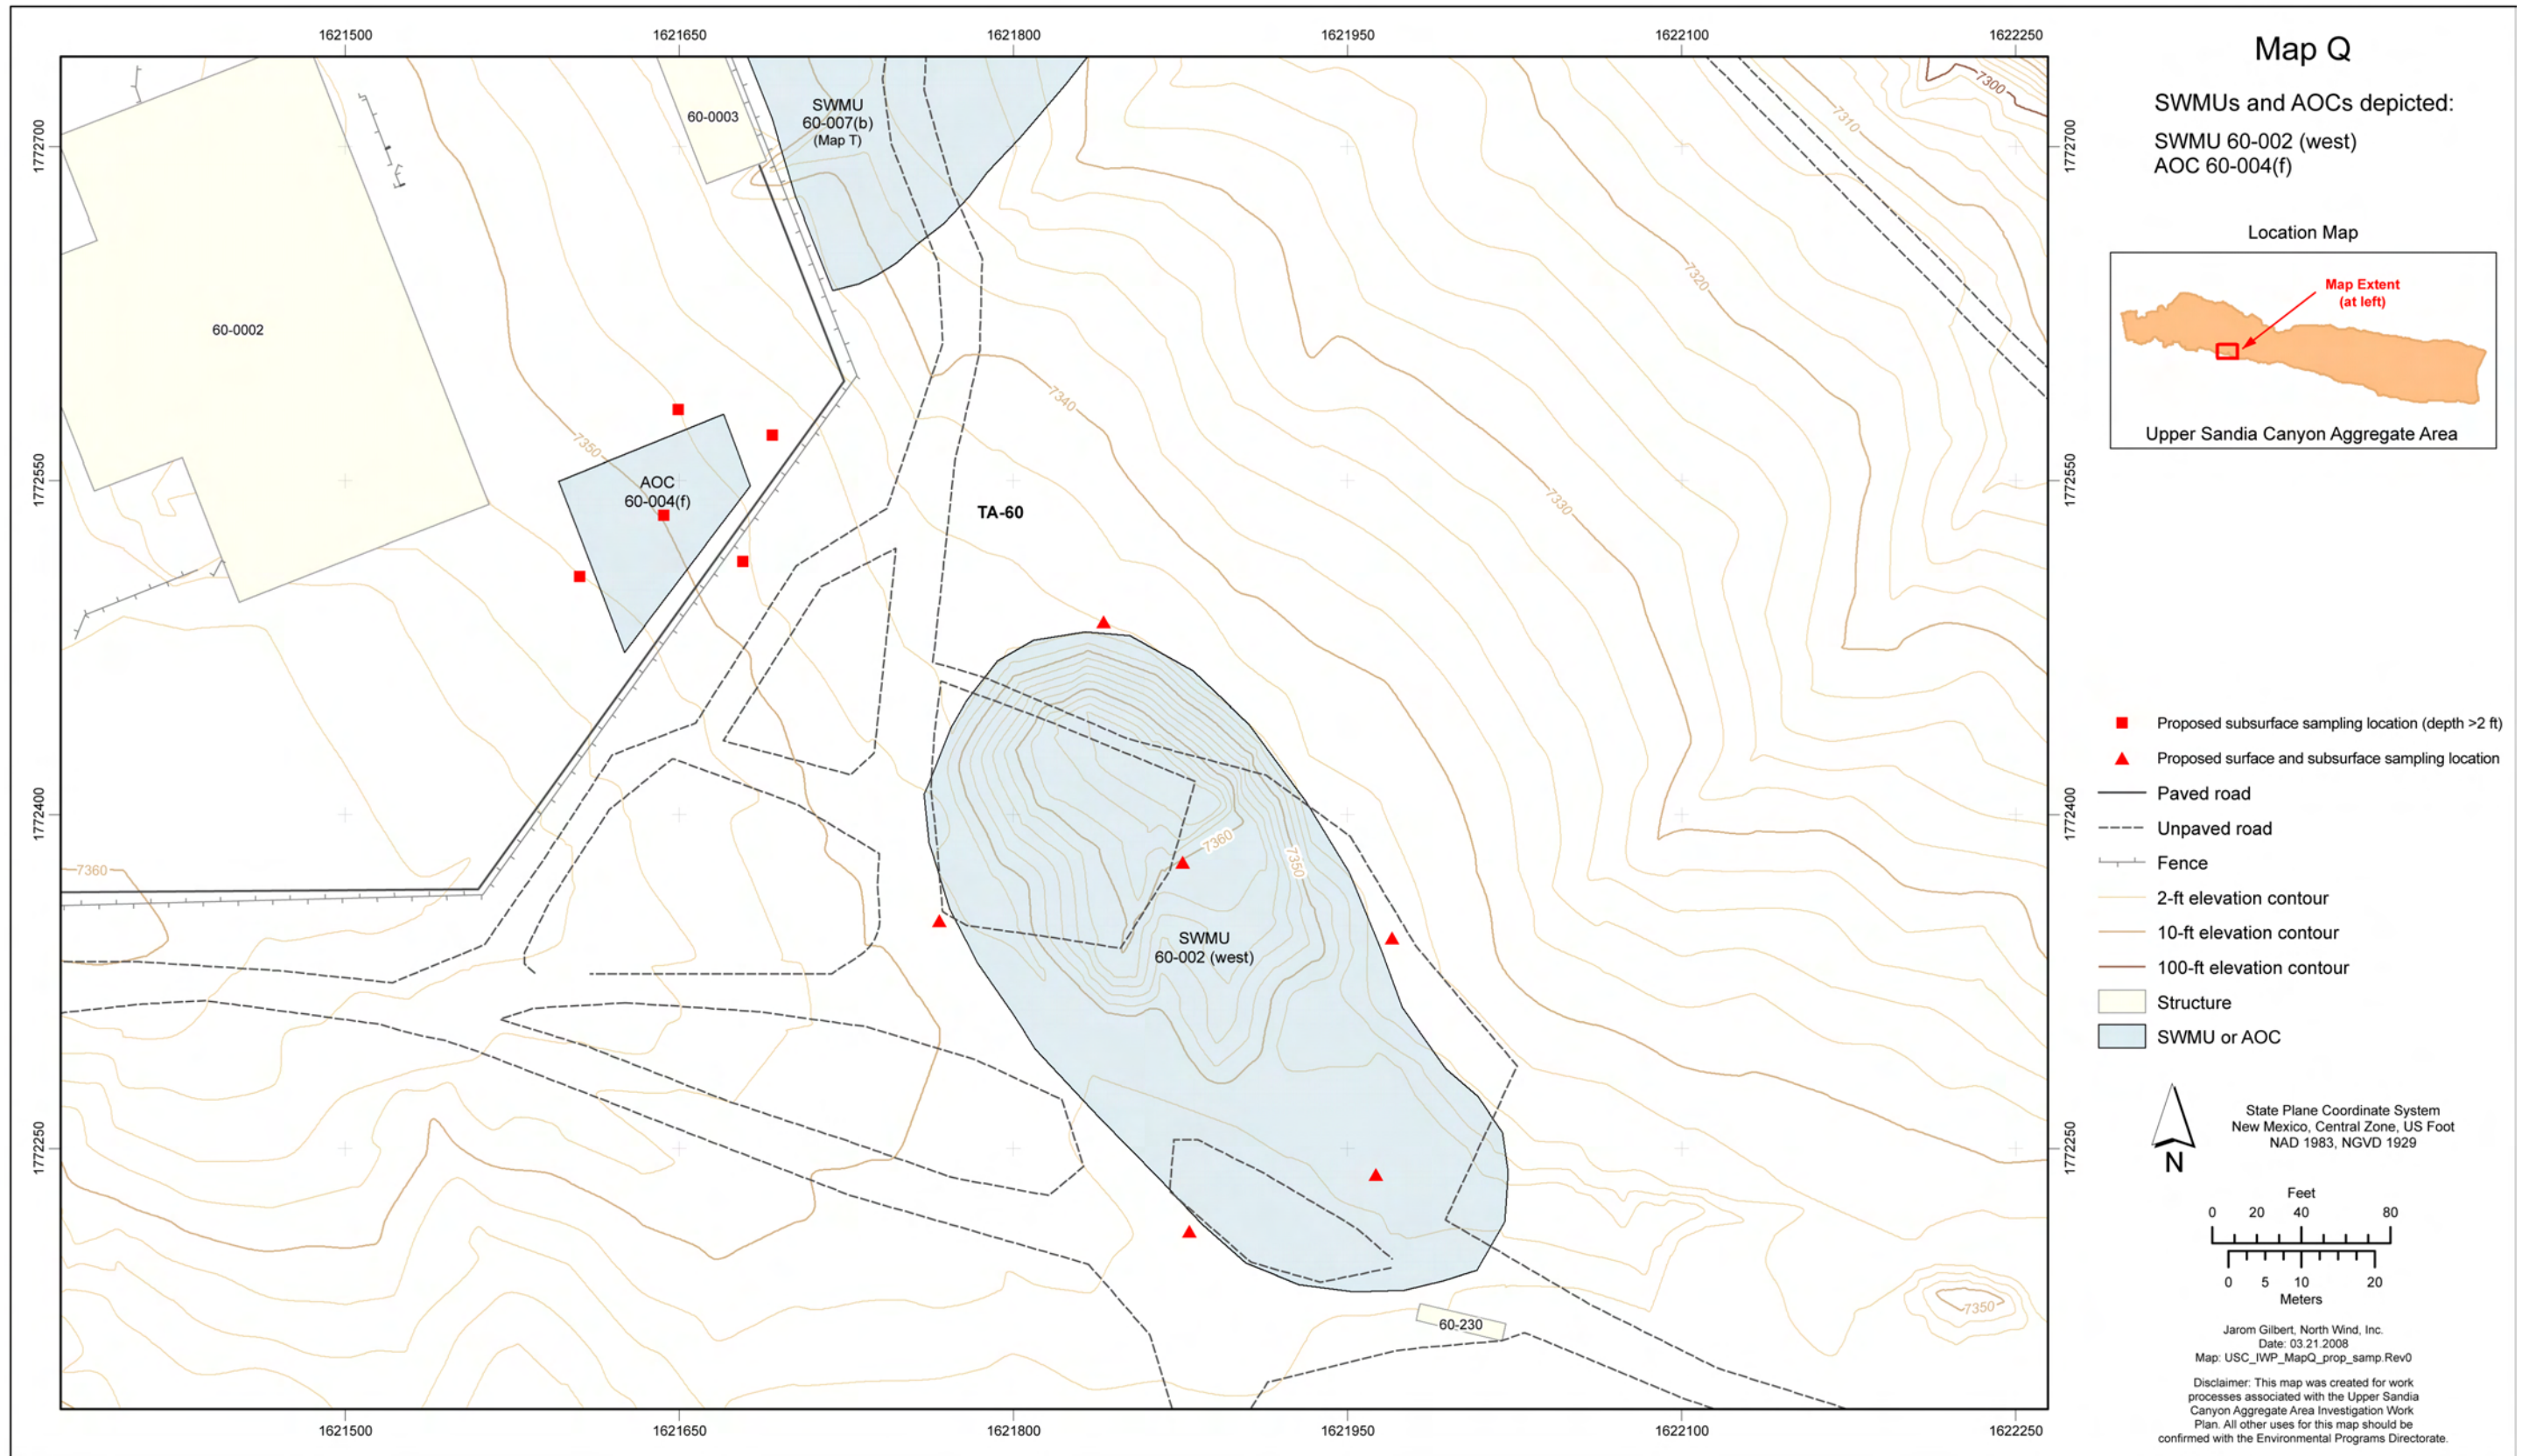


Figure 4.2-5 Map Q proposed sampling locations



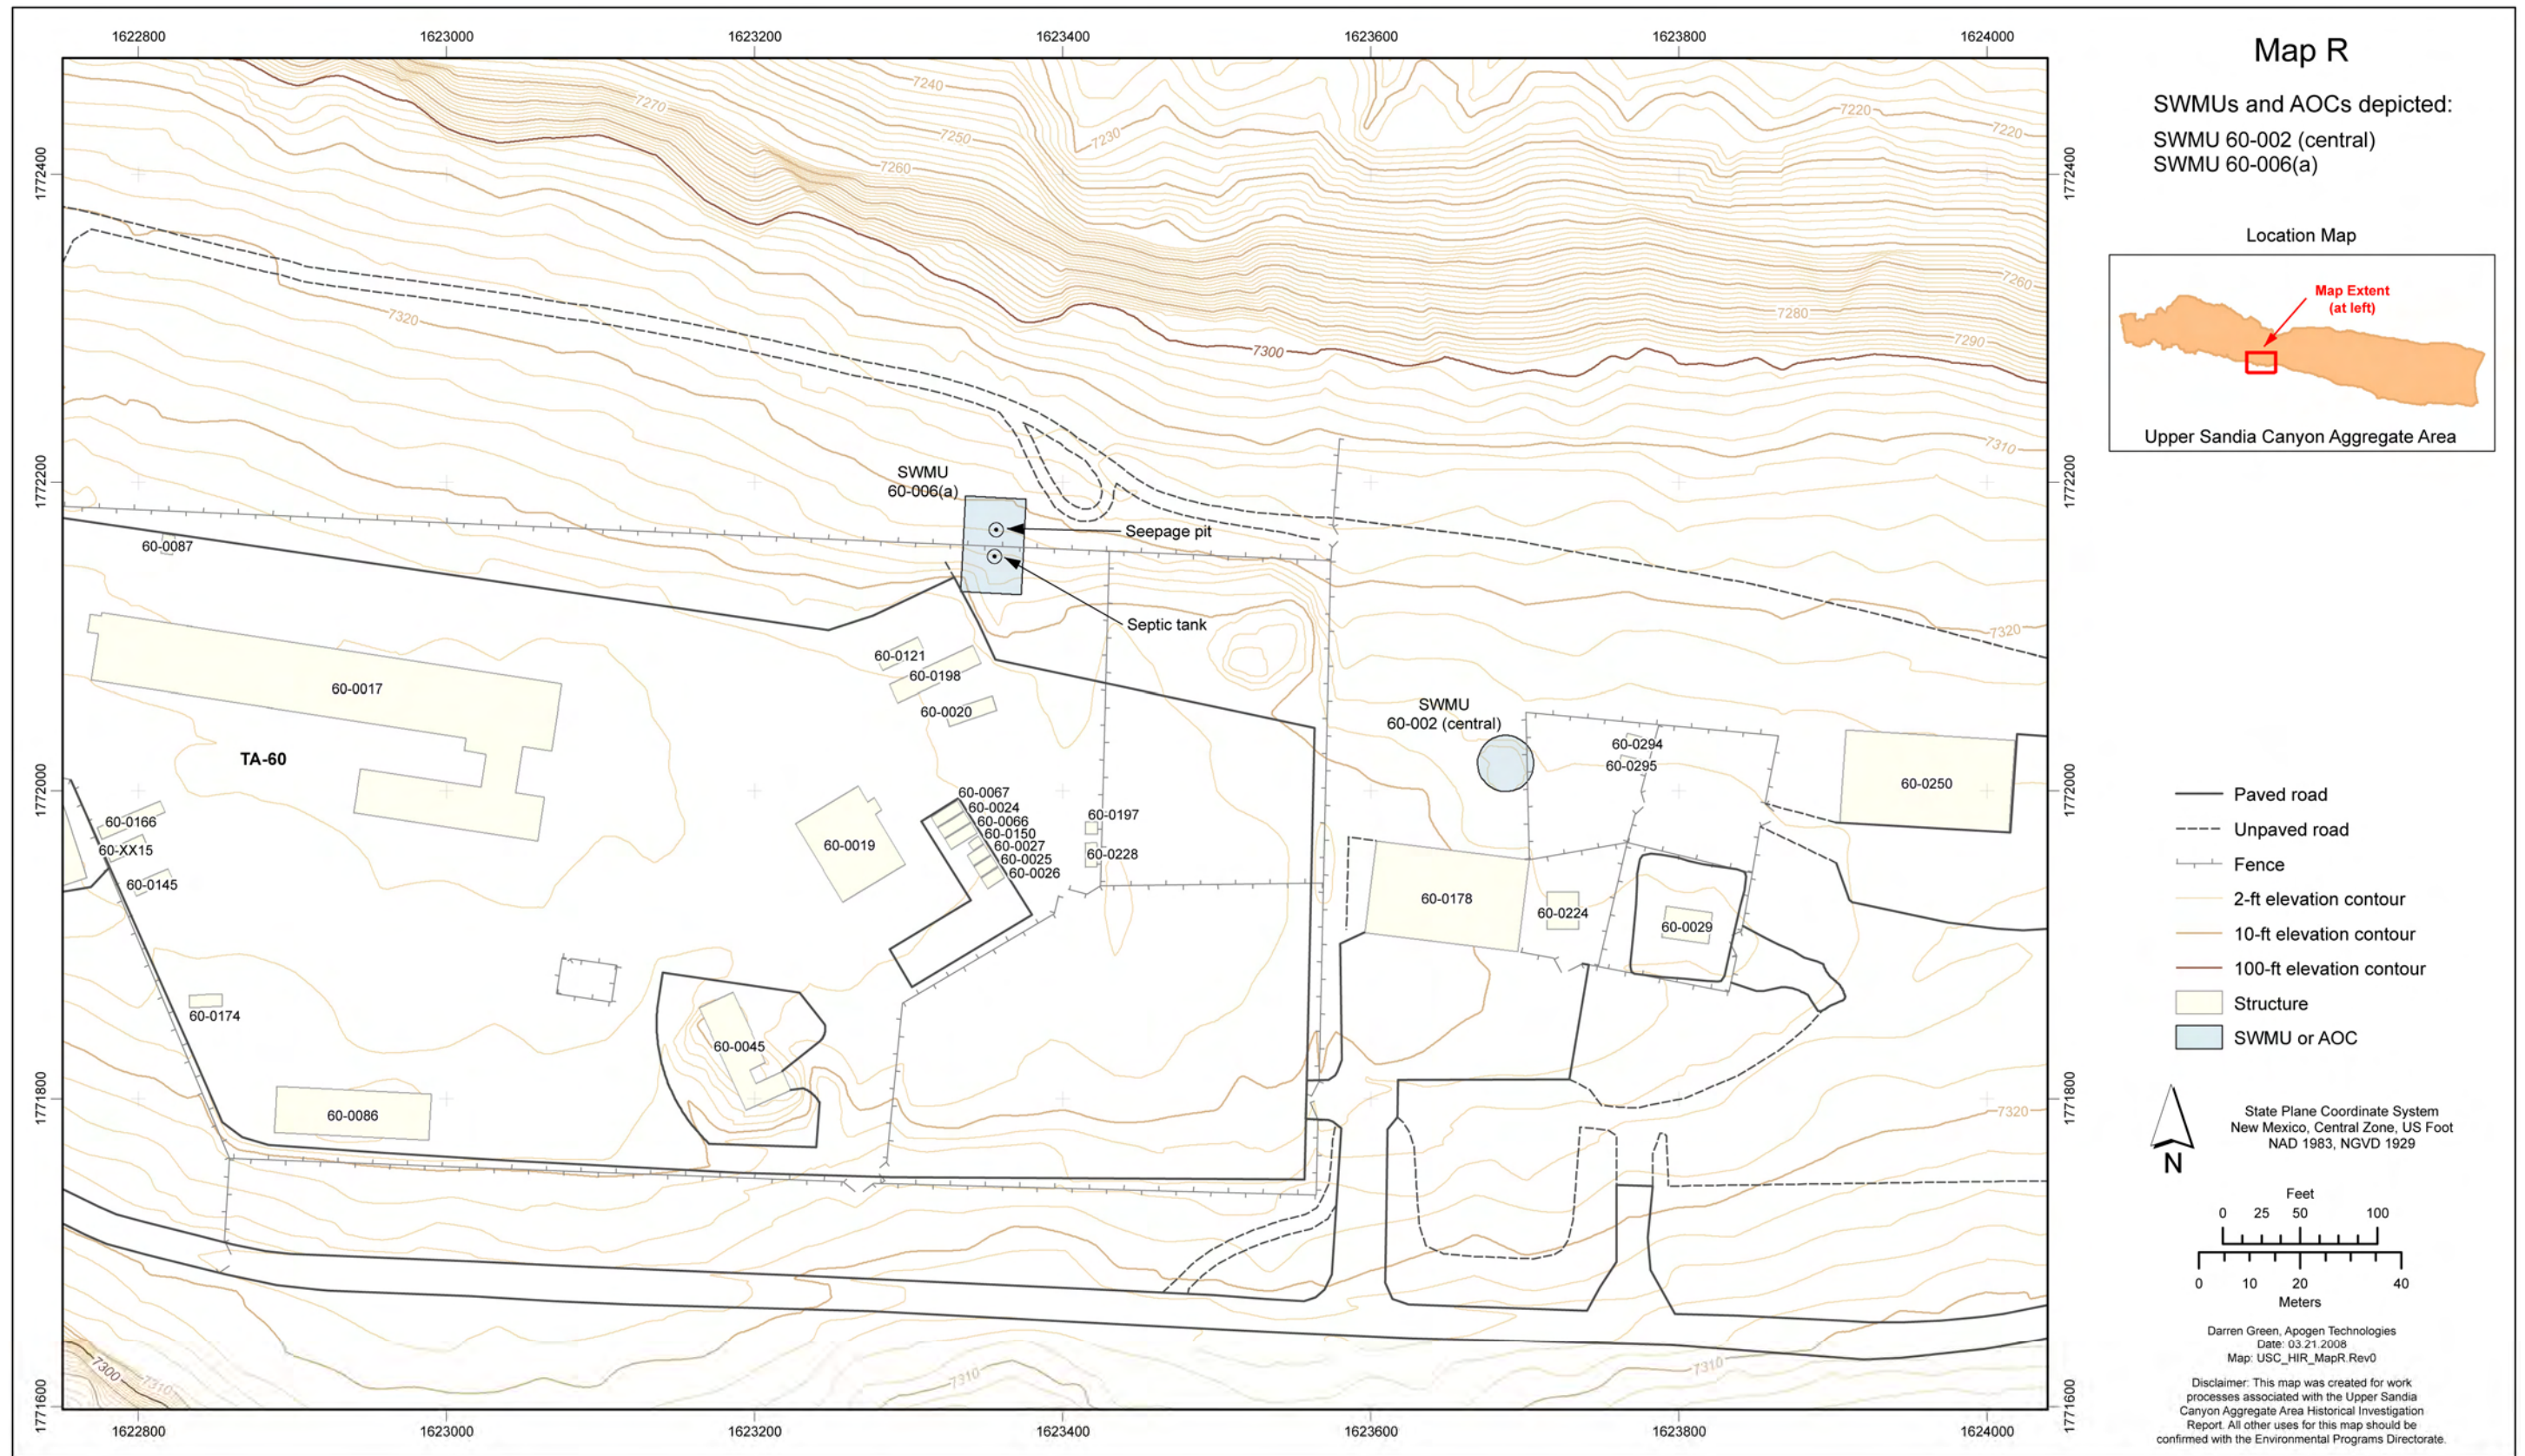


Figure 4.2-6 Map R site location



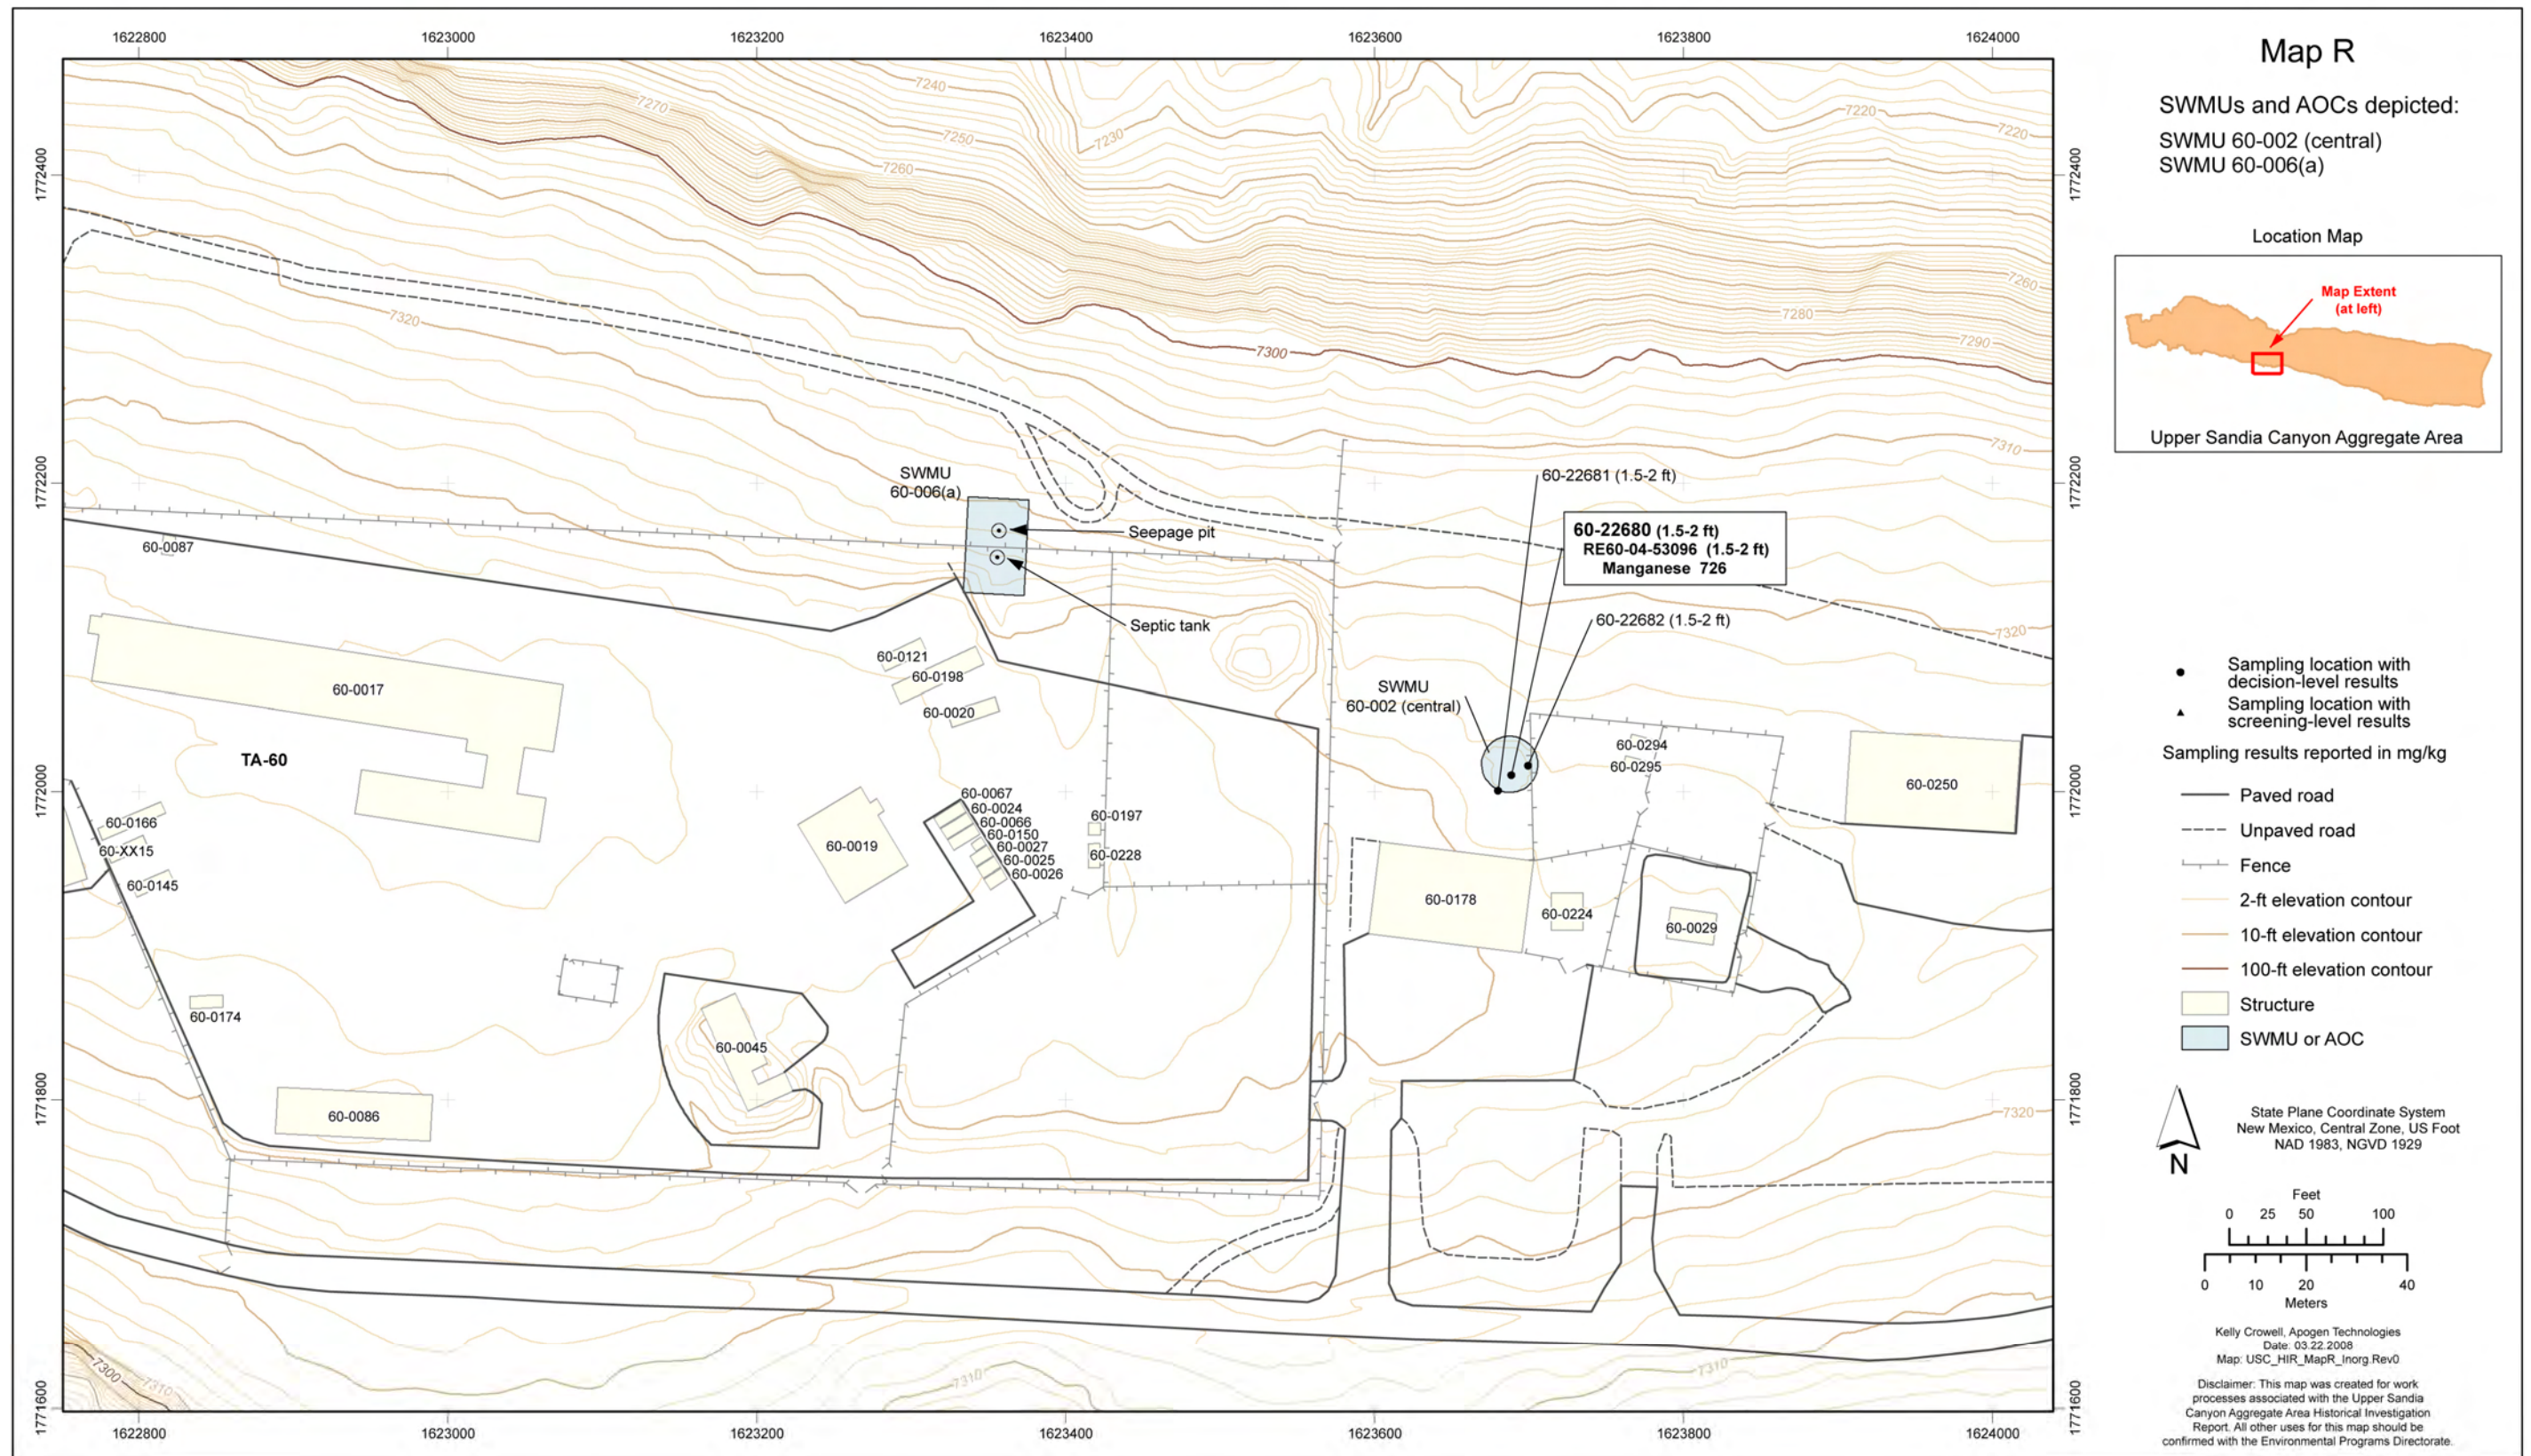


Figure 4.2-7 Map R inorganic chemical sampling locations and results detected above BVs



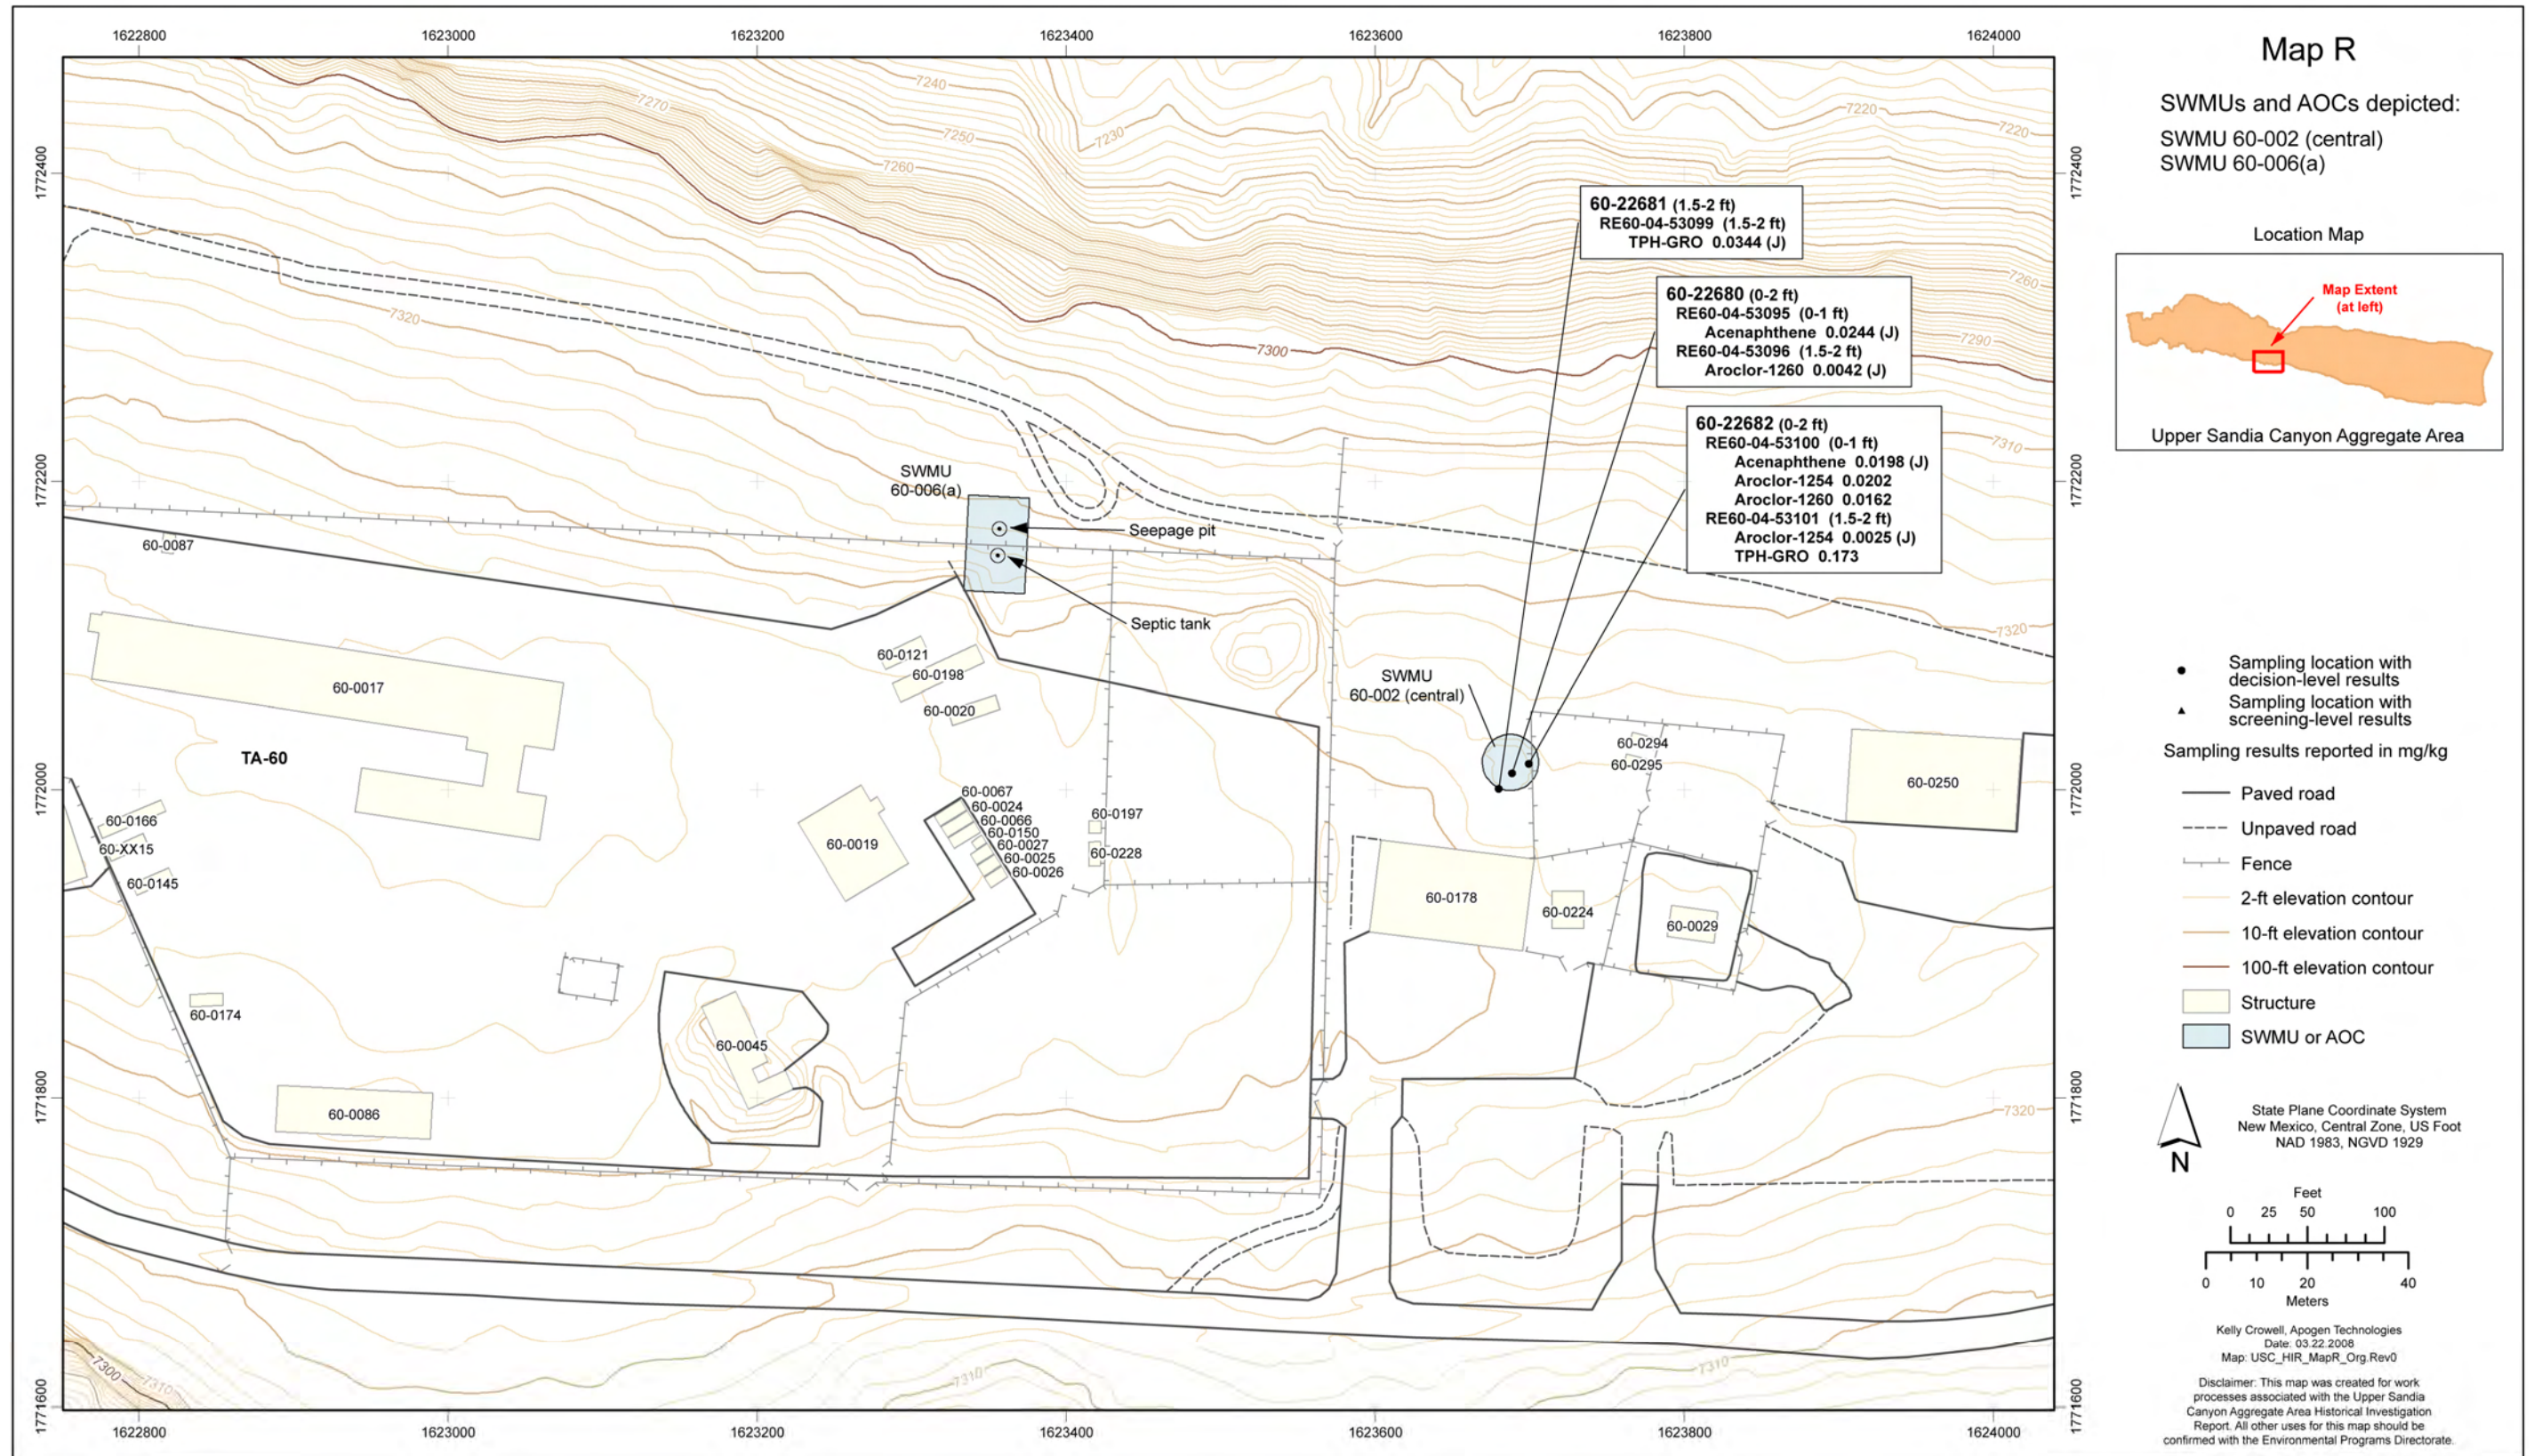


Figure 4.2-8 Map R organic chemical sampling locations and detected results



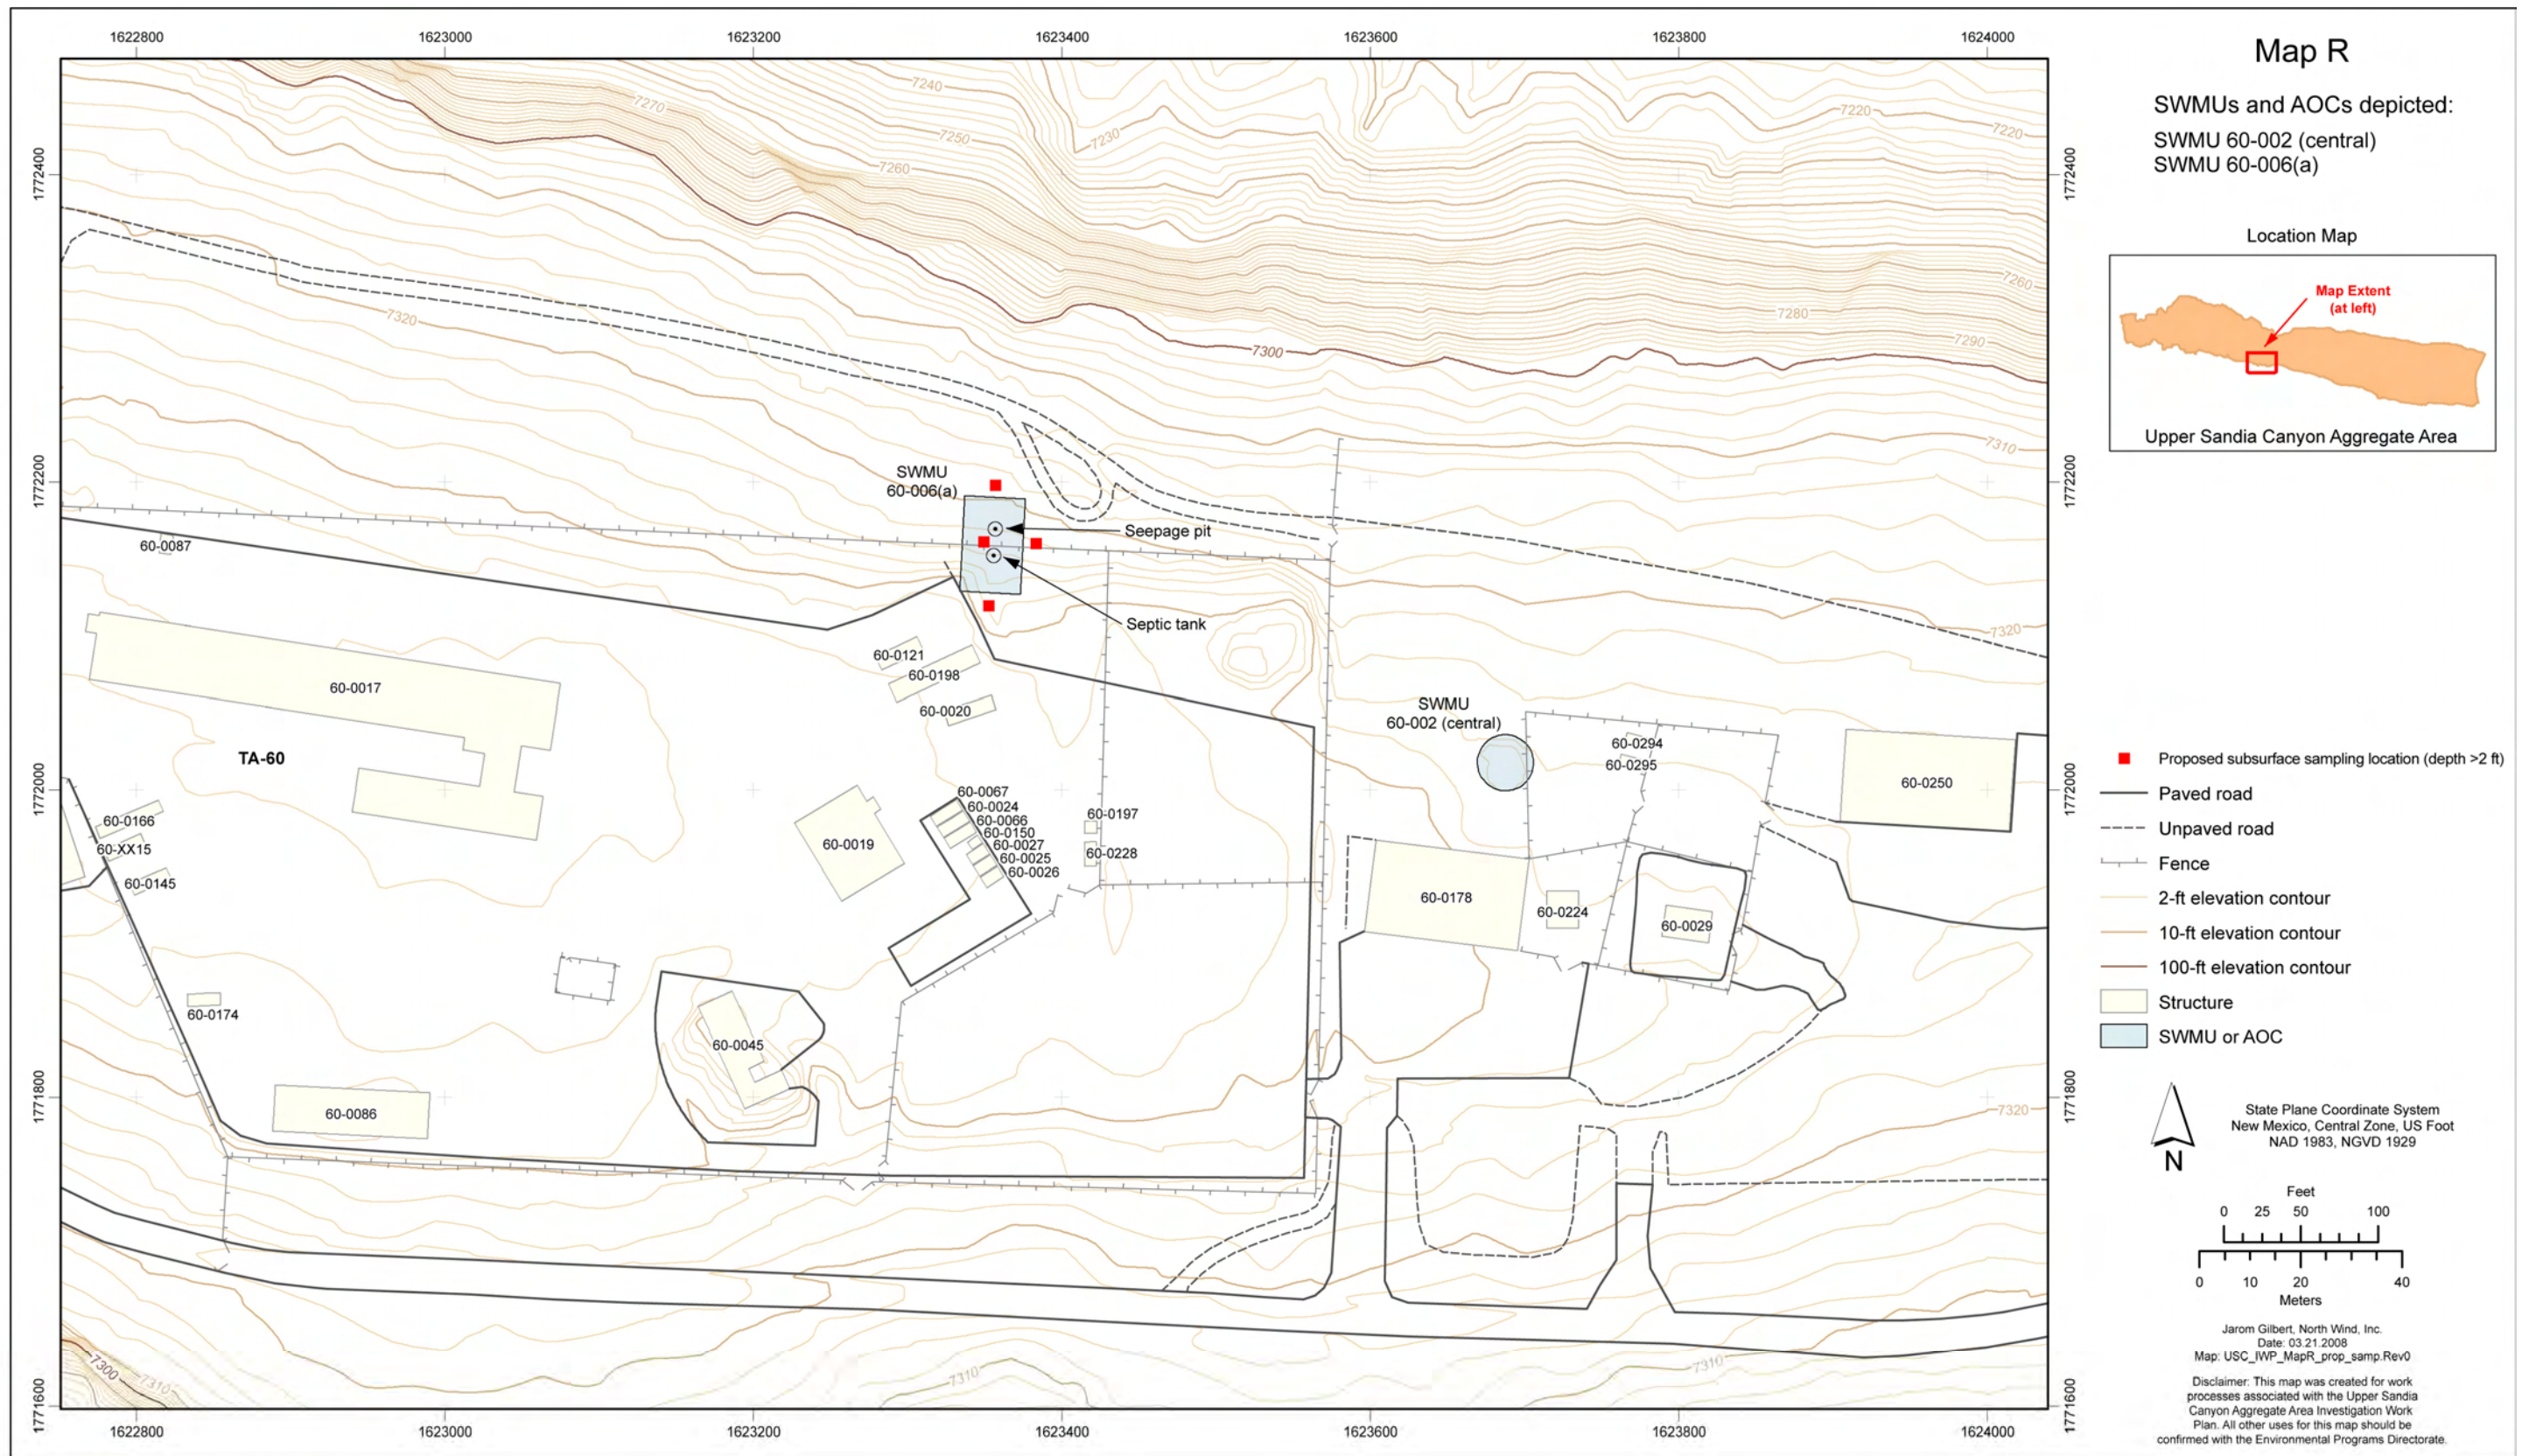


Figure 4.2-9 Map R proposed sampling locations



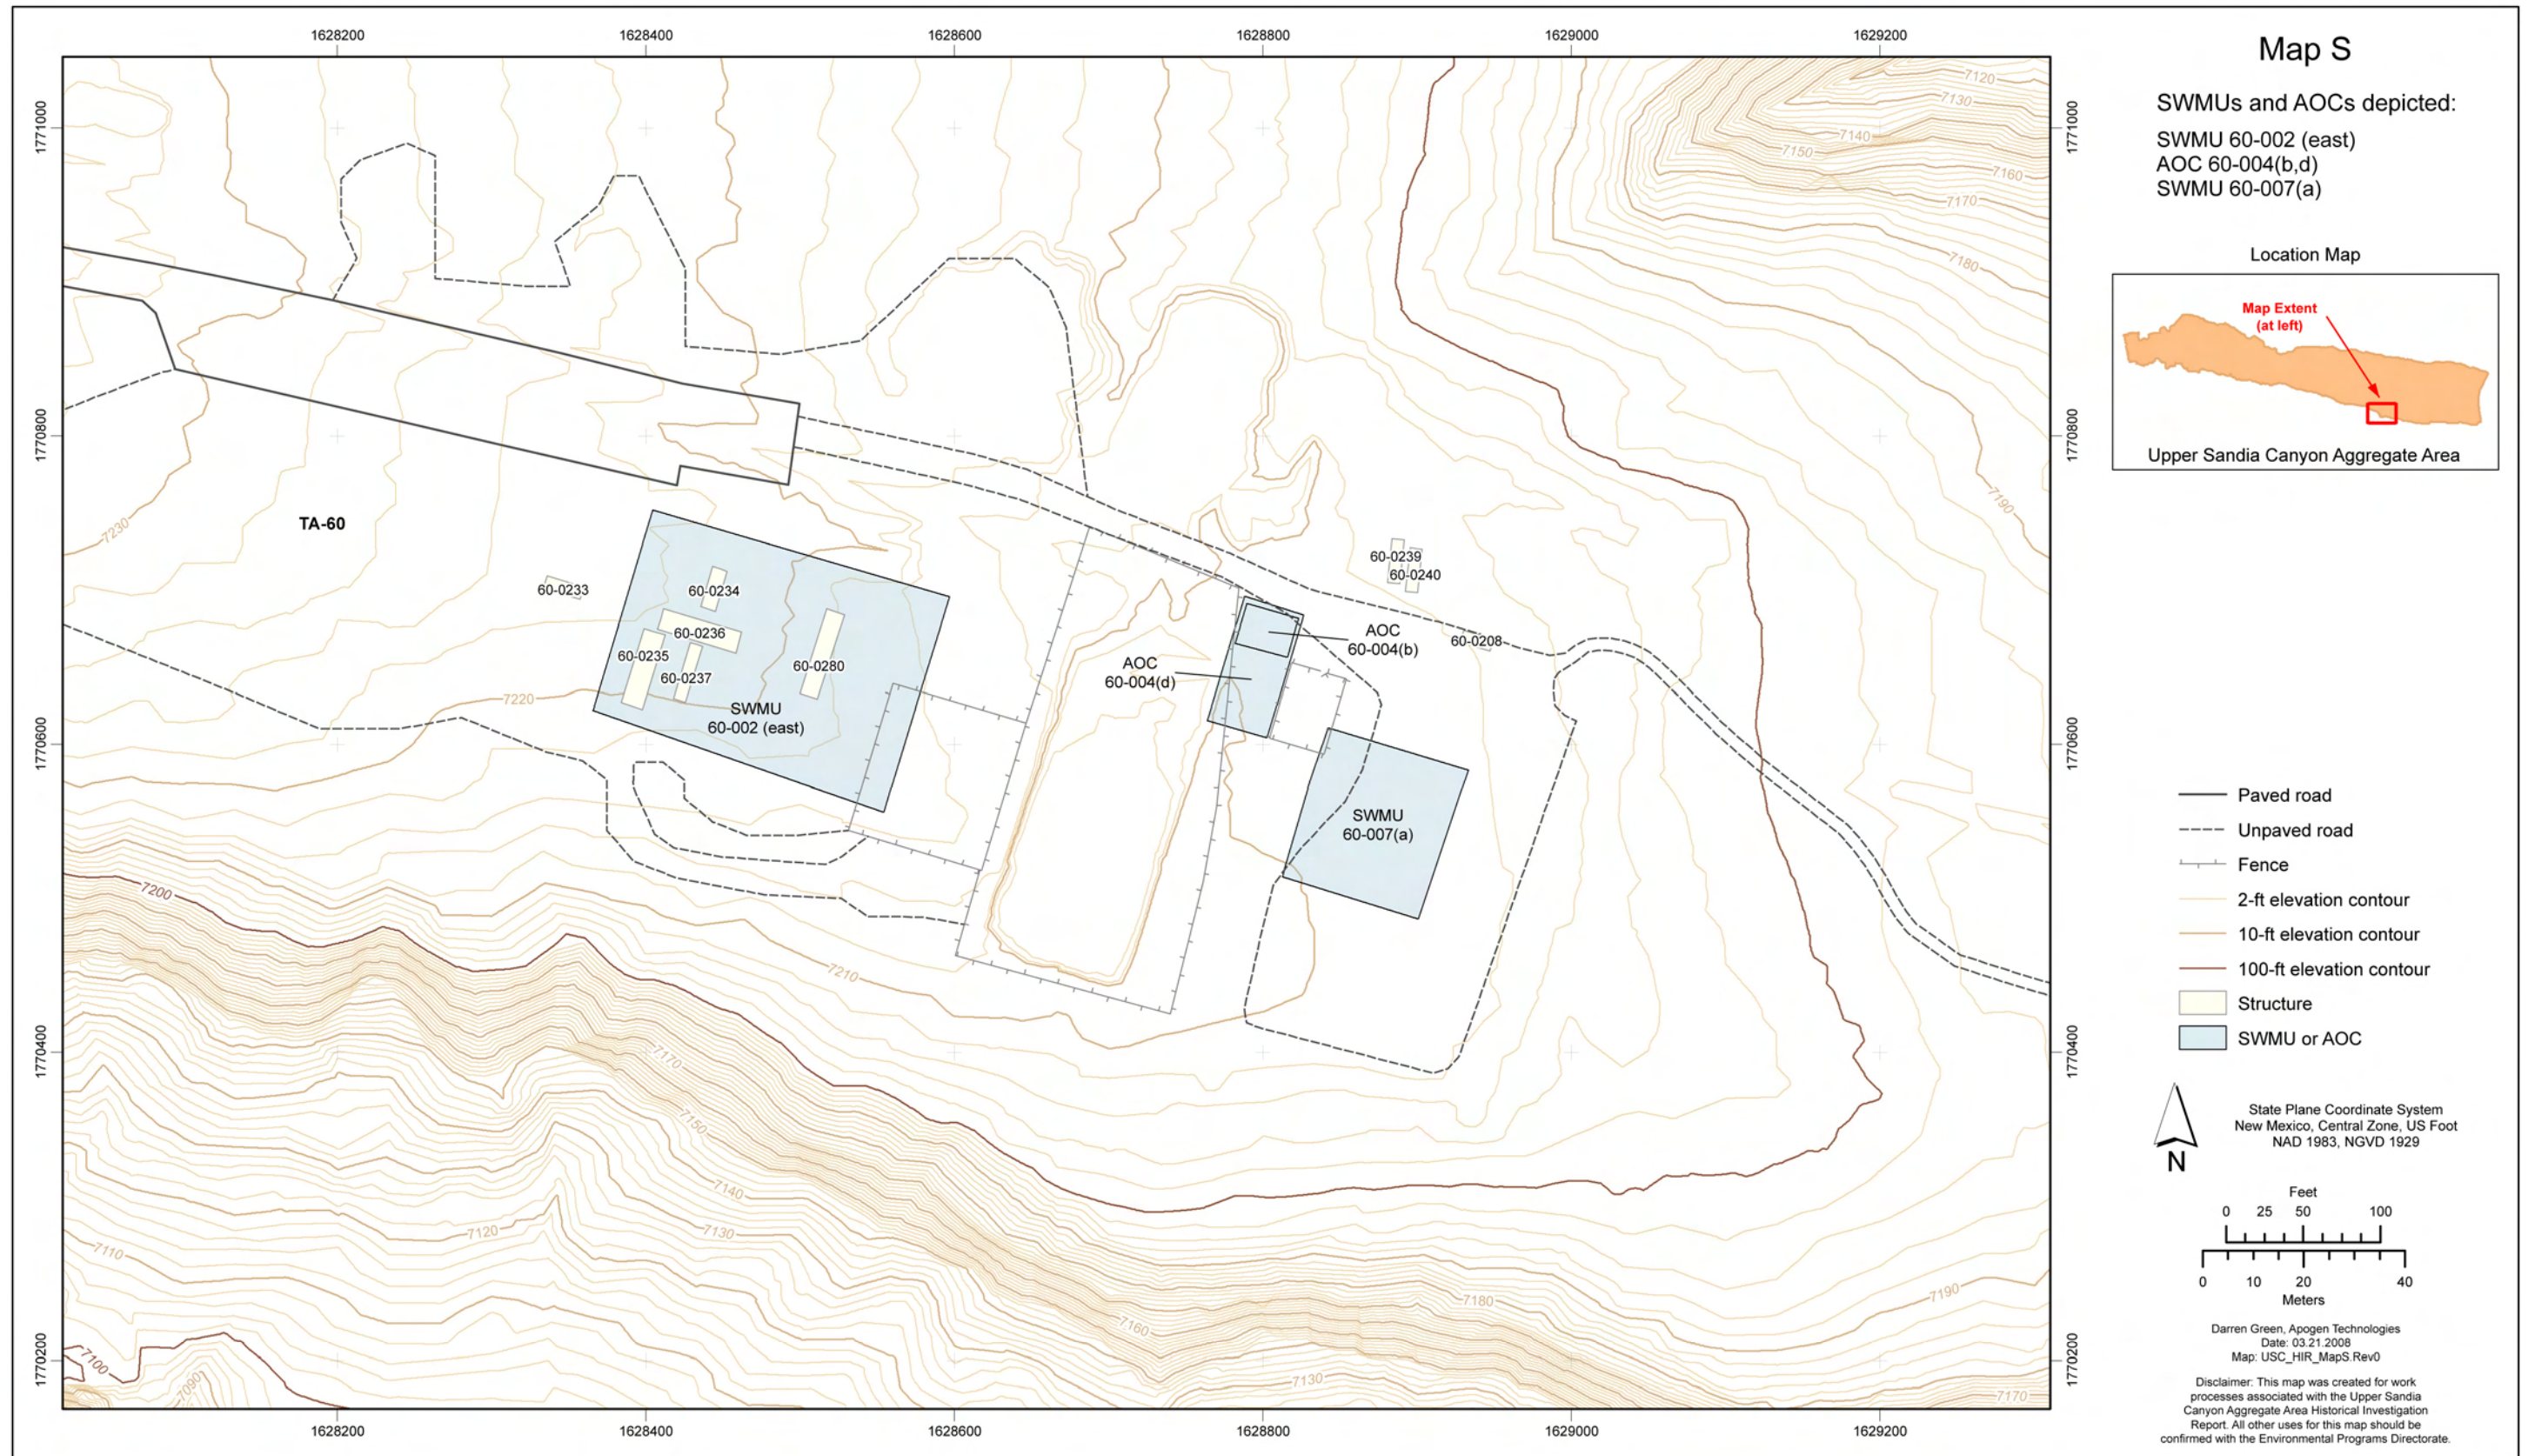


Figure 4.2-10 Map S site location



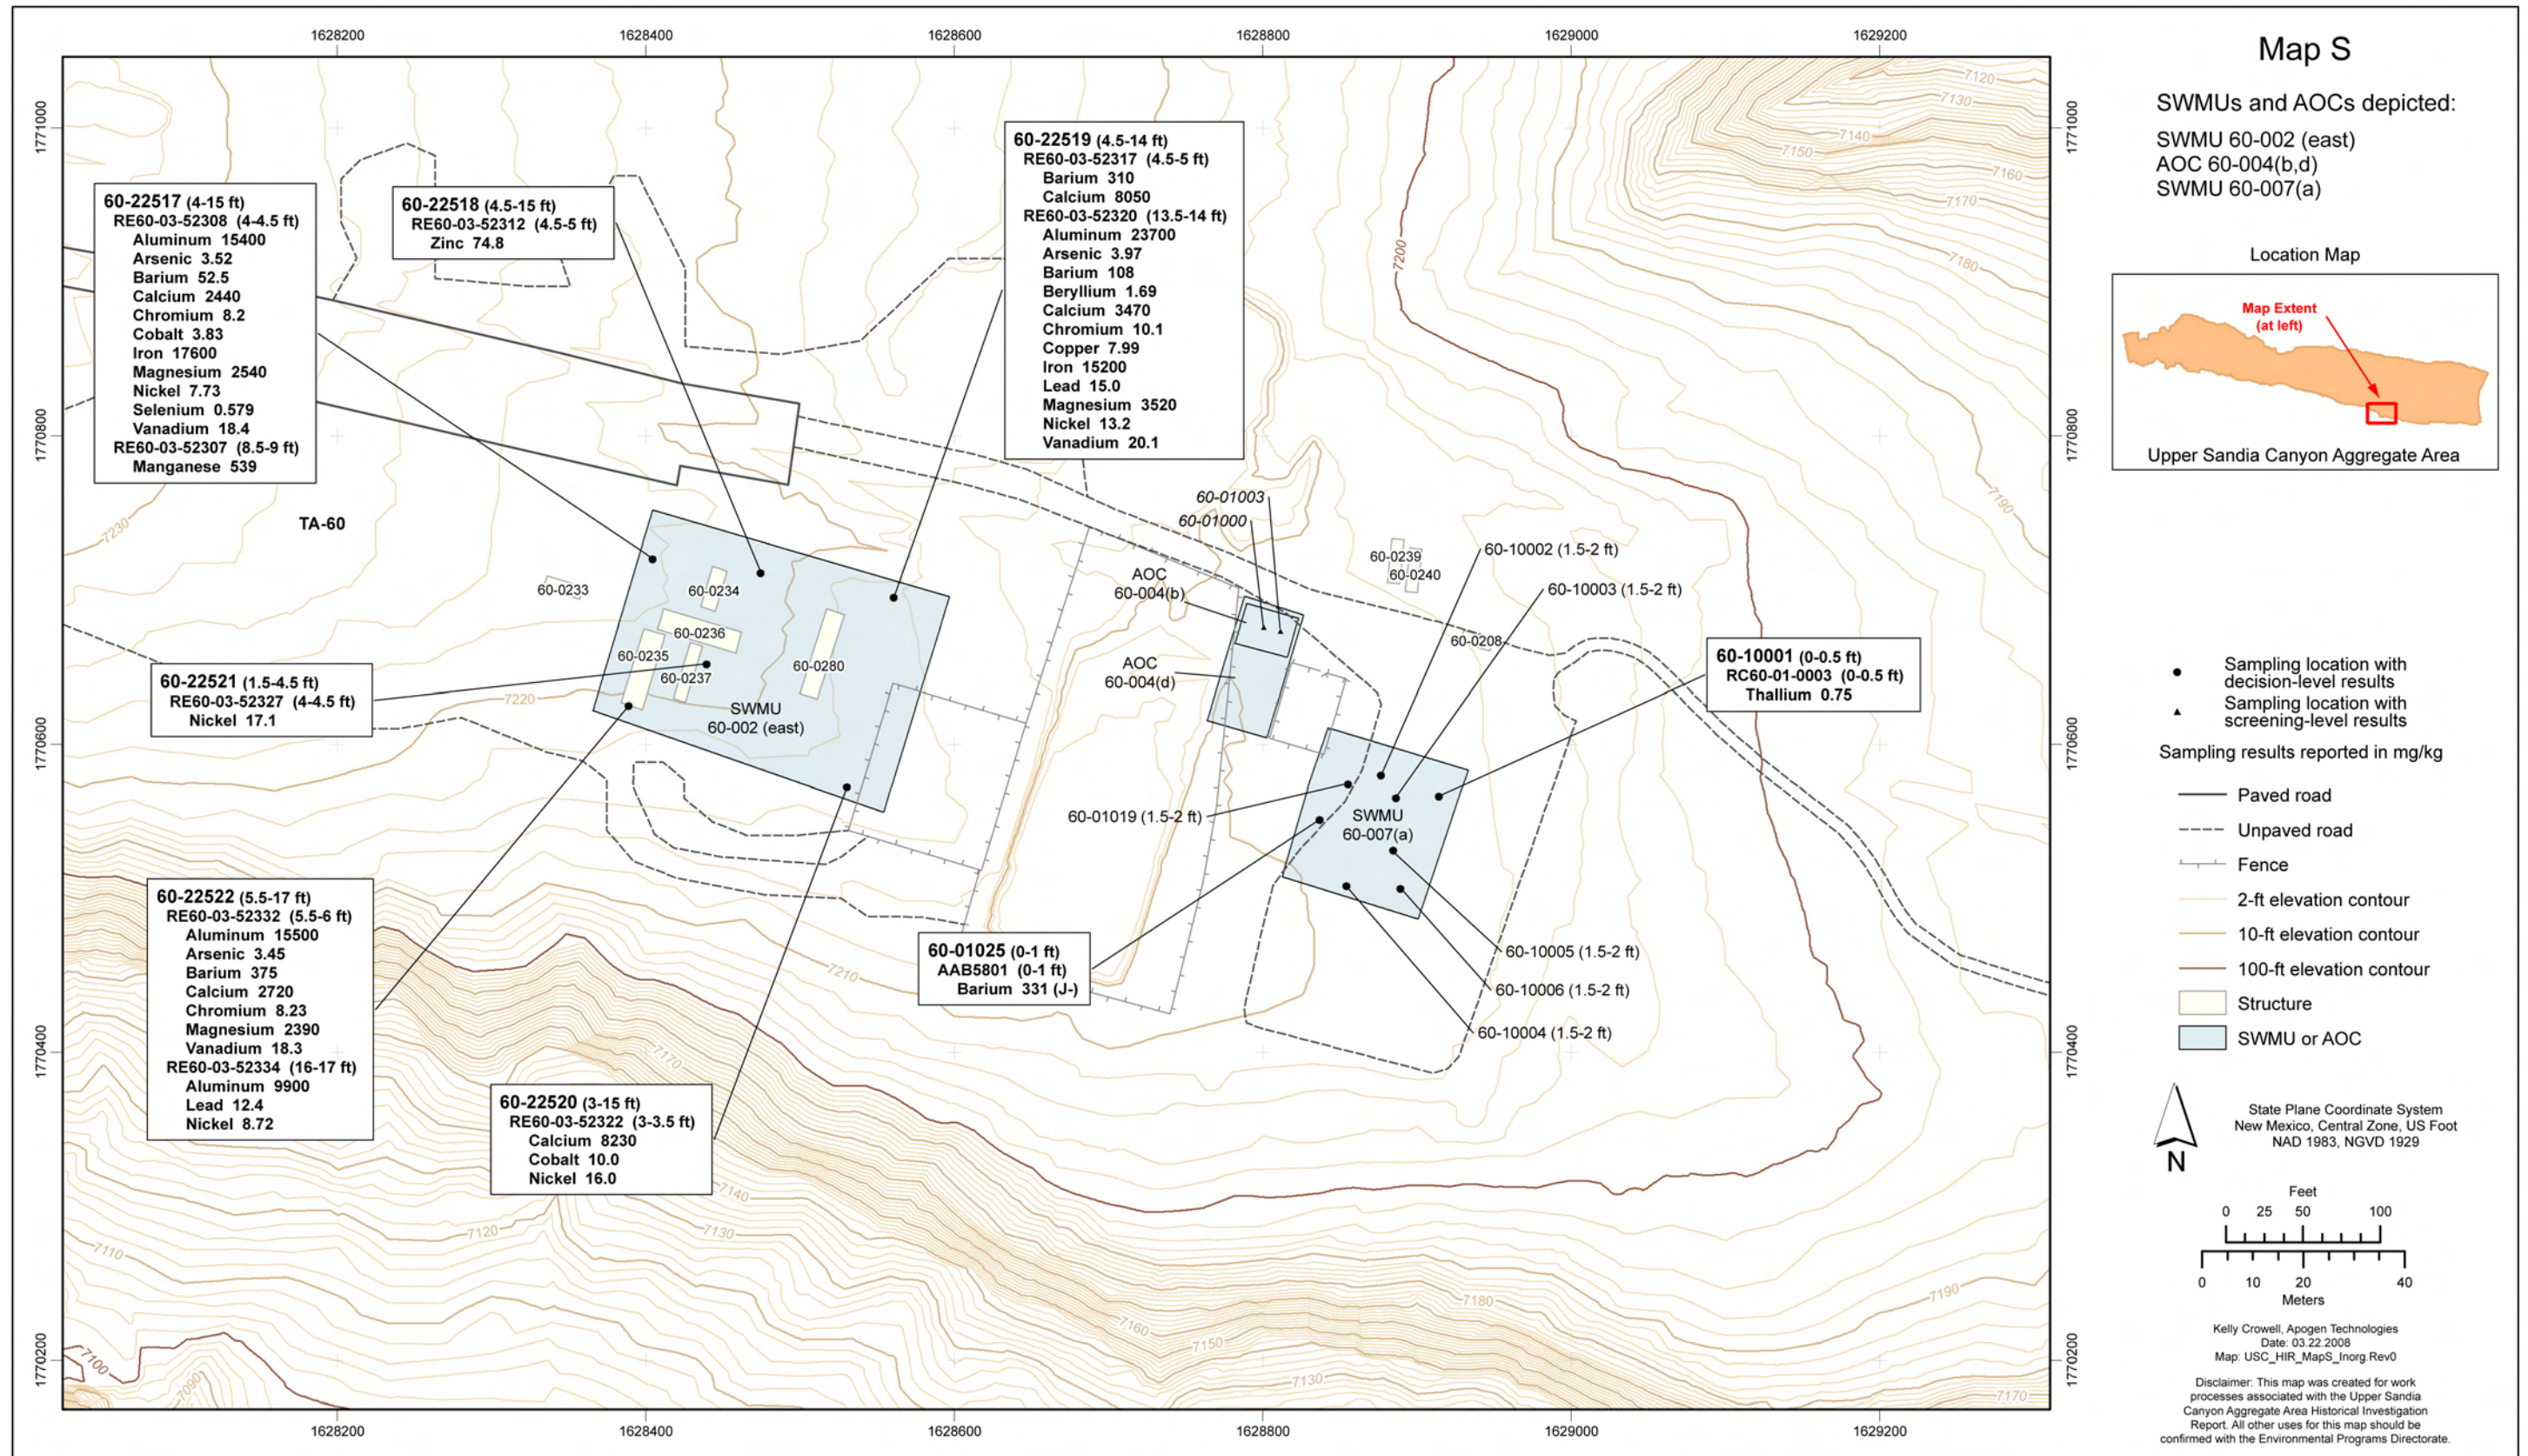


Figure 4.2-11 Map S inorganic chemical sampling locations and results detected above BVs



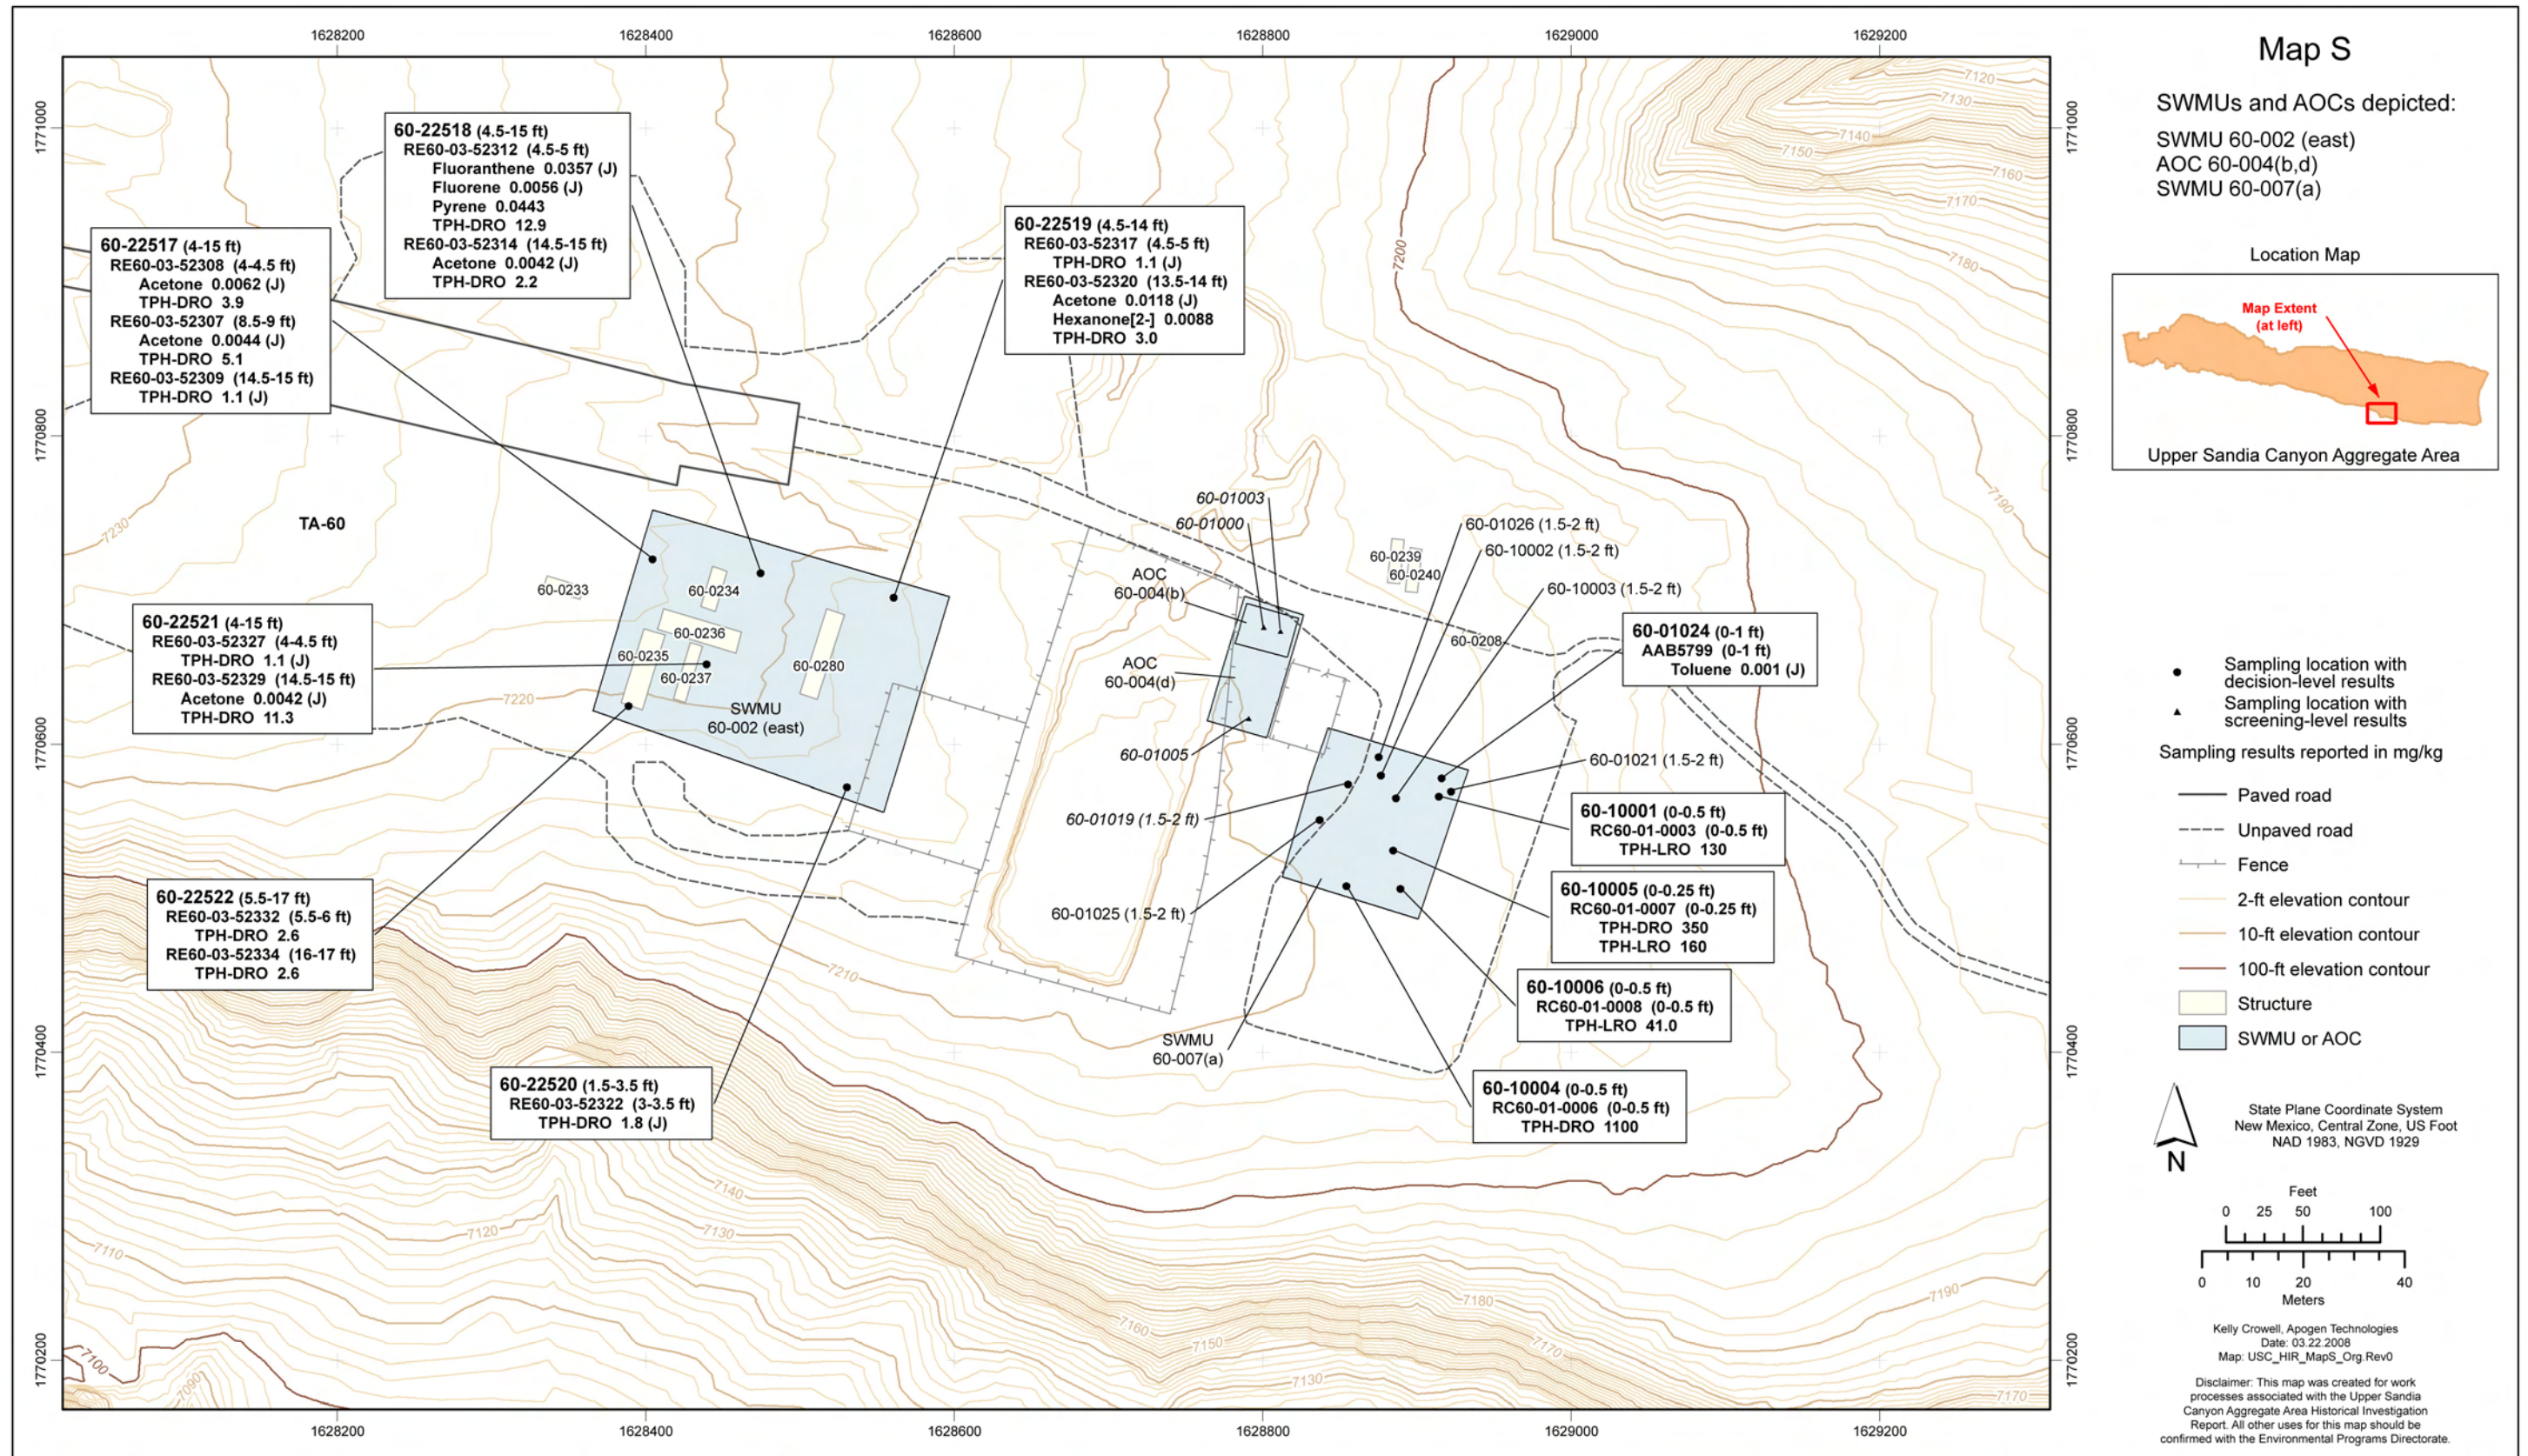


Figure 4.2-12 Map S organic chemical sampling locations and detected results



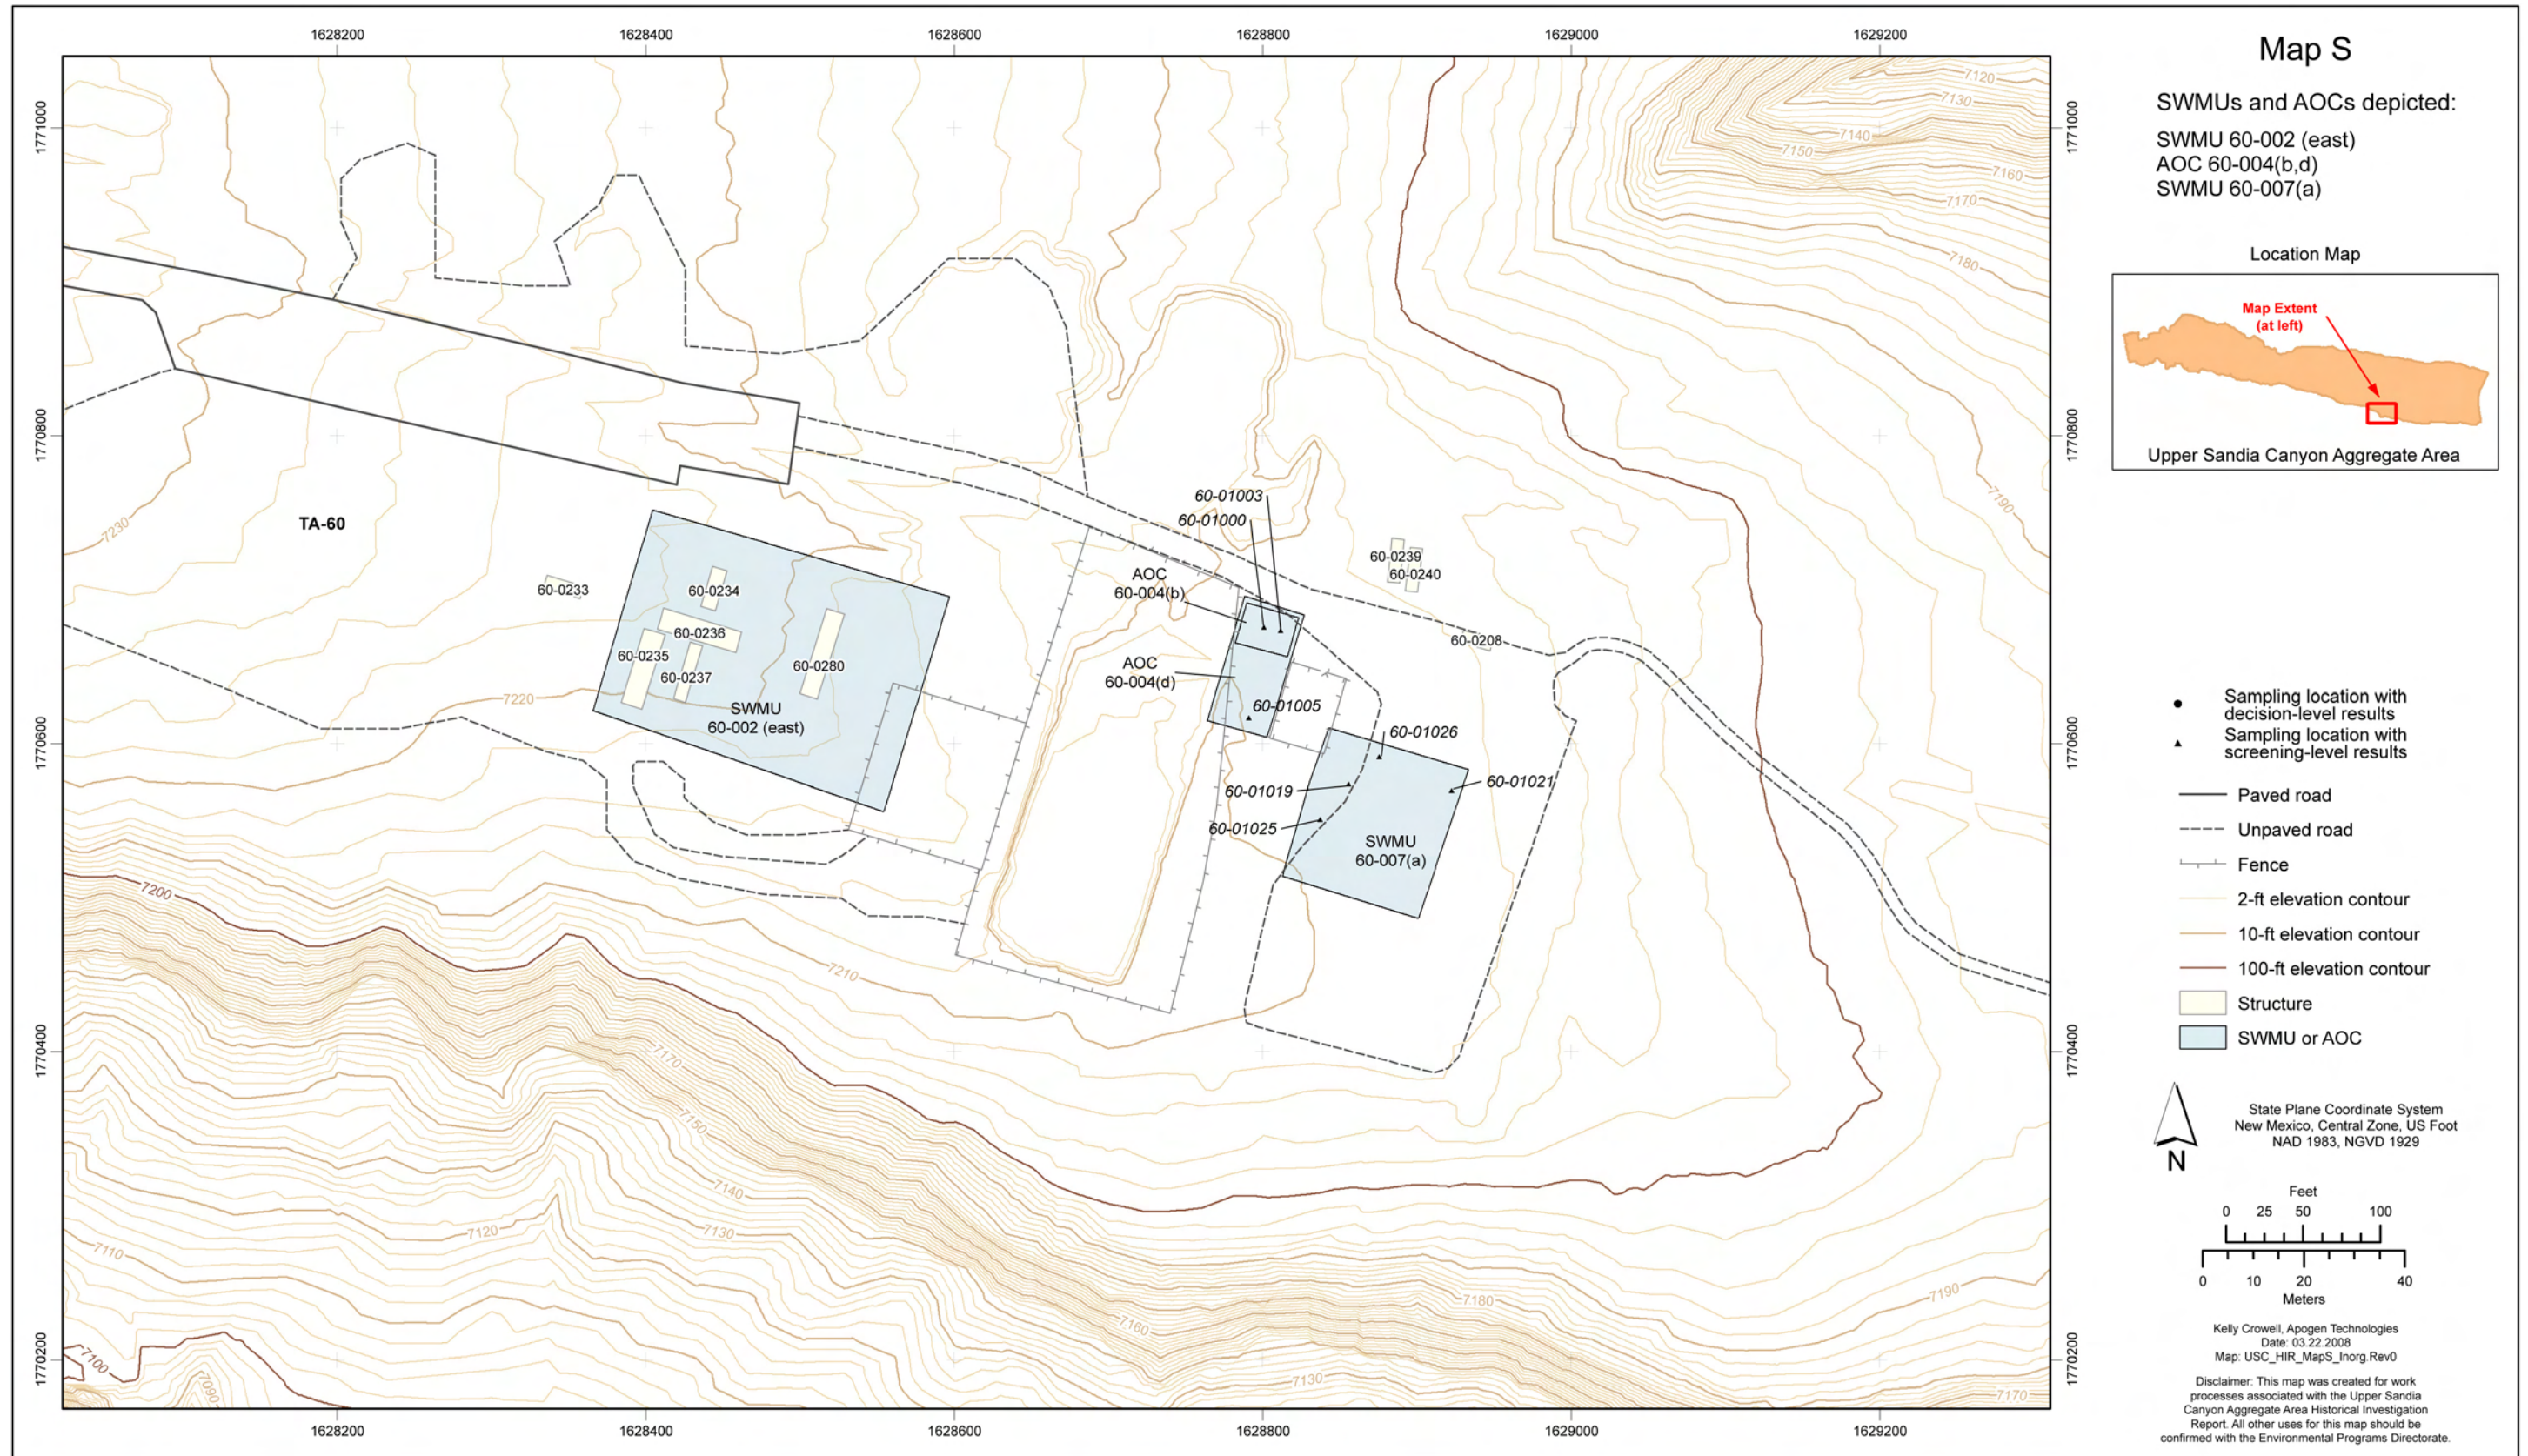


Figure 4.2-13 Map S radionuclide sampling locations



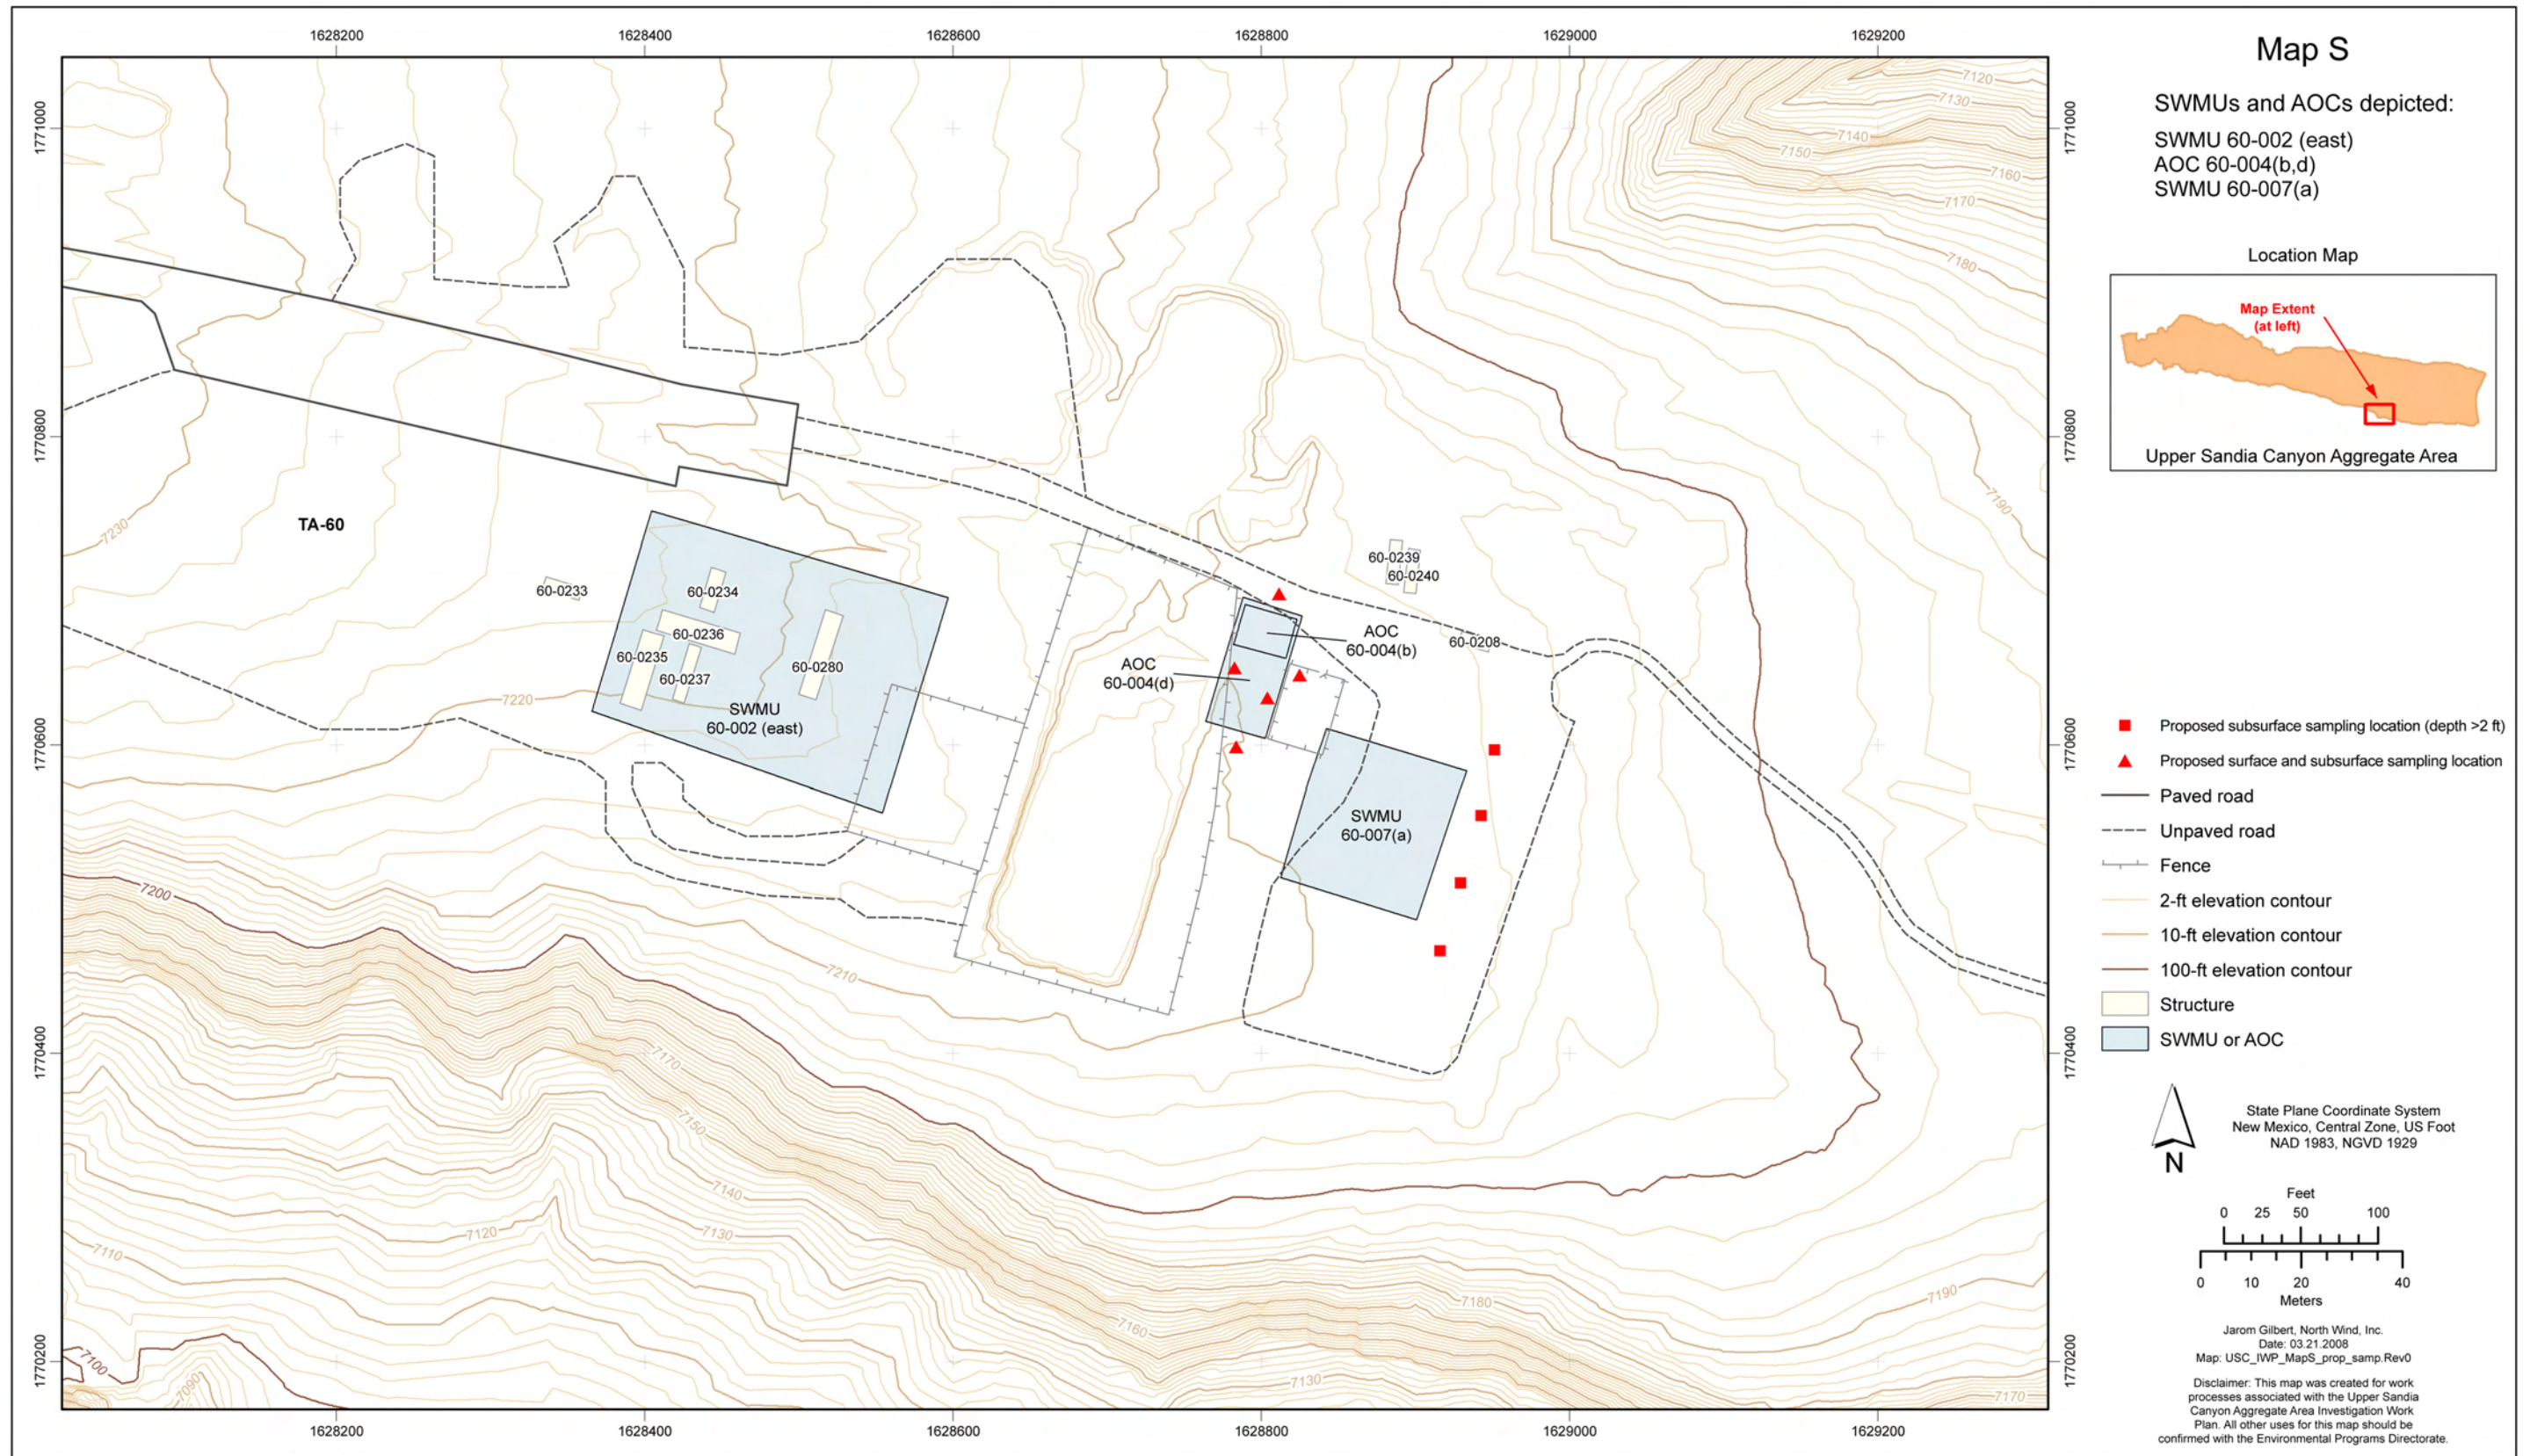


Figure 4.2-14 Map S proposed sampling locations



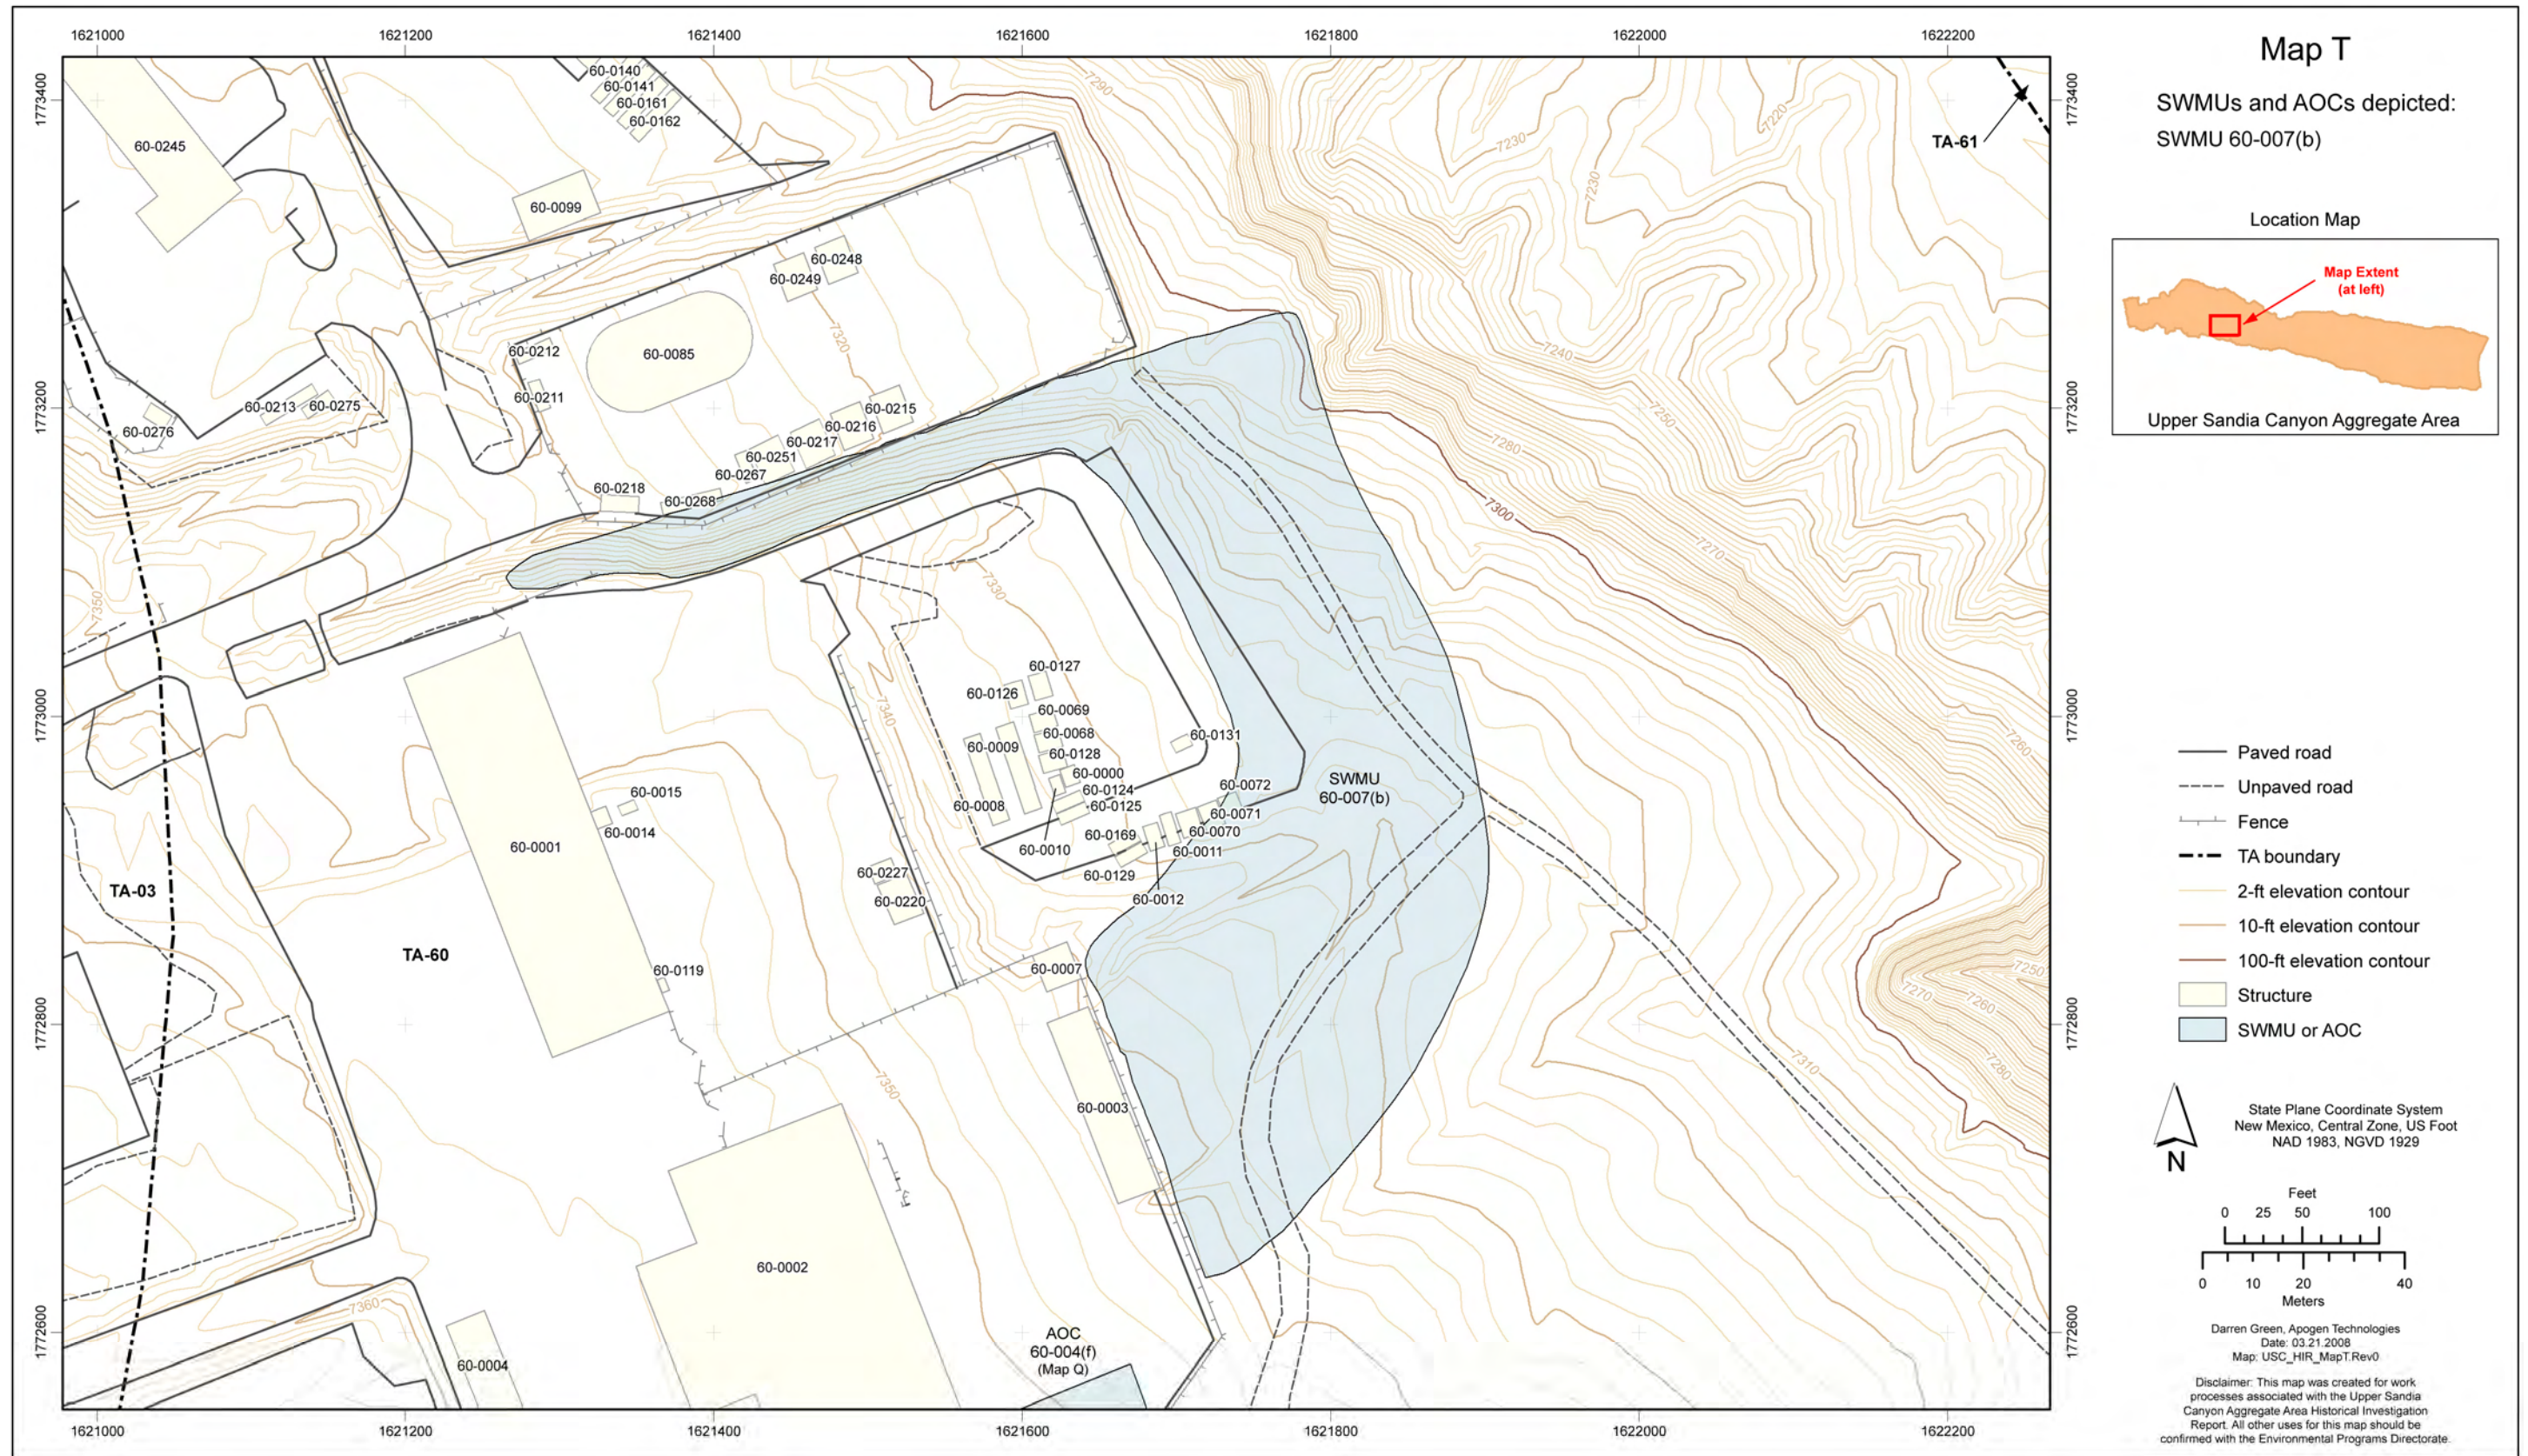


Figure 4.2-15 Map T site location



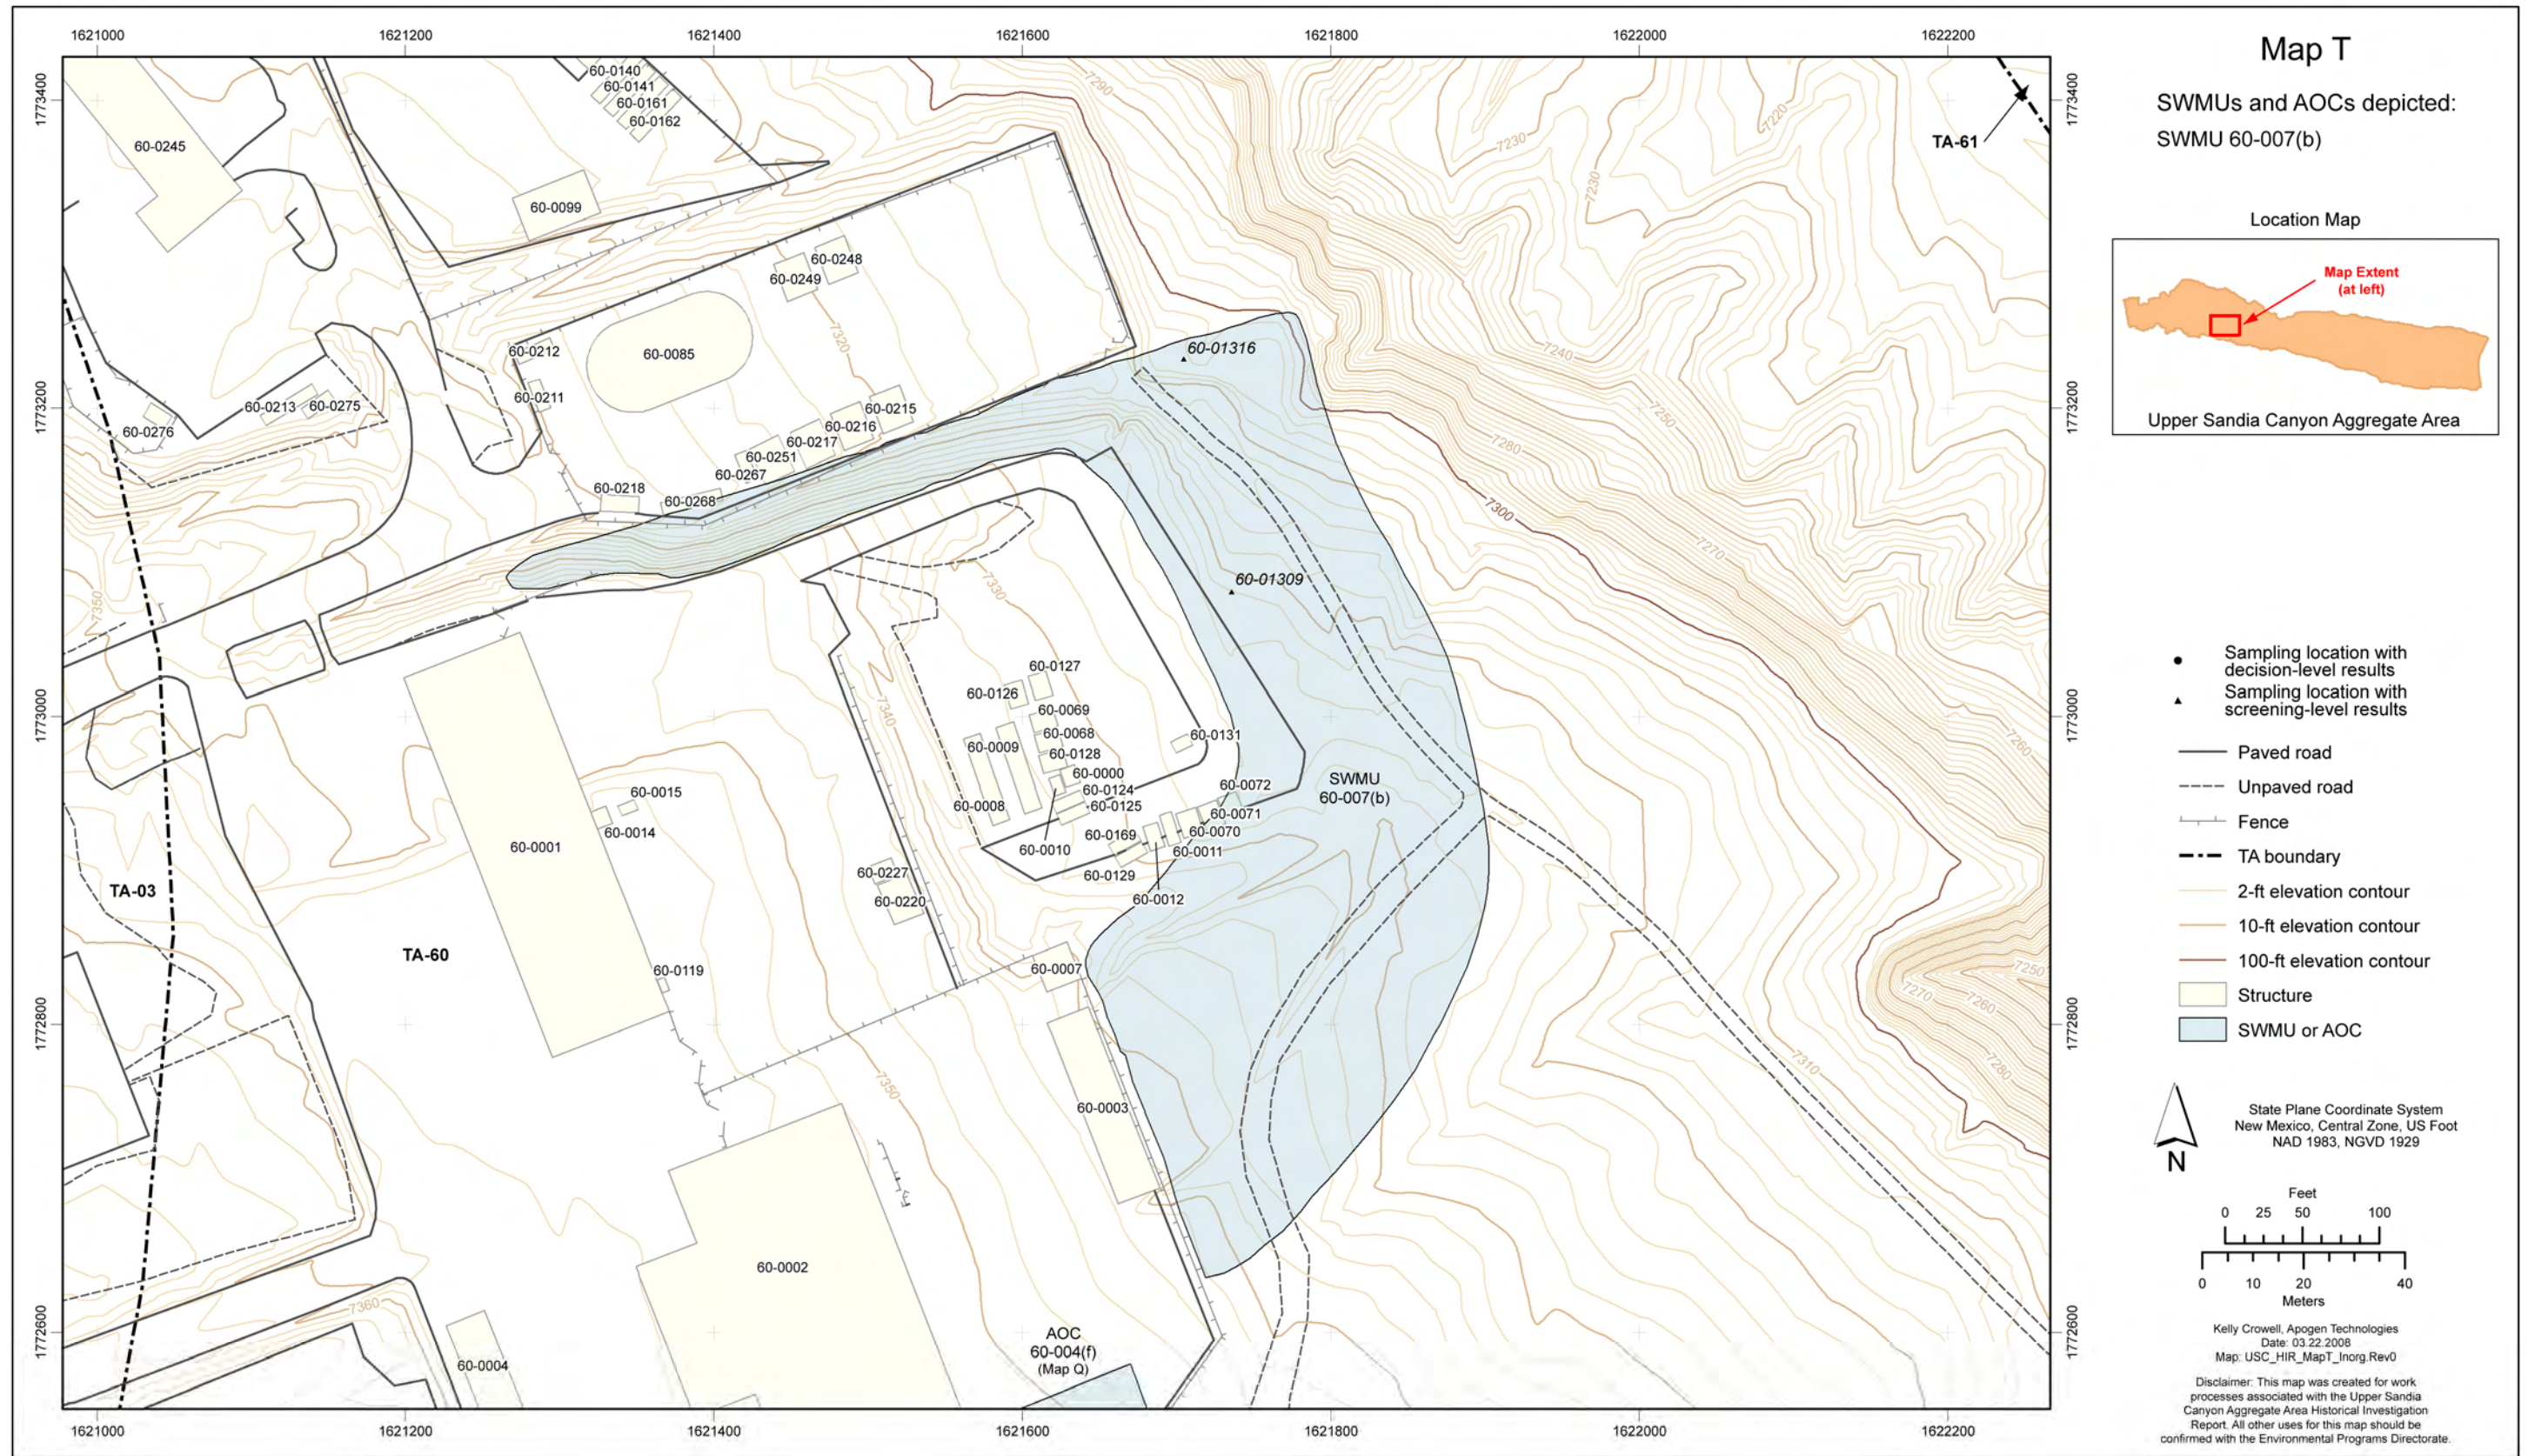


Figure 4.2-16 Map T inorganic chemical sampling locations



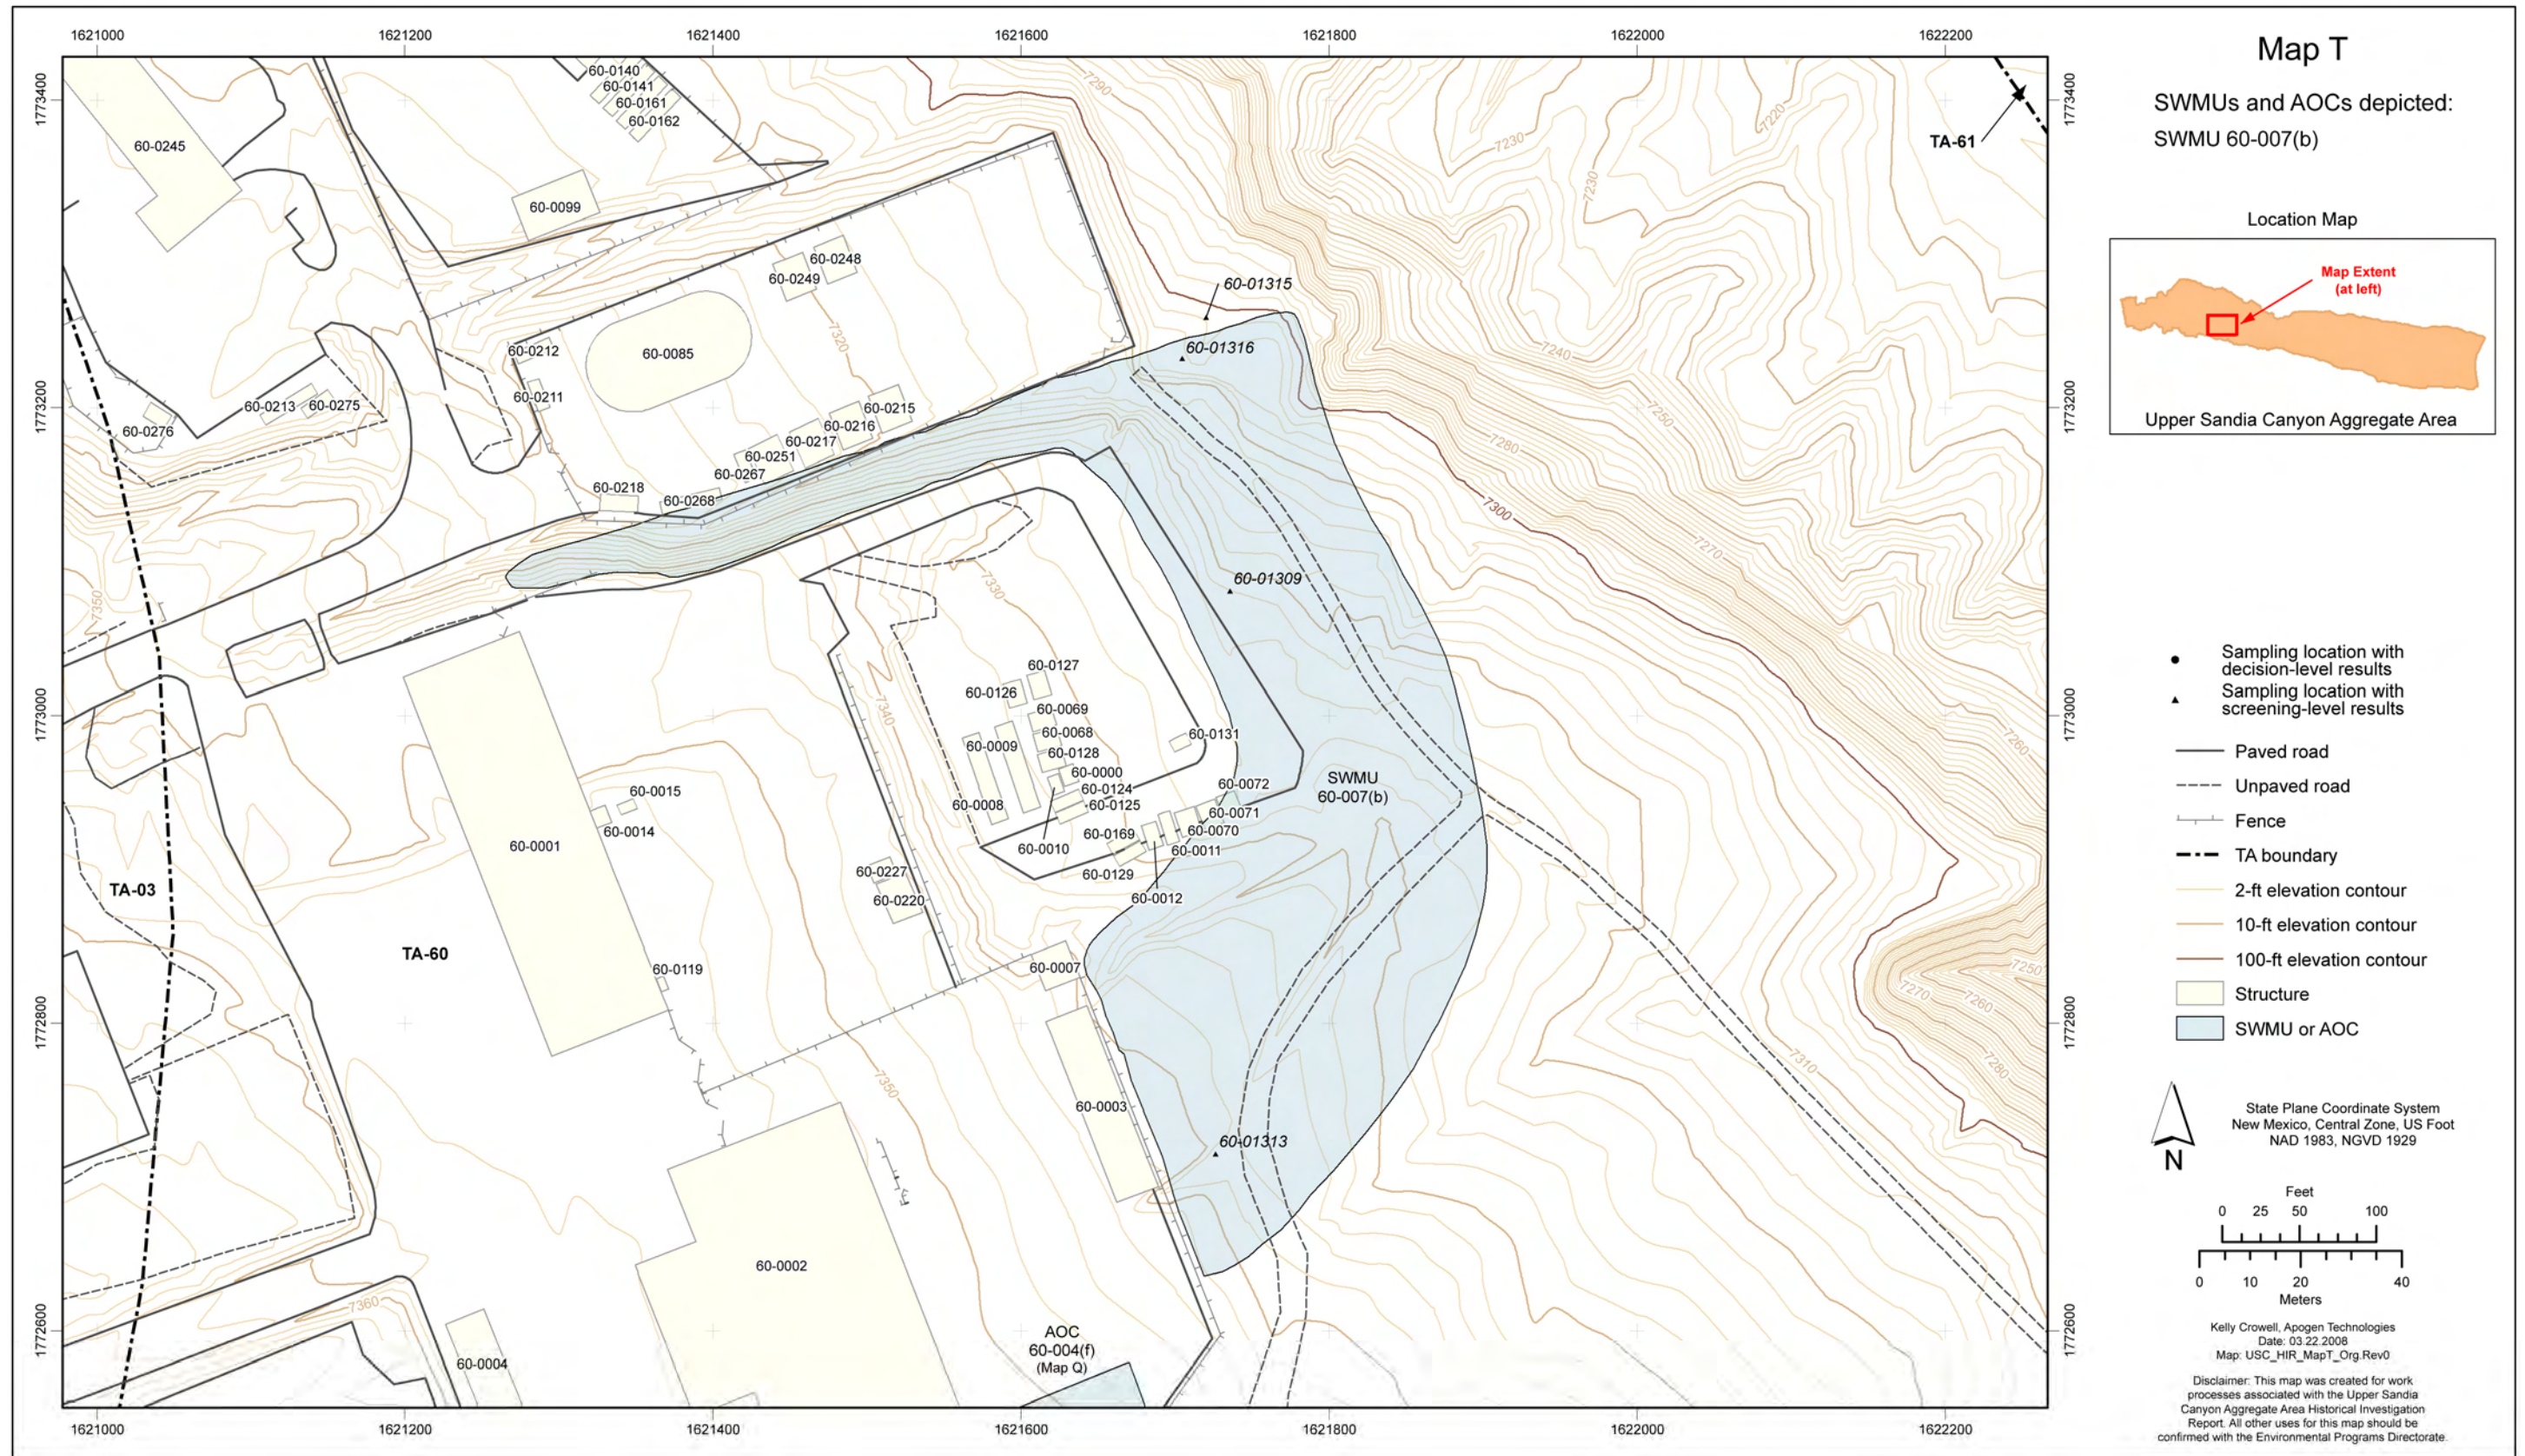


Figure 4.2-17 Map T organic chemical sampling locations



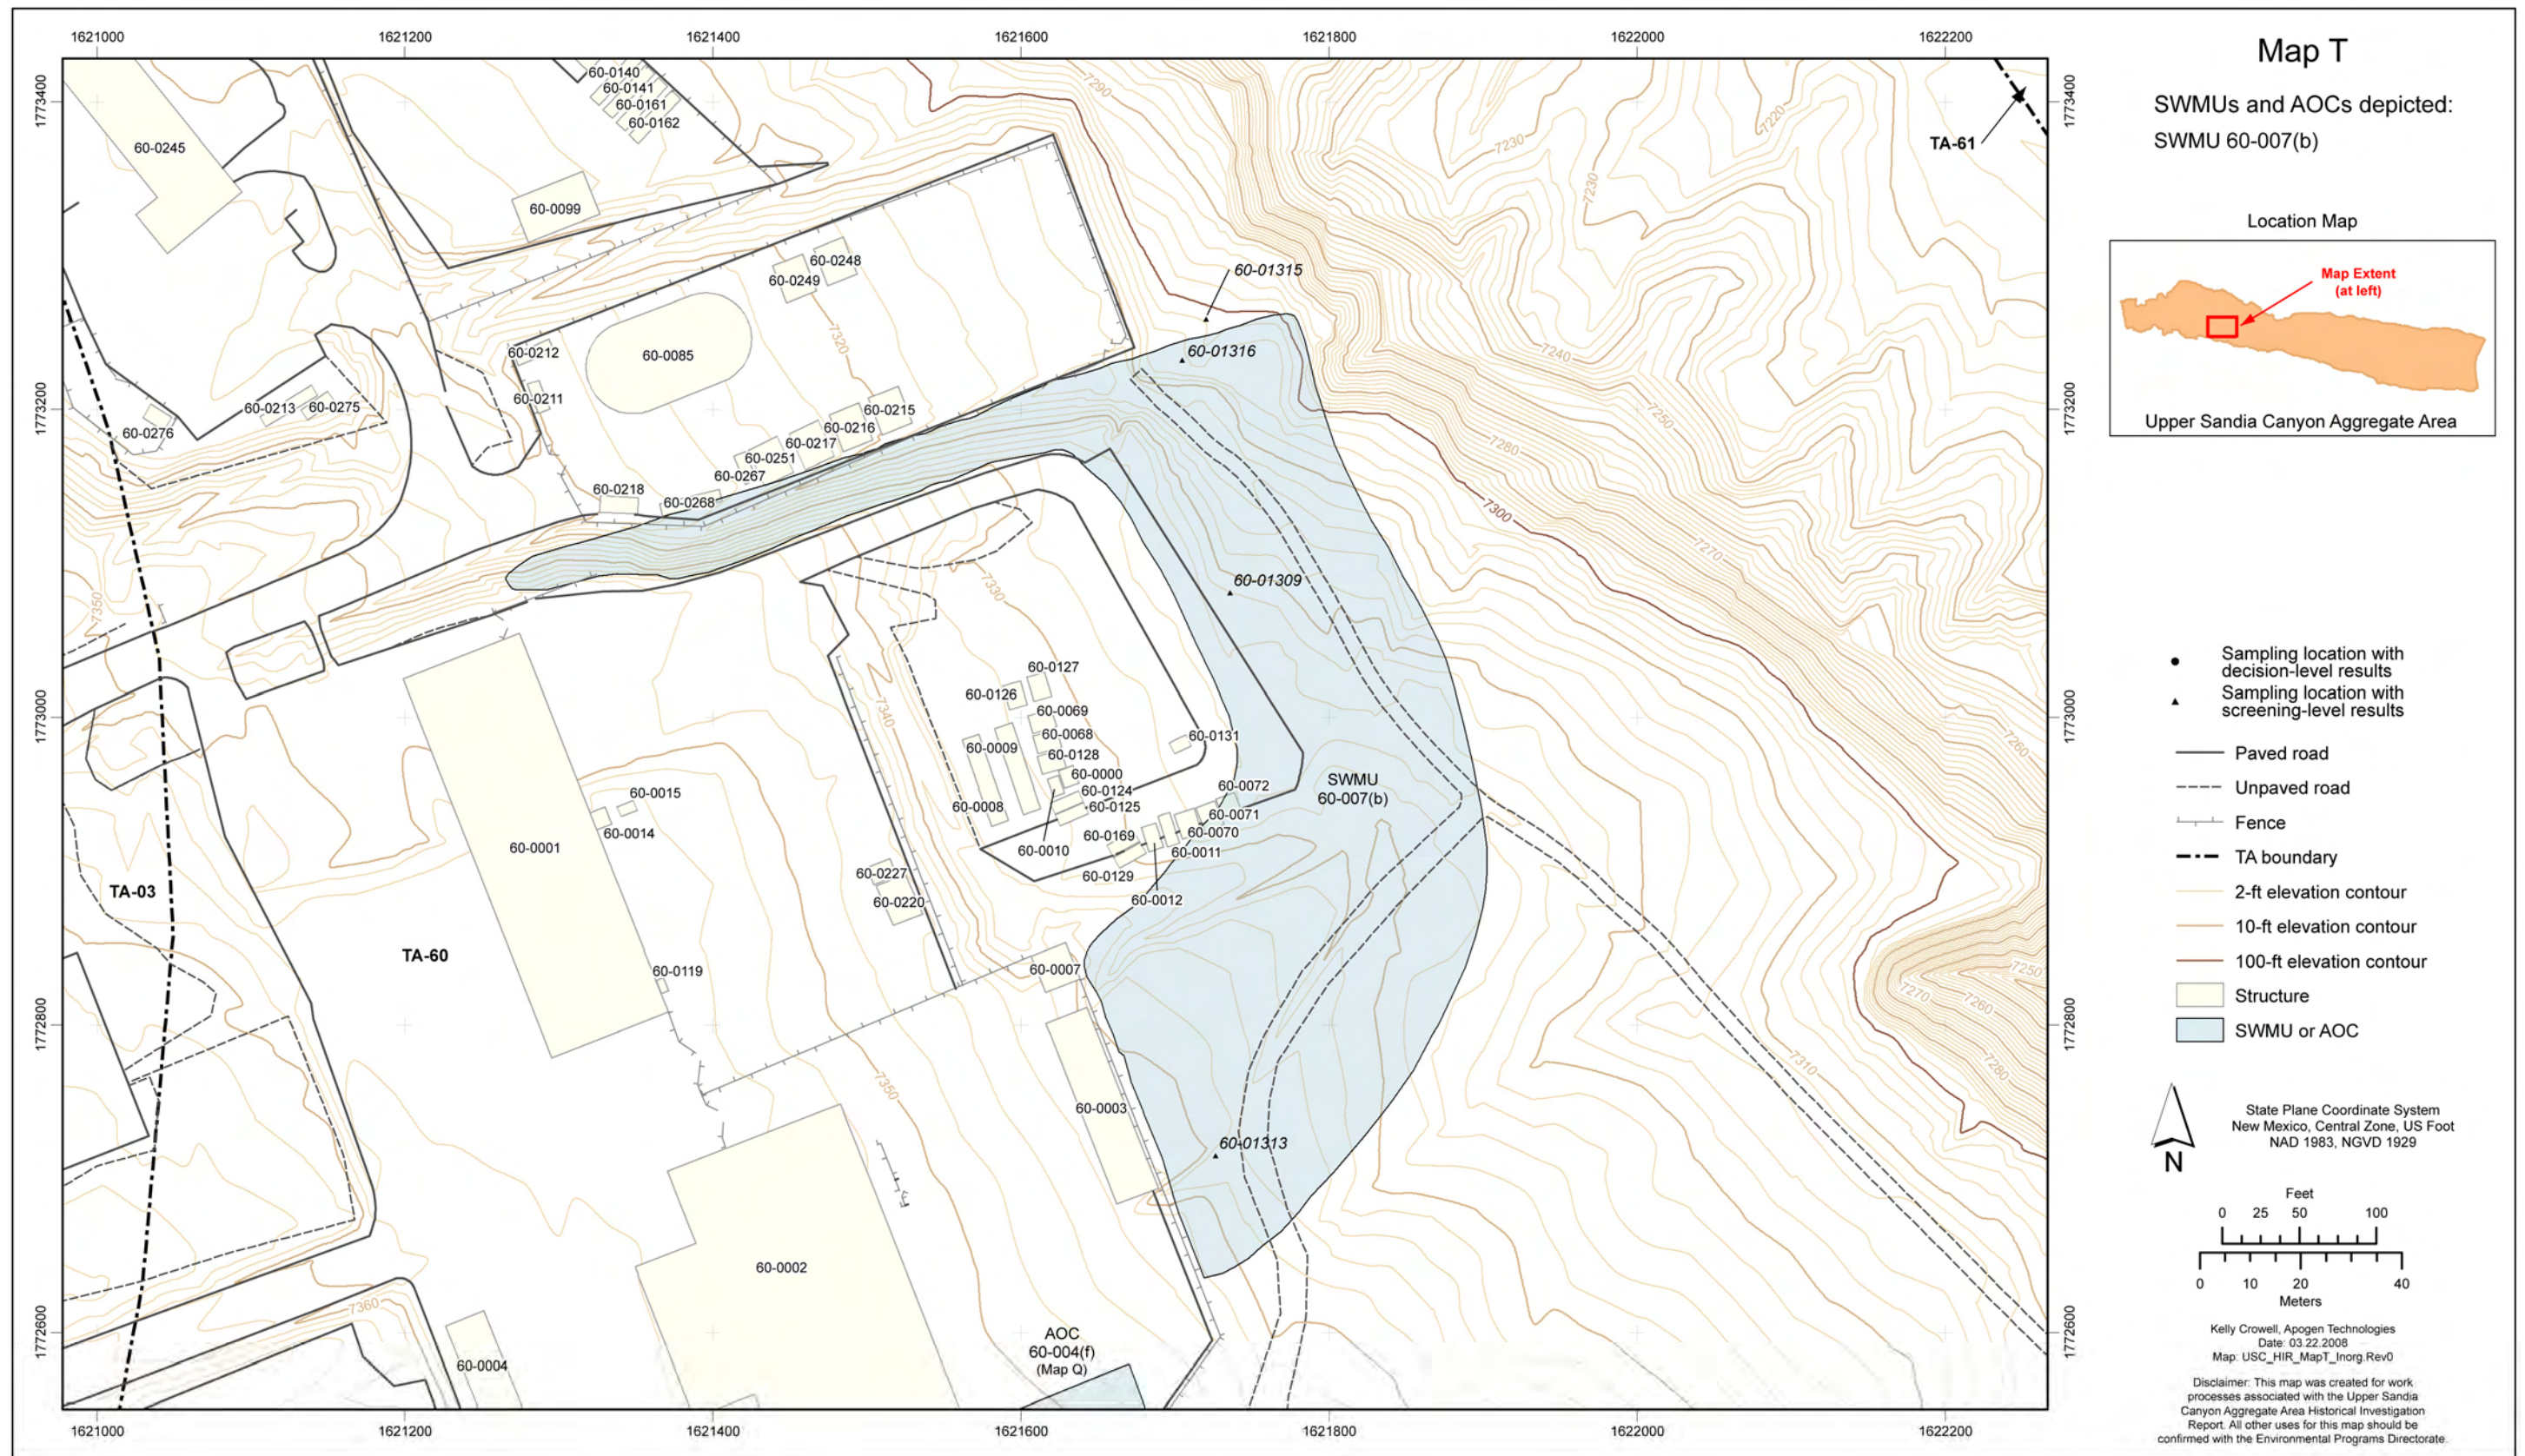


Figure 4.2-18 Map T radionuclide sampling locations



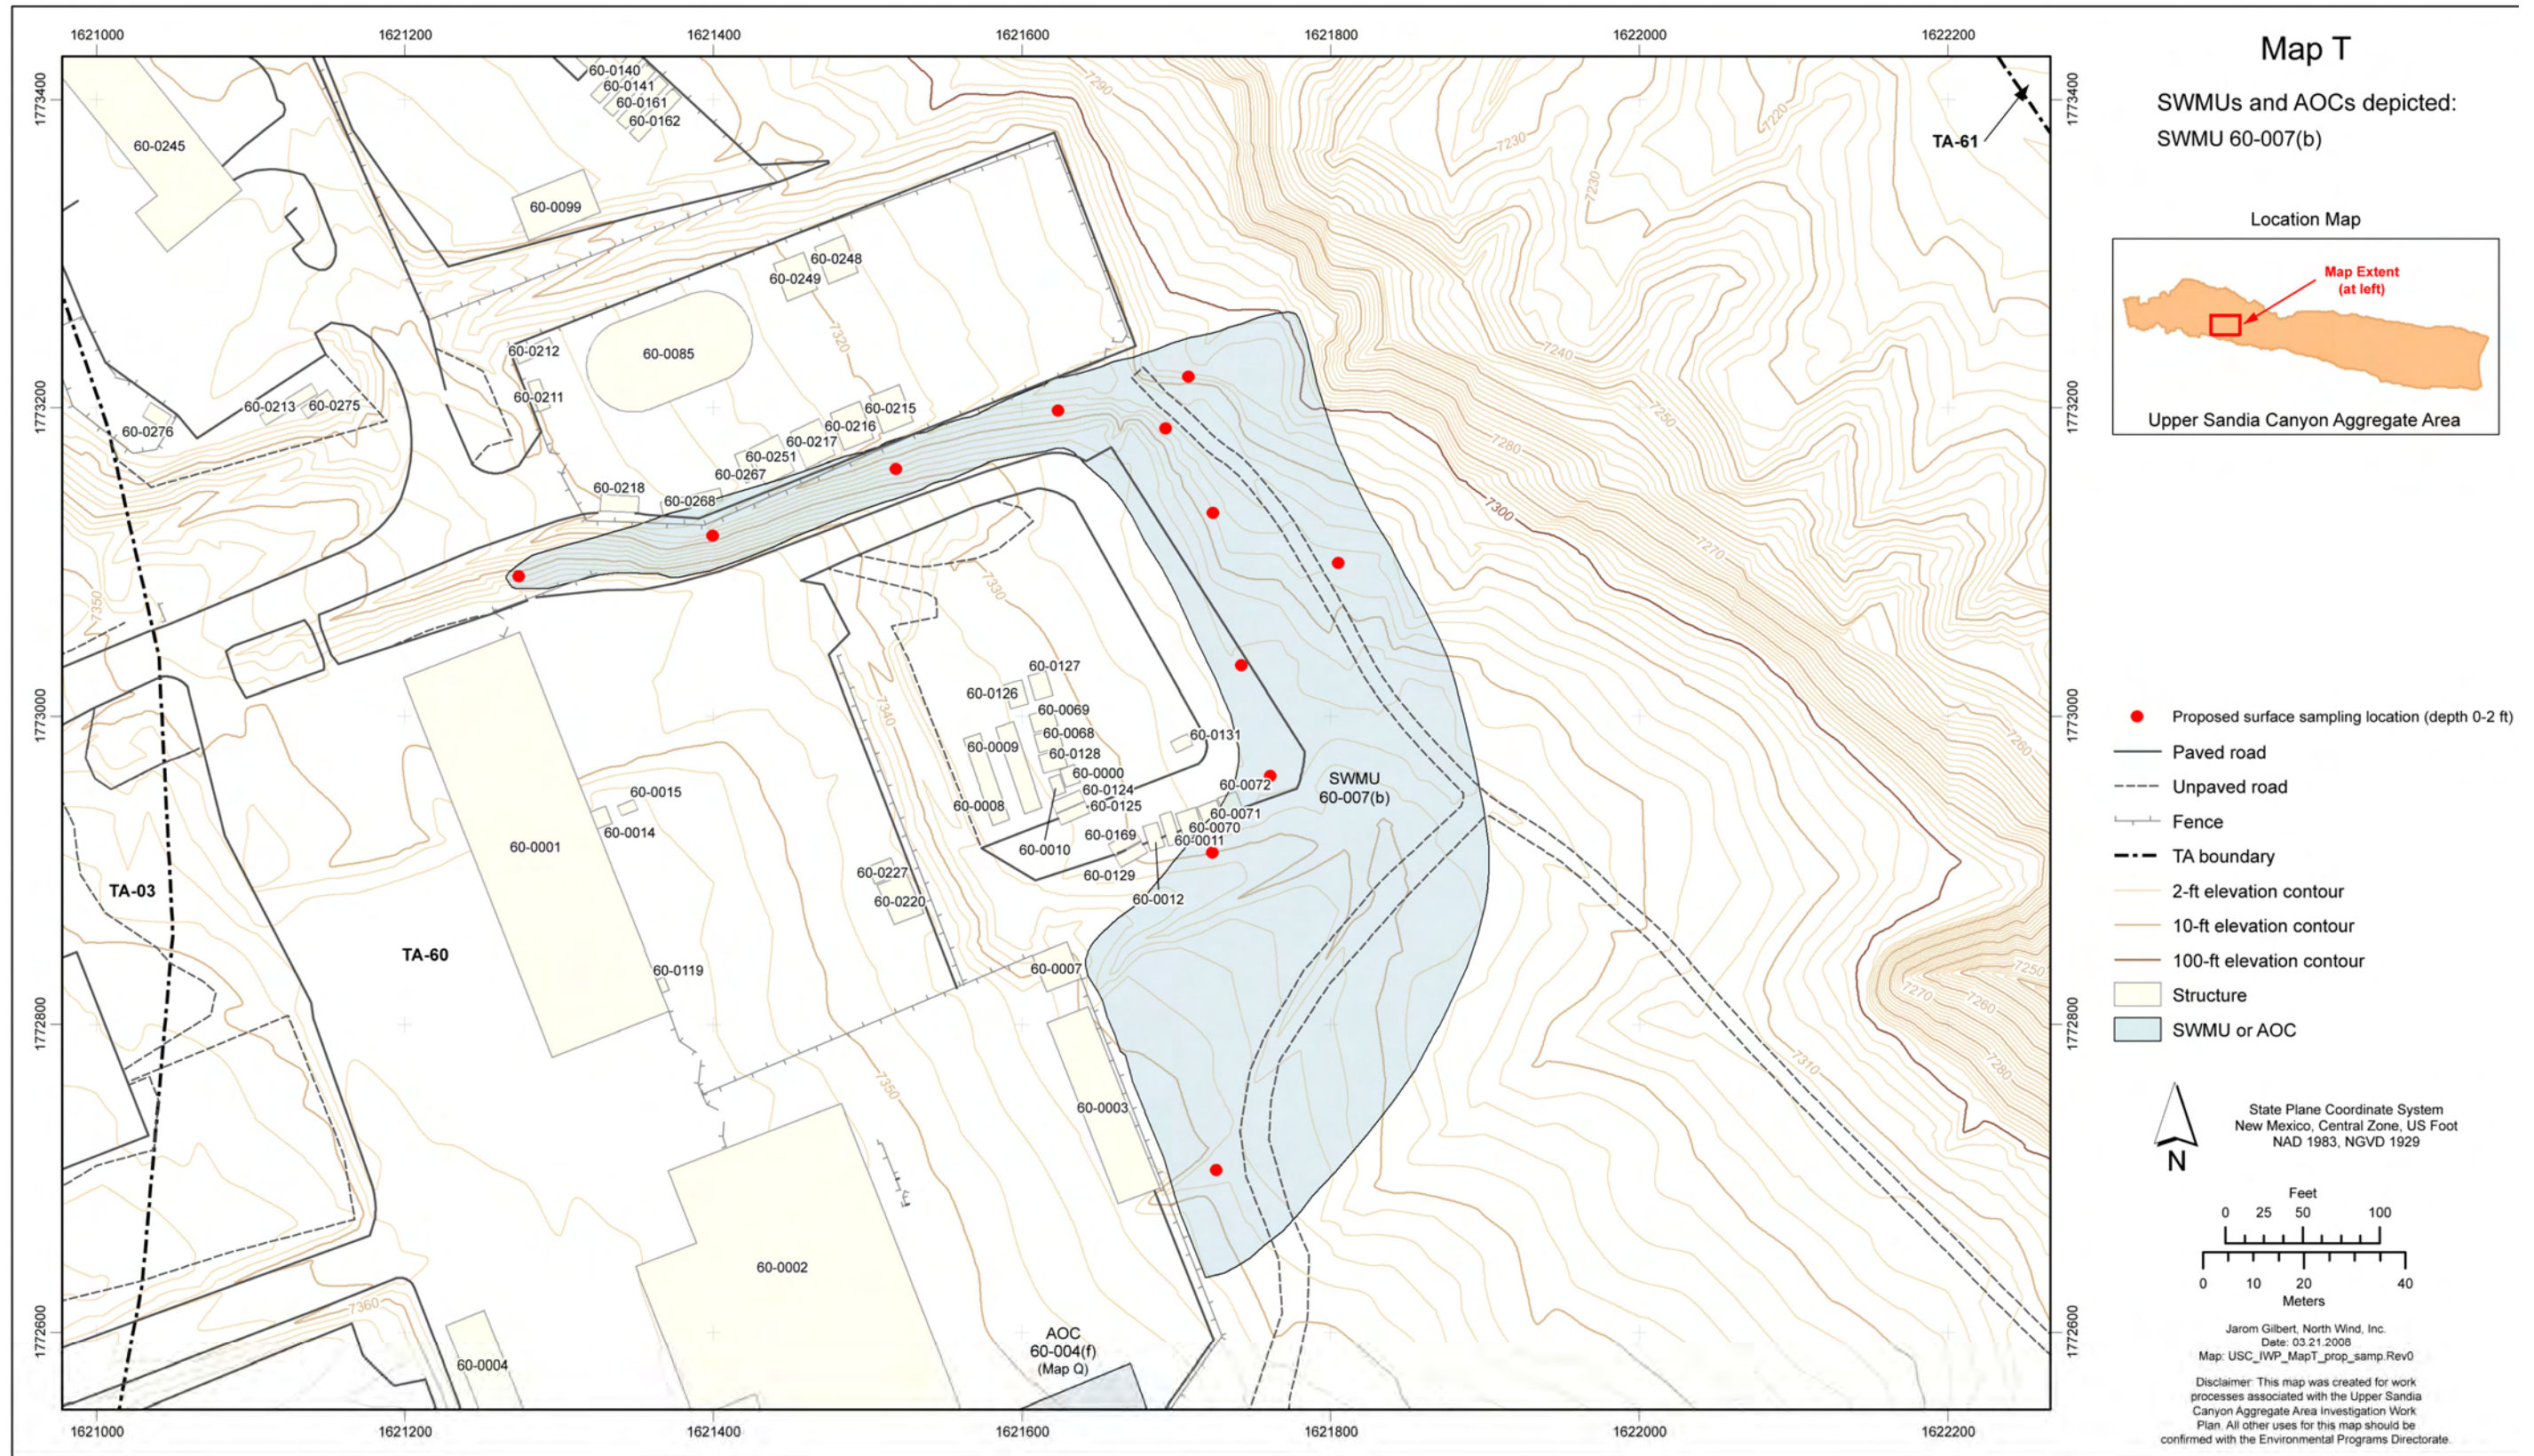


Figure 4.2-19 Map T proposed sampling locations



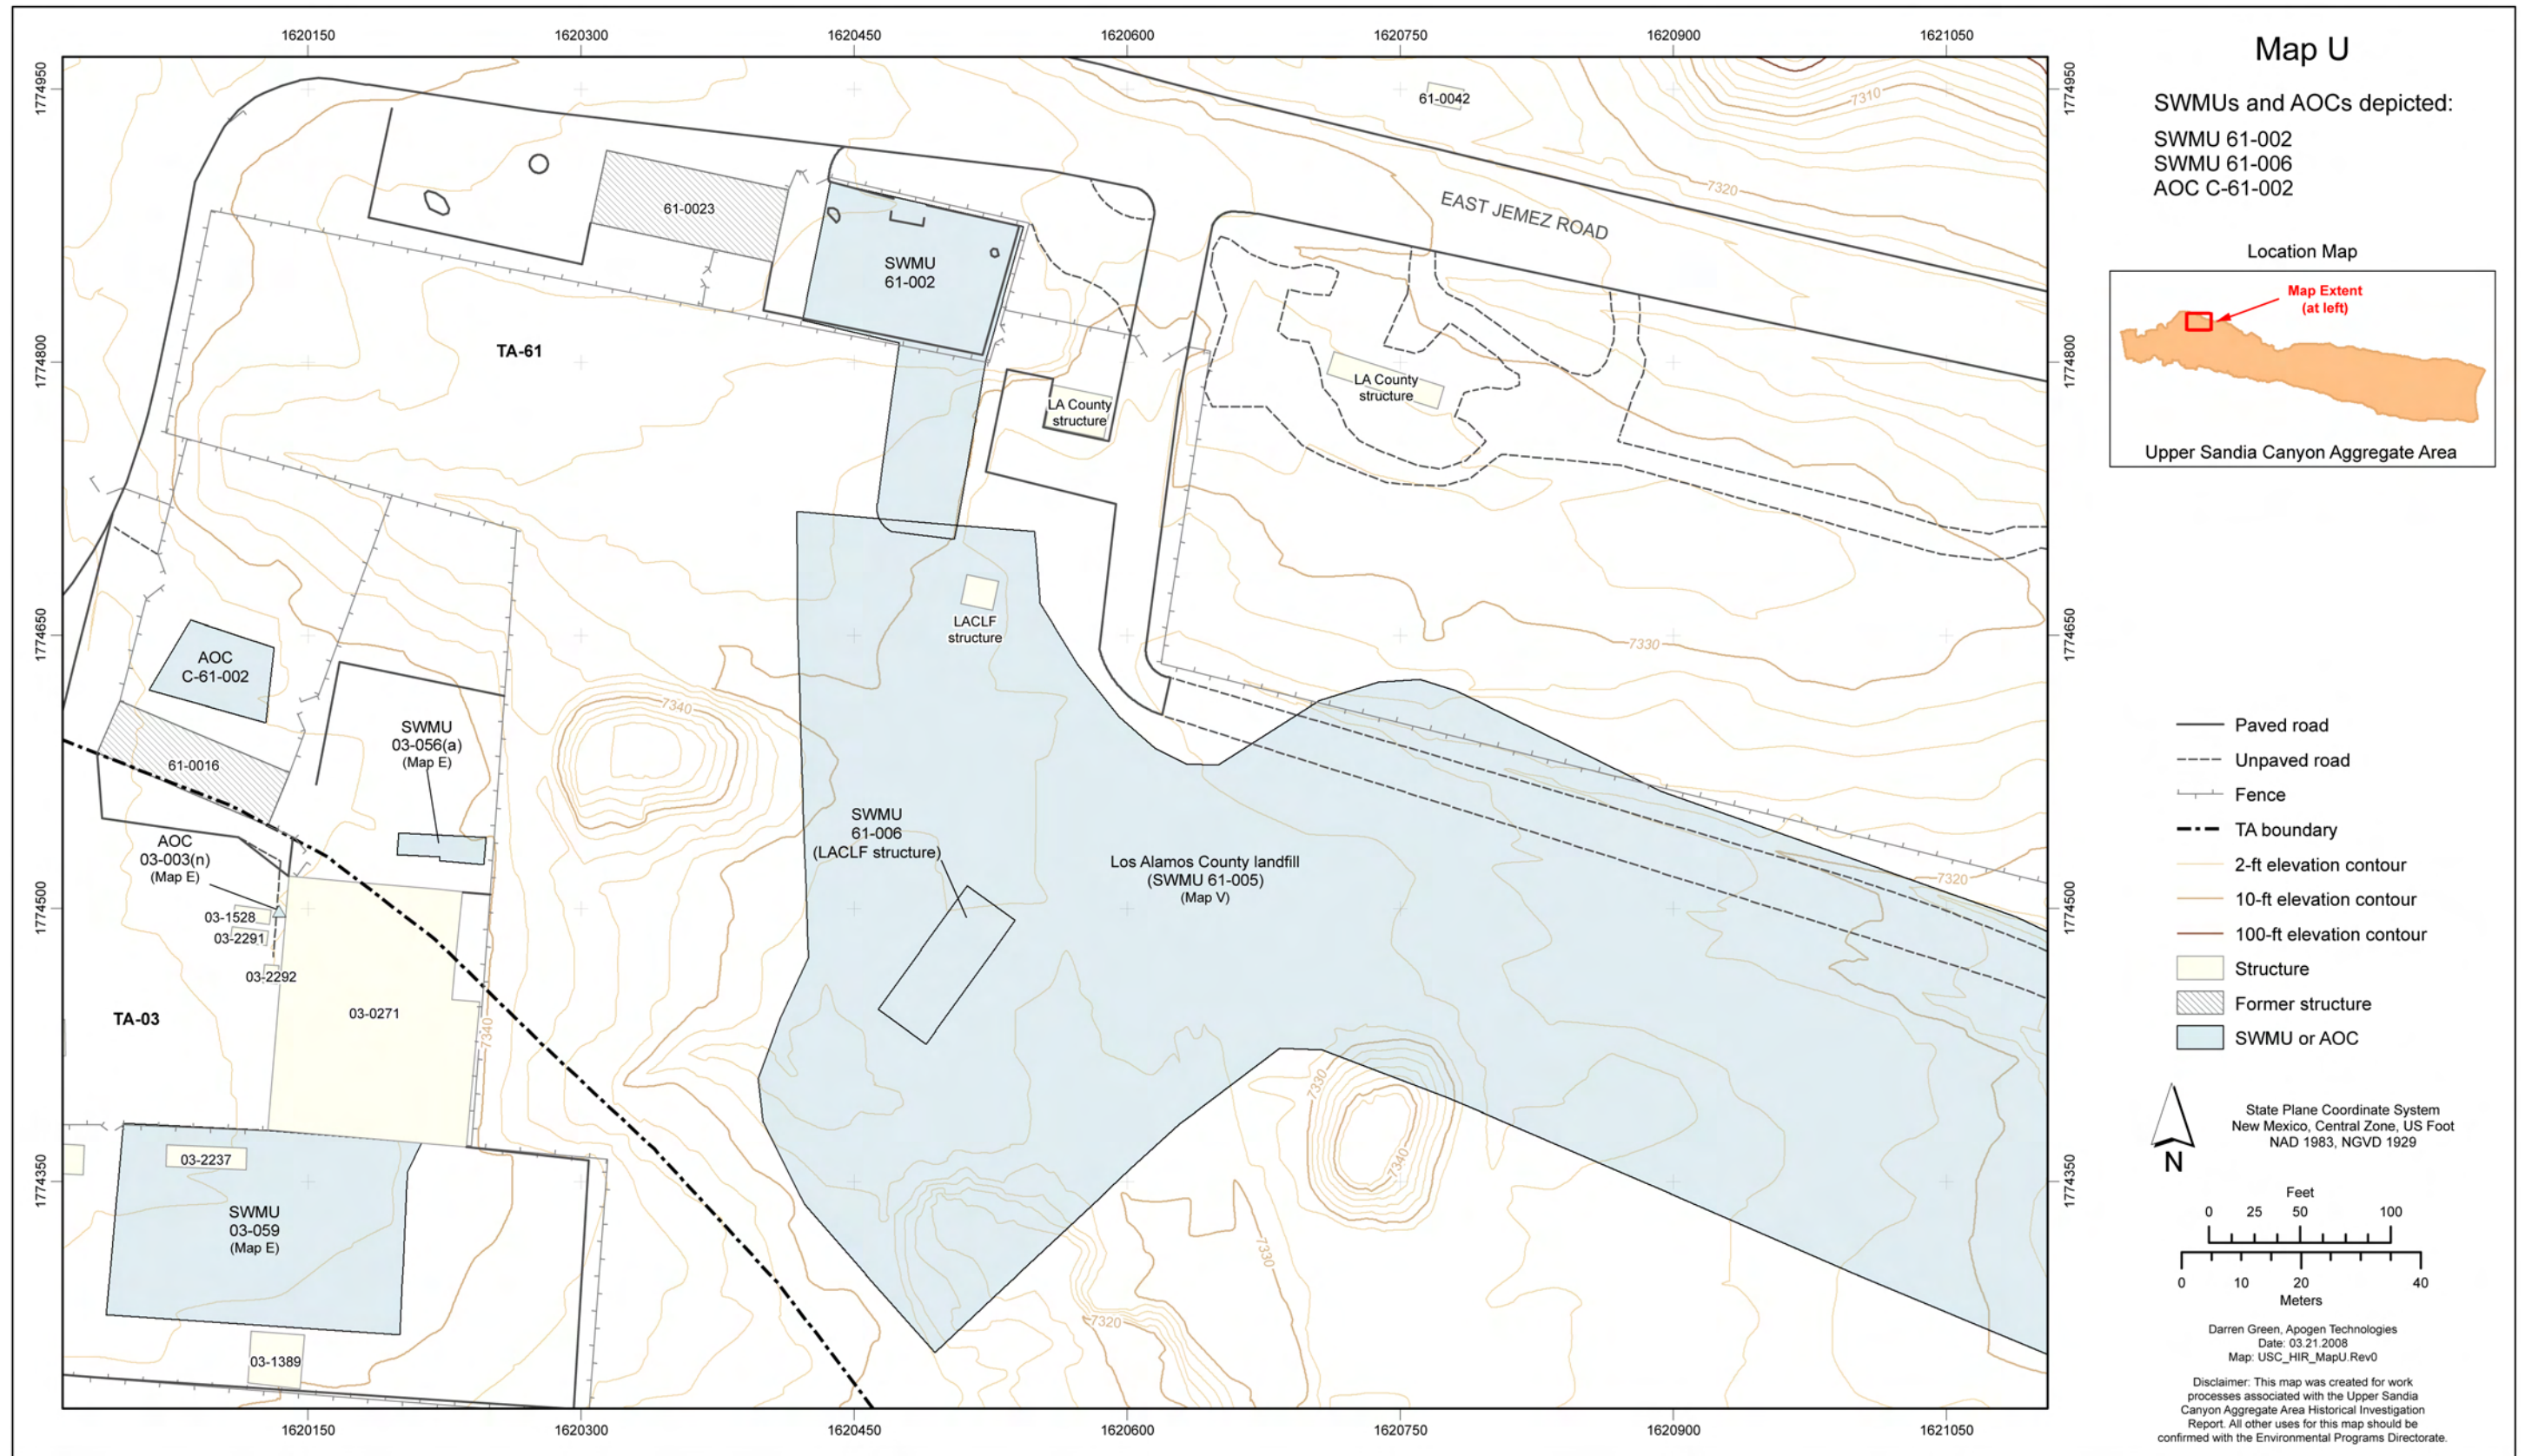


Figure 4.3-1 Map U site location



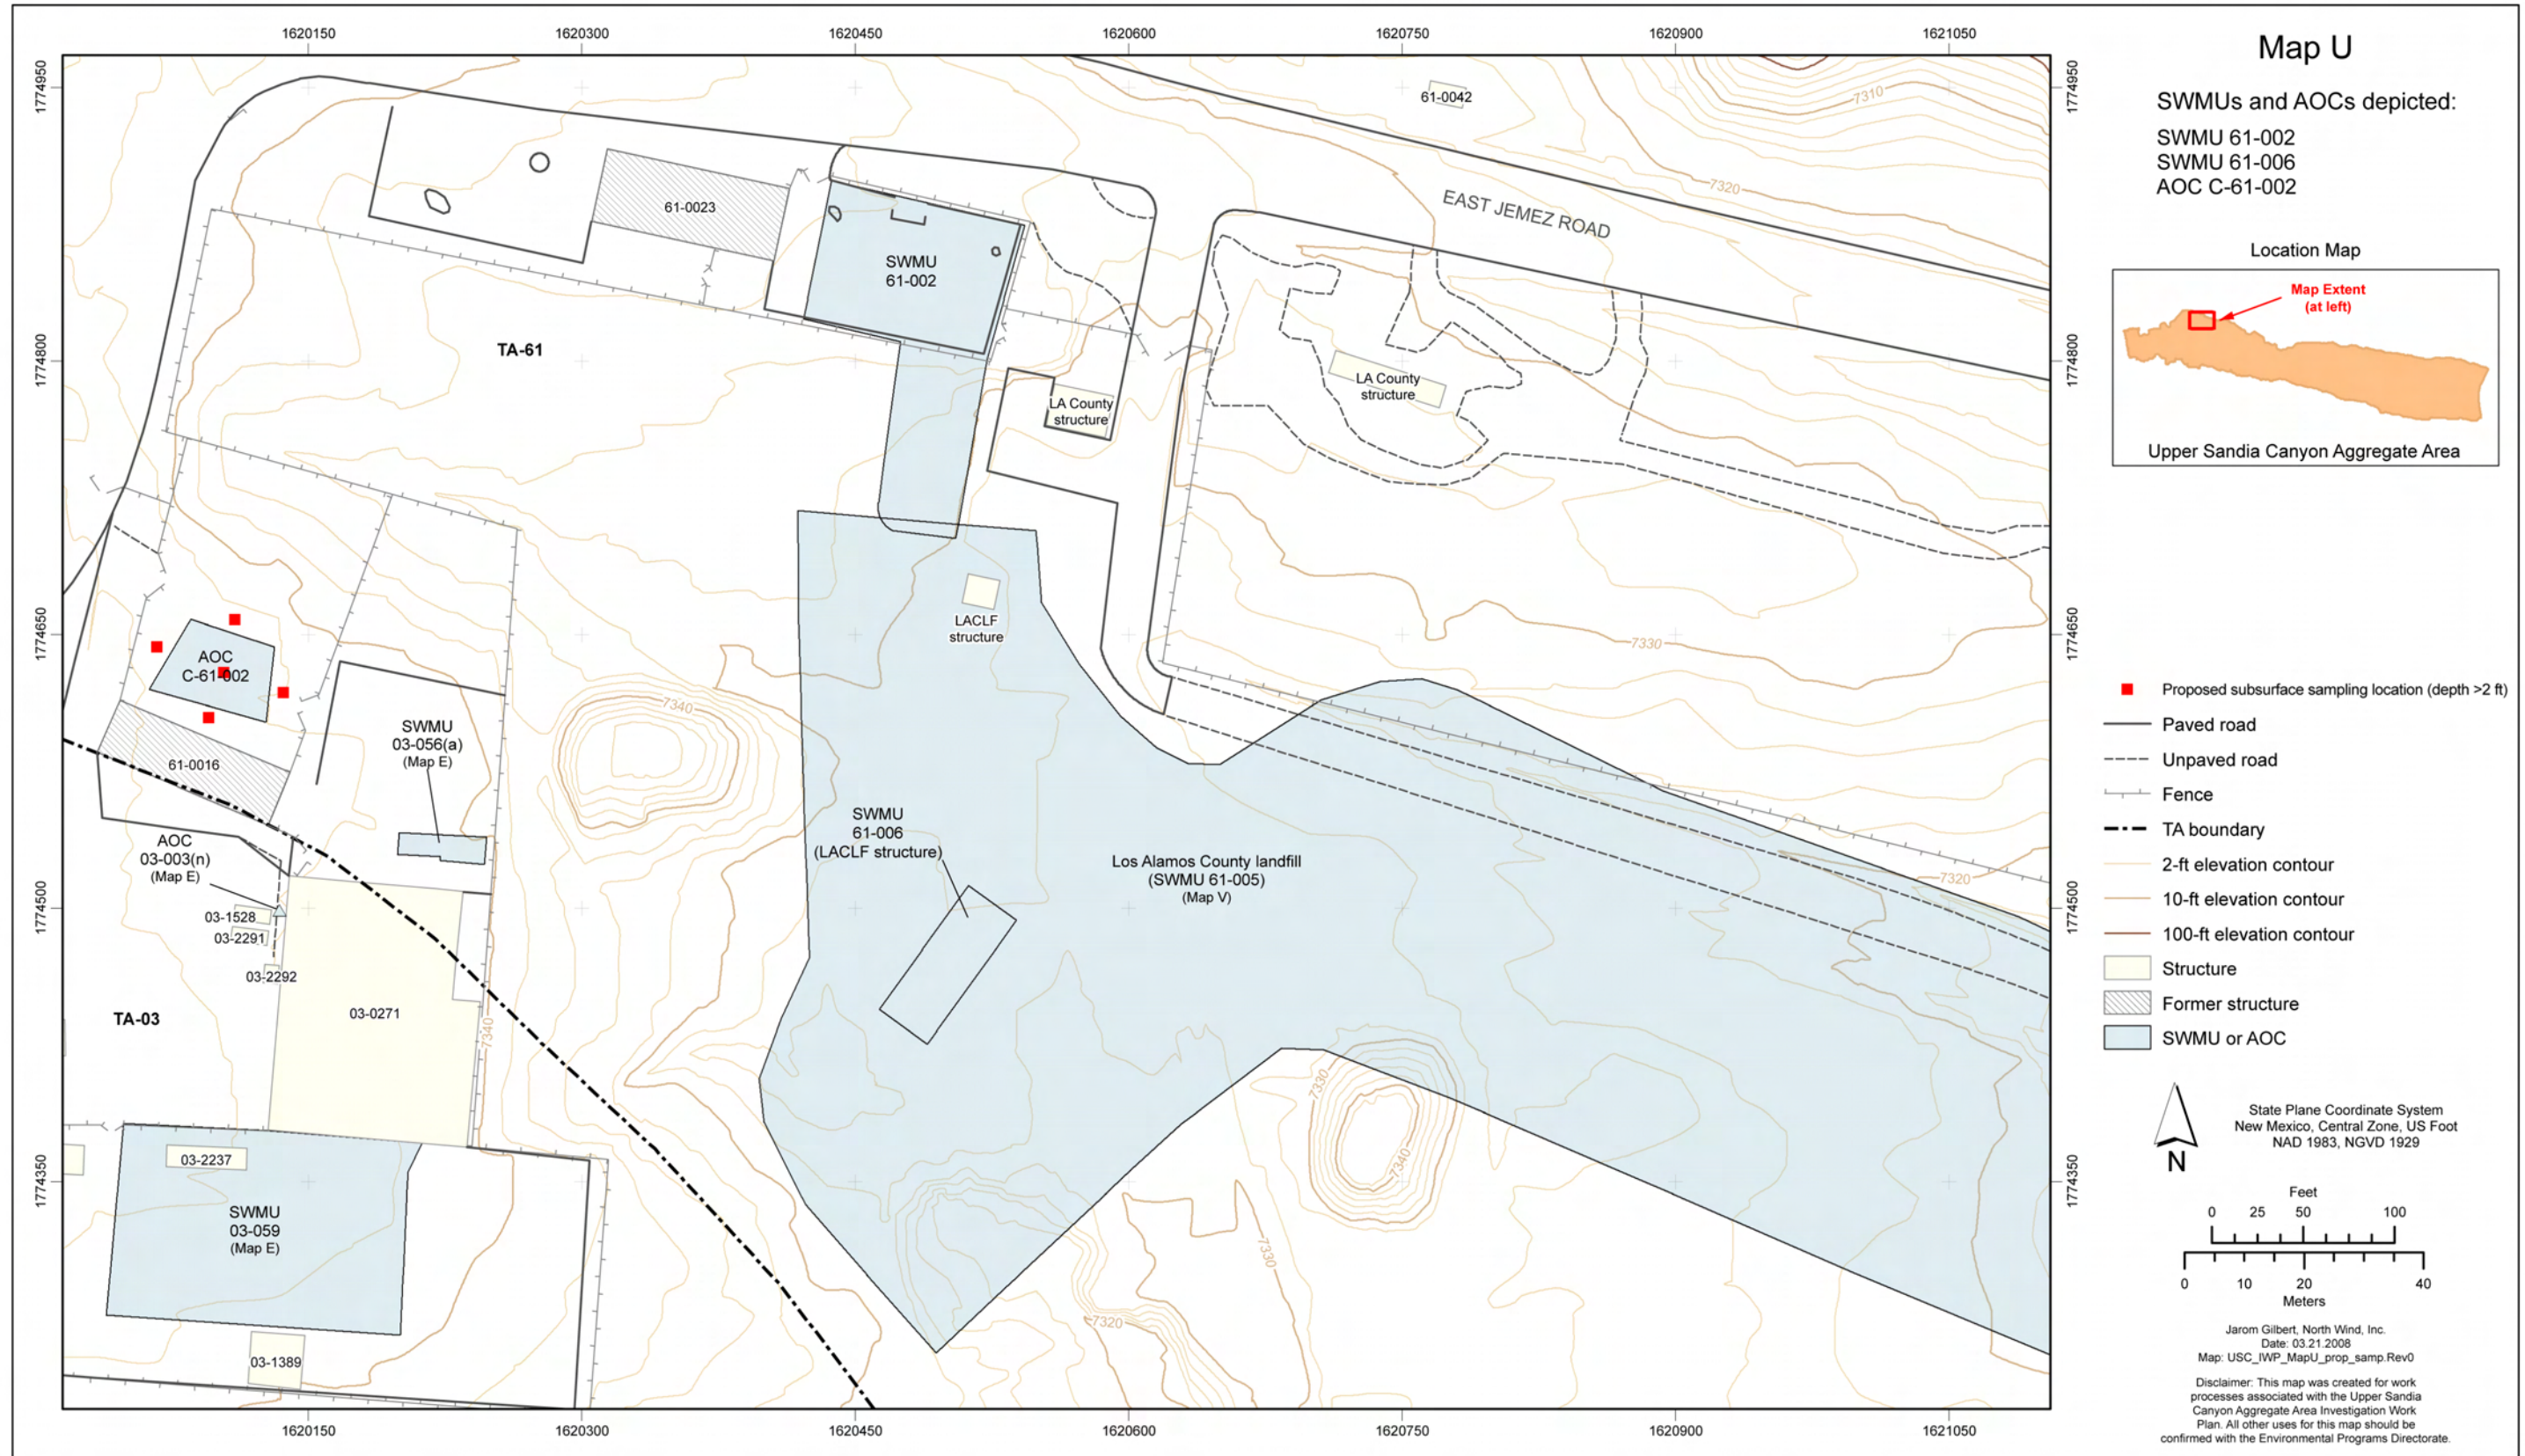


Figure 4.3-2 Map U proposed sampling locations



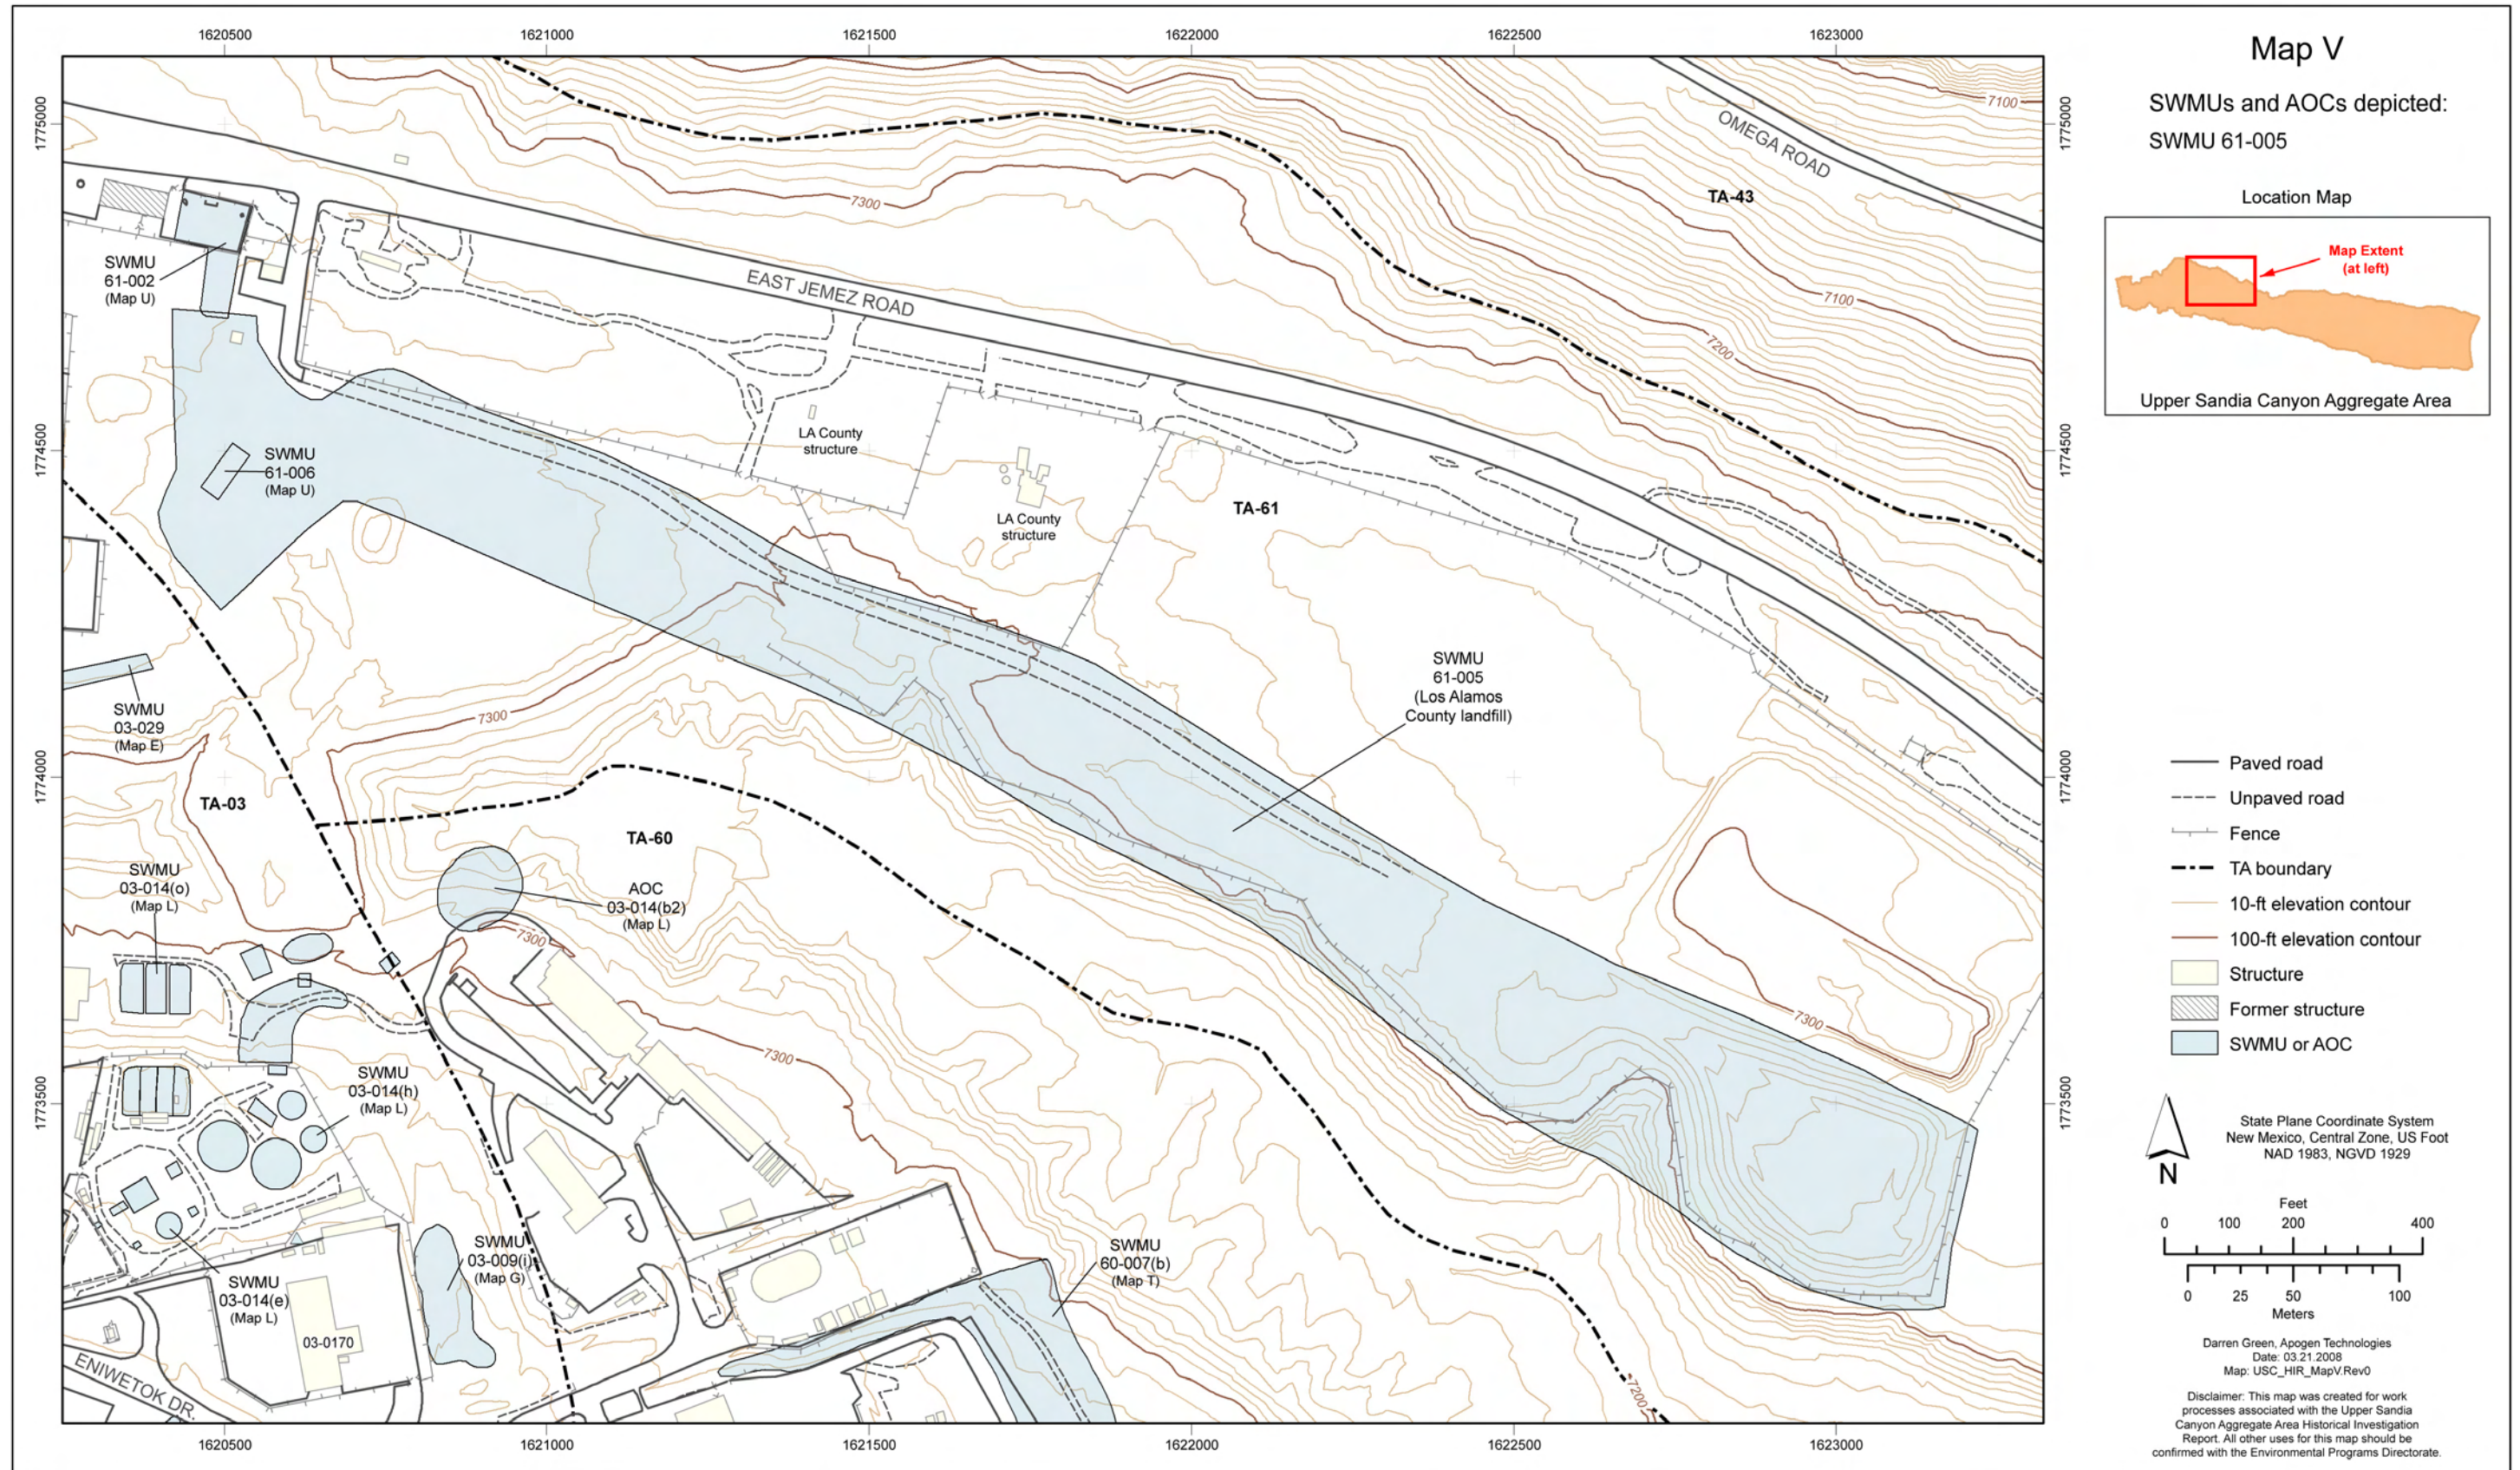


Figure 4.3-3 Map V site location





**Table 1.1-1  
SWMUs and AOCs within the Upper Sandia Canyon Aggregate Area**

Site ID	Subunit	Brief Description	Site Status	Reference	Proposed Action
<b>TA-03</b>					
AOC 03-001(d)		Former satellite accumulation area located on a paved area northwest of building 03-0170	NFA Approved	EPA 2005, 088464	None
AOC 03-001(f)		Satellite accumulation areas (rooms 122, 125, and 132) and a less-than-90-day hazardous waste accumulation area (room 103) within building 03-0038	Certificate of Completion with Controls	EPA 2005, 088464	None
AOC 03-001(i)		Two inactive material and equipment storage areas located near a parks and refuse office building (building 03-0070)	NFA Approved	NMED 2006, 094384	None
AOC 03-001(n)		Satellite accumulation areas in room 104 and on the south loading dock of building 03-032	NFA Approved	EPA 2005, 088464	None
AOC 03-001(o)		A former satellite accumulation area within room 100 of building 03-035	NFA Approved	EPA 2005, 088464	None
AOC 03-001(p)		Former satellite accumulation area located within building 03-037 (a carpenter shed)	NFA Approved	EPA 2005, 088464	None
AOC 03-001(q)		Former satellite accumulation areas located in rooms 108A and A326 of building 03-043	NFA Approved	EPA 2005, 088464	None
AOC 03-001(r)		Former satellite accumulation area within room 101 of building 03-409	NFA Approved	EPA 2005, 088464	None
AOC 03-001(v)		Former satellite accumulation area within a pesticide storage shed (building 60-029, formerly designated building 03-1486)	NFA Approved	EPA 2005, 088464	None
AOC 03-001(x)		Former Satellite accumulation area within building 03-022	NFA Approved	EPA 2005, 088464	None



Table 1.1-1 (continued)

Site ID	Subunit	Brief Description	Site Status	Reference	Proposed Action
SWMU 03-002(a)		A former less-than-90-day hazardous waste accumulation area that has also been identified as a less-than-90-day storage area that was established at the Laboratory within building 03-066 (outside of room P-100)	Removed from Module VIII, Hazardous Waste Facility Permit (HWFP)	NMED 2001, 070010	None
SWMU 03-002(b)		An inactive hazardous waste satellite accumulation area established at the Laboratory within building 03-1966	Removed from Module VIII, HWFP	NMED 1998, 063042	None
SWMU 03-002(c)		Former storage area used to store pesticides and herbicides	Under Investigation	Work plan section 4.1.1	Collect samples
SWMU 03-003(c)		Equipment storage area—PCB only site—used to temporarily store used dielectric oils/capacitors	Under Investigation	Work plan section 4.1.2	None
AOC 03-003(d)		Transformer pad—PCB only site—is a concrete pad that formerly housed transformers	Under Investigation	Work plan section 4.1.3	Collect samples
AOC 03-003(f)		Transformer—PCB only site—is an area of potential soil contamination	Under Investigation	Work plan section 4.1.4	Collect samples
AOC 03-003(g)		Transformer area—PCB only storage site	Under Investigation	Work plan section 4.1.5	Collect samples
AOC 03-003(m)		The location of two former capacitor banks at building 03-1188 in a limited access, fenced area	NFA Approved	EPA 2003, 087296	None
AOC 03-003(o)		Former non-PCB capacitor bank for Scyllac experiment	Under Investigation	Work plan section 4.1.6	None
AOC 03-006		Burn site	NFA Approved	EPA 2005, 088464	None
AOC 03-008(b)		Decommissioned firing chamber located in building 03-0043	NFA Approved	EPA 2005, 088464	None

Table 1.1-1 (continued)

Site ID	Subunit	Brief Description	Site Status	Reference	Proposed Action
Consolidated Unit 03-009(a)-00	SWMU 03-009(a)	Surface disposal (soil fill) located at the canyon rim south of asphalt plant	Under Investigation	Work plan section 4.1.7.1	Collect samples
	SWMU 03-028	Surface impoundment holding pond near asphalt plant	Under Investigation	Work plan section 4.1.7.2	None
	SWMU 03-029	Landfill near rim of Sandia Canyon south of building 03-0271	Under Investigation	Work plan section 4.1.7.3	Collect samples
	SWMU 03-036(a)	Aboveground tanks-two former product tanks at asphalt plant	Under Investigation	Work plan section 4.1.7.4	None
	SWMU 03-036(c)	Aboveground tank, former tank for cooled asphalt storage	Under Investigation	Work plan section 4.1.7.5	None
	SWMU 03-036(d)	Underground tank, hot emulsion storage tank	Under Investigation	Work plan section 4.1.7.6	None
	AOC 03-043(b)	Aboveground tank, asphalt emulsion storage	Under Investigation	Work plan section 4.1.7.7	None
	AOC 03-043(d)	Aboveground tank, duplicate of 03-036(a)	No Investigation Proposed	Work plan section 4.1.7.8	None
	AOC 03-043(h)	Aboveground tank, duplicate of 03-036(a)	No Investigation Proposed	Work plan section 4.1.7.9	None
	SWMU 03-045(g)	Storm drain, closed and locked formerly permitted outfall	Under Investigation	Work plan section 4.1.7.10	Collect samples
SWMU 03-009(i)		Surface disposal site for construction debris	Under Investigation	Work plan section 4.1.8	Collect samples
AOC 03-010(c)		Former hydraulic pump in metal shed north of building 03-0216	NFA Approved	EPA 2005, 088464	None
AOC 03-010(d)		Two former vacuum pumps in metal shed on east side of building 03-0141	NFA Approved	EPA 2005, 088464	None
Consolidated Unit 03-012(b)-00	SWMU 03-012(b)	Operational release and outfall associated with the power plant	Under Investigation	Work plan section 4.1.9.1	Collect samples
	SWMU 03-014(q)	Holding tank, former effluent tank	Under Investigation	Work plan section 4.1.9.2	Collect samples
	SWMU 03-045(b)	Operational release, duplicate of SWMU 03-012(b)	No Investigation Proposed	Work plan section 4.1.9.3	Collect samples

Table 1.1-1 (continued)

Site ID	Subunit	Brief Description	Site Status	Reference	Proposed Action
Consolidated Unit 03-012(b)-00 (continued)	SWMU 03-045(c)	Outfall currently NPDES permitted, receives effluent from cooling tower	Under Investigation	Work plan section 4.1.9.4	Collect samples
Consolidated Unit 03-013(a)-00	SWMU 03-013(a)	Storm drain, corrugated metal pipe	Under Investigation	Work plan section 4.1.10.1	None
	SWMU 03-052(f)	Outfall received wastewater from building 03-0038	Under Investigation	Work plan section 4.1.10.2	Collect samples
AOC 03-013(b)		Floor drains in basement of building 03-0038	Under Investigation	Work plan section 4.1.11	None
AOC 03-013(c)		Operational release, former cable cleaning site west of building 03-0038	NFA Approved	EPA 2005, 088464	None
AOC 03-013(d)		Operational release, site of former metal working equipment (hydraulic bender and shearer)	NFA Approved	EPA 2005, 088464	None
AOC 03-013(e)		Operational release, site of one-time antifreeze spill in paved storage yard west of building 03-0036	NFA Approved	EPA 2005, 088464	None
AOC 03-013(f)		Operational release, former area of stained soil associated with tar-melting pot and hopper	NFA Approved	EPA 2005, 088464	None
SWMU 03-013(i)		Operational release, oil contaminated soil and gravel	Under Investigation	Work plan section 4.1.12	Collect samples
Consolidated Unit 03-014(a)-99	SWMU 03-014(a)	Structure associated with former WWTP, Imhoff tank	Under Investigation	Work plan section 4.1.13.1	Collect samples
	SWMU 03-014(b)	Structure associated with former WWTP, the dosing siphon	Under Investigation	Work plan section 4.1.13.2	Collect samples
	AOC 03-014(b2)	Outfall formerly permitted, received effluent from flow-measurement weir	Under Investigation	Work plan section 4.1.13.3	Collect samples
	SWMU 03-014(c)	Structure associated with former WWTP, trickling filter	Under Investigation	Work plan section 4.1.13.4	Collect samples
	AOC 03-014(c2)	Outfall, abandoned overflow, received effluent from WWTP	Under Investigation	Work plan section 4.1.13.5	Collect samples
	SWMU 03-014(d)	Structure associated with former WWTP, secondary clarifier	Under Investigation	Work plan section 4.1.13.6	Collect samples



Table 1.1-1 (continued)

Site ID	Subunit	Brief Description	Site Status	Reference	Proposed Action
Consolidated Unit 03-014(a)-99 (continued)	SWMU 03-014(e)	Structure associated with former WWTP, Imhoff tank	Under Investigation	Work plan section 4.1.13.7	Collect samples
	SWMU 03-014(f)	Structure associated with former WWTP, dosing siphon	Under Investigation	Work plan section 4.1.13.8	Collect samples
	SWMU 03-014(g)	Structure associated with former WWTP, trickling filter	Under Investigation	Work plan section 4.1.13.9	Collect samples
	SWMU 03-014(h)	Structure associated with former WWTP, secondary clarifier	Under Investigation	Work plan section 4.1.13.10	Collect samples
	SWMU 03-014(i)	Structure associated with former WWTP, splitter box, a comminutor, and bar screen	Under Investigation	Work plan section 4.1.13.11	Collect samples
	SWMU 03-014(j)	Structure associated with former WWTP, chlorination system	Under Investigation	Work plan section 4.1.13.12	Collect samples
	SWMU 03-014(k)	Structure associated with former WWTP, unlined sludge-drying bed	Under Investigation	Work plan section 4.1.13.13	Collect samples
	SWMU 03-014(l)	Structure associated with former WWTP, unlined sludge-drying bed	Under Investigation	Work plan section 4.1.13.14	Collect samples
	SWMU 03-014(m)	Structure associated with former WWTP, unlined sludge-drying bed	Under Investigation	Work plan section 4.1.13.15	Collect samples
	SWMU 03-014(n)	Structure associated with former WWTP, unlined sludge-drying bed	Under Investigation	Work plan section 4.1.13.16	Collect samples
	SWMU 03-014(o)	Structure associated with former WWTP, three lined sludge-drying bed	Under Investigation	Work plan section 4.1.13.17	Collect samples
	SWMU 03-014(p)	Structure associated with former WWTP, active lift station	Under Investigation	Work plan section 4.1.13.18	Delay characterization
	SWMU 03-014(u)	Structure associated with former WWTP, former holding tank	Under Investigation	Work plan section 4.1.13.19	Collect samples
	SWMU 03-056(d)	Drum storage, active site on northeast side of Plant 1 trickling filter	Under Investigation	Work plan section 4.1.13.20	Collect samples
SWMU 03-014(r)		Active lift station associated with former WWTP	Under Investigation	Work plan section 4.1.14	Delay characterization
SWMU 03-014(s)		Active lift station associated with former WWTP	Under Investigation	Work plan section 4.1.15	Delay characterization

Table 1.1-1 (continued)

Site ID	Subunit	Brief Description	Site Status	Reference	Proposed Action
AOC 03-014(v)		Drain associated with former WWTP in former garage (building 03-0036)	Under Investigation	Work plan section 4.1.16	None
AOC 03-014(y)		Drain associated with former WWTP in basement of press building (03-0035)	Under Investigation	Work plan section 4.1.17	Delay characterization
Consolidated Unit 03-015-00	SWMU 03-015	Outfall located between Eniwetok Drive and security fence NE of building 03-0141	Under Investigation	Work plan section 4.1.18.1	Collect samples
	AOC 03-053	Operational facility, basement area of building 03-0141	Under Investigation	Work plan section 4.1.18.2	Collect samples
AOC C-03-016		Oil metal bin, cleanout bin	Under Investigation	Work plan section 4.1.19	Collect samples
AOC 03-016(b)		Septic system, served lavatory in building 03-0271	NFA Approved	EPA 2005, 088464	None
AOC 03-016(c)		Septic system, served lavatory in building 03 0007	NFA Approved	EPA 2005, 088464	None
AOC 03-016(d)		Lift station associated with building 03-0443	NFA Approved	EPA 2005, 088464	None
AOC 03-016(e)		Lift station associated with former WWTP, duplicate of SWMU 03-014(s)	NFA Approved	EPA 2005, 088464	None
AOC 03-016(f)		Lift station associated with former WWTP, duplicate of SWMU 03-014(s)	NFA Approved	EPA 2005, 088464	None
SWMU 03-020(a)		Disposal pit associated with air compressor system at former building 03-0287	Removed from Module VIII, HWFP	NMED 1998, 063042	None
AOC 03-020(b)		Disposal pit associated with steam-cleaning engines	NFA Approved	EPA 2005, 088464	None
SWMU 03-021		Outfall located 60 ft north of building 03-0170	Under Investigation	Work plan section 4.1.20	Collect samples
AOC 03-023		Sump used to collect water from floor drains and sinks in building 03-0105	NFA Approved	EPA 2005, 088464	None
SWMU 03-024		Tank and/or associated equipment, concrete pump pit associated with noncontact cooling water	Removed from Module VIII, HWFP	NMED 1998, 063042	None

Table 1.1-1 (continued)

Site ID	Subunit	Brief Description	Site Status	Reference	Proposed Action
SWMU 03-026(b)		Sumps/lift stations located in building 03-0132	Removed from Module VIII, HWFP	NMED 2001, 070010	None
AOC 03-027		Lift wells, two concrete-block-lined lift wells	Under Investigation	Work plan section 4.1.21	None
SWMU 03-032		Tank and associated equipment, recirculation tank in building 03-0038 used to control air emissions	Removed from Module VIII, HWFP	NMED 2001, 070010	None
SWMU 03-035(a)		Former underground diesel storage tank	Removed from Module VIII, HWFP	NMED 1998, 063042	None
SWMU 03-035(b)		Former underground diesel storage tank	Removed from Module VIII, HWFP	NMED 1998, 063042	None
AOC 03-036(b)		Former aboveground tanks that contained diesel fuel	Under Investigation	Work plan section 4.1.22	Collect samples
AOC 03-036(e)		Aboveground tank	NFA Approved	EPA 2005, 088464	None
AOC 03-036(f)		Aboveground gasoline storage tank	NFA Approved	EPA 2005, 088464	None
AOC 03-036(g)		Aboveground sulfuric acid storage tank	NFA Approved	EPA 2005, 088464	None
AOC 03-036(h)		Aboveground tanks used for cooling water corrosion inhibitors	NFA Approved	EPA 2005, 088464	None
AOC 03-036(i)		Aboveground diesel fuel storage tank	NFA Approved	EPA 2005, 088464	None
AOC 03-036(j)		Aboveground diesel fuel storage tanks	NFA Approved	EPA 2005, 088464	None
SWMU 03-037		Underground tanks, active concrete tank in basement of Sigma Building	Under Investigation	Work plan section 4.1.23	Delay characterization
AOC 03-038(c)		Waste lines, cast-iron piped rinse solution from copper electroplating	Under Investigation	Work plan section 4.1.24	Collect samples
AOC 03-038(d)		Waste lines, industrial line associated with liquid waste treatment system	Under Investigation	Work plan section 4.1.25	Collect samples
SWMU 03-039(a)		Silver recovery unit used at photography-processing operation in building 03-0043	Removed from Module VIII, HWFP	NMED 1998, 063042	None



Table 1.1-1 (continued)

Site ID	Subunit	Brief Description	Site Status	Reference	Proposed Action
AOC 03-039(b)		Silver recovery unit used at photography-processing operation in building 03-0028	NFA Approved	EPA 2005, 088464	None
AOC 03-039(d)		Silver recovery unit used at photography-processing operation in building 03-0132	NFA Approved	EPA 2005, 088464	None
AOC 03-039(e)		Silver recovery unit used at photography-processing operation in building 03-0409	NFA Approved	EPA 2005, 088464	None
AOC 03-040(b)		Storage area that contained a former film disintegrator in building 03-0043	NFA Approved	EPA 2005, 088464	None
AOC 03-043(a)		Aboveground tank stored asphalt emulsion	Under Investigation	Work plan section 4.1.26	None
SWMU 03-043(e)		Former diesel underground storage tank	Removed from Module VIII, HWFP	NMED 2001, 070010	None
AOC 03-043(f)		Aboveground tank, duplicate of 03-036(c)	No Investigation Proposed	Work plan section 4.1.27	None
AOC 03-043(g)		Aboveground tank, duplicate of 03-036(d)	No Investigation Proposed	Work plan section 4.1.28	None
SWMU 03-044(a)		Container storage area near building 03-0070 that contained wooden cable spools and drums containing diesel fuel, kerosene, and oil emulsion	Removed from Module VIII, HWFP	NMED 2001, 070010	None
SWMU 03-045(a)		Outfall from building 03-0022	Under Investigation	Work plan section 4.1.29	Collect samples
SWMU 03-045(d)		Outfall from structure 03-0336	Removed from Module VIII, HWFP	NMED 1998, 063042	None
SWMU 03-045(e)		Outfall from drain in an oil pump house, 03-0057	Under Investigation	Work plan section 4.1.30	Collect samples
SWMU 03-045(f)		Outfall from sink in utilities control center building 03-0223	Under Investigation	Work plan section 4.1.31	Collect samples
SWMU 03-045(h)		Outfall located at north perimeter of Sigma Complex	Under Investigation	Work plan section 4.1.32	Collect samples

Table 1.1-1 (continued)

Site ID	Subunit	Brief Description	Site Status	Reference	Proposed Action
SWMU 03-045(i)		Outfall for stormwater from parking lot into ditch, north of building 03-0034	Removed from Module VIII, HWFP	NMED 2001, 070010	None
SWMU 03-046		Aboveground wastewater neutralization tank located southeast of building 03-0022	Certificate of Completion	NMED 2008, 100116	None
AOC 03-047(a)		Storage area that contained materials used for lead-pouring shop and heavy-equipment repair	NFA Approved	EPA 2005, 088464	None
AOC 03-047(b)		Storage area that contained materials for road maintenance	NFA Approved	EPA 2005, 088464	None
AOC 03-047(c)		Drum storage used to store lubricating oil in 55-gal. drums and small equipment	NFA Approved	EPA 2005, 088464	None
AOC 03-047(d)		Storage area for containers for steam plant	Under Investigation	Work plan section 4.1.34	None
AOC 03-047(e)		Storage area that was used to store paint and related materials	NFA Approved	EPA 2005, 088464	None
AOC 03-047(f)		Storage area used to store engine and replacements parts for equipment	NFA Approved	EPA 2005, 088464	None
AOC 03-047(g)		Drum storage for three drums	Under Investigation	Work plan section 4.1.35	Collect samples
AOC 03-047(h)		Storage area for three drums	NFA Approved	EPA 2005, 088464	None
AOC 03-047(i)		Satellite accumulation area located on a paved area on the south side loading dock of building 03-0216	NFA Approved	EPA 2005, 088464	None
SWMU 03-049(c)		Outfall from building 03-0066, receives discharge from condensate system	Removed from Module VIII, HWFP	NMED 2001, 070010	None
AOC 03-050(c)		Exhaust emissions, off-gas scrubber of HEPA filter system	NFA Approved	EPA 2005, 088464	None
AOC 03-051(c)		Soil contamination from vacuum pump leaking	Under Investigation	Work plan section 4.1.36	Collect samples

Table 1.1-1 (continued)

Site ID	Subunit	Brief Description	Site Status	Reference	Proposed Action
AOC 03-052(b)		Storm drainage 20 ft north and west of Sigma Building (03-0066)	Under Investigation	Work plan section 4.1.37	Collect samples
SWMU 03-052(c)		One-time release of hydraulic oil	Removed from Module VIII, HWFP	NMED 2001, 070010	None
AOC 03-052(d)		Storm drainage southeast of building 03-0287	NFA Approved	EPA 2003, 087296	None
SWMU 03-054(c)		Outfall, former cooling tower, and pump house	Under Investigation	Work plan section 4.1.38	None
SWMU 03-056(a)		Storage area, inactive, used for oil accumulation	Under Investigation	Work plan section 4.1.39	Collect samples
AOC 03-056(b)		Container storage area used to store wooden cable spools and drums containing sand/asphalt mixtures	NFA Approved	EPA 2003, 087296	None
SWMU 03-056(c)		Transformer storage area—PCB only site north of utilities shop, 03-0223	Under Investigation	Work plan section 4.1.40	None
AOC 03-056(h)		Container storage area near 03-0105 and 03-0287	Under Investigation	Work plan section 4.1.41	None
AOC 03-056(i)		Drum storage on east dock of building 03-0038 that stored a drum that contained waste turbine oil	NFA Approved	EPA 2005, 088464	None
AOC 03-056(k)		Container storage area north side of loading dock at Sigma building 03-0066	Under Investigation	Work plan section 4.1.42	Collect samples
SWMU 03-056(l)		Storage area outside building 03-0141	Under Investigation	Work plan section 4.1.43	Collect samples
SWMU 03-056(n)		Container storage area that contained drums that stored waste from lead shop	Removed from Module VIII, HWFP	NMED 2001, 070010	None
AOC 03-057		Sump/grease trap that served building 03-0100	NFA Approved	EPA 2005, 088464	None
Consolidated Unit 03-059-00	AOC 03-003(n)	One-time spill—PCB only site	Under Investigation	Work plan section 4.1.44.1	Collect samples
	SWMU 03-059	Storage area—PCB only site—former salvage yard	Under Investigation	Work plan section 4.1.44.2	Collect samples
AOC C-03-001		Gas trap	NFA Approved	EPA 2005, 088464	None



Table 1.1-1 (continued)

Site ID	Subunit	Brief Description	Site Status	Reference	Proposed Action
AOC C-03-002		One-time spill, leak from asphalt machine in building 03-0035	NFA Approved	EPA 2005, 088464	None
AOC C-03-004		Miscellaneous construction debris pile located northwest of building 03-066	NFA Approved	EPA 2005, 088464	None
AOC C-03-005		Oil spill from asphalt oil distributor truck	NFA Approved	EPA 2005, 088464	None
AOC C-03-009		Storage area used to store equipment, oil, and chemicals for use in building 03-0066	NFA Approved	EPA 2005, 088464	None
AOC C-03-011		Former aboveground gasoline storage tank that was located north of asphalt batch plant	NFA Approved	EPA 2005, 088464	None
AOC C-03-015		Underground gasoline storage tank located northeast of building 03-0036	NFA Approved	EPA 2005, 088464	None
AOC C-03-017		Underground fuel storage tank located north of building 03-0028	NFA Approved	EPA 2005, 088464	None
AOC C-03-018		Underground diesel storage tank located north of building 03-0028	NFA Approved	EPA 2005, 088464	None
AOC C-03-020		Underground transformer oil storage tanks associated with building 03-0105	NFA Approved	EPA 2005, 088464	None
AOC C-03-022		Kerosene tanker trailer used to store and distribute kerosene for asphalt plant	Under Investigation	Work plan section 4.1.45	None
<b>TA-60</b>					
AOC 60-001(a)		Storage area on east side of building 60-0001	NFA Approved	EPA 2003, 087296	None
AOC 60-001(b)		Storage area in a metal shed, structure 60-0007, used to store paint and related-materials	NFA Approved	EPA 2005, 088464	None
AOC 60-001(c)		Satellite accumulation areas located at NTS test fabrication facility	NFA Approved	EPA 2005, 088464	None
AOC 60-001(d)		Storage area, located in a storage shed, structure 60-0029, east of NTS test fabrication facility	NFA Approved	EPA 2005, 088464	None

Table 1.1-1 (continued)

Site ID	Subunit	Brief Description	Site Status	Reference	Proposed Action
SWMU 60-002		Storage areas on Sigma Mesa (west, central, east)	Under Investigation	Work plan section 4.2.1	West- collect samples
AOC 60-003		Oil-water separator located northeast of building 60-0001 and used to collect liquid waste produced by a steam cleaning process	NFA Approved	EPA 2005, 088464	None
AOC 60-004(a)		Storage area that contained equipment and supplies such as wooden cables, light poles, and lumber posts.	NFA Approved	EPA 2005, 088464	None
AOC 60-004(b)		Storage area for 12 containers of diesel sludge	Under Investigation	Work plan section 4.2.2	Collect samples
AOC 60-004(d)		Storage area for dismantled underground storage tanks and contents	Under Investigation	Work plan section 4.2.3	Collect samples
AOC 60-004(f)		Storage area bermed and used for new product storage	Under Investigation	Work plan section 4.2.4	Collect samples
AOC 60-005(b)		Drilling mud pit used as a settling area to recycle water from spent mud	NFA Approved	EPA 2005, 088464	None
SWMU 60-006(a)		Septic system on Sigma Mesa	Under Investigation	Work plan section 4.2.5	Remove tank, collect samples
AOC 60-006(c)		Septic system on Sigma Mesa	NFA Approved	EPA 2005, 088464	None
SWMU 60-007(a)		Release, equipment stored leaked oil	Under Investigation	Work plan section 4.2.6	Collect samples
SWMU 60-007(b)		Release, storm drainage from motor pool building 03-0001	Under Investigation	Work plan section 4.2.7	Collect samples
AOC C-60-001		Former underground diesel fuel tank located near building 60-0001	NFA Approved	EPA 2005, 088464	None
AOC C-60-003		One-time spill of potable water from ruptured water line at pesticide shed, building 60-0029	NFA Approved	EPA 2005, 088464	None
AOC C-60-004		Former underground diesel storage tank located near building 60-0001	NFA Approved	EPA 2005, 088464	None

Table 1.1-1 (continued)

Site ID	Subunit	Brief Description	Site Status	Reference	Proposed Action
<b>TA-61</b>					
AOC 61-001		Transformer storage area—PCB only site located east of Radio Repair Shop 61-0023	NFA Approved	EPA 2005, 088464	None
SWMU 61-002		Transformer storage area—PCB only site located east of Radio Repair Shop 61-0023	Under Investigation	Work plan section 4.3.1	None
AOC 61-003		Burn site (nonexistent)	NFA Approved	EPA 2005, 088464	None
SWMU 61-004(a)		Septic tank located northeast of building 61-0023	Removed from Module VIII, HWFP	NMED 2001, 070010	None
AOC 61-004(c)		Former septic system at Los Alamos County landfill	NFA Approved	EPA 2005, 088464	None
SWMU 61-005		Landfill, County Subtitle D	Under Investigation	Work plan section 4.3.2	Delay characterization
SWMU 61-006		Waste oil tank, active, used oil recycling	Under Investigation	Work plan section 4.3.3	Delay characterization
AOC C-61-001		Leak from transformer storage area—PCB only site at building 61-0023,	NFA Approved	EPA 2005, 088464	None
AOC C-61-002		Subsurface contamination, potentially petroleum-based	Under Investigation	Work plan section 4.3.4	Collect samples

Note: Shading denotes sites approved for NFA.



**Table 2.3-1  
Industrial SSLs**

Chemical	Industrial SSL <sup>a</sup>
<b>Inorganic Chemicals (mg/kg)</b>	
Aluminum	100,000
Antimony	454
Arsenic	17.7
Barium	100,000
Beryllium	2250
Cadmium	564
Chromium (total)	5000 <sup>b</sup>
Chromium (hexavalent)	3400
Cobalt	20,500
Copper	45,400
Iron	100,000
Lead	800
Manganese	48,400
Mercury	340 <sup>c</sup>
Nickel	22,700
Selenium	5680
Silver	5680
Thallium	74.9
Vanadium	1140
Zinc	100,000
<b>Organic Chemicals (mg/kg)</b>	
Acenaphthene	33,500
Acetone	100,000
Anthracene	100,000
Benzene	25.8
Benzo(a)anthracene	23.4
Benzo(a)pyrene	2.34
Benzo(b)fluoranthene	23.4
Benzo(k)fluoranthene	234
Benzoic Acid	10,000
Bis(2-ethylhexyl) phthalate	1370
2-Butanone	48,700
n-Butylbenzene	62.1
tert-Butylbenzene	106
Carbon disulfide	460
Chrysene	2310
Dibenz(a,h)anthracene	2.34

Table 2.3-1 (continued)

Chemical	Industrial SSL <sup>a</sup>
Dibenzofuran	1620
1,4-Dichlorobenzene	103
Fluoranthene	24,400
Fluorene	26,500
Indeno(1,2,3-c,d)pyrene	23.4
Methylene chloride	490
Naphthalene	300
Phenanthrene	20,500
Phenol	100,000
Aroclor-1254	8.26
Aroclor-1260	8.26
n-Propylbenzene	62.1
Pyrene	30,900
Tetrachloroethene	31.6
Toluene	252
TPH-DRO	2000 <sup>d</sup>
TPH-GRO	2000 <sup>d</sup>
TPH-LRO	2000 <sup>d</sup>
1,1,1-Trichloroethane	563
Trichloroethylene	1.56
1,2,4-Trimethylbenzene	213
1,3,5-Trimethylbenzene	69.2
Xylenes	82
<b>Radionuclides (pCi/g)<sup>e</sup></b>	
Plutonium-239	210
Strontium-90	1900
Tritium	440,000
Uranium-234	1500
Uranium-235	87
Uranium-238	430

<sup>a</sup> SSLs from NMED 2006, 092513, unless otherwise noted.

<sup>b</sup> SSL from EPA Region 6 (EPA 2007, 099314).

<sup>c</sup> SSL from EPA Region 9 Preliminary Remediation Goals ([www.epa.gov/region09/waste/sfund/prg](http://www.epa.gov/region09/waste/sfund/prg)).

<sup>d</sup> NMED 2006, 094614.

<sup>e</sup> Radionuclides from screening actions levels from LANL 2005, 088493.

**Table 4.0-1  
Proposed Sampling Description and Analyses**

Site	Sampling Justification	Depth (ft)	Media	TAL Metals (EPA SW-846:6010B/6020)	VOCs (EPA SW-846:8260B)	SVOCs (EPA SW-846:8270C)	TPH (EPA-8015B)	Pesticides (EPA SW-846:8081A)	PCBs (EPA SW-846:8082)	Nitrate (EPA 300)	Cyanide (EPA SW-846:9012A)	Perchlorate (EPA SW-846:6850)	Uranium, Plutonium, or Americium (HASL-300)	Tritium (EPA 906)
<b>TA-03</b>														
<b>SWMU 03-002(c)</b>	8 samples at 4 locations (based on historic results) will be collected to confirm Phase I RFI results and define extent of contamination (Figure 4.1-5)	0–1, soil/tuff interface	Soil, tuff	X <sup>a</sup>	X	X	— <sup>b</sup>	X	X	—	X	—	—	—
<b>SWMU 03-003(c)</b>	No sampling is proposed. Refer to section 4.1.2.	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>AOC 03-003(d)</b>	5 samples will be collected to confirm the absence of PCBs (Figure 4.1-12)	Surface	Concrete	—	—	—	—	—	X	—	—	—	—	—
	6 samples will be collected from 3 locations surrounding the concrete pad to determine if PCBs have migrated (Figure 4.1-12)	0–1, 1–2	Soil	—	—	—	—	—	X	—	—	—	—	—
<b>AOC 03-003(f)</b>	9 surface swipe samples will be collected to confirm the absence of PCBs (Figure 4.1-17)	Surface	—	—	—	—	—	—	X	—	—	—	—	—
<b>AOC 03-003(g)</b>	3 surface swipe samples to confirm if PCBs are present (Figure 4.1-17)	Surface	—	—	—	—	—	—	X	—	—	—	—	—
<b>AOC 03-003(o)</b>	No sampling is proposed. Refer to section 4.1.6.	—	—	—	—	—	—	—	—	—	—	—	—	—



Table 4.0-1 (continued)

Site	Sampling Justification	Depth (ft)	Media	TAL Metals (EPA SW-846:6010B/6020)	VOCs (EPA SW-846:8260B) <sup>a</sup>	SVOCS (EPA SW-846:8270C)	TPH (EPA-8015B)	Pesticides (EPA SW-846:8081A)	PCBs (EPA SW-846:8082)	Nitrate (EPA 300)	Cyanide (EPA SW-846:9012A)	Perchlorate (EPA SW-846:6850)	Uranium, Plutonium, or Americium (HASL-300)	Tritium (EPA 906)
<b>Consolidated Unit 03-009(a)-00</b>														
<b>SWMU 03-009(a)</b>	12 samples will be collected from 3 locations to determine the extent of contamination identified in previous sampling efforts	Soil/tuff interface, 9–10, 14–15, 19–20	Soil, tuff	X	X	X	DRO	—	—	—	X	—	—	—
	4 samples will be collected from 2 locations at 2 depths to define lateral extent of contamination (Figure 4.1-5)	0–1, 1–2		—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 03-028</b>	No sampling is proposed. Refer to section 4.1.7.2.	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 03-029</b>	6 samples will be collected from 2 locations to define nature and extent of contamination (Figure 4.1-22)	Soil/tuff interface, 4–5, 9–10	Soil, tuff	X	X	X	DRO	—	—	—	X	—	—	—
<b>SWMU 03-036(a)</b>	No sampling is proposed. Refer to section 4.1.7.4.	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 03-036(c)</b>	No sampling is proposed. Refer to section 4.1.7.5.	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 03-036(d)</b>	No sampling is proposed. Refer to section 4.1.7.6.	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>AOC 03-043(b)</b>	No sampling is proposed. Refer to section 4.1.7.7.	—	—	—	—	—	—	—	—	—	—	—	—	—

**Table 4.0-1 (continued)**

Site	Sampling Justification	Depth (ft)	Media	TAL Metals (EPA SW-846:6010B/6020)	VOCs (EPA SW-846:8260B) <sup>a</sup>	SVOCs (EPA SW-846:8270C)	TPH (EPA-8015B)	Pesticides (EPA SW-846:8081A)	PCBs (EPA SW-846:8082)	Nitrate (EPA 300)	Cyanide (EPA SW-846:9012A)	Perchlorate (EPA SW-846:6850)	Uranium, Plutonium, or Americium (HASL-300)	Tritium (EPA 906)
<b>AOC 03-043(d)</b>	No sampling is proposed for this AOC because it is a duplicate of SWMU 03-036(a). Refer to section 4.1.7.4.	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>AOC 03-043(h)</b>	No sampling is proposed for this AOC because it is a duplicate of SWMU 03-036(a). Refer to section 4.1.7.4.	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 03-045(g)</b>	6 samples will be collected from 3 locations to define the extent of contamination (Figure 4.1-24)	0–1, 1–2	Soil	X	X	X	GRO	—	—	—	X	—	—	—
<b>SWMU 03-009(i)</b>	8 grab samples will be collected from 4 test pits to characterize the material (Figure 4.1-28)	5, 10	Soil	X	X	X	DRO	—	—	—	X	—	—	—
	4 samples will be collected from 2 locations to define lateral extent. (Figure 4.1-28)	0–1, 1–2												
<b>Consolidated Unit 03-012(b)-00</b>														
<b>SWMU 03-012(b)</b>	8 samples will be collected from 4 locations along the drainage to establish a baseline for the active outfalls and to define the nature and extent of contamination (Figure 4.1-33)	0–1, 1–2	Sediment, soil	X	X	X	DRO	—	X	—	X	—	—	—
<b>SWMU 03-045(c)</b>														

Table 4.0-1 (continued)

Site	Sampling Justification	Depth (ft)	Media	TAL Metals (EPA SW-846:6010B/6020)	VOCs (EPA SW-846:8260B) <sup>a</sup>	SVOCs (EPA SW-846:8270C)	TPH (EPA-8015B)	Pesticides (EPA SW-846:8081A)	PCBs (EPA SW-846:8082)	Nitrate (EPA 300)	Cyanide (EPA SW-846:9012A)	Perchlorate (EPA SW-846:6850)	Uranium, Plutonium, or Americium (HASL-300)	Tritium (EPA 906)
<b>SWMU 03-014(q)</b>	6 samples will be collected from 3 locations to confirm previous results and characterize the site (Figure 4.1-33)	0–1, 1–2	Sediment, soil	X	—	—	—	—	X	—	—	—	—	—
<b>Consolidated Unit 03-013(a)-00</b>														
<b>SWMU 03-013(a)</b>	No sampling is proposed. Refer to section 4.1.10.1.	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 03-052(f)</b>	14 samples will be collected from 7 locations to determine the extent of contamination (Figure 4.1-39)	0–1, 1–2	Sediment, soil	X	X	X	DRO	—	X	—	X	X	X	—
<b>AOC 03-013(b)</b>	No sampling is proposed. Refer to section 4.1.11.	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 03-013(i)</b>	32 samples will be collected from 16 locations to determine the extent of contamination (Figure 4.1-43)	0–1, 4–5	—	X	X	X	DRO	—	X	—	X	—	—	—
<b>Consolidated Unit 03-014(a)-99</b>														
<b>SWMU 03-014(a)</b>	15 samples will be collected from 5 locations to confirm Phase I RFI results and define the extent of contamination, samples will bound 03-014 (a, b, e, and f) (Figure 4.1-48)	0–1, 1–2, soil/tuff interface	Soil, tuff	X	X	X	DRO	—	X	X	X	X	X	—
<b>SWMU 03-014(b)</b>														
<b>SWMU 03-014(e)</b>														
<b>SWMU 03-014(f)</b>														



**Table 4.0-1 (continued)**

Site	Sampling Justification	Depth (ft)	Media	TAL Metals (EPA SW-846:6010B/6020)	VOCs (EPA SW-846:8260B) <sup>a</sup>	SVOCs (EPA SW-846:8270C)	TPH (EPA-8015B)	Pesticides (EPA SW-846:8081A)	PCBs (EPA SW-846:8082)	Nitrate (EPA 300)	Cyanide (EPA SW-846:9012A)	Perchlorate (EPA SW-846:6850)	Uranium, Plutonium, or Americium (HASL-300)	Tritium (EPA 906)
<b>AOC 03-014(b2)</b>	10 samples will be collected from 5 locations to confirm Phase I RFI data (Figure 4.1-48)	0–1, 1–2	Soil, sediment	X	X	X	DRO	—	X	X	X	X	X	—
<b>SWMU 03-014(c)</b>	3 samples will be collected from 1 location between SWMU 03-014(c) and SWMU 03-014(g) to characterize the site (Figure 4.1-48)	Base of tank, soil/tuff interface, 5 ft below interface	Soil, tuff	X	X	X	DRO	—	X	X	X	X	X	—
<b>SWMU 03-014(g)</b>														
<b>AOC 03-014(c2)</b>	10 samples will be collected from 5 locations to characterize the drainage, confirm Phase I RFI results, and define the extent of contamination. (Figure 4.1-48)	0–1, 1–2	Soil, sediment	X	X	X	DRO	—	X	X	X	X	X	—
	4 samples will be collected from 2 locations in the northern SWMU polygon (Figure 4.1-48)	0–1, 2–3	Soil, sediment	X	X	X	DRO	—	X	X	X	X	X	—
<b>SWMU 03-014(d)</b>	9 samples will be collected from 3 locations characterize the sites (Figure 4.1-48)	Base of tank, soil/tuff interface, 5 ft below interface	Soil, tuff	X	X	X	DRO	—	X	X	X	X	X	—
<b>SWMU 03-014(h)</b>														

**Table 4.0-1 (continued)**

Site	Sampling Justification	Depth (ft)	Media	TAL Metals (EPA SW-846:6010B/6020)	VOCs (EPA SW-846:8260B) <sup>a</sup>	SVOCs (EPA SW-846:8270C)	TPH (EPA-8015B)	Pesticides (EPA SW-846:8081A)	PCBs (EPA SW-846:8082)	Nitrate (EPA 300)	Cyanide (EPA SW-846:9012A)	Perchlorate (EPA SW-846:6850)	Uranium, Plutonium, or Americium (HASL-300)	Tritium (EPA 906)
<b>SWMU 03-014(i)</b>	12 samples will be collected from 3 locations to characterize the site (Figure 4.1-48)	Base of structure, soil/tuff interface, 5 ft below interface	Soil, tuff	X	X	X	DRO	—	X	X	X	X	X	—
<b>SWMU 03-014(j)</b>	6 samples will be collected from 2 locations to define the nature and extent of contamination at the pump pit (Figure 4.1-48)	Base of structure, soil/tuff interface, 5 ft below interface	Soil, tuff	X	X	X	DRO	—	X	X	X	X	X	—
	2 samples will be collected from 1 location to define the nature and extent of contamination (Figure 4.1-48)	0–1, soil/tuff interface	Soil, tuff	X	X	X	DRO	—	X		X	X	X	—
<b>SWMU 03-014(k)</b>	10 samples will be collected from 5 locations to confirm the Phase I RFI investigation results and to define the vertical extent of contamination (Figure 4.1-48)	4–5, 6–7	Soil, tuff	X	X	X	DRO	—	X	X	X	X	X	X
<b>SWMU 03-014(l)</b>														
<b>SWMU 03-014(m)</b>	16 soil samples will be collected from 4 locations to bound the 4 SWMUs (Figure 4.1-48)	4–5, 6–7	Soil, tuff	X	X	X	DRO	—	X	X	X	X	X	X
<b>SWMU 03-014(n)</b>														

**Table 4.0-1 (continued)**

Site	Sampling Justification	Depth (ft)	Media	TAL Metals (EPA SW-846:6010B/6020)	VOCs (EPA SW-846:8260B) <sup>a</sup>	SVOCs (EPA SW-846:8270C)	TPH (EPA-8015B)	Pesticides (EPA SW-846:8081A)	PCBs (EPA SW-846:8082)	Nitrate (EPA 300)	Cyanide (EPA SW-846:9012A)	Perchlorate (EPA SW-846:6850)	Uranium, Plutonium, or Americium (HASL-300)	Tritium (EPA 906)
<b>SWMU 03-014(o)</b>	6 samples will be collected, 1 from sample location (03-03204) in the center bed and one from each of the other beds to define vertical extent of contamination (Figure 4.1-48)	4–5, 6–7	Soil, tuff	X	—	—	—	—	—	—	X	—	—	—
	16 samples will be collected from 4 locations to define the lateral and vertical extent of contamination (Figure 4.1-48)	0–1 bgs, 0–1 beneath sand and gravel layer at base of bed, bed/tuff interface, 5 ft below interface	Soil, tuff	X	X	X	DRO	—	X	X	X	X	X	—
<b>SWMU 03-014(p)</b>	No sampling is proposed. Refer to section 4.1.13.18.	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 03-014(u)</b>	9 samples will be collected from 3 locations to define the nature and extent of contamination (Figure 4.1-48)	0–1, base of structure, soil/tuff interface	Soil, tuff	X	X	X	DRO	—	X	X	X	X	X	—
<b>SWMU 03-056(d)</b>	2 samples will be collected from 1 location to define the nature and extent of contamination (Figure 4.1-48)	0–1, soil/tuff interface	Soil, tuff	X	X	X	DRO	—	X	—	X	—	—	—



**Table 4.0-1 (continued)**

Site	Sampling Justification	Depth (ft)	Media	TAL Metals (EPA SW-846:6010B/6020)	VOCs (EPA SW-846:8260B) <sup>a</sup>	SVOCs (EPA SW-846:8270C)	TPH (EPA-8015B)	Pesticides (EPA SW-846:8081A)	PCBs (EPA SW-846:8082)	Nitrate (EPA 300)	Cyanide (EPA SW-846:9012A)	Perchlorate (EPA SW-846:6850)	Uranium, Plutonium, or Americium (HASL-300)	Tritium (EPA 906)
<b>SWMU 03-014(r)</b>	No sampling is proposed. Refer to section 4.1.14.	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 03-014(s)</b>	No sampling is proposed. Refer to section 4.1.15.	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>AOC 03-014(v)</b>	No sampling is proposed. Refer to section 4.1.16.	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>AOC 03-014(y)</b>	No sampling is proposed. Refer to section 4.1.17.	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>Consolidated Unit 03-015-00</b>														
<b>SWMU 03-015</b>	16 samples will be collected from 8 locations to define the nature and extent of contamination (Figure 4.1-12)	0–1, 1–2	Soil, sediment	X	X	X	DRO	—	X	—	—	X	X	—
<b>AOC 03-053</b>														
<b>AOC C-03-016</b>	2 samples will be collected from 1 location to determine vertical extent (Figure 4.1-5)	17–18, 19–20	Soil, tuff	X	X	X	DRO, GRO	—	—	—	X	—	—	—
<b>SWMU 03-021</b>	4 samples will be collected from 2 locations to confirm the Phase I RFI investigation results and define the vertical extent of contamination (the samples will be collected from historic sampling locations 03-03331 and 03-03329 at greater depths) (Figure 4.1-28)	4–5, 6–7	Soil, tuff	X	—	—	—	—	—	—	X	—	—	—

**Table 4.0-1 (continued)**

Site	Sampling Justification	Depth (ft)	Media	TAL Metals (EPA SW-846:6010B/6020)	VOCs (EPA SW-846:8260B) <sup>a</sup>	SVOCs (EPA SW-846:8270C)	TPH (EPA-8015B)	Pesticides (EPA SW-846:8081A)	PCBs (EPA SW-846:8082)	Nitrate (EPA 300)	Cyanide (EPA SW-846:9012A)	Perchlorate (EPA SW-846:6850)	Uranium, Plutonium, or Americium (HASL-300)	Tritium (EPA 906)
<b>SWMU 03-021 (continued)</b>	12 samples will be collected from 6 locations to define the extent of contamination in the drainage (Figure 4.1-28)	0–1, 1–2	Soil	X	X	X	—	—	—	—	X	—	—	—
<b>AOC 03-027</b>	No sampling is proposed. Refer to section 4.1.21.	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>AOC 03-036(b)</b>	6 samples will be collected from 2 locations to confirm the results of the previous investigation (Figure 4.1-5)	14–15, 19–20, 24–25	Soil, tuff	X	X	X	DRO GRO	—	—	—	X	—	—	—
<b>SWMU 03-037</b>	No sampling is proposed. Refer to section 4.1.23.	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>AOC 03-038(c)</b>	4 samples will be collected from 2 locations characterize the site (Figure 4.1-53)	0–1, 1–2	Soil	X	—	—	—	—	—	—	X	—	—	—
<b>AOC 03-038(d)</b>	10 samples will be collected from 5 locations to characterize the site (Figure 4.1-55)	0–1, 1–2	Soil	X	—	—	—	—	—	—	X	—	—	—
<b>AOC 03-043(a)</b>	No sampling is proposed. Refer to section 4.1.26.	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>AOC 03-043(f)</b>	No sampling is proposed; this site is a duplicate of SWMU 03-036(c). Refer to section 4.1.7.5.	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>AOC 03-043(g)</b>	No sampling is proposed; this site is a duplicate of SWMU 03-036(d). Refer to section 4.1.7.6.	—	—	—	—	—	—	—	—	—	—	—	—	—

**Table 4.0-1 (continued)**

Site	Sampling Justification	Depth (ft)	Media	TAL Metals (EPA SW-846:6010B/6020)	VOCs (EPA SW-846:8260B) <sup>a</sup>	SVOCs (EPA SW-846:8270C)	TPH (EPA-8015B)	Pesticides (EPA SW-846:8081A)	PCBs (EPA SW-846:8082)	Nitrate (EPA 300)	Cyanide (EPA SW-846:9012A)	Perchlorate (EPA SW-846:6850)	Uranium, Plutonium, or Americium (HASL-300)	Tritium (EPA 906)
<b>SWMU 03-045(a)</b>	10 samples will be collected from 5 locations to confirm previous sampling results and define the nature and extent of contamination (Figure 4.1-33)	0–1, 1–2	Sediment, soil	X	X	X	DRO, LRO	—	X	—	X	—	—	—
<b>SWMU 03-045(e)</b>	8 samples will be collected from 4 locations to define the nature and extent of contamination (Figure 4.1-24)	0–1, 1–2	Soil	X	X	X	DRO	—	—	—	X	—	—	—
<b>SWMU 03-045(f)</b>	10 samples will be collected from 5 locations to determine the nature and extent of contamination (Figure 4.1-33)	0–1, 1–2	Sediment, soil	X	X	X	—	—	X	X	X	—	—	—
<b>SWMU 03-045(h)</b>	No sampling is proposed, however discharges will be sampled as part of AOC 03-052(b)]. Refer to section 4.1.37.	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>AOC 03-047(d)</b>	No sampling is proposed. Refer to section 4.1.34.	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>AOC 03-047(g)</b>	8 samples will be collected from 4 locations immediately adjacent to the concrete pad to define the nature and extent of contamination (Figure 4.1-12)	0–1, 1–2	Soil	X	X	X	DRO	—	X	X	X	X	—	—



**Table 4.0-1 (continued)**

Site	Sampling Justification	Depth (ft)	Media	TAL Metals (EPA SW-846:6010B/6020)	VOCs (EPA SW-846:8260B) <sup>a</sup>	SVOCs (EPA SW-846:8270C)	TPH (EPA-8015B)	Pesticides (EPA SW-846:8081A)	PCBs (EPA SW-846:8082)	Nitrate (EPA 300)	Cyanide (EPA SW-846:9012A)	Perchlorate (EPA SW-846:6850)	Uranium, Plutonium, or Americium (HASL-300)	Tritium (EPA 906)
<b>AOC 03-051(c)</b>	4 samples will be collected from 2 locations to confirm the effectiveness of the VCA (Figure 4.1-12)	2-3, 4-5	Soil	X	—	X	DRO	—	X	X	X	X	—	—
<b>AOC 03-052(b)</b>	4 samples will be collected from 2 locations near historical sampling locations 03-03291 and 03-03286 to define the extent of contamination (Figure 4.1-17)	7-8, 10-11	Soil, tuff	X	X	X	—	—	—	—	X	—	—	—
	20 samples will be collected from 10 locations to define extent of contamination (Figure 4.1-17)	1-2, 4-5	Soil	X	X	X	—	—	—	—	X	—	—	—
	6 samples will be collected from 3 locations to define extent of contamination (Figure 4.1-17)	1-2, 4-5	Soil	X	X	X	—	—	—	—	X	—	—	—
<b>SWMU 03-054(c)</b>	No sampling is proposed. Refer to section 4.1.38.	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 03-056(a)</b>	8 samples will be collected from 4 locations (2 along each side of concrete floor) to confirm previous investigation and extent (Figure 4.1-22)	0-1 beneath concrete, 1-2 beneath concrete	Soil	X	X	X	DRO	—	—	—	X	—	—	—
<b>SWMU 03-056(c)</b>	No sampling is proposed. Refer to section 4.1.40.	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>AOC 03-056(h)</b>	No sampling is proposed. Refer to section 4.1.41.	—	—	—	—	—	—	—	—	—	—	—	—	—

**Table 4.0-1 (continued)**

Site	Sampling Justification	Depth (ft)	Media	TAL Metals (EPA SW-846:6010B/6020)	VOCs (EPA SW-846:8260B) <sup>a</sup>	SVOCs (EPA SW-846:8270C)	TPH (EPA-8015B)	Pesticides (EPA SW-846:8081A)	PCBs (EPA SW-846:8082)	Nitrate (EPA 300)	Cyanide (EPA SW-846:9012A)	Perchlorate (EPA SW-846:6850)	Uranium, Plutonium, or Americium (HASL-300)	Tritium (EPA 906)
<b>AOC 03-056(k)</b>	9 samples will be collected from 3 locations south, west, and northeast of the above samples define extent of contamination (Figure 4.1-17)	0-1, 3-4, 6-7	Soil, tuff	X	X	X	-	-	-	-	X	-	X	-
	2 samples will be collected from 1 location at historical sampling location 03-03281 to define the extent of organic chemical contamination (Figure 4.1-17)	3-4, 6-7	Soil, tuff	-	X	X	-	-	-	-	-	-	-	-
	2 samples will be collected from historic location 03-03290 to define extent of contamination (Figure 4.1-17)	3-4, 6-7	Soil, tuff	X	X	X	-	-	-	-	X	-	X	-
	8 samples will be collected from 4 new locations (Figure 4.1-17)	1-2, 3-4	Soil, tuff	-	X	X	-	-	-	-	-	-	-	-
<b>SWMU 03-056(l)</b>	5 samples will be collected from the asphalt and 5 samples will be collected from soil beneath the asphalt confirm results of previous investigation (Figure 4.1-12)	Asphalt and 2-3 beneath the asphalt	Asphalt, soil	X	-	-	-	-	-	-	X	-	-	-
<b>Consolidated Unit 03-059-00</b>														
<b>AOC 03-003(n)</b>	8 samples will be collected from 4 locations along the outside of Building 03-0271 to confirm effectiveness of previous remedial activities. (Figure 4.1-22)	0-1, 1-2	Soil	-	-	-	-	-	X	-	-	-	-	-

**Table 4.0-1 (continued)**

Site	Sampling Justification	Depth (ft)	Media	TAL Metals (EPA SW-846:6010B/6020)	VOCs (EPA SW-846:8260B) <sup>a</sup>	SVOCs (EPA SW-846:8270C)	TPH (EPA-8015B)	Pesticides (EPA SW-846:8081A)	PCBs (EPA SW-846:8082)	Nitrate (EPA 300)	Cyanide (EPA SW-846:9012A)	Perchlorate (EPA SW-846:6850)	Uranium, Plutonium, or Americium (HASL-300)	Tritium (EPA 906)
<b>SWMU 03-059</b>	34 samples will be collected from 17 locations beneath the asphalt (Figure 4.1-22)	0–1, 2–3	Soil	X	X	X	DRO	—	X	X	X	X	—	—
<b>AOC C-03-022</b>	No sampling is proposed. Refer to section 4.1.45.	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>TA-60</b>														
<b>SWMU 60-002</b>	24 samples will be collected from 6 boreholes to investigate nature and extent of contamination at the western portion of the SWMU (Figure 4.2-5) No sampling is proposed for the central and eastern portions. Refer to section 4.2.1.	0–1, 4–5, 9–10, 16–17	Soil, tuff	X	X	X	DRO, GRO	—	X	—	X	—	—	—
<b>AOC 60-004(b)</b>	25 samples will be collected from 5 boreholes to determine the nature and extent of contamination (Figure 4.2-14)	0–1, 2–3, 4–5, 9–10, 14–15	Soil, tuff	X	X	X	DRO	—	—	—	X	—	—	—
<b>AOC 60-004(d)</b>														
<b>AOC 60-004(f)</b>	20 samples will be collected from 5 boreholes to define the nature and extent of contamination (Figure 4.2-5)	0–1, 2–3, 4–5, 9–10	Soil, tuff	X	X	X	DRO	—	—	—	X	—	—	—



**Table 4.0-1 (continued)**

Site	Sampling Justification	Depth (ft)	Media	TAL Metals (EPA SW-846:6010B/6020)	VOCs (EPA SW-846:8260B) <sup>a</sup>	SVOCs (EPA SW-846:8270C)	TPH (EPA-8015B)	Pesticides (EPA SW-846:8081A)	PCBs (EPA SW-846:8082)	Nitrate (EPA 300)	Cyanide (EPA SW-846:9012A)	Perchlorate (EPA SW-846:6850)	Uranium, Plutonium, or Americium (HASL-300)	Tritium (EPA 906)
<b>SWMU 60-006(a)</b>	9 confirmatory samples will be collected from 3 boreholes around the former location of the tank to characterize the site (Figure 4.2-9)	5-6, 9-10, 14-15	Soil, tuff	X	X	X	—	—	X	X	X	X	X	—
	4 samples will be collected from 1 borehole in the seepage pit to define the nature and vertical extent of contamination (Figure 4.2-9)	2-3, 5-6, 9-10, 14-15	Soil, tuff	X	X	X	—	—	—	—	X	—	—	—
<b>SWMU 60-007(a)</b>	12 samples will be collected from 4 locations to confirm effectiveness of remedial activities (Figure 4.2-14)	0-1, 2-3, 4-5	Soil	X	X	X	DRO	—	X	—	X	—	—	—
<b>SWMU 60-007(b)</b>	24 samples will be collected from 12 locations within the drainage to define the nature and extent of contamination (Figure 4.2-19)	0-1, 1-2	Sediment	X	X	X	DRO	—	X	—	X	—	—	—
<b>TA-61</b>														
<b>SWMU 61-002</b>	No sampling is proposed. Refer to section 4.3.1	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 61-005</b>	No sampling is proposed. Refer to section 4.3.2	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 61-006</b>	No sampling is proposed. Refer to section 4.3.3	—	—	—	—	—	—	—	—	—	—	—	—	—

**Table 4.0-1 (continued)**

Site	Sampling Justification	Depth (ft)	Media	TAL Metals (EPA SW-846:6010B/6020)	VOCs (EPA SW-846:8260B) <sup>a</sup>	SVOCs (EPA SW-846:8270C)	TPH (EPA-8015B)	Pesticides (EPA SW-846:8081A)	PCBs (EPA SW-846:8082)	Nitrate (EPA 300)	Cyanide (EPA SW-846:9012A)	Perchlorate (EPA SW-846:6850)	Uranium, Plutonium, or Americium (HASL-300)	Tritium (EPA 906)
<b>AOC C-61-002</b>	30 samples will be collected from 5 boreholes to define the nature and extent of contamination (Figure 4.3-2)	3-4, 5-6, 7-8, 9-10, 11-12, 14-15	Soil/tuff	X	X	X	DRO	—	—	—	X	—	—	—

Note: Shading indicates the SWMU or AOC is part of a consolidated unit.

<sup>a</sup> X = Analysis proposed.

<sup>b</sup> — = Analysis will not be performed.

**Table 4.0-2  
Analytical Methods for Surface and Subsurface Characterization**

Analytical Method	Analytical Description	Analytical Suite
<b>Inorganic Methods</b>		
EPA Method 300	Ion chromatography	Anions (nitrates)
EPA SW-846: 9012A	Colorimetric	Cyanide
EPA SW-846: 6010B/6020	Inductively Coupled Plasma Emission Spectrometry— Atomic Emission Spectroscopy	Aluminum, antimony, arsenic, barium, beryllium, boron, calcium, cadmium, cobalt, chromium, copper, iron, lead, lithium, magnesium, manganese, nickel, potassium, selenium, silicon, sodium, silver, thallium, titanium, uranium, vanadium, and zinc (TAL metals)
EPA SW-846: 6850	Liquid Chromatography/Mass Spectrometry	Perchlorate
<b>Organic Methods</b>		
EPA SW-846:8270C	Gas Chromatograph/Mass Spectrometry	SVOCs
EPA SW-846:8260B	Gas Chromatograph/Mass Spectrometry	VOCs
EPA SW-846:8082	Gas Chromatograph	PCBs
EPA SW-846:8081A	Gas Chromatograph	Organochlorinated pesticides
EPA SW-846:8015B	Gas Chromatograph	TPH-DRO
<b>Radionuclide Methods</b>		
HASL-300	Chemical Separation/Alpha Spectroscopy	Isotopic plutonium, isotopic uranium, americium-241
EPA 906	Liquid Scintillation	Tritium



March 2008

208

EP2008-0139

**Table 4.1-1  
Decision-Level Data from TA-03 Site Samples Collected and Analyses Requested**

Sample Id	Location Id	Depth (ft)	Media	Chromium Hexavalent Ion	Gamma Spectroscopy	Gross Alpha/Beta Radiation	Herbicides	Isotopic Plutonium	Isotopic Uranium	Metals	PCBs	Pesticides	Strontium-90	SVOCs	TPH-DRO	TPH-GRO	Tritium	VOCs
<b>SWMU 03-003(c)</b>																		
RC03-01-0012	03-14454	0.0–0.25	Debris	—*	—	—	—	—	—	—	9441R	—	—	—	—	—	—	—
RC03-01-0013	03-14455	0.0–0.25	Debris	—	—	—	—	—	—	—	9441R	—	—	—	—	—	—	—
RC03-01-0014	03-14456	0.0–0.25	Debris	—	—	—	—	—	—	—	9441R	—	—	—	—	—	—	—
RC03-01-0015	03-14457	0.33–0.5	Fill	—	—	—	—	—	—	—	9441R	—	—	—	—	—	—	—
RC03-01-0016	03-14458	0.33–0.5	Fill	—	—	—	—	—	—	—	9441R	—	—	—	—	—	—	—
RC03-01-0017	03-14459	0.33–0.5	Fill	—	—	—	—	—	—	—	9441R	—	—	—	—	—	—	—
<b>Consolidated Unit 03-009(a)-00</b>																		
<b>SWMU 03-009(a)</b>																		
RE03-03-52417	03-22537	4.5–5.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52422	03-22538	14.5–15.0	Fill	—	—	—	—	—	—	1886S	—	—	—	1886S	1886S	1886S	—	1886S
RE03-03-52423	03-22538	19.5–20.0	Qbt 4	—	—	—	—	—	—	1892S	—	—	—	1892S	1892S	1892S	—	1892S
RE03-03-52427	03-22539	4.0–5.0	Qbt 4	—	—	—	—	—	—	1886S	—	—	—	1886S	1886S	1886S	—	1886S
RE03-03-52429	03-22539	19.5–20.0	Qbt 4	—	—	—	—	—	—	1886S	—	—	—	1886S	1886S	1886S	—	1886S
<b>SWMU 03-028</b>																		
RE03-03-52348	03-22523	5.0–5.5	Soil	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52351	03-22523	19.0–19.5	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52352	03-22524	7.5–8.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52354	03-22524	19.5–20.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
<b>SWMU 03-036(a)</b>																		
RE03-03-52357	03-22525	8.0–8.5	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52359	03-22525	19.5–20.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
<b>SWMU 03-036(c)</b>																		
RE03-03-52362	03-22526	3.0–4.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52365	03-22526	19.5–20.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
<b>SWMU 03-036(d)</b>																		
RE03-03-52368	03-22527	4.5–5.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
<b>AOC 03-043(b)</b>																		
RE03-03-52372	03-22528	9.5–10.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52374	03-22528	19.5–20.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52419	03-22537	19.5–20.0	Qbt 4	—	—	—	—	—	—	1892S	—	—	—	1892S	1892S	1892S	—	1892S

Table 4.1-1 (continued)

Sample Id	Location Id	Depth (ft)	Media	Chromium Hexavalent Ion	Gamma Spectroscopy	Gross Alpha/Beta Radiation	Herbicides	Isotopic Plutonium	Isotopic Uranium	Metals	PCBs	Pesticides	Strontium-90	SVOCs	TPH-DRO	TPH-GRO	Tritium	VOCs
<b>SWMU 03-045(g)</b>																		
RE03-03-52407	03-22535	0.0–0.5	Sediment	—	—	—	—	—	—	1886S	—	—	—	1886S	1886S	1886S	—	1886S
RE03-03-52408	03-22535	1.5–2.0	Sediment	—	—	—	—	—	—	1886S	—	—	—	1886S	1886S	1886S	—	1886S
RE03-03-52412	03-22536	0.0–0.5	Sediment	—	—	—	—	—	—	1886S	—	—	—	1886S	1886S	1886S	—	1886S
RE03-03-52413	03-22536	1.5–2.0	Sediment	—	—	—	—	—	—	1886S	—	—	—	1886S	1886S	1886S	—	1886S
<b>Consolidated Unit 03-012(b)-00</b>																		
<b>03-012(b)-00</b>																		
RE03-02-49270	03-02-21036	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49284	03-02-21036	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49271	03-02-21037	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49285	03-02-21037	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49272	03-02-21038	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49286	03-02-21038	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49273	03-02-21039	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49287	03-02-21039	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49274	03-02-21040	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49288	03-02-21040	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49275	03-02-21041	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49289	03-02-21041	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49276	03-02-21042	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49290	03-02-21042	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49277	03-02-21043	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49291	03-02-21043	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49278	03-02-21044	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49292	03-02-21044	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49279	03-02-21045	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49293	03-02-21045	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49280	03-02-21046	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49294	03-02-21046	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49281	03-02-21047	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49295	03-02-21047	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49282	03-02-21048	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49296	03-02-21048	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49283	03-02-21049	0.0–0.5	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49297	03-02-21049	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—



Table 4.1-1 (continued)

Sample Id	Location Id	Depth (ft)	Media	Chromium Hexavalent Ion	Gamma Spectroscopy	Gross Alpha/Beta Radiation	Herbicides	Isotopic Plutonium	Isotopic Uranium	Metals	PCBs	Pesticides	Strontium-90	SVOCs	TPH-DRO	TPH-GRO	Tritium	VOCs
RE03-02-49298	03-02-21050	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49299	03-02-21051	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49300	03-02-21052	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-02-49301	03-02-21053	0.5–1.0	Fill	1199S	—	—	—	—	—	1199S	—	—	—	—	—	—	—	—
RE03-04-52775	03-22576	0.0–0.5	Soil	1954S	—	—	—	—	—	1954S	1953S	—	—	—	—	—	—	—
RE03-04-52785	03-22576	3.5–4.0	Soil	1954S	—	—	—	—	—	1954S	—	—	—	—	—	—	—	—
RE03-04-52776	03-22577	0.0–0.5	Soil	1954S	—	—	—	—	—	1954S	—	—	—	—	—	—	—	—
RE03-04-52786	03-22577	3.0–3.5	Soil	1954S	—	—	—	—	—	1954S	—	—	—	—	—	—	—	—
RE03-04-52777	03-22578	0.0–0.5	Soil	1954S	—	—	—	—	—	1954S	1953S	—	—	—	—	—	—	—
RE03-04-52787	03-22578	3.5–4.0	Soil	1954S	—	—	—	—	—	1954S	—	—	—	—	—	—	—	—
RE03-04-52778	03-22579	0.0–0.5	Soil	1954S	—	—	—	—	—	1954S	—	—	—	—	—	—	—	—
RE03-04-52788	03-22579	3.5–4.0	Soil	1954S	—	—	—	—	—	1954S	—	—	—	—	—	—	—	—
RE03-04-52779	03-22580	0.0–0.5	Soil	1961S	—	—	—	—	—	1961S	1960S	—	—	—	—	—	—	—
RE03-04-52789	03-22580	3.5–4.0	Soil	1961S	—	—	—	—	—	1961S	—	—	—	—	—	—	—	—
RE03-04-52781	03-22582	0.83–1.33	Soil	1959S	—	—	—	—	—	1959S	1958S	—	—	—	—	—	—	—
RE03-04-52791	03-22582	1.83–2.83	Soil	1959S	—	—	—	—	—	1959S	—	—	—	—	—	—	—	—
RE03-04-52782	03-22583	0.0–0.5	Soil	1959S	—	—	—	—	—	1959S	—	—	—	—	—	—	—	—
RE03-04-52792	03-22583	3.5–4.0	Soil	1959S	—	—	—	—	—	1959S	—	—	—	—	—	—	—	—
RE03-04-52783	03-22584	0.0–0.5	Soil	1959S	—	—	—	—	—	1959S	1958S	—	—	—	—	—	—	—
RE03-04-52793	03-22584	3.5–4.0	Soil	1959S	—	—	—	—	—	1959S	—	—	—	—	—	—	—	—
RE03-04-52784	03-22585	0.0–0.5	Soil	1959S	—	—	—	—	—	1959S	—	—	—	—	—	—	—	—
RE03-04-52794	03-22585	3.5–4.0	Soil	1959S	—	—	—	—	—	1959S	—	—	—	—	—	—	—	—
<b>SWMU 03-013(i)</b>																		
RE03-05-59527	03-24444	0.0–0.5	Fill	—	—	—	—	—	—	3193S	3192S	—	—	3192S	3192S	3192S	—	—
RE03-05-59528	03-24444	1.5–1.5	Fill	—	—	—	—	—	—	3193S	3192S	—	—	3192S	3192S	3192S	—	3192S
RE03-05-59529	03-24445	0.0–0.5	Fill	—	—	—	—	—	—	3193S	3192S	—	—	3192S	3192S	3192S	—	—
RE03-05-59530	03-24445	1.5–1.5	Fill	—	—	—	—	—	—	3193S	3192S	—	—	3192S	3192S	3192S	—	3192S
RE03-05-59531	03-24446	0.0–0.5	Fill	—	—	—	—	—	—	3195S	3194S	—	—	3194S	3194S	3194S	—	—
RE03-05-59532	03-24446	1.5–1.5	Fill	—	—	—	—	—	—	3195S	3194S	—	—	3194S	3194S	3194S	—	3194S
RE03-05-59533	03-24447	0.0–0.5	Fill	—	—	—	—	—	—	3193S	3192S	—	—	3192S	3192S	3192S	—	—
RE03-05-59534	03-24447	1.5–1.5	Fill	—	—	—	—	—	—	3193S	3192S	—	—	3192S	3192S	3192S	—	3192S
RE03-05-59535	03-24448	0.0–0.5	Fill	—	—	—	—	—	—	3193S	3192S	—	—	3192S	3192S	3192S	—	—
RE03-05-59536	03-24448	1.5–1.5	Fill	—	—	—	—	—	—	3193S	3192S	—	—	3192S	3192S	3192S	—	3192S
RE03-05-59537	03-24449	0.0–0.5	Fill	—	—	—	—	—	—	3193S	3192S	—	—	3192S	3192S	3192S	—	—
RE03-05-59538	03-24449	1.5–1.5	Fill	—	—	—	—	—	—	3193S	3192S	—	—	3192S	3192S	3192S	—	3192S

Table 4.1-1 (continued)

Sample Id	Location Id	Depth (ft)	Media	Chromium Hexavalent Ion	Gamma Spectroscopy	Gross Alpha/Beta Radiation	Herbicides	Isotopic Plutonium	Isotopic Uranium	Metals	PCBs	Pesticides	Strontium-90	SVOCs	TPH-DRO	TPH-GRO	Tritium	VOCs
RE03-05-59539	03-24450	0.0–0.5	Fill	—	—	—	—	—	—	3193S	3192S	—	—	3192S	3192S	3192S	—	—
RE03-05-59540	03-24450	1.5–1.5	Fill	—	—	—	—	—	—	3193S	3192S	—	—	3192S	3192S	3192S	—	3192S
RE03-05-59541	03-24451	0.0–0.5	Fill	—	—	—	—	—	—	3195S	3194S	—	—	3194S	3194S	3194S	—	—
RE03-05-59542	03-24451	1.5–1.5	Fill	—	—	—	—	—	—	3195S	3194S	—	—	3194S	3194S	3194S	—	3194S
<b>Consolidated Unit 03-014(a)-99</b>																		
<b>SWMU 03-014(k)</b>																		
0103-97-0011	03-03264	0.0–1.0	Fill	—	—	—	3375R	3377R	3377R	3376R	3375R	3375R	3377R	3375R	—	—	3377R	—
0103-97-0012	03-03264	1.33–2.33	Qbt 4	—	—	—	3375R	3377R	3377R	3376R	3375R	3375R	3377R	3375R	—	—	3377R	—
0103-97-0013	03-03264	2.33–3.33	Qbt 4	—	—	—	3375R	3377R	3377R	3376R	3375R	3375R	3377R	3375R	—	—	3377R	3375R
<b>SWMU 03-014(l)</b>																		
0103-97-0014	03-03265	0.0–1.17	Fill	—	—	—	3375R	3377R	3377R	3376R	3375R	3375R	3377R	3375R	—	—	3377R	—
0103-97-0015	03-03265	1.67–2.67	Qbt 4	—	—	—	3375R	3377R	3377R	3376R	3375R	3375R	3377R	3375R	—	—	3377R	—
0103-97-0016	03-03265	2.67–3.67	Qbt 4	—	—	—	3375R	3377R	3377R	3376R	3375R	3375R	3377R	3375R	—	—	3377R	3375R
<b>SWMU 03-014(m)</b>																		
0103-97-0017	03-03266	0.0–0.17	Fill	—	—	—	3375R	3377R	3377R	3376R	3375R	3375R	3377R	3375R	—	—	3377R	—
0103-97-0018	03-03266	0.75–1.75	Qbt 4	—	—	—	3375R	3377R	3377R	3376R	3375R	3375R	3377R	3375R	—	—	3377R	—
0103-97-0019	03-03266	1.75–2.75	Qbt 4	—	—	—	3375R	3377R	3377R	3376R	3375R	3375R	3377R	3375R	—	—	3377R	3375R
0103-97-0363	03-03386	0.0–0.5	Fill	—	—	—	—	—	—	—	4002R	—	—	4002R	—	—	—	—
0103-97-0362	03-03386	0.5–1.0	Fill	—	—	—	—	—	—	—	4002R	—	—	4002R	—	—	—	—
0103-97-0361	03-03386	0.67–1.0	Fill	—	—	—	—	—	—	—	4002R	—	—	4002R	—	—	—	—
0103-97-0367	03-03387	0.0–0.5	Fill	—	—	—	—	—	—	—	4002R	—	—	4002R	—	—	—	—
0103-97-0366	03-03387	0.5–1.0	Fill	—	—	—	—	—	—	—	4002R	—	—	4002R	—	—	—	—
0103-97-0365	03-03387	1.0–1.5	Fill	—	—	—	—	—	—	—	4002R	—	—	4002R	—	—	—	—
0103-97-0364	03-03387	1.5–2.0	Fill	—	—	—	—	—	—	—	4002R	—	—	4002R	—	—	—	—
<b>SWMU 03-014(n)</b>																		
0103-97-0020	03-03201	0.0–1.58	Fill	—	—	—	3433R	3435R	3435R	3434R	—	3433R	3435R	3433R	3433R	—	3435R	3433R
0103-97-0021	03-03201	1.58–2.58	Qbt 4	—	—	—	3433R	3435R	3435R	3434R	—	3433R	3435R	3433R	3433R	—	3435R	3433R
0103-97-0022	03-03201	2.58–3.58	Qbt 4	—	—	—	3433R	3435R	3435R	3434R	—	3433R	3435R	3433R	3433R	—	3435R	3433R
0103-97-0023	03-03202	0.0–0.33	Fill	—	—	—	3433R	—	—	3434R	—	3433R	—	3433R	3433R	—	—	3433R
0103-97-0341	03-603357	0.0–0.5	Sludge	—	—	—	—	—	—	—	—	—	—	—	3721R	—	—	—
0103-97-0343	03-603357	0.0–0.5	Soil	—	—	—	—	—	—	—	—	—	—	—	3721R	—	—	—
0103-97-0345	03-603357	0.0–0.5	Fill	—	—	—	—	—	—	—	—	—	—	—	3721R	—	—	—
0103-97-0347	03-603357	0.0–0.5	Fill	—	—	—	—	—	—	—	—	—	—	—	3721R	—	—	—
<b>SWMU 03-014(o)</b>																		
0103-97-0024	03-03203	0.0–0.5	Fill	—	—	—	3444R	3446R	3446R	3445R	3444R	3444R	3446R	3444R	—	—	—	—

Table 4.1-1 (continued)

Sample Id	Location Id	Depth (ft)	Media	Chromium Hexavalent Ion	Gamma Spectroscopy	Gross Alpha/Beta Radiation	Herbicides	Isotopic Plutonium	Isotopic Uranium	Metals	PCBs	Pesticides	Strontium-90	SVOCs	TPH-DRO	TPH-GRO	Tritium	VOCs
0103-97-0025	03-03203	1.5–2.5	Qbt 4	—	—	—	3444R	3446R	3446R	3445R	3444R	3444R	3446R	3444R	—	—	3446R	—
0103-97-0026	03-03203	2.5000–3.5	Qbt 4	—	—	—	3444R	3446R	3446R	3445R	3444R	3444R	3446R	3444R	—	—	3446R	3444R
0103-97-0027	03-03204	0.0–0.83	Fill	—	—	—	3444R	3446R	3446R	3445R	3444R	3444R	3446R	3444R	—	—	3446R	—
0103-97-0028	03-03204	1.75–2.75	Qbt 4	—	—	—	3444R	3446R	3446R	3445R	3444R	3444R	3446R	3444R	—	—	3446R	—
0103-97-0029	03-03204	2.75–3.75	Qbt 4	—	—	—	3444R	3446R	3446R	3445R	3444R	3444R	3446R	3444R	—	—	3446R	3444R
0103-97-0030	03-03205	0.0–0.75	Fill	—	—	—	3444R	3446R	3446R	3445R	3444R	3444R	3446R	3444R	—	—	3446R	—
0103-97-0031	03-03205	1.25–2.25	Qbt 4	—	—	—	3444R	3446R	3446R	3445R	3444R	3444R	3446R	3444R	—	—	3446R	—
0103-97-0032	03-03205	2.25–3.25	Qbt 4	—	—	—	3444R	3446R	3446R	3445R	3444R	3444R	3446R	3444R	—	—	3446R	3444R
<b>AOC 03-014(v)</b>																		
RE03-99-2004	03-14227	3.0–3.5	Fill	—	—	—	—	—	—	5825R	5824R	—	—	—	5824R	5824R	—	5824R
RE03-99-2005	03-14227	4.0–4.5	Fill	—	—	—	—	—	—	5825R	5824R	—	—	—	5824R	5824R	—	5824R
<b>Consolidated Unit 03-015-00</b>																		
<b>SWMU 03-015</b>																		
AAB5813	03-02004	0.0–1.5	Sediment	—	20229	20229, 20957	—	—	—	20215	—	—	—	—	—	—	20229, 20957	—
<b>AOC C-03-016</b>																		
RE03-03-52397	03-22533	1.0–1.5	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52398	03-22533	16.0–16.5	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52402	03-22534	4.0–5.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52403	03-22534	9.5–10.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52405	03-22534	19.5–20.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
<b>SWMU 03-021</b>																		
0103-97-0241	03-03326	0.0–1.0	Soil	—	—	—	—	—	—	3429R	—	—	—	3428R	—	—	—	—
0103-97-0242	03-03327	2.0–3.0	Soil	—	—	—	—	—	—	3429R	—	—	—	3428R	—	—	—	—
0103-97-0243	03-03327	3.0–4.0	Soil	—	—	—	—	—	—	3429R	—	—	—	3428R	—	—	—	—
0103-97-0244	03-03328	3.0–4.0	Soil	—	—	—	—	—	—	3429R	—	—	—	3428R	—	—	—	3427R
0103-97-0245	03-03328	4.0–5.0	Soil	—	—	—	—	—	—	3429R	—	—	—	3428R	—	—	—	—
0103-97-0246	03-03329	2.0–3.0	Soil	—	—	—	—	—	—	3429R	—	—	—	3428R	—	—	—	—
0103-97-0247	03-03329	3.0–4.0	Soil	—	—	—	—	—	—	3429R	—	—	—	3428R	—	—	—	—
0103-97-0248	03-03330	2.75–3.75	Soil	—	—	—	—	—	—	3429R	—	—	—	3428R	—	—	—	—
0103-97-0251	03-03330	3.75–4.25	Soil	—	—	—	—	—	—	3429R	—	—	—	3428R	—	—	—	—
0103-97-0249	03-03331	3.0–4.0	Soil	—	—	—	—	—	—	3429R	—	—	—	3428R	—	—	—	—
0103-97-0250	03-03331	4.0–5.0	Soil	—	—	—	—	—	—	3429R	—	—	—	3428R	—	—	—	—



Table 4.1-1 (continued)

Sample Id	Location Id	Depth (ft)	Media	Chromium Hexavalent Ion	Gamma Spectroscopy	Gross Alpha/Beta Radiation	Herbicides	Isotopic Plutonium	Isotopic Uranium	Metals	PCBs	Pesticides	Strontium-90	SVOCs	TPH-DRO	TPH-GRO	Tritium	VOCs
<b>AOC 03-027</b>																		
RE03-99-2000	03-14225	7.0–7.5	Fill	—	—	—	—	—	—	5825R	5824R	—	—	—	5824R	5824R	—	5824R
RE03-99-2001	03-14225	7.5–8.0	Fill	—	—	—	—	—	—	5825R	5824R	—	—	—	5824R	5824R	—	5824R
RE03-99-2212	03-14225	9.0–9.5	Qbt 3	—	—	—	—	—	—	—	—	—	—	—	6108R	—	—	—
RE03-99-2002	03-14226	7.0–7.5	Fill	—	—	—	—	—	—	5825R	5824R	—	—	—	5824R	5824R	—	5824R
RE03-99-2003	03-14226	7.5–8.0	Fill	—	—	—	—	—	—	5825R	5824R	—	—	—	5824R	5824R	—	5824R
RE03-99-2006	03-14228	7.5–8.0	Fill	—	—	—	—	—	—	5825R	5824R	—	—	—	5824R	5824R	—	5824R
RE03-99-2007	03-14229	7.5–8.0	Fill	—	—	—	—	—	—	5825R	5824R	—	—	—	5824R	5824R	—	5824R
RE03-99-2213	03-14230	8.5–9.0	Qbt 3	—	—	—	—	—	—	—	—	—	—	—	6108R	—	—	—
RE03-99-2214	03-14231	8.5–9.0	Qbt 3	—	—	—	—	—	—	—	—	—	—	—	6108R	—	—	—
<b>AOC 03-036(b)</b>																		
RE03-03-52377	03-22529	11.0–11.5	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52378	03-22529	14.5–15.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52379	03-22529	19.5–20.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52382	03-22530	10.0–11.0	Soil	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52383	03-22530	14.5–15.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
RE03-03-52384	03-22530	19.5–20.0	Qbt 4	—	—	—	—	—	—	1885S	—	—	—	1885S	1885S	1885S	—	1885S
<b>AOC 03-052(b)</b>																		
0103-97-0163	03-03285	0.0–1.0	Soil	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0164	03-03285	2.0–3.0	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	3408R
0103-97-0165	03-03286	0.0–1.0	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0166	03-03286	1.0–2.0	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0167	03-03287	0.0–1.0	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0168	03-03287	1.0–2.0	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0169	03-03288	0.0–1.0	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0170	03-03288	1.0–2.0	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0175	03-03291	0.0–1.0	Soil	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0176	03-03291	4.0–5.0	Soil	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0177	03-03292	0.0–0.67	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
<b>SWMU 03-054(c)</b>																		
RC03-01-0029	03-14470	6.0–6.5	Fill	9516R	—	—	—	—	—	9516R	—	—	—	—	—	—	—	—
RC03-01-0031	03-14472	6.0–6.5	Fill	9516R	—	—	—	—	—	9516R	—	—	—	—	—	—	—	—
RC03-01-0032	03-14473	5.0–5.5	Fill	9516R	—	—	—	—	—	9516R	—	—	—	—	—	—	—	—
RC03-01-0033	03-14474	8.0–8.5	Fill	9516R	—	—	—	—	—	9516R	—	—	—	—	—	—	—	—
RC03-01-0034	03-14475	7.0–7.5	Soil	9516R	—	—	—	—	—	9516R	—	—	—	—	—	—	—	—

Table 4.1-1 (continued)

Sample Id	Location Id	Depth (ft)	Media	Chromium Hexavalent Ion	Gamma Spectroscopy	Gross Alpha/Beta Radiation	Herbicides	Isotopic Plutonium	Isotopic Uranium	Metals	PCBs	Pesticides	Strontium-90	SVOCs	TPH-DRO	TPH-GRO	Tritium	VOCs
RC03-01-0036	03-14477	2.0–2.5	Soil	9516R	—	—	—	—	—	9516R	—	—	—	—	—	—	—	—
RC03-01-0037	03-14478	2.0–2.5	Soil	9516R	—	—	—	—	—	9516R	—	—	—	—	—	—	—	—
RC03-01-0038	03-14479	2.0–2.5	Soil	9516R	—	—	—	—	—	9516R	—	—	—	—	—	—	—	—
RE03-04-53103	03-22683	0.0–0.5	Fill	—	—	—	—	—	—	2039S	—	—	—	—	—	—	—	—
RE03-04-53104	03-22683	1.5–2.0	Fill	—	—	—	—	—	—	2039S	—	—	—	—	—	—	—	—
RE03-04-53108	03-22684	0.0–0.5	Fill	—	—	—	—	—	—	2039S	—	—	—	—	—	—	—	—
RE03-04-53109	03-22684	1.5–2.0	Fill	—	—	—	—	—	—	2039S	—	—	—	—	—	—	—	—
RE03-04-53110	03-22685	0.0–0.5	Fill	—	—	—	—	—	—	2039S	—	—	—	—	—	—	—	—
RE03-04-53111	03-22685	1.5–2.0	Fill	—	—	—	—	—	—	2039S	—	—	—	—	—	—	—	—
<b>SWMU 03-056(a)</b>																		
RC03-01-0041	03-14481	0.5–1.0	Fill	—	—	—	—	—	—	9433R	—	—	—	—	9432R	—	—	—
RC03-01-0042	03-14482	0.5–1.0	Fill	—	—	—	—	—	—	9433R	—	—	—	—	9432R	—	—	—
RC03-01-0043	03-14483	0.5–1.0	Fill	—	—	—	—	—	—	9433R	—	—	—	—	9432R	—	—	—
RC03-01-0044	03-14484	0.5–1.0	Fill	—	—	—	—	—	—	9433R	—	—	—	—	9432R	—	—	—
RC03-01-0046	03-14485	0.0–0.5	Debris	—	—	—	—	—	—	9433R	—	—	—	—	—	—	—	—
RC03-01-0047	03-14486	0.0–0.5	Debris	—	—	—	—	—	—	9433R	—	—	—	—	—	—	—	—
RC03-01-0048	03-14487	0.0–0.5	Debris	—	—	—	—	—	—	9433R	—	—	—	—	—	—	—	—
RC03-01-0049	03-14488	0.0–0.25	Debris	—	—	—	—	—	—	9433R	—	—	—	—	—	—	—	—
<b>AOC 03-056(k)</b>																		
0103-97-0151	03-03281	0.0–0.17	Engineered Material	—	—	—	—	—	3411R	—	—	—	—	—	—	—	—	—
0103-97-0152	03-03281	0.5–1.0	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0153	03-03281	1.83–2.83	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	3408R
0103-97-0154	03-03282	0.0–0.5	Engineered Material	—	3411R	3411R	—	—	3411R	—	—	—	—	—	—	—	—	—
0103-97-0155	03-03282	0.5–1.5	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0156	03-03282	1.5–2.17	Soil	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0157	03-03283	0.0–0.25	Engineered Material	—	—	—	—	—	3411R	—	—	—	—	—	—	—	—	—
0103-97-0158	03-03283	0.33–1.25	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0160	03-03284	0.0–0.17	Engineered Material	—	—	—	—	—	3411R	—	—	—	—	—	—	—	—	—
0103-97-0161	03-03284	0.5–1.25	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0171	03-03289	0.0–1.0	Fill	—	3411R	3411R	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0172	03-03289	3.5–4.5	Soil	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0173	03-03290	0.0–1.0	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—
0103-97-0174	03-03290	1.0–1.5	Fill	—	—	—	—	—	3411R	3410R	—	—	—	—	—	—	—	—

Table 4.1-1 (continued)

Sample Id	Location Id	Depth (ft)	Media	Chromium Hexavalent Ion	Gamma Spectroscopy	Gross Alpha/Beta Radiation	Herbicides	Isotopic Plutonium	Isotopic Uranium	Metals	PCBs	Pesticides	Strontium-90	SVOCs	TPH-DRO	TPH-GRO	Tritium	VOCs
<b>SWMU 03-056(I)</b>																		
RE03-03-51685	03-22331	0.0–0.4921	Engineered Material	—	—	—	—	—	—	1803S	—	—	—	—	—	—	—	—
RE03-03-51686	03-22331	0.4921–2.2966	Soil	—	—	—	—	—	—	1803S	—	—	—	—	—	—	—	—
RE03-03-51687	03-22332	0.0–0.4921	Engineered Material	—	—	—	—	—	—	1803S	—	—	—	—	—	—	—	—
RE03-03-51688	03-22332	0.4921–2.2966	Soil	—	—	—	—	—	—	1803S	—	—	—	—	—	—	—	—
RE03-03-51689	03-22333	0.0–0.6562	Engineered Material	—	—	—	—	—	—	1803S	—	—	—	—	—	—	—	—
RE03-03-51690	03-22333	0.6562–1.6404	Soil	—	—	—	—	—	—	1803S	—	—	—	—	—	—	—	—
RE03-03-51692	03-22334	0.0–1.6404	Soil	—	—	—	—	—	—	1803S	—	—	—	—	—	—	—	—

\*— = Analyses not requested.



**Table 4.1-2  
Screening-Level Data from TA-03 Site Samples Collected and Analyses Requested**

Sample ID	Location ID	Depth (ft)	Media	Gamma Spectroscopy	Gross Alpha/Beta Radiation	Gross Gamma Radiation	Herbicides	Isotopic Plutonium	Isotopic Uranium	Metals	PCBs	Pesticides	Pesticides/PCBs	Strontium-90	Tritium	SVOCs	VOCs
<b>SWMU 03-002(c)</b>																	
AAB6034	03-02300	0.0–0.5	Fill	—*	19231	19231	18269	—	—	18460	18269	18269	—	—	19231	18269	—
AAB6037	03-02301	0.0–0.5	Fill	—	19231	19231	18269	—	—	18460	18269	18269	—	—	19231	18269	—
AAB6038	03-02302	0.0–0.5	Fill	—	19231	19231	18269	—	—	18460	18269	18269	—	—	19231	18269	18269
AAB6039	03-02303	0.0–0.5	Fill	—	19231	19231	18269	—	—	18460	18269	18269	—	—	19231	18269	—
AAB6035	03-02304	0.0–0.25	Fill	—	19231	19231	18269	—	—	18460	18269	18269	—	—	19231	18269	—
<b>Consolidated Unit 03-012(b)-00</b>																	
<b>SWMU 03-012(b)</b>																	
AAB5881	03-02118	0.0–0.5	Soil	19954	19954	21698	—	—	—	20225	18186	18186	—	—	19954	18186	18186
AAB7668	03-02118	0.0–0.5	Soil	—	20714	20714	18550	—	—	—	18550	—	—	—	20714	—	—
AAB7703	03-02118	0.0–0.5	Soil	—	20520	20520	19136	—	—	—	19136	—	—	—	20520	—	—
AAB5882	03-02119	0.0–0.5	Soil	19954	19954	21698	18186	19954	19954	20225	18186	18186	—	19954	19954	18186	18186
AAB5883	03-02120	0.0–0.5	Sediment	19954	19954	21698	18186	—	—	20225	18186	18186	—	—	19954	18186	18186
AAB5884	03-02121	0.0–0.5	Engineered Material	19954	19954	21698	—	—	—	20225	18186	18186	—	—	19954	18186	18186
AAB7669	03-02121	0.0–0.5	Sediment	—	20714	20714	18550	—	—	—	18550	—	—	—	20714	—	—
AAB7704	03-02121	0.0–0.5	Sediment	—	20520	20520	19136	—	—	—	19136	—	—	—	20520	—	—
AAB5885	03-02122	0.0–0.5	Sediment	19954	19954	21698	—	—	—	20225	18186	18186	—	—	19954	18186	18186
AAB7667	03-02122	0.0–0.5	Sediment	—	20714	20714	18550	—	—	—	18550	—	—	—	20714	—	—
AAB7702	03-02122	0.0–0.5	Sediment	—	20520	20520	19136	—	—	—	19136	—	—	—	20520	—	—
<b>Consolidated Unit 03-013(a)-00</b>																	
AAB6023	03-02600	0.0–0.33	Sediment	—	19230	19230	—	—	—	18459	18315	—	—	—	19230	18315	18315
AAB6026	03-02601	0.0–0.25	Sediment	—	19230	19230	—	—	—	18459	18315	—	—	—	19230	18315	18315
AAB6029	03-02601	0.0–0.25	Sediment	—	19230	19230	—	—	—	18459	18315	—	—	—	19230	18315	—
AAB6027	03-02602	0.0–0.5	Sediment	—	19230	19230	—	—	—	18459	18315	—	—	—	19230	18315	18315
AAB6028	03-02603	0.0–0.5	Sediment	—	19230	19230	—	—	—	18459	18315	—	—	—	19230	18315	18315
AAB6030	03-02604	0.0–0.67	Sediment	—	19230	19230	—	—	—	18459	18315	—	—	—	19230	18315	18315
<b>Consolidated Unit 03-014(a)-99</b>																	
<b>SWMU 03-014(a)</b>																	
AAB5944	03-02100	0.0–1.0	Soil	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	—	18891	18246	—
AAB5952	03-02100	1.0–1.5	Soil	—	18891	18891	—	—	—	18298	—	—	—	—	18891	—	18246

Table 4.1-2 (continued)

Sample ID	Location ID	Depth (ft)	Media	Gamma Spectroscopy	Gross Alpha/Beta Radiation	Gross Gamma Radiation	Herbicides	Isotopic Plutonium	Isotopic Uranium	Metals	PCBs	Pesticides	Pesticides/PCBs	Strontium-90	SVOCs	Tritium	VOCs
AAB5945	03-02101	0.0–1.0	Soil	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	—	18246	18891	—
AAB5953	03-02101	1.0–1.5	Soil	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
AAB5947	03-02102	0.0–1.0	Soil	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	—	18246	18891	—
AAB5954	03-02102	1.0–1.5	Soil	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
AAB5948	03-02103	0.0–1.0	Soil	19329	18891	18891	—	19329	19329	18298	—	—	—	—	—	18891	—
AAB5955	03-02103	1.0–1.5	Soil	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
AAB5949	03-02104	0.0–1.0	Soil	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	—	18246	18891	—
AAB5956	03-02104	1.0–1.5	Soil	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
<b>AOC 03-014(b2)</b>																	
AAB5930	03-02105	0.0–1.0	Soil	19954	19954	21698	18186	—	—	20225	18186	18186	—	—	18186	19954	18186
AAB5932	03-02105	0.0–1.0	Soil	—	—	—	—	—	—	20225	—	—	—	—	—	—	—
AAB5931	03-02106	0.0–1.0	Soil	19954	19954	21698	18186	—	—	20225	18186	18186	—	—	18186	19954	18186
AAB5933	03-02106	1.0–1.5	Soil	—	—	—	—	—	—	20225	—	—	—	—	—	—	—
AAB5934	03-02107	0.0–1.0	Soil	19954	19954	21698	18186	—	—	20225	18186	18186	—	—	18186	19954	—
AAB5936	03-02107	1.0–1.5	Soil	—	—	—	—	—	—	—	—	—	—	—	—	—	18186
AAB5935	03-02108	0.0–0.5	Soil	19954	19954	21698	18186	—	—	20225	18186	18186	—	—	18186	19954	—
AAB5937	03-02108	0.0–0.5	Soil	—	—	—	—	—	—	—	—	—	—	—	—	—	18186
AAB7670	03-02108	0.0–0.5	Soil	—	20714	20714	18550	—	—	—	18550	—	—	—	—	20714	—
AAB7701	03-02108	0.0–0.17	Soil	—	20520	20520	19136	—	—	—	19136	—	—	—	—	20520	—
<b>AOC 03-014(c2)</b>																	
AAB5907	03-02109	0.0–1.0	Sediment	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	19329	18246	18891	—
AAB5908	03-02110	0.0–1.0	Sediment	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	19329	18246	18891	—
AAB5909	03-02110	0.67–1	Sediment	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
AAB5910	03-02110	1.0–1.5	Sediment	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
AAB5911	03-02111	0.0–1.0	Sediment	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	19329	18246	18891	—
AAB5913	03-02111	1.0–1.5	Sediment	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
AAB5912	03-02112	0.0–1.0	Sediment	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	19329	18246	18891	—
AAB5914	03-02112	0.67–1	Sediment	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
AAB5915	03-02113	0.0–1.0	Sediment	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	19329	18246	18891	—
AAB5916	03-02113	1.0–1.5	Sediment	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
AAB5917	03-02114	0.0–1.0	Sediment	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	19329	18246	18891	—
AAB5919	03-02114	1.0–1.5	Sediment	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
AAB5918	03-02115	0.0–0.5	Sediment	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	19329	18246	18891	—

Table 4.1-2 (continued)

Sample ID	Location ID	Depth (ft)	Media	Gamma Spectroscopy	Gross Alpha/Beta Radiation	Gross Gamma Radiation	Herbicides	Isotopic Plutonium	Isotopic Uranium	Metals	PCBs	Pesticides	Pesticides/PCBs	Strontium-90	SVOCs	Tritium	VOCs
AAB5921	03-02115	0.33–0.5	Sediment	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
AAB5929	03-02115	0.33–0.5	Sediment	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
AAB5922	03-02116	0.0–0.67	Sediment	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	19329	18246	18891	—
AAB5924	03-02116	0.0–0.67	Sediment	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
AAB5923	03-02117	0.0–0.5	Sediment	19329	18891	18891	18246	19329	19329	18298	18246	18246	—	19329	18246	18891	—
AAB5925	03-02117	0.0–0.5	Sediment	—	18891	18891	—	—	—	18298	—	—	—	—	—	18891	18246
<b>SWMU 03-014(0)</b>																	
0103-97-0024	03-03203	0.0–0.5	Fill	—	—	—	—	—	—	3446R	—	—	—	—	—	—	—
<b>Consolidated Unit 03-015-00</b>																	
<b>SWMU 03-015</b>																	
AAB5809	03-02000	0.0–1.5	Soil	20251	20251	20864	—	20251	20251	20221	—	—	—	—	18212	20251	—
AAB5810	03-02001	0.0–1.5	Soil	20251	20251	20864	—	20251	20251	20221	—	—	—	—	18212	20251	—
AAB5811	03-02002	0.0–1.5	Soil	20251	20251	20864	—	20251	20251	20221	—	—	—	—	18212	20251	—
AAB5812	03-02003	0.0–1.5	Soil	20251	20251	20864	—	—	—	20221	—	—	—	—	18212	20251	—
AAB5813	03-02004	0.0–1.5	Sediment	—	20957	20957	—	—	—	—	—	—	—	—	18213	20957	—
<b>AOC 03-047(d)</b>																	
VCXX-95-0082	03-09008	0.0–0.5	Soil	—	—	—	—	—	—	72632	—	—	72619	—	72618	—	72580
VCXX-95-0083	03-09009	0.0–0.5	Soil	—	—	—	—	—	—	72632	—	—	72619	—	72618	—	72580
VCXX-95-0084	03-09010	0.0–0.5	Soil	—	—	—	—	—	—	72632	—	—	72619	—	72618	—	72580
<b>AOC 03-051(c)</b>																	
VCXX-95-0091	03-09012	0.0–0.5	Soil	—	—	—	—	—	—	72520	—	—	72541	—	72542	—	—
VCXX-95-0092	03-09013	0.0–0.5	Soil	—	—	—	—	—	—	72520	—	—	72541	—	72542	—	—
VCXX-95-0093	03-09014	0.0–0.5	Soil	—	—	—	—	—	—	72520	—	—	72541	—	72542	—	—
VCXX-95-0094	03-09015	0.0–0.5	Soil	—	—	—	—	—	—	72520	—	—	72541	—	72542	—	—
<b>Consolidated Unit 03-059-00</b>																	
<b>SWMU 03-059</b>																	
AAB7765	03-02700	0.0–0.83	Soil	—	20758	20758	—	—	—	—	20492	—	—	—	—	20758	—
AAB7766	03-02701	0.0–0.83	Soil	—	20758	20758	—	—	—	—	20492	—	—	—	—	20758	—
AAB7768	03-02703	0.0–0.5	Engineered Material	—	20758	20758	—	—	—	—	20492	—	—	—	—	20758	—
AAB7769	03-02704	0.0–0.5	Engineered Material	—	20758	20758	—	—	—	—	20492	—	—	—	—	20758	—
AAB7770	03-02705	0.0–0.5	Engineered Material	—	20758	20758	—	—	—	—	20492	—	—	—	—	20758	—
AAB7771	03-02706	0.0–0.5	Engineered Material	—	20758	20758	—	—	—	—	20492	—	—	—	—	20758	—
AAB7772	03-02707	0.0–0.5	Engineered Material	—	20758	20758	—	—	—	—	20492	—	—	—	—	20758	—



Table 4.1-2 (continued)

Sample ID	Location ID	Depth (ft)	Media	Gamma Spectroscopy	Gross Alpha/Beta Radiation	Gross Gamma Radiation	Herbicides	Isotopic Plutonium	Isotopic Uranium	Metals	PCBs	Pesticides	Pesticides/PCBs	Strontium-90	SVOCs	Tritium	VOCs
AAB7773	03-02708	0.0-0.5	Engineered Material	—	20758	20758	—	—	—	—	20492	—	—	—	—	20758	—
AAB7774	03-02709	0.0-0.5	Engineered Material	—	20758	20758	—	—	—	—	20492	—	—	—	—	20758	—
AAB7775	03-02710	0.0-0.5	Engineered Material	—	20758	20758	—	—	—	—	20492	—	—	—	—	20758	—
AAB7776	03-02711	0.0-0.5	Engineered Material	—	20758	20758	—	—	—	—	20492	—	—	—	—	20758	—
AAB7777	03-02712	0.0-0.5	Engineered Material	—	20758	20758	—	—	—	—	20492	—	—	—	—	20758	—

\*— = Analyses not requested.

**Table 4.1-3  
Summary of Inorganic Chemicals Detected Above BVs for TA-60 Sites**

Sample ID	Location ID	Depth (ft)	Media	Aluminum	Antimony	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium	Chromium hexavalent ion	Cobalt	Copper	Iron	Lead	Magnesium	Manganese	Mercury	Nickel	Potassium	Selenium	Silver	Sodium	Thallium	Vanadium	Zinc	
<b>Soil/Fill BV</b>				<b>29200</b>	<b>0.83</b>	<b>8.17</b>	<b>295</b>	<b>1.83</b>	<b>0.4</b>	<b>6120</b>	<b>19.3</b>	<b>na<sup>a</sup></b>	<b>8.64</b>	<b>14.7</b>	<b>21500</b>	<b>22.3</b>	<b>4610</b>	<b>671</b>	<b>0.1</b>	<b>15.4</b>	<b>3460</b>	<b>1.52</b>	<b>1</b>	<b>915</b>	<b>0.73</b>	<b>39.6</b>	<b>48.8</b>	
<b>Sediment BV</b>				<b>15400</b>	<b>0.83</b>	<b>3.98</b>	<b>127</b>	<b>1.31</b>	<b>0.4</b>	<b>4420</b>	<b>10.5</b>	<b>na</b>	<b>4.73</b>	<b>11.2</b>	<b>13800</b>	<b>19.7</b>	<b>2370</b>	<b>543</b>	<b>0.1</b>	<b>9.38</b>	<b>2690</b>	<b>0.3</b>	<b>1</b>	<b>1470</b>	<b>0.73</b>	<b>19.7</b>	<b>60.2</b>	
<b>Qbt 3/Qbt 4 BV</b>				<b>7340</b>	<b>0.5</b>	<b>2.79</b>	<b>46</b>	<b>1.21</b>	<b>1.63</b>	<b>2200</b>	<b>7.14</b>	<b>na</b>	<b>3.14</b>	<b>4.66</b>	<b>14500</b>	<b>11.2</b>	<b>1690</b>	<b>482</b>	<b>0.1</b>	<b>6.58</b>	<b>3500</b>	<b>0.3</b>	<b>1</b>	<b>2770</b>	<b>1.1</b>	<b>17</b>	<b>63.5</b>	
<b>Consolidated Unit 03-009(a)-00</b>																												
<b>SWMU 03-009(a)</b>																												
RE03-03-52423	03-22538	19.5–20.0	Qbt 4	— <sup>b</sup>	—	—	—	—	—	—	—	NA <sup>c</sup>	—	—	—	—	—	—	—	—	—	0.48(J+)	—	—	—	—	—	—
RE03-03-52427	03-22539	4.0–5.0	Qbt 4	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	0.43(J+)	—	—	—	—	—	—
<b>SWMU 03-028</b>																												
RE03-03-52351	03-22523	19.0–19.5	Qbt 4	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	0.43(J-)	—	—	—	—	—	—
RE03-03-52352	03-22524	7.5–8.0	Qbt 4	10500	—	3.2	148	—	—	5020	—	NA	—	5.4	—	13	2460	—	—	7.7	—	0.68(J-)	—	—	—	—	—	—
RE03-03-52354	03-22524	19.5–20.0	Qbt 4	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	0.54(J-)	—	—	—	—	—	—
<b>SWMU 03-036(a)</b>																												
RE03-03-52357	03-22525	8.0–8.5	Qbt 4	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	0.67(J-)	—	—	—	—	—	—
<b>SWMU 03-036(c)</b>																												
RE03-03-52362	03-22526	3.0–4.0	Qbt 4	—	—	5.7	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	0.43(J-)	—	—	—	—	—	—
<b>SWMU 03-036(d)</b>																												
RE03-03-52368	03-22527	4.5–5.0	Qbt 4	—	—	—	—	—	—	—	—	NA	—	—	—	13.8	—	—	—	—	—	0.51(J-)	—	—	—	—	—	—
<b>AOC 03-043(b)</b>																												
RE03-03-52372	03-22528	9.5–10.0	Qbt 4	7480	—	4.3	67.5	—	—	—	10(J-)	NA	—	—	18400	31.7	2190	—	—	6.6	—	0.66(J-)	—	—	—	—	—	115
RE03-03-52374	03-22528	19.5–20.0	Qbt 4	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	0.4(J-)	—	—	—	—	—	—
<b>SWMU 03-045(g)</b>																												
RE03-03-52407	03-22535	0.0–0.5	Sediment	—	—	4.2	262	—	—	23400	27.5(J-)	NA	7.9	29.4	19700	—	6310	582(J)	—	17.5	2850	—	—	2190	—	32	61.1	
RE03-03-52408	03-22535	1.5–2.0	Sediment	—	—	—	128	—	0.63	13700	14.4(J-)	NA	—	24.5	—	—	2700	—	—	11	—	—	—	—	—	21.6	65.1	
RE03-03-52412	03-22536	0.0–0.5	Sediment	—	—	—	241	—	0.93	22100	27.7(J-)	NA	7.7	39.2	19900	27.3	5200	—	—	19.3	2870	—	—	1510	—	31.3	141	
RE03-03-52413	03-22536	1.5–2.0	Sediment	—	—	—	—	—	—	66000	10.9(J-)	NA	—	—	—	—	3340	654(J)	—	11.9	—	—	—	—	—	—	—	
<b>Consolidated Unit 03-012(b)-00</b>																												
RE03-02-49270	03-02-21036	0.0–0.5	Fill	—	—	—	—	—	0.688	—	157	4.22	—	26.1	—	—	—	—	0.102	—	—	—	6.45	—	—	—	—	98.0
RE03-02-49272	03-02-21038	0.0–0.5	Fill	—	—	—	—	—	—	—	42.9	8.94	—	20.6	—	—	—	—	—	—	—	—	1.49	—	—	—	—	49.9
RE03-02-49273	03-02-21039	0.0–0.5	Fill	—	—	—	—	—	—	—	—	5.23	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-02-49287	03-02-21039	0.5–1.0	Fill	—	5.57(U)	—	—	—	2.79(U)	—	—	2.06	—	—	—	—	—	—	—	—	—	—	2.79(U)	—	2.79(U)	—	—	
RE03-02-49275	03-02-21041	0.0–0.5	Fill	—	—	—	—	—	—	—	—	5.61	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	

Table 4.1-3 (continued)

Sample ID	Location ID	Depth (ft)	Media	Aluminum	Antimony	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium	Chromium hexavalent ion	Cobalt	Copper	Iron	Lead	Magnesium	Manganese	Mercury	Nickel	Potassium	Selenium	Silver	Sodium	Thallium	Vanadium	Zinc	
<b>Soil/Fill BV</b>				<b>29200</b>	<b>0.83</b>	<b>8.17</b>	<b>295</b>	<b>1.83</b>	<b>0.4</b>	<b>6120</b>	<b>19.3</b>	na <sup>a</sup>	<b>8.64</b>	<b>14.7</b>	<b>21500</b>	<b>22.3</b>	<b>4610</b>	<b>671</b>	<b>0.1</b>	<b>15.4</b>	<b>3460</b>	<b>1.52</b>	<b>1</b>	<b>915</b>	<b>0.73</b>	<b>39.6</b>	<b>48.8</b>	
<b>Sediment BV</b>				<b>15400</b>	<b>0.83</b>	<b>3.98</b>	<b>127</b>	<b>1.31</b>	<b>0.4</b>	<b>4420</b>	<b>10.5</b>	na	<b>4.73</b>	<b>11.2</b>	<b>13800</b>	<b>19.7</b>	<b>2370</b>	<b>543</b>	<b>0.1</b>	<b>9.38</b>	<b>2690</b>	<b>0.3</b>	<b>1</b>	<b>1470</b>	<b>0.73</b>	<b>19.7</b>	<b>60.2</b>	
<b>Qbt 3/Qbt 4 BV</b>				<b>7340</b>	<b>0.5</b>	<b>2.79</b>	<b>46</b>	<b>1.21</b>	<b>1.63</b>	<b>2200</b>	<b>7.14</b>	na	<b>3.14</b>	<b>4.66</b>	<b>14500</b>	<b>11.2</b>	<b>1690</b>	<b>482</b>	<b>0.1</b>	<b>6.58</b>	<b>3500</b>	<b>0.3</b>	<b>1</b>	<b>2770</b>	<b>1.1</b>	<b>17</b>	<b>63.5</b>	
RE03-02-49289	03-02-21041	0.5–1.0	Fill	—	—	—	—	—	—	—	—	3.66	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
RE03-02-49277	03-02-21043	0.0–0.5	Fill	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	62
RE03-02-49291	03-02-21043	0.5–1.0	Fill	—	—	—	—	—	—	—	—	4.00	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
RE03-02-49278	03-02-21044	0.0–0.5	Fill	—	—	—	—	—	—	—	21.3	3.25	—	—	—	—	—	—	—	—	—	—	1.28	—	—	—	145	
RE03-02-49292	03-02-21044	0.5–1.0	Fill	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	73.7	
RE03-02-49279	03-02-21045	0.0–0.5	Fill	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	130	
RE03-02-49293	03-02-21045	0.5–1.0	Fill	—	—	—	—	—	—	—	22.2	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	78.8	
RE03-02-49280	03-02-21046	0.0–0.5	Fill	—	—	—	—	—	—	—	—	7.57	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-02-49294	03-02-21046	0.5–1.0	Fill	—	—	—	—	—	—	—	—	5.16	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-02-49281	03-02-21047	0.0–0.5	Fill	—	—	—	—	—	—	—	—	9.5	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-02-49296	03-02-21048	0.5–1.0	Fill	—	—	—	—	—	—	—	19.4	1.83	—	—	—	—	—	—	—	—	—	—	—	—	—	—	57.3	
RE03-02-49283	03-02-21049	0.0–0.5	Fill	—	—	—	—	—	—	—	45.8	2.31	—	—	—	—	—	—	—	—	—	—	1.63	—	—	—	52.3	
RE03-02-49297	03-02-21049	0.5–1.0	Fill	—	—	—	—	—	—	—	—	1.46	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-02-49298	03-02-21050	0.5–1.0	Fill	—	—	—	—	—	—	—	—	3.70	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-02-49300	03-02-21052	0.5–1.0	Fill	—	—	—	—	—	—	—	—	2.08	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-02-49301	03-02-21053	0.5–1.0	Fill	—	—	—	—	—	0.470	—	—	5.02	—	—	—	—	—	—	—	—	—	—	—	—	—	—	67.7	
RE03-04-52775	03-22576	0.0–0.5	Soil	—	—	—	—	—	0.524(U)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-04-52785	03-22576	3.5–4.0	Soil	—	—	—	—	—	0.547(U)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-04-52776	03-22577	0.0–0.5	Soil	—	—	—	—	—	—	—	31	0.241	—	—	—	—	—	—	—	—	—	—	1.18	—	—	—	54.5	
RE03-04-52786	03-22577	3.0–3.5	Soil	—	—	—	—	—	0.539(U)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-04-52777	03-22578	0.0–0.5	Soil	—	—	—	—	—	0.56(U)	—	25	—	—	—	—	—	—	—	—	—	—	—	1.88	—	—	—	—	
RE03-04-52778	03-22579	0.0–0.5	Soil	—	—	—	—	—	—	—	28	—	—	—	—	—	—	—	—	—	—	—	1.04	—	—	—	54.6	
RE03-04-52788	03-22579	3.5–4.0	Soil	—	—	—	—	—	0.501(U)	—	—	0.102(J)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-04-52779	03-22580	0.0–0.5	Soil	—	—	—	—	—	—	—	—	0.0952(J)	—	—	—	—	—	—	—	—	—	—	1.99	—	—	—	—	
RE03-04-52791	03-22582	1.83–2.83	Soil	—	—	—	—	—	0.545(U)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-04-52782	03-22583	0.0–0.5	Soil	—	—	—	—	—	0.514(U)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-04-52792	03-22583	3.5–4.0	Soil	—	—	—	—	—	0.532(U)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-04-52783	03-22584	0.0–0.5	Soil	—	—	—	—	—	—	—	—	0.157	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-04-52793	03-22584	3.5–4.0	Soil	—	—	—	—	—	0.491(U)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
RE03-04-52784	03-22585	0.0–0.5	Soil	—	—	—	—	—	—	—	32.5	—	—	—	—	—	—	—	—	—	—	—	2.08	—	—	—	54.2	
RE03-04-52794	03-22585	3.5–4.0	Soil	—	—	—	—	—	—	—	—	0.21	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	



Table 4.1-3 (continued)

Sample ID	Location ID	Depth (ft)	Media	Aluminum	Antimony	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium	Chromium hexavalent ion	Cobalt	Copper	Iron	Lead	Magnesium	Manganese	Mercury	Nickel	Potassium	Selenium	Silver	Sodium	Thallium	Vanadium	Zinc
<b>Soil/Fill BV</b>				29200	0.83	8.17	295	1.83	0.4	6120	19.3	na <sup>a</sup>	8.64	14.7	21500	22.3	4610	671	0.1	15.4	3460	1.52	1	915	0.73	39.6	48.8
<b>Sediment BV</b>				15400	0.83	3.98	127	1.31	0.4	4420	10.5	na	4.73	11.2	13800	19.7	2370	543	0.1	9.38	2690	0.3	1	1470	0.73	19.7	60.2
<b>Qbt 3/Qbt 4 BV</b>				7340	0.5	2.79	46	1.21	1.63	2200	7.14	na	3.14	4.66	14500	11.2	1690	482	0.1	6.58	3500	0.3	1	2770	1.1	17	63.5
<b>SWMU 03-013(i)</b>																											
RE03-05-59527	03-24444	0.0–0.5	Fill	—	—	—	—	—	0.505(J)	—	—	NA	—	—	—	38.1	—	—	—	—	—	1.7(U)	—	—	—	—	52.8
RE03-05-59528	03-24444	1.5–1.5	Fill	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	1.75(U)	—	—	—	—	—
RE03-05-59529	03-24445	0.0–0.5	Fill	—	—	—	—	—	0.797	—	—	NA	—	—	—	—	—	—	—	—	—	1.68(U)	—	—	—	—	—
RE03-05-59530	03-24445	1.5–1.5	Fill	—	—	—	—	—	3.53	—	—	NA	—	—	—	—	—	—	—	—	—	1.81(U)	—	—	—	—	55.9
RE03-05-59531	03-24446	0.0–0.5	Fill	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	1.76(U)	—	—	—	—	—
RE03-05-59532	03-24446	1.5–1.5	Fill	—	—	—	—	—	0.57(U)	—	—	NA	—	—	—	—	—	—	—	—	—	1.71(U)	—	—	—	—	—
RE03-05-59533	03-24447	0.0–0.5	Fill	—	1.71(J-)	—	—	—	5.58	—	—	NA	—	21.8(J)	—	238	—	—	—	16.3	—	1.76(U)	—	—	—	—	482
RE03-05-59534	03-24447	1.5–1.5	Fill	—	1.55(J-)	—	—	—	2.79	—	—	NA	—	—	—	140	—	—	—	—	—	1.68(U)	—	—	—	—	196
RE03-05-59535	03-24448	0.0–0.5	Fill	—	0.961(J-)	—	—	—	1.18	—	—	NA	—	—	—	137	—	—	—	—	—	1.66(U)	—	—	—	—	113
RE03-05-59536	03-24448	1.5–1.5	Fill	—	—	—	—	—	—	—	—	NA	—	—	—	37.6	—	—	—	—	—	1.72(U)	—	—	—	—	56.5
RE03-05-59537	03-24449	0.0–0.5	Fill	—	—	—	—	—	0.406(J)	—	—	NA	—	—	—	45.8	—	—	—	—	—	1.79(U)	—	—	—	—	61.7
RE03-05-59538	03-24449	1.5–1.5	Fill	—	—	—	—	—	0.656(U)	—	—	NA	—	—	—	—	—	—	—	—	—	1.97(U)	—	—	—	—	—
RE03-05-59539	03-24450	0.0–0.5	Fill	—	—	—	302(J+)	—	0.623	—	—	NA	—	—	—	37.1	—	—	—	—	—	—	—	—	—	—	59.1
RE03-05-59540	03-24450	1.5–1.5	Fill	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	1.89(U)	—	—	—	—	—
RE03-05-59541	03-24451	0.0–0.5	Fill	—	—	—	—	—	0.568(U)	—	—	NA	—	—	—	—	—	—	—	—	—	1.7(U)	—	—	—	—	—
RE03-05-59542	03-24451	1.5–1.5	Fill	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	1.7(U)	—	—	—	—	—
<b>Consolidated Unit 03-014(a)-99</b>																											
<b>SWMU 03-014(k)</b>																											
0103-97-0011	03-03264	0.0–1.0	Fill	—	4.7(U)	—	—	—	0.47(U)	—	—	NA	—	—	—	—	—	—	0.16	—	—	—	2.7	—	—	—	—
0103-97-0012	03-03264	1.33–2.33	Qbt 4	—	5.4(U)	—	—	—	—	—	19.3	NA	—	—	—	—	—	—	—	8.6	—	—	—	—	—	—	154
0103-97-0013	03-03264	2.33–3.33	Qbt 4	—	5(U)	—	—	—	—	—	24	NA	—	6.9	—	—	—	—	—	11.9	—	—	—	—	—	—	164
<b>SWMU 03-014(l)</b>																											
0103-97-0014	03-03265	0.0–1.17	Fill	—	5(U)	—	—	—	0.5(U)	—	—	NA	—	30	—	—	—	—	0.15	—	—	—	5.7	—	—	—	—
0103-97-0015	03-03265	1.67–2.67	Qbt 4	—	5.2(U)	—	—	—	—	—	9.7	NA	—	4.7	—	—	—	—	—	—	—	—	—	—	—	—	—
0103-97-0016	03-03265	2.67–3.67	Qbt 4	—	5(U)	—	—	—	—	—	11.4	NA	—	—	—	—	—	—	—	8.2	—	—	—	—	—	—	—
<b>SWMU 03-014(m)</b>																											
0103-97-0017	03-03266	0.0–0.17	Fill	—	4.6(U)	—	—	—	0.49	—	38.9	NA	—	44.8	—	29.1	—	—	0.92	—	—	—	18.3	—	—	—	76.9
0103-97-0018	03-03266	0.75–1.75	Qbt 4	—	5.3(U)	—	—	—	—	—	13.1	NA	—	8.4	—	—	—	—	—	8.4	—	—	—	—	—	—	—
0103-97-0019	03-03266	1.75–2.75	Qbt 4	—	5.8(U)	—	—	—	—	—	17.6	NA	—	—	—	—	—	—	—	11.1	—	—	—	—	—	—	—

Table 4.1-3 (continued)

Sample ID	Location ID	Depth (ft)	Media	Aluminum	Antimony	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium	Chromium hexavalent ion	Cobalt	Copper	Iron	Lead	Magnesium	Manganese	Mercury	Nickel	Potassium	Selenium	Silver	Sodium	Thallium	Vanadium	Zinc	
<b>Soil/Fill BV</b>				29200	0.83	8.17	295	1.83	0.4	6120	19.3	na <sup>a</sup>	8.64	14.7	21500	22.3	4610	671	0.1	15.4	3460	1.52	1	915	0.73	39.6	48.8	
<b>Sediment BV</b>				15400	0.83	3.98	127	1.31	0.4	4420	10.5	na	4.73	11.2	13800	19.7	2370	543	0.1	9.38	2690	0.3	1	1470	0.73	19.7	60.2	
<b>Qbt 3/Qbt 4 BV</b>				7340	0.5	2.79	46	1.21	1.63	2200	7.14	na	3.14	4.66	14500	11.2	1690	482	0.1	6.58	3500	0.3	1	2770	1.1	17	63.5	
<b>SWMU 03-014(n)</b>																												
0103-97-0020	03-03201	0.0–1.58	Fill	—	—	—	—	—	—	—	—	NA	—	25.1	—	—	—	—	0.55(J-)	—	—	—	3.1	—	—	—	71.3	
0103-97-0021	03-03201	1.58–2.58	Qbt 4	—	0.75(UJ)	—	—	—	—	—	—	NA	—	11.6	—	—	—	—	0.14(J-)	—	—	0.6(U)	1.1(J)	—	—	—	—	
0103-97-0022	03-03201	2.58–3.58	Qbt 4	—	0.76(UJ)	—	—	—	—	—	8.8	NA	—	5.6(J)	—	—	—	—	—	8.7(J)	—	0.61(U)	—	—	—	—	—	
0103-97-0023	03-03202	0.0–0.33	Fill	—	8.3(J-)	—	345	—	15.5	6430	51.9	NA	—	231	—	217	—	—	0.46(J-)	30.7	—	—	1.4(J)	—	—	—	638	
<b>SWMU 03-014(o)</b>																												
0103-97-0024	03-03203	0.0–0.5	Fill	—	4.31(U)	—	—	—	0.627	—	40.6(J+)	NA	—	46.8	—	—	—	—	1.5	—	—	—	19.7	—	—	—	53.7	
0103-97-0025	03-03203	1.5–2.5	Qbt 4	—	3.82(U)	—	—	—	—	—	12.8(J+)	NA	—	5.04	—	—	—	—	—	6.7	—	—	1.34	—	—	—	—	
0103-97-0026	03-03203	2.5–3.5	Qbt 4	—	4.79(U)	—	—	—	—	—	9.88(J+)	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
0103-97-0027	03-03204	0.0–0.83	Fill	—	5.38(U)	—	—	—	0.538(U)	—	—	NA	—	18.5	—	—	—	—	0.22	—	—	—	6.48	—	—	—	—	
0103-97-0028	03-03204	1.75–2.75	Qbt 4	—	4.86(U)	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
0103-97-0029	03-03204	2.75–3.75	Qbt 4	—	5.09(U)	—	—	—	—	—	12(J+)	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
0103-97-0030	03-03205	0.0–0.75	Fill	—	4.96(U)	—	—	—	2.5	—	136(J+)	NA	—	122	—	45.1	—	—	3.8	—	—	—	71.3	—	—	—	131	
0103-97-0031	03-03205	1.25–2.25	Qbt 4	—	4.94(U)	—	—	—	—	—	25(J+)	NA	—	—	—	—	—	—	—	11.4	—	—	1.13	—	—	—	—	
0103-97-0032	03-03205	2.25–3.25	Qbt 4	—	4.62(U)	—	—	—	—	—	19.2(J+)	NA	—	—	—	—	—	—	—	10.1	—	—	—	—	—	—	—	
<b>SWMU 03-014(v)</b>																												
RE03-99-2005	03-14227	4.0–4.5	Fill	—	—	—	—	—	—	—	—	NA	9	—	—	—	—	—	—	—	—	—	—	—	—	—	—	
<b>Consolidated Unit 03-015-00</b>																												
<b>SWMU 03-015</b>																												
AAB5813	03-02004	0.0–1.5	Sediment	NA	—	—	181(J-)	—	—	NA	—	NA	NA	NA	NA	29.3(J-)	NA	NA	—	—	NA	0.61(UJ)	—	NA	—	NA	NA	
<b>AOC C-03-016</b>																												
RE03-03-52397	03-22533	1.0–1.5	Qbt 4	—	—	—	48	—	—	—	—	NA	—	9.5	—	31.5	—	1490	—	—	—	0.37(J-)	—	—	—	—	—	
RE03-03-52398	03-22533	16.0–16.5	Qbt 4	24800	—	3.6	156	4.2	—	9830(J)	12(J-)	NA	—	10.8	16400	26	4980	—	—	10	—	0.69(J-)	—	—	—	19.4	—	
RE03-03-52402	03-22534	4.0–5.0	Qbt 4	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	0.39(J-)	—	—	—	—	—	
RE03-03-52403	03-22534	9.5–10.0	Qbt 4	—	—	—	—	—	—	—	—	NA	—	—	—	12.6	—	—	—	—	—	0.48(J-)	—	—	—	—	—	
RE03-03-52405	03-22534	19.5–20.0	Qbt 4	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	0.38(J-)	—	—	—	—	—	
<b>SWMU 03-021</b>																												
0103-97-0241	03-03326	0.0–1.0	Soil	—	—	—	—	—	—	—	—	NA	—	22.9	—	24.7	—	—	—	24.5	—	—	—	—	2.1(J)	—	53	
0103-97-0242	03-03327	2.0–3.0	Soil	—	—	—	—	—	—	—	28.1	NA	—	—	—	84.7	—	—	—	—	—	—	—	—	2(J)	—	—	
0103-97-0243	03-03327	3.0–4.0	Soil	—	0.95(U)	—	—	—	—	—	101	NA	—	—	33200	33.7	—	—	—	—	—	—	—	—	1.3(J)	—	—	
0103-97-0244	03-03328	3.0–4.0	Soil	—	—	—	—	—	—	—	—	NA	—	—	—	29.7	—	—	—	—	—	—	—	—	—	—	—	
0103-97-0245	03-03328	4.0–5.0	Soil	—	0.86(U)	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	

Table 4.1-3 (continued)

Sample ID	Location ID	Depth (ft)	Media	Aluminum	Antimony	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium	Chromium hexavalent ion	Cobalt	Copper	Iron	Lead	Magnesium	Manganese	Mercury	Nickel	Potassium	Selenium	Silver	Sodium	Thallium	Vanadium	Zinc	
<b>Soil/Fill BV</b>				29200	0.83	8.17	295	1.83	0.4	6120	19.3	na <sup>a</sup>	8.64	14.7	21500	22.3	4610	671	0.1	15.4	3460	1.52	1	915	0.73	39.6	48.8	
<b>Sediment BV</b>				15400	0.83	3.98	127	1.31	0.4	4420	10.5	na	4.73	11.2	13800	19.7	2370	543	0.1	9.38	2690	0.3	1	1470	0.73	19.7	60.2	
<b>Qbt 3/Qbt 4 BV</b>				7340	0.5	2.79	46	1.21	1.63	2200	7.14	na	3.14	4.66	14500	11.2	1690	482	0.1	6.58	3500	0.3	1	2770	1.1	17	63.5	
0103-97-0246	03-03329	2.0–3.0	Soil	—	—	—	—	—	—	—	—	NA	—	—	—	31.4	—	—	—	—	—	—	—	—	—	—	—	52.5
0103-97-0247	03-03329	3.0–4.0	Soil	—	—	—	—	—	—	—	56.6	NA	11.2	—	—	358	—	—	—	—	—	—	—	—	—	—	—	193
0103-97-0248	03-03330	2.75–3.75	Soil	—	—	—	—	—	—	—	—	NA	—	—	—	103	—	—	—	—	—	—	—	—	—	—	—	—
0103-97-0251	03-03330	3.75–4.25	Soil	—	—	—	—	—	—	—	—	NA	—	—	—	67.1	—	—	—	—	—	—	—	—	—	—	—	49.3
0103-97-0249	03-03331	3.0–4.0	Soil	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	49.3
0103-97-0250	03-03331	4.0–5.0	Soil	—	—	—	—	—	—	—	—	NA	—	—	—	41.6	—	—	—	—	—	—	—	—	—	—	—	74.9
<b>AOC 03-027</b>																												
RE03-99-2001	03-14225	7.5–8.0	Fill	—	2.8(U)	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
RE03-99-2003	03-14226	7.5–8.0	Fill	—	3(U)	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
RE03-99-2006	03-14228	7.5–8.0	Fill	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	49
RE03-99-2007	03-14229	7.5–8.0	Fill	31000	3.1(U)	—	—	2.5	—	—	—	NA	—	—	22000	—	5100	—	—	22	—	—	—	1100	—	—	—	54
<b>AOC 03-036(b)</b>																												
RE03-03-52377	03-22529	11.0–11.5	Qbt 4	—	—	—	66.4	—	—	4500	—	NA	—	5.9	—	27.3	—	—	—	—	—	0.59(J-)	—	—	—	—	—	—
RE03-03-52378	03-22529	14.5–15.0	Qbt 4	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	0.35(J-)	—	—	—	—	—	64.5
RE03-03-52379	03-22529	19.5–20.0	Qbt 4	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	0.39(J-)	—	—	—	—	—	—
RE03-03-52383	03-22530	14.5–15.0	Qbt 4	—	—	—	—	—	—	—	—	NA	—	—	—	21	—	—	—	—	—	1.2(J-)	—	—	—	—	—	—
RE03-03-52384	03-22530	19.5–20.0	Qbt 4	—	—	—	—	1.3	—	—	—	NA	—	—	—	11.3	—	—	—	—	—	0.54(J-)	—	—	—	—	—	—
<b>AOC 03-052(b)</b>																												
0103-97-0163	03-03285	0.0–1.0	Soil	—	7.7(UJ)	—	—	—	0.64(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	2.2(U)
0103-97-0164	03-03285	2.0–3.0	Fill	—	7.6(UJ)	—	—	—	0.63(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	2.2(U)
0103-97-0165	03-03286	0.0–1.0	Fill	—	6.7(UJ)	—	—	—	0.55(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	1.9(U)
0103-97-0166	03-03286	1.0–2.0	Fill	—	7.2(UJ)	—	—	—	0.6(U)	—	—	NA	—	—	—	64(J-)	—	—	—	—	—	—	—	—	—	—	—	2.1(U)
0103-97-0167	03-03287	0.0–1.0	Fill	—	7.4(UJ)	—	—	—	0.62(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	2.2(U)
0103-97-0168	03-03287	1.0–2.0	Fill	—	7.1(UJ)	—	—	—	0.59(U)	—	—	NA	—	—	—	45(J-)	—	—	—	—	—	—	—	—	—	—	—	2.1(U)
0103-97-0169	03-03288	0.0–1.0	Fill	—	7.3(UJ)	—	—	—	0.6(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	2.1(U)
0103-97-0170	03-03288	1.0–2.0	Fill	—	7.5(UJ)	—	—	—	0.62(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	2.2(U)
0103-97-0175	03-03291	0.0–1.0	Soil	—	6.7(UJ)	—	—	—	0.55(U)	—	—	NA	21.5	—	—	—	—	—	—	—	—	—	—	—	—	—	—	1.9(U)
0103-97-0176	03-03291	4.0–5.0	Soil	—	7.1(UJ)	—	—	—	0.59(U)	—	—	NA	13.7	—	—	—	—	1000(J+)	—	20	—	—	—	—	—	—	—	2.1(U)
0103-97-0177	03-03292	0.0–0.67	Fill	—	5.9(UJ)	—	—	—	0.61(J-)	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	1.7(U)
<b>SWMU 03-054(c)</b>																												
RC03-01-0029	03-14470	6.0–6.5	Fill	—	0.92(UJ)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
RC03-01-0031	03-14472	6.0–6.5	Fill	—	0.86(UJ)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—



Table 4.1-3 (continued)

Sample ID	Location ID	Depth (ft)	Media	Aluminum	Antimony	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium	Chromium hexavalent ion	Cobalt	Copper	Iron	Lead	Magnesium	Manganese	Mercury	Nickel	Potassium	Selenium	Silver	Sodium	Thallium	Vanadium	Zinc	
<b>Soil/Fill BV</b>				<b>29200</b>	<b>0.83</b>	<b>8.17</b>	<b>295</b>	<b>1.83</b>	<b>0.4</b>	<b>6120</b>	<b>19.3</b>	na <sup>a</sup>	<b>8.64</b>	<b>14.7</b>	<b>21500</b>	<b>22.3</b>	<b>4610</b>	<b>671</b>	<b>0.1</b>	<b>15.4</b>	<b>3460</b>	<b>1.52</b>	<b>1</b>	<b>915</b>	<b>0.73</b>	<b>39.6</b>	<b>48.8</b>	
<b>Sediment BV</b>				<b>15400</b>	<b>0.83</b>	<b>3.98</b>	<b>127</b>	<b>1.31</b>	<b>0.4</b>	<b>4420</b>	<b>10.5</b>	na	<b>4.73</b>	<b>11.2</b>	<b>13800</b>	<b>19.7</b>	<b>2370</b>	<b>543</b>	<b>0.1</b>	<b>9.38</b>	<b>2690</b>	<b>0.3</b>	<b>1</b>	<b>1470</b>	<b>0.73</b>	<b>19.7</b>	<b>60.2</b>	
<b>Qbt 3/Qbt 4 BV</b>				<b>7340</b>	<b>0.5</b>	<b>2.79</b>	<b>46</b>	<b>1.21</b>	<b>1.63</b>	<b>2200</b>	<b>7.14</b>	na	<b>3.14</b>	<b>4.66</b>	<b>14500</b>	<b>11.2</b>	<b>1690</b>	<b>482</b>	<b>0.1</b>	<b>6.58</b>	<b>3500</b>	<b>0.3</b>	<b>1</b>	<b>2770</b>	<b>1.1</b>	<b>17</b>	<b>63.5</b>	
RC03-01-0032	03-14473	5.0–5.5	Fill	—	0.87(UJ)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	51.9(J)
RC03-01-0033	03-14474	8.0–8.5	Fill	—	0.86(UJ)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
RC03-01-0034	03-14475	7.0–7.5	Soil	—	0.87(UJ)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
RC03-01-0036	03-14477	2.0–2.5	Soil	—	0.9(UJ)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
RC03-01-0037	03-14478	2.0–2.5	Soil	—	0.85(UJ)	—	—	—	—	10200	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
RC03-01-0038	03-14479	2.0–2.5	Soil	—	0.92(UJ)	—	—	—	—	—	—	—	—	—	—	147	—	—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 03-056(a)</b>																												
RC03-01-0041	03-14481	0.5–1.0	Fill	—	—	—	—	—	—	7850(J)	—	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
RC03-01-0042	03-14482	0.5–1.0	Fill	—	—	—	—	—	—	6750(J)	—	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
RC03-01-0043	03-14483	0.5–1.0	Fill	—	—	—	—	—	—	11500(J)	—	NA	—	—	—	—	—	—	—	—	—	—	1.6	—	—	—	—	89.8
RC03-01-0044	03-14484	0.5–1.0	Fill	—	—	—	—	—	—	10400(J)	—	NA	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>AOC 03-056(k)</b>																												
0103-97-0152	03-03281	0.5–1.0	Fill	—	7.6(UJ)	—	—	—	0.63(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	2.2(U)	—	—	—	—	
0103-97-0153	03-03281	1.83–2.83	Fill	—	7.2(UJ)	—	—	—	0.6(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	2.1(U)	—	—	—	—	
0103-97-0155	03-03282	0.5–1.5	Fill	—	6.4(UJ)	—	—	—	0.53(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	1.9(U)	—	—	—	—	
0103-97-0156	03-03282	1.5–2.17	Soil	—	7.5(UJ)	—	—	—	0.62(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	2.2(U)	—	—	—	—	
0103-97-0158	03-03283	0.33–1.25	Fill	—	7.4(UJ)	—	—	—	0.61(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	2.2(U)	—	—	—	—	
0103-97-0161	03-03284	0.5–1.25	Fill	—	7(UJ)	—	—	—	0.58(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	2(U)	—	—	—	—	
0103-97-0171	03-03289	0.0–1.0	Fill	—	6.6(UJ)	—	—	—	0.55(U)	—	—	NA	—	20.1	—	24.9(J-)	—	—	—	—	—	—	1.9(U)	—	—	—	—	
0103-97-0172	03-03289	3.5–4.5	Soil	—	7.4(UJ)	—	—	—	0.61(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	2.1(U)	—	—	—	—	
0103-97-0173	03-03290	0.0–1.0	Fill	—	6.3(UJ)	—	—	—	0.52(U)	—	—	NA	—	—	—	—	—	—	—	—	—	—	1.8(U)	—	—	—	—	
0103-97-0174	03-03290	1.0–1.5	Fill	—	6.9(UJ)	—	—	—	0.57(U)	—	—	NA	—	28.2	—	—	—	—	—	—	—	—	2(U)	—	—	—	—	
<b>SWMU 03-056(l)</b>																												
RE03-03-51690	03-22333	0.65–1.64	Soil	—	—	—	—	—	—	9050	—	NA	—	29.4	—	—	—	1530	—	—	—	—	—	—	—	—	—	—
RE03-03-51692	03-22334	0.0–1.64	Soil	—	—	—	—	—	—	6800	—	NA	—	19.5	—	—	—	—	—	—	—	—	—	—	—	—	—	60.9

Note: All values in mg/kg. BVs are provided in LANL 1998, 059730.

<sup>a</sup> na = Not available.

<sup>b</sup> — = Not detected or not detected above BV.

<sup>c</sup> NA = Not analyzed.

**Table 4.1-4  
Summary of Detected VOCs for TA-03 Sites**

Sample ID	Location ID	Depth (ft)	Media	Acetone	Benzene	Butanone[2-]	Butylbenzene[n-]	Butylbenzene[sec-]	Carbon Disulfide	Isopropylbenzene	Isopropyltoluene[4-]	Methylene Chloride	Propylbenzene[1-]	Tetrachloroethene	Toluene	Trichloroethane[1,1,1-]	Trichloroethene	Trimethylbenzene[1,2,4-]	Trimethylbenzene[1,3,5-]	Xylene (Total)
<b>Consolidated Unit 03-009(a)-00</b>																				
<b>SWMU 03-009(a)</b>																				
RE03-03-52422	03-22538	14.5–15.0	Fill	— <sup>a</sup>	—	—	—	—	—	—	—	0.031	—	0.00057(J)	—	—	—	—	—	—
RE03-03-52427	03-22539	4.0–5.0	Qbt 4	—	—	—	—	—	—	—	—	0.023	—	—	—	—	—	—	—	—
RE03-03-52429	03-22539	19.5–20.0	Qbt 4	—	—	—	—	—	—	—	—	0.024	—	—	—	—	—	—	—	—
<b>SWMU 03-028</b>																				
RE03-03-52352	03-22524	7.5–8.0	Qbt 4	—	—	—	—	—	—	—	—	0.0036(J)	—	—	—	—	—	—	—	—
RE03-03-52354	03-22524	19.5–20.0	Qbt 4	0.0057(J)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 03-036(a)</b>																				
RE03-03-52357	03-22525	8.0–8.5	Qbt 4	0.0062(J)	—	—	—	—	—	—	—	—	—	0.00053(J)	—	—	—	—	—	—
<b>SWMU 03-036(c)</b>																				
RE03-03-52365	03-22526	19.5–20.0	Qbt 4	0.0051(J)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 03-036(d)</b>																				
RE03-03-52368	03-22527	4.5–5.0	Qbt 4	—	—	—	—	—	—	—	—	—	—	0.00025(J)	—	—	—	—	—	—
<b>AOC 03-043(b)</b>																				
RE03-03-52374	03-22528	19.5–20.0	Qbt 4	0.003(J)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 03-045(g)</b>																				
RE03-03-52407	03-22535	0.0–0.5	Sediment	—	—	—	—	—	—	—	—	0.013	—	—	—	—	—	—	—	—
RE03-03-52408	03-22535	1.5–2.0	Sediment	—	—	—	—	—	—	—	—	0.011	—	—	—	—	—	—	—	—
RE03-03-52412	03-22536	0.0–0.5	Sediment	—	—	—	—	—	—	—	—	0.018	—	—	—	—	—	—	—	—
RE03-03-52413	03-22536	1.5–2.0	Sediment	—	—	—	0.0018(J)	—	—	—	0.014	0.013	—	—	—	—	0.0019(J)	0.0029(J)	0.0011(J)	—
<b>SWMU 03-013(i)</b>																				
RE03-05-59528	03-24444	1.5–1.5	Fill	0.0168	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	NA <sup>b</sup>
RE03-05-59530	03-24445	1.5–1.5	Fill	0.376	—	0.0174	—	—	—	—	—	—	—	—	—	—	—	—	—	NA
RE03-05-59532	03-24446	1.5–1.5	Fill	0.0091	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	NA
RE03-05-59534	03-24447	1.5–1.5	Fill	0.0296	—	—	—	—	—	—	0.0017	—	—	—	—	—	—	—	—	NA
RE03-05-59536	03-24448	1.5–1.5	Fill	—	—	—	—	—	—	—	0.0012(J)	—	—	—	—	—	—	—	—	NA

Table 4.1-4 (continued)

Sample ID	Location ID	Depth (ft)	Media	Acetone	Benzene	Butanone[2-]	Butylbenzene[n-]	Butylbenzene[sec-]	Carbon Disulfide	Isopropylbenzene	Isopropyltoluene[4-]	Methylene Chloride	Propylbenzene[1-]	Tetrachloroethene	Toluene	Trichloroethane[1,1,1-]	Trichloroethene	Trimethylbenzene[1,2,4-]	Trimethylbenzene[1,3,5-]	Xylene (Total)
<b>Consolidated Unit 03-014(a)-99</b>																				
<b>SWMU 03-014(l)</b>																				
0103-97-0016	03-03265	2.67–3.67	Qbt 4	—	—	—	—	—	—	—	—	—	—	—	0.004(J)	—	—	—	—	—
<b>SWMU 03-014(n)</b>																				
0103-97-0021	03-03201	1.58–2.58	Qbt 4	0.042(J)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
0103-97-0023	03-03202	0.0–0.33	Fill	2.2(J)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 03-014(o)</b>																				
0103-97-0032	03-03205	2.25–3.25	Qbt 4	0.002(J)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>AOC 03-027</b>																				
RE03-99-2000	03-14225	7.0–7.5	Fill	—	—	0.0027(J)	0.00071(J)	0.00035(J)	—	—	0.00043(J)	—	0.00064(J)	—	—	—	—	0.0042(J)	0.0036(J)	0.001(J)
RE03-99-2001	03-14225	7.5–8.0	Fill	—	—	—	0.0011(J)	0.00068(J)	—	0.00021(J)	0.00076(J)	—	0.00087(J)	—	—	—	—	0.0033(J)	0.0046(J)	0.001(J)
RE03-99-2002	03-14226	7.0–7.5	Fill	—	—	—	0.0003(J)	—	—	—	—	—	—	0.00057(J)	—	—	—	0.0018(J)	0.0011(J)	—
RE03-99-2003	03-14226	7.5–8.0	Fill	—	—	—	—	—	—	—	—	—	—	—	—	—	—	0.00044(J)	—	—
<b>AOC 03-036(b)</b>																				
RE03-03-52382	03-22530	10.0–11.0	Soil	—	—	—	—	—	—	—	—	—	—	0.00075(J)	—	—	—	0.0013(J)	—	—
RE03-03-52384	03-22530	19.5–20.0	Qbt 4	0.0026(J)	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
<b>AOC 03-056(k)</b>																				
0103-97-0153	03-03281	1.83–2.83	Fill	—	—	0.006(J)	—	—	0.004(J)	—	—	—	—	—	—	—	—	—	—	—

Note: All values in mg/kg.

<sup>a</sup> — = Not detected.<sup>b</sup> NA = Not analyzed.



**Table 4.1-5  
Summary of Detected SVOCs for TA-03 Sites**

Sample ID	Location ID	Depth (ft)	Media	Acenaphthene	Acenaphthylene	Anthracene	Benzo(a)anthracene	Benzo(a)pyrene	Benzo(b)fluoranthene	Benzo(g,h,i)perylene	Benzo(k)fluoranthene	Benzoic Acid	Bis(2-ethylhexyl)phthalate	Butylbenzylphthalate	Carbazole	Chrysene	Dibenz(a,h)anthracene	Dibenzofuran	Dichlorobenzene[1,4-]	Fluoranthene	Fluorene	Indeno(1,2,3-cd)pyrene	Methylnaphthalene[2-]	Naphthalene	Phenanthrene	Pyrene	
<b>Consolidated Unit 03-009(a)-00</b>																											
<b>SWMU 03-028</b>																											
RE03-03-52348	03-22523	5.0-5.5	Soil	— <sup>a</sup>	—	—	—	—	—	—	—	0.28(J)	0.079(J)	—	NA <sup>b</sup>	—	—	—	—	—	—	—	—	—	—	—	—
RE03-03-52351	03-22523	19.0-19.5	Qbt 4	—	—	—	—	—	—	—	—	0.14(J)	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 03-036(a)</b>																											
RE03-03-52359	03-22525	19.5-20.0	Qbt 4	—	—	—	—	—	—	—	—	0.25(J)	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	—
<b>SWMU 03-045(g)</b>																											
RE03-03-52407	03-22535	0.0-0.5	Sediment	—	—	—	0.16(J)	0.22(J)	0.19(J)	0.2(J)	0.2(J)	—	0.73	—	NA	0.21(J)	—	—	—	0.37(J)	—	0.18(J)	—	—	0.14(J)	0.38(J)	
RE03-03-52408	03-22535	1.5-2.0	Sediment	—	—	—	—	—	—	—	—	—	0.28(J)	—	NA	—	—	—	—	0.12(J)	—	—	—	—	—	0.11(J)	
RE03-03-52412	03-22536	0.0-0.5	Sediment	—	—	—	0.12(J)	0.14(J)	0.15(J)	—	0.12(J)	—	0.77	—	NA	0.15(J)	—	—	—	0.33(J)	—	0.12(J)	—	—	0.12(J)	0.28(J)	
RE03-03-52413	03-22536	1.5-2.0	Sediment	—	—	—	0.16(J)	0.16(J)	0.15(J)	0.11(J)	0.14(J)	—	0.32(J)	—	NA	0.18(J)	—	—	—	0.42	—	0.12(J)	—	—	0.2(J)	0.34(J)	
<b>SWMU 03-013(i)</b>																											
RE03-05-59529	03-24445	0.0-0.5	Fill	—	—	—	—	—	—	—	—	0.689(J)	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	
RE03-05-59533	03-24447	0.0-0.5	Fill	0.0923	0.0421	0.095	—	—	—	—	—	0.666(J)	—	—	NA	—	—	—	—	1.32	0.0947	—	0.0275(J)	—	1.09	1.36	
RE03-05-59534	03-24447	1.5-1.5	Fill	—	—	—	—	—	—	—	—	—	1.13(J)	—	NA	—	—	—	—	0.0795	—	—	—	—	—	—	
RE03-05-59535	03-24448	0.0-0.5	Fill	—	0.0186(J)	—	—	—	—	—	—	—	—	—	NA	—	—	—	—	0.535	0.017(J)	—	0.0141(J)	—	0.468	0.477	
RE03-05-59536	03-24448	1.5-1.5	Fill	—	—	—	—	—	—	—	—	0.609(J)	—	—	NA	—	—	—	—	—	—	—	—	—	—	—	
RE03-05-59537	03-24449	0.0-0.5	Fill	—	—	—	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	—	—	0.0393(J)	—	
RE03-05-59538	03-24449	1.5-1.5	Fill	—	—	—	—	—	—	—	—	—	1.39(J)	—	NA	—	—	—	—	—	—	—	—	—	—	—	
RE03-05-59539	03-24450	0.0-0.5	Fill	—	—	0.0266(J)	—	—	—	—	—	—	—	—	NA	—	—	—	—	0.161	0.013(J)	—	—	—	0.108	0.2	
RE03-05-59542	03-24451	1.5-1.5	Fill	—	—	—	—	—	—	—	—	—	1.19(J)	—	NA	—	—	—	—	—	—	—	—	—	—	—	
<b>Consolidated Unit 03-014(a)-99</b>																											
<b>SWMU 03-014(m)</b>																											
0103-97-0017	03-03266	0.0-0.17	Fill	2.3(J)	—	3.9	11	8.3	15	5.6	NA	—	—	—	3.2(J)	9.3	1.1(J)	1.2(J)	1.4(J)	24	2(J)	4.6	—	0.94(J)	22	32	
<b>SWMU 03-014(n)</b>																											
0103-97-0020	03-03201	0.0-1.58	Fill	—	—	—	—	—	—	—	—	—	3.1	—	NA	—	—	—	—	—	—	—	—	—	—	—	
0103-97-0021	03-03201	1.58-2.58	Qbt 4	—	—	—	—	—	—	—	—	—	0.5	—	NA	—	—	—	—	—	—	—	—	—	—	—	
0103-97-0023	03-03202	0.0-0.33	Fill	—	—	—	—	—	—	—	—	—	44	30	NA	—	—	—	—	—	—	—	—	—	—	—	

Table 4.1-5 (continued)

Sample ID	Location ID	Depth (ft)	Media	Acenaphthene	Acenaphthylene	Anthracene	Benzo(a)anthracene	Benzo(a)pyrene	Benzo(b)fluoranthene	Benzo(g,h,i)perylene	Benzo(k)fluoranthene	Benzoic Acid	Bis(2-ethylhexyl)phthalate	Butylbenzylphthalate	Carbazole	Chrysene	Dibenz(a,h)anthracene	Dibenzofuran	Dichlorobenzene[1,4-]	Fluoranthene	Fluorene	Indeno(1,2,3-cd)pyrene	Methylnaphthalene[2-]	Naphthalene	Phenanthrene	Pyrene	
<b>SWMU 03-014(o)</b>																											
0103-97-0024	03-03203	0.0–0.5	Fill	—	—	—	0.16(J)	0.22(J)	0.39	0.16(J)	0.12(J)	—	—	—	—	0.25(J)	—	—	—	0.26(J)	—	0.16(J)	—	—	0.036(J)	0.23(J)	
0103-97-0030	03-03205	0.0–0.75	Fill	—	0.036(J)	0.057(J)	0.48	0.65	1.2	0.29(J)	0.46	0.12(J)	—	—	0.037(J)	0.69	0.084(J)	—	—	0.81	—	0.31(J)	—	—	0.29(J)	0.74	
<b>AOC C-03-016</b>																											
RE03-03-52402	03-22534	4.0–5.0	Qbt 4	—	—	—	—	—	—	—	—	—	0.15(J)	—	NA	—	—	—	—	—	—	—	—	—	—	—	
RE03-03-52403	03-22534	9.5–10.0	Qbt 4	—	—	—	—	—	—	—	—	—	0.13(J)	—	NA	—	—	—	—	—	—	—	—	—	—	—	
<b>AOC 03-036(b)</b>																											
RE03-03-52377	03-22529	11.0–11.5	Qbt 4	—	—	—	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	0.61	—	0.092(J)	—	
RE03-03-52383	03-22530	14.5–15.0	Qbt 4	—	—	—	—	—	—	—	—	—	—	—	NA	—	—	—	—	—	—	—	0.092(J)	—	—	—	

Note: All values in mg/kg.

<sup>a</sup> — = Not detected or not detected above BV.

<sup>b</sup> NA = Not analyzed.

**Table 4.1-6  
Summary of Detected PCBs, Herbicides, and TPH for TA-03 Sites**

Sample ID	Location ID	Depth (ft)	Media	PCBs		Herbicides		TPH		
				Aroclor-1254	Aroclor-1260	MCPA	MCPP	DRO	GRO	LRO
<b>SWMU 03-003(c)</b>										
RC03-01-0015	03-14457	0.33–0.5	Fill	0.054	— <sup>a</sup>	NA <sup>b</sup>	NA	NA	NA	NA
RC03-01-0016	03-14458	0.33–0.5	Fill	0.043	—	NA	NA	NA	NA	NA
<b>Consolidated Unit 03-009(a)-00</b>										
<b>SWMU 03-036(d)</b>										
RE03-03-52368	03-22527	4.5–5.0	Qbt 4	NA	NA	NA	NA	—	0.86	NA
<b>SWMU 03-045(g)</b>										
RE03-03-52413	03-22536	1.5–2.0	Sediment	NA	NA	NA	NA	—	0.95	NA
<b>Consolidated Unit 03-012(b)-00</b>										
RE03-04-52777	03-22578	0.0–0.5	Soil	0.0085(J)	0.0321(J)	NA	NA	NA	NA	NA
RE03-04-52779	03-22580	0.0–0.5	Soil	0.0213(J)	0.0711(J)	NA	NA	NA	NA	NA
RE03-04-52781	03-22582	0.83–1.33	Soil	—	0.259	NA	NA	NA	NA	NA
RE03-04-52783	03-22584	0.0–0.5	Soil	0.336	0.925	NA	NA	NA	NA	NA
<b>SWMU 03-013(i)</b>										
RE03-05-59527	03-24444	0.0–0.5	Fill	2.81	2.26	NA	NA	231	0.0156(J)	NA
RE03-05-59528	03-24444	1.5–1.5	Fill	—	—	NA	NA	134	0.0127(J-)	NA
RE03-05-59529	03-24445	0.0–0.5	Fill	—	—	NA	NA	2730	0.35(J-)	NA
RE03-05-59530	03-24445	1.5–1.5	Fill	—	—	NA	NA	3340	0.132(J-)	NA
RE03-05-59531	03-24446	0.0–0.5	Fill	0.0184(J)	—	NA	NA	398	0.0292(J)	NA
RE03-05-59532	03-24446	1.5–1.5	Fill	—	—	NA	NA	88	—	NA
RE03-05-59533	03-24447	0.0–0.5	Fill	0.193	0.0665	NA	NA	5370	—	NA
RE03-05-59534	03-24447	1.5–1.5	Fill	0.0274(J)	0.0154(J)	NA	NA	595	0.308	NA
RE03-05-59535	03-24448	0.0–0.5	Fill	0.0483(J-)	0.021(J-)	NA	NA	208	—	NA
RE03-05-59536	03-24448	1.5–1.5	Fill	0.0054(J-)	0.0039(J-)	NA	NA	270	0.338	NA
RE03-05-59537	03-24449	0.0–0.5	Fill	0.0537(J-)	0.0193(J-)	NA	NA	604	0.0192(J)	NA
RE03-05-59538	03-24449	1.5–1.5	Fill	0.0018(J)	—	NA	NA	9.3(J)	—	NA
RE03-05-59539	03-24450	0.0–0.5	Fill	0.0261	0.0082	NA	NA	92	—	NA
RE03-05-59540	03-24450	1.5–1.5	Fill	0.0209(J-)	0.0071(J-)	NA	NA	161	0.013(J-)	NA
RE03-05-59541	03-24451	0.0–0.5	Fill	0.0025(J)	0.0013(J)	NA	NA	99.9	—	NA
RE03-05-59542	03-24451	1.5–1.5	Fill	0.0024(J)	0.0014(J)	NA	NA	230	0.0292(J)	NA



Table 4.1-6 (continued)

Sample ID	Location ID	Depth (ft)	Media	PCBs		Herbicides		TPH		
				Aroclor-1254	Aroclor-1260	MCPA	MCPP	DRO	GRO	LRO
<b>Consolidated Unit 03-014(a)-99</b>										
<b>SWMU 03-014(l)</b>										
0103-97-0014	03-03265	0.0–1.17	Fill	0.078	—	—	—	NA	NA	NA
<b>SWMU 03-014(m)</b>										
0103-97-0017	03-03266	0.0–0.17	Fill	6.5	—	—	—	NA	NA	NA
0103-97-0363	03-03386	0.0–0.5	Fill	—	0.096	NA	NA	NA	NA	NA
0103-97-0362	03-03386	0.5–1.0	Fill	—	0.041	NA	NA	NA	NA	NA
0103-97-0367	03-03387	0.0–0.5	Fill	—	0.089	NA	NA	NA	NA	NA
<b>SWMU 03-014(n)</b>										
0103-97-0020	03-03201	0.0–1.58	Fill	—	—	—	—	3000	NA	NA
0103-97-0021	03-03201	1.58–2.58	Qbt 4	—	—	—	—	460	NA	NA
0103-97-0022	03-03201	2.58–3.58	Qbt 4	—	—	—	—	200	NA	NA
0103-97-0023	03-03202	0.0–0.33	Fill	—	—	—	—	31000	NA	NA
0103-97-0343	03-603357	0.0–0.5	Soil	NA	NA	NA	NA	—	NA	450
0103-97-0345	03-603357	0.0–0.5	Fill	NA	NA	NA	NA	—	NA	290
0103-97-0347	03-603357	0.0–0.5	Fill	NA	NA	NA	NA	130	NA	490
<b>SWMU 03-014(o)</b>										
0103-97-0027	03-03204	0.0–0.83	Fill	—	—	—	0.993	NA	NA	NA
0103-97-0030	03-03205	0.0–0.75	Fill	—	1.22	0.956	—	NA	NA	NA
<b>AOC 03-014(v)</b>										
RE03-99-2004	03-14227	3.0–3.5	Fill	—	—	NA	NA	31(J-)	—	NA
RE03-99-2005	03-14227	4.0–4.5	Fill	—	—	NA	NA	5.7	—	NA
<b>AOC C-03-016</b>										
RE03-03-52402	03-22534	4.0–5.0	Qbt 4	NA	NA	NA	NA	5900	390	NA
RE03-03-52403	03-22534	9.5–10.0	Qbt 4	NA	NA	NA	NA	7100	770	NA
<b>AOC 03-027</b>										
RE03-99-2000	03-14225	7.0–7.5	Fill	—	—	NA	NA	160(J-)	0.048(J)	NA
RE03-99-2001	03-14225	7.5–8.0	Fill	—	—	NA	NA	240(J-)	0.17(J-)	NA
RE03-99-2212	03-14225	9.0–9.5	Qbt 3	NA	NA	NA	NA	1.8(J)	NA	NA
RE03-99-2002	03-14226	7.0–7.5	Fill	—	—	NA	NA	14	—	NA
RE03-99-2003	03-14226	7.5–8.0	Fill	—	—	NA	NA	27(J-)	0.038(J-)	NA
RE03-99-2006	03-14228	7.5–8.0	Fill	—	—	NA	NA	5.5	—	NA
RE03-99-2213	03-14230	8.5–9.0	Qbt 3	NA	NA	NA	NA	3.6(J)	NA	NA
RE03-99-2214	03-14231	8.5–9.0	Qbt 3	NA	NA	NA	NA	3(J)	NA	NA

Table 4.1-6 (continued)

Sample ID	Location ID	Depth (ft)	Media	PCBs		Herbicides		TPH		
				Aroclor-1254	Aroclor-1260	MCPA	MCPP	DRO	GRO	LRO
<b>AOC 03-036(b)</b>										
RE03-03-52377	03-22529	11.0–11.5	Qbt 4	NA	NA	NA	NA	46	0.38	NA
RE03-03-52378	03-22529	14.5–15.0	Qbt 4	NA	NA	NA	NA	—	0.23	NA
RE03-03-52379	03-22529	19.5–20.0	Qbt 4	NA	NA	NA	NA	—	0.64	NA
RE03-03-52382	03-22530	10.0–11.0	Soil	NA	NA	NA	NA	—	0.18	NA
RE03-03-52383	03-22530	14.5–15.0	Qbt 4	NA	NA	NA	NA	51	0.47	NA
RE03-03-52384	03-22530	19.5–20.0	Qbt 4	NA	NA	NA	NA	—	0.18	NA

Note: All values in mg/kg.

<sup>a</sup> — = Not detected or not detected above BV.

<sup>b</sup> NA = Not analyzed.

**Table 4.1-7  
Summary of Radionuclides Detected or Detected Above BVs/FVs for TA-03 Sites**

Sample ID	Location ID	Depth (ft)	Media	Gross Alpha	Gross Beta	Plutonium-239/240	Strontium-90	Tritium	Uranium-234	Uranium-235	Uranium-238
<b>Soil/Fill BV/FV</b>				na <sup>a</sup>	na	0.054	1.31	na	2.59	0.2	2.29
<b>Qbt 4 BV/FV</b>				na	na	na	na	na	1.98	0.09	1.93
<b>Consolidated Unit 03-014(a)-99</b>											
<b>SWMU 03-014(l)</b>											
0103-97-0016	03-03265	2.67-3.67	Qbt 4	NA <sup>b</sup>	NA	— <sup>c</sup>	—	0.04	—	—	—
<b>SWMU 03-014(o)</b>											
0103-97-0024	03-03203	0.0-0.5	Fill	NA	NA	0.088	—	NA	—	—	—
0103-97-0027	03-03204	0.00-0.83	Fill	NA	NA	0.017	—	0.286	—	—	—
0103-97-0028	03-03204	1.75-2.75	Qbt 4	NA	NA	—	3.2	—	—	—	—
0103-97-0030	03-03205	0.00-0.75	Fill	NA	NA	0.131	8.01	2.906	2.68	—	—
0103-97-0031	03-03205	1.25-2.25	Qbt 4	NA	NA	0.186	—	—	—	—	—
<b>SWMU 03-056(k)</b>											
0103-97-0171	03-03289	0.0-1.0	Fill	6.1	5.9	NA	NA	NA	—	—	4.44
0103-97-0173	03-03290	0.0-1.0	Fill	NA	NA	NA	NA	NA	—	—	10.07
0103-97-0174	03-03290	1.0-1.5	Fill	NA	NA	NA	NA	NA	—	0.203	7.13

Note: All values in pCi/g. BV/FV are provided in LANL 1998, 059730.

<sup>a</sup> na = Not available.

<sup>b</sup> NA = Not analyzed.

<sup>c</sup> — = Not detected or not detected above BV/FV.

**Table 4.1-8  
Summary of Inorganic Chemicals Detected in Debris and Engineered Material for TA-03 Sites**

Sample ID	Location ID	Depth (ft)	Media	Aluminum	Antimony	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium	Cobalt	Copper	Iron	Lead	Magnesium	Manganese	Nickel	Potassium	Selenium	Silver	Sodium	Thallium	Vanadium	Zinc	
<b>SWMU 03-056(a)</b>																										
RC03-01-0046	03-14485	0.0-0.5	Debris	3340	—*	2.7	67.5	0.23	—	5830(J)	7.1	2.6	7.5(J)	7550	7.3	1740	139	9.8(J)	759	—	—	259	—	16.4	21.7(J)	
RC03-01-0047	03-14486	0.0-0.5	Debris	3200	—	1.7	51	0.23	—	5370(J)	7.4	2.5	8(J)	7160	5.5	1780	133	7.8	663	—	—	306	—	15.4	18.4(J)	
RC03-01-0048	03-14487	0.0-0.5	Debris	2420	0.24	1.2	43.1	0.25	0.1	6660(J)	3.8	2	4.7	6170	7	1250	126	5	839	—	0.36	121	—	12.1	56.7(J)	
RC03-01-0049	03-14488	0.0-0.25	Debris	6090	—	2	77.7	0.41	—	10900(J)	8.9	3.1	6.9(J)	10600	5.1	2760	182	6.8	1790	—	—	187	—	20.7	42.2	
<b>SWMU 03-056(l)</b>																										
RE03-03-51685	03-22331	0.0-0.4921	Engineered Material	3810	—	3.49	33.2	0.313	0.262	802	2.74	1.13	6.83	4970(J+)	8.98	441	154	4.36	470	2.92	—	911	2.82	6.26	34.4	
RE03-03-51687	03-22332	0.0-0.4921	Engineered Material	1780	—	0.911	93.5	—	0.05	9920	2.49	0.906	6.32	2870(J+)	2.08	747	135	5.38	340	0.116	—	876	—	8.31	10.4	
RE03-03-51689	03-22333	0.0-0.6562	Engineered Material	2150	—	1.62	29.8	0.263	0.08	3780	5.61	1.85	9.32	4600(J+)	4.43	1290	150	6.76	452	0.478	—	746	—	9.27	16.5	

Note: All values in mg/kg.

\* — = Not detected.



**Table 4.1-9**  
**Summary of Organic Chemicals Detected in Debris and Sludge for TA-03 Sites**

Sample ID	Location ID	Depth (ft)	Media	Aroclor-1254	LRO
<b>SWMU 03-003(c)</b>					
RC03-01-0013	03-14455	0.0–0.25	Debris	14	NA*
RC03-01-0014	03-14456	0.0–0.25	Debris	0.64	NA
<b>Consolidated Unit 03-014(a)-99</b>					
<b>SWMU 03-014(n)</b>					
0103-97-0341	03-603357	0.0–0.5	Sludge	NA	580

Note: All values in mg/kg.

\* NA = Not analyzed.

**Table 4.1-10**  
**Summary of Radionuclides Detected in Engineered Material for TA-03 Sites**

Sample ID	Location ID	Depth (ft)	Media	Cesium-134	Cesium-137	Gross alpha	Gross beta	Uranium-234	Uranium-235	Uranium-238
<b>AOC 03-056(k)</b>										
0103-97-0151	03-03281	0.0–0.17	Engineered Material	NA*	NA	NA	NA	0.801	0.076	2.91
0103-97-0154	03-03282	0.0–0.5	Engineered Material	0.101	0.22	6.1	10.8	1.39	0.144	4.71
0103-97-0157	03-03283	0.0–0.25	Engineered Material	NA	NA	NA	NA	0.607	0.071	1.59
0103-97-0160	03-03284	0.0–0.17	Engineered Material	NA	NA	NA	NA	1.07	0.092	2.01

Note: All values in pCi/g.

\* NA = Not analyzed.

**Table 4.1-11  
Summary of Inorganic Chemical Screening-Level Results for TA-03 Sites**

Sample ID	Location	Depth (ft)	Media	Aluminum	Antimony	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium	Cobalt	Copper	Cyanide (Total)	Iron	Lead	Magnesium	Manganese	Mercury	Nickel	Potassium	Selenium	Silver	Sodium	Thallium	Vanadium	Zinc	
<b>Soil/Fill BV</b>				<b>29200</b>	<b>0.83</b>	<b>8.17</b>	<b>295</b>	<b>1.83</b>	<b>0.4</b>	<b>6120</b>	<b>19.3</b>	<b>8.64</b>	<b>14.7</b>	<b>0.5</b>	<b>21500</b>	<b>22.3</b>	<b>4610</b>	<b>671</b>	<b>0.1</b>	<b>15.4</b>	<b>3460</b>	<b>1.52</b>	<b>1</b>	<b>915</b>	<b>0.73</b>	<b>39.6</b>	<b>48.8</b>	
<b>Sediment BV</b>				<b>15400</b>	<b>0.83</b>	<b>3.98</b>	<b>127</b>	<b>1.31</b>	<b>0.4</b>	<b>4420</b>	<b>10.5</b>	<b>4.73</b>	<b>11.2</b>	<b>0.82</b>	<b>13800</b>	<b>19.7</b>	<b>2370</b>	<b>543</b>	<b>0.1</b>	<b>9.38</b>	<b>2690</b>	<b>0.3</b>	<b>1</b>	<b>1470</b>	<b>0.73</b>	<b>19.7</b>	<b>60.2</b>	
<b>SWMU 03-002(c)</b>																												
AAB6034	03-02300	0.0-0.5	Fill	8440	<5.6 <sup>a</sup>	<1.4	341	<1.2	<1.1	6220	5.8	<11.7	<5.1	NA <sup>b</sup>	10100	11.2	1330	1410	<0.08	<7.9	<1130	<0.53	<0.98	<235	<0.53	21.5	25.5	
AAB6037	03-02301	0.0-0.5	Fill	7190	<5.1	<0.95	59	<0.89	<1	3750	7.4	<3.5	<5.2	NA	7890	10.4	<1150	106	<0.03	<6.3	<959	<0.49	<0.9	<189	<0.49	28.6	23.9	
AAB6038	03-02302	0.0-0.5	Fill	7090	<5.2	<1.1	96.8	<0.9	1.5	9360	6.9	<5	<6.1	NA	8060	12.5	<1060	311	0.14	<6.8	<1010	<0.49	<0.91	<509	<0.49	13.4	41.3	
AAB6039	03-02303	0.0-0.5	Fill	7740	<5.1	<0.91	72.7	<0.85	<1	5540	6.1	<7.2	10.6	NA	10900	18.4	1230	204	<0.04	<8.4	<1070	<0.49	12.5	<343	<0.49	15.3	88.8	
AAB6035	03-02304	0.0-0.25	Fill	3480	<4.5	<1.2	57.9	<0.47	<0.86	8480	13.1	<3.8	10.7	NA	8470	21.5	1750	182	<0.03	10.8	<825	<0.43	<0.8	<464	<0.43	14.4	61.6	
<b>Consolidated Unit 03-012(b)-00</b>																												
<b>SWMU 03-012(b)</b>																												
AAB5881	03-02118	0.0-0.5	Soil	NA	<0.45	<2.3	<46.9	<0.38	<0.96	NA	130	NA	NA	NA	NA	21.4	NA	NA	NA	<6.5	NA	<0.72	25.8	NA	<0.69	NA	NA	
AAB5882	03-02119	0.0-0.5	Soil	NA	<0.44	10.1	211	<0.18	5.2	NA	2080	NA	NA	NA	NA	224	NA	NA	NA	19.8	NA	<0.71	108	NA	<0.68	NA	NA	
AAB5883	03-02120	0.0-0.5	Sediment	NA	<0.45	<0.97	<28	<0.13	<0.05	NA	8.3	NA	NA	NA	NA	8.1	NA	NA	NA	<3.6	NA	<0.73	<0.08	NA	<0.7	NA	NA	
AAB5884	03-02121	0.0-0.5	Engineered Material	NA	<0.44	<1.1	<20.9	<0.1	<0.07	NA	4.4	NA	NA	NA	NA	8.3	NA	NA	NA	<2.3	NA	<0.72	<0.07	NA	<0.69	NA	NA	
AAB5885	03-02122	0.0-0.5	Sediment	NA	<0.43	<0.83	<16	<0.08	<0.24	NA	2.7	NA	NA	NA	NA	6.2	NA	NA	NA	<1.6	NA	<0.69	<0.12	NA	<0.67	NA	NA	
<b>Consolidated Unit 03-013(a)-00</b>																												
AAB6023	03-02600	0.0-0.33	Sediment	2160	<4.5	<0.43	<35.9	<0.28	<0.51	3690	9.9	<2	114	NA	3900	60.6	<776	142	<0.03	<6.8	<389	<0.57	<1.7	<106	<0.43	<5.4	94.6	
AAB6026	03-02601	0.0-0.25	Sediment	1340	<4.7	<0.45	<27.2	<0.33	<0.52	1720	2.3	<2.6	5.9	NA	4380	42.4	<759	77.5	<0.03	<3.2	<376	<0.45	<0.83	<121	<0.45	<5.2	107	
AAB6029	03-02601	0.0-0.25	Sediment	1480	<5.5	<0.53	<31.3	<0.39	<0.45	<1160	3	<2	6.7	NA	5730	13.9	<735	86.7	<0.03	<4.3	<412	<0.53	<0.97	<85.9	<0.53	<9.1	80.9	
AAB6027	03-02602	0.0-0.5	Sediment	1980	<5.5	<0.52	<40.2	<0.43	<0.58	2230	16.5	<2.1	10.1	NA	4310	14.1	<725	67.2	0.14	<4.9	<446	<0.52	<0.96	<118	<0.52	<6.1	111	
AAB6028	03-02603	0.0-0.5	Sediment	1550	<5.7	<0.54	<31.5	<0.31	<0.46	3260	3.6	<1.6	<5.2	NA	3480	15	<711	75.2	<0.03	<4.3	<438	<0.54	<1	<114	<0.54	<4.8	72.7	
AAB6030	03-02604	0.0-0.67	Sediment	2260	<4.4	<0.48	<31	<0.44	<0.58	2120	5.4	<2.5	6.7	NA	3320	49.4	<780	117	<0.03	<3.7	<472	<0.42	<0.78	<203	<0.42	<5.7	83.9	
<b>Consolidated Unit 03-014(a)-99</b>																												
<b>SWMU 03-014(a)</b>																												
AAB5944	03-02100	0.0-1.0	Soil	7310	<4.8	<1.4	70.5	<0.69	2.4	<991	30.6	<2.2	68.6	NA	9830	45.8	1170	258	0.14	<6.6	<1060	<0.45	20.2	<225	<0.45	12	94.7	
AAB5952	03-02100	1.0-1.5	Soil	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	2.2	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	
AAB5945	03-02101	0.0-1.0	Soil	7360	<4.4	3.1	136	<0.69	2.3	2480	164	<3.8	159	NA	11100	115	1170	341	0.67	<8.3	<1020	<0.42	81.2	<143	<0.42	20.1	111	
AAB5953	03-02101	1.0-1.5	Soil	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	4.9	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	
AAB5947	03-02102	0.0-1.0	Soil	11700	<4.7	3.6	169	1.3	4	2620	239	<8.4	210	NA	17400	102	1950	472	0.14	10.6	1240	<0.45	110	<425	<0.45	30.6	125	
AAB5954	03-02102	1.0-1.5	Soil	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	<0.48	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	
AAB5948	03-02103	0.0-1.0	Soil	5950	<4.6	<1.9	116	<0.76	3.4	1730	200	<2.6	220	NA	7420	76.4	1350	193	2.6	10.6	<950	<0.44	106	<180	<0.44	13.9	113	
AAB5955	03-02103	1.0-1.5	Soil	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	0.62	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	
AAB5949	03-02104	0.0-1.0	Soil	7730	<4.6	<1.8	132	<0.7	3	1590	209	<2.7	203	NA	8410	93	1170	272	0.21	<8.5	<910	<0.44	106	<259	<0.44	17.2	104	
AAB5956	03-02104	1.0-1.5	Soil	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	<0.53	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	

Table 4.1-11 (continued)

Sample ID	Location	Depth (ft)	Media	Aluminum	Antimony	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium	Cobalt	Copper	Cyanide (Total)	Iron	Lead	Magnesium	Manganese	Mercury	Nickel	Potassium	Selenium	Silver	Sodium	Thallium	Vanadium	Zinc
<b>AOO 03-014(b2)</b>																											
AAB5930	03-02105	0.0–1.0	Soil	NA	<0.43	<1.1	<22.1	<0.45	<0.05	NA	2.6	NA	NA	NA	NA	8.4	NA	NA	NA	<1.5	NA	<0.69	<0.61	NA	<0.66	NA	NA
AAB5931	03-02106	0.0–1.0	Soil	NA	<0.58	<1.6	<57.4	<0.33	<0.29	NA	86	NA	NA	NA	NA	30.5	NA	NA	NA	<4.4	NA	<0.94	42.4	NA	<0.91	NA	NA
AAB5934	03-02107	0.0–1.0	Soil	NA	<0.53	<2	<53.6	<0.51	<0.1	NA	10.8	NA	NA	NA	NA	17.7	NA	NA	NA	<2.6	NA	<0.85	5.5	NA	<0.82	NA	NA
AAB5935	03-02108	0.0–0.5	Soil	NA	<0.49	2.9	60.8	<0.41	<0.32	NA	4.1	NA	NA	NA	NA	30.2	NA	NA	NA	<2.9	NA	<0.79	<0.62	NA	<0.77	NA	NA
<b>AOO 03-014(c2)</b>																											
AAB5907	03-02109	0.0–1.0	Sediment	3330	<4.5	<0.67	<37.3	<0.52	<1.1	1860	4.2	<0.8	<5.1	NA	6440	1550	<948	242	<0.03	<1.3	<513	<0.43	<1.9	<115	<0.43	<6.8	28.2
AAB5908	03-02110	0.0–1.0	Sediment	6500	<4.5	<1.3	68.8	<0.65	<1.1	1850	5.8	<1.4	11.1	NA	8710	27	1150	191	<0.09	<2.3	1080	<0.42	<1.8	<106	<0.42	<9.7	42.7
AAB5909	03-02110	0.67–1.0	Sediment	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	<0.4	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
AAB5910	03-02110	1.0–1.5	Sediment	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	<0.4	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
AAB5911	03-02111	0.0–1.0	Sediment	5240	<4.4	<0.66	45.7	<0.78	1.4	1160	2.8	<2	<2.9	NA	9740	13.3	<1050	235	<0.03	<3.6	<860	<0.42	<0.78	<96.9	<0.42	<9	39.4
AAB5913	03-02111	1.0–1.5	Sediment	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	<0.39	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
AAB5912	03-02112	0.0–1.0	Sediment	3720	<4.5	2.3	47.4	<0.4	7.3	2600	118	<1.2	105	NA	11800	39.7	<865	179	1.3	26.5	<717	<0.43	60.2	<120	<0.43	<7.3	106
AAB5914	03-02112	0.67–1.0	Sediment	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	8.5	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
AAB5915	03-02113	0.0–1.0	Sediment	4160	<4.5	<0.66	84.2	<0.4	1.7	1940	61.4	<1.4	36.9	NA	5960	17.8	1090	194	0.26	<6.8	<779	<0.43	29.2	<194	<0.43	<8.6	52.2
AAB5916	03-02113	1.0–1.5	Sediment	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	32.1	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
AAB5917	03-02114	0.0–1.0	Sediment	5120	<4.5	<1.7	46.4	<0.62	2	1610	11.5	<1.1	16.7	NA	8570	9.7	1140	243	0.23	11.3	<923	<0.43	3	<136	<0.43	<9.7	40.2
AAB5919	03-02114	1.0–1.5	Sediment	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	<0.42	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
AAB5918	03-02115	0.0–0.5	Sediment	3680	<4.4	<0.78	89.4	<0.38	1.4	6970	67.8	<1.7	30.2	NA	6190	18.4	1120	184	0.25	<4.3	<749	<0.42	32	<124	<0.42	<8	49.2
AAB5921	03-02115	0.33–0.5	Sediment	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	14.4	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
AAB5929	03-02115	0.33–0.5	Sediment	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	13.6	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
AAB5922	03-02116	0.0–0.67	Sediment	2880	<4.3	<0.64	45.8	<0.39	<0.82	2180	30.9	<0.79	26.3	NA	4680	10.5	<702	126	0.14	<2.1	<645	<0.41	15.3	<185	<0.41	<5.2	30.7
AAB5924	03-02116	0.0–0.67	Sediment	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	7.8	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
AAB5923	03-02117	0.0–0.5	Sediment	3370	<4.6	<1.4	<38.3	<0.4	1.3	1280	74.9	<0.77	52.9	NA	5560	15.5	<588	61.6	0.5	12.6	<727	<0.44	32.6	<180	<0.44	<8.8	39.9
AAB5925	03-02117	0.0–0.5	Sediment	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	17.4	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
<b>Consolidated Unit 03-015-00</b>																											
<b>SWMU 03-015</b>																											
AAB5809	03-02000	0.0–1.5	Soil	NA	<0.83	3.7	134	<0.96	<0.75	NA	16.1	NA	NA	NA	NA	71.5	NA	NA	2.4	16.5	NA	1.2	2.7	NA	<0.64	NA	NA
AAB5810	03-02001	0.0–1.5	Soil	NA	<0.39	4.4	105	<0.74	<0.23	NA	13	NA	NA	NA	NA	22.1	NA	NA	NA	<8.4	NA	<1	<0.07	NA	<0.61	NA	NA
AAB5811	03-02002	0.0–1.5	Soil	NA	<0.4	4.2	150	<0.8	<0.07	NA	11.7	NA	NA	NA	NA	15.1	NA	NA	NA	<7.7	NA	<0.65	<0.07	NA	<0.62	NA	NA
AAB5812	03-02003	0.0–1.5	Soil	NA	<0.47	5.1	129	<0.9	<0.11	NA	10.8	NA	NA	NA	NA	20.8	NA	NA	NA	<7.6	NA	<0.64	<0.07	NA	<0.62	NA	NA
<b>AOO 03-047(d)</b>																											
VCXX-95-0082	03-09008	0.0–0.5	Soil	4690	<0.992	2.19	52.2	0.417	0.562	3240	13	2.14	18.3	NA	8430	21.7	1120	175	0.637	6.16	790	0.372	<0.992	132	<0.992	10.5	71.6
VCXX-95-0083	03-09009	0.0–0.5	Soil	4870	<0.992	2.13	38.7	0.545	<0.496	1120	4.73	1.29	5.28	NA	8660	13	915	197	0.0561	3.41	732	0.346	<0.992	231	<0.992	7.91	43.3
VCXX-95-0084	03-09010	0.0–0.5	Soil	4450	0.246	2.56	217	0.354	0.346	6040	13.2	2.87	16.9	NA	10100	391	1050	198	0.15	7.63	723	0.518	<0.995	81.4	<0.995	12.4	125



Table 4.1-11 (continued)

Sample ID	Location	Depth (ft)	Media	Aluminum	Antimony	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium	Cobalt	Copper	Cyanide (Total)	Iron	Lead	Magnesium	Manganese	Mercury	Nickel	Potassium	Selenium	Silver	Sodium	Thallium	Vanadium	Zinc
<b>AOC 03-051(c)</b>																											
VCXX-95-0091	03-09012	0.0–0.5	Soil	8810	<0.941	2.7	64.7	0.566	0.862	1070	6.27	2.52	3.73	NA	10800	18.3	1270	210	<0.0305	4.25	1020	<0.47	<0.941	115	<0.941	15.1	34.4
VCXX-95-0092	03-09013	0.0–0.5	Soil	15300	<0.953	3.71	94.8	0.874	1.34	2830	14.1	3.9	7.63	NA	16200	199	2730	444	<0.0328	7.48	1980	<0.477	<0.953	126	<0.953	26.6	305
VCXX-95-0093	03-09014	0.0–0.5	Soil	6520	<0.936	2.34	52.8	0.471	0.808	1110	4.43	2.35	3.2	NA	10100	17.9	1130	247	<0.0319	4.88	760	<0.468	<0.936	102	<2.34	10.2	42.1
VCXX-95-0094	03-09015	0.0–0.5	Soil	11800	0.319	4.04	115	0.796	1.07	1950	9.23	6.03	6.19	NA	13800	18.4	1790	442	<0.0261	6.74	1180	<0.47	<0.94	98.2	<2.35	26.2	27.5

Note: All values in mg/kg. Shaded values denote results detected above BV.

<sup>a</sup> < = Result is not detected.

<sup>b</sup> NA = Not analyzed.

Table 4.1-12  
Summary of VOC Screening-Level Results for TA-03 Sites

Sample ID	Location ID	Depth (ft)	Media	Acetone	Isopropyltoluene 4-	Methylene Chloride	Toluene
<b>Consolidated Unit 03-014(a)-99</b>							
<b>AOC 03-014(b2)</b>							
AAB5930	03-02105	0.0–1.0	Soil	<0.074 <sup>a</sup>	0.28	<0.007	0.008
<b>AOC 03-047(d)</b>							
VCXX-95-0082	03-09008	0.0–0.5	Soil	0.0134	NA <sup>b</sup>	0.00267	<0.002
VCXX-95-0083	03-09009	0.0–0.5	Soil	0.0487	NA	0.00508	<0.002
VCXX-95-0084	03-09010	0.0–0.5	Soil	0.00994	NA	0.0028	<0.002

Note: All values in mg/kg. Shaded values denote detected results.

<sup>a</sup> < = Result is not detected.

<sup>b</sup> NA = Not analyzed.

**Table 4.1-13  
Summary of SVOC Screening-Level Results for TA-03 Sites**

Sample ID	Location ID	Depth (ft)	Media Code	Acenaphthene	Anthracene	Benzo(a)anthracene	Benzo(a)pyrene	Benzo(b)fluoranthene	Benzo(g,h,i)perylene	Benzo(k)fluoranthene	Bis(2-ethylhexyl)phthalate	Chrysene	Dibenz(a,h)anthracene	Dibenzofuran	Fluoranthene	Fluorene	Indeno(1,2,3-cd)pyrene	Naphthalene	Phenanthrene	Pyrene
<b>Consolidated Unit 03-012(b)-00</b>																				
<b>SWMU 03-012(b)</b>																				
AAB5881	03-02118	0-0.5	Soil	<0.41*	<0.41	<0.41	<0.41	<0.41	<0.41	<0.41	<0.41	<0.41	<0.41	<0.41	0.41	<0.41	<0.41	<0.41	<0.41	<0.41
AAB5882	03-02119	0-0.5	Soil	<0.44	1.5	5.9	4.1	4.9	1.2	1.2	<0.44	3.5	0.5	<0.44	11	<0.44	1.6	<0.44	6.3	7.8
<b>Consolidated Unit 03-014(a)-99</b>																				
<b>AOC 03-014(b2)</b>																				
AAB5931	03-02106	0-1	Soil	<0.58	<0.58	<0.58	<0.58	<0.58	<0.58	<0.58	0.6	<0.58	<0.58	<0.58	<0.58	<0.58	<0.58	<0.58	<0.58	<0.58
<b>AOC 03-014(c2)</b>																				
AAB5912	03-02112	0-1	Sediment	<0.35	<0.35	<0.35	1.8	1.7	0.43	2	<0.35	1.8	<0.35	<0.35	3.2	<0.35	0.66	<0.35	1.3	3.2
<b>Consolidated Unit 03-015-00</b>																				
<b>SWMU 03-015</b>																				
AAB5809	03-02000	0-1.5	Soil	12	22	63	57	54	40	38	<3.8	60	14	5.6	120	10	45	7.2	88	120
AAB5810	03-02001	0-1.5	Soil	<0.36	<0.36	<0.36	<0.36	<0.36	<0.36	<0.36	<0.36	<0.36	<0.36	<0.36	0.52	<0.36	<0.36	<0.36	<0.36	0.44
<b>AOC 03-047(d)</b>																				
VCXX-95-0082	03-09008	0-0.5	Soil	<13.2	<13.2	<13.2	21.9	31.3	<13.2	<13.2	<13.2	<13.2	<13.2	<13.2	60.1	<13.2	11.6	<13.2	49.6	43
VCXX-95-0084	03-09010	0-0.5	Soil	<12.9	<12.9	<12.9	10.1	13.4	<12.9	<12.9	<12.9	9.57	<12.9	<12.9	29.1	<12.9	<12.9	<12.9	23.5	20.7

Note: All values in mg/kg. Shaded values denote detected results.

\* < = Result is not detected.

**Table 4.1-14  
Summary of PCB Screening-Level Results for TA-03 Sites**

Sample ID	Location ID	Depth (ft)	Media Code	Aroclor-1254	Aroclor-1260	Total PCB
<b>Consolidated Unit 03-012(b)-00</b>						
<b>SWMU 03-012(b)</b>						
AAB5881	03-02118	0-0.5	Soil	<0.21 <sup>a</sup>	6.2	NA <sup>b</sup>
AAB7668	03-02118	0-0.5	Soil	<2.2	4.5	<8.3
AAB7703	03-02118	0-0.5	Soil	<0.064	7.6	7.6
AAB5882	03-02119	0-0.5	Soil	<0.88	0.83	NA
<b>Consolidated Unit 03-013(a)-00</b>						
AAB6029	03-02601	0-0.25	Sediment	0.021	<0.0156	0.021
<b>Consolidated Unit 03-014(a)-99</b>						
<b>SWMU 03-014(a)</b>						
AAB5944	03-02100	0-1	Soil	<0.037	0.18	NA
AAB5945	03-02101	0-1	Soil	<0.035	0.73	NA
AAB5947	03-02102	0-1	Soil	<0.037	0.42	NA
AAB5949	03-02104	0-1	Soil	<0.037	0.36	NA
<b>AOC 03-014(c2)</b>						
AAB5907	03-02109	0-1	Sediment	<0.035	0.16	NA
AAB5908	03-02110	0-1	Sediment	<0.035	0.3	NA
AAB5911	03-02111	0-1	Sediment	<0.035	0.34	NA
AAB5912	03-02112	0-1	Sediment	<1.1	0.63	NA
AAB5915	03-02113	0-1	Sediment	<0.035	0.25	NA
AAB5917	03-02114	0-1	Sediment	<0.035	0.38	NA
AAB5922	03-02116	0-0.67	Sediment	<0.034	0.15	NA
AAB5923	03-02117	0-0.5	Sediment	<0.108	0.19	NA
<b>AOC 03-047(d)</b>						
VCXX-95-0083	03-09009	0-0.5	Soil	<0.0333	0.0866	NA
VCXX-95-0084	03-09010	0-0.5	Soil	<0.331	1.19	NA

Note: All values in mg/kg. Shaded values denote detected results.

<sup>a</sup> < = Result is not detected.

<sup>b</sup> NA = Not analyzed.



**Table 4.1-15**  
**Summary of Radionuclide Screening-Level Results for TA-03 Sites**

Sample ID	Location ID	Depth (ft)	Media	Americium-241	Cesium-137	Cobalt-60	Europium-152	Gross alpha	Gross beta	Plutonium-238	Plutonium-239/240	Strontium-90	Tritium	Uranium-234	Uranium-235	Uranium-238
<b>Soil BV/FV</b>				<b>0.013</b>	<b>1.65</b>	<b>na<sup>a</sup></b>	<b>na</b>	<b>na</b>	<b>na</b>	<b>0.023</b>	<b>0.054</b>	<b>1.31</b>	<b>na</b>	<b>2.59</b>	<b>0.2</b>	<b>2.29</b>
<b>Sediment BV/FV</b>				<b>0.04</b>	<b>0.9</b>	<b>na</b>	<b>na</b>	<b>na</b>	<b>na</b>	<b>0.006</b>	<b>0.068</b>	<b>1.04</b>	<b>na</b>	<b>2.59</b>	<b>0.2</b>	<b>2.29</b>
<b>Consolidated Unit 03-012(b)-00</b>																
<b>SWMU 03-012(b)</b>																
AAB5881	03-02118	0.0–0.5	Soil	<0.002 <sup>b</sup>	0.232	<0	<-0.017	4.21	2.54	NA	NA	NA	<0.0891	NA	NA	NA
AAB5882	03-02119	0.0–0.5	Soil	<0.054	0.307	<-0.037	<0.014	8	5.03	0.1	0.81	<-0.05	0.420	5.68	0.22	3.81
AAB7669	03-02121	0.0–0.5	Sediment	NA <sup>c</sup>	NA	NA	NA	<-14.67	<-34.65	NA	NA	NA	1.5	NA	NA	NA
AAB7702	03-02122	0.0–0.5	Sediment	NA	NA	NA	NA	<-7.34	<-15.07	NA	NA	NA	6.66	NA	NA	NA
<b>Consolidated Unit 03-014(a)-99</b>																
<b>SWMU 03-014(a)</b>																
AAB5944	03-02100	0.0–1.0	Soil	<0.022	<0.053	<-0.006	<0.086	<-44.02	<-42.94	0.07	0.047	<0.5	<0	1.482	0.056	1.059
AAB5945	03-02101	0.0–1.0	Soil	<0.177	<0.091	<-0.006	<0.135	<-14.67	<-24.86	0.097	0.57	<0.06	<0	2.734	0.131	1.284
AAB5947	03-02102	0.0–1.0	Soil	<0.025	0.301	<0.016	<0.075	<-44.02	<-45.95	0.178	0.113	<-0.12	<0	10.011	0.543	2.581
AAB5954	03-02102	1.0–1.5	Soil	NA	NA	NA	NA	<-44.02	<-59.51	NA	NA	NA	0.94	NA	NA	NA
AAB5948	03-02103	0.0–1.0	Soil	<0.14	0.145	<-0.022	<0.021	<29.35	<-18.83	0.135	0.164	<-0.04	<0.6	2.644	0.113	1.633
AAB5949	03-02104	0.0–1.0	Soil	0.068	0.271	<0.013	<0.147	<-29.35	<-30.88	0.144	0.074	<-0.17	<0	2.757	0.092	2.16
<b>SWMU 03-014(b2)</b>																
AAB5930	03-02105	0.0–1.0	Soil	<0.078	<0.037	<0.019	<0.111	2.7	1.73	NA	NA	NA	<0.0319	NA	NA	NA
AAB5931	03-02106	0.0–1.0	Soil	<0.025	0.904	0.07	<0.151	3.59	3.92	NA	NA	NA	<0.304	NA	NA	NA
AAB5934	03-02107	0.0–1.0	Soil	<0.028	0.797	<-0.041	<0.169	6.3	4.62	NA	NA	NA	<0.0339	NA	NA	NA
AAB5935	03-02108	0.0–0.5	Soil	<0.076	2.44	<0.005	<-0.042	7.42	9.7	NA	NA	0.66	<0.185	NA	NA	NA
<b>SWMU 03-014(c2)</b>																
AAB5907	03-02109	0.0–1.0	Sediment	<0	0.173	<0.012	<0.073	<-29.35	<-32.39	0.009	<-0.002	<0.03	<0.03	0.617	0.029	0.628
AAB5908	03-02110	0.0–1.0	Sediment	<0.104	0.101	<-0.042	<0.159	<14.67	<-18.83	0.02	<0.002	<0.37	<0	0.689	0.011	0.68
AAB5911	03-02111	0.0–1.0	Sediment	<0.023	<0.034	<0.015	0.44	<-44.02	<-35.4	<-0.002	NA	<0.07	<0	0.554	0.034	0.507
AAB5912	03-02112	0.0–1.0	Sediment	<0.045	0.235	<0.039	<0.141	<-44.02	<-26.36	0.007	0.257	<0.01	<0.44	2.41	0.104	1.117
AAB5915	03-02113	0.0–1.0	Sediment	<0.005	0.067	<-0.042	<0.07	<-44.02	<-56.49	0.002	0.065	<-0.22	1.03	1.248	0.056	0.863
AAB5917	03-02114	0.0–1.0	Sediment	<0.04	<0.041	<-0.008	<0.171	<-29.35	<-29.38	<-0.009	0.011	<-0.14	<0.87	0.899	0.032	0.689
AAB5918	03-02115	0.0–0.5	Sediment	<0.031	<0.079	<-0.002	<0.004	<-44.02	<-44.44	0.014	0.011	<-1.31	<0.54	1.095	0.059	0.869
AAB5922	03-02116	0–0.67	Sediment	<0.052	<0.038	<-0.003	0.214	<-29.35	<-44.44	0.007	0.005	<0.27	<0.47	0.759	0.032	0.768
AAB5923	03-02117	0.0–0.5	Sediment	<0.028	0.206	<-0.021	<0.146	<-44.02	<-54.99	0.016	0.029	<0	3.14	1.815	0.101	1.468

Table 4.1-15 (continued)

Sample ID	Location ID	Depth (ft)	Media	Americium-241	Cesium-137	Cobalt-60	Europium-152	Gross alpha	Gross beta	Plutonium-238	Plutonium-239/240	Strontium-90	Tritium	Uranium-234	Uranium-235	Uranium-238
<b>Soil BV/FV</b>				<b>0.013</b>	<b>1.65</b>	na <sup>a</sup>	na	na	na	<b>0.023</b>	<b>0.054</b>	<b>1.31</b>	na	<b>2.59</b>	<b>0.2</b>	<b>2.29</b>
<b>Sediment BV/FV</b>				<b>0.04</b>	<b>0.9</b>	na	na	na	na	<b>0.006</b>	<b>0.068</b>	<b>1.04</b>	na	<b>2.59</b>	<b>0.2</b>	<b>2.29</b>
<b>Consolidated Unit 03-015-00</b>																
<b>SWMU 03-015</b>																
AAB5809	03-02000	0.0–1.5	Soil	<0.042	0.191	<0.022	<0.061	23.2	15.2	<0.01	0.03	<-0.06	<0	6.31	0.31	6.29
AAB5810	03-02001	0.0–1.5	Soil	<0.072	0.068	<0.001	<0.12	<-29.35	<12.81	<0	<0.01	NA	<0	1.91	0.12	1.89
AAB5811	03-02002	0.0–1.5	Soil	<0.181	<0.026	<0.018	0.195	<-29.35	3.52	<-0.01	<0.01	NA	<0	0.95	0.07	0.99
<b>Consolidated Unit 03-059-00</b>																
<b>SWMU 03-059</b>																
AAB7771	03-02706	0.0–0.5	Engineered Material	NA	NA	NA	NA	<-7.38	<-16.01	NA	NA	NA	2.55	NA	NA	NA
AAB7774	03-02709	0.0–0.5	Engineered Material	NA	NA	NA	NA	<-7.38	<-22.42	NA	NA	NA	5.69	NA	NA	NA
AAB7777	03-02712	0.0–0.5	Engineered Material	NA	NA	NA	NA	<7.38	<30.96	NA	NA	NA	1.48	NA	NA	NA

Note: All values in pCi/g. Shaded values denote results detected above BV/FV. BV/FV are provided in LANL 1998, 059730.

<sup>a</sup> na = Not available.

<sup>b</sup> < = Result is not detected.

<sup>c</sup> NA = Not analyzed.

**Table 4.2-1  
Decision-Level Data from TA-60 Site Samples Collected and Analyses Requested**

Sample ID	Location ID	Depth (ft)	Media	Metals	PCBs	SVOCs	TPH	VOCs
<b>SWMU 60-002 (east and central)</b>								
RE60-03-52308	60-22517	4-4.5	Qbt 4	1884S	—*	1884S	1884S	1884S
RE60-03-52307	60-22517	8.5-9	Qbt 4	1884S	—	1884S	1884S	1884S
RE60-03-52309	60-22517	14.5-15	Qbt 4	1884S	—	1884S	1884S	1884S
RE60-03-52312	60-22518	4.5-5	Soil	1884S	—	1884S	1884S	1884S
RE60-03-52314	60-22518	14.5-15	Qbt 4	1884S	—	1884S	1884S	1884S
RE60-03-52317	60-22519	4.5-5	Soil	1884S	—	1884S	1884S	1884S
RE60-03-52320	60-22519	13.5-14	Qbt 4	1884S	—	1884S	1884S	1884S
RE60-03-52322	60-22520	3-3.5	Soil	1884S	—	1884S	1884S	1884S
RE60-03-52324	60-22520	14.5-15	Qbt 4	1884S	—	1884S	1884S	1884S
RE60-03-52327	60-22521	4-4.5	Soil	1884S	—	1884S	1884S	1884S
RE60-03-52329	60-22521	14.5-15	Qbt 4	1884S	—	1884S	1884S	1884S
RE60-03-52332	60-22522	5.5-6	Qbt 4	1884S	—	1884S	1884S	1884S
RE60-03-52334	60-22522	16-17	Qbt 4	1884S	—	1884S	1884S	1884S
RE60-04-53095	60-22680	0-1	Soil	2042S	2042S	2042S	2042S	2042S
RE60-04-53096	60-22680	1.5-2	Soil	2042S	2042S	2042S	2042S	2042S
RE60-04-53098	60-22681	0-1	Soil	2042S	2042S	2042S	2042S	2042S
RE60-04-53099	60-22681	1.5-2	Soil	2042S	2042S	2042S	2042S	2042S
RE60-04-53100	60-22682	0-1	Soil	2042S	2042S	2042S	2042S	2042S
RE60-04-53101	60-22682	1.5-2	Soil	—	2042S	—	2042S	2042S
<b>SWMU 60-007(a)</b>								
AAB5794	60-01019	0-1	Fill	—	—	—	—	18086
AAB5804	60-01019	0-1	Soil	20203	18086	18086	—	—
AAB5796	60-01021	0-1	Soil	—	—	—	—	18086
AAB5799	60-01024	0-1	Soil	—	—	—	—	18086
AAB5801	60-01025	0-1	Soil	20203	18086	18086	—	18086
AAB5806	60-01026	0-1	Soil	—	18086	—	—	18086
RC60-01-0003	60-10001	0-0.5	Fill	9408R	9407R	—	9407R	—
RC60-01-0004	60-10002	0-0.5	Fill	9408R	9407R	—	9407R	—
RC60-01-0005	60-10003	0-0.5	Fill	9408R	9407R	—	9407R	—
RC60-01-0006	60-10004	0-0.5	Fill	9408R	9407R	—	9407R	—
RC60-01-0007	60-10005	0-0.25	Fill	9408R	9407R	—	9407R	—
RC60-01-0008	60-10006	0-0.5	Fill	9408R	9407R	—	9407R	—

\*— = Analyses not requested.

**Table 4.2-2  
Screening-Level Data from TA-60 Site Samples Collected and Analyses Requested**

Sample ID	Location ID	Depth (ft)	Media	Gross Alpha/Beta Radiation	Gross Gamma Radiation	Tritium	Metals	PCBs	Pesticides	SVOCs	VOCs
<b>AOC 60-004(b)</b>											
AAB5769	60-01000	0.0–1.0	Soil	18896	18896	—*	18958	18084	18084	18084	—
AAB5875	60-01003	0.0–1.0	Soil	18896	18896	—	18958	18084	18084	18084	—
AAB5774	60-01005	0.0–1.0	Soil	18896	18896	—	—	—	—	—	18084
<b>AOC 60-004(f)</b>											
AAB7646	60-01322	0.0–0.5	Sediment	20713	20713	20713	19168	—	—	—	—
AAC0418	60-01322	2.0–2.5	Soil	20639	20639	20639	—	—	—	—	19731
AAC0419	60-01322	6.0–6.5	Qbt 4	20639	20639	20639	—	—	—	—	19731
AAC0417	60-01322	6.5–7.0	Qbt 4	20639	20639	20639	19990	19731	19731	19731	—
AAB7641	60-01323	0.0–1.5	Sediment	20713	20713	20713	—	—	—	—	—
AAB7635	60-01324	0.0–1.5	Sediment	20713	20713	20713	19168	—	—	—	—
AAB7647	60-01325	1.0–1.5	Soil	20713	20713	20713	—	—	—	—	—
AAB7726	60-01330	1.0–2.0	Soil	20527	20527	20527	19866	19137	—	19137	—
AAC0406	60-01330	2.0–2.5	Soil	20639	20639	20639	—	—	—	—	19731
AAC0407	60-01330	5.5–6.0	Qbt 4	20639	20639	20639	—	—	—	—	19731
AAC0405	60-01330	6.0–6.5	Qbt 4	20639	20639	20639	19990	19731	19731	19731	—
AAB7727	60-01331	1.0–2.0	Soil	20527	20527	20527	19866	19137	—	19137	—
AAC0412	60-01331	2.0–2.5	Soil	20639	20639	20639	—	—	—	—	19731
AAC0413	60-01331	5.0–5.5	Qbt 4	20639	20639	20639	—	—	—	—	19731
AAC0411	60-01331	5.5–6.0	Qbt 4	20639	20639	20639	19990	19731	19731	19731	—
AAB7728	60-01332	1.0–2.0	Soil	20527	20527	20527	19866	19137	—	19137	—
AAC0415	60-01332	2.0–2.5	Soil	20639	20639	20639	—	—	—	—	19731
AAC0416	60-01332	5.0–5.5	Qbt 4	20639	20639	20639	—	—	—	—	19731
AAC0414	60-01332	5.5–6.0	Qbt 4	20639	20639	20639	19990	19731	19731	19731	—
AAB7729	60-01333	1.0–2.0	Soil	20527	20527	20527	19866	19137	—	19137	—
AAB7730	60-01334	1.0–2.0	Soil	20527	20527	20527	19866	19137	—	19137	—
AAC0409	60-01335	2.0–2.5	Soil	20639	20639	20639	—	—	—	—	19731
AAC0410	60-01335	5.0–5.5	Qbt 4	20639	20639	20639	—	—	—	—	19731
AAC0408	60-01335	5.5–6.0	Qbt 4	20639	20639	20639	19990	19731	19731	19731	—
<b>SWMU 60-006(a)</b>											
AAB5817	60-01100	1.0–2.0	Sludge	18896	18896	18896	18958	—	—	18084	—
AAB5818	60-01100	1.0–2.0	Sludge	18896	18896	18896	18958	—	—	18084	—



Table 4.2-2 (continued)

Sample ID	Location ID	Depth (ft)	Media	Gross Alpha/Beta Radiation	Gross Gamma Radiation	Tritium	Metals	PCBs	Pesticides	SVOCs	VOCs
<b>SWMU 60-007(a)</b>											
AAB5794	60-01019	0.0–1.0	Fill	20952	20952	—	—	—	—	—	—
AAB5804	60-01019	0.0–1.0	Soil	20952	20952	—	—	—	—	—	—
AAB5796	60-01021	0.0–1.0	Soil	20952	20952	—	—	—	—	—	—
AAB5801	60-01025	0.0–1.0	Soil	20952	20952	—	—	—	—	—	—
AAB5806	60-01026	0.0–1.0	Soil	20952	20952	—	—	—	—	—	—
<b>SWMU 60-007(b)</b>											
AAB7639	60-01309	0.0–1.0	Sediment	20713	20713	20713	19168	—	—	—	—
AAB7708	60-01309	0.0–1.0	Sediment	20520	20520	20520	—	19136	—	19136	—
AAB7636	60-01313	0.0–1.5	Soil	20713	20713	20713	—	—	—	—	—
AAB7705	60-01313	0.0–1.5	Soil	20520	20520	20520	—	—	—	—	19136
AAB7643	60-01315	0.0–0.5	Sediment	21950	21950	21950	—	—	—	—	—
AAB7706	60-01315	0.0–0.5	Sediment	20520	20520	20520	—	—	—	—	19136
AAB7648	60-01316	0.0–0.5	Sediment	20713	20713	20713	19168	—	—	—	—
AAB7707	60-01316	0.0–1.0	Sediment	20520	20520	20520	—	19136	—	19136	—

\*— = Analyses not requested.

**Table 4.2-3  
Summary of Inorganic Chemicals Above BVs for TA-60 Sites**

Sample ID	Location ID	Depth (ft)	Media	Aluminum	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium	Cobalt	Copper	Iron	Lead	Magnesium	Manganese	Nickel	Selenium	Thallium	Vanadium	Zinc
<b>Soil/Fill BV</b>				<b>29200</b>	<b>8.17</b>	<b>295</b>	<b>1.83</b>	<b>0.4</b>	<b>6120</b>	<b>19.3</b>	<b>8.64</b>	<b>14.7</b>	<b>21500</b>	<b>22.3</b>	<b>4610</b>	<b>671</b>	<b>15.4</b>	<b>1.52</b>	<b>0.73</b>	<b>39.6</b>	<b>48.8</b>
<b>Sediment BV</b>				<b>15400</b>	<b>3.98</b>	<b>127</b>	<b>1.31</b>	<b>0.4</b>	<b>4420</b>	<b>10.5</b>	<b>4.73</b>	<b>11.2</b>	<b>13800</b>	<b>19.7</b>	<b>2370</b>	<b>543</b>	<b>9.38</b>	<b>0.3</b>	<b>0.73</b>	<b>19.7</b>	<b>60.2</b>
<b>Qbt 4 BV</b>				<b>7340</b>	<b>2.79</b>	<b>46</b>	<b>1.21</b>	<b>1.63</b>	<b>2200</b>	<b>7.14</b>	<b>3.14</b>	<b>4.66</b>	<b>14500</b>	<b>11.2</b>	<b>1690</b>	<b>482</b>	<b>6.58</b>	<b>0.3</b>	<b>1.1</b>	<b>17</b>	<b>63.5</b>
<b>SWMU 60-002 (east)</b>																					
RE60-03-52308	60-22517	4.0–4.5	Qbt 4	15350	3.52	52.5	— <sup>a</sup>	—	2440	8.2	3.83	—	17600	—	2540	—	7.73	0.579	—	18.4	—
RE60-03-52307	60-22517	8.5–9.0	Qbt 4	—	—	—	—	—	—	—	—	—	—	—	—	539	—	0.54(U)	—	—	—
RE60-03-52309	60-22517	14.5–15.0	Qbt 4	—	—	—	—	—	—	—	—	—	—	—	—	—	—	0.516(U)	—	—	—
RE60-03-52312	60-22518	4.5–5.0	Soil	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	74.8
RE60-03-52314	60-22518	14.5–15.0	Qbt 4	—	—	—	—	—	—	—	—	—	—	—	—	—	—	0.48(U)	—	—	—
RE60-03-52317	60-22519	4.50–5.00	Soil	—	—	310	—	0.539(U)	8050	—	—	—	—	—	—	—	—	—	—	—	—
RE60-03-52320	60-22519	13.5–14.0	Qbt 4	23720	3.97	108	1.69	—	3470	10.1	—	7.99	15200	15	3520	—	13.2	0.583(U)	—	20.1	—
RE60-03-52322	60-22520	3.0-3.5	Soil	—	—	—	—	0.55(U)	8230	—	10	—	—	—	—	—	16	—	—	—	—
RE60-03-52324	60-22520	14.5–15.0	Qbt 4	—	—	—	—	—	—	—	—	—	—	—	—	—	—	0.489(U)	—	—	—
RE60-03-52327	60-22521	4.0–4.5	Soil	—	—	—	—	0.533(U)	—	—	—	—	—	—	—	—	17.1	—	—	—	—
RE60-03-52332	60-22522	5.5–6.0	Qbt 4	15520	3.45	375	—	—	2720	8.23	—	—	—	—	2390	—	—	0.542(U)	—	18.3	—
RE60-03-52334	60-22522	16.0–17.0	Qbt 4	9900	—	—	—	—	—	—	—	—	—	12.4	—	—	8.72	0.565(U)	—	—	—
<b>SWMU 60-002 (central)</b>																					
RE60-04-53096	60-22680	1.5–2.0	Soil	—	—	—	—	—	—	—	—	—	—	—	—	726	—	—	—	—	—
<b>SWMU 60-007(a)</b>																					
AAB5801	60-01025	0.0–1.0	Soil	NA <sup>b</sup>	—	331(J-)	—	—	NA	—	NA	NA	NA	—	NA	NA	—	—	—	NA	NA
RC60-01-0003	60-10001	0.0–0.5	Fill	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	0.75	—	—

Note: All values in mg/kg. BVs are provided in LANL 1998, 059730.

<sup>a</sup> — = Not detected or not detected above BV.

<sup>b</sup> NA = Not analyzed.

**Table 4.2-4  
Summary of Detected Organic Chemicals for TA-60 Sites**

Sample ID	Location ID	Depth (ft)	Media	VOCs			SVOCs				PCBs		TPH			
				Acetone	Hexanone[2-]	Toluene	Acenaphthene	Fluoranthene	Fluorene	Pyrene	Aroclor-1254	Aroclor-1260	DRO	GRO	LRO	
<b>SWMU 60-002 (east)</b>																
RE60-03-52308	60-22517	4.0–4.5	Qbt 4	0.0062(J)	— <sup>a</sup>	—	—	—	—	—	—	NA <sup>b</sup>	NA	3.9	—	NA
RE60-03-52307	60-22517	8.5–9.0	Qbt 4	0.0044(J)	—	—	—	—	—	—	—	NA	NA	5.1	—	NA
RE60-03-52309	60-22517	14.5–15.0	Qbt 4	—	—	—	—	—	—	—	—	NA	NA	1.1(J)	—	NA
RE60-03-52312	60-22518	4.5–5.0	Soil	—	—	—	—	0.0357(J)	0.0056(J)	0.0443	—	NA	NA	12.9	—	NA
RE60-03-52314	60-22518	14.5–15.0	Qbt 4	0.0042(J)	—	—	—	—	—	—	—	NA	NA	2.2	—	NA
RE60-03-52317	60-22519	4.50–5.00	Soil	—	—	—	—	—	—	—	—	NA	NA	1.1(J)	—	NA
RE60-03-52320	60-22519	13.5–14.0	Qbt 4	0.0118(J)	0.0088	—	—	—	—	—	—	NA	NA	3	—	NA
RE60-03-52322	60-22520	3.0–3.5	Soil	—	—	—	—	—	—	—	—	NA	NA	1.8(J)	—	NA
RE60-03-52327	60-22521	4.0–4.5	Soil	—	—	—	—	—	—	—	—	NA	NA	1.1(J)	—	NA
RE60-03-52329	60-22521	14.5–15.0	Qbt 4	0.0042(J)	—	—	—	—	—	—	—	NA	NA	11.3	—	NA
RE60-03-52332	60-22522	5.5–6.0	Qbt 4	—	—	—	—	—	—	—	—	NA	NA	2.6	—	NA
RE60-03-52334	60-22522	16.0–17.0	Qbt 4	—	—	—	—	—	—	—	—	NA	NA	2.6	—	NA
<b>SWMU 60-002 (central)</b>																
RE60-04-53095	60-22680	0.0–1.0	Soil	—	—	—	0.0244(J)	—	—	—	—	—	—	—	—	NA
RE60-04-53096	60-22680	1.5–2.0	Soil	—	—	—	—	—	—	—	—	—	0.0042(J)	—	—	NA
RE60-04-53099	60-22681	1.5–2.0	Soil	—	—	—	—	—	—	—	—	—	—	—	0.0344(J)	NA
RE60-04-53100	60-22682	0.0–1.0	Soil	—	—	—	0.0198(J)	—	—	—	—	0.0202	0.0162	—	—	NA
RE60-04-53101	60-22682	1.5–2.0	Soil	—	—	—	NA	NA	NA	NA	NA	0.0025(J)	—	NA	0.173	NA
<b>SWMU 60-007(a)</b>																
AAB5799	60-01024	0.0–1.0	Soil	—	—	0.001(J)	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
RC60-01-0003	60-10001	0.0–0.5	Fill	NA	NA	NA	NA	NA	NA	NA	NA	—	—	—	NA	130
RC60-01-0006	60-10004	0.0–0.5	Fill	NA	NA	NA	NA	NA	NA	NA	NA	—	—	1100	NA	—
RC60-01-0007	60-10005	0.0–0.25	Fill	NA	NA	NA	NA	NA	NA	NA	NA	—	—	350	NA	160
RC60-01-0008	60-10006	0.0–0.5	Fill	NA	NA	NA	NA	NA	NA	NA	NA	—	—	—	NA	41

Note: All values in mg/kg.

<sup>a</sup> — = Not detected.<sup>b</sup> NA = Not analyzed.

**Table 4.2-5  
Summary of Inorganic Chemical Screening-Level Results for TA-60 Sites**

Sample ID	Location ID	Depth (ft)	Media Code	Aluminum	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium	Cobalt	Copper	Iron	Lead	Magnesium	Manganese	Mercury	Nickel	Potassium	Selenium	Silver	Sodium	Vanadium	Zinc
<b>Soil BV</b>				<b>29200</b>	<b>8.17</b>	<b>295</b>	<b>1.83</b>	<b>0.4</b>	<b>6120</b>	<b>19.3</b>	<b>8.64</b>	<b>14.7</b>	<b>21500</b>	<b>22.3</b>	<b>4610</b>	<b>671</b>	<b>0.1</b>	<b>15.4</b>	<b>3460</b>	<b>1.52</b>	<b>1</b>	<b>915</b>	<b>39.6</b>	<b>48.8</b>
<b>Sediment BV</b>				<b>15400</b>	<b>3.98</b>	<b>127</b>	<b>1.31</b>	<b>0.4</b>	<b>4420</b>	<b>10.5</b>	<b>4.73</b>	<b>11.2</b>	<b>13800</b>	<b>19.7</b>	<b>2370</b>	<b>543</b>	<b>0.1</b>	<b>9.38</b>	<b>2690</b>	<b>0.3</b>	<b>1</b>	<b>1470</b>	<b>19.7</b>	<b>60.2</b>
<b>Qbt 4 BV</b>				<b>7340</b>	<b>2.79</b>	<b>46</b>	<b>1.21</b>	<b>1.63</b>	<b>2200</b>	<b>7.14</b>	<b>3.14</b>	<b>4.66</b>	<b>14500</b>	<b>11.2</b>	<b>1690</b>	<b>482</b>	<b>0.1</b>	<b>6.58</b>	<b>3500</b>	<b>0.3</b>	<b>1</b>	<b>2770</b>	<b>17</b>	<b>63.5</b>
<b>AOC 60-004(b)</b>																								
AAB5769	60-01000	0.0–1.0	Soil	3270	<1.1 <sup>a</sup>	95.4	<0.43	<0.56	1880	5.3	<3.2	6.6	8180	7.9	1120	225	0.17	<6.4	<607	<0.34	<0.43	<192	12.6	27.7
AAB5875	60-01003	0.0–1.0	Soil	2700	<0.45	66	<0.36	<0.56	1180	4.5	<2.1	<4.3	7450	19.4	<885	243	<0.06	<4.7	<563	<0.34	<0.43	<154	<8.3	43.5
<b>AOC 60-004(f)</b>																								
AAB7646	60-01322	0.0–0.5	Sediment	7250	3.4	149	<0.7	<0.5	2460	8.9	<4.1	16.6	9870	13	1700	252	<0.06	<5.3	1220	<0.54	<0.8	<205	16.9	85.7
AAC0417	60-01322	6.5–7.0	Qbt 4	11200	<2.1	64.2	<0.78	<0.07	2050	7.4	<3.9	<3.4	12700	18.6	2180	NA <sup>b</sup>	<0.11	<8.7	1510	<1	<0.61	<76	12.8	50.2
AAB7635	60-01324	0.0–1.5	Sediment	6600	5.9	147	<0.53	<0.37	2280	8.3	<3.2	7.5	7460	9.7	1650	223	<0.02	<5	1100	<0.54	<0.8	<187	15.5	36.4
AAB7726	60-01330	1.0–2.0	Soil	6770	5.8	230	<0.57	<0.07	2700	7.7	<4.6	7.5	9850	8	2090	305	NA	<6.8	1270	<0.94	<0.47	NA	23.2	32.8
AAC0405	60-01330	6.0–6.5	Qbt 4	13000	<2.2	74	<0.91	<0.08	2400	7.9	<2.5	<3.8	13400	4.1	2410	NA	0.28	<9.5	1710	<1.1	<0.73	<80.8	<12.7	57.2
AAB7727	60-01331	1.0–2.0	Soil	7940	5.2	180	<0.63	<0.07	1890	9.6	<4.6	8.7	9080	15.4	1700	347	NA	<6.6	1500	<0.95	<0.56	NA	19.1	47.1
AAC0411	60-01331	5.5–6.0	Qbt 4	9330	<1.7	61.9	<0.62	<0.08	1610	7.9	<2	<2.6	10500	10.9	1870	NA	0.27	<7	<1280	<1.1	<0.63	<92.6	<9.8	38.6
AAB7728	60-01332	1.0–2.0	Soil	8960	3.1	163	<0.65	<0.06	2180	7.4	<4.6	13.6	9900	12	1820	247	NA	<6.6	1570	<0.86	<0.39	NA	22	98.2
AAC0414	60-01332	5.5–6.0	Qbt 4	13800	3.7	200	<1.1	<0.08	13400	8.7	<4.1	<3.7	13900	10.5	2770	NA	0.28	10.9	1890	<1.1	<1	<155	<16.9	53.6
AAB7729	60-01333	1.0–2.0	Soil	7490	2.5	225	<0.5	<0.07	5850	7.7	<5.1	<1.7	11000	8.2	2380	956	NA	<6.4	1260	<0.94	<0.49	NA	24.5	160
AAB7730	60-01334	1.0–2.0	Soil	11600	5	193	<0.72	<0.07	2530	11.7	<5	28.7	12000	18.4	2080	245	NA	<8	1930	<0.96	<0.51	NA	26.5	77.7
AAC0408	60-01335	5.5–6.0	Qbt 4	5500	<1.5	57.5	<0.4	<0.08	1530	4.3	<1.7	<0.78	9990	5.7	1280	NA	0.31	<4.3	<975	<1.1	<0.66	<80.3	<8.1	45.5
<b>SWMU 60-006(a)</b>																								
AAB5817	60-01100	1.0–2.0	Sludge	116000	115	5060	9.7	174	327000	1230	106	4240	237000	3600	33100	2450	65.6	737	67100	71.28	215	72400	819	42600
AAB5818	60-01100	1.0–2.0	Sludge	9820	<7.5	334	<1.7	10.6	170000	96.7	<13.6	285	21900	369	16900	287	3.76	82.4	52300	<6.2	<7.6	66200	56.5	2950
<b>SWMU 60-007(b)</b>																								
AAB7639	60-01309	0.0–1.0	Sediment	2900	<0.68	48.5	<0.39	<0.37	1770	2.7	<3.7	<2.6	3960	6.7	<714	331	<0.02	<4.1	<448	<0.55	<0.81	<89.7	<6.2	35.8
AAB7648	60-01316	0.0–0.5	Sediment	1750	<0.56	<31	<0.3	<0.35	5890	2.3	<1	<3.5	3340	3.4	<597	102	<0.02	<1.6	<335	<0.52	<0.77	<102	<5.1	20.7

Note: All values in mg/kg. Shaded values denote results detected above BV.

<sup>a</sup> < = Result is not detected.

<sup>b</sup> NA = Not analyzed.



**Table 4.2-6**  
**Summary of Organic Chemical Screening-Level Results for TA-60 Sites**

Sample ID	Location ID	Depth (ft)	Media Code	PCBs		SVOCs			
				Aroclor-1254	Aroclor-1260	Benzoic Acid	Benzyl Alcohol	Bis(2-ethylhexyl)phthalate	Phenol
<b>SWMU 60-004(b)</b>									
AAB5769	60-01000	0-1	Soil	0.0563	<0.0359*	<1.7	<0.36	<0.36	<0.36
AAB5875	60-01003	0-1	Soil	<0.0359	<0.0359	<1.7	<0.36	0.36	1.9
<b>SWMU 60-004(f)</b>									
AAC0411	60-01331	5.5-6	Qbt 4	0.0556	0.0439	<2	<0.41	<0.41	<0.41
<b>SWMU 60-007(b)</b>									
AAB7707	60-01316	0-1	Sediment	<0.46	<0.46	<3.5	<1.7	5.3	<0.35

Note: All values in mg/kg. Shaded values denote detected results.

\* < = Result is not detected.

**Table 4.2-7**  
**Summary of Radionuclide Screening-Level Results for TA-60 Sites**

Sample ID	Location ID	Depth (ft)	Media	Tritium
<b>AOC 60-004(f)</b>				
AAC0418	60-01322	2.0-2.5	Soil	1.21
AAC0419	60-01322	6.0-6.5	Qbt 4	0.98
AAC0417	60-01322	6.5-7.0	Qbt 4	1.37
AAB7641	60-01323	0.0-1.5	Sediment	0.95
AAC0407	60-01330	5.5-6.0	Qbt 4	1.52
AAC0405	60-01330	6.0-6.5	Qbt 4	1.93
AAC0411	60-01331	5.5-6.0	Qbt 4	1.97
AAC0416	60-01332	5.0-5.5	Qbt 4	1.48
AAC0414	60-01332	5.5-6.0	Qbt 4	1.08
AAC0408	60-01335	5.5-6.0	Qbt 4	0.93
<b>SWMU 60-006(a)</b>				
AAB5817	60-01100	1.0-2.0	Sludge	910
AAB5818	60-01100	1.0-2.0	Sludge	1090
<b>SWMU 60-007(b)</b>				
AAB7639	60-01309	0.0-1.0	Sediment	0.99
AAB7636	60-01313	0.0-1.5	Soil	2.97
AAB7648	60-01316	0.0-0.5	Sediment	0.99

Note: All values in pCi/g.



**Table 5.0-1  
Summary of Investigation Methods**

Method	Summary
Spade and Scoop Collection of Soil Samples	This method is typically used to collect shallow (e.g., approximately 0–12 in.) soil or sediment samples. The “spade-and-scoop” method involves digging a hole to the desired depth, as prescribed in the sampling and analysis plan, and collecting a discrete grab sample. The sample is typically placed in a clean, stainless-steel bowl for transfer into various sample containers.
Hand Auger Sampling	This method is typically used for sampling soil or sediment at depths of less than 10–15 ft but may in some cases be used for collecting samples of weathered or nonwelded tuff. The method involves hand-turning a stainless-steel bucket auger (typically 3–4-in. inner diameter), creating a vertical hole which can be advanced to the desired sample depth. When the desired depth is reached, the auger is decontaminated before advancing the hole through the sample depth. The sample material is transferred from the auger bucket to a stainless-steel sampling bowl before filling the various required sample containers.
Handling, Packaging, and Shipping of Samples	Field team member seal and label samples before packing and ensure that the sample containers and the containers used for transport are free of external contamination. Field team members package all samples so as to minimize the possibility of breakage during transportation. After all environmental samples are collected, packaged, and preserved; a field team member transports the samples to either the SMO or an SMO-approved radiation screening laboratory under chain of custody. The SMO arranges for shipping of samples to analytical laboratories. The field team member must inform the SMO and/or the radiation screening laboratory coordinator when levels of radioactivity are in the action-level or limited-quantity ranges.
Sample Control and Field Documentation	The collection, screening, and transport of samples are documented on standard forms generated by the SMO. These include sample collection logs, chain-of-custody forms, and sample container labels. Collection logs are completed at the time of sample collection and are signed by the sampler and a reviewer who verifies the logs for completeness and accuracy. Corresponding labels are initialed and applied to each sample container, and custody seals are placed around container lids or openings. Chain-of-custody forms are completed and assigned to verify that the samples are not left unattended. Site attributes (e.g., former and proposed soil sampling locations, sediment sampling locations) are located by using a global positioning system. Horizontal locations will be measured to the nearest 0.5 ft. The survey results for this field event will be presented as part of the investigation report. Sample coordinates will be uploaded into the Environmental Restoration Database.
Field Quality Control Samples	Field quality control samples are collected as directed in the Order on Consent as follows: <i>Field Duplicate:</i> At a frequency 10%; collected at the same time as a regular sample and submitted for the same analyses. <i>Equipment Rinsate Blank:</i> At a frequency of 10%; collected by rinsing sampling equipment with deionized water, which is collected in a sample container and submitted for laboratory analysis. <i>Trip Blanks:</i> Required for all field events that include the collection of samples for VOC analysis. Trip blanks containers of certified clean sand that are opened and kept with the other sample containers during the sampling process.

**Table 5.0-1 (continued)**

Method	Summary
Field Decontamination of Drilling and Sampling Equipment	Dry decontamination is the preferred method to minimize generating liquid waste. Dry decontamination may include the use of a wire brush or other tool to remove soil or other material adhering to the sampling equipment, followed by use of a commercial cleaning agent (nonacid, waxless cleaners) and paper wipes. Dry decontamination may be followed by wet decontamination if necessary. Wet decontamination may include washing with a nonphosphate detergent and water, followed by a water rinse and a second rinse with deionized water. Alternatively, steam cleaning may be used.
Containers and Preservation of Samples	Specific requirements/processes for sample containers, preservation techniques, and holding times are based on EPA guidance for environmental sampling, preservation, and quality assurance. Specific requirements for each sample are printed on the sample collection logs provided by the sample management office (size and type of container (glass, amber glass, polyethylene, preservative, etc.). All samples are preserved by placing in insulated containers with ice to maintain a temperature of 4°C. Other requirements such as nitric acid or other preservatives may apply to different media or analytical requests.
Management, Characterization, and Storage of Investigation-Derived Waste	Investigation-derived waste is managed, characterized, and stored in accordance with an approved waste characterization strategy form that documents site history, field activities, and the characterization approach for each waste stream managed. Waste characterization shall be adequate to comply with on-site or off-site waste acceptance criteria. All stored IDW will be marked with appropriate signage and labels, as appropriate. Drummed IDW will be stored on pallets to prevent the containers from deterioration. Generators are required to reduce the volume of waste generated as much as technically and economically feasible. Means to store, control, and transport each potential waste type and classification shall be determined before field operations that generate waste begin. A waste storage area shall be established before generating waste. Waste storage areas located in controlled areas of the laboratory shall be controlled as needed to prevent inadvertent addition or management of wastes by unauthorized personnel. Each container of waste generated shall be individually labeled as to waste classification, item identification number, and radioactivity (if applicable), immediately following containerization. All waste shall be segregated by classification and compatibility to prevent cross-contamination. See Appendix B for additional information.
Geodetic Surveys	This method describes the methodology for coordinating and evaluating geodetic surveys and establishing QA and QC for geodetic survey data. The procedure covers evaluating geodetic survey requirements, preparing to perform a geodetic survey, performing geodetic survey field activities, preparing geodetic survey data for QA review, performing QA review of geodetic survey data, and submitting geodetic survey data.
Hollow Stem Auger Drilling Methods	In this method, hollow-stem augers (sections of seamless pipe with auger flights welded to the pipe) act as a screw conveyor to bring cuttings of sediment, soil, and/or rock to the surface. Auger sections are typically 5 ft in length and have outside diameters of 4.25 to 14 in. Drill rods, split-spoon core barrels, Shelby tubes, and other samplers can pass through the center of the hollow-stem auger sections for collection of discrete samples from desired depths. Hollow-stem augers are used as temporary casings when setting wells to prevent cave-ins of the borehole walls.

March 2008

252

EP2008-0139

Upper Sandia Canyon Aggregate Area Investigation Work Plan



# **Appendix A**

---

*Acronyms and Abbreviations, Glossary,  
Metric Conversion Table, and Data Qualifier Definitions*



## A-1.0 ACRONYMS AND ABBREVIATIONS

ACA	accelerated corrective action
AIRNET	air sampling network
AK	acceptable knowledge
amsl	above mean sea level
AOC	area of concern
bgs	below ground surface
BV	background value
CFR	Code of Federal Regulations
CSM	conceptual site model
CST	Chemical Sciences and Technology
D&D	decontamination and decommissioning
DOE	Department of Energy (U.S.)
DOT	Department of Transportation (U.S.)
dpm	disintegrations per minute
DRO	diesel range organic
DU	depleted uranium
EM	electromagnetic
EP	Environmental Programs Directorate
EPA	Environmental Protection Agency (U.S.)
EQL	estimated quantitation limit
ER	Environmental Restoration (Project)
FFCA	Federal Facility Compliance Act
FV	fallout value
GPR	ground-penetrating radar
GPS	global-positioning system
GRO	gasoline range organic
HE	high explosives
HIR	historical investigation report
HWFP	Hazardous Waste Facility Permit
IDW	investigation-derived waste
IFWGMP	Interim Facility-Wide Groundwater Monitoring Plan
kV	kilovolt
LANL	Los Alamos National Laboratory

LRO	lubrication range organic
MCL	maximum contaminant level
MCPA	methyl chlorophenoxy acetic acid
MCPP	2-(2-methyl-4- chlorophenoxy) propionic
MSGP	Multi-Sector General Permit
NFA	no further action
NMED	New Mexico Environment Department
NPDES	National Pollutant Discharge Elimination System
NSSB	National Security Science Building
NTS	Nevada Test Site
OU	operable unit
PAH	polycyclic aromatic hydrocarbon
PCB	polychlorinated biphenyl
PCE	perchloroethylene (also tetrachloroethane)
pH	potential of hydrogen
PID	photoionization detector
PPE	personal protective equipment
ppm	parts per million
QA/QC	quality assurance/quality control
RCRA	Resource Conservation and Recovery Act
RLW	radioactive liquid waste
RFI	RCRA facility investigation
RPF	Records Processing Facility
SOP	standard operating procedure
SSL	soil screening level
SVOCs	semivolatile organic compounds
SWMU	solid waste management unit
SWSC	Sanitary Wastewater Systems Consolidation
TA	technical area
TLD	thermoluminescent dosimeter
TPH	total petroleum hydrocarbons
TSCA	Toxic Substances Control Act
TSS	total suspended solids
VCA	voluntary corrective action



VOC	volatile organic compound
WAC	waste acceptance criteria
WCSF	waste characterization strategy form
WWTP	wastewater treatment plant
XRF	x-ray fluorescence

## A-2.0 GLOSSARY

**abandonment**—The plugging of a well or borehole in a manner that precludes the migration of surface runoff or groundwater along the length of the well or borehole.

**administrative authority**—For Los Alamos National Laboratory, one or more regulatory agencies, such as the New Mexico Environment Department, the U.S. Environmental Protection Agency, or the U.S. Department of Energy, as appropriate.

**aggregate**—At the Los Alamos National Laboratory, an area within a *watershed* containing solid waste management units (SWMUs) and/or areas of concern (AOCs), and the media affected or potentially affected by releases from those SWMUs and/or AOCs. Aggregates are designated to promote efficient and effective corrective action activities.

**alluvial**—Pertaining to geologic deposits or features formed by running water.

**alluvium**—Soil deposited by a river or other running water.

**analysis**—A critical evaluation, usually made by breaking a subject (either material or intellectual) down into its constituent parts, then describing the parts and their relationship to the whole. Analyses may include physical analysis, chemical analysis, toxicological analysis, and knowledge-of-process determinations.

**analyte**—The element, nuclide, or ion a chemical analysis seeks to identify and/or quantify; the chemical constituent of interest.

**analytical method**—A procedure or technique for systematically performing an activity.

**aquifer**—An underground geological formation (or group of formations) containing water that is the source of groundwater for wells and springs.

**area of concern**—(1) A release that may warrant investigation or remediation and is not a solid waste management unit (SWMU). (2) An area at Los Alamos National Laboratory that may have had a release of a hazardous waste or a hazardous constituent but is not a SWMU.

**assessment**—(1) The act of reviewing, inspecting, testing, checking, conducting surveillance, auditing, or otherwise determining and documenting whether items, processes, or services meet specified requirements. (2) An evaluation process used to measure the performance or effectiveness of a system and its elements. In this glossary, assessment is an all-inclusive term used to denote any one of the following: audit, performance evaluation, management system review, peer review, inspection, or surveillance.

**background concentration**—Naturally occurring concentrations of an inorganic chemical or radionuclide in soil, sediment, or tuff.

**background data**—Data that represent naturally occurring concentrations of inorganic and radionuclide constituents in a geologic medium. Los Alamos National Laboratory's (the Laboratory's) background data are derived from samples collected at locations that are either within, or adjacent to, the

Laboratory. These locations (1) are representative of geological media found within Laboratory boundaries, and (2) have not been affected by Laboratory operations.

**background level**—(1) The concentration of a substance in an environmental medium (air, water, or soil) that occurs naturally or is not the result of human activities. (2) In exposure assessment, the concentration of a substance in a defined control area over a fixed period of time before, during, or after a data-gathering operation.

**background radiation**—The amount of radioactivity naturally present in the environment, including cosmic rays from space and natural radiation from soils and rock.

**background value (BV)**—A statistically derived concentration (i.e., the upper tolerance limit [UTL]) of a chemical used to represent the background data set. If a UTL cannot be derived, either the detection limit or maximum reported value in the background data set is used.

**bentonite**—An absorbent aluminum silicate clay formed from volcanic ash and used in various adhesives, cements, and ceramic fillers. Because bentonite can absorb large quantities of water and expand to several times its normal volume, it is a common drilling mud additive.

**beta radiation**—High-energy electrons emitted by certain types of radioactive nuclei, such as potassium-40. The beta particles emitted are a form of ionizing radiation also known as beta rays.

**blank**—A sample that is expected to have a negligible or unmeasurable amount of an analyte. Results of blank sample analyses indicate whether field samples might have been contaminated during the sample collection, transport, storage, preparation, or analysis processes.

**borehole**—(1) A hole drilled or bored into the ground, usually for exploratory or economic purposes. (2) A hole into which casing, screen, and other materials may be installed to construct a well.

**caldera**—A large crater formed by a volcanic explosion or by the collapse of a volcanic cone.

**canyon**—A stream-cut chasm or gorge, the sides of which are composed of cliffs or a series of cliffs rising from the chasm's bed. Canyons are characteristic of arid or semiarid regions where downcutting by streams greatly exceeds weathering.

**catchment**—(1) A structure, such as a basin or reservoir, used for collecting or draining water. (2) The amount of water collected in such a structure. (3) A catching or collecting of water, especially rainwater.

**certificate of completion**—A document to be issued by the New Mexico Environment Department (NMED) under the March 1, 2005, Compliance Order on Consent (Consent Order) once NMED determines that the requirements of the Consent Order have been satisfied for a particular solid waste management unit or area of concern.

**chain of custody**—An unbroken, documented trail of accountability that is designed to ensure the uncompromised physical integrity of samples, data, and records.

**chemical**—Any naturally occurring or human-made substance characterized by a definite molecular composition.

**chemical analysis**—A process used to measure one or more attributes of a sample in a clearly defined, controlled, and systematic manner. Chemical analysis often requires treating a sample chemically or physically before measurement.

**cleanup**—A series of actions taken to deal with the release, or threat of a release, of a hazardous substance that could affect humans and/or the environment. The term cleanup is sometimes used interchangeably with the terms remedial action, removal action, or corrective action.

**Code of Federal Regulations (CFR)**—A document that codifies all rules of the executive departments and agencies of the federal government. The code is divided into 50 volumes, known as titles. Title 40 of the CFR (referenced as 40 CFR) covers environmental regulations.

**colluvium**—A loose deposit of rock debris accumulated through the action of gravity at the base of a cliff or slope.

**Compliance Order on Consent (Consent Order)**—For the Environmental Remediation and Surveillance Program, an enforcement document signed by the New Mexico Environment Department, the U.S. Department of Energy, and the Regents of the University of California on March 1, 2005, which prescribes the requirements for corrective action at Los Alamos National Laboratory. The purposes of the Consent Order are (1) to define the nature and extent of releases of contaminants at, or from, the facility; (2) to identify and evaluate, where needed, alternatives for corrective measures to clean up contaminants in the environment and prevent or mitigate the migration of contaminants at, or from, the facility; and (3) to implement such corrective measures. The Consent Order supersedes the corrective action requirements previously specified in Module VIII of the Laboratory's Hazardous Waste Facility Permit.

**Consent Order**—See Compliance Order on Consent.

**consolidated unit**—A group of solid waste management units (SWMUs), or SWMUs and areas of concern, which generally are geographically proximate and have been combined for the purposes of investigation, reporting, or remediation.

**contaminant**—(1) Chemicals and radionuclides present in environmental media or on debris above background levels. (2) According to the March 1, 2005, Compliance Order on Consent (Consent Order), any hazardous waste listed or identified as characteristic in 40 Code of Federal Regulations (CFR) 261 (incorporated by 20.4.1.200 New Mexico Administrative Code [NMAC]); any hazardous constituent listed in 40 CFR 261 Appendix VIII (incorporated by 20.4.1.200 NMAC) or 40 CFR 264 Appendix IX (incorporated by 20.4.1.500 NMAC); any groundwater contaminant listed in the Water Quality Control Commission (WQCC) Regulations at 20.6.3.3103 NMAC; any toxic pollutant listed in the WQCC Regulations at 20.6.2.7 NMAC; explosive compounds; nitrate; and perchlorate. (Note: Under the Consent Order, the term "contaminant" does not include radionuclides or the radioactive portion of mixed waste.)

**corrective action**—(1) In the Resource Conservation and Recovery Act, an action taken to rectify conditions potentially adverse to human health or the environment. (2) In the quality assurance field, the process of rectifying and preventing nonconformances.

**data validation**—A systematic process that applies a defined set of performance-based criteria to a body of data and that may result in the qualification of the data. The data-validation process is performed independently of the analytical laboratory that generates the data set and occurs before conclusions are drawn from the data. The process may include a standardized data review (routine data validation) and/or a problem-specific data review (focused data validation).

**data verification**—The process of evaluating the completeness, correctness, consistency, and compliance of a laboratory data package against a specified standard or contract.

- **Completeness:** All required information is present—in both hard copy and electronic forms.
- **Correctness:** The reported results are based on properly documented and correctly applied algorithms.
- **Consistency:** The values are the same when they appear in different reports or are transcribed from one report to another.

- **Compliance:** The data pass numerical quality-control tests based on parameters or limits specified in a contract or in an auxiliary document.

**decision peer review**—A technical (subject-matter-expert) review that occurs before document writing has begun. The focus of the decision peer review is on the appropriateness of the stated objectives for the identified problem, on the adequacy of the proposed approach to address the objectives, and on the identification of concerns and necessary contingencies. Any decision that is expected to lead to the writing of a peer-reviewed document is subject to a decision peer review and falls under Quality Procedure 3.5, Peer Review Process.

**decommissioning**—The permanent removal of facilities and their components from service after the discontinued use of structures or buildings that are deemed no longer useful. Decommissioning must take place in accordance with regulatory requirements and applicable environmental policies.

**decontamination**—The removal of unwanted material from the surface of, or from within, another material.

**detect (detection)**—An analytical result, as reported by an analytical laboratory, that denotes a chemical or radionuclide to be present in a sample at a given concentration.

**detection limit**—The minimum concentration that can be determined by a single measurement of an instrument. A detection limit implies a specified statistical confidence that the analytical concentration is greater than zero.

**discharge**—The accidental or intentional spilling, leaking, pumping, pouring, emitting, emptying, or dumping of hazardous waste into, or on, any land or water.

**disposal**—The discharge, deposit, injection, dumping, spilling, leaking, or placing of any solid waste or hazardous waste into, or on, any land or water so that such solid waste or hazardous waste or any constituent thereof may enter the environment or be emitted into the air or discharged into any waters, including groundwaters.

**document catalog number**—A unique document identifier designed to track every document generated by the Environmental Remediation and Surveillance Program. (This number is automatically assigned when an online document signature form is obtained.)

**document peer review**—A technical, regulatory, and legal review of a final, professionally edited document. Before the peer review, the document should receive a Level 3 (full) edit as defined by Los Alamos National Laboratory's Communication Arts and Services (IM-1) Group. Because this review follows the decision peer review, the approach should already have been agreed upon. Thus, the primary focus of a document peer review is on content (and to a lesser extent on approach; the clarity of presentation; and a consistent, appropriate format). The document peer review may be either a panel review or a read review. Quality Procedure 4.9 (Document Development and Approval Process) lists the types of Environmental Remediation and Surveillance Program documents that require a formal peer review.

**effluent**—Wastewater (treated or untreated) that flows out of a treatment plant, sewer, or industrial outfall. Generally refers to wastes discharged into surface waters.

**Environmental Restoration (ER) Project**—A Los Alamos National Laboratory project established in 1989 as part of a U.S. Department of Energy nationwide program, and precursor of today's Environmental Remediation and Surveillance (ERS) Program. This program is designed (1) to investigate hazardous and/or radioactive materials that may be present in the environment as a result of past Laboratory operations, (2) to determine if the materials currently pose an unacceptable



risk to human health or the environment, and (3) to remediate (clean up, stabilize, or restore) those sites where unacceptable risk is still present.

**environmental samples**—Air, soil, water, or other media samples that have been collected from streams, wells, and soils, or other locations, and that are not expected to exhibit properties classified as hazardous by the U.S. Department of Transportation.

**ephemeral**—Pertaining to a stream or spring that flows only during, and immediately after, periods of rainfall or snowmelt.

**ER data**—Data derived from samples that have been collected and paid for through Environmental Remediation and Surveillance Program funding.

**ER database (ERDB)**—A database housing analytical and other programmatic information for the Environmental Remediation and Surveillance Program. The ERDB currently contains about 3 million analyses in 300 tables.

**ER identification (ER ID) number**—A unique identifier assigned by the Environmental Remediation and Surveillance Program's Records Processing Facility to each document when it is submitted as a final record.

**estimated quantitation limit (EQL)**—The lowest concentration that can be reliably achieved within specified limits of precision and accuracy during routine analytical-laboratory operating conditions. The low point on a calibration curve should reflect this quantitation limit. The EQL is not used to establish detection status. Sample EQLs are highly matrix dependent, and the specified EQLs might not always be achievable.

**evapotranspiration**—(1) The discharge of water from the earth's surface to the atmosphere by evaporation from lakes, streams, and soil surfaces and by transpiration from plants. (2) The loss of water from the soil by evaporation and/or by transpiration from the plants growing in the soil.

**facility**—All contiguous land (and structures, other appurtenances, and improvements on the land) used for treating, storing, or disposing of hazardous waste. A facility may consist of several treatment, storage, or disposal operational units. For the purpose of implementing a corrective action, a facility is all the contiguous property that is under the control of the owner or operator seeking a permit under Subtitle C of the Resource Conservation and Recovery Act.

**field duplicate (replicate) samples**—Two separate, independent samples taken from the same source, which are collected as collocated samples (i.e., equally representative of a sample matrix at a given location and time).

**floodplain**—The flat, or nearly flat, land along a river or stream, or in a tidal area, that is covered by water during a flood.

**gamma radiation**—A form of electromagnetic, high-energy ionizing radiation emitted from a nucleus. Gamma rays are essentially the same as x-rays (though at higher energy) and require heavy shielding, such as concrete or steel, to be blocked.

**groundwater**—Interstitial water that occurs in saturated earth material and is capable of entering a well in sufficient amounts to be used as a water supply.

**hazard index**—The sum of hazard quotients for multiple contaminants to which a receptor may have been exposed.

**Hazardous and Solid Waste Amendments (HSWA)**—Public Law No. 98-616, 98 Stat. 3221, enacted in 1984, which amended the Resource Conservation and Recovery Act of 1976 (42 United States Code § 6901 et seq).

**hazardous waste**—(1) Solid waste that is listed as a hazardous waste, or exhibits any of the characteristics of hazardous waste (i.e., ignitability, corrosivity, reactivity, or toxicity, as provided in 40 CFR, Subpart C). (2) According to the March 1, 2005, Compliance Order of Consent (Consent Order), any solid waste or combination of solid wastes that, because of its quantity, concentration, or physical, chemical, or infectious characteristics, meets the description set forth in New Mexico Statutes Annotated 1978, § 74-4-3(K) and is listed as a hazardous waste or exhibits a hazardous waste characteristic under 40 CFR 261 (incorporated by 20.4.1.200 New Mexico Administrative Code).

**Hazardous Waste Bureau**—The New Mexico Environment Department bureau charged with providing regulatory oversight and technical guidance to New Mexico hazardous waste generators and to treatment, storage, and disposal facilities, as required by the New Mexico Hazardous Waste Act.

**Hazardous Waste Facility Permit**—The authorization issued to Los Alamos National Laboratory (the Laboratory) by the New Mexico Environment Department that allows the Laboratory to operate as a hazardous waste treatment, storage, and disposal facility.

**high-explosive wastes**—Any waste-containing material having an amount of stored chemical energy that could start a violent reaction when initiated by impact, spark, or heat. This violent reaction would be accompanied by a strong shock wave and the potential for high-velocity particles to be propelled.

**HSWA module**—See Module VIII.

**infiltration**—(1) The penetration of water through the ground surface into subsurface soil. (2) The technique of applying large volumes of wastewater to land to penetrate the surface and percolate through the underlying soil.

**investigation-derived waste**—Solid waste or hazardous waste that was generated as a result of corrective action investigation or remediation field activities. Investigation-derived waste may include drilling muds, cuttings, and purge water from the installation of test pits or wells; purge water, soil, and other materials from the collection of samples; residues from the testing of treatment technologies and pump-and-treat systems; contaminated personal protective equipment; and solutions (aqueous or otherwise) used to decontaminate nondisposable protective clothing and equipment.

**laboratory qualifier (laboratory flag)**—Codes applied to data by a contract analytical laboratory to indicate, on a gross scale, a verifiable or potential data deficiency. These flags are applied according to the U.S. Environmental Protection Agency contract-laboratory program guidelines.

**LANL (Los Alamos National Laboratory) data validation qualifiers**—The Los Alamos National Laboratory data qualifiers which are defined by, and used, in the Environmental Remediation and Surveillance (ERS) Program validation process. The qualifiers describe the general usability (or quality) of data. For a complete list of data qualifiers applicable to any particular analytical suite, consult the appropriate ERS standard operating procedure.

**medium (environmental)**—Any material capable of absorbing or transporting constituents. Examples of media include tuffs, soils and sediments derived from these tuffs, surface water, soil water, groundwater, air, structural surfaces, and debris.

**migration**—The movement of inorganic and organic chemical species through unsaturated or saturated materials.

**mixed waste**—Waste containing both hazardous and source, special nuclear, or byproduct materials subject to the Atomic Energy Act of 1954.

**Module VIII**—Module VIII of the Los Alamos National Laboratory (the Laboratory) Hazardous Waste Facility Permit. This permit allows the Laboratory to operate as a hazardous-waste treatment, storage, and disposal facility. From 1990 to 2005, Module VIII included requirements from the Hazardous and Solid Waste Amendments. These requirements have been superseded by the March 1, 2005, Compliance Order on Consent (Consent Order).

**monitoring well**—(1) A well used to obtain water-quality samples or to measure groundwater levels, (2) A well drilled at a hazardous waste management facility or Superfund site to collect groundwater samples for the purpose of physical, chemical, or biological analysis and to determine the amounts, types, and distribution of contaminants in the groundwater beneath the site.

**National Pollutant Discharge Elimination System**—The national program for issuing, modifying, revoking and reissuing, terminating, monitoring, and enforcing permits to discharge wastewater or storm water, and for imposing and enforcing pretreatment requirements under the Clean Water Act.

**no further action**—Under the Resource Conservation and Recovery Act, a corrective-action determination whereby, based on evidence or risk, no further investigation or remediation is warranted.

**nondetect**—A result that is less than the method detection limit.

**operable units (OUs)**—At Los Alamos National Laboratory, 24 areas originally established for administering the Environmental Remediation and Surveillance Program. Set up as groups of potential release sites, the OUs were aggregated according to geographic proximity for the purposes of planning and conducting Resource Conservation and Recovery Act (RCRA) facility assessments and RCRA facility investigations. As the project matured, it became apparent that there were too many areas to allow efficient communication and to ensure consistency in approach. In 1994, the 24 OUs were reduced to 6 administrative field units.

**peer review**—See decision peer review and document peer review.

**permit**—An authorization, license, or equivalent control document issued by the U.S. Environmental Protection Agency or an approved state agency to implement the requirements of an environmental regulation.

**permit modification**—A change to a condition in a facility's permit, initiated by either a request from the permittee or by the administrative authority's action.

**polychlorinated biphenyls (PCBs)**—Any chemical substance limited to the biphenyl molecule that has been chlorinated to varying degrees, or any combination that contains such substances. PCBs are colorless, odorless compounds that are chemically, electrically, and thermally stable and have proven to be toxic to both humans and other animals.

**quality assurance/quality control**—A system of procedures, checks, audits, and corrective actions set up to ensure that all U.S. Environmental Protection Agency research design and performance, environmental monitoring and sampling, and other technical and reporting activities are of the highest achievable quality.

**quality control**—See quality assurance/quality control.

**radiation**—A stream of particles or electromagnetic waves emitted by atoms and molecules of a radioactive substance as a result of nuclear decay. The particles or waves emitted can consist of neutrons, positrons, alpha particles, beta particles, or gamma radiation.

**radioactive material**—For purposes of complying with U.S. Department of Transportation regulations, any material having a specific activity (activity per unit mass of the material) greater than 2 nanocuries per gram (nCi/g) and in which the radioactivity is evenly distributed.

**radioactive waste**—Waste that, by either monitoring and analysis, or acceptable knowledge, or both, has been determined to contain added (or concentrated and naturally occurring) radioactive material or activation products, or that does not meet radiological release criteria.

**radionuclide**—Radioactive particle (human-made or natural) with a distinct atomic weight number.

**RCRA facility investigation (RFI)**—A Resource Conservation and Recovery Act (RCRA) investigation that determines if a release has occurred and characterizes the nature and extent of contamination at a hazardous waste facility. The RFI is generally equivalent to the remedial investigation portion of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA) process.

**reach**—A specific length of a canyon that is treated as a single unit for sampling and analysis. Reaches tend to be internally uniform with respect to geomorphic setting and land use.

**record**—Any book, paper, map, photograph, machine-readable material, or other documentary material, regardless of physical form or characteristics.

**reference set**—A hard-copy compilation of reference items cited in Environmental Remediation and Surveillance Program documents.

**regional aquifer**—Geologic material(s) or unit(s) of regional extent whose saturated portion yields significant quantities of water to wells, contains the regional zone of saturation, and is characterized by the regional water table or potentiometric surface.

**release**—Any spilling, leaking, pumping, pouring, emitting, emptying, discharging, injecting, escaping, leaching, dumping, or disposing of hazardous waste or hazardous constituents into the environment.

**remediation**—(1) The process of reducing the concentration of a contaminant (or contaminants) in air, water, or soil media to a level that poses an acceptable risk to human health and the environment. (2) The act of restoring a contaminated area to a usable condition based on specified standards.

**request number**—An identifying number assigned by the Environmental Remediation and Surveillance Program to a group of samples submitted for analysis.

**Resource Conservation and Recovery Act**—The Solid Waste Disposal Act as amended by the Resource Conservation and Recovery Act of 1976 (Public Law [PL] 94-580, as amended by PL 95-609 and PL 96-482, United States Code 6901 et seq.).

**risk**—A measure of the probability that damage to life, health, property, and/or the environment will occur as a result of a given hazard.

**runoff**—The portion of the precipitation on a drainage area that is discharged from the area.

**sample**—A portion of a material (e.g., rock, soil, water, or air), which, alone or in combination with other portions, is expected to be representative of the material or area from which it is taken. Samples are typically either sent to a laboratory for analysis or inspection or are analyzed in the field. When referring to samples of environmental media, the term field sample may be used.

**screening action level (SAL)**—A radionuclide's medium-specific concentration level; it is calculated by using conservative criteria below which it is generally assumed that no potential exists for a dose that is unacceptable to human health. The derivation of a SAL is based on conservative exposure and on land-use assumptions. However, if an applicable regulatory standard exists that is less than the value derived, it is used in place of the SAL.



**sediment**—(1) A mass of fragmented inorganic solid that comes from the weathering of rock and is carried or dropped by air, water, gravity, or ice. (2) A mass that is accumulated by any other natural agent and that forms in layers on the earth's surface (e.g., sand, gravel, silt, mud, fill, or loess). (3) A solid material that is not in solution and is either distributed through the liquid or has settled out of the liquid.

**site characterization**—Defining the pathways and methods of migration of hazardous waste or constituents, including the media affected; the extent, direction and speed of the contaminants; complicating factors influencing movement; or concentration profiles.

**site conceptual model**—A qualitative or quantitative description of sources of contamination, environmental transport pathways for contamination, and receptors that may be impacted by contamination and whose relationships describe qualitatively or quantitatively the release of contamination from the sources, the movement of contamination along the pathways to the exposure points, and the uptake of contaminants by the receptors.

**soil**—(1) A material that overlies bedrock and has been subject to soil-forming processes. (2) A sample media group that includes naturally occurring and artificial fill materials.

**solid waste**—Any garbage, refuse, or sludge from a waste treatment plant, water-supply treatment plant, or air-pollution control facility, and other discarded material, including solid, liquid, semisolid, or contained gaseous material resulting from industrial, commercial, mining, and agricultural operations and from community activities. Solid waste does not include solid or dissolved materials in domestic sewage; solid or dissolved materials in irrigation return flows; industrial discharges that are point sources subject to permits under section 402 of the Federal Water Pollution Control Act, as amended; or source, special nuclear, or byproduct material as defined by the Atomic Energy Act of 1954, as amended.

**solid waste management unit (SWMU)**—(1) Any discernible site at which solid wastes have been placed at any time, whether or not the site use was intended to be the management of solid or hazardous waste. SWMUs include any site at a facility at which solid wastes have been routinely and systematically released. This definition includes regulated sites (i.e., landfills, surface impoundments, waste piles, and land treatment sites), but does not include passive leakage or one-time spills from production areas and sites in which wastes have not been managed (e.g., product storage areas). (2) According to the March 1, 2005, Compliance Order on Consent (Consent Order), any discernible site at which solid waste has been placed at any time, and from which the New Mexico Environment Department determines there may be a risk of a release of hazardous waste or hazardous waste constituents (hazardous constituents), whether or not the site use was intended to be the management of solid or hazardous waste. Such sites include any area in Los Alamos National Laboratory at which solid wastes have been routinely and systematically released; they do not include one-time spills.

**standard operating procedure**—A document that details the officially approved method(s) for an operation, analysis, or action, with thoroughly prescribed techniques and steps.

**surface sample**—A sample taken at a collection depth that is (or was) representative of the medium's surface during the period of investigative interest. A typical depth interval for a surface sample is 0 to 6 in. for mesa-top locations, but may be up to several feet in sediment-deposition areas within canyons.

**technical area (TA)**—At Los Alamos National Laboratory, an administrative unit of operational organization (e.g., TA-21).

**topography**—The physical or natural features of an object or entity and their structural relationships.

**transport (transportation)**—(1) The movement of a hazardous waste by air, rail, highway, or water.  
(2) The movement of a contaminant from a source through a medium to a receptor.

**treatment**—Any method, technique, or process, including elementary neutralization, designed to change the physical, chemical, or biological character or composition of any hazardous waste so as to neutralize such waste, recover energy or material resources from the waste, or to render such waste nonhazardous or less hazardous; safer to transport, store, or dispose of; or amenable for recovery or storage; or reduced in volume.

**tuff**—Consolidated volcanic ash, composed largely of fragments produced by volcanic eruptions.

**underground storage tank**—A tank located at least partially underground and designed to hold gasoline or other petroleum products or chemicals.

**U.S. Department of Energy**—The federal agency that sponsors energy research and regulates nuclear materials for weapons production.

**U.S. Environmental Protection Agency (EPA)**—The federal agency responsible for enforcing environmental laws. Although state regulatory agencies may be authorized to administer some of this responsibility, EPA retains oversight authority to ensure the protection of human health and the environment.

**vadose zone**—The zone between the land surface and the water table within which the moisture content is less than saturation (except in the capillary fringe) and pressure is less than atmospheric. Soil pore space also typically contains air or other gases. The capillary fringe is included in the vadose zone.

**verification**—A test or tests, generally performed before and after logging in lieu of a calibration, to ascertain whether the logging system is operating properly. Verification differs from calibration in that it does not provide updated system-calibration values.

**welded tuff**—A volcanic deposit hardened by the action of heat, pressures from overlying material, and hot gases.

**work plan**—A document that specifies the activities to be performed when implementing an investigation or remedy. At a minimum, the work plan should identify the scope of the work to be performed, specify the procedures to be used to perform the work, and present a schedule for performing the work. The work plan may also present the technical basis for performing the work.

**A-3.0 METRIC CONVERSION TABLE**

Multiply SI (Metric) Unit	by	To Obtain US Customary Unit
kilometers (km)	0.622	miles (mi)
kilometers (km)	3281	feet (ft)
meters (m)	3.281	feet (ft)
meters (m)	39.37	inches (in.)
centimeters (cm)	0.03281	feet (ft)
centimeters (cm)	0.394	inches (in.)
millimeters (mm)	0.0394	inches (in.)
micrometers or microns ( $\mu\text{m}$ )	0.0000394	inches (in.)
square kilometers ( $\text{km}^2$ )	0.3861	square miles ( $\text{mi}^2$ )
hectares (ha)	2.5	acres
square meters ( $\text{m}^2$ )	10.764	square feet ( $\text{ft}^2$ )
cubic meters ( $\text{m}^3$ )	35.31	cubic feet ( $\text{ft}^3$ )
kilograms (kg)	2.2046	pounds (lb)
grams (g)	0.0353	ounces (oz)
grams per cubic centimeter ( $\text{g}/\text{cm}^3$ )	62.422	pounds per cubic foot ( $\text{lb}/\text{ft}^3$ )
milligrams per kilogram (mg/kg)	1	parts per million (ppm)
micrograms per gram ( $\mu\text{g}/\text{g}$ )	1	parts per million (ppm)
liters (L)	0.26	gallons (gal.)
milligrams per liter (mg/L)	1	parts per million (ppm)
degrees Celsius ( $^{\circ}\text{C}$ )	$9/5 + 32$	degrees Fahrenheit ( $^{\circ}\text{F}$ )

**A-4.0 DATA QUALIFIER DEFINITIONS**

Data Qualifier	Definition
U	The analyte was analyzed for but not detected.
J	The analyte was positively identified, and the associated numerical value is estimated to be more uncertain than would normally be expected for that analysis.
J+	The analyte was positively identified, and the result is likely to be biased high.
J-	The analyte was positively identified, and the result is likely to be biased low.
UJ	The analyte was not positively identified in the sample, and the associated value is an estimate of the sample-specific detection or quantitation limit.
R	The data are rejected as a result of major problems with quality assurance/quality control (QA/QC) parameters.





## **Appendix B**

---

### *Investigation-Derived Waste Management Plan*



## **B-1.0 INTRODUCTION**

This appendix describes the management of investigation-derived waste (IDW) generated during the investigation of sites comprising Upper Sandia Canyon Aggregate Area at Los Alamos National Laboratory (LANL or the Laboratory). This waste is generated during field-investigation activities and may include, but is not limited to, drill cuttings; contaminated soil; contaminated personal protective equipment (PPE), sampling supplies, and plastic; fluids from the decontamination of PPE and sampling equipment; and all other waste that has potentially come into contact with contaminants.

## **B-2.0 INVESTIGATION-DERIVED WASTE**

All IDW generated during the Upper Sandia Canyon Aggregate Area field-investigation activities will also be managed in accordance with applicable standard operating procedures (SOPs). These SOPs incorporate the requirements of all applicable U.S. Environmental Protection Agency (EPA) and New Mexico Environment Department regulations, U.S. Department of Energy (DOE) orders, and Laboratory implementation requirements. Two SOPs are applicable to the characterization and management of IDW.

- SOP-5022, Characterization and Management of Environmental Restoration Project Waste
- SOP-5023, Waste Characterization.

These SOPs are available at <http://www.lanl.gov/environment/all/ga.shtml>.

All IDW will be placed in a hazardous waste accumulation area until it is characterized. If the waste is found not to be hazardous, it will be stored in an appropriate nonhazardous storage area until final disposal.

Preliminary sampling will be conducted to provide sufficient information to complete the waste characterization strategy form (WCSF) for dispositioning. The characterization strategy to complete the WCSF is described in section 8 of SOP-01-10, as follows:

- Review existing data/documentation to determine if they meet requirements for acceptable knowledge (AK), as specified in LIG 404-00-02.0.
- Identify preliminary waste classifications. Classifications may include, but are not limited to, the following:
  - ❖ Radioactive
  - ❖ Solid
  - ❖ Hazardous
  - ❖ Mixed (hazardous and radioactive)
  - ❖ Toxic Substances Control Act
  - ❖ New Mexico Special Waste
  - ❖ Industrial
  - ❖ Or combinations of the above

- Identify additional waste classification considerations. SOP-01.06, Management of Environmental Remediation Project Waste, specifically addresses IDW remediation waste
- Prepare the WCSF

Investigation activities will be conducted in a manner that minimizes waste generation.

Waste minimization will be accomplished by implementing the requirements of the Environmental Programs Directorate's portion of the "Los Alamos National Laboratory Hazardous Waste Minimization Report" (LANL 2006, 096015). This report is updated annually to meet a requirement of Module VIII of the Laboratory's Hazardous Waste Facility Permit, which was issued by the EPA on May 23, 1990, and modified on May 19, 1994 (EPA 1990, 001585; EPA 1994, 044146).

The waste streams that will be generated and managed during the field investigation at Upper Sandia Canyon Aggregate Area sites are described below. Container and storage requirements will be detailed in the WCSF and approved before waste is generated.

### **B-2.1 Drill Cuttings**

The drill cuttings waste stream will consist of cuttings from boreholes that will be drilled in, and around, Upper Sandia Canyon Aggregate Area sites. Drill cuttings will be collected and initially placed in containers at a hazardous waste accumulation area until it is characterized. If the waste is found not to be hazardous, it will be stored in an appropriate nonhazardous storage area until final disposal. The drill cuttings waste stream will be characterized using analytical results from direct sampling of the containerized cuttings. Potential contaminants of concern include radionuclides, inorganic chemicals, volatile organic compounds (VOCs), and semivolatile organic compounds (SVOCs). The maximum detected concentrations of radionuclides will be compared with the background or fallout values. If the maximum detected concentrations exceed these values, the drill cuttings will be designated as low-level radioactive waste. Maximum concentrations of toxicity characteristic leaching procedure (TCLP) constituents will be compared with 20 times the TCLP regulatory level. If the concentrations are less than 20 times the regulatory level, the drill cuttings will be designated as nontoxicity characteristic nonhazardous waste. If the concentrations exceed 20 times the regulatory level, the drill cuttings will be sampled and analyzed by TCLP to determine whether it is a toxicity characteristic hazardous (or mixed) waste. Based on the results of previous investigations, the Laboratory expects most of these drill cuttings to be designated as nonhazardous, nonradioactive waste that will be either used for cover material at Technical Area 54 (TA-54) or disposed of at an off-site disposal facility permitted for the disposal of industrial waste. Potentially, some drill cuttings may be designated as low-level radioactive or mixed waste because of the presence of radionuclides and metals. Low-level waste will be disposed of at TA-54 or off-site at a licensed facility. Mixed waste will be sent to an off-site facility permitted for treating and/or disposing of mixed waste.

### **B-2.2 Septic Tank and Seepage Pit**

Waste from the removal of the septic tank and seepage pit may consist of liquid contents, sludge, concrete reinforced with steel rebar and vitrified clay pipe or steel pipe. Waste will be placed into drums or 20-yd<sup>3</sup> rolloff containers, secured, and temporarily stored at the site. Chemicals of potential concern include inorganic and organic chemicals. Determination of whether the waste is hazardous will be based on AK using characterization data from the tank contents or from media where the tank contents were released. Based on the results of previous investigations, the Laboratory expects these wastes to be designated as nonhazardous, nonradioactive waste that will be disposed of at an off-site disposal facility permitted for the disposal of solid waste.



### **B-2.3 Soil**

Soil will be placed into containers appropriate to the waste volume generated (drums and/or rolloff containers), secured, and temporarily stored at a hazardous waste accumulation area until it is characterized. If the waste is found not to be hazardous, it will be stored in an appropriate nonhazardous storage area until final disposal. Potential contaminants of concern include radionuclides, inorganic chemicals, VOCs, and SVOCs. The maximum detected concentrations of radionuclides will be compared with the background or fallout values. If the maximum concentrations exceed these values, the soil will be designated as low-level radioactive waste. Maximum concentrations of TCLP constituents will be compared with 20 times the TCLP regulatory level. If the concentrations are less than 20 times the regulatory level, the drill cuttings will be designated as nontoxicity characteristic nonhazardous waste. If the concentrations exceed 20 times the regulatory level, the drill cuttings will be sampled and analyzed by TCLP to determine whether it is a toxicity characteristic hazardous (or mixed) waste. Based on the results of previous investigations, the Laboratory expects these wastes to be designated as nonhazardous, nonradioactive waste that will be used either for cover material at TA-54 or disposed of at an off-site disposal facility permitted for the disposal of industrial waste. Potentially, some soil may be designated as low-level radioactive or mixed waste because of the presence of radionuclides and metals. Low-level waste will be disposed of on-site at TA-54 or off-site at a licensed facility. Mixed waste will be sent to an off-site facility permitted for the treatment and/or disposal of mixed waste.

### **B-2.4 Spent PPE and Disposable Sampling Supplies**

The spent PPE waste stream will consist of PPE that has come into contact with contaminated environmental media (e.g., core and/or drill cuttings) and cannot be decontaminated. The bulk of this waste stream will consist of protective clothing such as coveralls, gloves, shoe covers, and (if required) respirator cartridges. Spent PPE will be collected in containers at personnel decontamination stations, secured, and temporarily stored at a hazardous waste accumulation area until it is characterized. If the waste is found not to be hazardous, it will be stored in an appropriate nonhazardous storage area until final disposal. Characterization of this waste stream will be performed through AK of the waste materials, the methods of generation, and the levels of contamination observed in the associated environmental media. The Laboratory expects spent PPE to be designated as nonhazardous, nonradioactive waste that will be disposed of at an off-site disposal facility permitted for the disposal of industrial waste.

The disposable sampling supplies waste stream will consist of all equipment and materials that are necessary for collecting samples and that have come into direct contact with contaminated environmental media and cannot be decontaminated. This waste stream also includes wastes associated with dry decontamination activities and will consist primarily of paper and plastic items collected in bags at a hazardous waste accumulation area until it is characterized. If the waste is found not to be hazardous, it will be stored in an appropriate nonhazardous storage area until final disposal. Characterization of this waste stream will be performed through AK of the waste materials, the methods of generation, and the levels of contamination observed in the associated environmental media. The Laboratory expects disposable sampling supplies to be designated as nonhazardous, nonradioactive waste. Nonhazardous wastes will be disposed of at an off-site disposal facility permitted for the disposal of industrial waste; hazardous wastes will be sent to an off-site facility permitted for the treatment and/or disposal of hazardous waste.

### **B-2.5 Decontamination Fluids**

The decontamination fluids waste stream will consist of liquid wastes from decontamination activities (e.g., decontamination solutions and rinse waters). Following waste-minimization practices, the

Laboratory employs dry decontamination methods to the extent possible. If dry decontamination cannot be performed, liquid decontamination wastes will be collected in containers at the point of generation and transferred to accumulation drums. Decontamination fluids will be accumulated in drums and temporarily stored at a hazardous waste accumulation area until it is characterized. If the waste is found not to be hazardous, it will be stored in an appropriate nonhazardous storage area. The Laboratory expects that the majority of decontamination fluids will be designated as nonhazardous, nonradioactive liquid waste. A potential exists for some decontamination rinsate to be designated as low-level radioactive or mixed waste at several of the sites because of presence of radionuclides and metals. Nonhazardous and radioactive liquid wastes may be treated and discharged by several Clean Water Act-permitted on-site treatment facilities, provided the waste meets the facility's waste acceptance criteria (WAC). Mixed waste and waste that does not meet the WAC of Laboratory treatment facilities will be sent to permitted off-site treatment facilities.

### **B-2.6 Returned or Excess Samples**

Soil samples either returned from or obtained but not submitted to the analytical laboratory will be containerized and stored at a hazardous waste accumulation area until they are characterized. If the waste is found not to be hazardous, it will be stored in an appropriate nonhazardous storage area until final disposal. Returned soil samples will be managed in a manner consistent with analytical results, and it is anticipated that the returned soil samples will be classified as nonhazardous, nonradioactive solid waste. The returned soil samples will be disposed of at a Laboratory-approved off-site industrial waste facility.

### **B-3.0 WASTE MANAGEMENT**

All wastes will be managed in accordance with applicable federal, state, DOE, and Laboratory requirements. The IDW waste streams, expected waste types, estimated waste volumes, and other data are listed in Table B-3.0-1.

All waste drums and containers (rolloff bins) will remain at a registered hazardous waste accumulation area until analytical results have been received and waste characterization completed shows that the waste is nonhazardous.

Before field-investigation activities begin, a WCSF will be prepared and approved as required by the current version of SOP-5023. The WCSF will provide detailed information about IDW characterization, management, containerization, and potential volume generated for each subaggregate.

The IDW will be characterized through existing data and/or documentation, direct sampling of the IDW, or sampling of the media being investigated (e.g., surface soil, subsurface soil). If sampling is necessary, the procedures will be described in a sampling and analysis plan that will be developed in conjunction with the WCSF.

Some wastes will be characterized on the basis of AK rather than direct waste analysis. The AK characterization will consist of the results of analyzing the environmental media associated with each waste stream. For example, spent PPE and disposable sampling supplies that have potentially come into contact with contaminated media will be characterized based on the analytical results for samples of that media. Similarly, borehole drill cuttings will be characterized by the analytical results from direct sampling of the containerized cuttings. If decontamination fluids are to be sent off-site for disposal, they will be sampled to demonstrate compliance with the WAC of the receiving facility.

#### **B-4.0 WASTE CONTAINERS AND TRANSPORTATION**

The selection of waste containers will be based on both the appropriate U.S. Department of Transportation (DOT) requirements and the type and amount of IDW anticipated to be generated. Immediately following containerization, each waste container will be individually labeled to identify the waste classification, the item identification number, its radioactivity (if applicable), and the date of generation. Waste containers will be managed in clearly marked and appropriately constructed waste accumulation areas. Waste accumulation area postings, regulated storage duration, and inspection requirements will be based on IDW type and classification. The wastes will be stored in accordance with Laboratory hazardous and mixed waste requirements documents.

Transportation of IDW will comply with appropriate DOT requirements. Transportation and disposal requirements will be detailed in the WCSF and approved prior to the generation of waste.

#### **B-5.0 REFERENCES**

*The following list includes all documents cited in this appendix. Parenthetical information following each reference provides the author(s), publication date, and ER ID number. This information is also included in text citations. ER ID numbers are assigned by the Environmental Programs Directorate's Records Processing Facility (RPF) and are used to locate the document at the RPF and, where applicable, in the master reference set.*

*Copies of the master reference set are maintained at the NMED Hazardous Waste Bureau; the U.S. Department of Energy–Los Alamos Site Office; the U.S. Environmental Protection Agency, Region 6; and the Directorate. The set was developed to ensure that the administrative authority has all material needed to review this document, and it is updated with every document submitted to the administrative authority. Documents previously submitted to the administrative authority are not included.*

EPA (U.S. Environmental Protection Agency), April 10, 1990. "Module VIII of RCRA Permit No. NM0890010515, issued to Los Alamos National Laboratory, Los Alamos, New Mexico," EPA Region VI, Hazardous Waste Management Division, Dallas, Texas. (EPA 1990, 001585)

EPA (U.S. Environmental Protection Agency), April 19, 1994. "Module VIII of RCRA Permit No. NM0890010515, EPA, Region 6, New Requirements Issued to Los Alamos National Laboratory, Los Alamos, New Mexico," EPA Region 6, Hazardous Waste Management Division, Dallas, Texas. (EPA 1994, 044146)

LANL (Los Alamos National Laboratory), November 2006. "Los Alamos National Laboratory Hazardous Waste Minimization Report," Los Alamos National Laboratory document LA-UR-06-8175, Los Alamos, New Mexico. (LANL 2006, 096015)





**Table B-3.0-1**  
**Generation and Management of the Estimated IDW for Upper Sandia Canyon Aggregate Area**

Waste Stream	Expected Waste Type	Estimated Volume*	Characterization Method	On-Site Management	Expected Disposition
Drill Cuttings and Soil*	Industrial waste, nonhazardous, nonradioactive	3.5 yd <sup>3</sup>	Analytical results from waste and core samples	Accumulation in 55-gal. drums, covered rolloff containers, or soft-sided containers	Permitted off-site facility for which waste meets acceptance criteria
Septic Tank and Seepage Pit	Structure: Industrial waste, nonhazardous, nonradioactive	50 yd <sup>3</sup>	Analytical results from direct sampling of waste	Accumulation in 55-gal. drums or covered rolloff containers	Permitted off-site facility for which waste meets acceptance criteria
	Soil: Industrial waste, nonhazardous, nonradioactive	10 yd <sup>3</sup>			
	Tank contents: Liquid waste, nonhazardous	<1000 gal.			On-site Clean Water Act-permitted treatment facility for which waste meets acceptance criteria
Spent PPE and Disposable Sampling Supplies	Industrial waste, nonhazardous, nonradioactive	0.3 yd <sup>3</sup>	AK	Accumulation in 55-gal. drums	Permitted off-site facility for which waste meets acceptance criteria
Decontamination Fluids	Liquid waste, nonhazardous or low-level radioactive	54 gal.	Analytical results from direct sampling of waste	Accumulation in 55-gal. drum	On-site Clean Water Act-permitted treatment facility for which waste meets acceptance criteria
Returned or Excess Samples	Industrial waste, nonhazardous, nonradioactive	0.2 yd <sup>3</sup>	AK from sample analytical data and method of generation	Accumulation in a 5-gal. bucket or 55-gal. drum, stored on Laboratory property	Permitted off-site facility for which waste meets acceptance criteria

\* Sample depths, numbers, and/or locations are yet to be determined.

