


# Expanded Site Inspection St. George Island Pribilof Islands, Alaska

## Volume I

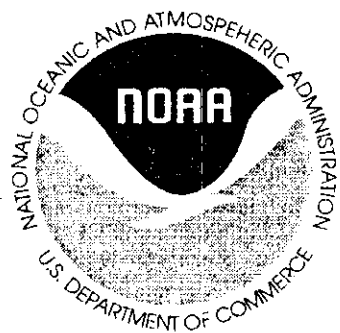

January 1997

Prepared for  
U.S. Army Corps of Engineers  
Seattle District  
4735 East Marginal Way South  
Seattle, Washington 98124-2255

Hart Crowser  
1910 Fairview Avenue East  
Seattle, Washington 98102-3699

CONTENTS

	<u>Page</u>
<b>VOLUME I</b>	
<b>ACRONYMS</b>	x
<b>EXECUTIVE SUMMARY</b>	ES-1
<i>Site-Specific Results</i>	ES-1
<b>1.0 INTRODUCTION</b>	1-1
<i>1.1 Report Organization</i>	1-2
<i>1.2 Island Historical Information</i>	1-3
<i>1.3 Environmental Setting</i>	1-3
<b>2.0 FIELD ACTIVITIES</b>	2-1
<i>2.1 General Approach</i>	2-1
<i>2.2 Soil Sampling Techniques</i>	2-2
<i>2.3 Modifications from the Management Plan</i>	2-4
<b>3.0 CHEMICAL TESTING PROGRAM AND DATA QUALITY REVIEW</b>	3-1
<i>3.1 Scope of Chemical Testing Program</i>	3-1
<i>3.2 Summary of Data Quality Review Results</i>	3-2
<i>3.3 Comparison of Field Laboratory and Project Laboratory Analytical Results</i>	3-3
<b>4.0 POTENTIAL SOIL CLEANUP LEVELS</b>	4-1
<i>4.1 ADEC Soil Matrix Cleanup Levels</i>	4-2
<i>4.2 EPA Region 3 RBC Soil Cleanup Levels</i>	4-4
<i>4.3 PCB Soil Cleanup Levels</i>	4-5
<i>4.4 Soil Background Concentrations for Metals</i>	4-5
<b>5.0 SITE-SPECIFIC EVALUATIONS</b>	5-1
<i>5.1 Open Pits Site</i>	5.1-1
<i>5.2 Inactive/Abandoned Diesel Tank Farm Site</i>	5.2-1
<i>5.3 Inactive Gasoline Tank Farm Site</i>	5.3-1
<i>5.4 Old Power Plant Site</i>	5.4-1
<i>5.5 Former Kerosene/AST Storage Area Site</i>	5.5-1
<i>5.6 Cross Hill Drum Dump Site</i>	5.6-1

**CONTENTS (Continued)**

	<u>Page</u>
<b>5.7 Former Fuel Storage Area Site</b>	5.7-1
<b>5.8 Old Carpenter Shop Site</b>	5.8-1
<b>5.9 Old Coal House Site</b>	5.9-1
<b>5.10 Port Fuel Supply Line—West Oceanfront Subarea</b>	5.10-1
<b>5.11 Port Fuel Supply Line—East Oceanfront Subarea</b>	5.11-1
<b>5.12 Port Fuel Supply Line—North Cargo Line Subarea</b>	5.12-1
<b>5.13 Port Fuel Supply Line—South Cargo Line Subarea</b>	5.13-1
<b>5.14 Active Power Plant Site</b>	5.14-1
<b>5.15 Makushin Pit Site</b>	5.15-1
<b>6.0 REFERENCES</b>	6-1

**TABLES**

ES-1	St. George Summary of Results and Recommendations	ES-3
2-1	Contingency Soil Sampling Screening Levels	2-6
3-1	Summary of Planned and Completed Chemical Analyses	3-9
3-2	Summary of Field Laboratory and Project Laboratory Split Sample Results BTEX Analyses	3-10
3-3	Summary of Field Laboratory and Project Laboratory Split Sample Results TPH Analyses	3-11
3-4	Summary of Field Laboratory and Project Laboratory Split Sample Results Pesticide/PCB Analysis	3-14
3-5	Comparison of Field and Project Laboratory Split Sample Detection and Cleanup Level Exceedence Frequencies-Benzene Analysis	3-16
3-6	Comparison of Field and Project Laboratory Split Sample Detection and Cleanup Level Exceedence Frequencies-Total BTEX Analysis	3-17
3-7	Comparison of Field and Project Laboratory Split Sample Detection and Cleanup Level Exceedence Frequencies-Gasoline-Range Hydrocarbon Analysis	3-18
3-8	Comparison of Field and Project Laboratory Split Sample Detection and Cleanup Level Exceedence Frequencies-Diesel-Range Hydrocarbon Analysis	3-19
3-9	Comparison of Field and Project Laboratory Split Sample Detection and Cleanup Level Exceedence Frequencies-Total Petroleum Hydrocarbon Analysis	3-20
4-1	ADEC Soil Cleanup Level Matrix Table	4-6
4-2	Input Parameters and Matrix Scores for Sites on St. George Island	4-7
4-3	Potential Non-Petroleum Soil Cleanup Levels	4-8
4-4	Summary of Background Soil Analytical Results - St. George Island	4-11
5.1-1	Statistical Summary of Soil Quality Data - St. George Island - Open Pits Site	5.1-7

**CONTENTS (Continued)**

	<u>Page</u>	
<b>TABLES (Continued)</b>		
5.1-2	Screening Level Exceedences - St. George Island - Open Pits Site	5.1-11
5.2-1	Statistical Summary of Soil Quality Data - St. George Island - Inactive/Abandoned Diesel Tank Farm Site	5.2-7
5.2-2	Screening Level Exceedences - St. George Island - Inactive/Abandoned Diesel Tank Farm Site	5.2-8
5.3-1	Statistical Summary of Soil Quality Data St. George Island - Inactive Gasoline Tank Farm Site	5.3-6
5.3-2	Screening Level Exceedences - St. George Island - Inactive Gasoline Tank Farm Site	5.3-7
5.4-1	Statistical Summary of Soil Quality Data St. George Island - Old Power Plant Site	5.4-7
5.4-2	Screening Level Exceedences - St. George Island - Old Power Plant Site	5.4-9
5.5-1	Statistical Summary of Soil Quality Data St. George Island - Former Kerosene/AST Storage Area Site	5.5-3
5.6-1	Statistical Summary of Soil Quality Data St. George Island - Cross Hill Drum Dump Site	5.6-3
5.7-1	Statistical Summary of Soil Quality Data St. George Island - Former Fuel Storage Area Site	5.7-7
5.7-2	Screening Level Exceedences - St. George Island - Former Fuel Storage Area Site	5.7-8
5.8-1	Statistical Summary of Soil Quality Data St. George Island - Old Carpenter Shop Site	5.8-3
5.9-1	Statistical Summary of Soil Quality Data St. George Island - Old Coal House Site	5.9-6
5.9-2	Screening Level Exceedences - St. George Island - Old Coal House Site	5.9-9
5.10-1	Statistical Summary of Soil Quality Data St. George Island - Port Fuel Supply Line - West Oceanfront Subarea	5.10-4
5.11-1	Statistical Summary of Soil Quality Data St. George Island - Port Fuel Supply Line - East Oceanfront Subarea	5.11-9
5.11-2	Screening Level Exceedences - St. George Island - Port Fuel Supply Line - East Oceanfront Subarea	5.11-10
5.12-1	Statistical Summary of Soil Quality Data St. George Island - Port Fuel Supply Line - North Cargo Line Subarea (North)	5.12-11

**CONTENTS (Continued)**

	<u>Page</u>
<b>TABLES (Continued)</b>	
5.12-2	Statistical Summary of Soil Quality Data St. George Island - Port Fuel Supply Line - North Cargo Line Subarea (South) 5.12-12
5.12-3	Screening Level Exceedences - St. George Island - Port Fuel Supply Line - North Cargo Line Subarea 5.12-13
5.13-1	Statistical Summary of Soil Quality Data St. George Island - Port Fuel Supply Line - South Cargo Line Subarea (North) 5.13-9
5.13-2	Statistical Summary of Soil Quality Data St. George Island - Port Fuel Supply Line - South Cargo Line Subarea (South) 5.13-10
5.13-3	Screening Level Exceedences - St. George Island - Port Fuel Supply Line - South Cargo Line Subarea 5.13-11
5.14-1	Statistical Summary of Soil Quality Data St. George Island - Active Power Plant Site 5.14-7

**FIGURES**

1-1	Location Map
1-2	Site Map
1-3	Sites in City of St. George, Alaska
4-1	Background Sample Location Plan
5.1-1	Site and Exploration Plan Showing TPH Concentrations Open Pit Sites
5.1-2	Generalized Subsurface Cross Section A-A' Open Pit Sites
5.2-1	Site and Exploration Plan Showing TPH Concentrations Inactive/Abandoned Diesel Tank Farm Site and Port Fuel Supply Line - South Cargo Line Subarea
5.2-2	Generalized Subsurface Cross Section A-A' Inactive/Abandoned Diesel Tank Farm Site
5.3-1	Site and Exploration Plan Showing TPH Concentrations Inactive Gasoline Tank Farm Site and Port Fuel Supply Line - North Cargo Line Subarea
5.3-2	Generalized Subsurface Cross Section A-A' Inactive Gasoline Tank Farm Site
5.4-1	Site and Exploration Plan Showing TPH Concentrations Old Power Plant Site

**CONTENTS (Continued)**

Page

**FIGURES (Continued)**

- 5.4-2 Generalized Subsurface Cross Section A-A'  
Old Power Plant Site
- 5.5-1 Site and Exploration Plan Showing TPH Concentrations  
Former Kerosene/AST Storage Area Site
- 5.6-1 Site and Exploration Plan Showing TPH Concentrations  
Cross Hill Drum Dump Site
- 5.7-1 Site and Exploration Plan Showing TPH Concentrations  
Former Fuel Storage Area Site
- 5.7-2 Generalized Subsurface Cross Section A-A'  
Former Fuel Storage Area Site
- 5.8-1 Site and Exploration Plan Showing TPH Concentrations  
Old Carpenter Shop Site
- 5.9-1 Site and Exploration Plan Showing Hydrocarbon Concentrations  
Old Coal House Site
- 5.10-1 Site and Exploration Plan Showing TPH Concentrations  
Port Fuel Supply Line - West Oceanfront Subarea
- 5.11-1 Site and Exploration Plan Showing TPH Concentrations -  
Port Fuel Supply Line - East Oceanfront Subarea
- 5.11-2 Generalized Subsurface Cross Section A-A'  
Port Fuel Supply Line - East Oceanfront Subarea
- 5.12-1 Site and Exploration Plan Showing TPH Concentrations  
Inactive Gasoline Tank Farm Site and  
Port Fuel Supply Line - North Cargo Line Subarea
- 5.12-2 Generalized Subsurface Cross Section A-A'  
Port Fuel Supply Line - North Cargo Line Subarea - North
- 5.12-3 Generalized Subsurface Cross Section B-B'  
Port Fuel Supply Line - North Cargo Line Subarea - South
- 5.13-1 Site and Exploration Plan Showing TPH Concentrations  
Inactive/Abandoned Diesel Tank Farm Site and  
Port Fuel Supply Line - South Cargo Line Subarea
- 5.13-2 Generalized Subsurface Cross Section A-A'  
Inactive/Abandoned Diesel Tank Farm Site and  
Port Fuel Supply Line - South Cargo Line Subarea - South
- 5.14-1 Site and Exploration Plan Showing TPH Concentrations  
Active Power Plant Site
- 5.14-2 Generalized Subsurface Cross Section A-A'  
Active Power Plant Site
- 5.15-1 Site and Exploration Plan Showing TPH Concentrations  
Makushin Pit

**CONTENTS (Continued)**

	<u>Page</u>
<b>APPENDIX A</b>	
<b>FIELD EXPLORATION PROCEDURES AND LOGS</b>	A-1
<i>Surface and Subsurface Soil Sampling</i>	A-1
<i>Decontamination Procedures</i>	A-5
<i>Disposal of Investigation-Derived Wastes</i>	A-5
<i>Field Documentation</i>	A-6
<i>Sample Quality Handling</i>	A-7
<i>Health and Safety Plan Assessment</i>	A-12
<i>Hart Crowser Project Team</i>	A-13
<b>TABLES</b>	
A-1 Summary of Surface Samples and Visual Descriptions	A-15
A-2 Logbook Format	A-19
<b>FIGURES</b>	
A-1 Key to Exploration Logs	
A-2 through A-7 Test Pit Log TP-1 through TP-13, Open Pits	
A-8 through A-12 Test Pit Log TP-1 through TP-13, Inactive/Abandoned Diesel Tank Farm	
A-13 Hand-Auger Boring Log HA-1, Inactive/Abandoned Diesel Tank Farm	
A-14 and A-15 Test Pit Log TP-1 through TP-4, Inactive Gasoline Tank Farm	
A-16 Hand-Auger Boring Log HA-1 through HA-4, Inactive Gasoline Tank Farm	
A-17 through A-19 Test Pit Log OP-TP-1 through OP-TP-7, Old Power Plant and Hand-Auger Boring Log HA-1, Old Power Plant	
A-20 and A-21 Test Pit Log TP-1 through TP-4, Former Kerosene/AST Storage Area	
A-22 and A-23 Test Pit Log TP-1 through TP-7, Former Fuel Storage Area	
A-24 and A-25 Hand-Auger Boring Log HA-1 through HA-5, Old Coal House	
A-26 Test Pit Log EO-TP-1 and EO-TP-2, Port Fuel Supply Line - East Ocean Front	
A-27 through A-30 Test Pit Log NC-TP-1 through NC-TP-7, Port Fuel Supply Line - North Cargo Line	
A-31 Test Pit Log TP-1, Port Fuel Supply Line - South Cargo Line	
A-32 Test Pit Log TP-9 and TP-10, Active Power Plant	
A-33 Hand-Auger Boring Log HA-1, Makushin Pit	

**CONTENTS (Continued)**

	<u>Page</u>
<b>APPENDIX B</b>	
<b>FIELD LABORATORY SOIL QUALITY DATA</b>	
<b>REVIEW AND SUMMARY TABLES</b>	
<i>Hydrocarbon Identification (TPH-HCID)</i>	B-1
<i>Aromatic Volatiles (BTEX)</i>	B-1
<i>Pesticide/PCBs (Pesticide Screen)</i>	B-1
<b>SUMMARY TABLES</b>	
B-1 Summary of Field Laboratory Analytical Results St. George Island - Open Pits	B-3
B-2 Summary of Field Laboratory Analytical Results St. George Island - Inactive/Abandoned Diesel Tank Farm	B-16
B-3 Summary of Field Laboratory Analytical Results St. George Island - Inactive Gasoline Tank Farm	B-28
B-4 Summary of Field Laboratory Analytical Results St. George Island - Old Power Plant	B-35
B-5 Summary of Field Laboratory Analytical Results St. George Island - Former Kerosene/AST Storage Area	B-44
B-6 Summary of Field Laboratory Analytical Results St. George Island - Cross Hill Drum Dump	B-48
B-7 Summary of Field Laboratory Analytical Results St. George Island - Former Fuel Storage Area	B-52
B-8 Summary of Field Laboratory Analytical Results St. George Island - Old Carpenter Shop	B-62
B-9 Summary of Field Laboratory Analytical Results St. George Island - Old Coal House	B-64
B-10 Summary of Field Laboratory Analytical Results St. George Island - Port Fuel Supply Line	B-68
B-11 Summary of Field Laboratory Analytical Results St. George Island - Active Power Plant	B-87
B-12 Summary of Field Laboratory Analytical Results St. George Island - Makushin Pit	B-89



CONTENTS (Continued)

	<u>Page</u>
<b>APPENDIX C</b>	
<b>PROJECT LABORATORY SOIL QUALITY DATA</b>	
<b>REVIEW AND SUMMARY TABLES</b>	
<i>Hydrocarbon Identification (AK-DRO, AK-GRO, and 418.1)</i>	C-1
<i>Volatiles (EPA Method 8020)</i>	C-2
<i>Pesticide/PCBs (EPA Method 8080)</i>	C-2
<i>Semivolatile Organics (EPA Method 8270)</i>	C-2
<i>Total Metals (EPA Method 6000 and 7000 series)</i>	C-3
<b>SUMMARY TABLES</b>	
C-1 Summary of Project Laboratory Analytical Results St. George Island - Open Pits	C-4
C-2 Summary of Project Laboratory Analytical Results St. George Island - Inactive/Abandoned Diesel Tank Farm	C-9
C-3 Summary of Project Laboratory Analytical Results St. George Island - Inactive Gasoline Tank Farm	C-12
C-4 Summary of Project Laboratory Analytical Results St. George Island - Old Power Plant	C-15
C-5 Summary of Project Laboratory Analytical Results St. George Island - Former Kerosene/AST Storage Area	C-18
C-6 Summary of Project Laboratory Analytical Results St. George Island - Cross Hill Drum Dump	C-19
C-7 Summary of Project Laboratory Analytical Results St. George Island - Former Fuel Storage Area	C-20
C-8 Summary of Project Laboratory Analytical Results St. George Island - Old Carpenter Shop	C-22
C-9 Summary of Project Laboratory Analytical Results St. George Island - Old Coal House	C-23
C-10 Summary of Project Laboratory Analytical Results St. George Island - Port Fuel Supply Line	C-27
C-11 Summary of Project Laboratory Analytical Results St. George Island - Active Power Plant	C-30
C-12 Summary of Project Laboratory Analytical Results St. George Island - Makushin Pit	C-31
C-13 Summary of Project Laboratory Analytical Results St. George Island - Background Soil Samples	C-32
C-14 Summary of Laboratory Analytical Results St. George Island, QA/QC Samples	C-34

**CONTENTS (Continued)**

Page

**VOLUME II**

**APPENDIX D  
FIELD LABORATORY ANALYTICAL REPORTS  
HART CROWSER *FAST* LABORATORY**

**VOLUME III**

**APPENDIX E  
PROJECT LABORATORY CERTIFICATES OF ANALYSIS  
ANALYTICAL TECHNOLOGIES, INC.**